Report No.: HK12081016-1

### **Equipment Photographs**

Model: 1568

(Internal)





Report No.: HK12081016-1

## **Equipment Photographs**

Model: 1568

(Internal)






Report No.: HK12081016-1

#### **Equipment Photographs**

Model: 1568

(Internal)



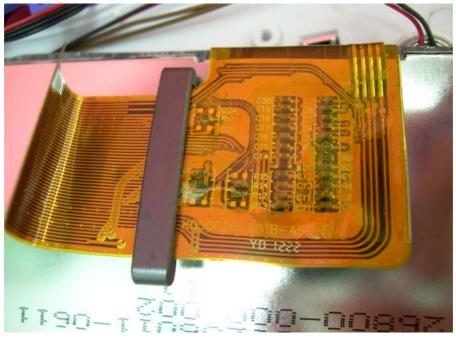



Report No.: HK12081016-1

## **Equipment Photographs**

Model: 1568

(Internal)

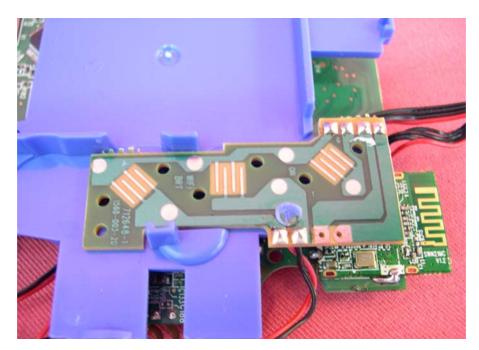

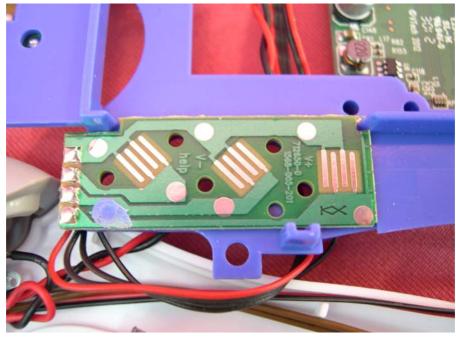


Report No.: HK12081016-1

### **Equipment Photographs**

Model: 1568

(Internal)

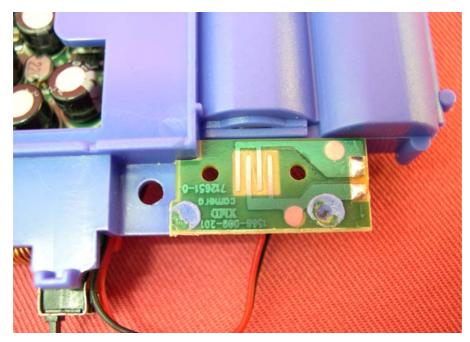




Report No.: HK12081016-1

### **Equipment Photographs**

Model: 1568

(Internal)

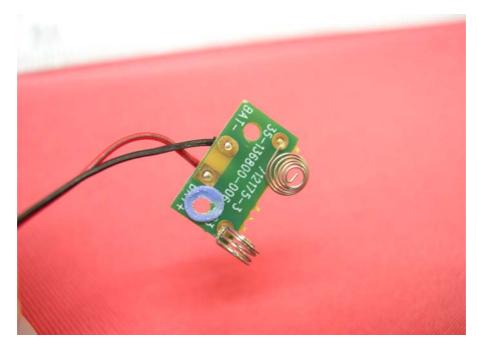



Report No.: HK12081016-1

## **Equipment Photographs**

Model: 1568

(Internal)






Report No.: HK12081016-1

## **Equipment Photographs**

Model: 1568

(Internal)



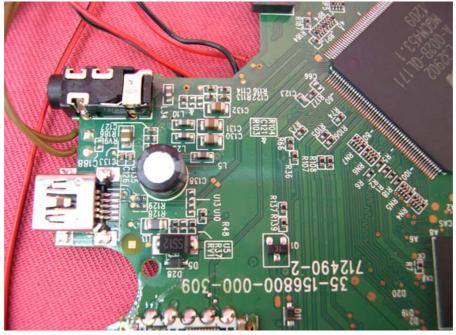



Report No.: HK12081016-1

## **Equipment Photographs**

Model: 1568

(Internal)

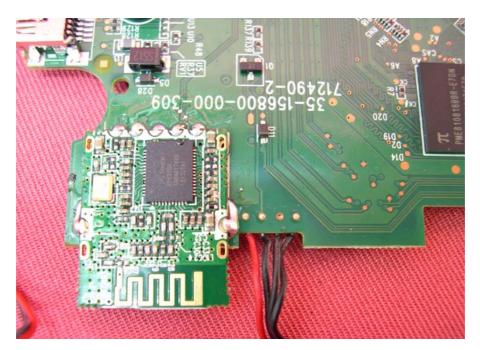

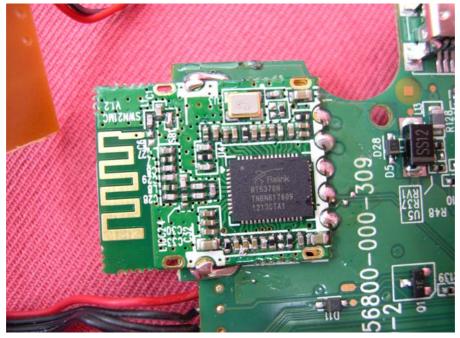


Report No.: HK12081016-1

### **Equipment Photographs**

Model: 1568

(Internal)

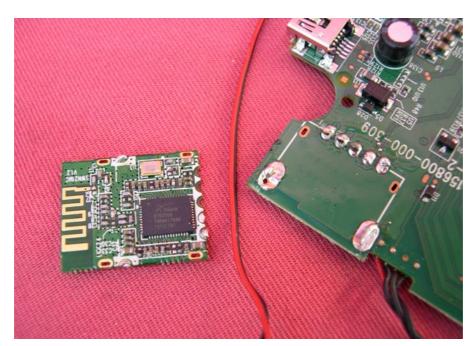




Report No.: HK12081016-1

### **Equipment Photographs**

Model: 1568

(Internal)



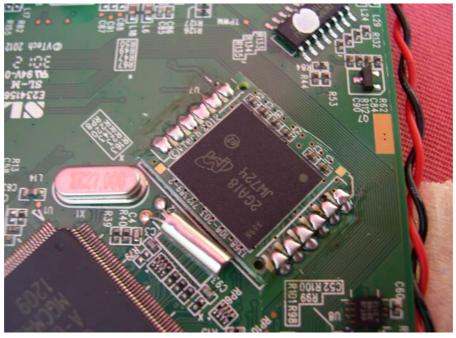



Report No.: HK12081016-1

### **Equipment Photographs**

Model: 1568

(Internal)

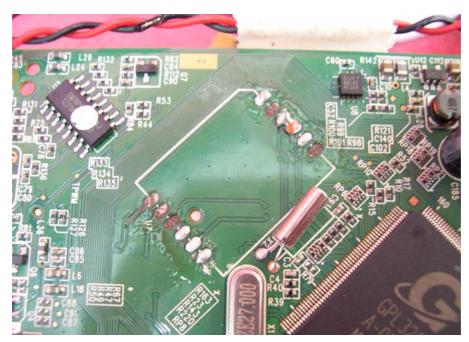

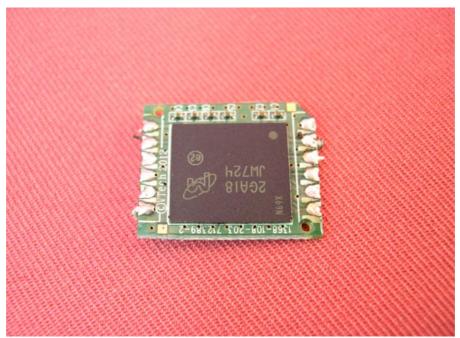

Report No.: HK12081016-1

### **Equipment Photographs**

Model: 1568

(Internal)

