
Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)



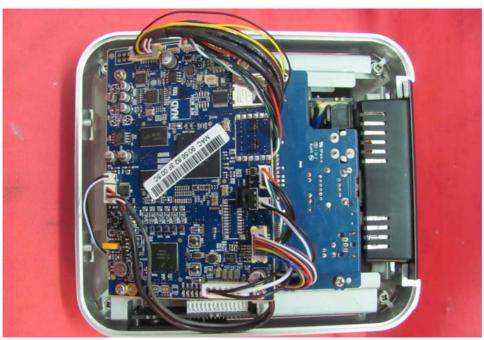

Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)





Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)






Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)



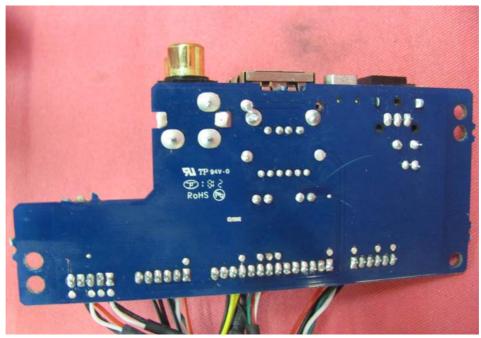

Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)






Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)



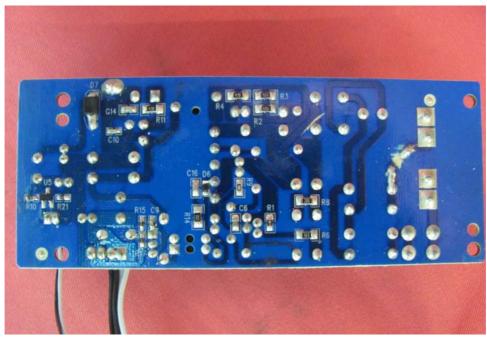

Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)







Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)

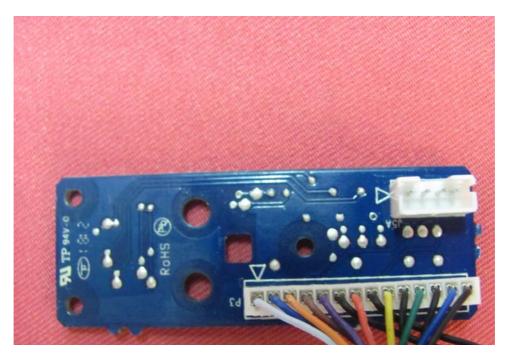

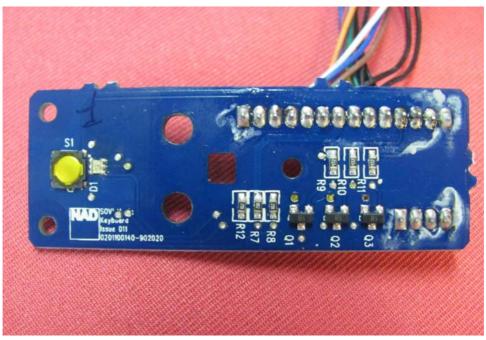


Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)



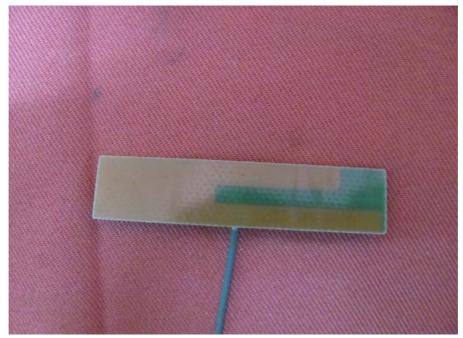


Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)



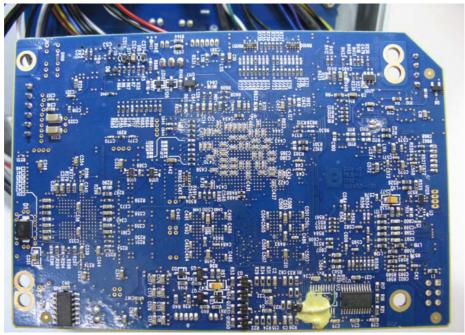



Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)

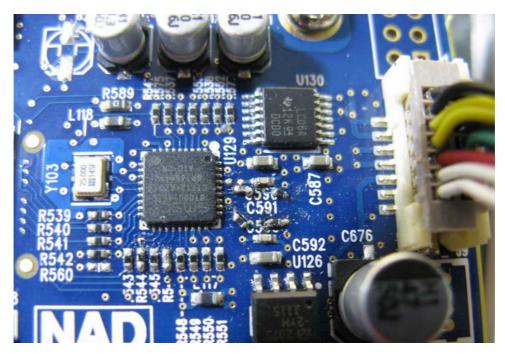

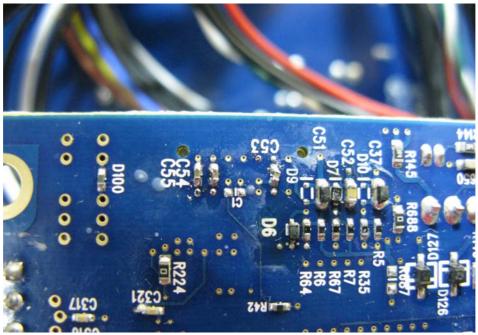

Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)







Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)

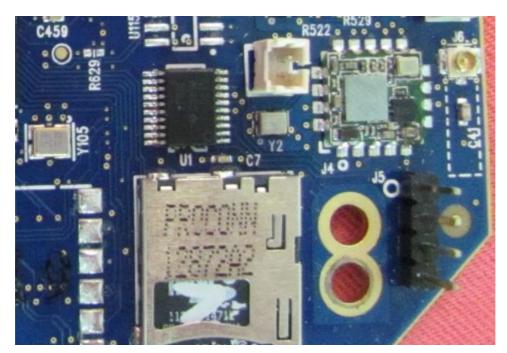

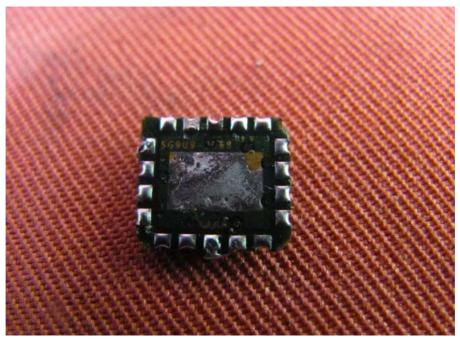



Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)

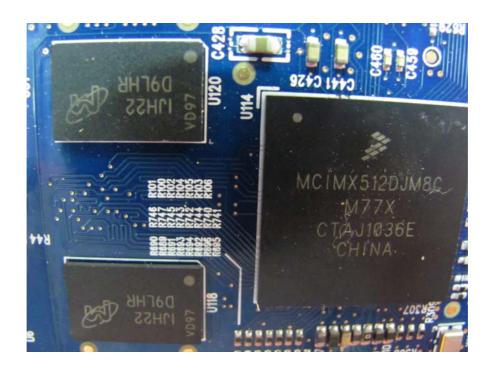

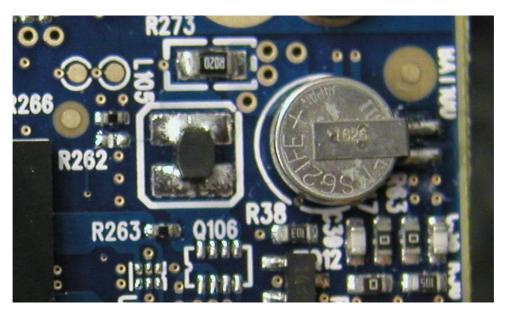


Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)



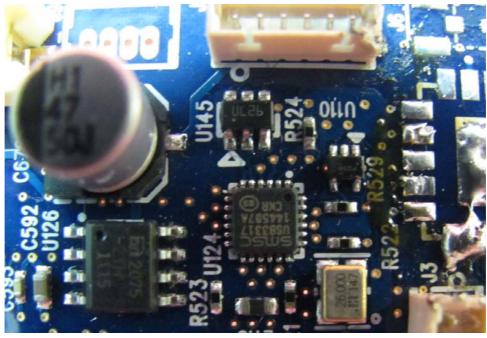

Report No.: HK12061673-1

Equipment Photographs

Model: NODE N100

(Internal)



