
Report No.: HK18081638


Equipment Photographs



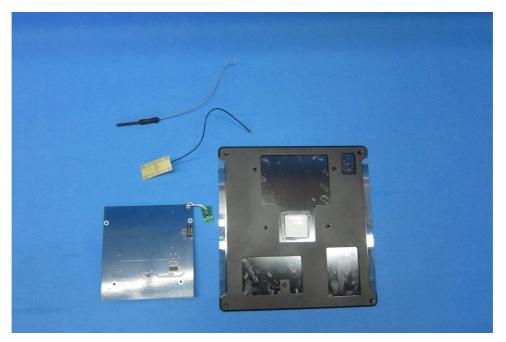

Report No.: HK18081638


Equipment Photographs

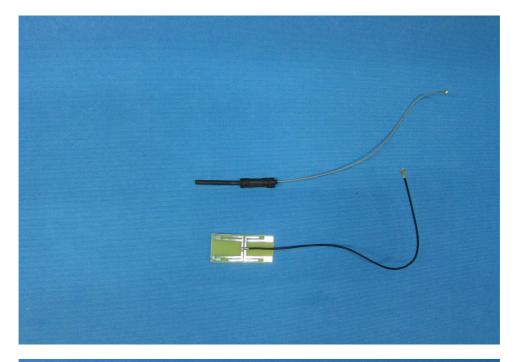




Report No.: HK18081638


Equipment Photographs

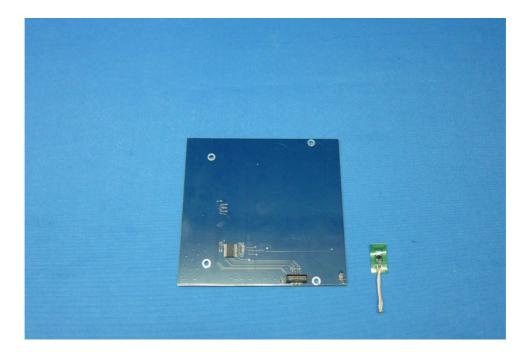

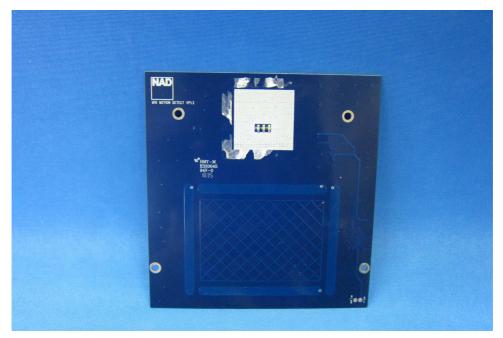

Report No.: HK18081638

Equipment Photographs

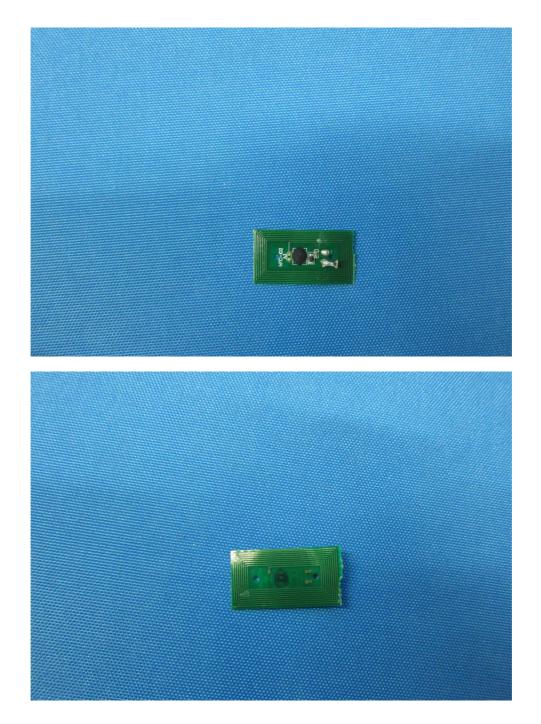

Report No.: HK18081638

Equipment Photographs



Report No.: HK18081638


Equipment Photographs





Report No.: HK18081638


Equipment Photographs

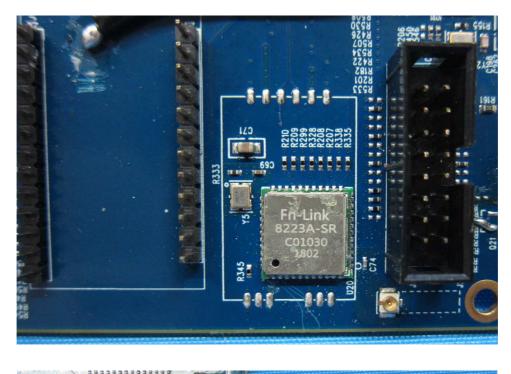




Report No.: HK18081638

Equipment Photographs

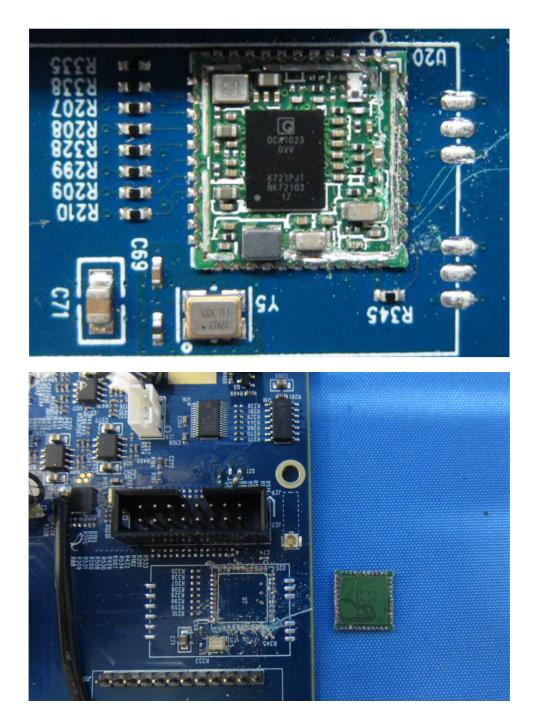


Report No.: HK18081638


Equipment Photographs

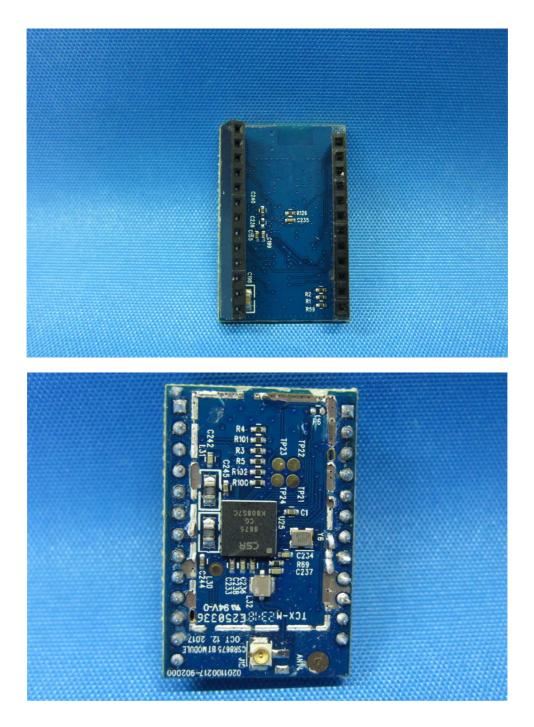

Report No.: HK18081638


Equipment Photographs

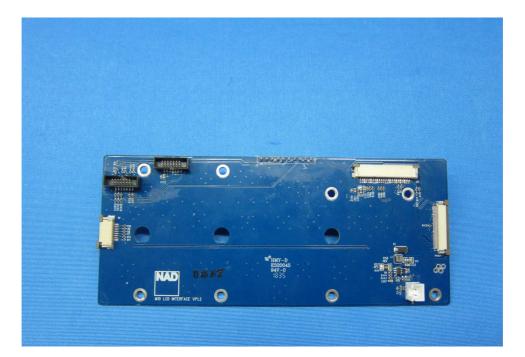

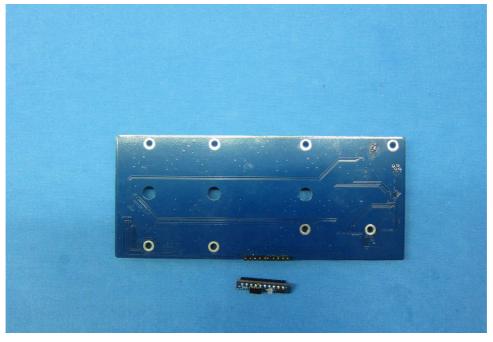

Report No.: HK18081638

Equipment Photographs

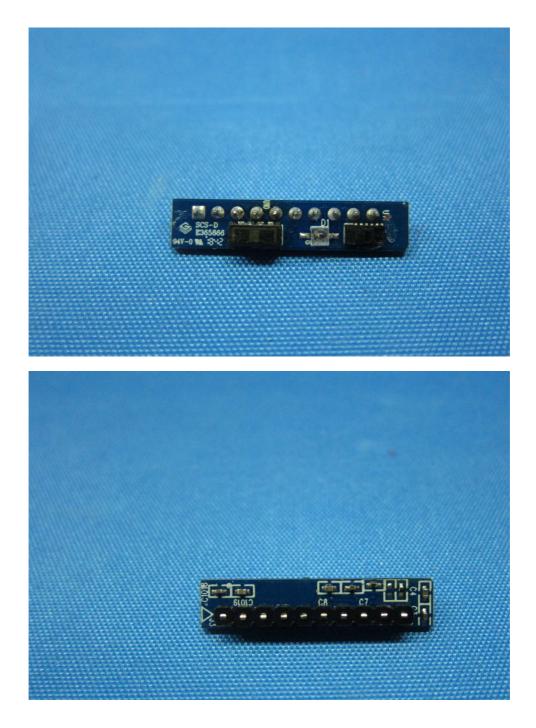

Report No.: HK18081638

Equipment Photographs



Report No.: HK18081638

Equipment Photographs





Report No.: HK18081638

Equipment Photographs



