

Date: Jun. 16, 17

To: Federal Communications Commission
Authorization and Evaluation Division
7435 Oakland Mills Road
Columbia, MD 21046

Attn: OET Dept.

Ref: FCC Class II Permissive change for FCC ID: 2AJOTTA-1025
Original Grant Date: May., 2nd, 17
Applicant: HMD Global Oy

Dear Examiner,

This is to request a Class II permissive change for FCC ID: 2AJOTTA-1025
, originally granted on May., 2nd, 17

The major change filed under this application is:

Software part:


1. Fix RF Card configuration error
 2. Not load FP driver when the device enter power off charging
- No impact to other performance.

Hardware part:

- Add 2nd source battery, HE335
- Add 4G RAM / 64G ROM
- Change L6219 & R6210 to NC to improve WiFi mask performance
- Change L6220 to NC
- Change R711, R707, R2207 to Murata Bead board to optimize camera de-sense
- change FPM to low voltage, add one diode + Low voltage FW to reduce FPM noise
- Speaker Box SUS material change from 304 to 430 to resolve static magnetic issue.
Change coil material from FH5 to FH7 to improve coil heat resistant.

- Mechanical:
 - a. Rear cover, Increase the thickness of Rib to improve the Main Cam deviation
 - b. Rear cover, Increase the chamfer to fit the change of battery tape
 - c. Rear cover, Decrease the thickness to increase the gap between Battery and Rear Cover
 - d. Camera Ring, modify the Rib of Camera Ring to avoid the interference
 - e. A Cover, increase the mark of PLE
 - f. Change front camera sponge to conductive sponge, to resolve defense issue
 - g. Power Key: modify the key dimension to improve key feeling
 - h. Rear cover, increase thickness of NFC pad
 - i. Rear cover, increase thickness to resolve the front cam deviation issue
 - j. Rear cover, modify the gap between rear cover & A cover to resolve assembly interference issue

Sincerely yours,

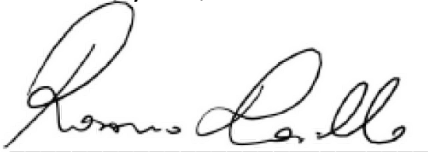

Name: Rosario Casillo
Job Title: Director Technology and Compliance
Email: Rosario.Casillo@hmdglobal.com