


## Frequency Adjustment

---

The transmitter frequency should be checked at lease once every 5 years. If the frequency offset is greater than +/- 1.5kHz, adjustments can be made by tuning C52; see diagram for location.

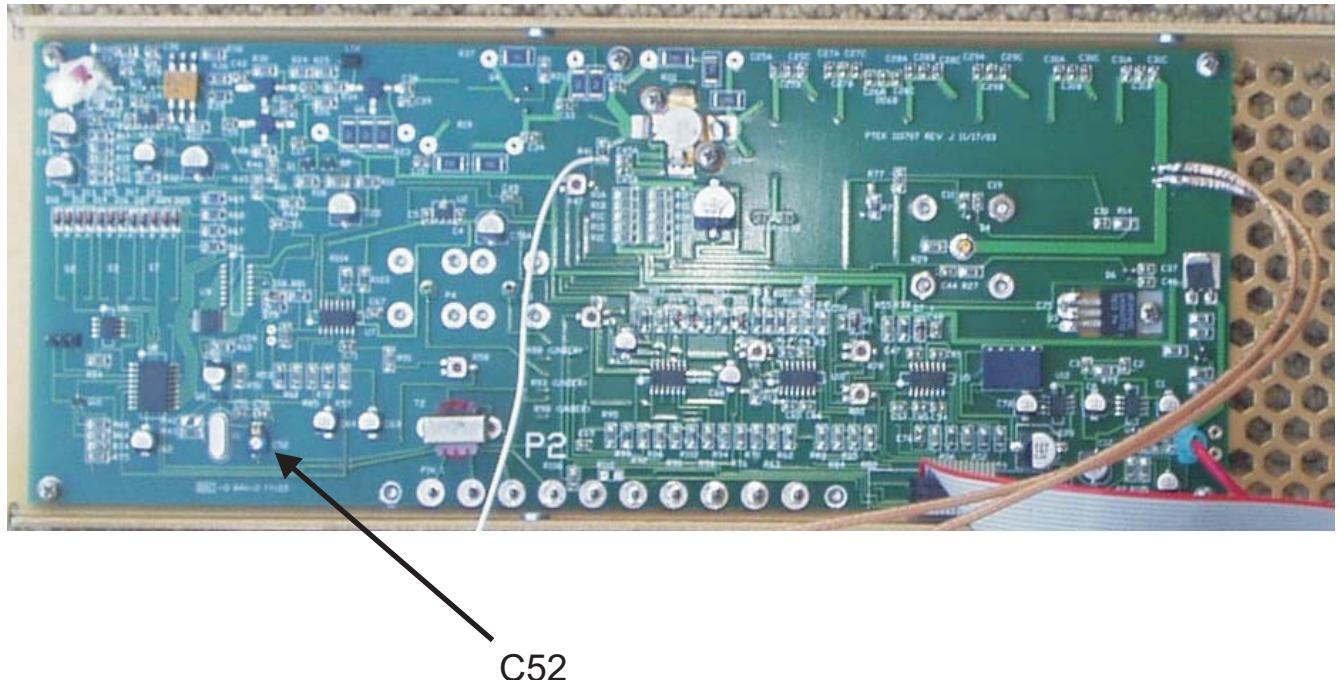

A qualified service technician should make adjustments. Alternatively the unit can be returned to the factory for service.