| | Ant4 | 7085 | -3.67 | -1.67 | ≤5.00 | PASS |
|---|---|---|---|---|---|---|
| | Ant9 | 7085 | -2.49 | -0.49 | ≤5.00 | PASS |
| | Ant10 | 7085 | -2.71 | -0.71 | ≤5.00 | PASS |
| | total | 7085 | 2.87 | 4.87 | ≤5.00 | PASS |
| | Ant3 | 6145 | -3.74 | -1.74 | ≤5.00 | PASS |
| | Ant4 | 6145 | -3.52 | -1.52 | ≤5.00 | PASS |
| | Ant9 | 6145 | -2.83 | -0.83 | ≤5.00 | PASS |
| | Ant10 | 6145 | -3.32 | -1.32 | ≤5.00 | PASS |
| | total | 6145 | 2.68 | 4.68 | ≤5.00 | PASS |
| | Ant3 | 6225 | -4.11 | -2.11 | ≤5.00 | PASS |
| | Ant4 | 6225 | -3.6 | -1.6 | ≤5.00 | PASS |
| | Ant9 | 6225 | -2.42 | -0.42 | ≤5.00 | PASS |
| | Ant10 | 6225 | -2.99 | -0.99 | ≤5.00 | PASS |
| | total | 6225 | 2.79 | 4.79 | ≤5.00 | PASS |
| | Ant3 | 6385 | -3.96 | -1.96 | ≤5.00 | PASS |
| | Ant4 | 6385 | -3.7 | -1.7 | ≤5.00 | PASS |
| | Ant9 | 6385 | -2.14 | -0.14 | ≤5.00 | PASS |
| | Ant10 | 6385 | -2.87 | -0.87 | ≤5.00 | PASS |
| | total | 6385 | 2.91 | 4.91 | ≤5.00 | PASS |
| | Ant3 | 6465 | -3.71 | -1.71 | ≤5.00 | PASS |
| | Ant4 | 6465 | -3.62 | -1.62 | ≤5.00 | PASS |
| | Ant9 | 6465 | -2.46 | -0.46 | ≤5.00 | PASS |
| | Ant10 | 6465 | -2.79 | -0.79 | ≤5.00 | PASS |
| | total | 6465 | 2.91 | 4.91 | ≤5.00 | PASS |
| | Ant3 | 6545 | -3.87 | -1.87 | ≤5.00 | PASS |
| | Ant4 | 6545 | -3.73 | -1.73 | ≤5.00 | PASS |
| 11BE80MIMO | Ant9 | 6545 | -2.5 | -0.5 | ≤5.00 | PASS |
| | Ant10 | 6545 | -2.79 | -0.79 | ≤5.00 | PASS |
| | total | 6545 | 2.84 | 4.84 | ≤5.00 | PASS |
| | Ant3 | 6705 | -4.01 | -2.01 | ≤5.00 | PASS |
| | Ant4 | 6705 | -3.83 | -1.83 | ≤5.00 | PASS |
| | Ant9 | 6705 | -2.85 | -0.85 | ≤5.00 | PASS |
| | Ant10 | 6705 | -2.6 | -0.6 | ≤5.00 | PASS |
| | total | 6705 | 2.74 | 4.74 | ≤5.00 | PASS |
| | Ant3 | 6865 | -3.86 | -1.86 | ≤5.00 | PASS |
| | Ant4 | 6865 | -3.73 | -1.73 | ≤5.00 | PASS |
| | Ant9 | 6865 | -2.57 | -0.57 | ≤5.00 | PASS |
| | Ant10 | 6865 | -2.62 | -0.62 | ≤5.00 | PASS |
| | total | 6865 | 2.87 | 4.87 | ≤5.00 | PASS |
| | Ant3 | 6945 | -4.45 | -2.45 | ≤5.00 | PASS |
| | Ant4 | 6945 | -4.37 | -2.37 | ≤5.00 | PASS |
| | Ant9 | 6945 | -2.7 | -0.7 | ≤5.00 | PASS |
| | Ant10 | 6945 | -3.35 | -1.35 | ≤5.00 | PASS |
| | total | 6945 | 2.37 | 4.37 | ≤5.00 | PASS |
| | Ant3 | 7025 | -3.76 | -1.76 | ≤5.00 | PASS |
| | Ant4 | 7025 | -3.79 | -1.79 | ≤5.00 | PASS |
| | Ant9 | 7025 | -2.65 | -0.65 | ≤5.00 | PASS |
| | Ant10 | 7025 | -3.02 | -1.02 | ≤5.00 | PASS |
| | total | 7025 | 2.74 | 4.74 | ≤5.00 | PASS |
| | Ant3 | 6185 | -3.75 | -1.75 | ≤5.00 | PASS |
| | Ant4 | 6185 | -3.96 | -1.96 | ≤5.00 | PASS |
| | Ant9 | 6185 | -3.39 | -1.39 | ≤5.00 | PASS |
| | Ant10 | 6185 | -3.72 | -1.72 | ≤5.00 | PASS |
| | total | 6185 | 2.32 | 4.32 | ≤5.00 | PASS |
| 11BE160MIMO | Ant3 | 6345 | -4.25 | -2.25 | ≤5.00 | PASS |
| | Ant4 | 6345 | -3.62 | -1.62 | ≤5.00 | PASS |
| | Ant9 | 6345 | -2.58 | -0.58 | ≤5.00 | PASS |
| | Ant10 | 6345 | -3.05 | -1.05 | ≤5.00 | PASS |
| | total | 6345 | 2.69 | 4.69 | ≤5.00 | PASS |
| | Ant3 | 6505 | -4.29 | -2.29 | ≤5.00 | PASS |
| | Ant4 | 6505 | -3.91 | -1.91 | ≤5.00 | PASS |

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

| | | | | | | |
|---|---|---|---|---|---|---|
| | Ant9 | 6505 | -3.46 | -1.46 | ≤5.00 | PASS |
| | Ant10 | 6505 | -3.35 | -1.35 | ≤5.00 | PASS |
| | total | 6505 | 2.28 | 4.28 | ≤5.00 | PASS |
| | Ant3 | 6665 | -4.07 | -2.07 | ≤5.00 | PASS |
| | Ant4 | 6665 | -4.04 | -2.04 | ≤5.00 | PASS |
| | Ant9 | 6665 | -2.22 | -0.22 | ≤5.00 | PASS |
| | Ant10 | 6665 | -2.79 | -0.79 | ≤5.00 | PASS |
| | total | 6665 | 2.81 | 4.81 | ≤5.00 | PASS |
| | Ant3 | 6825 | -3.52 | -1.52 | ≤5.00 | PASS |
| | Ant4 | 6825 | -3.79 | -1.79 | ≤5.00 | PASS |
| | Ant9 | 6825 | -2.93 | -0.93 | ≤5.00 | PASS |
| | Ant10 | 6825 | -3.71 | -1.71 | ≤5.00 | PASS |
| | total | 6825 | 2.55 | 4.55 | ≤5.00 | PASS |
| | Ant3 | 6985 | -2.88 | -0.88 | ≤5.00 | PASS |
| | Ant4 | 6985 | -3.8 | -1.8 | ≤5.00 | PASS |
| | Ant9 | 6985 | -3.22 | -1.22 | ≤5.00 | PASS |
| | Ant10 | 6985 | -3.93 | -1.93 | ≤5.00 | PASS |
| | total | 6985 | 2.58 | 4.58 | ≤5.00 | PASS |
| 11BE320MIMO | Ant3 | 6265 | -4.24 | -2.24 | ≤5.00 | PASS |
| | Ant4 | 6265 | -3.84 | -1.84 | ≤5.00 | PASS |
| | Ant9 | 6265 | -2.45 | -0.45 | ≤5.00 | PASS |
| | Ant10 | 6265 | -3.13 | -1.13 | ≤5.00 | PASS |
| | total | 6265 | 2.66 | 4.66 | ≤5.00 | PASS |
| | Ant3 | 6425 | -3.88 | -1.88 | ≤5.00 | PASS |
| | Ant4 | 6425 | -4 | -2 | ≤5.00 | PASS |
| | Ant9 | 6425 | -2.63 | -0.63 | ≤5.00 | PASS |
| | Ant10 | 6425 | -2.9 | -0.9 | ≤5.00 | PASS |
| | total | 6425 | 2.71 | 4.71 | ≤5.00 | PASS |
| | Ant3 | 6585 | -3.7 | -1.7 | ≤5.00 | PASS |
| | Ant4 | 6585 | -4.52 | -2.52 | ≤5.00 | PASS |
| | Ant9 | 6585 | -3.11 | -1.11 | ≤5.00 | PASS |
| | Ant10 | 6585 | -3.25 | -1.25 | ≤5.00 | PASS |
| | total | 6585 | 2.41 | 4.41 | ≤5.00 | PASS |
| | Ant3 | 6745 | -3.8 | -1.8 | ≤5.00 | PASS |
| | Ant4 | 6745 | -4.21 | -2.21 | ≤5.00 | PASS |
| | Ant9 | 6745 | -2.76 | -0.76 | ≤5.00 | PASS |
| | Ant10 | 6745 | -2.96 | -0.96 | ≤5.00 | PASS |
| | total | 6745 | 2.63 | 4.63 | ≤5.00 | PASS |
| | Ant3 | 6905 | -3.64 | -1.64 | ≤5.00 | PASS |
| | Ant4 | 6905 | -3.73 | -1.73 | ≤5.00 | PASS |
| | Ant9 | 6905 | -2.73 | -0.73 | ≤5.00 | PASS |
| | Ant10 | 6905 | -2.82 | -0.82 | ≤5.00 | PASS |
| | total | 6905 | 2.81 | 4.81 | ≤5.00 | PASS |

Note：1.The Duty Cycle Factor and RBW Factor is compensated in the graph.

## 11.4.2. Test Graphs NSS=4



11BE20MIMO_Ant3_6115



11BE20MIMO_Ant4_6115



11BE20MIMO_Ant9_6115

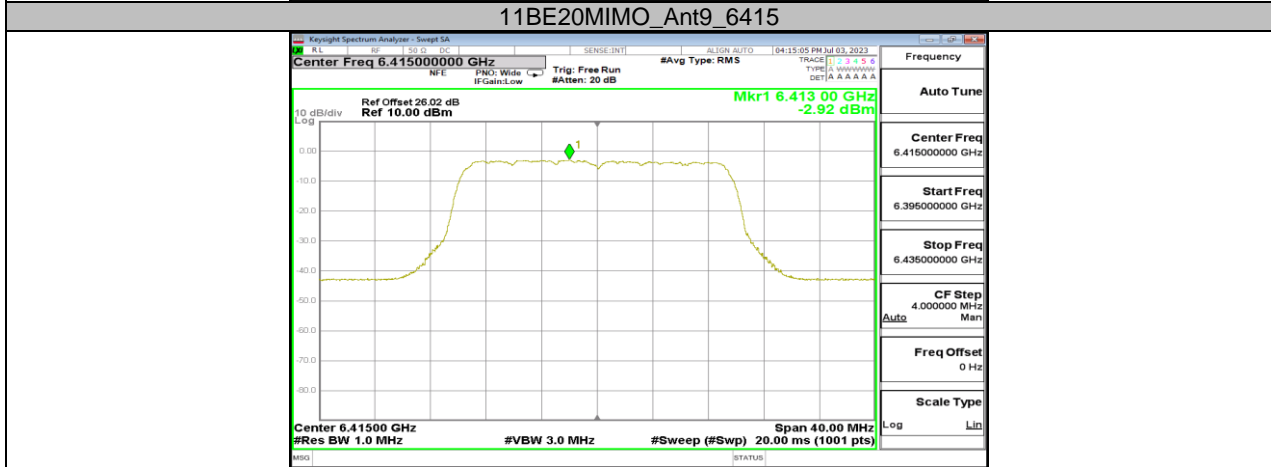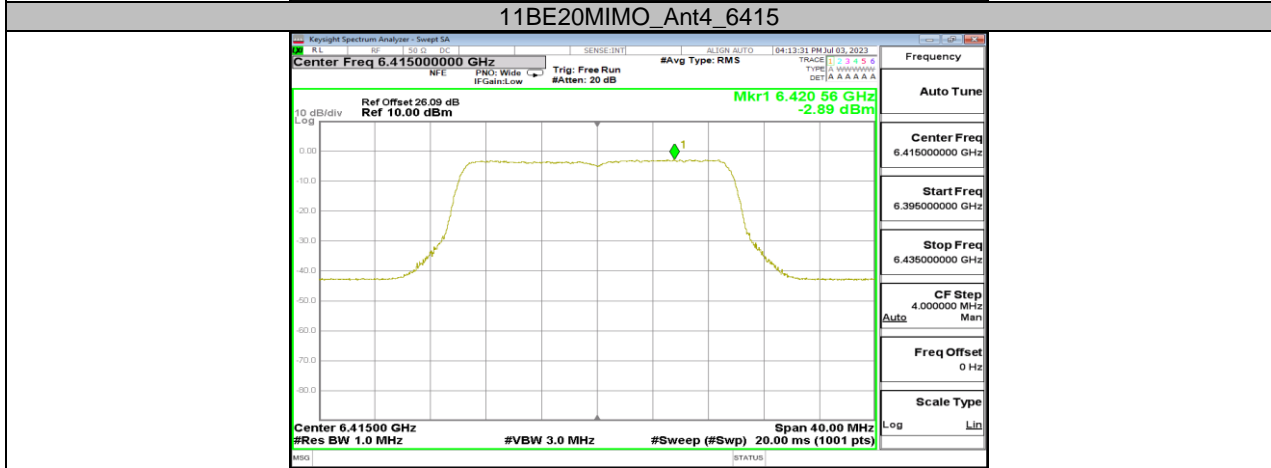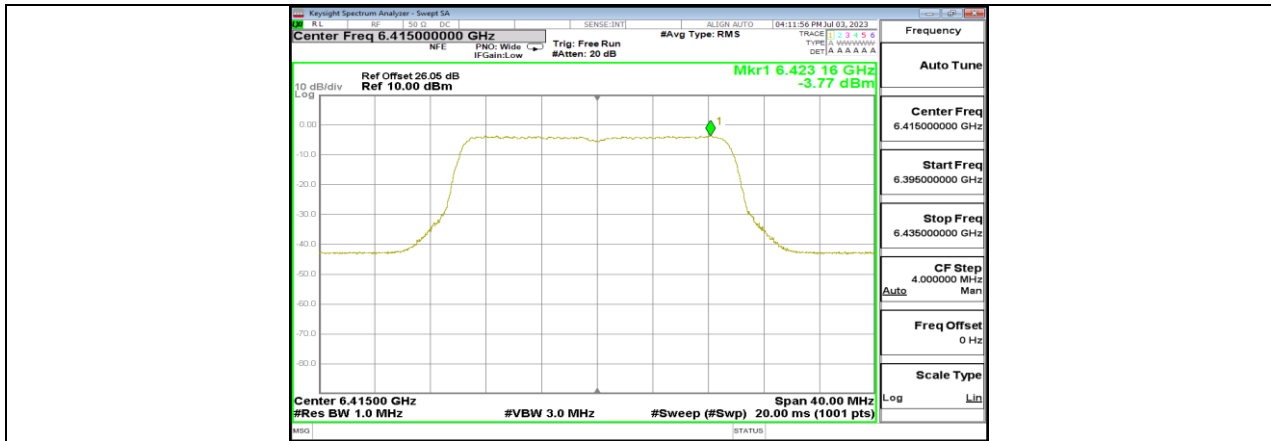11BE20MIMO_Ant10_6115



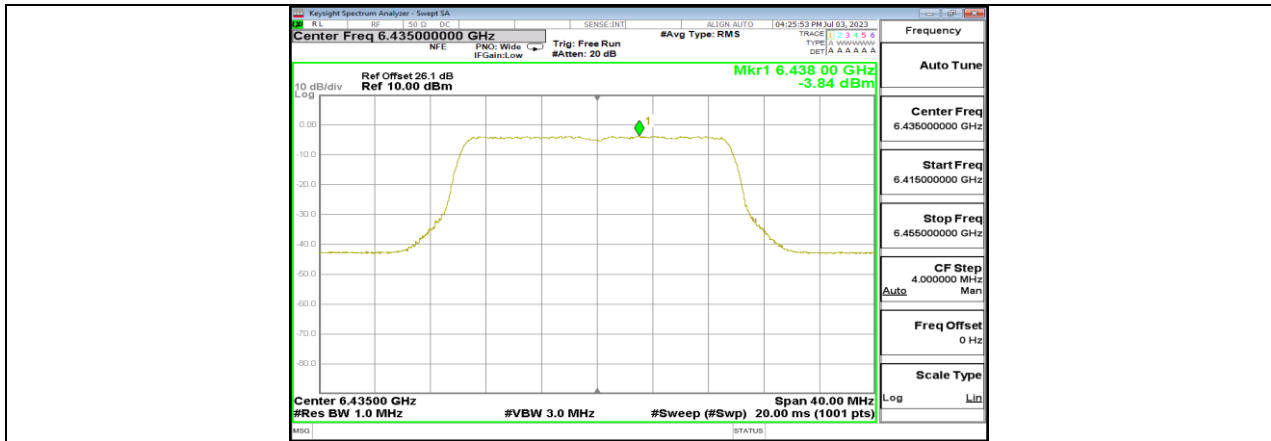11BE20MIMO_Ant3_6275
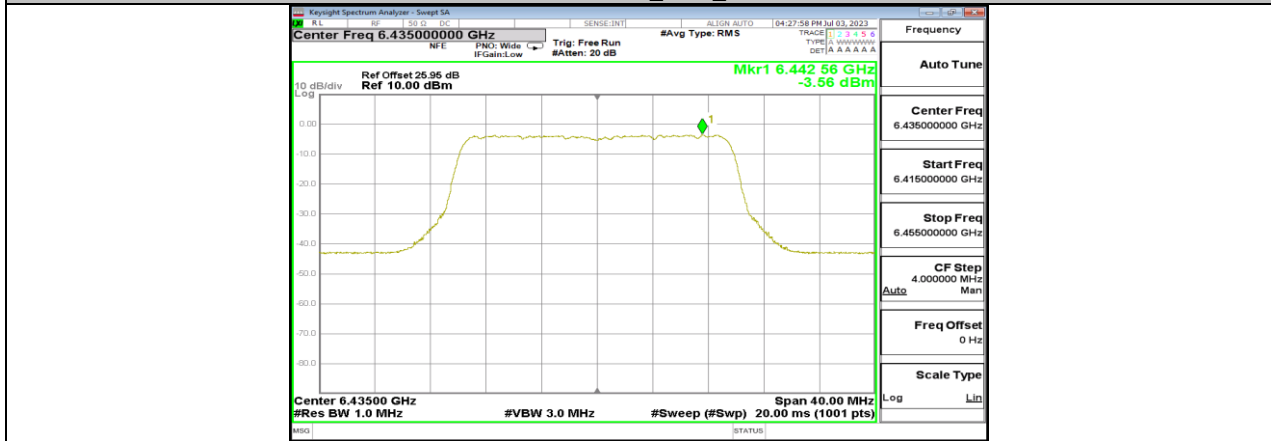


11BE20MIMO_Ant4_6275
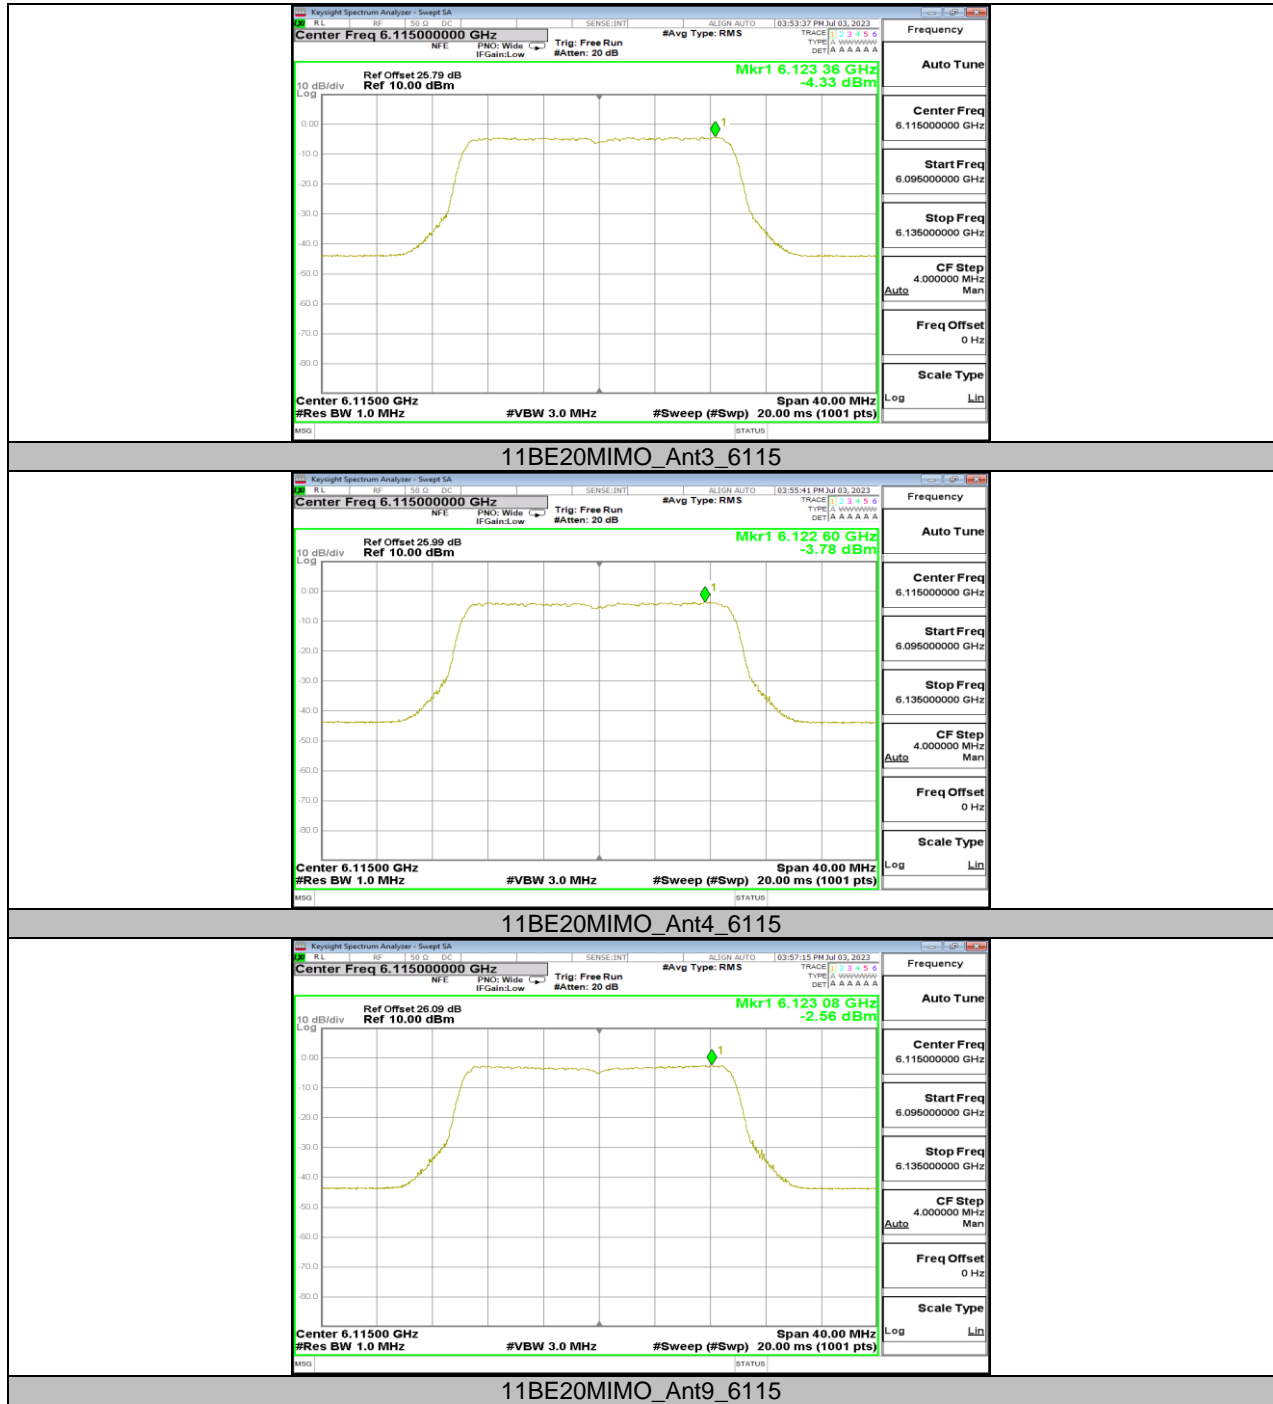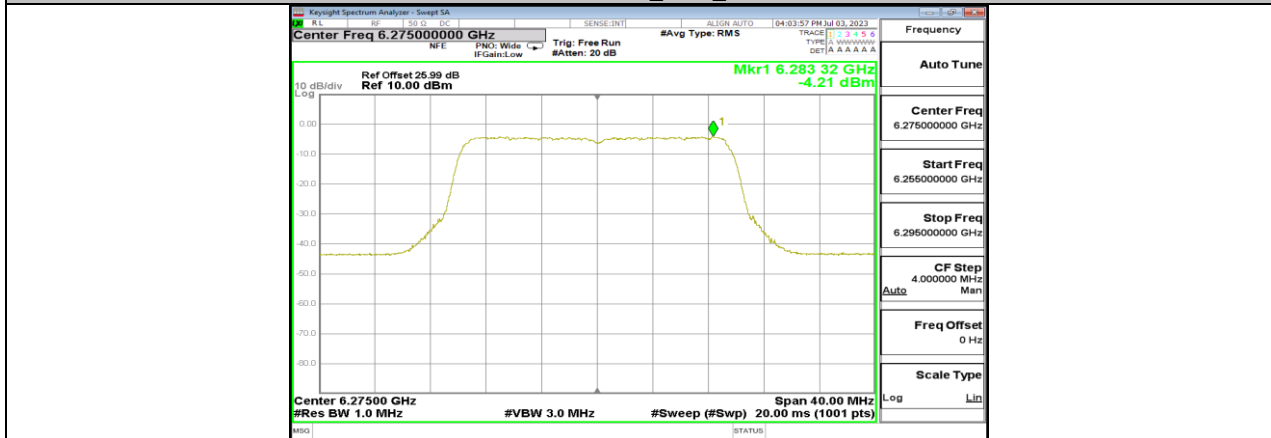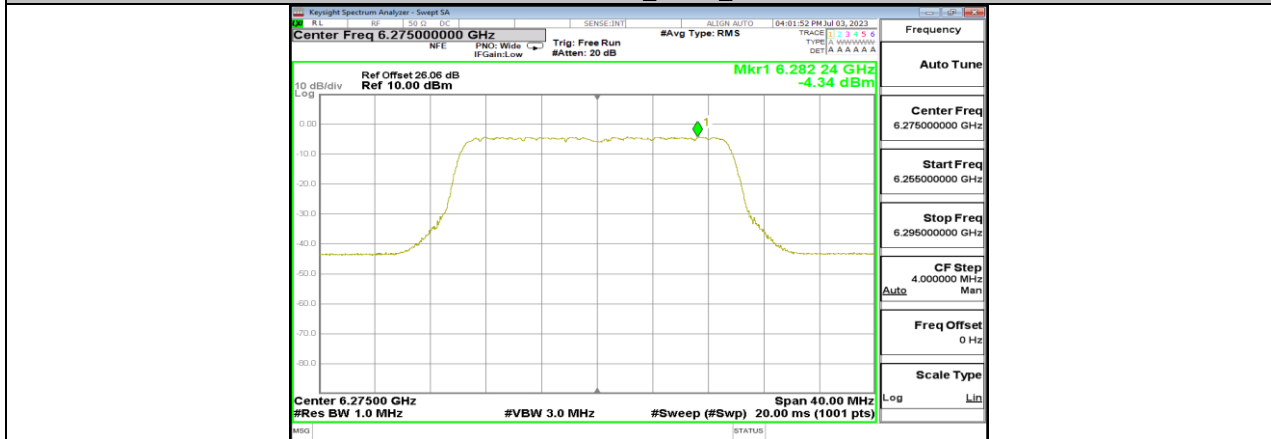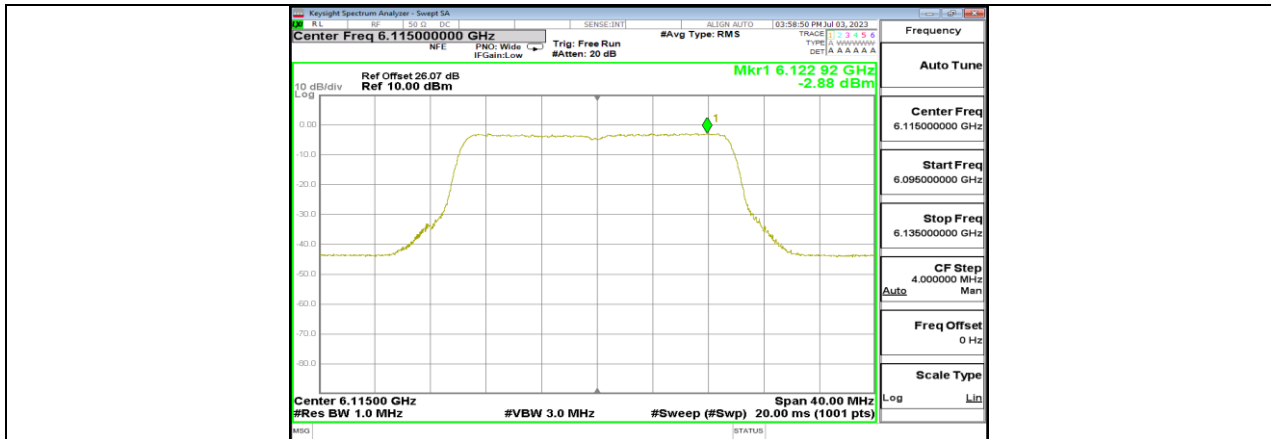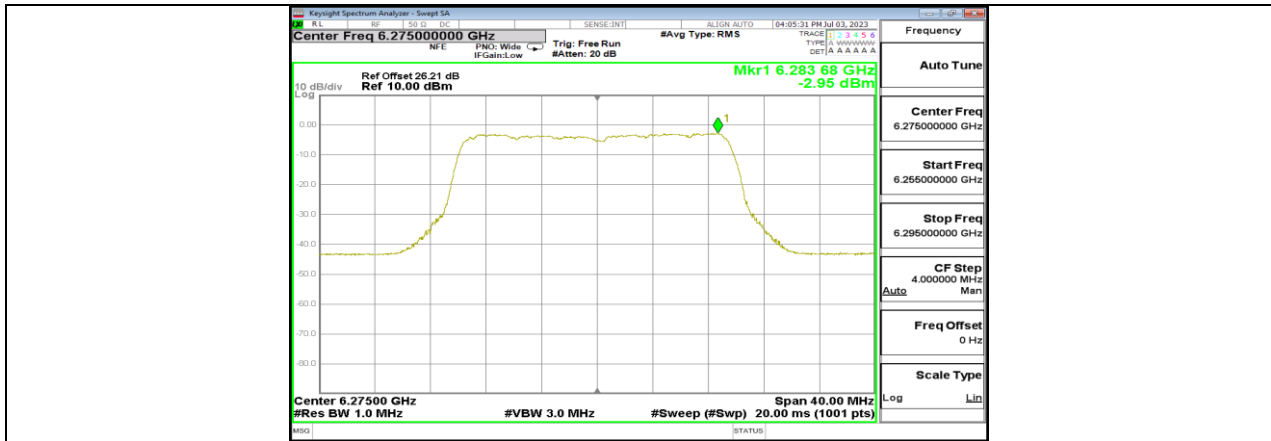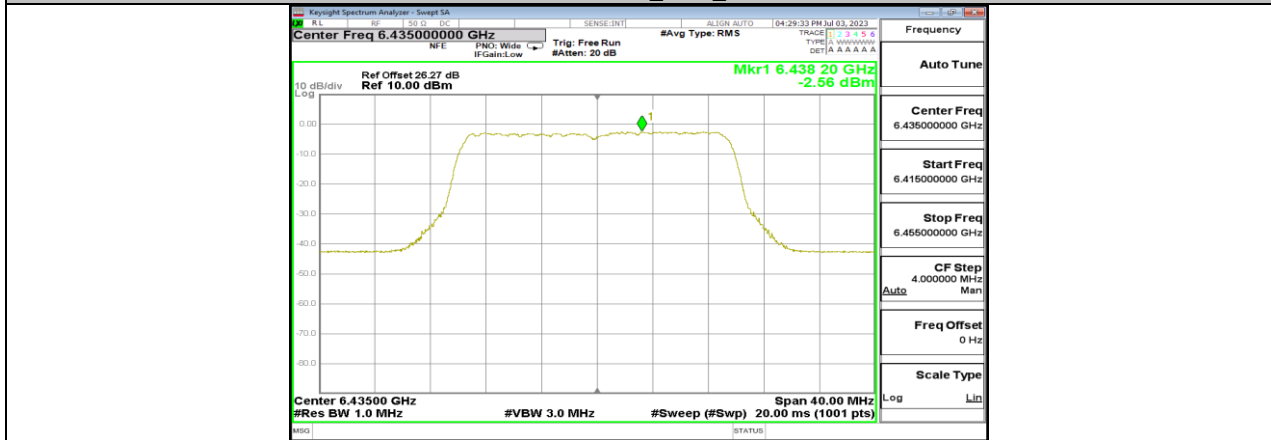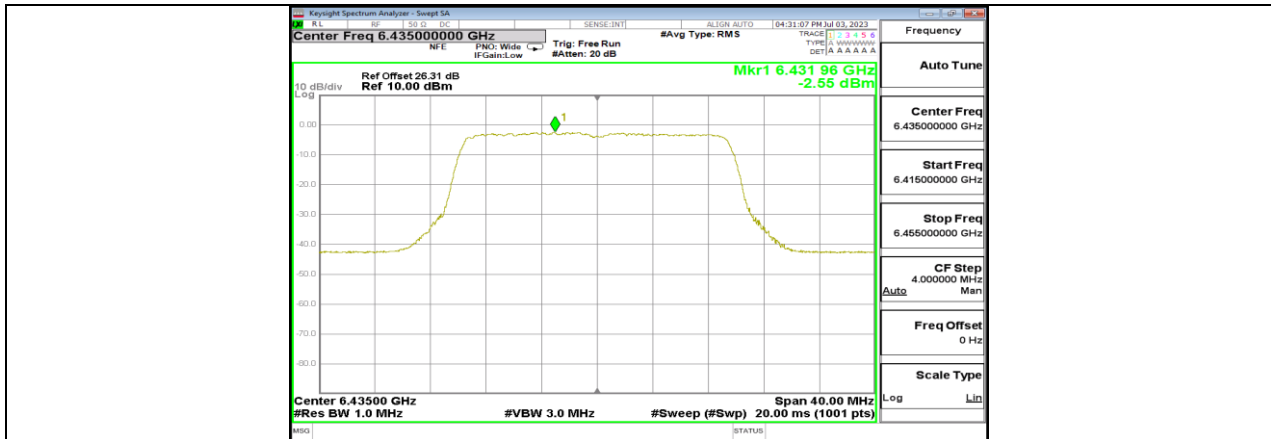
11BE20MIMO_Ant9_6275
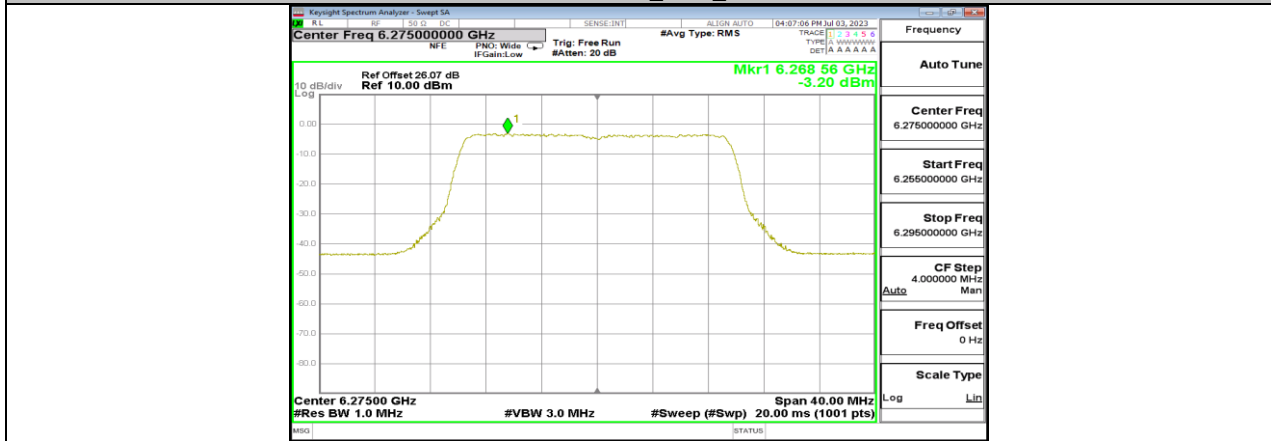
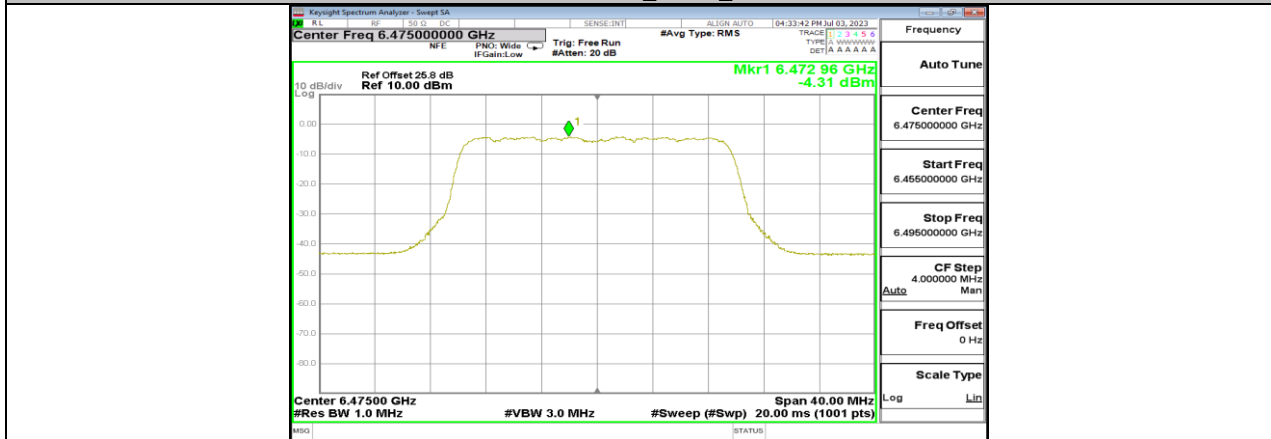

11BE20MIMO_Ant10_6275
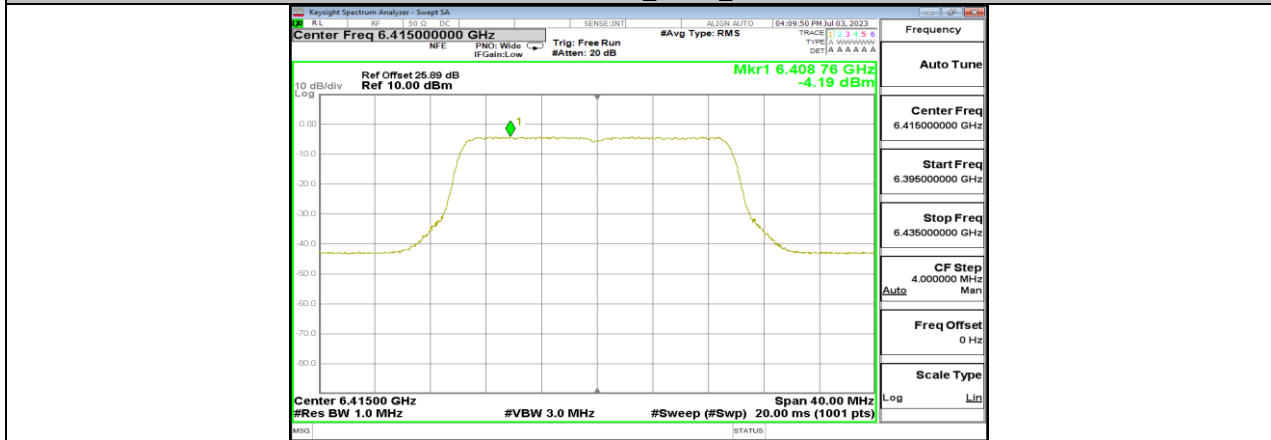


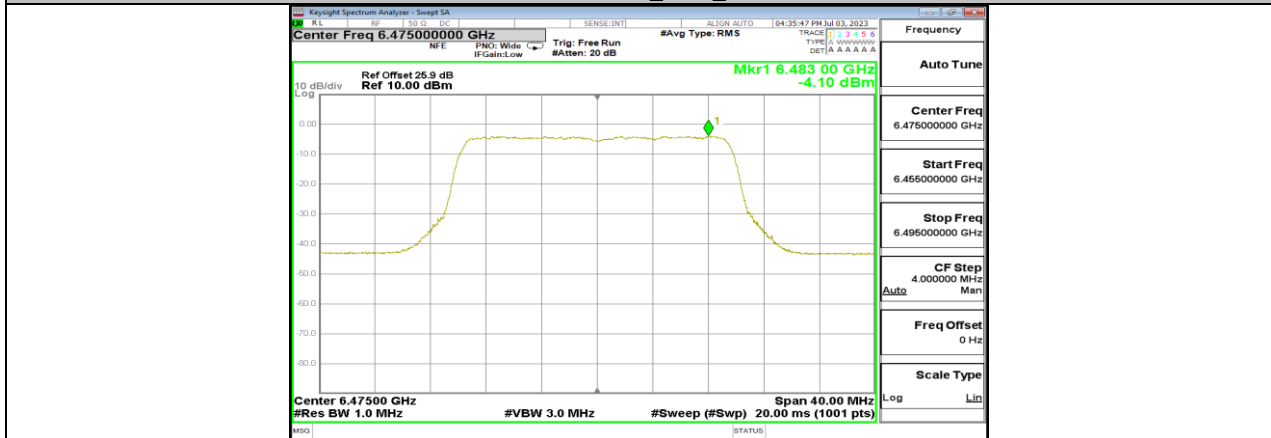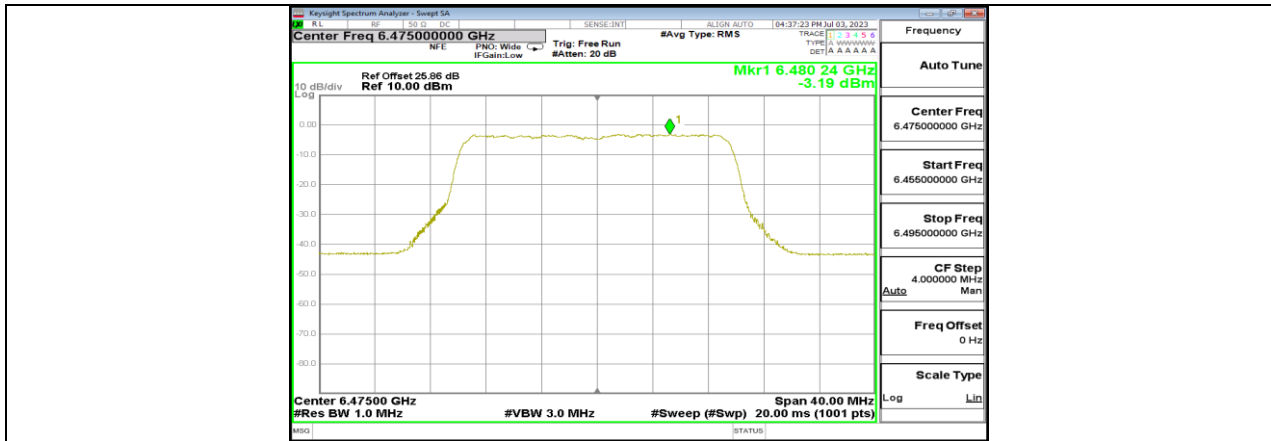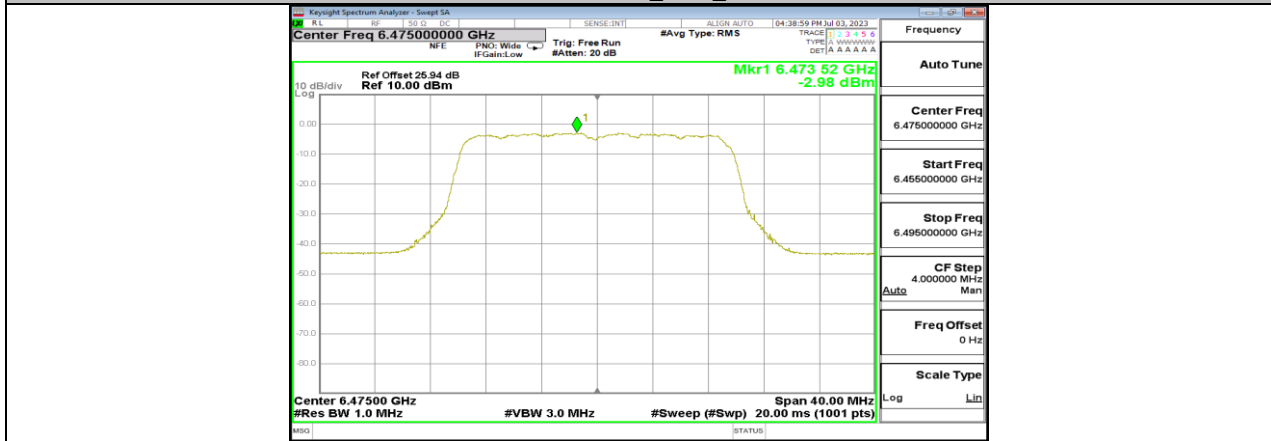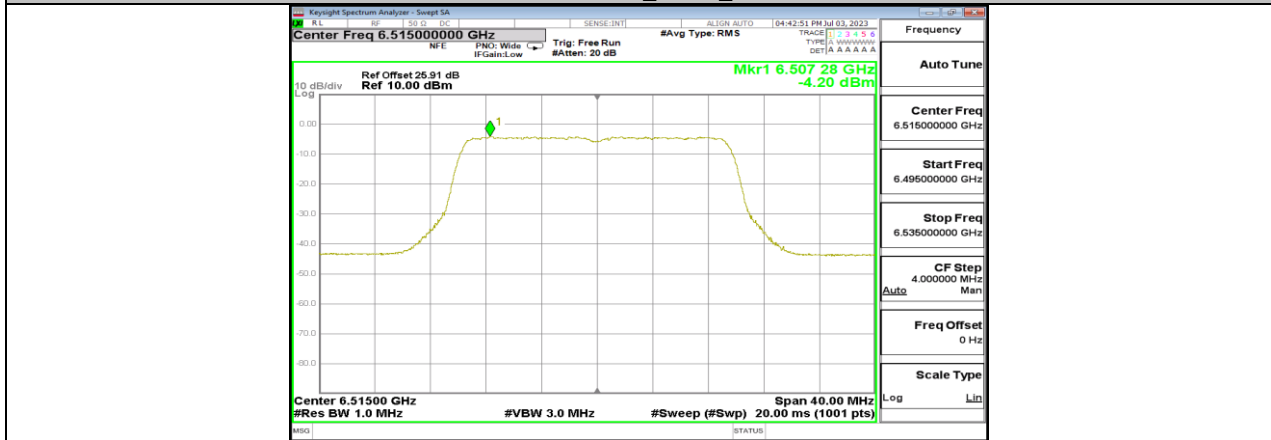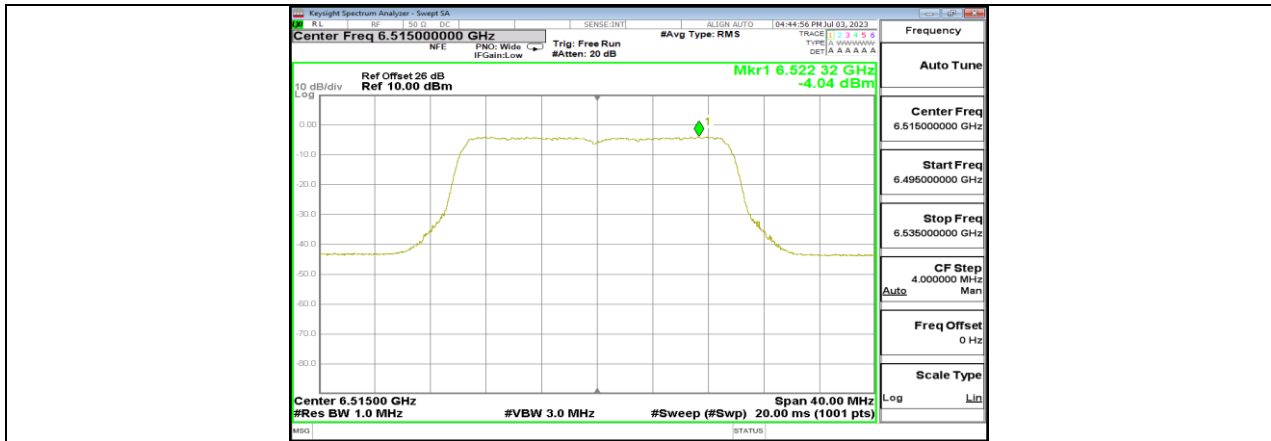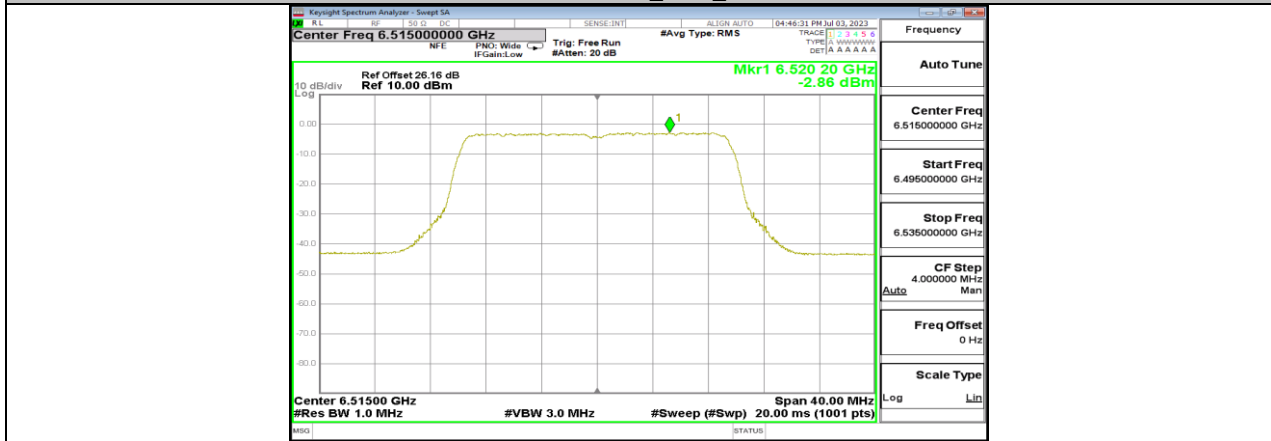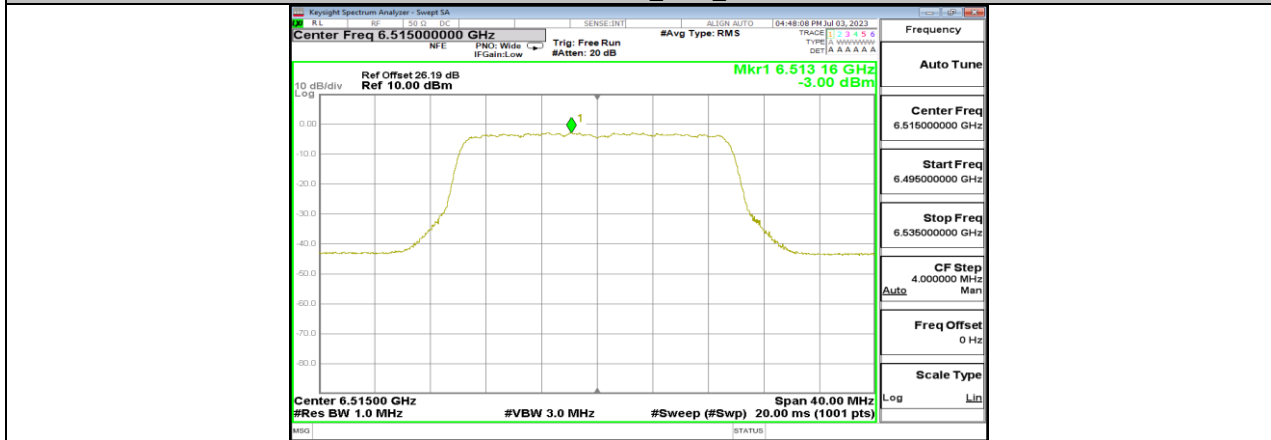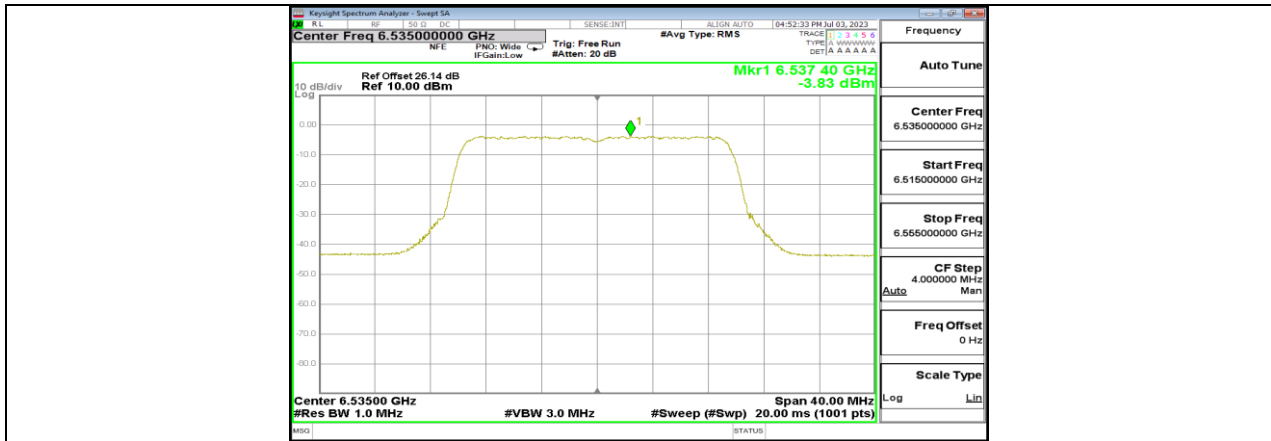11BE20MIMO_Ant3_6415

11BE20MIMO_Ant4_6415



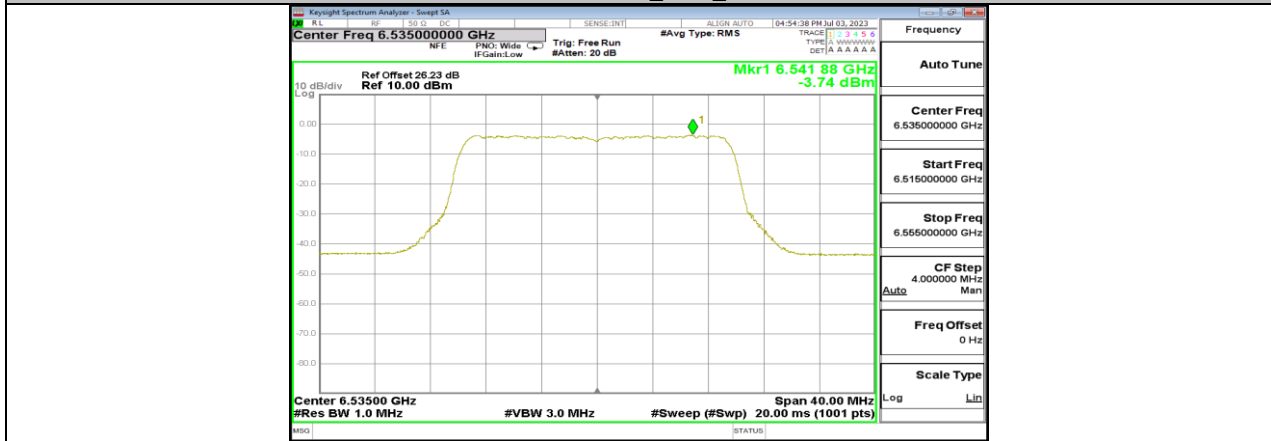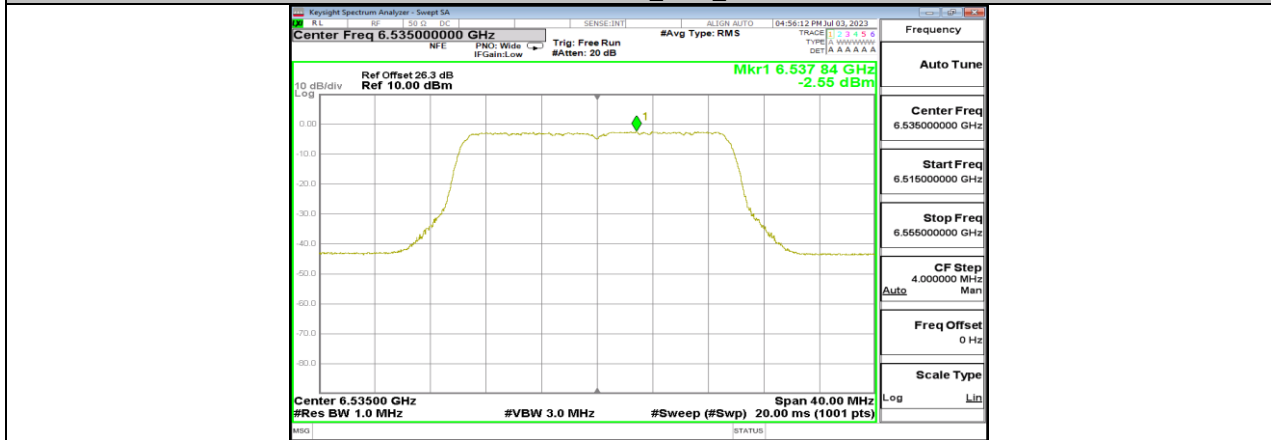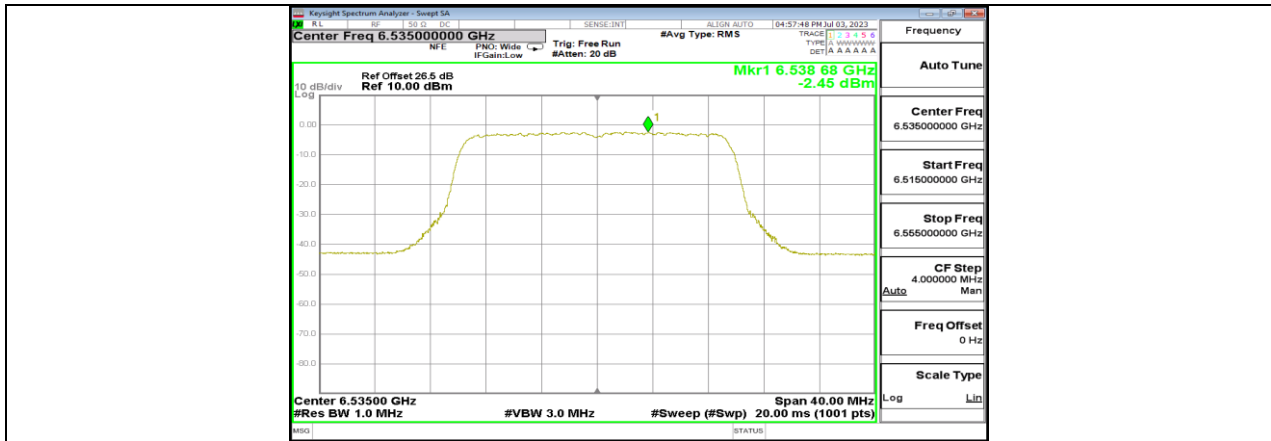11BE20MIMO_Ant9_6415



11BE20MIMO_Ant10_6415

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

11BE20MIMO_Ant3_6435


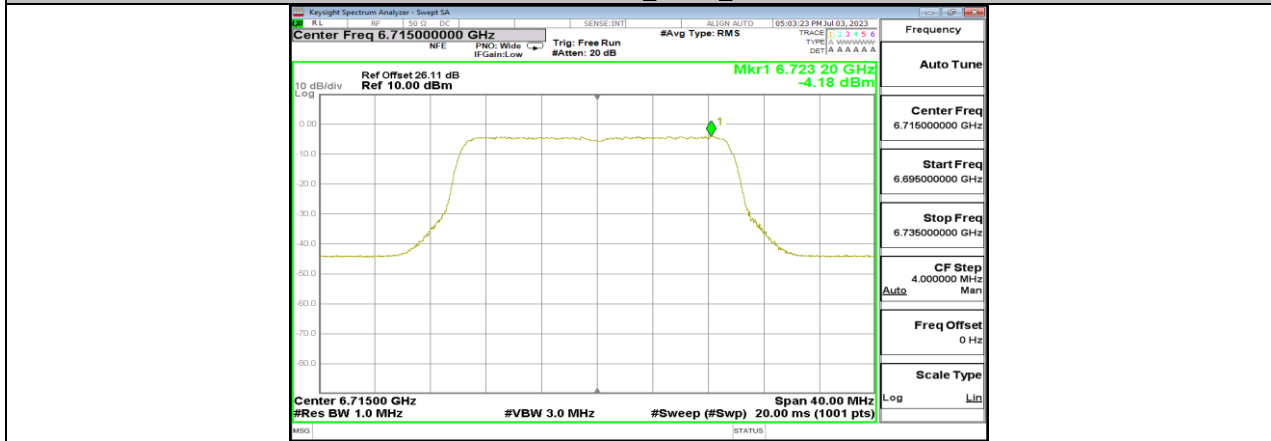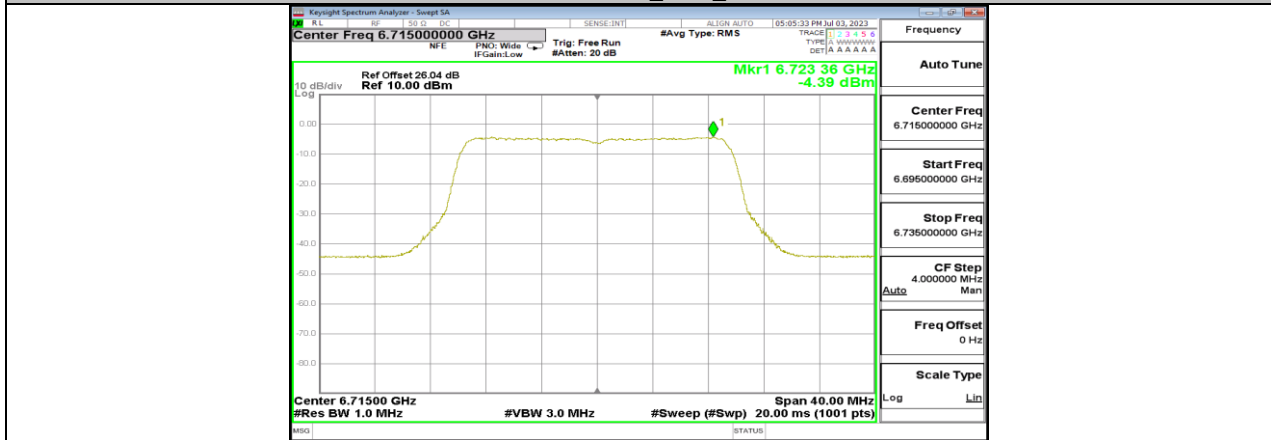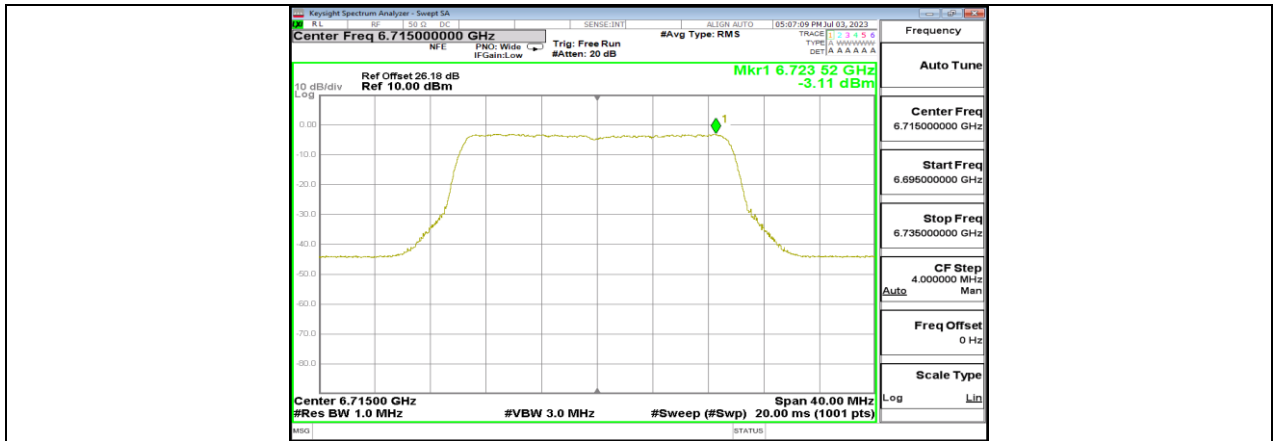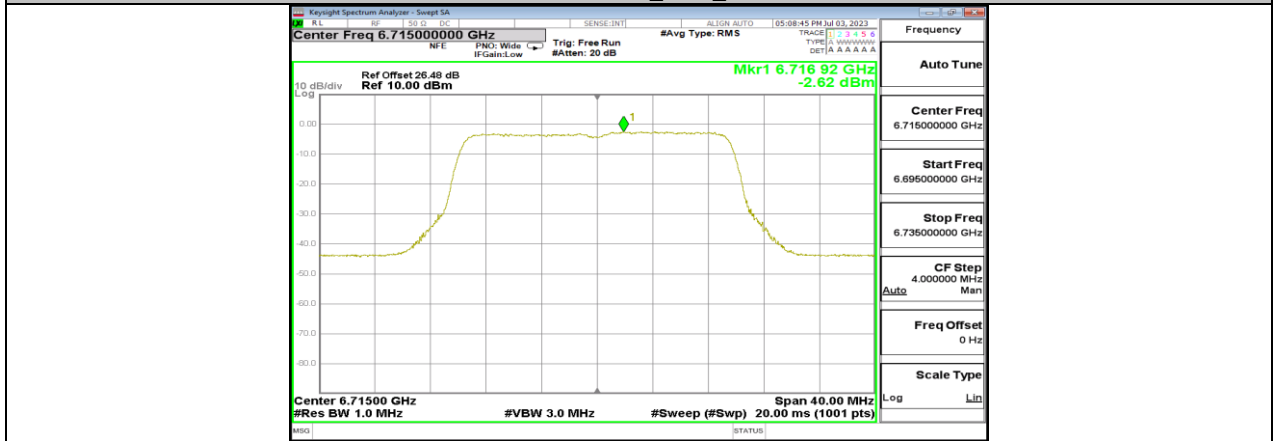
11BE20MIMO_Ant4_6435



11BE20MIMO_Ant9_6435

11BE20MIMO_Ant10_6435



11BE20MIMO_Ant3_6475



11BE20MIMO_Ant4_6475

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

11BE20MIMO_Ant9_6475



11BE20MIMO_Ant10_6475



11BE20MIMO_Ant3_6515

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*
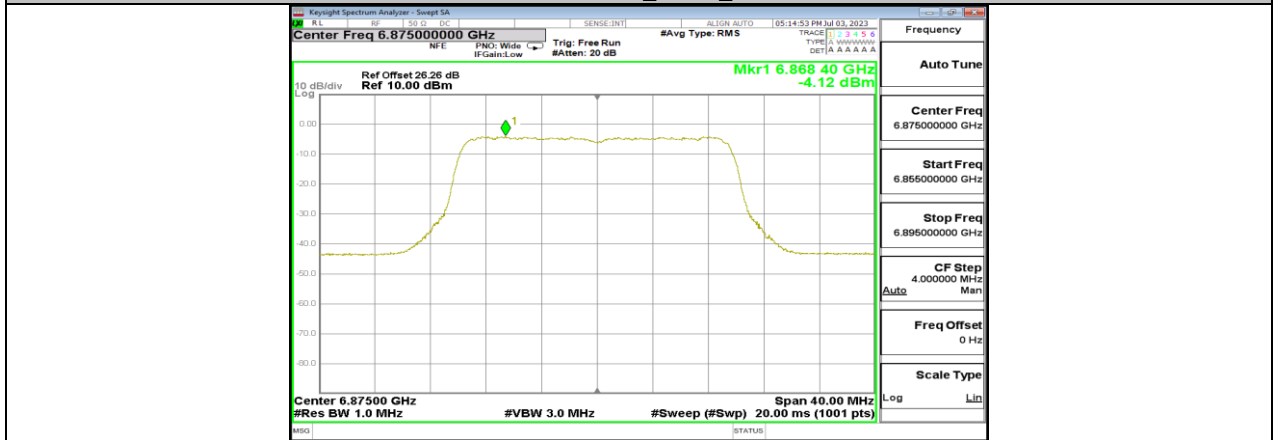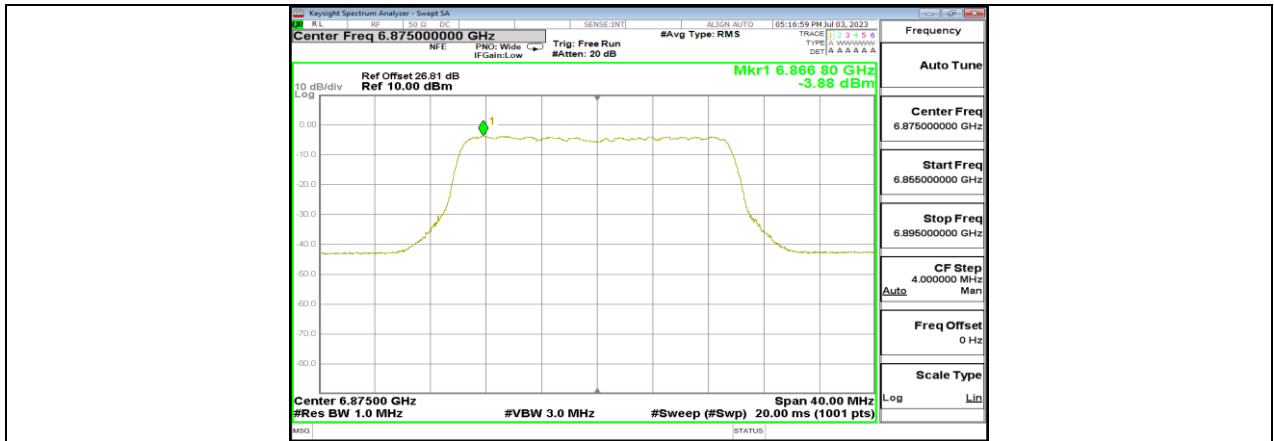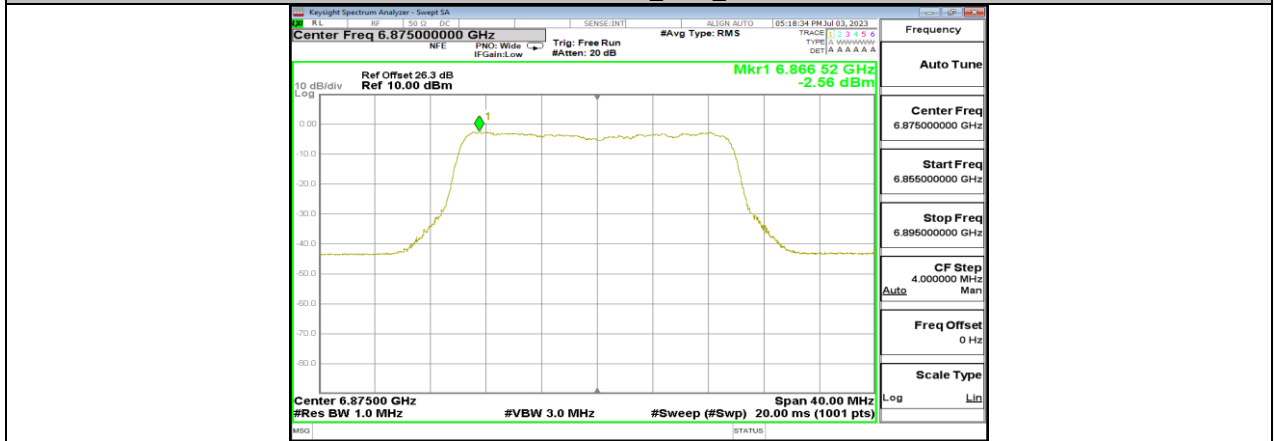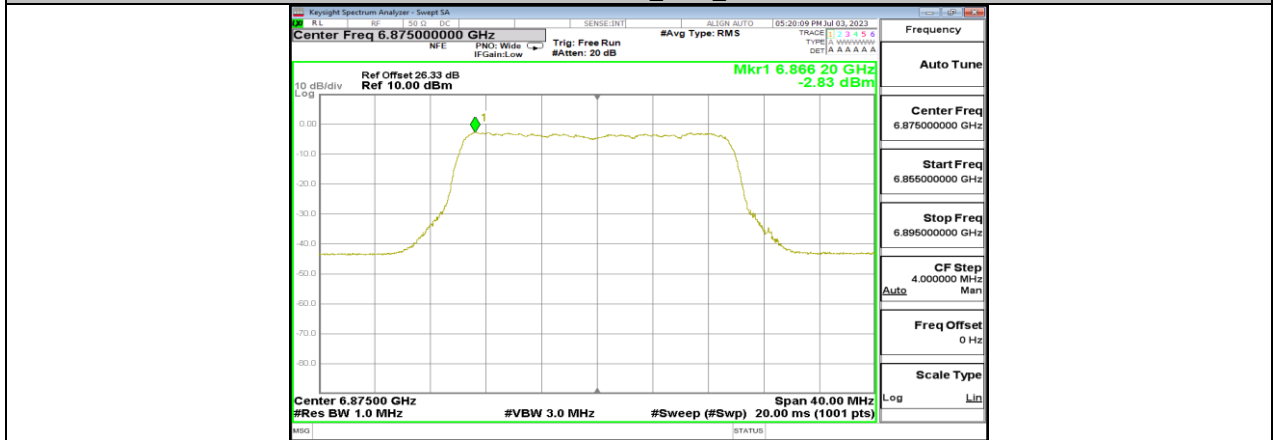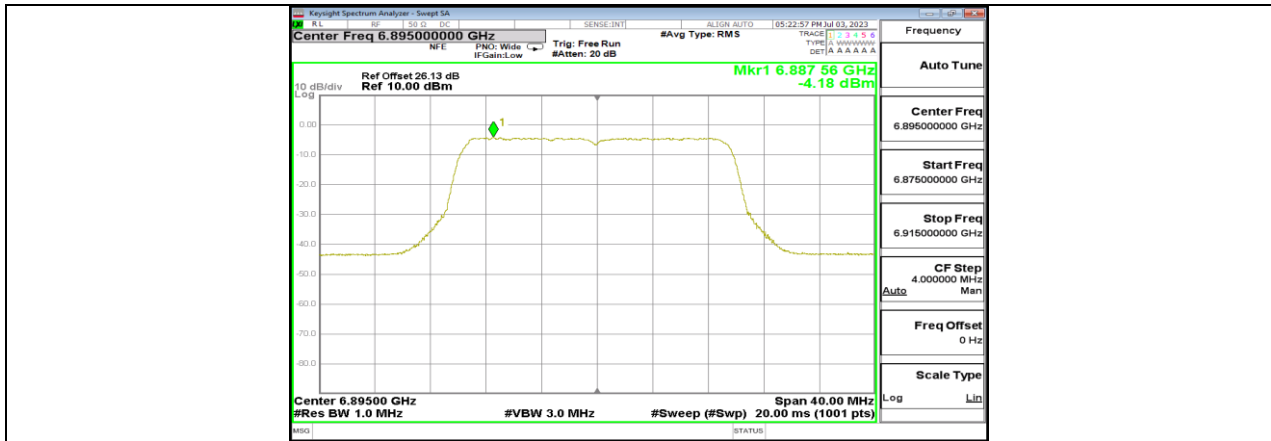
11BE20MIMO_Ant4_6515



11BE20MIMO_Ant9_6515



11BE20MIMO_Ant10_6515

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

11BE20MIMO_Ant3_6535



11BE20MIMO_Ant4_6535



11BE20MIMO_Ant9_6535

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

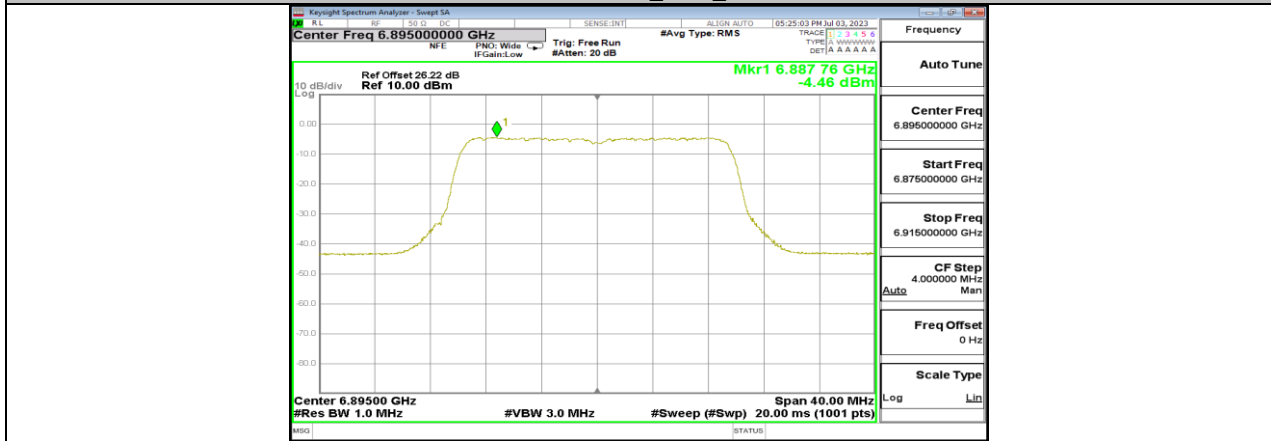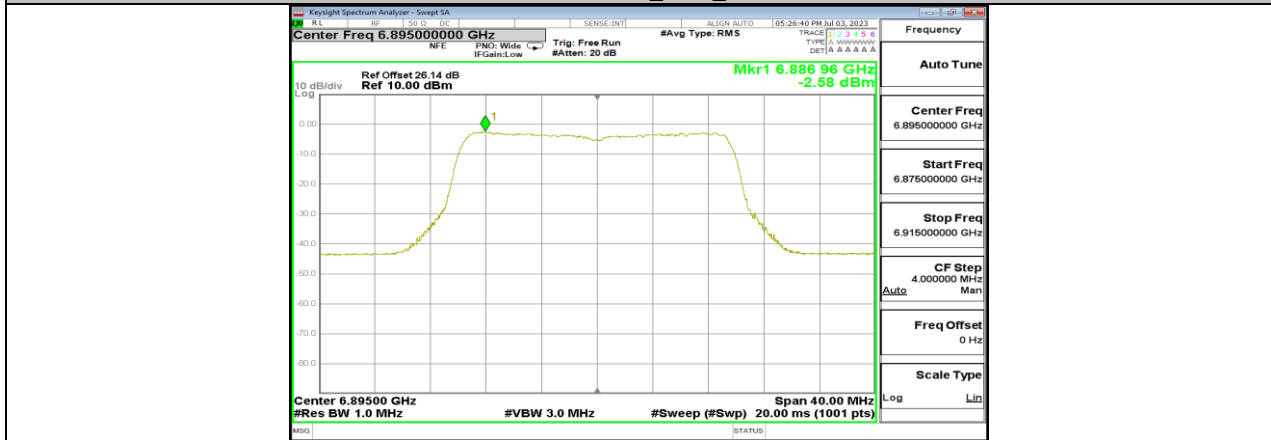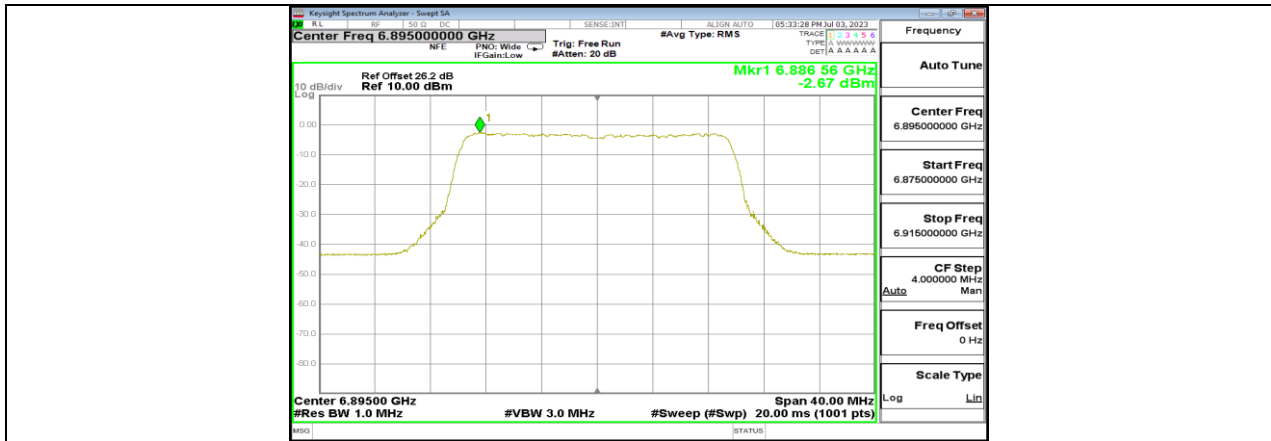11BE20MIMO_Ant10_6535



11BE20MIMO_Ant3_6715



11BE20MIMO_Ant4_6715

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

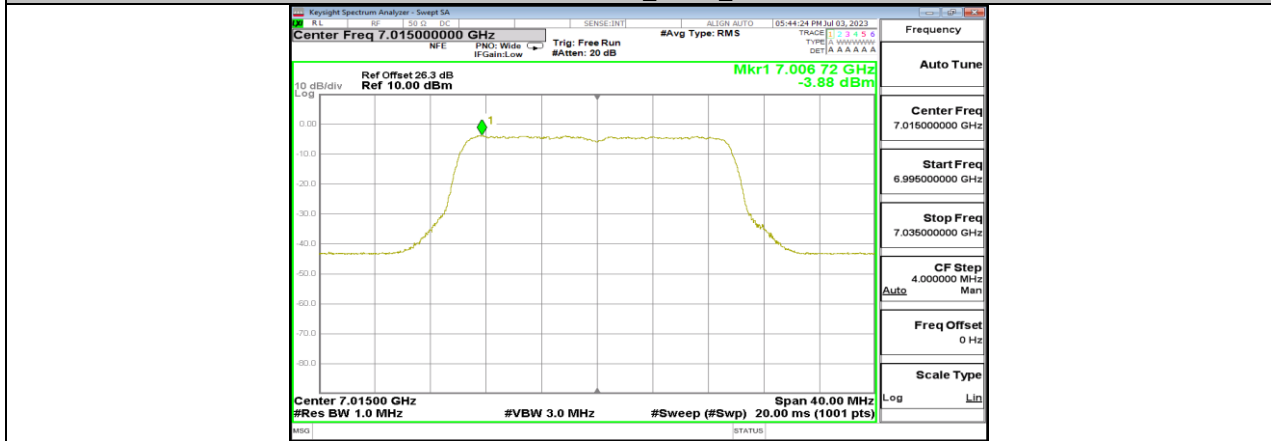11BE20MIMO_Ant9_6715



11BE20MIMO_Ant10_6715



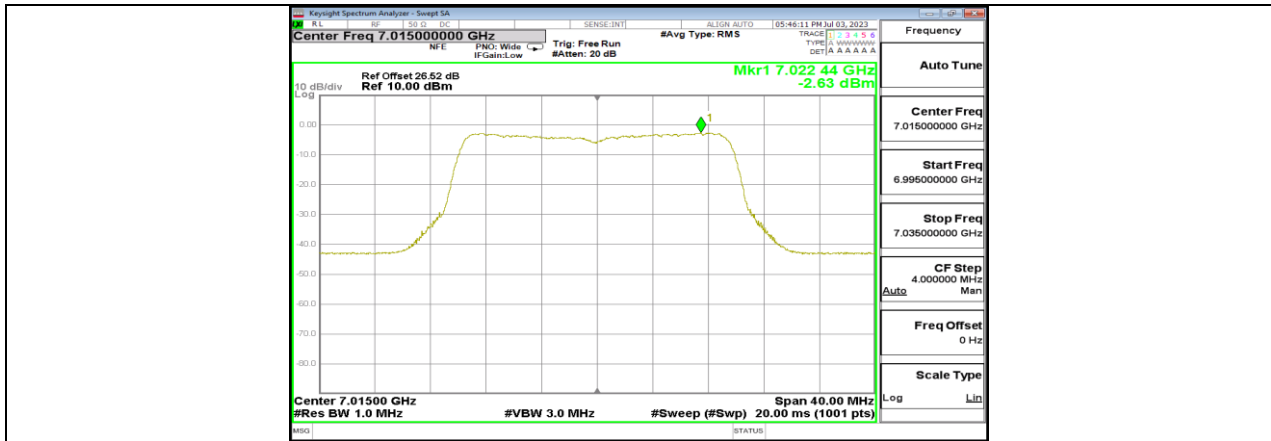11BE20MIMO_Ant3_6875

11BE20MIMO_Ant4_6875



11BE20MIMO_Ant9_6875



11BE20MIMO_Ant10_6875

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

11BE20MIMO_Ant3_6895



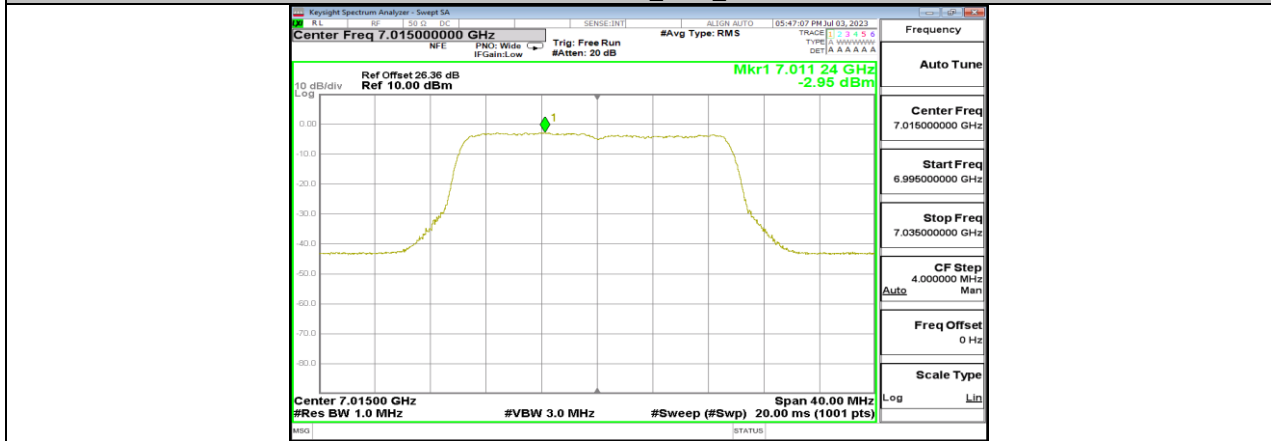11BE20MIMO_Ant4_6895



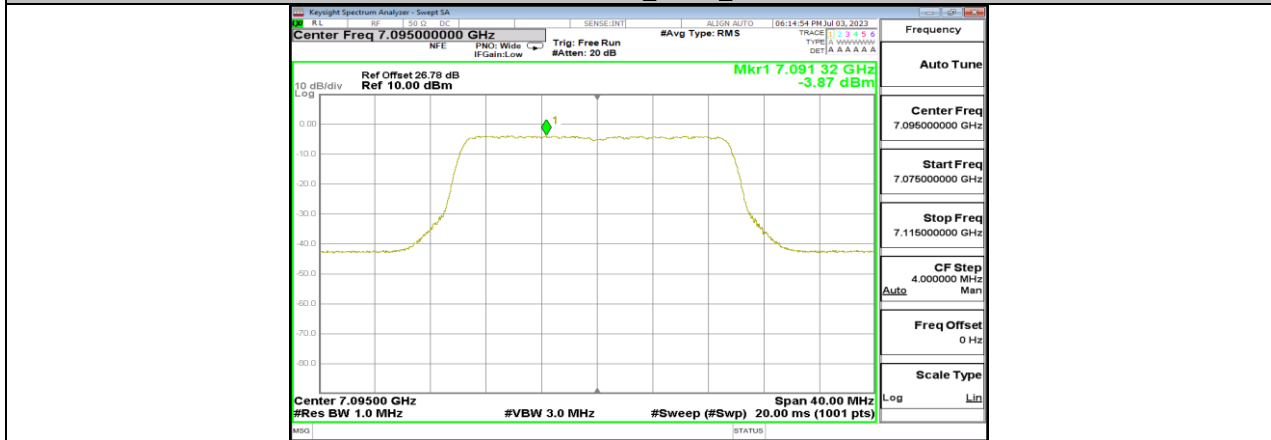11BE20MIMO_Ant9_6895

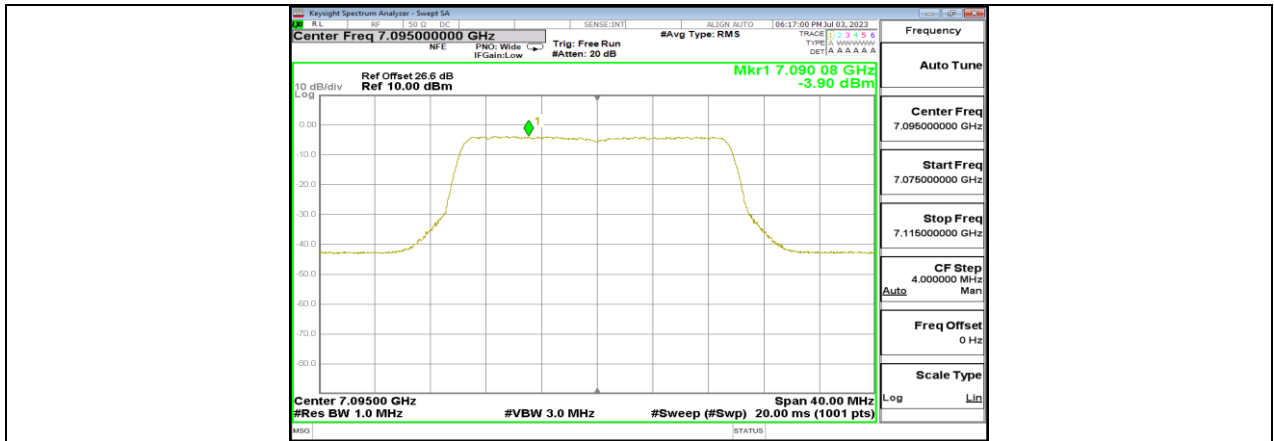11BE20MIMO_Ant10_6895
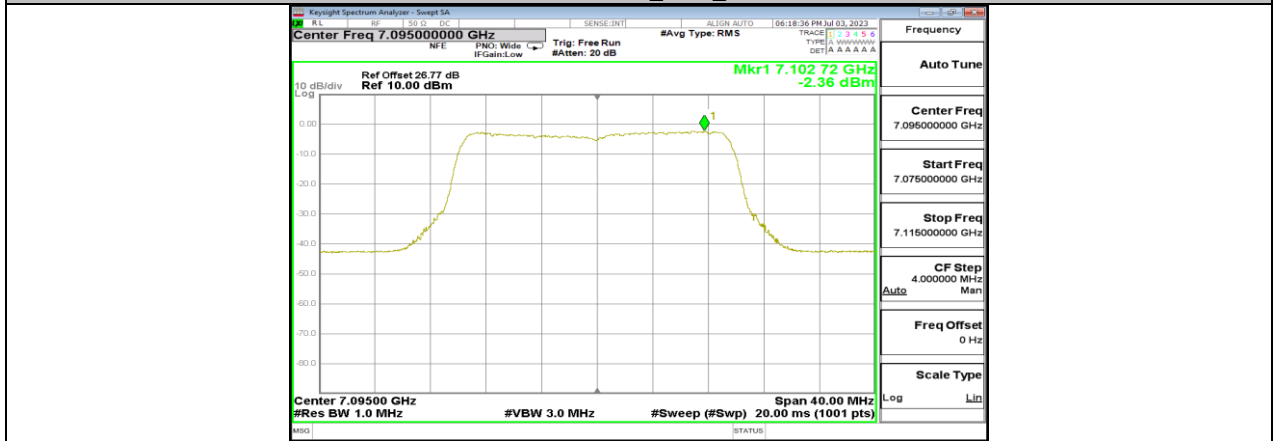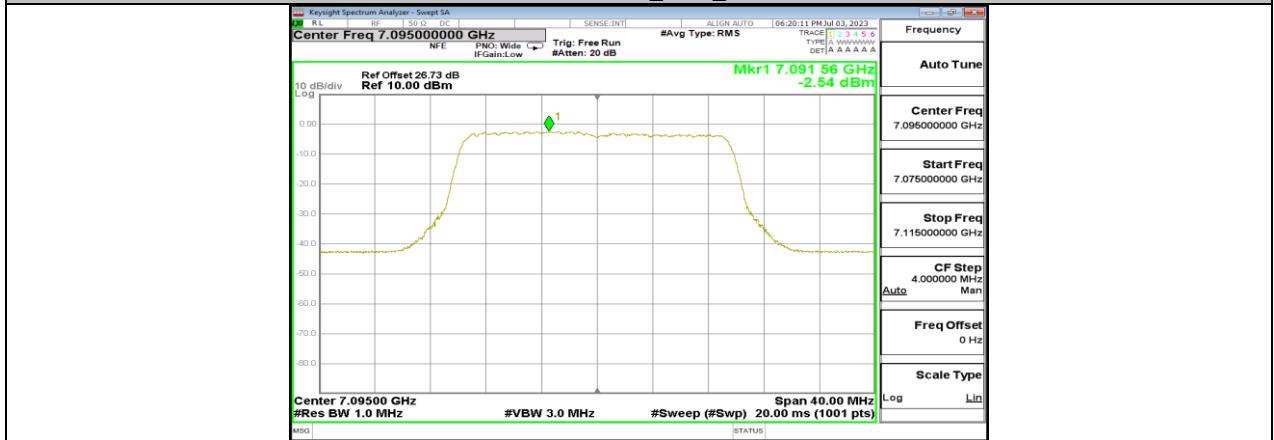


11BE20MIMO_Ant3_7015



11BE20MIMO_Ant4_7015

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*
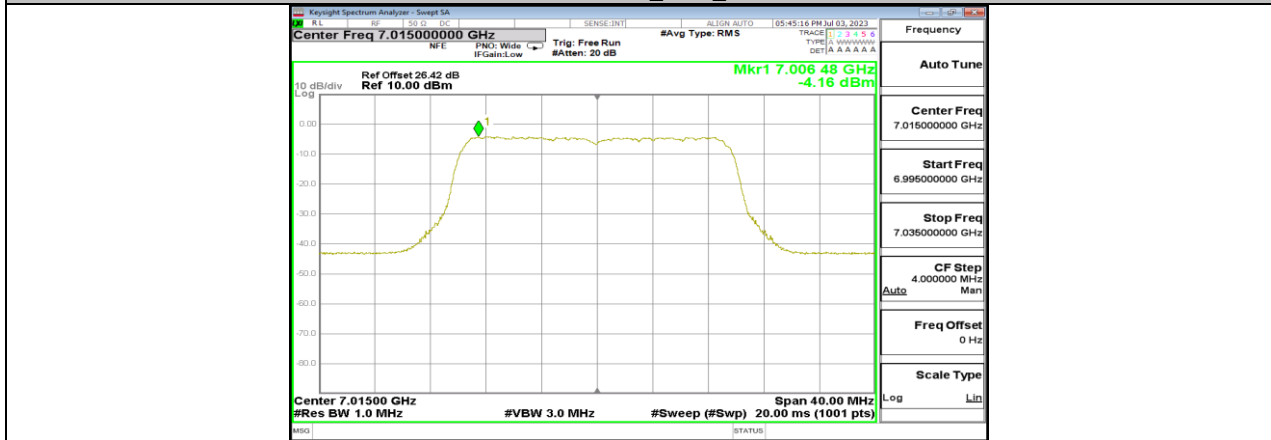
11BE20MIMO_Ant9_7015

11BE20MIMO_Ant10_7015

11BE20MIMO_Ant3_7095

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*
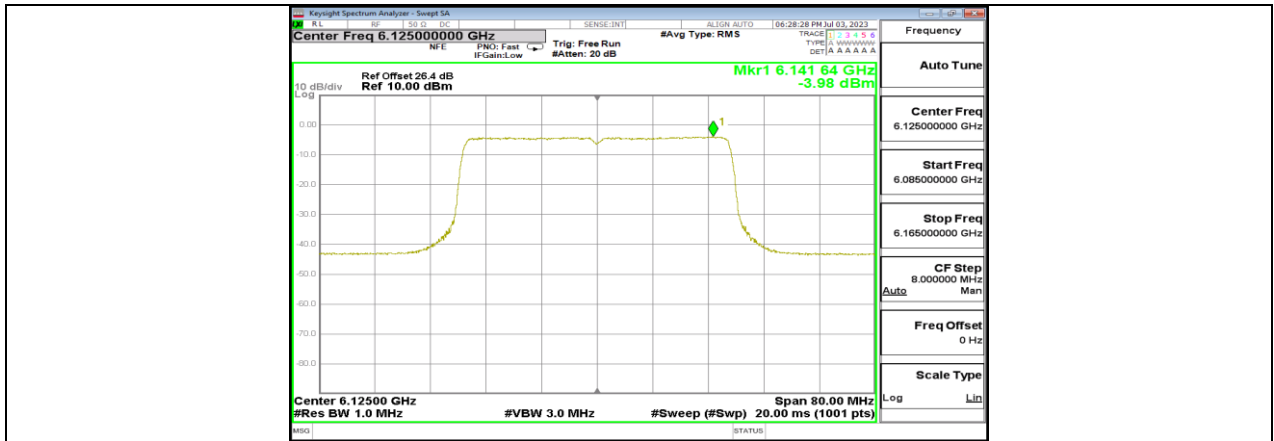
UL Solutions



11BE20MIMO_Ant4_7095
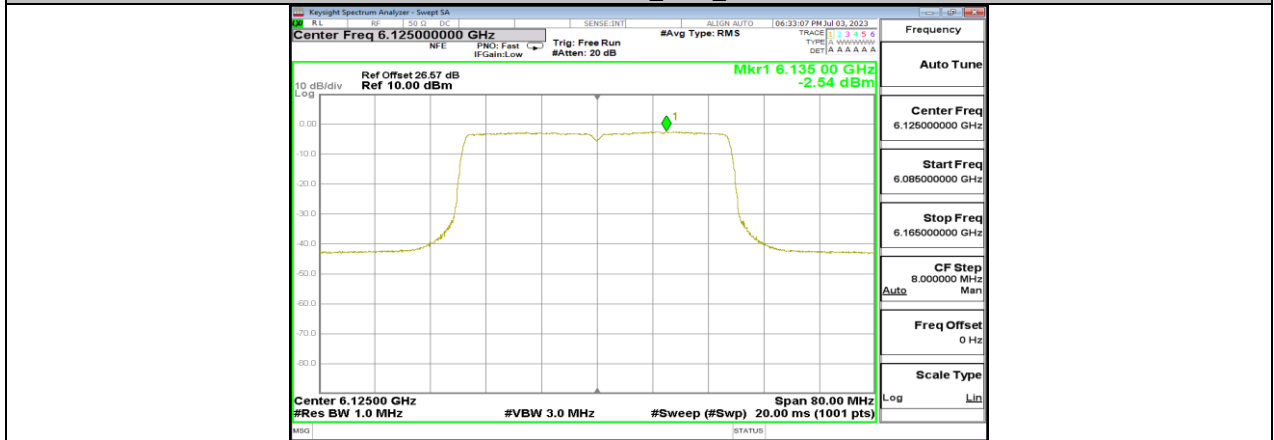


11BE20MIMO_Ant9_7095



11BE20MIMO_Ant10_7095

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*
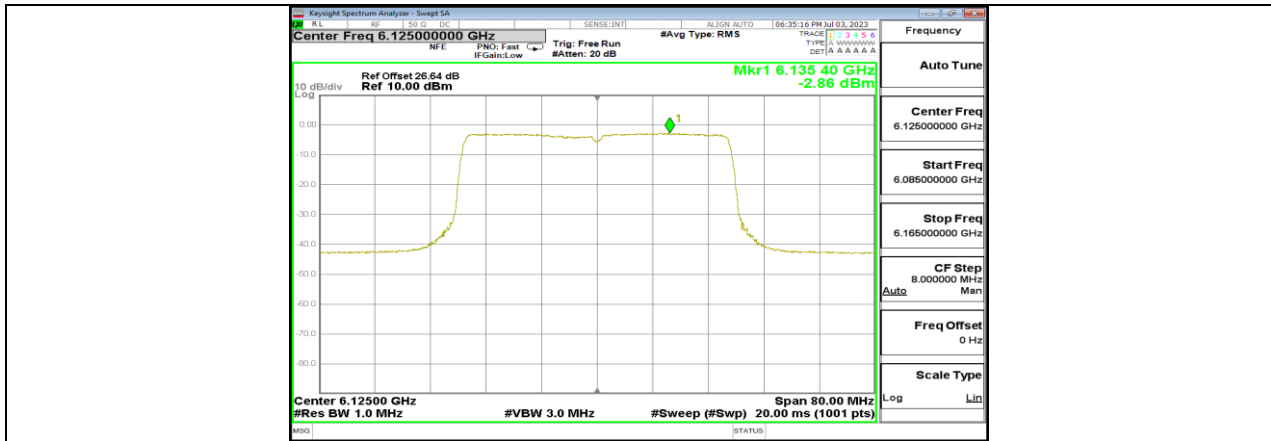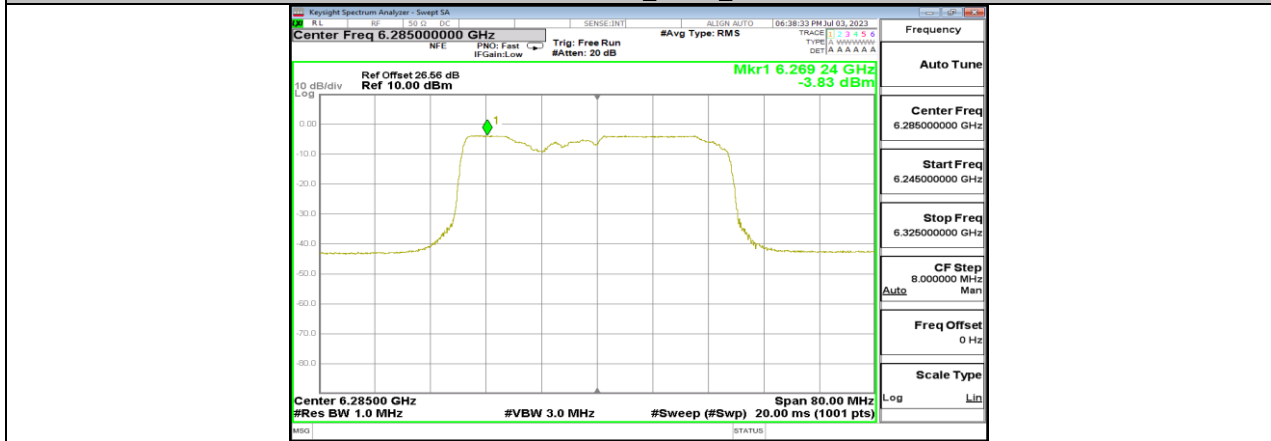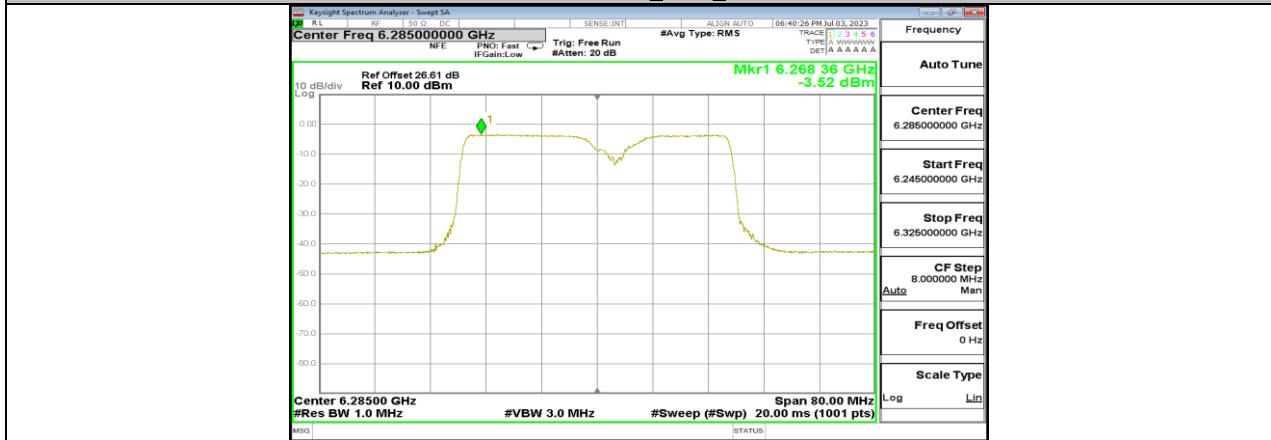
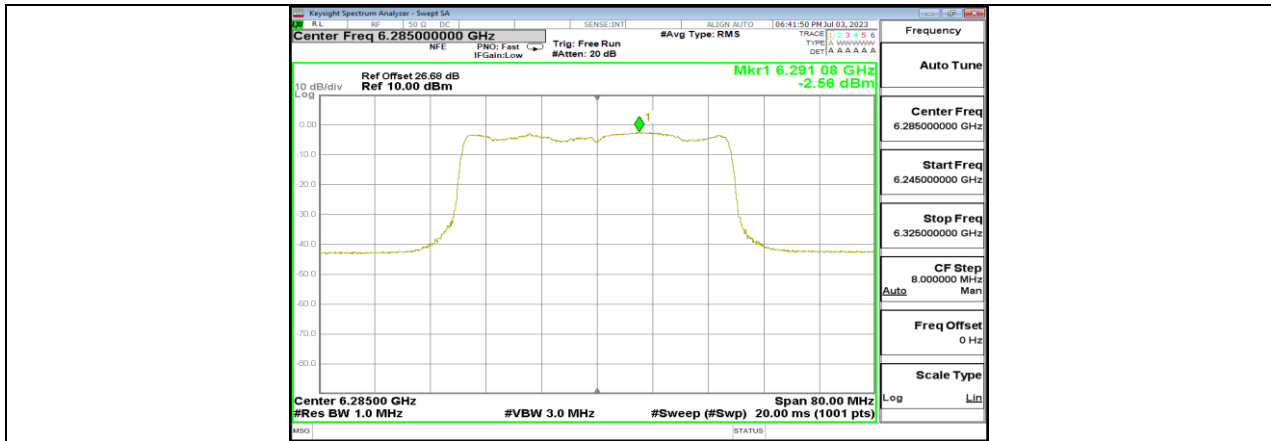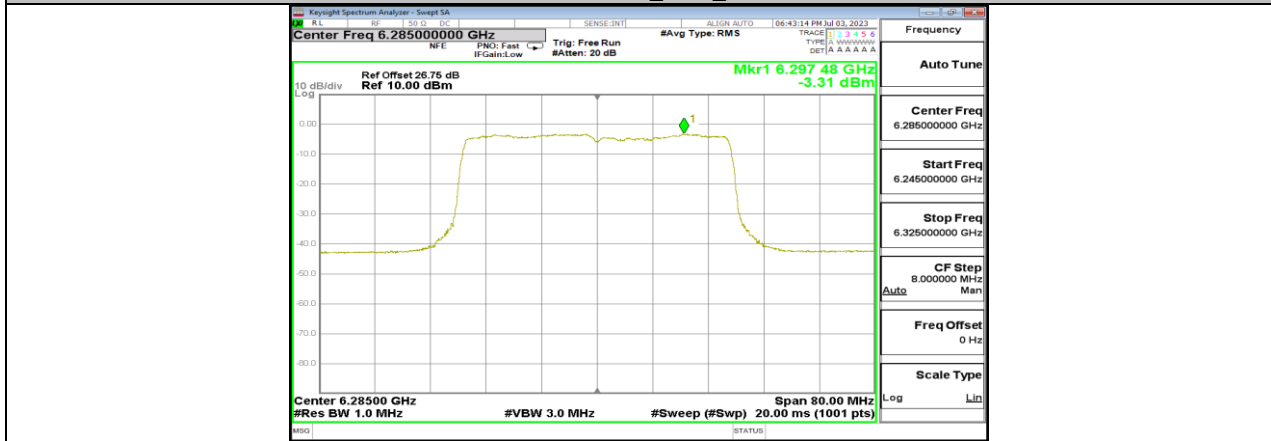11BE40MIMO_Ant3_6125
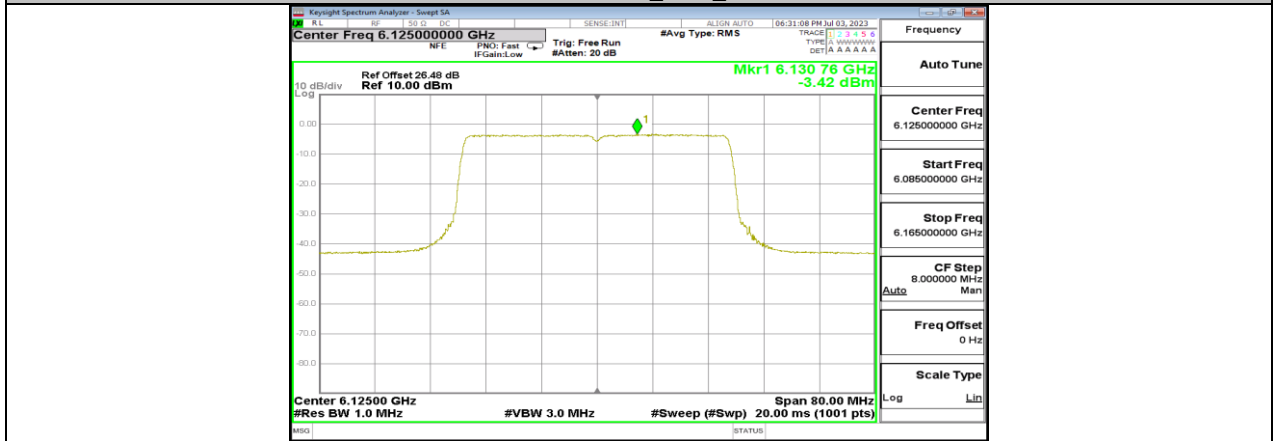


11BE40MIMO_Ant4_6125



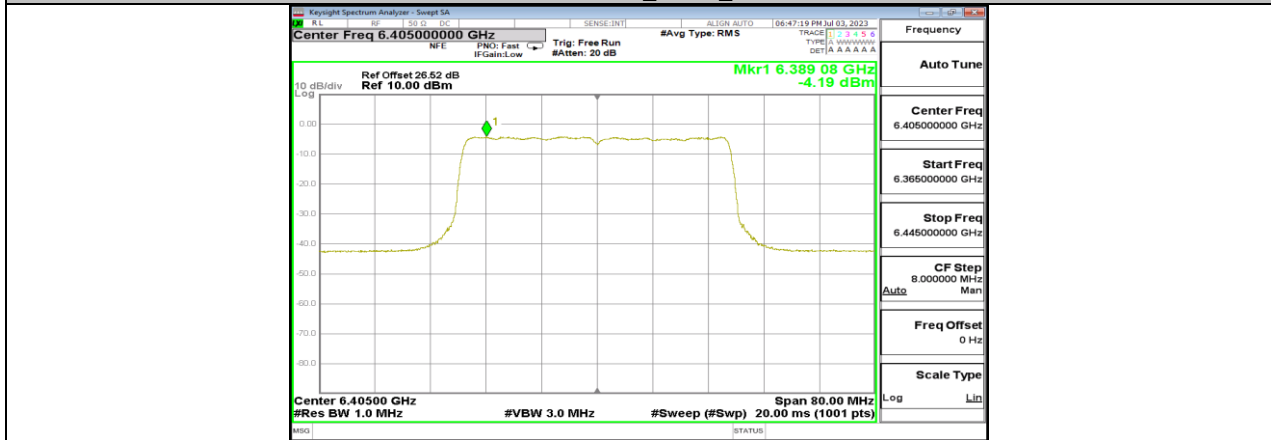11BE40MIMO_Ant9_6125

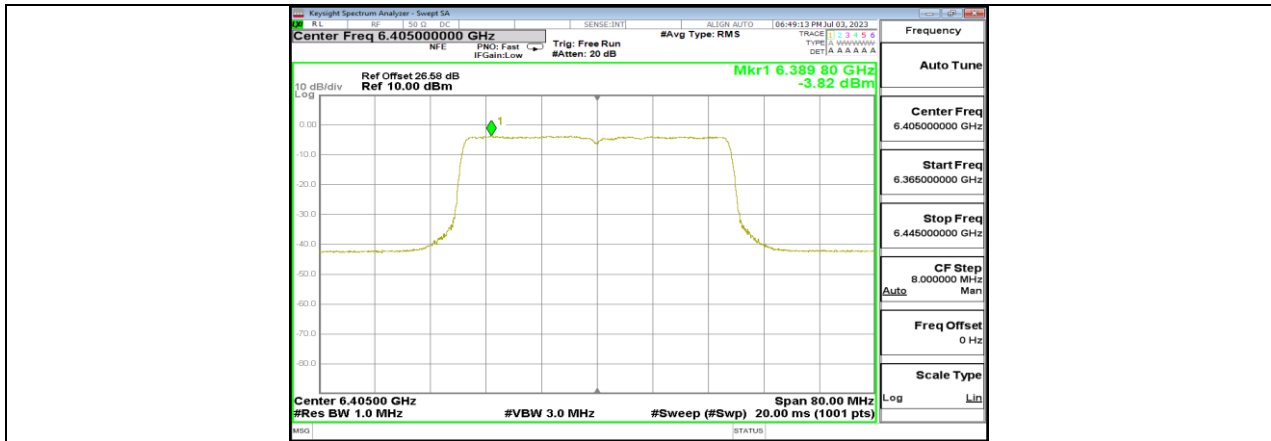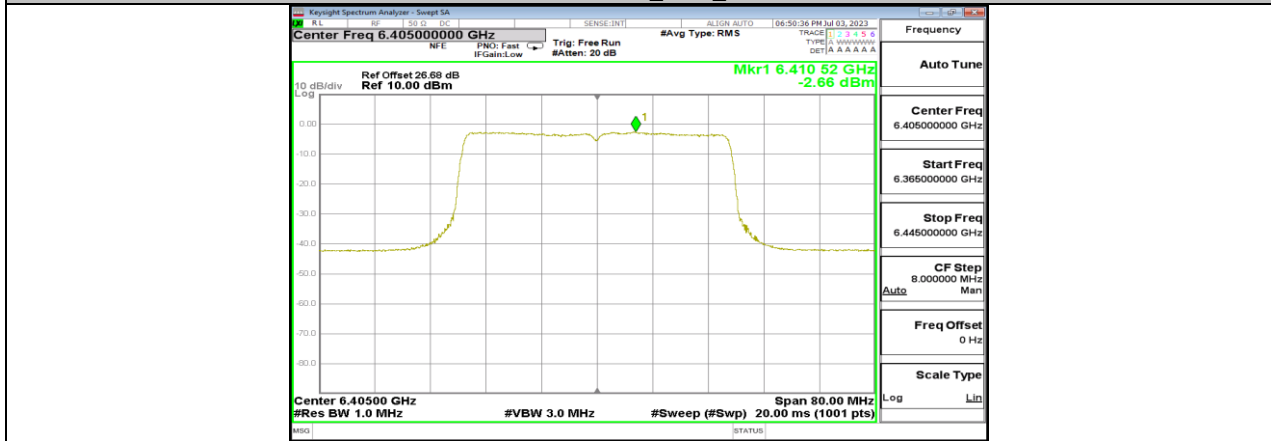11BE40MIMO_Ant10_6125



11BE40MIMO_Ant3_6285



11BE40MIMO_Ant4_6285

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch        FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

11BE40MIMO_Ant9_6285



11BE40MIMO_Ant10_6285



11BE40MIMO_Ant3_6405

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch        FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*
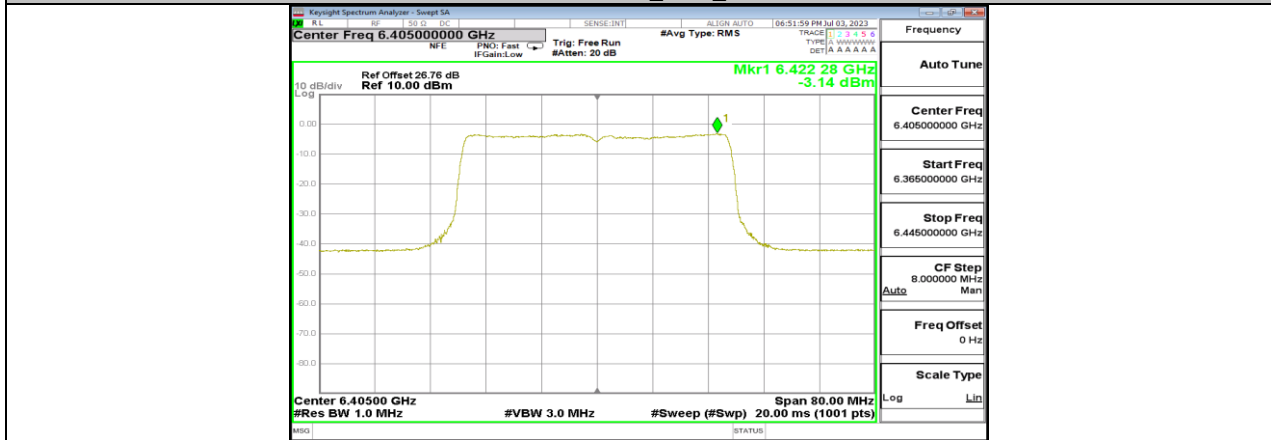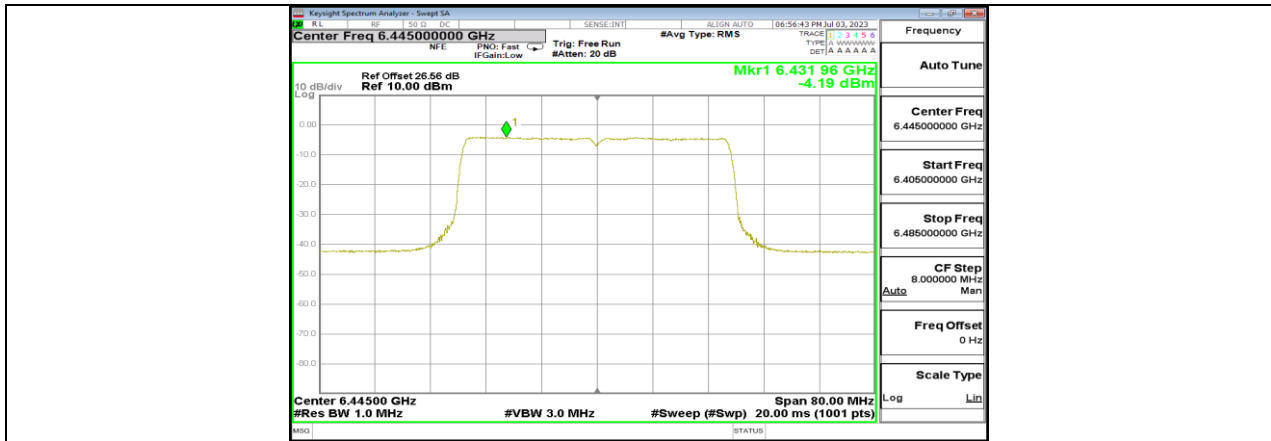
11BE40MIMO_Ant4_6405



11BE40MIMO_Ant9_6405



11BE40MIMO_Ant10_6405

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*
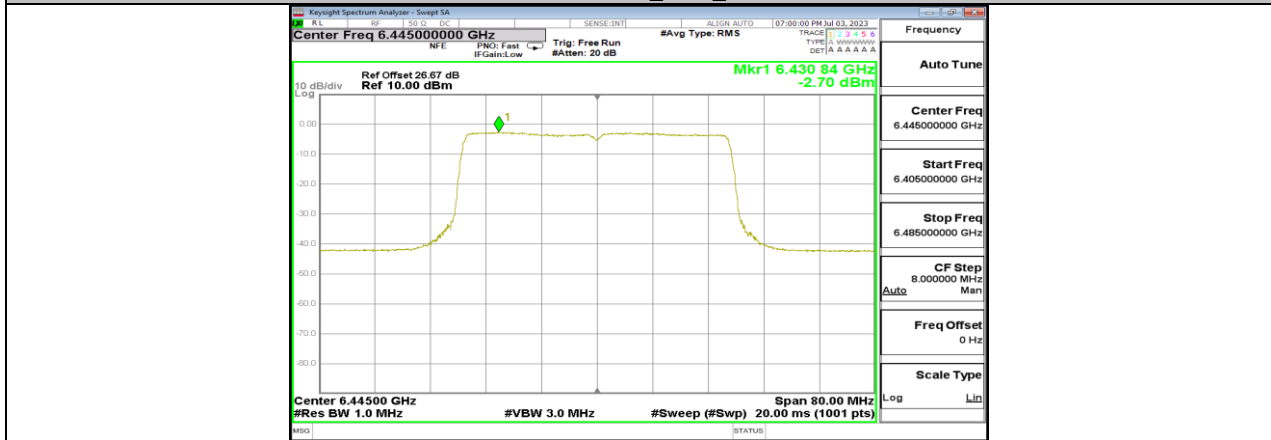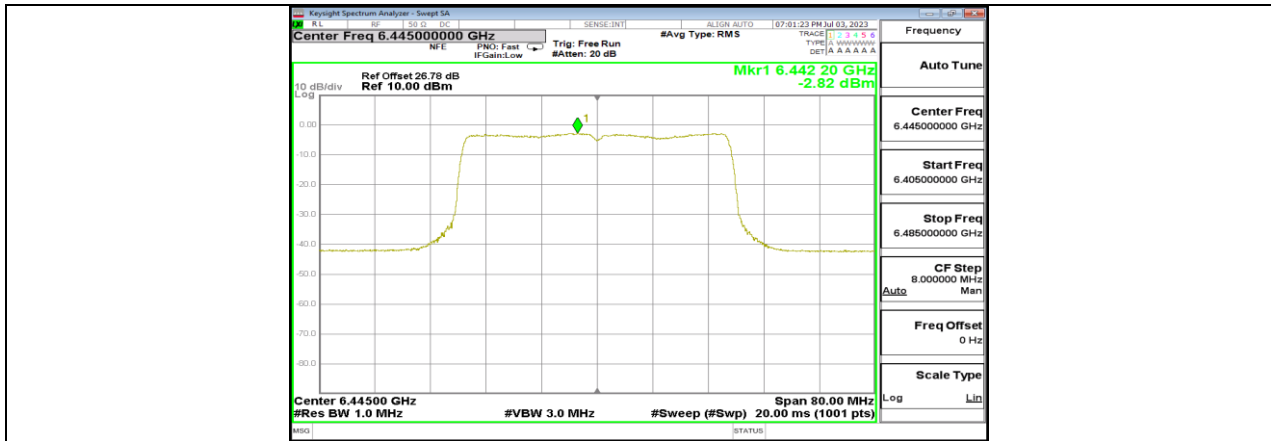
11BE40MIMO_Ant3_6445
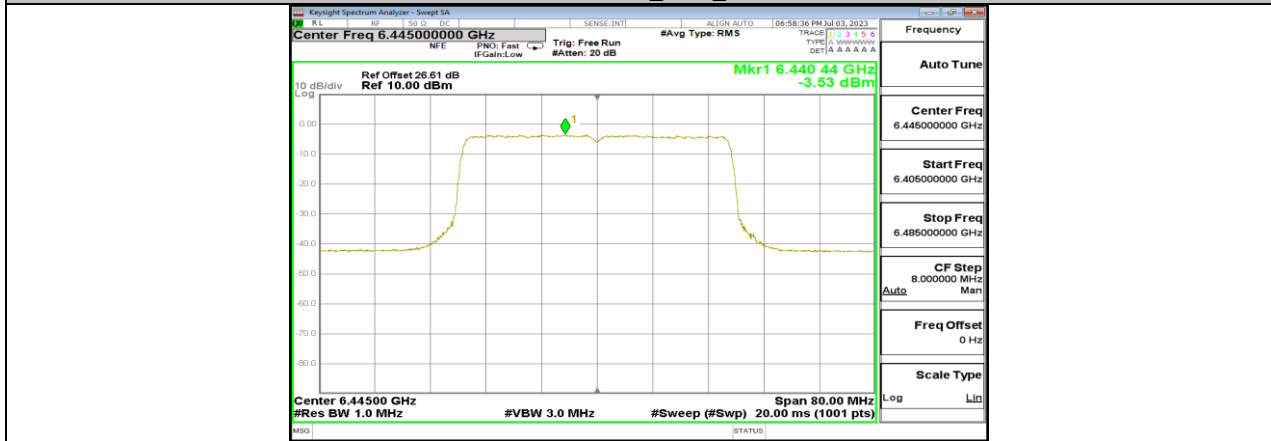


11BE40MIMO_Ant4_6445



11BE40MIMO_Ant9_6445

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

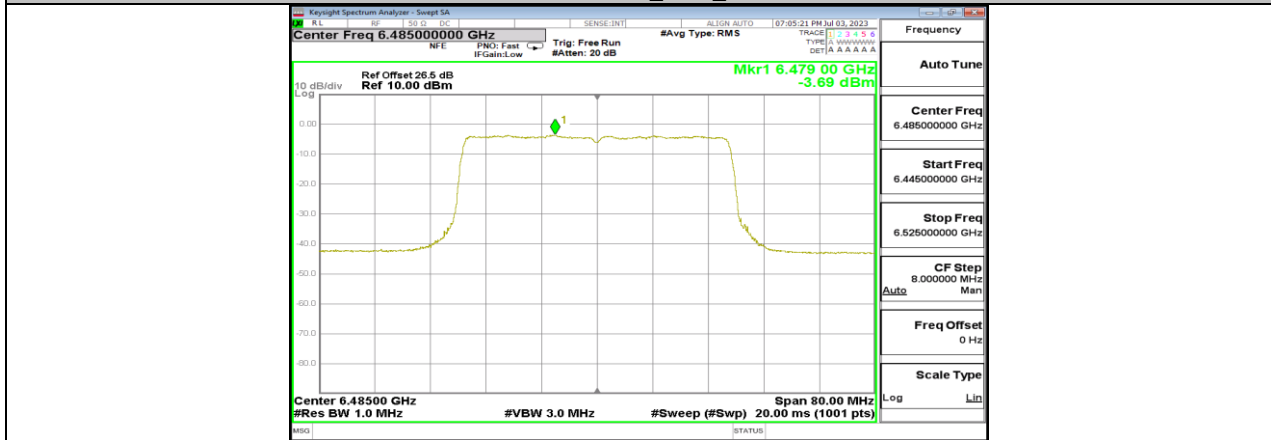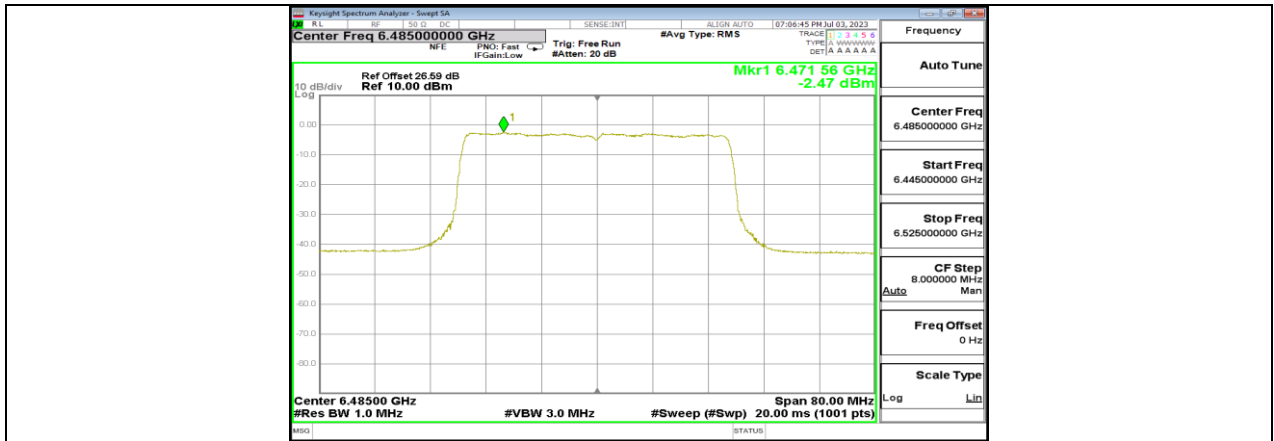11BE40MIMO_Ant10_6445
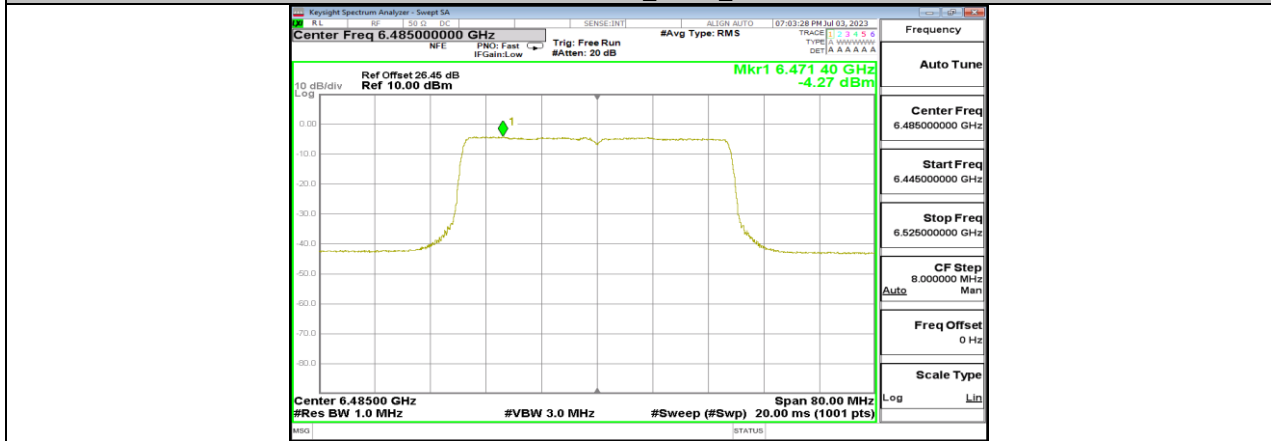


11BE40MIMO_Ant3_6485



11BE40MIMO_Ant4_6485

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*

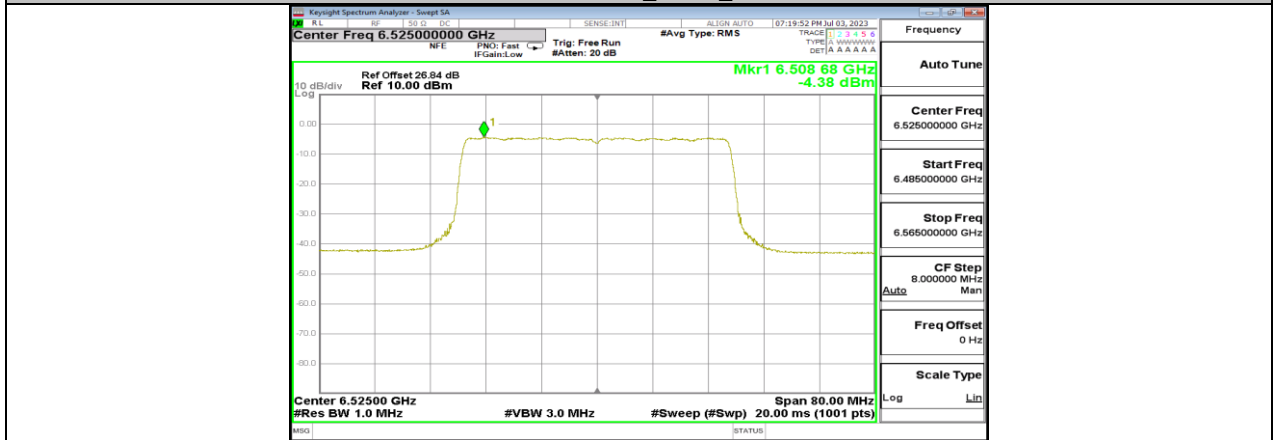11BE40MIMO_Ant9_6485
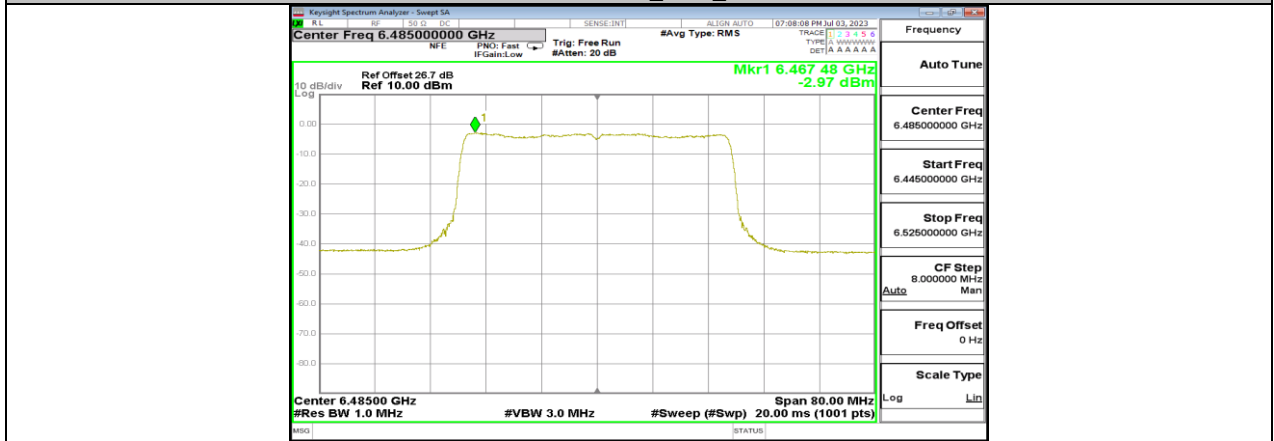


11BE40MIMO_Ant10_6485



11BE40MIMO_Ant3_6525

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch          FORM NO: 10-SL-F0035

*This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.*