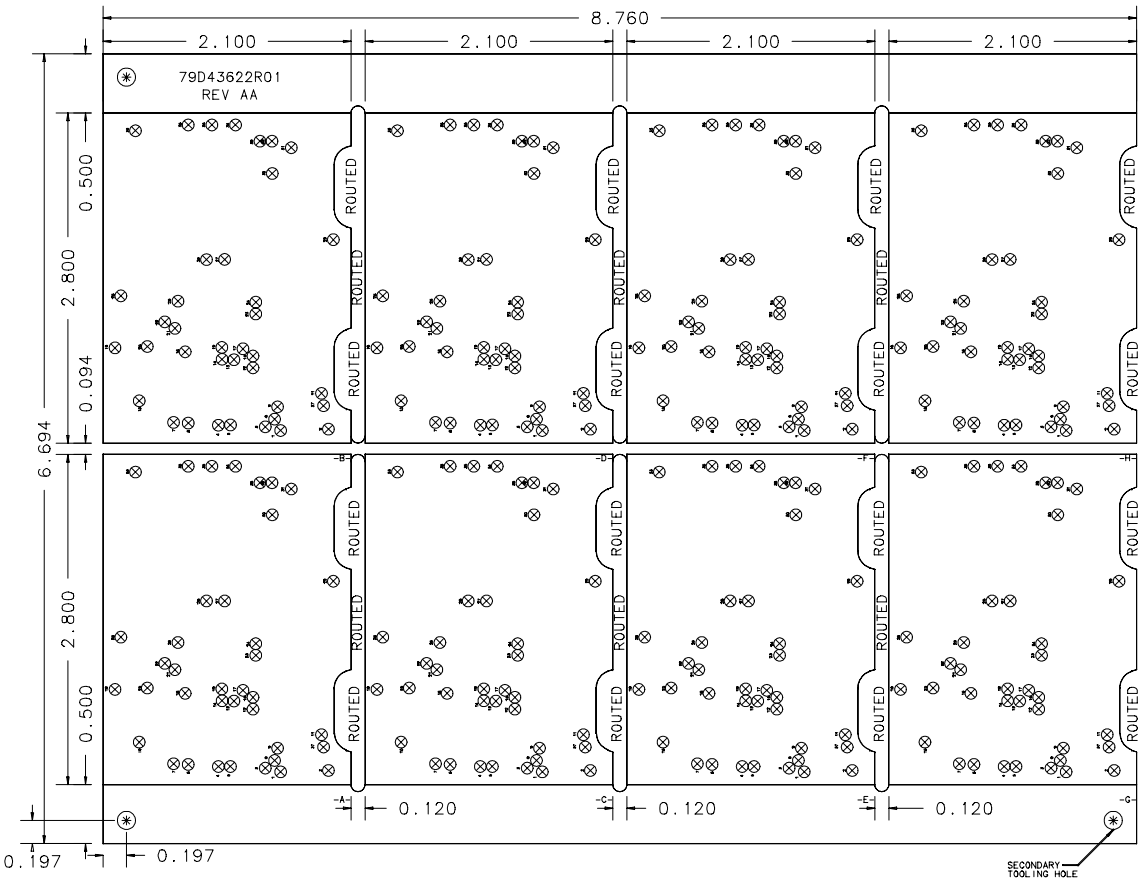

TOP SIDE PROBES TOP SIDE VIEW

TOP SIDE PROBES

PROBE NO.	INCHES X	INCHES Y
1	1.306	0.412
2	1.713	0.453
3	1.177	0.443
4	0.780	0.457
5	0.881	0.458
6	0.524	0.475
7	0.400	0.480
8	1.256	0.508
9	1.281	0.819
10	0.198	0.683
11	1.653	0.727
12	1.073	0.843
13	0.911	1.019
14	0.810	1.015
15	1.073	1.043
16	0.498	1.078
17	0.988	1.103
18	-0.097	1.111
19	0.809	1.115
20	0.178	1.193
21	0.411	1.278
22	0.325	1.339
23	1.097	1.399
24	1.097	1.499
25	0.437	1.508
26	-0.047	1.553
27	0.839	1.861
28	0.878	1.880
29	1.754	2.028
30	1.235	2.590
31	1.397	2.899
32	1.231	2.883
33	0.077	2.563
34	0.924	3.002
35	0.774	3.002
36	0.524	3.002
37	1.670	0.629
38	1.132	2.883

MIDPOINT W/REF TO BOARD PRIMARY TOOLING HOLE

ISSUE	RELEASES AND REVISIONS	MEMO
AA	SEE SHEET 1	

THE DRAWING ON THIS PRINT AND INFORMATION THEREWITH ARE MOTOROLA CONFIDENTIAL PROPRIETARY AND SHALL NOT BE USED IN WHOLE OR IN PART WITHOUT MOTOROLA'S WRITTEN CONSENT.

☐ MOTOROLA GENERAL BUSINESS INFORMATION
☐ MOTOROLA INTERNAL USE ONLY
☐ MOTOROLA CONFIDENTIAL PROPRIETARY

Classified by:
Date:

MOTOROLA
Automotive and Industrial Electronics Group
SEGUIN, TEXAS 78155

SCALE: 2:1

/net/pcl4/users/local_boards/ms272_a_lojj3pa_a3/assy_models/lojj3.5pa_adpt/assy_layout - panel

Wed Aug 30 11:00:26 CDT 2000

SHEET 5 OF 5

DWG. NO. 79D43622R01