



OBW a 5825MHz Ant1

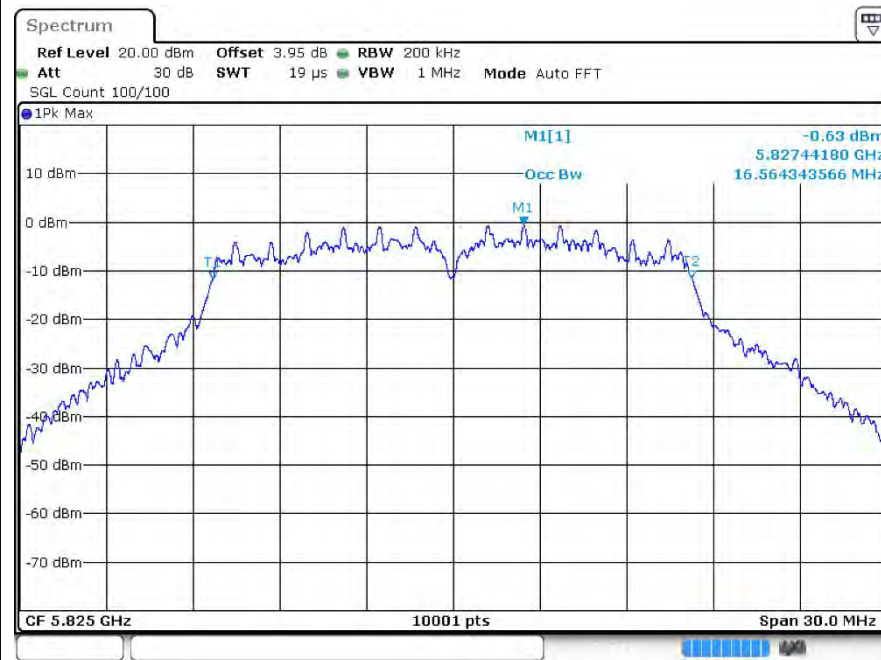


OBW n20 5745MHz Ant1

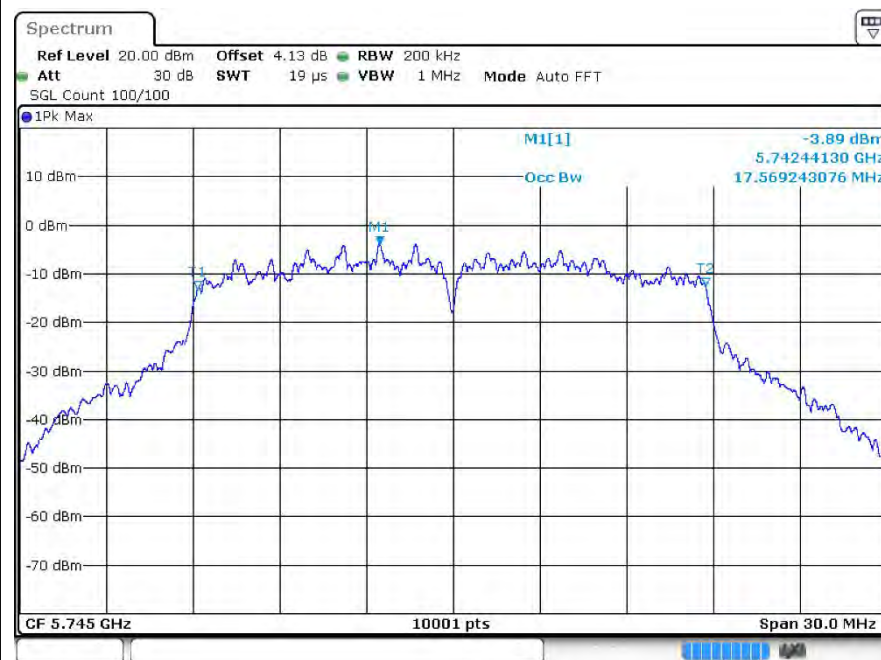


OBW n20 5785MHz Ant1




OBW n20 5825MHz Ant1

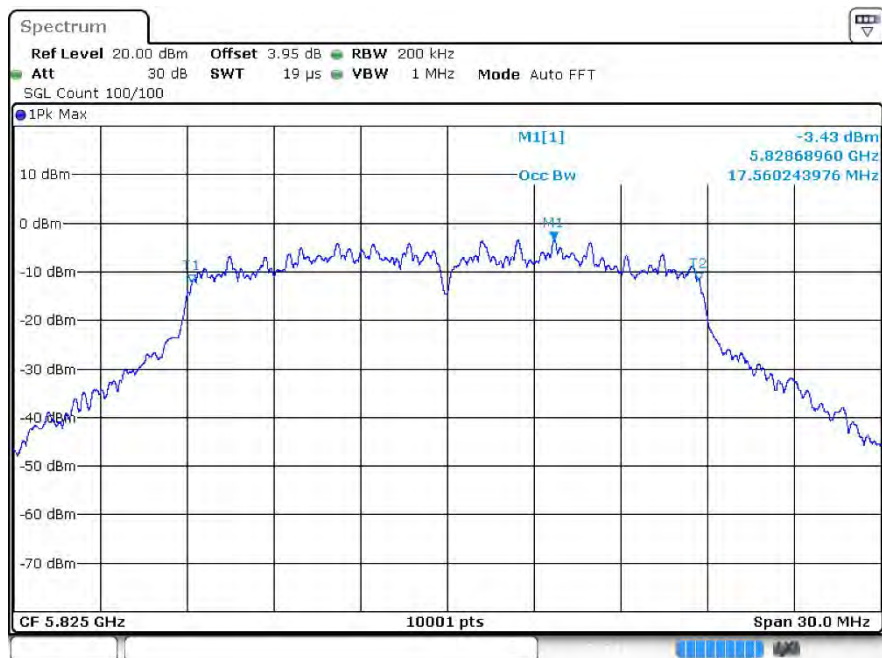


OBW n40 5755MHz Ant1

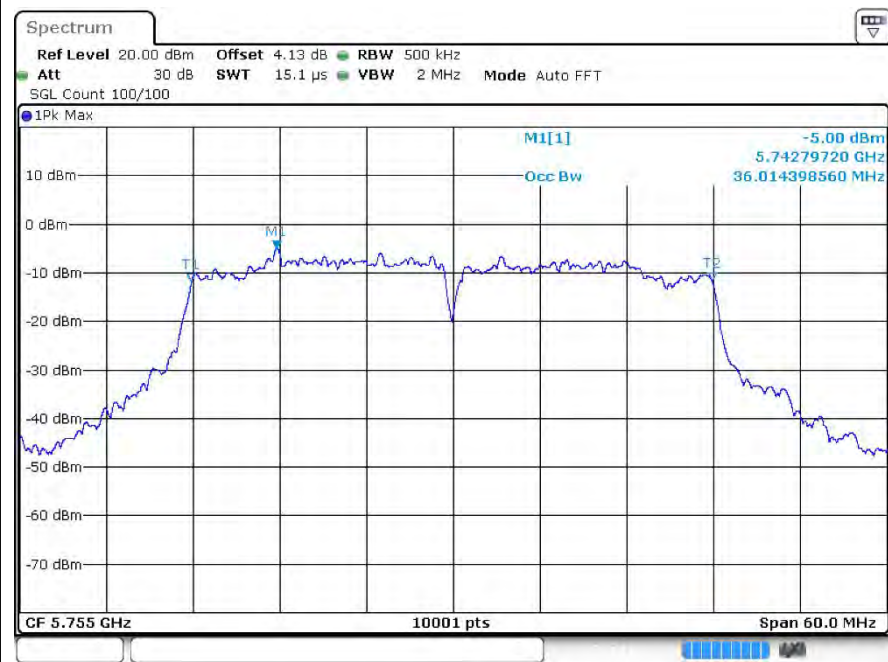

OBW n40 5795MHz Ant1

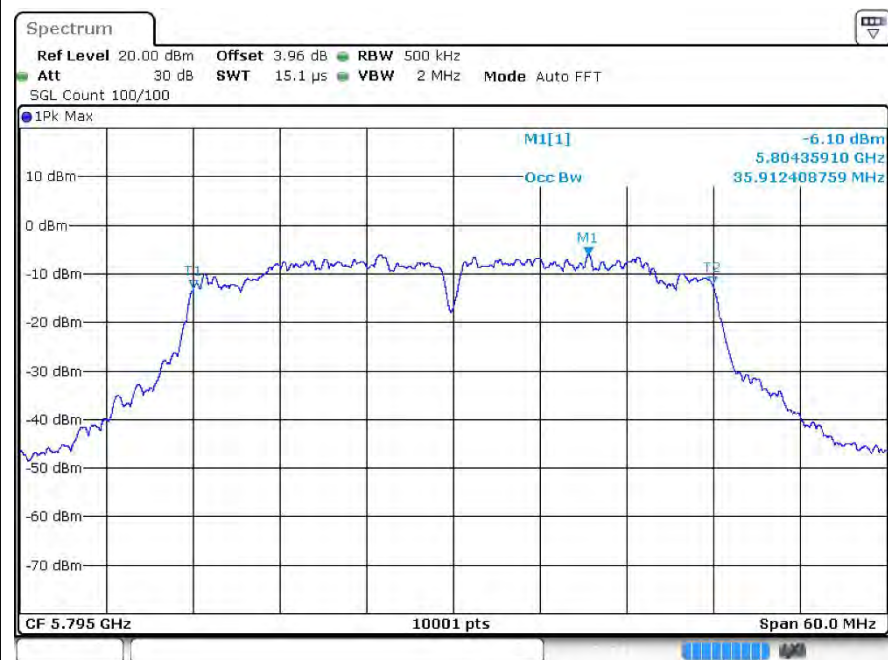


OBW ac20 5745MHz Ant1

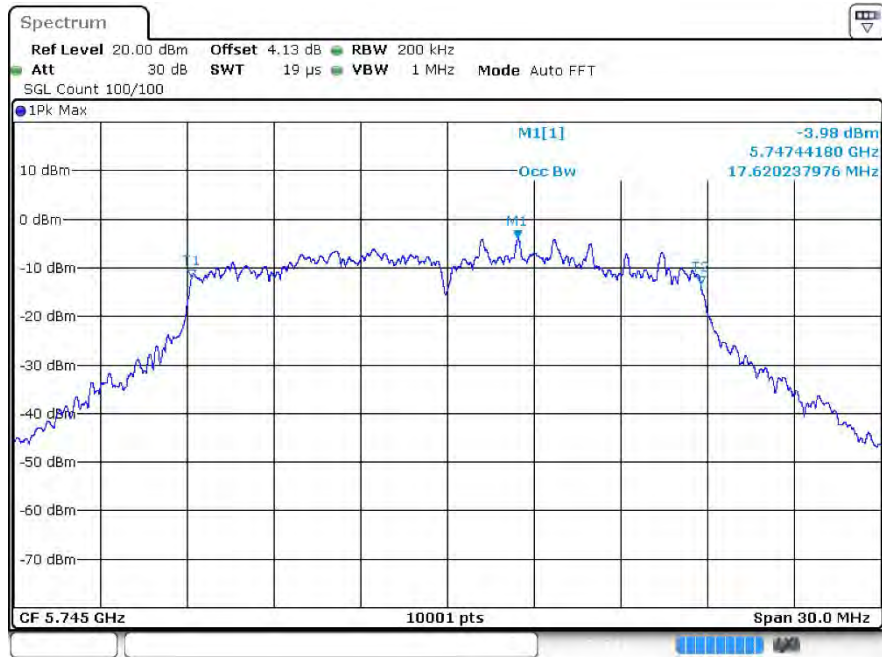

OBW ac20 5785MHz Ant1




OBW ac20 5825MHz Ant1

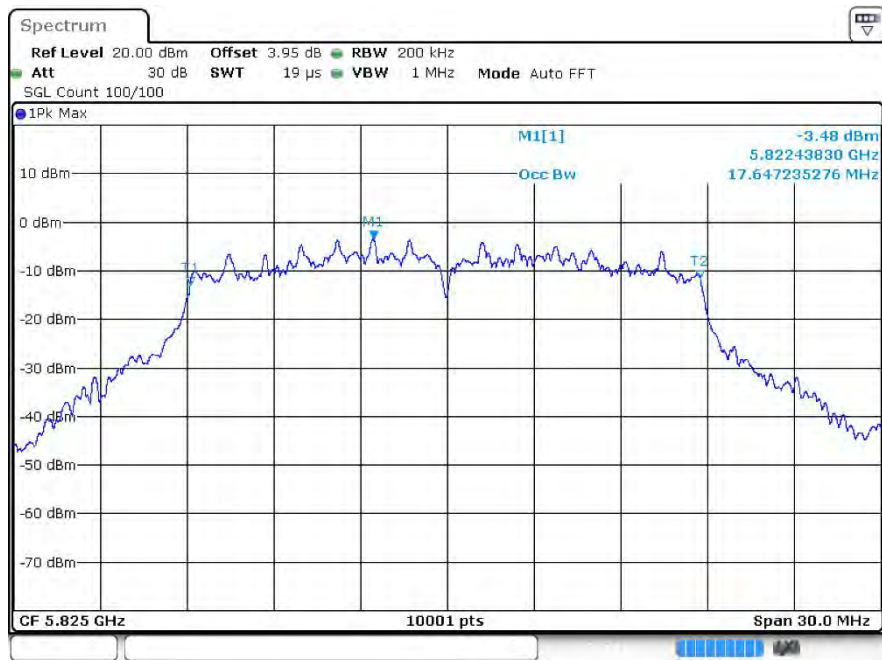


OBW ac40 5755MHz Ant1




OBW ac40 5795MHz Ant1

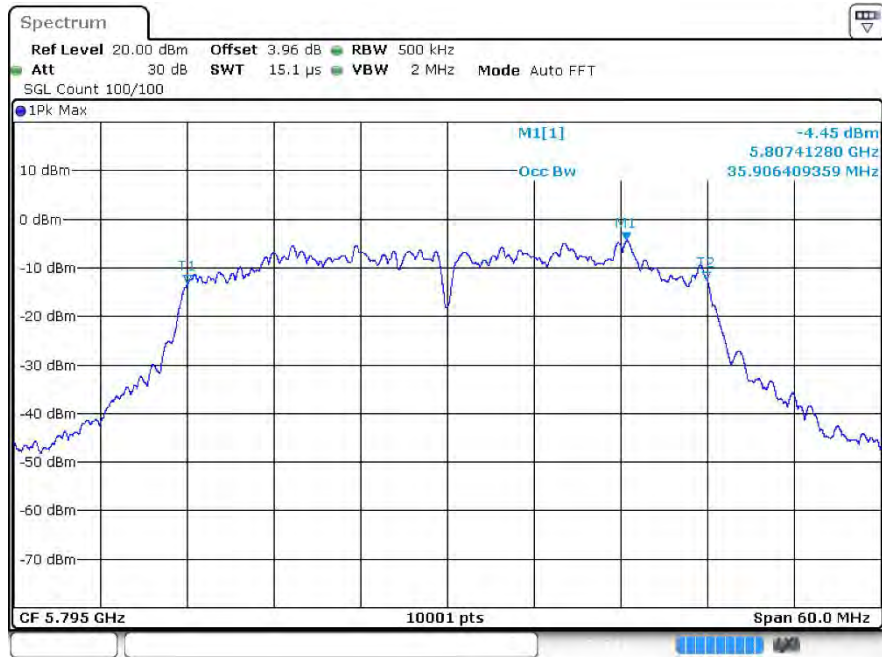

OBW ac80 5775MHz Ant1

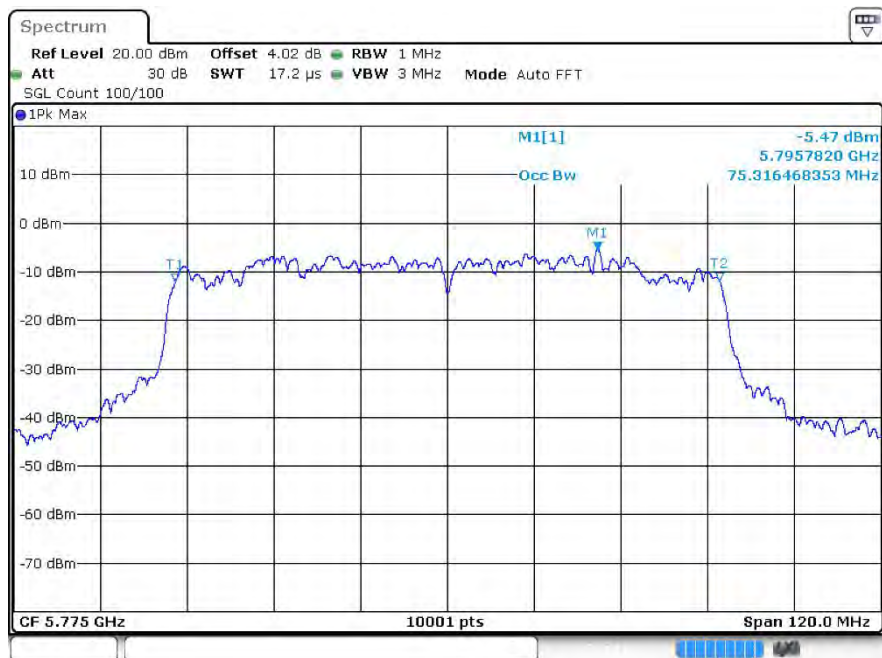


OBW ax20 5745MHz Ant1

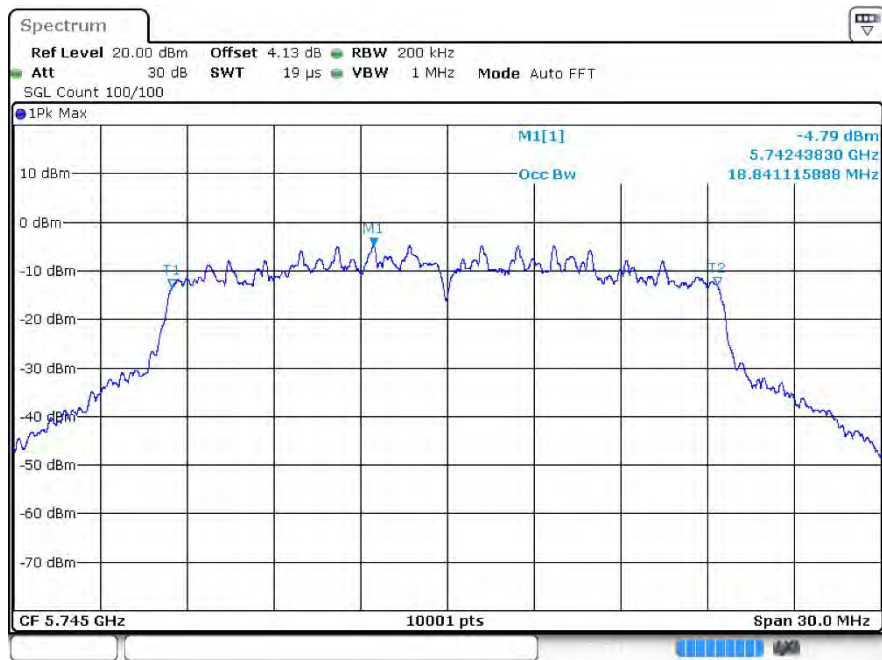

OBW ax20 5785MHz Ant1




OBW ax20 5825MHz Ant1

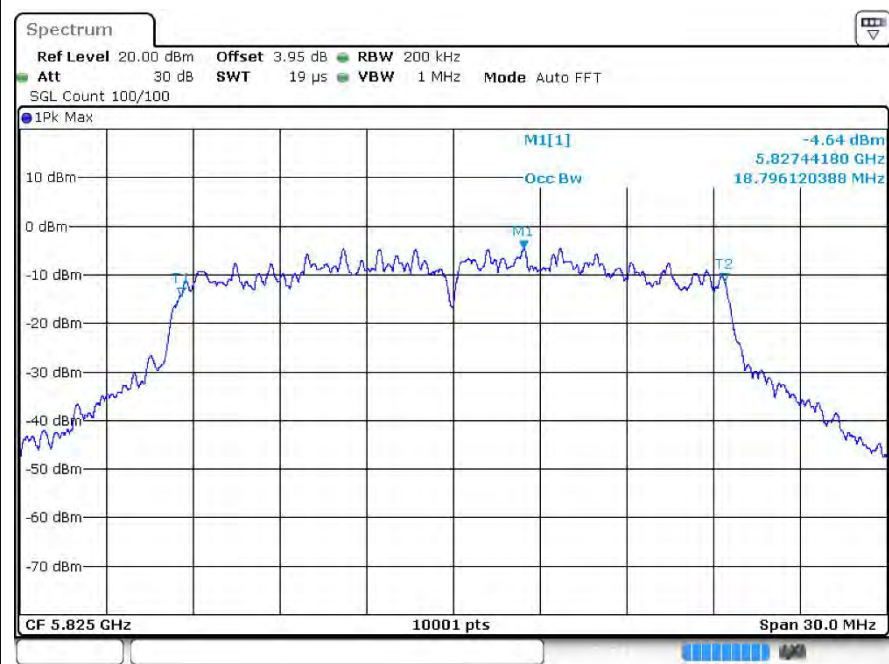


OBW ax40 5755MHz Ant1



OBW ax40 5795MHz Ant1

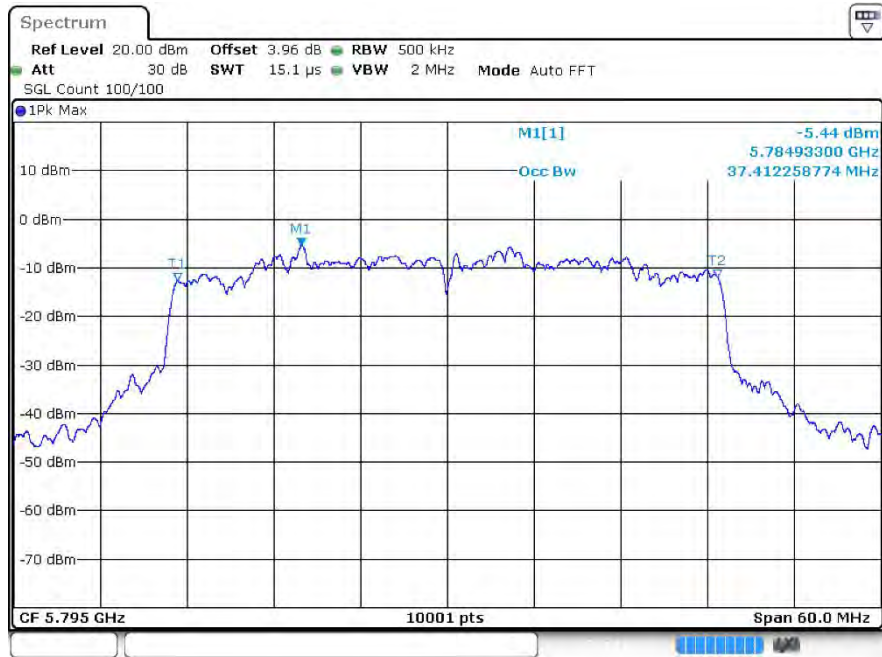

OBW ax80 5775MHz Ant1

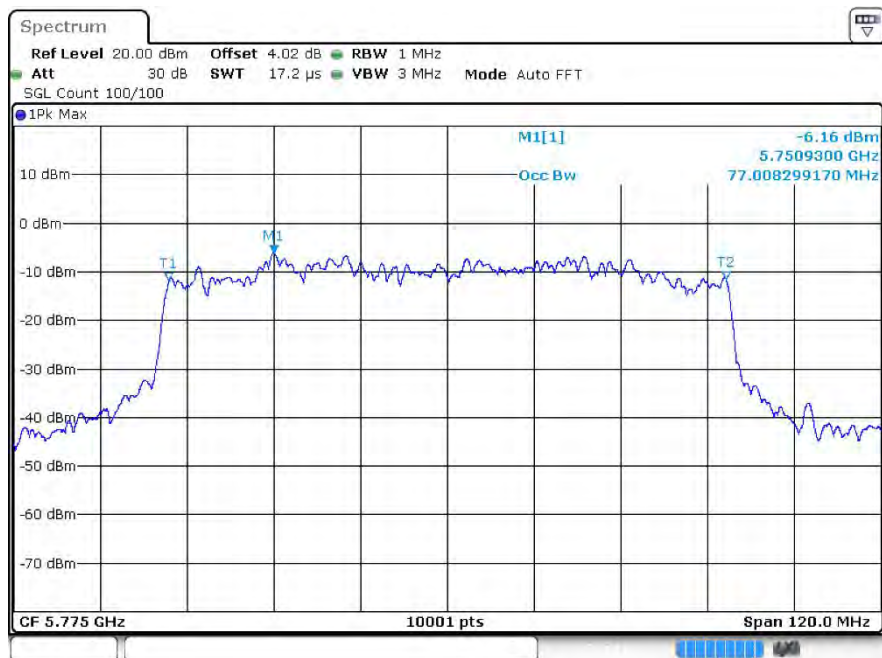



5 Maximum Power Spectral Density Level

5.1 Test Result

Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
a	5745	Ant0	-4.69	0.61	-4.08	30	Pass
a	5785	Ant0	-5.5	0.6	-4.9	30	Pass
a	5825	Ant0	-5.55	0.6	-4.95	30	Pass
a	5745	Ant1	-6.65	0.6	-6.05	30	Pass
a	5785	Ant1	-8.53	0.6	-7.93	30	Pass
a	5825	Ant1	-6.65	0.6	-6.05	30	Pass
n20	5745	Ant0	-6.42	0.31	-6.11	30	Pass
n20	5745	Ant1	-8.7	0.31	-8.39	30	Pass
n20	5745	Sum	-	-	-4.09	27.49	Pass
n20	5785	Ant0	-9.47	0.31	-9.16	30	Pass
n20	5785	Ant1	-9.68	0.31	-9.37	30	Pass
n20	5785	Sum	-	-	-6.25	27.49	Pass
n20	5825	Ant0	-8.27	0.32	-7.95	30	Pass
n20	5825	Ant1	-8.06	0.31	-7.75	30	Pass
n20	5825	Sum	-	-	-4.84	27.49	Pass
n40	5755	Ant0	-11.68	0.32	-11.36	30	Pass
n40	5755	Ant1	-13.61	0.33	-13.28	30	Pass
n40	5755	Sum	-	-	-9.20	27.49	Pass
n40	5795	Ant0	-12.01	0.32	-11.69	30	Pass
n40	5795	Ant1	-13.16	0.35	-12.81	30	Pass
n40	5795	Sum	-	-	-9.20	27.49	Pass
ac20	5745	Ant0	-7.14	0.6	-6.54	30	Pass
ac20	5745	Ant1	-8.91	0.59	-8.32	30	Pass
ac20	5745	Sum	-	-	-5.45	27.49	Pass
ac20	5785	Ant0	-8.42	0.6	-7.82	30	Pass
ac20	5785	Ant1	-9.79	0.59	-9.2	30	Pass
ac20	5785	Sum	-	-	-5.45	27.49	Pass
ac20	5825	Ant0	-8.22	0.6	-7.62	30	Pass
ac20	5825	Ant1	-8.1	0.59	-7.51	30	Pass
ac20	5825	Sum	-	-	-4.55	27.49	Pass
ac40	5755	Ant0	-11.64	0.59	-11.05	30	Pass
ac40	5755	Ant1	-14.19	0.61	-13.58	30	Pass
ac40	5755	Sum	-	-	-9.12	27.49	Pass
ac40	5795	Ant0	-11.62	0.59	-11.03	30	Pass



ac40	5795	Ant1	-14.04	0.68	-13.36	30	Pass
ac40	5795	Sum	-	-	-9.03	27.49	Pass
ac80	5775	Ant0	-13.95	0.59	-13.36	30	Pass
ac80	5775	Ant1	-16.13	0.87	-15.26	30	Pass
ac80	5775	Sum	-	-	-11.20	27.49	Pass
ax20	5745	Ant0	-8.46	0.61	-7.85	30	Pass
ax20	5745	Ant1	-10.32	0.6	-9.72	30	Pass
ax20	5745	Sum	-	-	-5.67	27.49	Pass
ax20	5785	Ant0	-8.85	0.6	-8.25	30	Pass
ax20	5785	Ant1	-10.05	0.6	-9.45	30	Pass
ax20	5785	Sum	-	-	-5.80	27.49	Pass
ax20	5825	Ant0	-8.81	0.62	-8.19	30	Pass
ax20	5825	Ant1	-9.27	0.6	-8.67	30	Pass
ax20	5825	Sum	-	-	-5.41	27.49	Pass
ax40	5755	Ant0	-11.79	0.58	-11.21	30	Pass
ax40	5755	Ant1	-14.2	0.7	-13.5	30	Pass
ax40	5755	Sum	-	-	-9.20	27.49	Pass
ax40	5795	Ant0	-12.42	0.57	-11.85	30	Pass
ax40	5795	Ant1	-14.41	0.71	-13.7	30	Pass
ax40	5795	Sum	-	-	-9.67	27.49	Pass
ax80	5775	Ant0	-14.82	0.62	-14.2	30	Pass
ax80	5775	Ant1	-18.19	0.97	-17.22	30	Pass
ax80	5775	Sum	-	-	-12.44	27.49	Pass


Note:

For MIMO mode:

Directional gain= $10\log[(10^{G1/20}+10^{G2/20})^2/2]$ dB_i=8.51dB_i

Limit =30-(8.51-6)=27.49dBm for PSD

5.2 Test Graphs

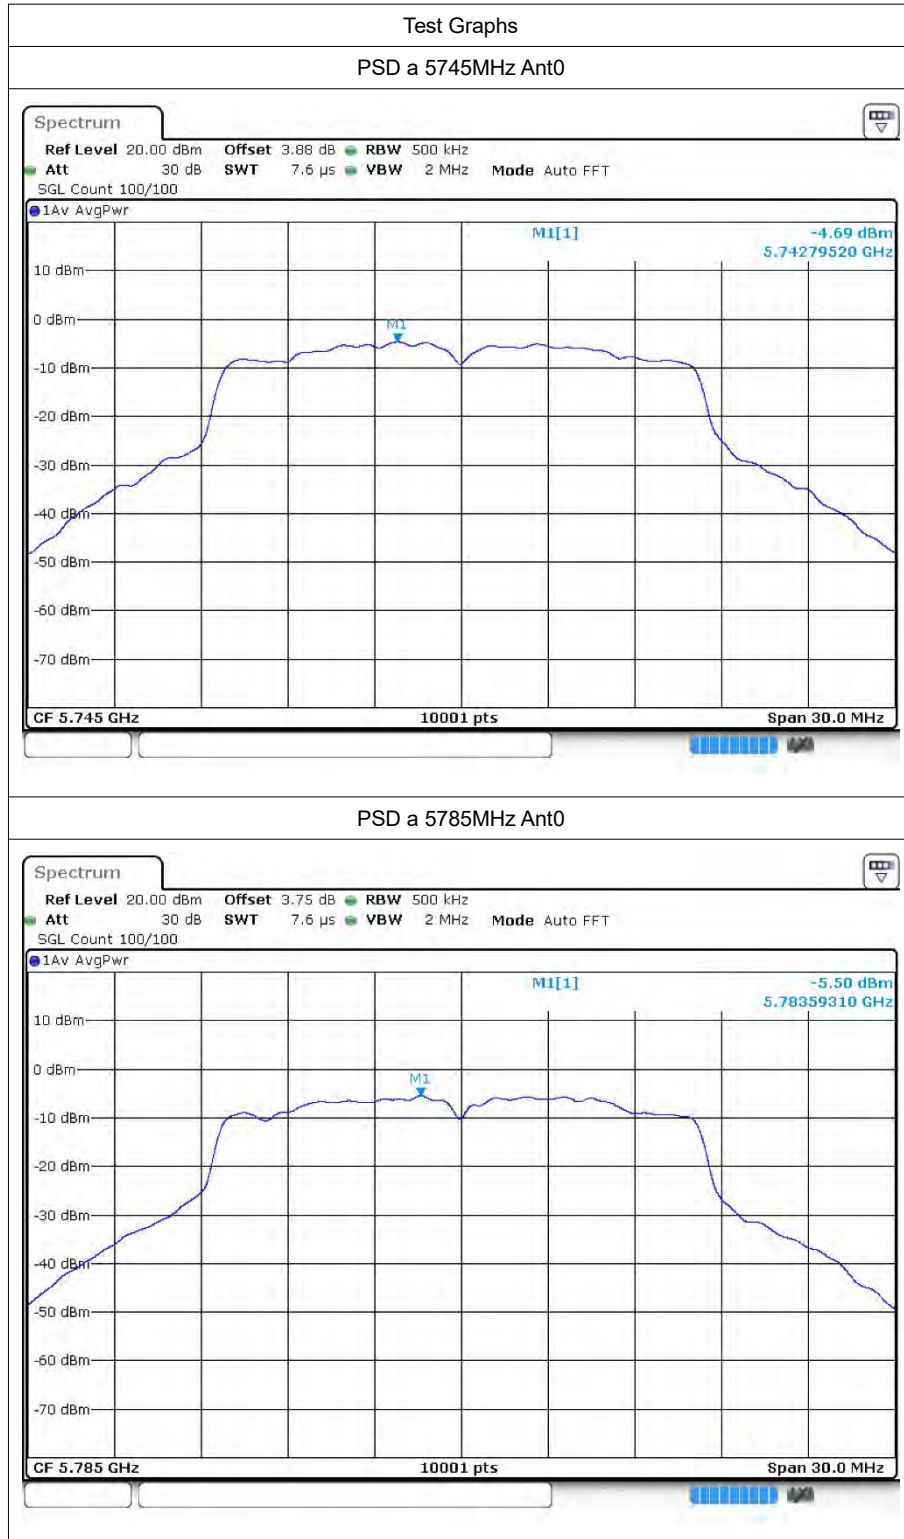


PSD a 5825MHz Ant0



PSD a 5745MHz Ant1



PSD a 5785MHz Ant1

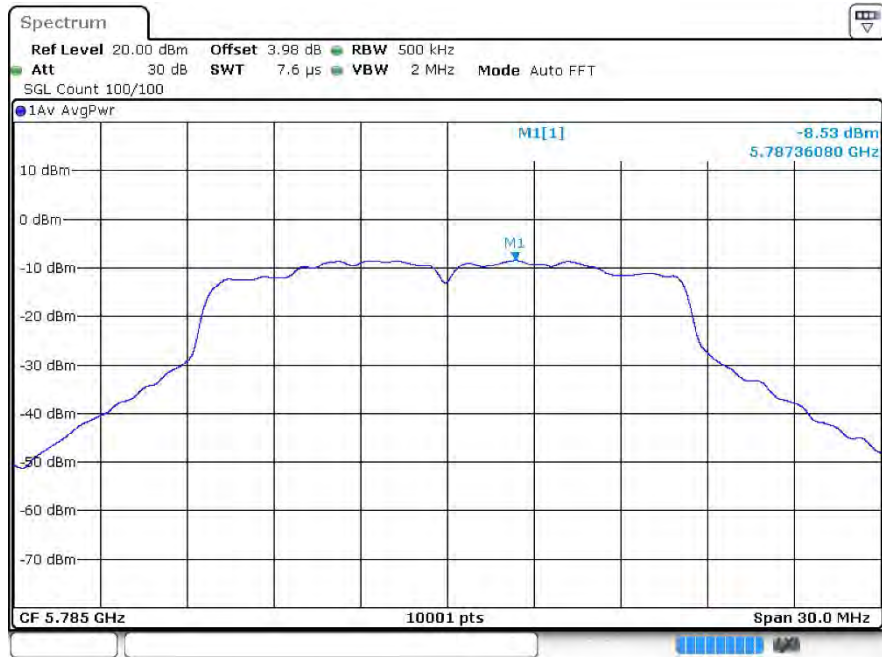

PSD a 5825MHz Ant1




PSD n20 5745MHz Ant0



PSD n20 5785MHz Ant0




PSD n20 5825MHz Ant0

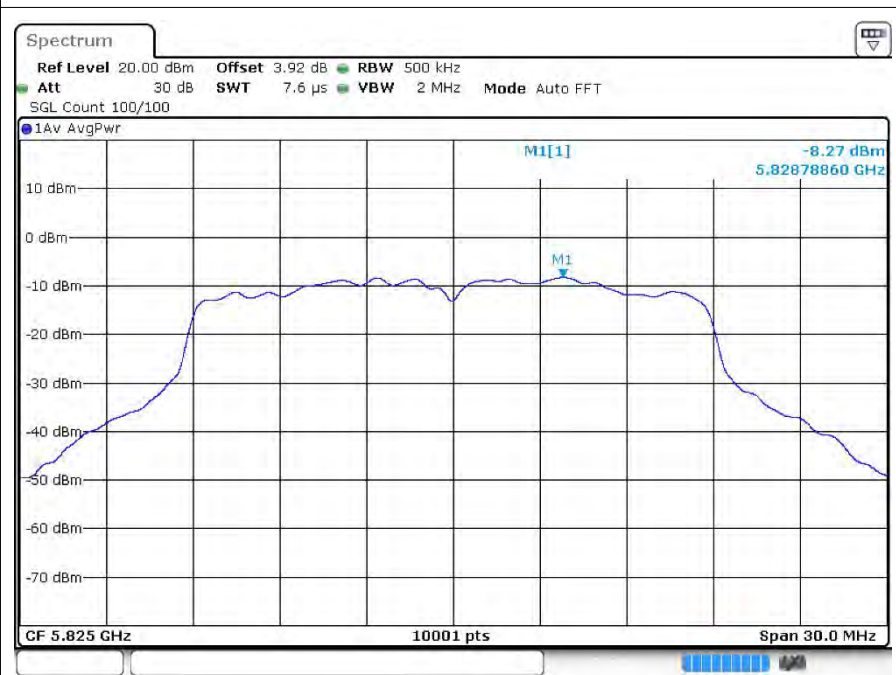


PSD n20 5745MHz Ant1




PSD n20 5785MHz Ant1

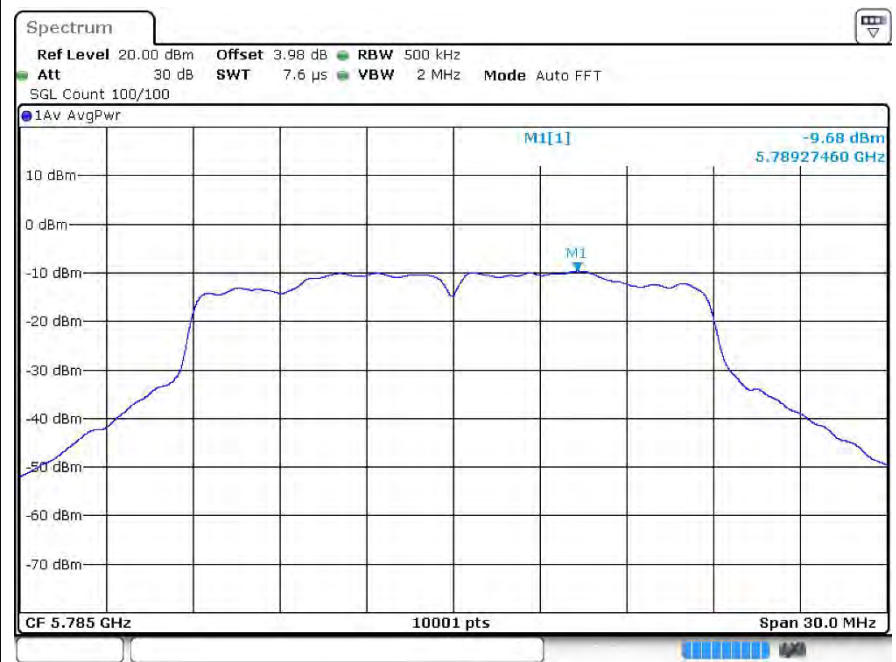


PSD n20 5825MHz Ant1

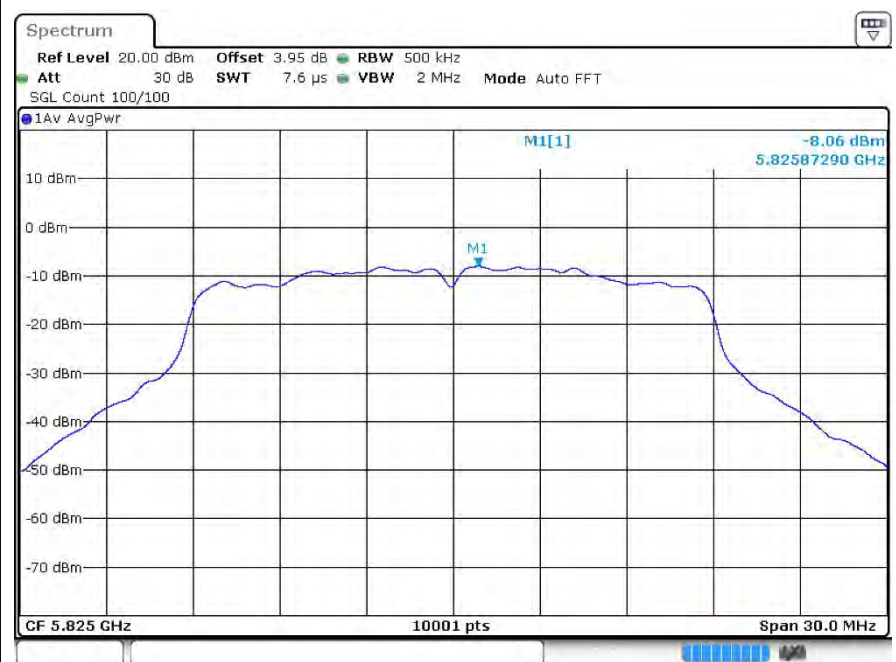


PSD n40 5755MHz Ant0

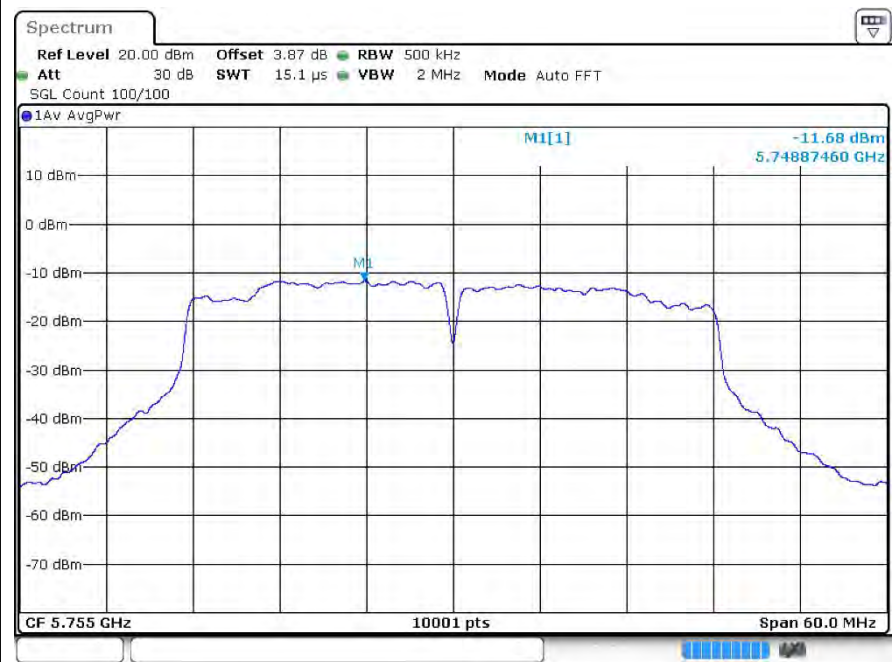


PSD n40 5795MHz Ant0

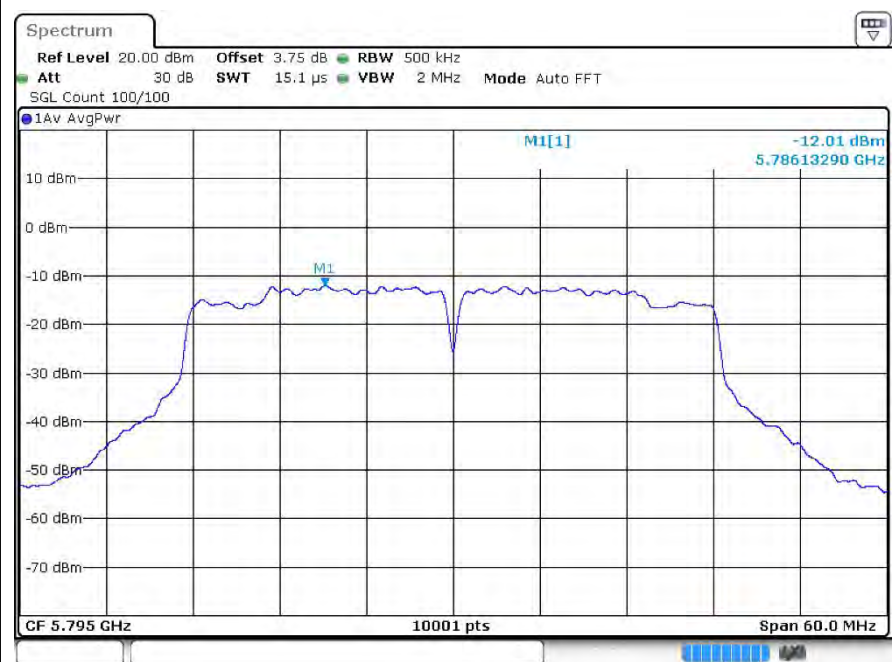


PSD n40 5755MHz Ant1

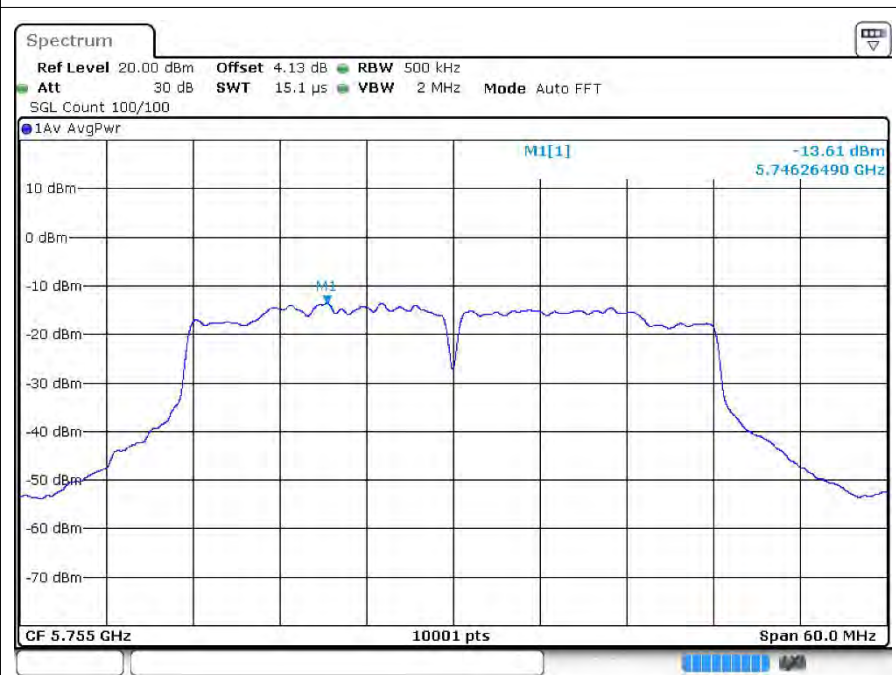


PSD n40 5795MHz Ant1

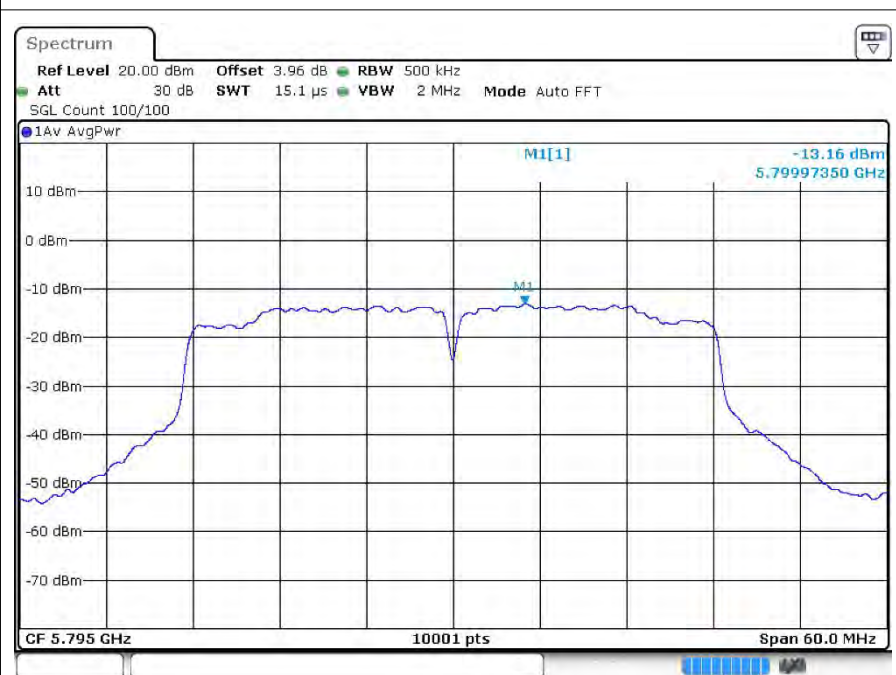


PSD ac20 5745MHz Ant0

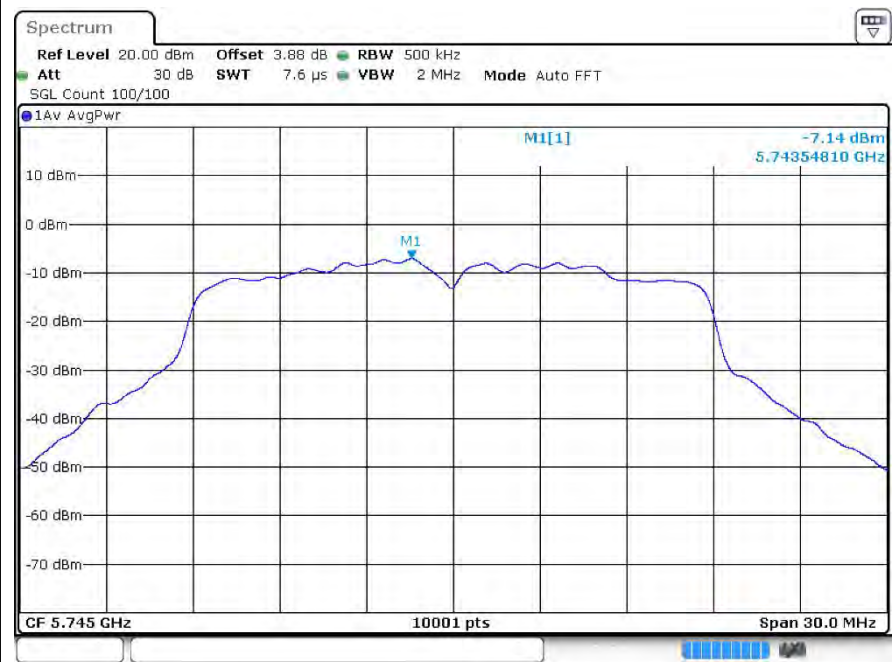


PSD ac20 5785MHz Ant0

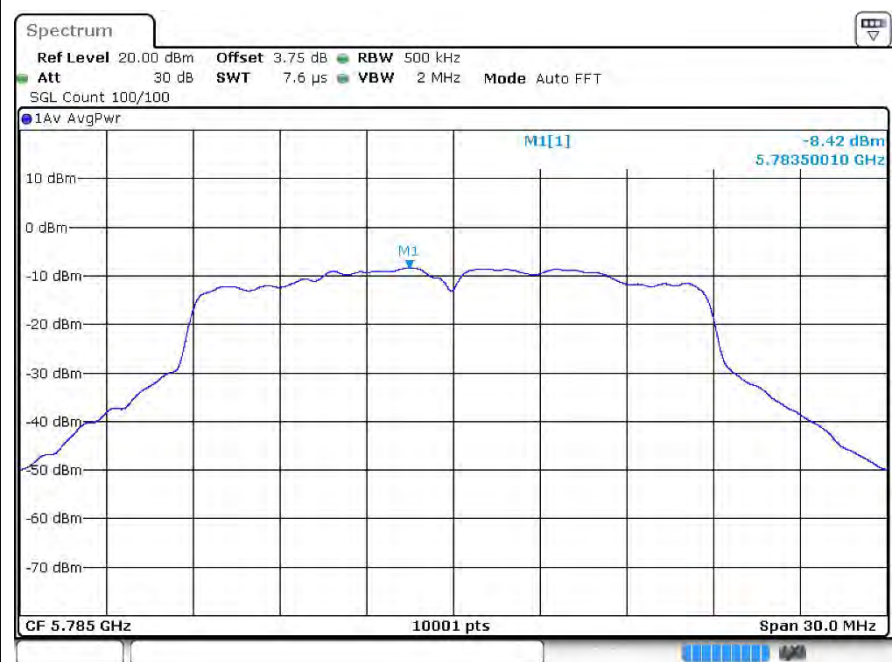


PSD ac20 5825MHz Ant0

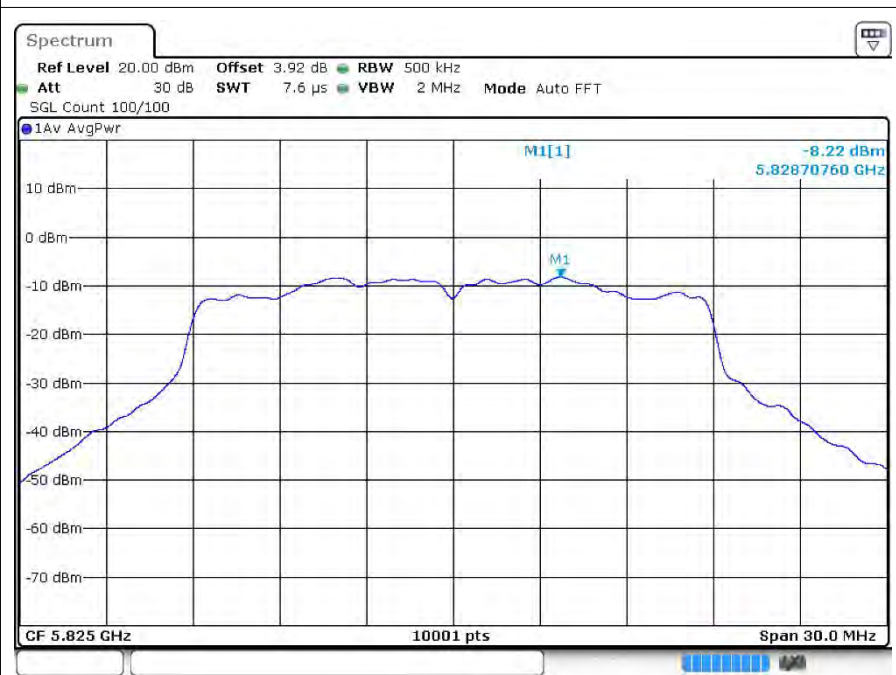

PSD ac20 5745MHz Ant1

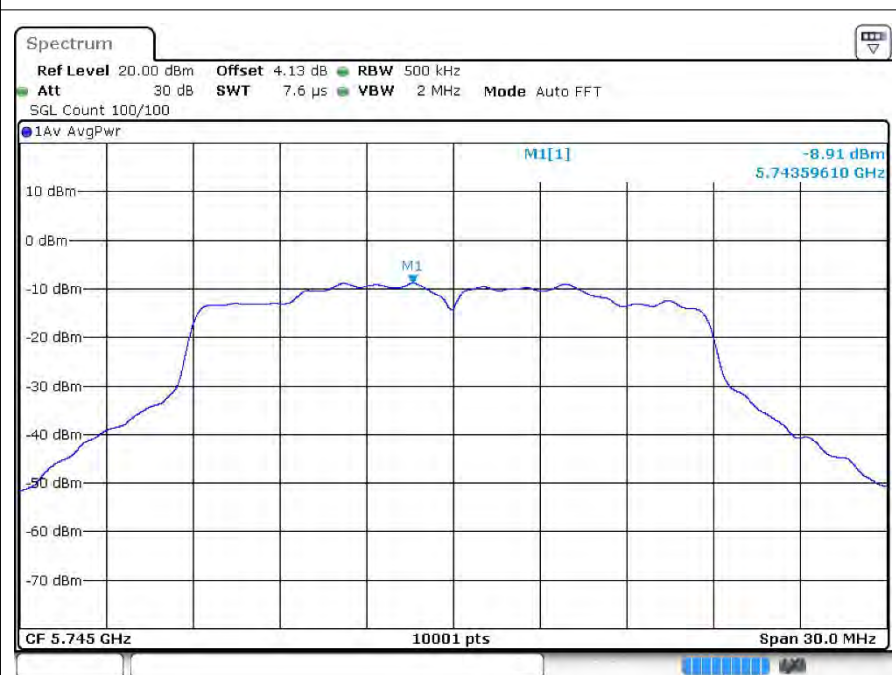


PSD ac20 5785MHz Ant1

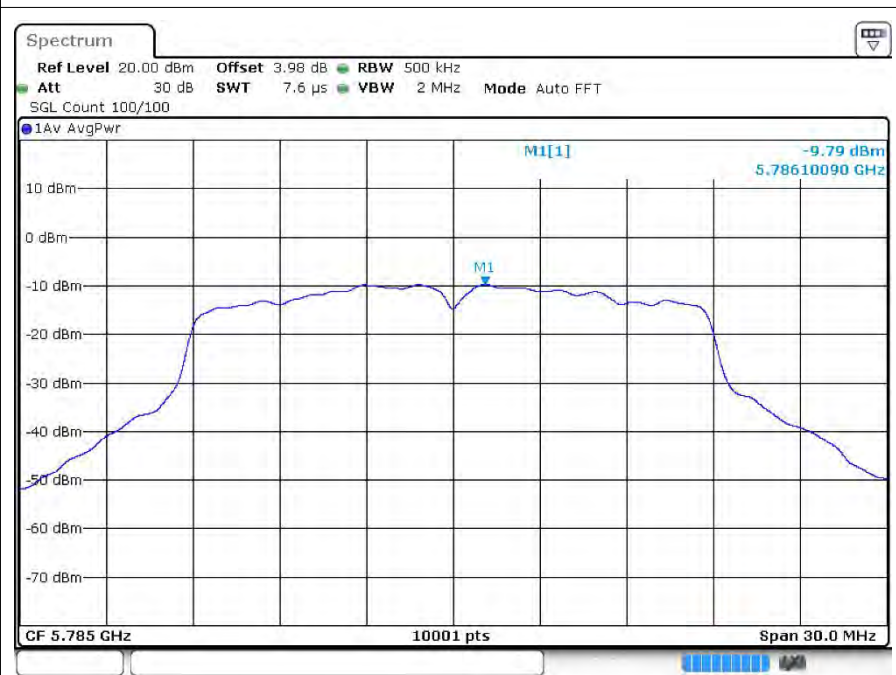


PSD ac20 5825MHz Ant1




PSD ac40 5755MHz Ant0

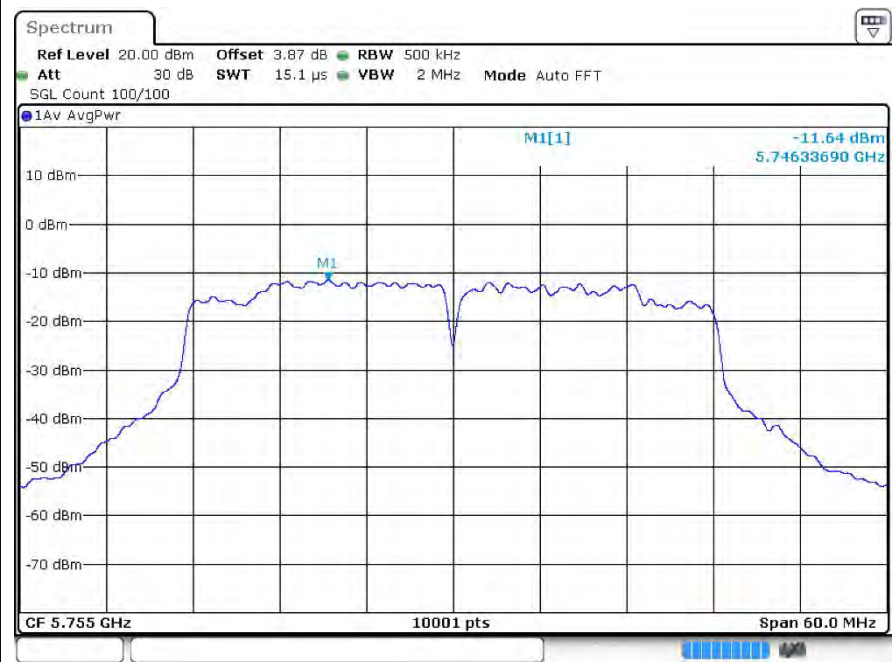


PSD ac40 5795MHz Ant0

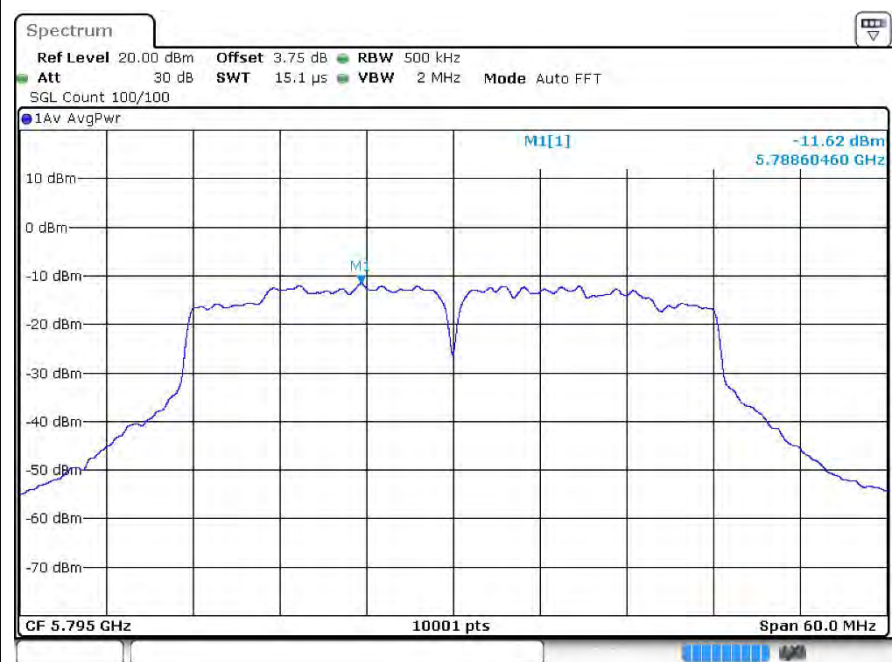


PSD ac40 5755MHz Ant1

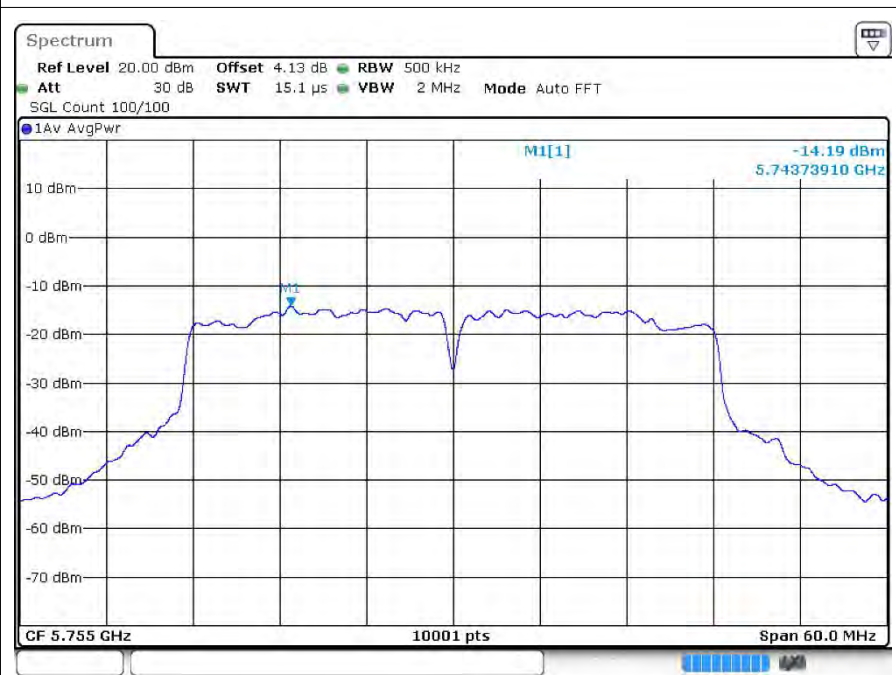


PSD ac40 5795MHz Ant1

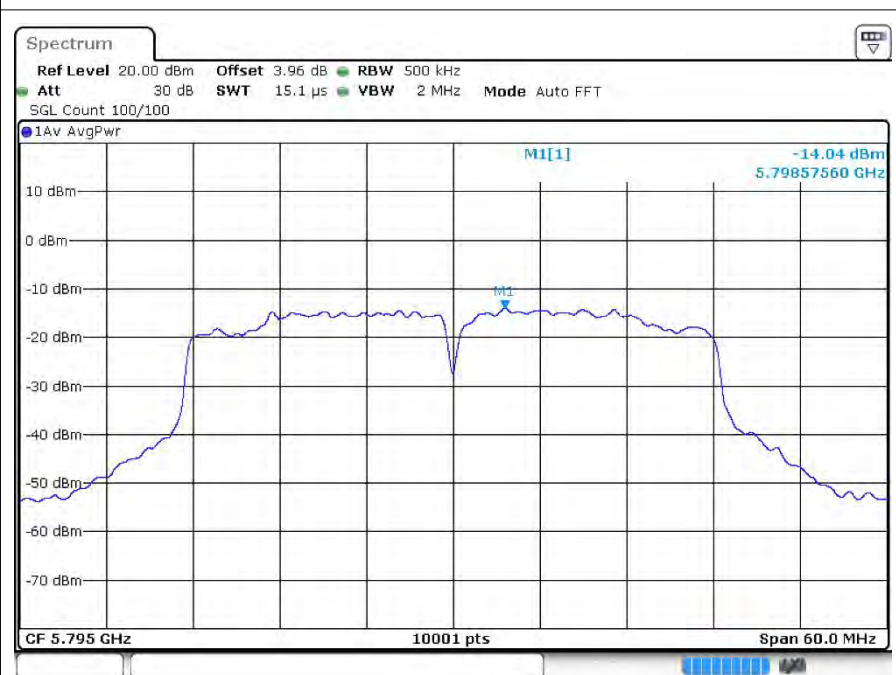


PSD ac80 5775MHz Ant0

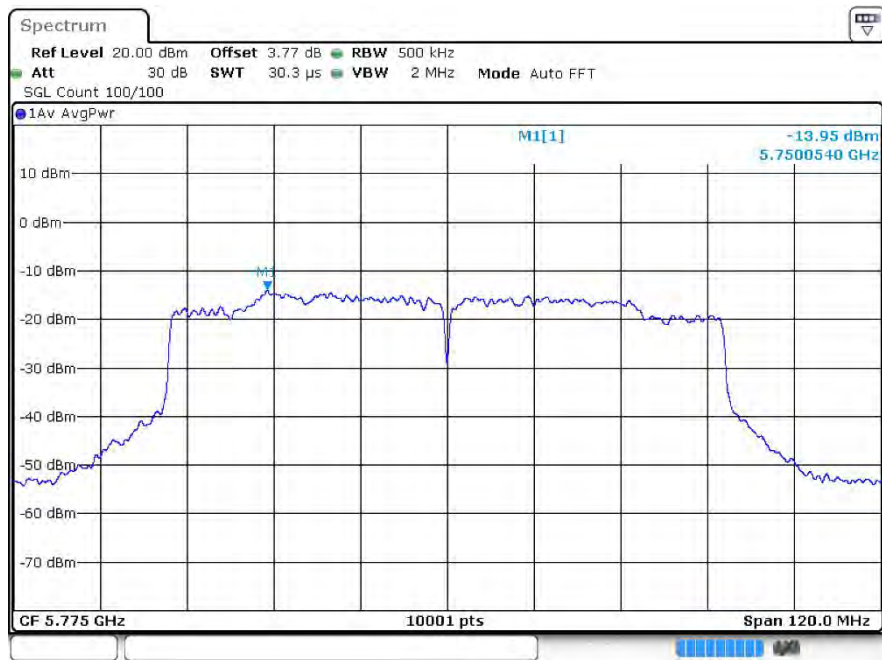

PSD ac80 5775MHz Ant1

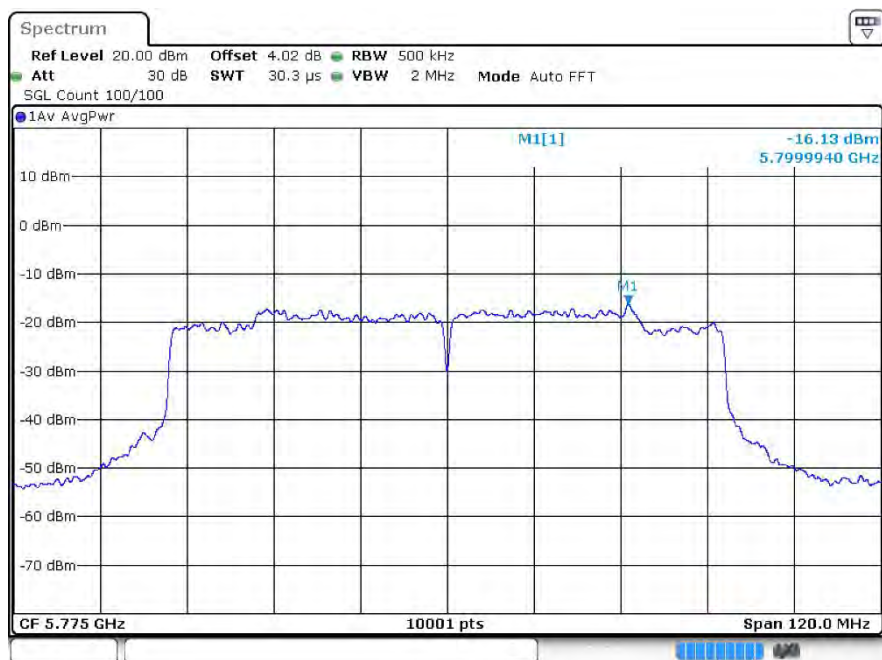

PSD ax20 5745MHz Ant0

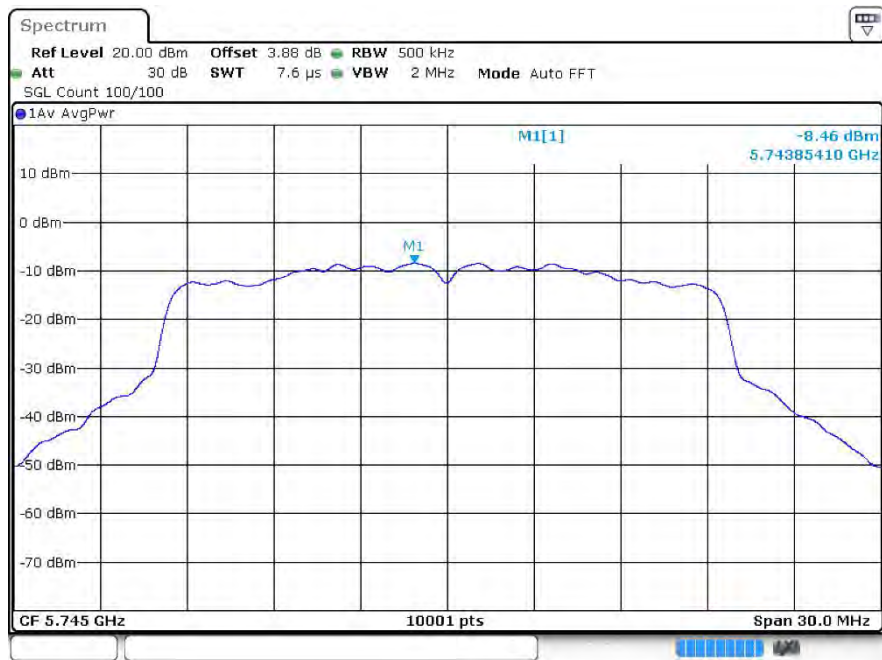


PSD ax20 5785MHz Ant0




PSD ax20 5825MHz Ant0




PSD ax20 5745MHz Ant1

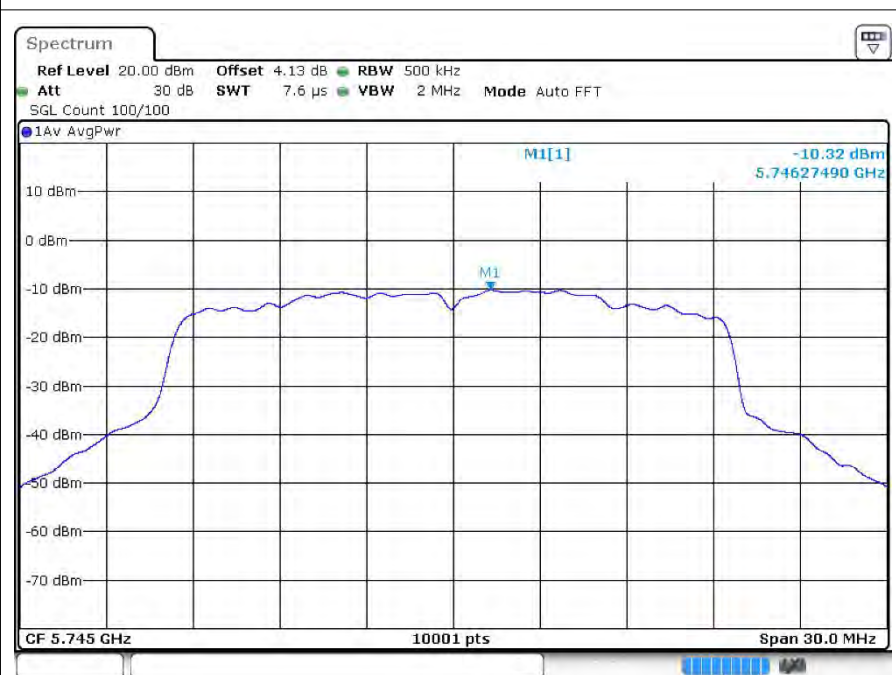


PSD ax20 5785MHz Ant1

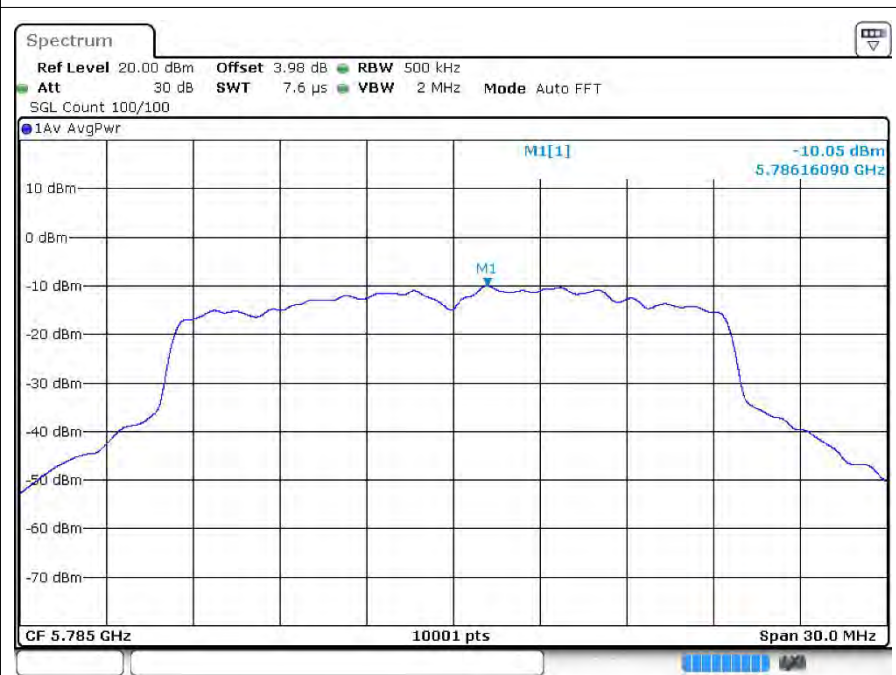


PSD ax20 5825MHz Ant1

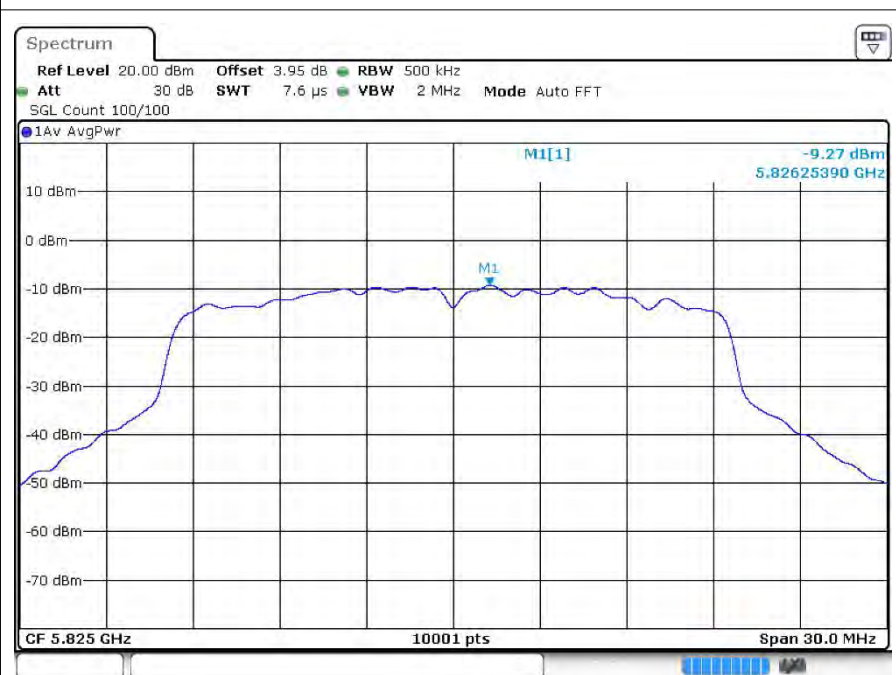


PSD ax40 5755MHz Ant0

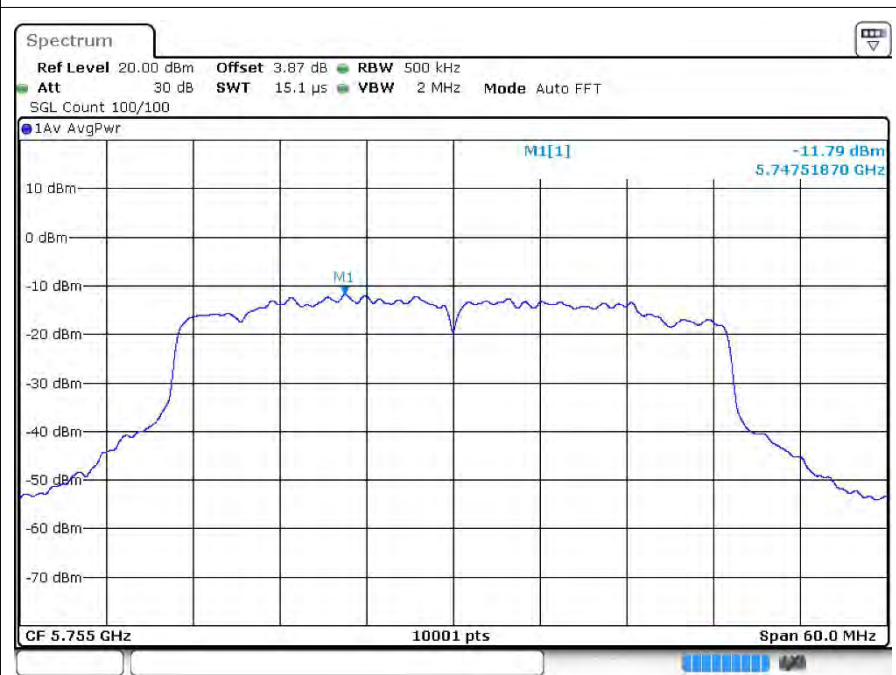


PSD ax40 5795MHz Ant0

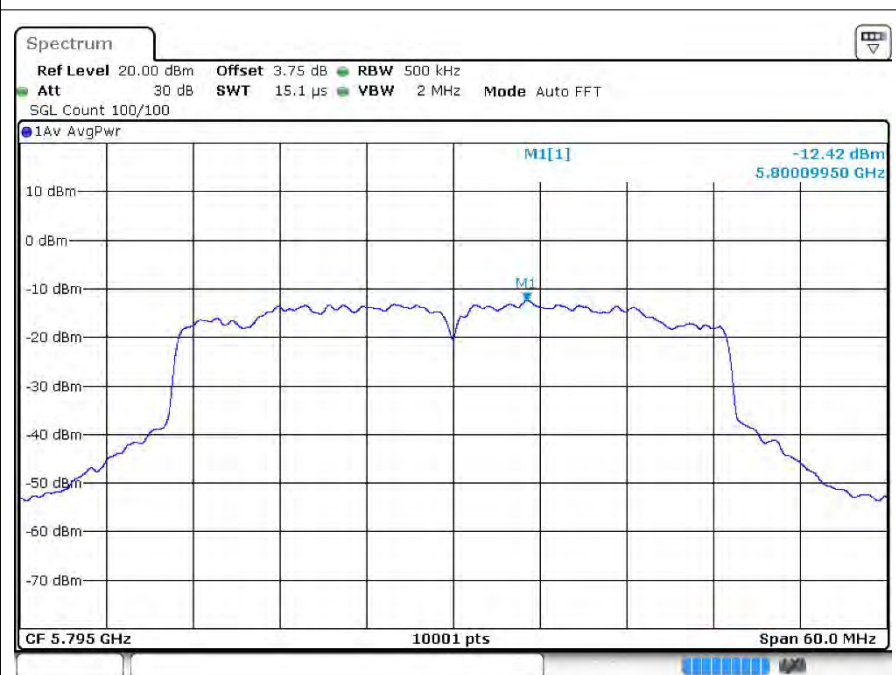


PSD ax40 5755MHz Ant1

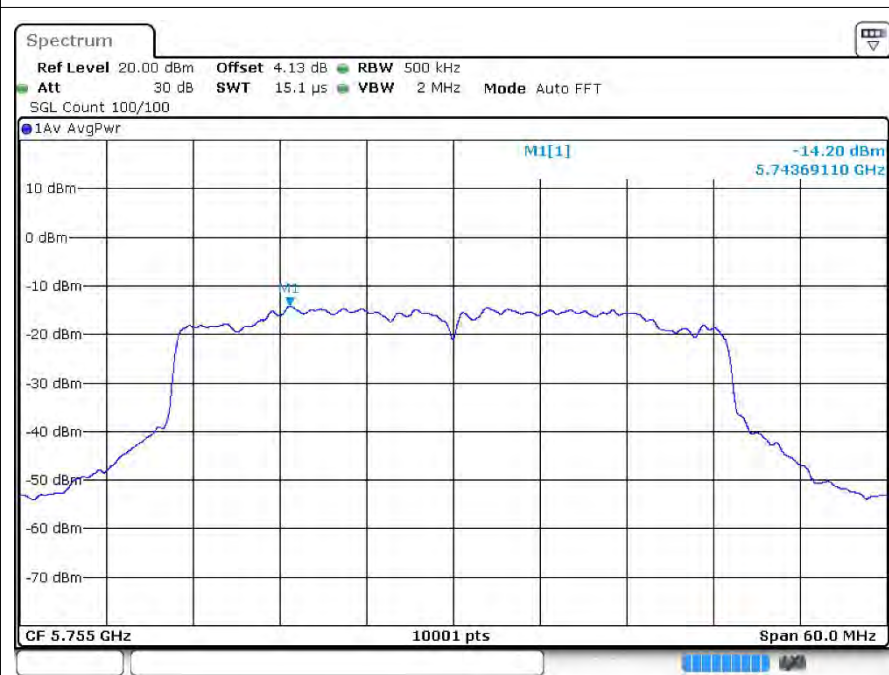


PSD ax40 5795MHz Ant1

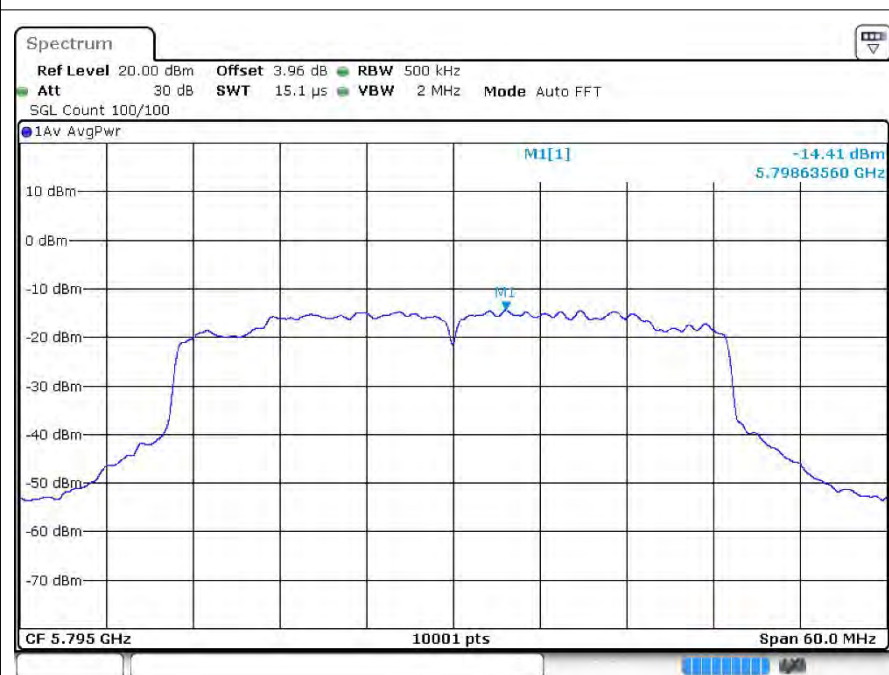

PSD ax80 5775MHz Ant0

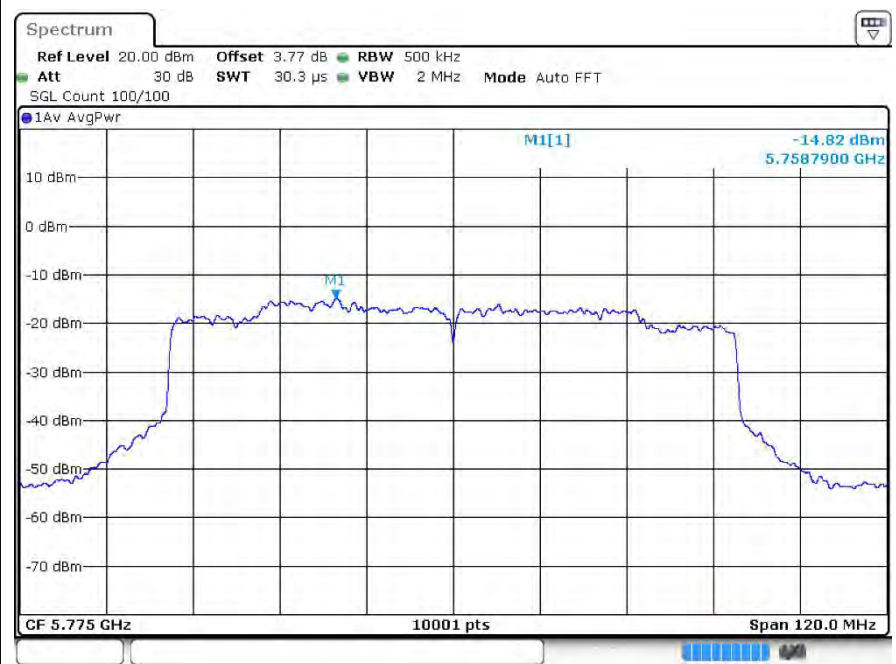

PSD ax80 5775MHz Ant1

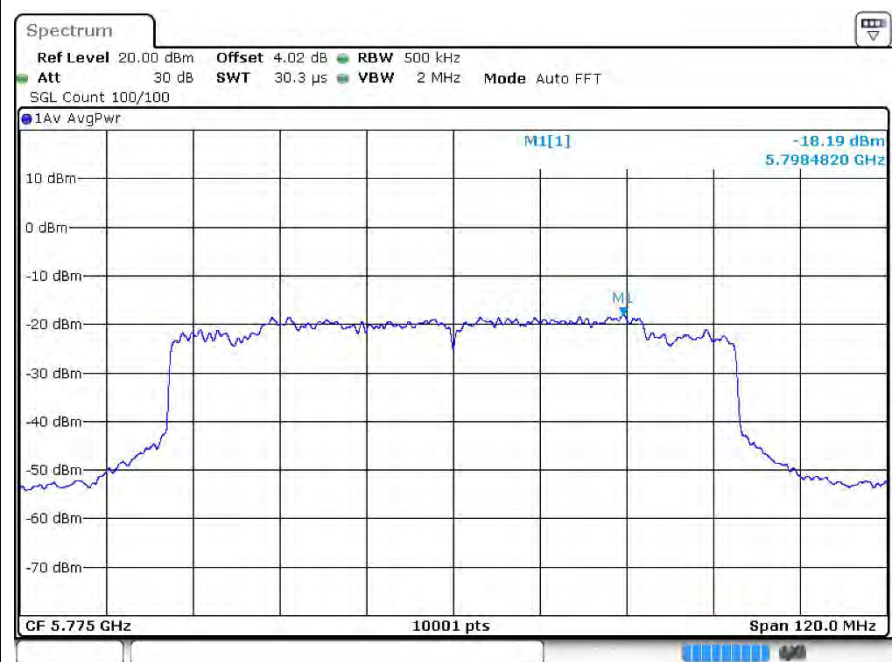



6 Frequency Stability

6.1 Test Result

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5745	Ant0	5744.92	-80000	-13.93	25	Pass
20C 120V	a	5745	Ant0	5744.92	-80000	-13.93	25	Pass
20C 138V	a	5745	Ant0	5744.94	-60000	-10.44	25	Pass
-20C 120V	a	5745	Ant0	5744.96	-40000	-6.96	25	Pass
-10C 120V	a	5745	Ant0	5744.96	-40000	-6.96	25	Pass
0C 120V	a	5745	Ant0	5744.92	-80000	-13.93	25	Pass
10C 120V	a	5745	Ant0	5744.9	-100000	-17.41	25	Pass
30C 120V	a	5745	Ant0	5744.92	-80000	-13.93	25	Pass
40C 120V	a	5745	Ant0	5744.94	-60000	-10.44	25	Pass
50C 120V	a	5745	Ant0	5744.94	-60000	-10.44	25	Pass
20C 102V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
20C 120V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
20C 138V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
-20C 120V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
-10C 120V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
0C 120V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
10C 120V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
30C 120V	a	5785	Ant0	5784.94	-60000	-10.37	25	Pass
40C 120V	a	5785	Ant0	5784.92	-80000	-13.83	25	Pass
50C 120V	a	5785	Ant0	5784.96	-40000	-6.91	25	Pass
20C 102V	a	5825	Ant0	5824.96	-40000	-6.87	25	Pass
20C 120V	a	5825	Ant0	5824.94	-60000	-10.3	25	Pass
20C 138V	a	5825	Ant0	5824.94	-60000	-10.3	25	Pass
-20C 120V	a	5825	Ant0	5824.96	-40000	-6.87	25	Pass
-10C 120V	a	5825	Ant0	5824.94	-60000	-10.3	25	Pass
0C 120V	a	5825	Ant0	5824.94	-60000	-10.3	25	Pass
10C 120V	a	5825	Ant0	5824.94	-60000	-10.3	25	Pass
30C 120V	a	5825	Ant0	5824.94	-60000	-10.3	25	Pass
40C 120V	a	5825	Ant0	5824.94	-60000	-10.3	25	Pass
50C 120V	a	5825	Ant0	5824.96	-40000	-6.87	25	Pass
20C 102V	n20	5745	Ant0	5744.96	-40000	-6.96	25	Pass
20C 120V	n20	5745	Ant0	5744.98	-20000	-3.48	25	Pass
20C 138V	n20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
-20C 120V	n20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
-10C 120V	n20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
0C 120V	n20	5745	Ant0	5744.92	-80000	-13.93	25	Pass



10C 120V	n20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
30C 120V	n20	5745	Ant0	5744.86	-140000	-24.37	25	Pass
40C 120V	n20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
50C 120V	n20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
20C 102V	n20	5785	Ant0	5784.98	-20000	-3.46	25	Pass
20C 120V	n20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
20C 138V	n20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
-20C 120V	n20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
-10C 120V	n20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
0C 120V	n20	5785	Ant0	5784.92	-80000	-13.83	25	Pass
10C 120V	n20	5785	Ant0	5784.92	-80000	-13.83	25	Pass
30C 120V	n20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
40C 120V	n20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
50C 120V	n20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
20C 102V	n20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
20C 120V	n20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
20C 138V	n20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
-20C 120V	n20	5825	Ant0	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	Ant0	5824.92	-80000	-13.73	25	Pass
0C 120V	n20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
10C 120V	n20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
30C 120V	n20	5825	Ant0	5824.92	-80000	-13.73	25	Pass
40C 120V	n20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
50C 120V	n20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
20C 102V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
20C 120V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
20C 138V	n40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
-20C 120V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
-10C 120V	n40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
0C 120V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
10C 120V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
30C 120V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
40C 120V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
50C 120V	n40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
20C 102V	n40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	5795	Ant0	5794.88	-120000	-20.71	25	Pass
20C 138V	n40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
-20C 120V	n40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
-10C 120V	n40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
0C 120V	n40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
10C 120V	n40	5795	Ant0	5795	0	0	25	Pass
30C 120V	n40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
40C 120V	n40	5795	Ant0	5794.92	-80000	-13.81	25	Pass



50C 120V	n40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
20C 102V	ac20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
20C 120V	ac20	5745	Ant0	5744.88	-120000	-20.89	25	Pass
20C 138V	ac20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
-20C 120V	ac20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
-10C 120V	ac20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
0C 120V	ac20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
10C 120V	ac20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
30C 120V	ac20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
40C 120V	ac20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
50C 120V	ac20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
20C 102V	ac20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
20C 120V	ac20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
20C 138V	ac20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
-20C 120V	ac20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
-10C 120V	ac20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
0C 120V	ac20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
10C 120V	ac20	5785	Ant0	5784.98	-20000	-3.46	25	Pass
30C 120V	ac20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
40C 120V	ac20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
50C 120V	ac20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
20C 102V	ac20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
20C 120V	ac20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
20C 138V	ac20	5825	Ant0	5824.92	-80000	-13.73	25	Pass
-20C 120V	ac20	5825	Ant0	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	Ant0	5824.92	-80000	-13.73	25	Pass
0C 120V	ac20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
10C 120V	ac20	5825	Ant0	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
40C 120V	ac20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
50C 120V	ac20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
20C 102V	ac40	5755	Ant0	5754.88	-120000	-20.85	25	Pass
20C 120V	ac40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
-20C 120V	ac40	5755	Ant0	5754.88	-120000	-20.85	25	Pass
-10C 120V	ac40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
0C 120V	ac40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
10C 120V	ac40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
30C 120V	ac40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
40C 120V	ac40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
50C 120V	ac40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
20C 102V	ac40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
20C 120V	ac40	5795	Ant0	5794.92	-80000	-13.81	25	Pass



20C 138V	ac40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
-20C 120V	ac40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
-10C 120V	ac40	5795	Ant0	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
30C 120V	ac40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
40C 120V	ac40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
50C 120V	ac40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
20C 102V	ac80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
20C 120V	ac80	5775	Ant0	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant0	5774.76	-240000	-41.56	25	Pass
-20C 120V	ac80	5775	Ant0	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
0C 120V	ac80	5775	Ant0	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant0	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant0	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
50C 120V	ac80	5775	Ant0	5775	0	0	25	Pass
20C 102V	ax20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
20C 120V	ax20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
20C 138V	ax20	5745	Ant0	5744.92	-80000	-13.93	25	Pass
-20C 120V	ax20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
-10C 120V	ax20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
0C 120V	ax20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
10C 120V	ax20	5745	Ant0	5744.96	-40000	-6.96	25	Pass
30C 120V	ax20	5745	Ant0	5744.96	-40000	-6.96	25	Pass
40C 120V	ax20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
50C 120V	ax20	5745	Ant0	5744.94	-60000	-10.44	25	Pass
20C 102V	ax20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
20C 120V	ax20	5785	Ant0	5784.88	-120000	-20.74	25	Pass
20C 138V	ax20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
-20C 120V	ax20	5785	Ant0	5784.92	-80000	-13.83	25	Pass
-10C 120V	ax20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
0C 120V	ax20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
10C 120V	ax20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
30C 120V	ax20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
40C 120V	ax20	5785	Ant0	5784.92	-80000	-13.83	25	Pass
50C 120V	ax20	5785	Ant0	5784.94	-60000	-10.37	25	Pass
20C 102V	ax20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
20C 120V	ax20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
20C 138V	ax20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
-20C 120V	ax20	5825	Ant0	5825.1	100000	17.17	25	Pass
-10C 120V	ax20	5825	Ant0	5824.96	-40000	-6.87	25	Pass



0C 120V	ax20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
10C 120V	ax20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
30C 120V	ax20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
40C 120V	ax20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
50C 120V	ax20	5825	Ant0	5824.94	-60000	-10.3	25	Pass
20C 102V	ax40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
20C 120V	ax40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
20C 138V	ax40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
-20C 120V	ax40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
-10C 120V	ax40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
0C 120V	ax40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
10C 120V	ax40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
30C 120V	ax40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
40C 120V	ax40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
50C 120V	ax40	5755	Ant0	5754.92	-80000	-13.9	25	Pass
20C 102V	ax40	5795	Ant0	5794.88	-120000	-20.71	25	Pass
20C 120V	ax40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
20C 138V	ax40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
-20C 120V	ax40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
-10C 120V	ax40	5795	Ant0	5794.88	-120000	-20.71	25	Pass
0C 120V	ax40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
10C 120V	ax40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
30C 120V	ax40	5795	Ant0	5795	0	0	25	Pass
40C 120V	ax40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
50C 120V	ax40	5795	Ant0	5795	0	0	25	Pass
20C 102V	ax80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
20C 120V	ax80	5775	Ant0	5774.84	-160000	-27.71	25	Pass
20C 138V	ax80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
-20C 120V	ax80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
-10C 120V	ax80	5775	Ant0	5774.84	-160000	-27.71	25	Pass
0C 120V	ax80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
10C 120V	ax80	5775	Ant0	5774.84	-160000	-27.71	25	Pass
30C 120V	ax80	5775	Ant0	5774.84	-160000	-27.71	25	Pass
40C 120V	ax80	5775	Ant0	5774.76	-240000	-41.56	25	Pass
50C 120V	ax80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
20C 102V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 138V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-20C 120V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-10C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
0C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
10C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
30C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass



40C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
50C 120V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 102V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 120V	a	5785	Ant1	5784.92	-80000	-13.83	25	Pass
20C 138V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-10C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
30C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
40C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	a	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 138V	a	5825	Ant1	5824.9	-100000	-17.17	25	Pass
-20C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-10C 120V	a	5825	Ant1	5824.92	-80000	-13.73	25	Pass
0C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	a	5825	Ant1	5824.92	-80000	-13.73	25	Pass
50C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 102V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-20C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-10C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
0C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
10C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
30C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
40C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
50C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 102V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 138V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-20C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-10C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
30C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
40C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	n20	5825	Ant1	5824.92	-80000	-13.73	25	Pass



20C 120V	n20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 138V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-10C 120V	n20	5825	Ant1	5824.9	-100000	-17.17	25	Pass
0C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
30C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
40C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 138V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-20C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-10C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
0C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
10C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
30C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
50C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 102V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 138V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
-10C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
0C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
50C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-20C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-10C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
10C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
30C 120V	ac20	5745	Ant1	5744.9	-100000	-17.41	25	Pass
40C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
50C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 102V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-20C 120V	ac20	5785	Ant1	5784.92	-80000	-13.83	25	Pass



-10C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
0C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
30C 120V	ac20	5785	Ant1	5784.92	-80000	-13.83	25	Pass
40C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
50C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 102V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	ac20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
-10C 120V	ac20	5825	Ant1	5824.86	-140000	-24.03	25	Pass
0C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 102V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 138V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-10C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 102V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 138V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	ac40	5795	Ant1	5794.76	-240000	-41.42	25	Pass
0C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
30C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass
-20C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
0C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass



30C 120V	ac80	5775	Ant1	5774.76	-240000	-41.56	25	Pass
40C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
50C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 102V	ax20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	ax20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	ax20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-20C 120V	ax20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-10C 120V	ax20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
0C 120V	ax20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	ax20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
30C 120V	ax20	5745	Ant1	5744.9	-100000	-17.41	25	Pass
40C 120V	ax20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
50C 120V	ax20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 102V	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	ax20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	ax20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-20C 120V	ax20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-10C 120V	ax20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	ax20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	ax20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
30C 120V	ax20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
40C 120V	ax20	5785	Ant1	5785	0	0	25	Pass
50C 120V	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	ax20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 120V	ax20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	ax20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-20C 120V	ax20	5825	Ant1	5824.84	-160000	-27.47	25	Pass
-10C 120V	ax20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
10C 120V	ax20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
30C 120V	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
50C 120V	ax20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	ax40	5755	Ant1	5754.88	-120000	-20.85	25	Pass
20C 138V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
10C 120V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	ax40	5755	Ant1	5755	0	0	25	Pass



20C 102V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 138V	ax40	5795	Ant1	5795.04	40000	6.9	25	Pass
-20C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
10C 120V	ax40	5795	Ant1	5795.12	120000	20.71	25	Pass
30C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 120V	ax80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-20C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-10C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
0C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
10C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
30C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
40C 120V	ax80	5775	Ant1	5774.84	-160000	-27.71	25	Pass
50C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass



7 Conducted RF Spurious Emission


7.1 Test Result

Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
a	5745	Ant0	-31.43	-27	Pass
a	5785	Ant0	-32.05	-27	Pass
a	5825	Ant0	-31.51	-27	Pass
n20	5745	Ant0	-31.53	-27	Pass
n20	5785	Ant0	-31.81	-27	Pass
n20	5825	Ant0	-31.6	-27	Pass
n40	5755	Ant0	-31.43	-27	Pass
n40	5795	Ant0	-31.5	-27	Pass
ac20	5745	Ant0	-31.21	-27	Pass
ac20	5785	Ant0	-31.79	-27	Pass
ac20	5825	Ant0	-30.7	-27	Pass
ac40	5755	Ant0	-31.45	-27	Pass
ac40	5795	Ant0	-31.43	-27	Pass
ac80	5775	Ant0	-31.48	-27	Pass
ax20	5745	Ant0	-31.85	-27	Pass
ax20	5785	Ant0	-31.64	-27	Pass
ax20	5825	Ant0	-31.06	-27	Pass
ax40	5755	Ant0	-31.68	-27	Pass
ax40	5795	Ant0	-31.67	-27	Pass
ax80	5775	Ant0	-32.2	-27	Pass
a	5745	Ant1	-30.12	-27	Pass
a	5785	Ant1	-30.79	-27	Pass
a	5825	Ant1	-29.92	-27	Pass
n20	5745	Ant1	-31.23	-27	Pass
n20	5785	Ant1	-30.91	-27	Pass
n20	5825	Ant1	-30.76	-27	Pass
n40	5755	Ant1	-30.44	-27	Pass
n40	5795	Ant1	-30.07	-27	Pass
ac20	5745	Ant1	-30.02	-27	Pass
ac20	5785	Ant1	-30.48	-27	Pass
ac20	5825	Ant1	-30.65	-27	Pass
ac40	5755	Ant1	-30.39	-27	Pass
ac40	5795	Ant1	-31.01	-27	Pass
ac80	5775	Ant1	-30.83	-27	Pass
ax20	5745	Ant1	-29.9	-27	Pass
ax20	5785	Ant1	-30.63	-27	Pass
ax20	5825	Ant1	-29.76	-27	Pass




ax40	5755	Ant1	-30.31	-27	Pass
ax40	5795	Ant1	-29.39	-27	Pass
ax80	5775	Ant1	-30.41	-27	Pass


7.2 Test Graphs

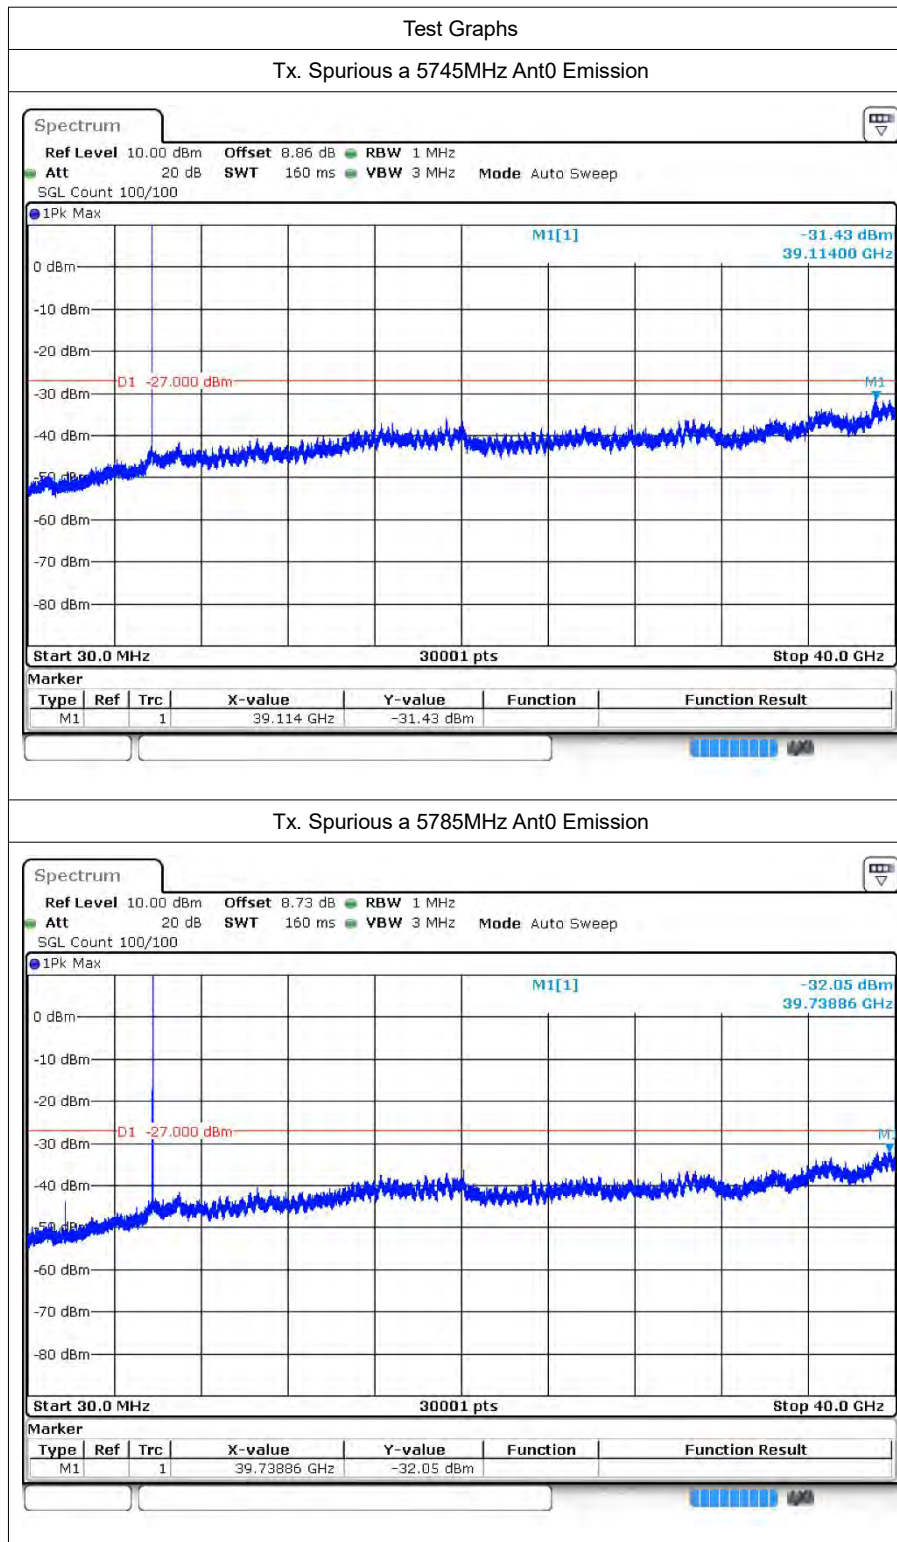


Tx. Spurious a 5825MHz Ant0 Emission

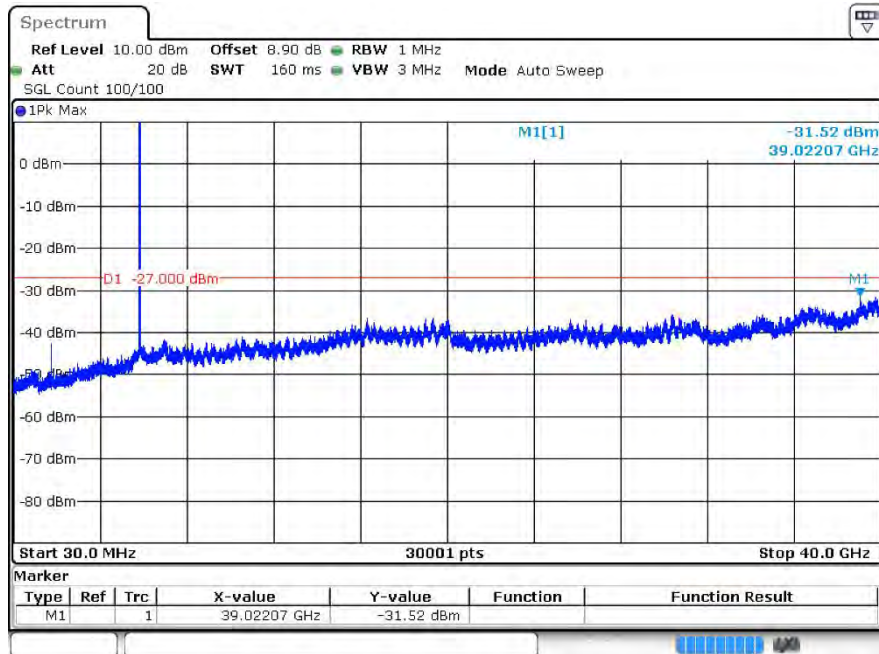


Tx. Spurious n20 5745MHz Ant0 Emission

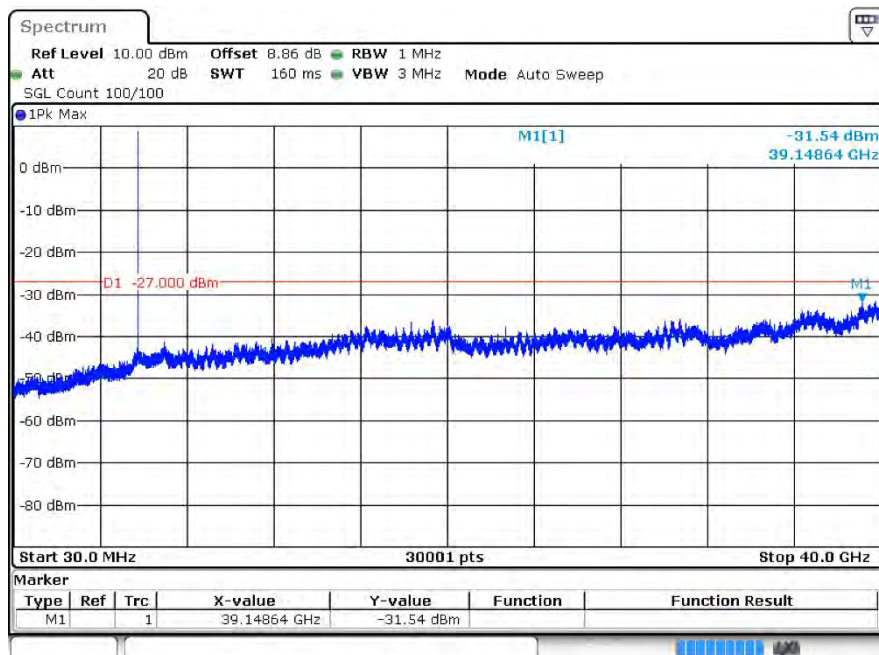


Tx. Spurious n20 5785MHz Ant0 Emission

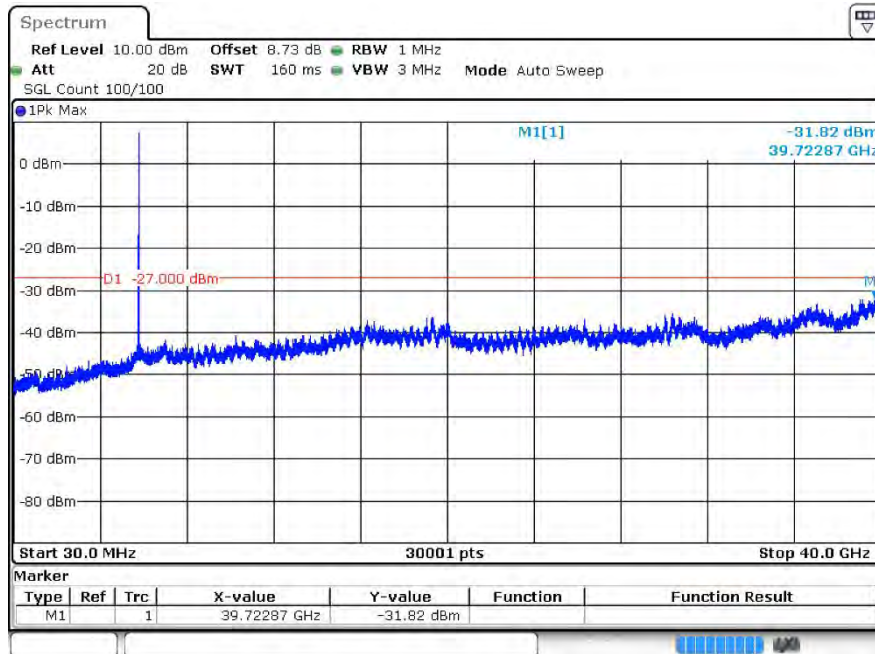


Tx. Spurious n20 5825MHz Ant0 Emission

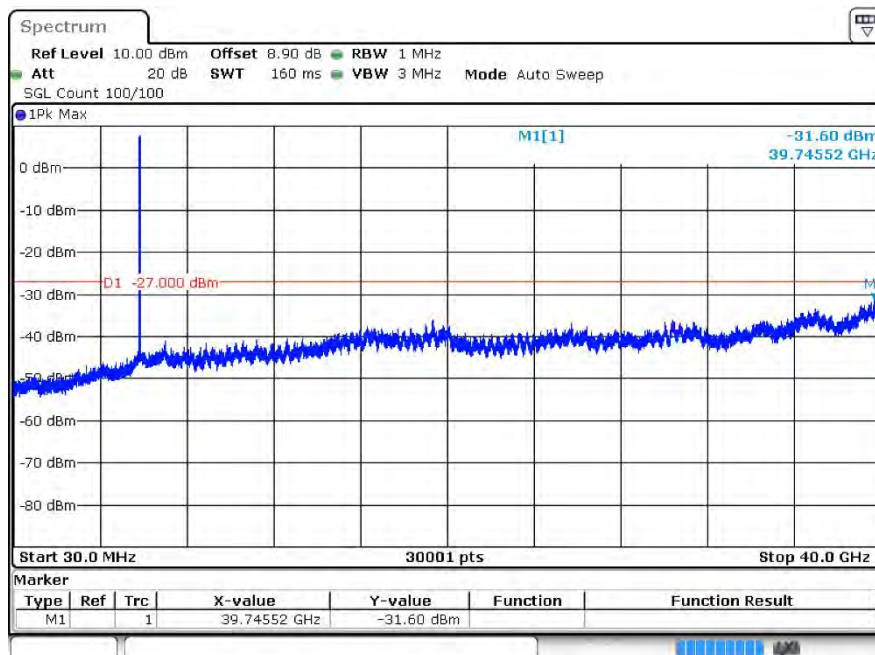


Tx. Spurious n40 5755MHz Ant0 Emission

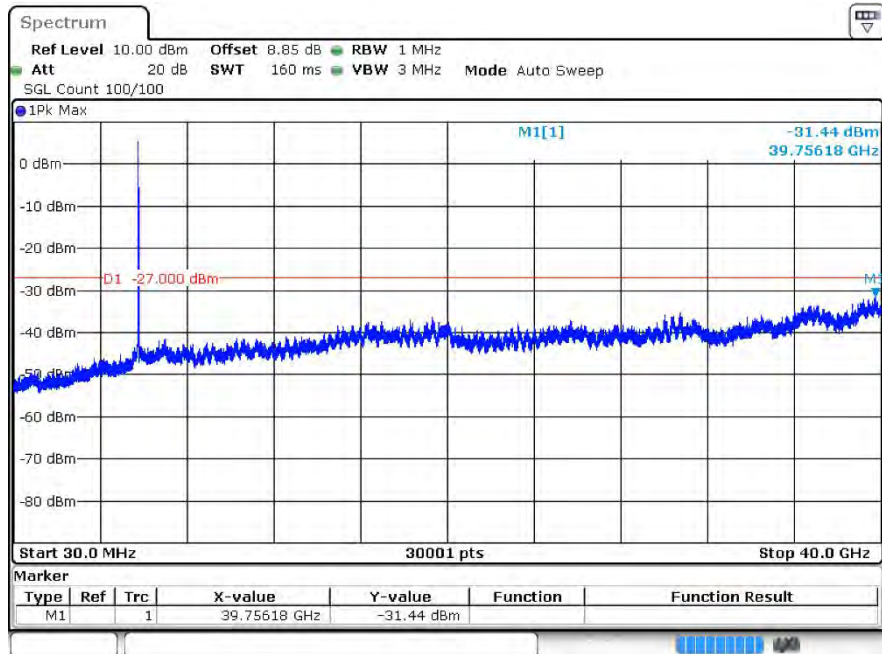


Tx. Spurious n40 5795MHz Ant0 Emission

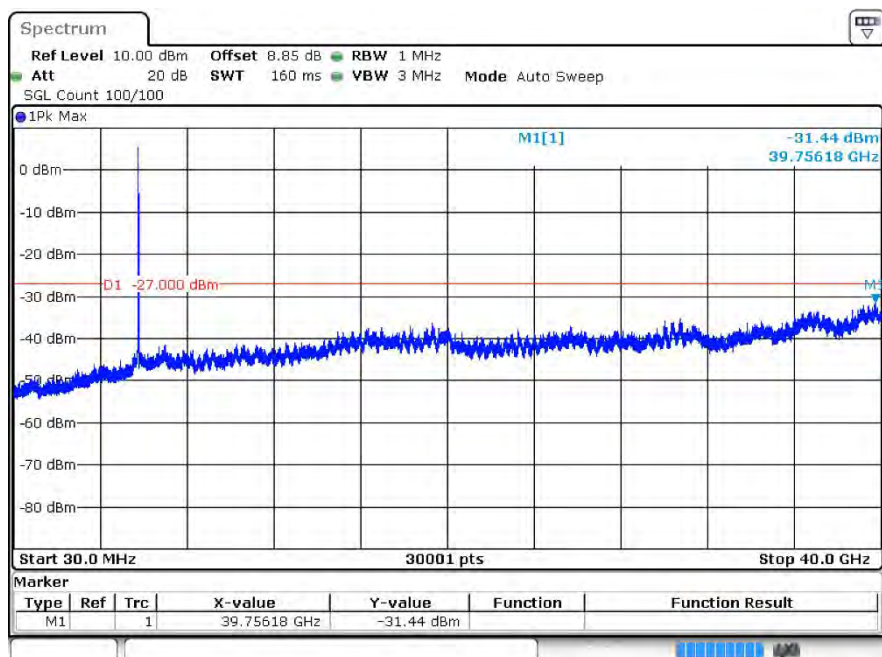


Tx. Spurious ac20 5745MHz Ant0 Emission

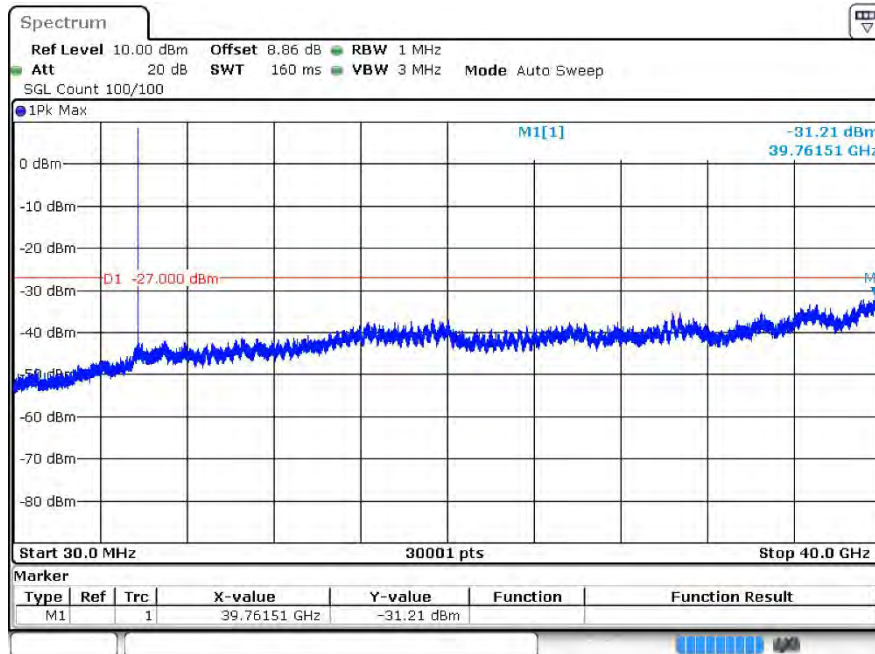


Tx. Spurious ac20 5785MHz Ant0 Emission

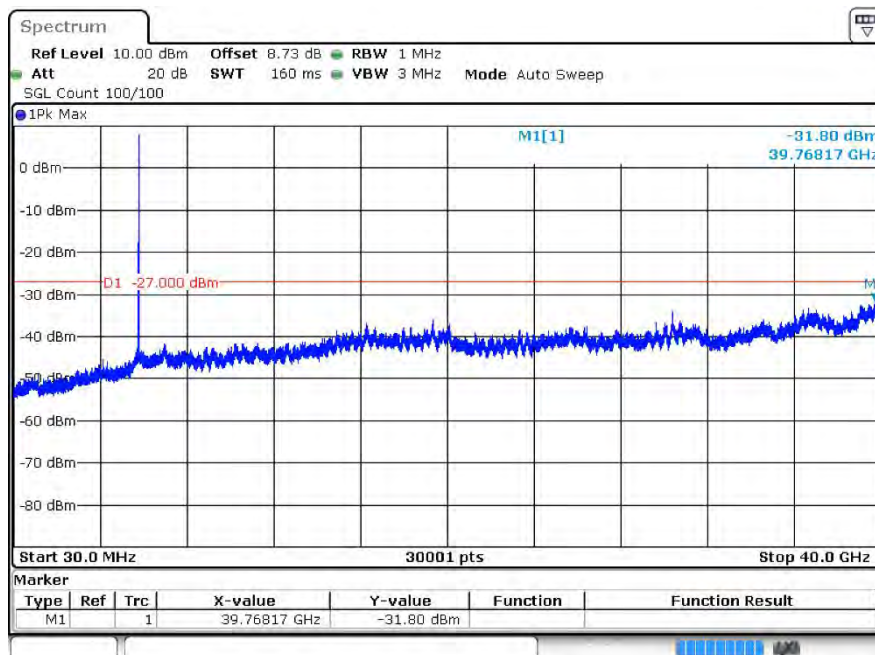


Tx. Spurious ac20 5825MHz Ant0 Emission

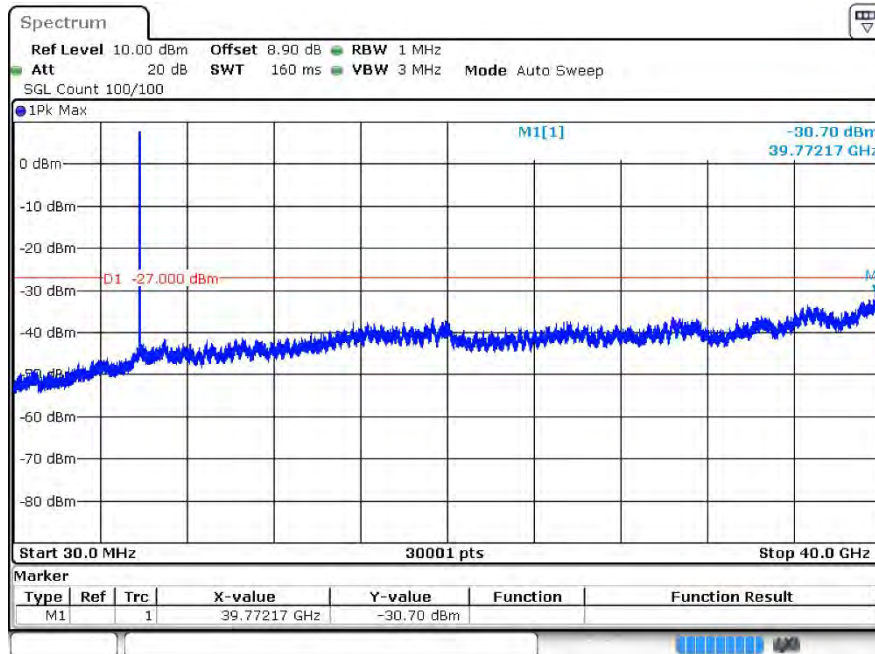


Tx. Spurious ac40 5755MHz Ant0 Emission

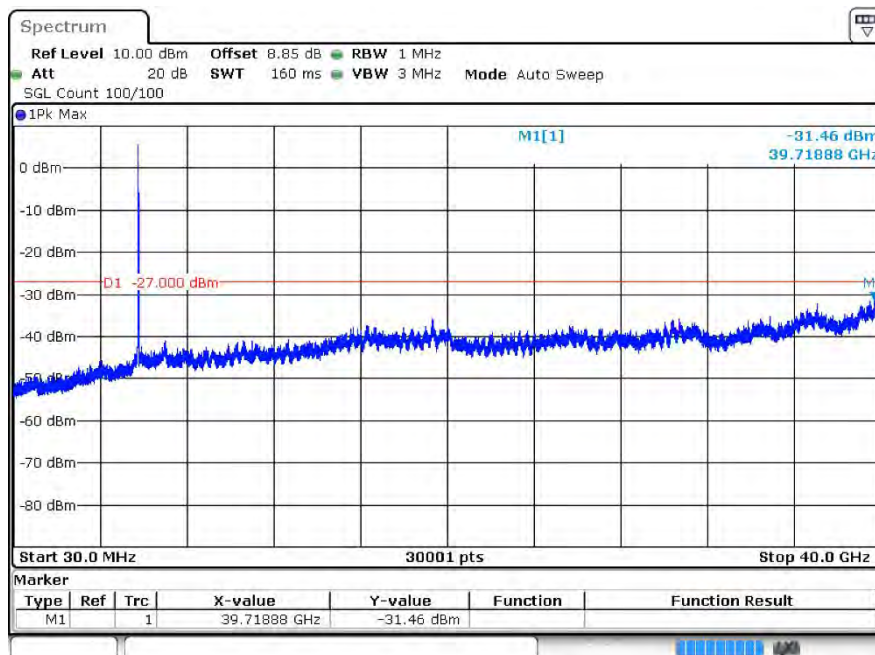


Tx. Spurious ac40 5795MHz Ant0 Emission

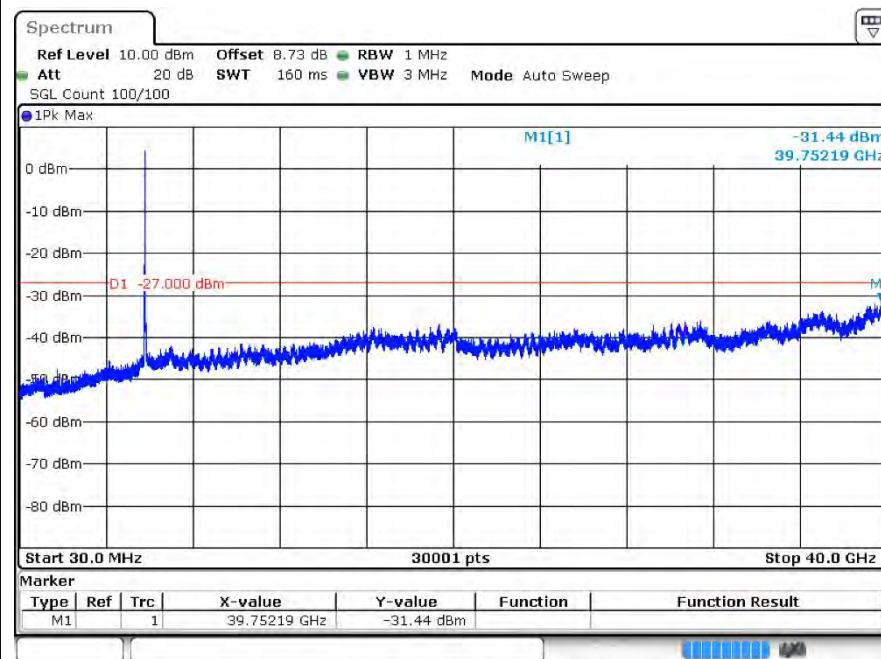


Tx. Spurious ac80 5775MHz Ant0 Emission

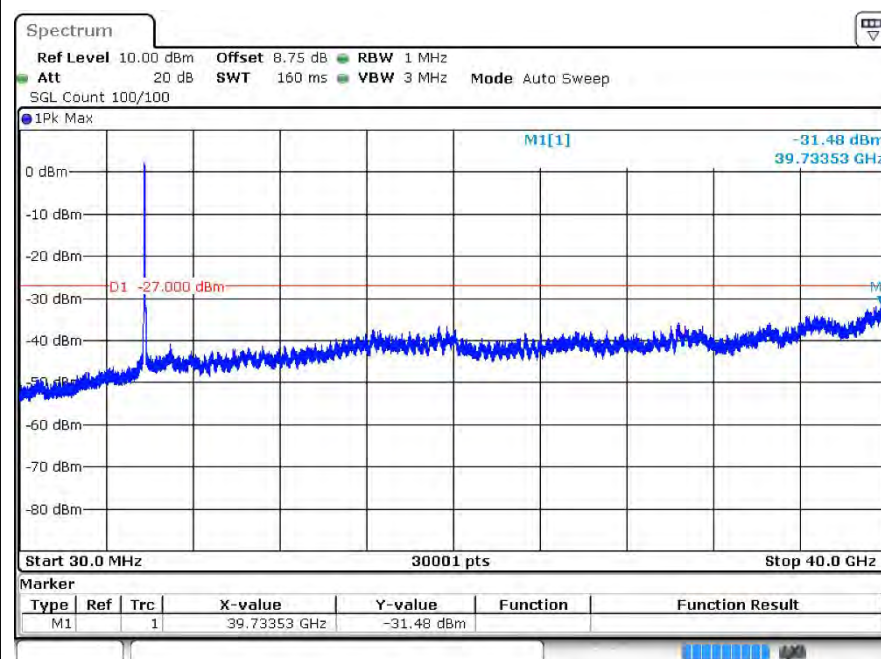


Tx. Spurious ax20 5745MHz Ant0 Emission

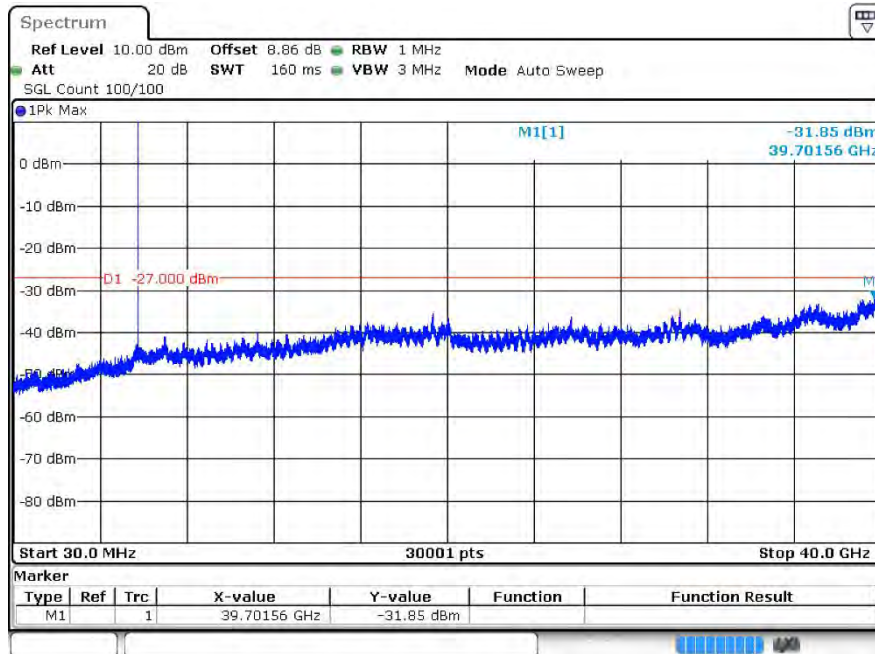


Tx. Spurious ax20 5785MHz Ant0 Emission

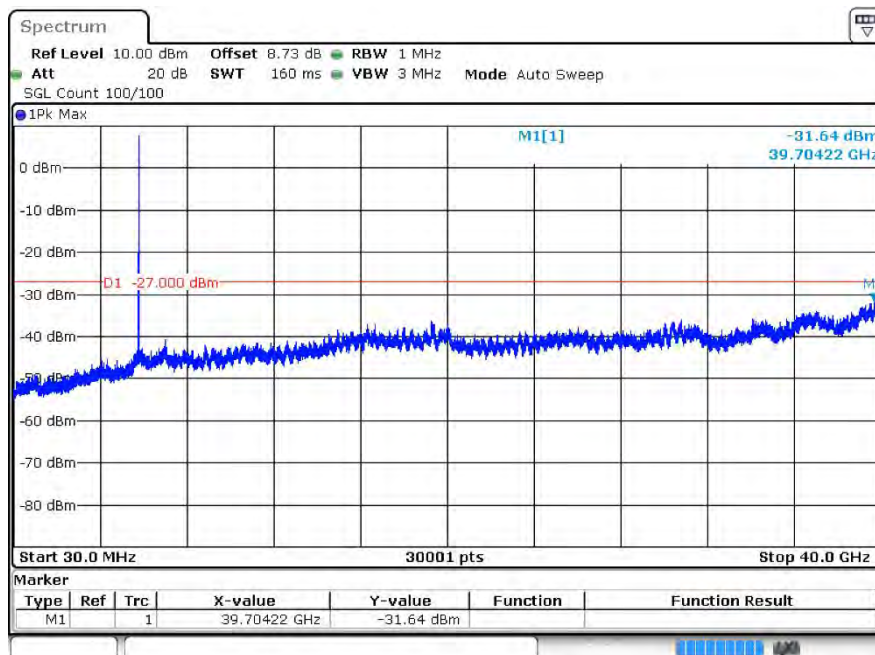


Tx. Spurious ax20 5825MHz Ant0 Emission

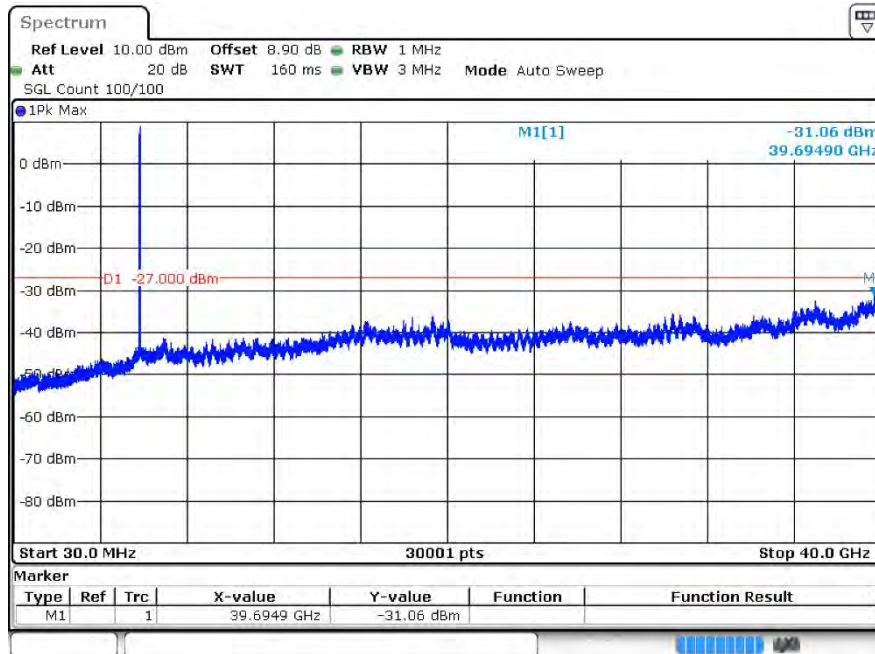


Tx. Spurious ax40 5755MHz Ant0 Emission

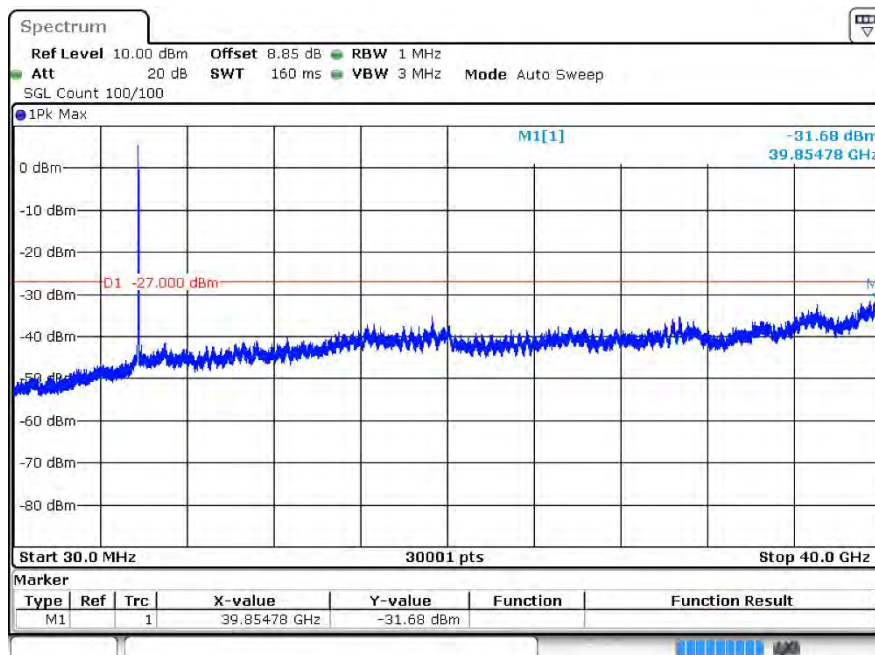


Tx. Spurious ax40 5795MHz Ant0 Emission

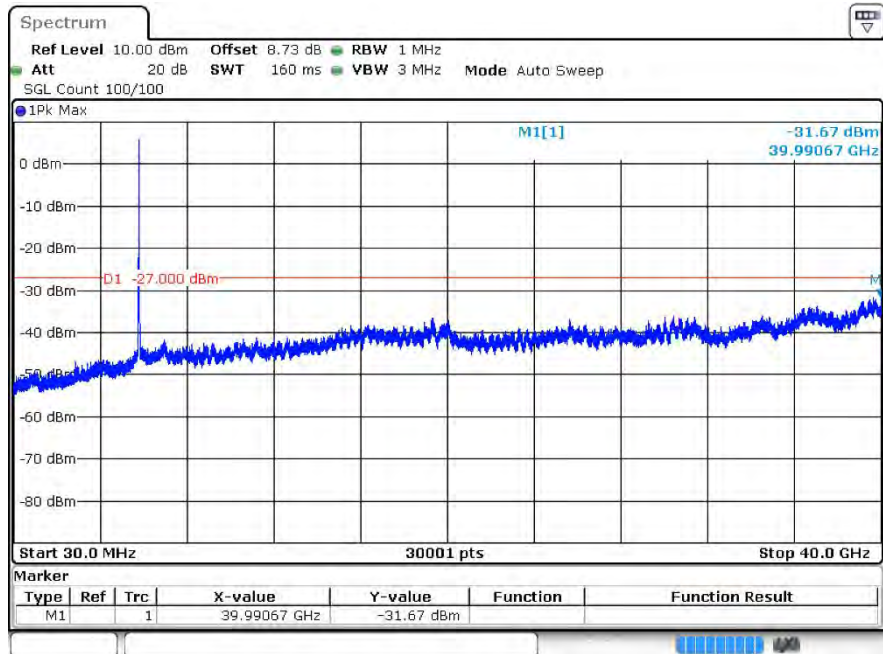


Tx. Spurious ax80 5775MHz Ant0 Emission

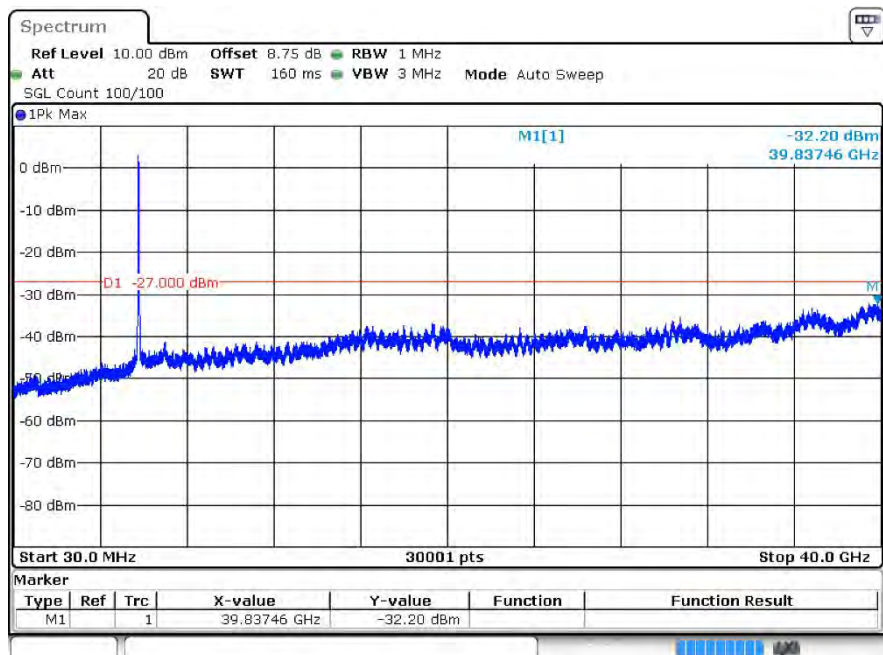


Tx. Spurious a 5745MHz Ant1 Emission

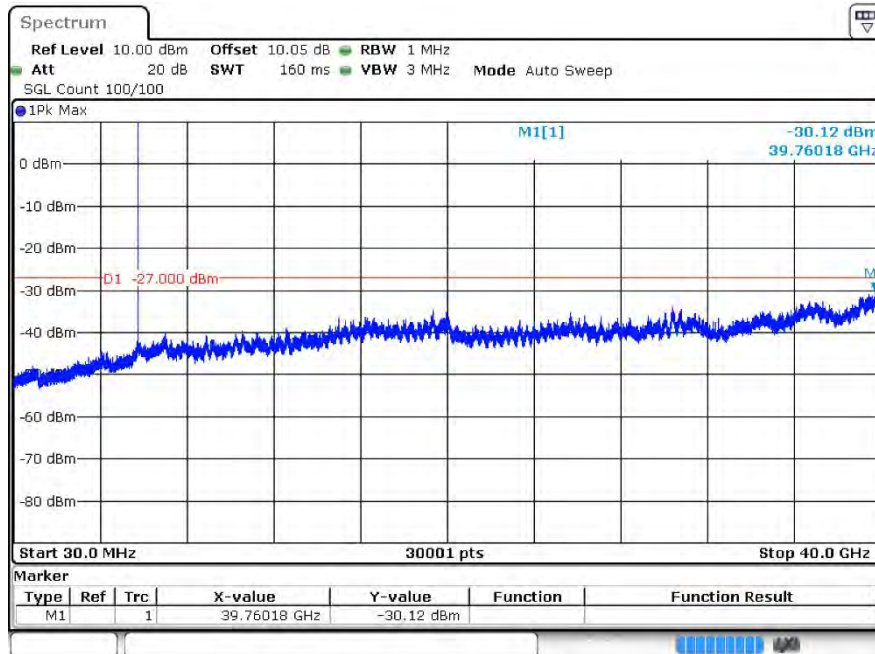


Tx. Spurious a 5785MHz Ant1 Emission

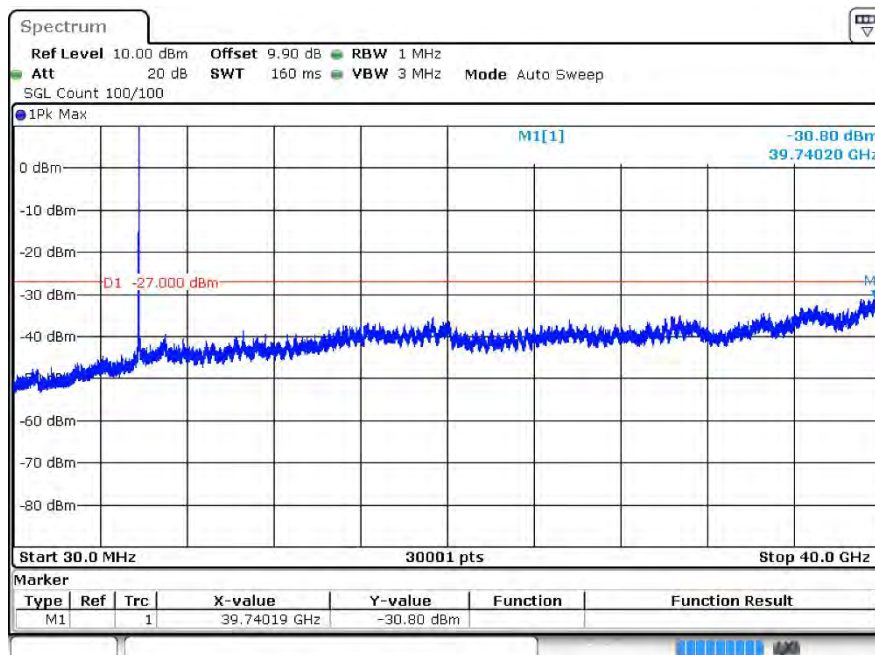


Tx. Spurious a 5825MHz Ant1 Emission

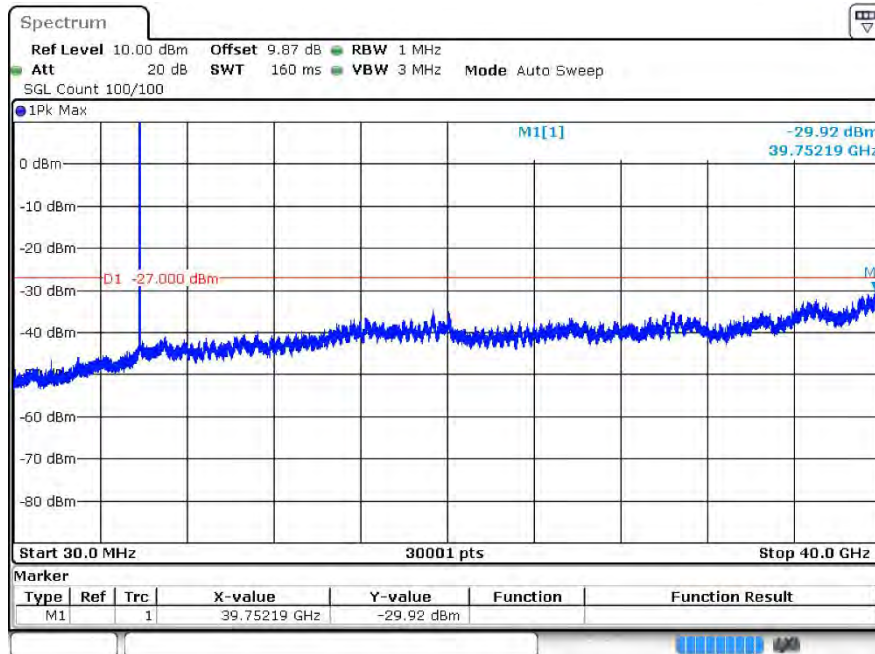


Tx. Spurious n20 5745MHz Ant1 Emission

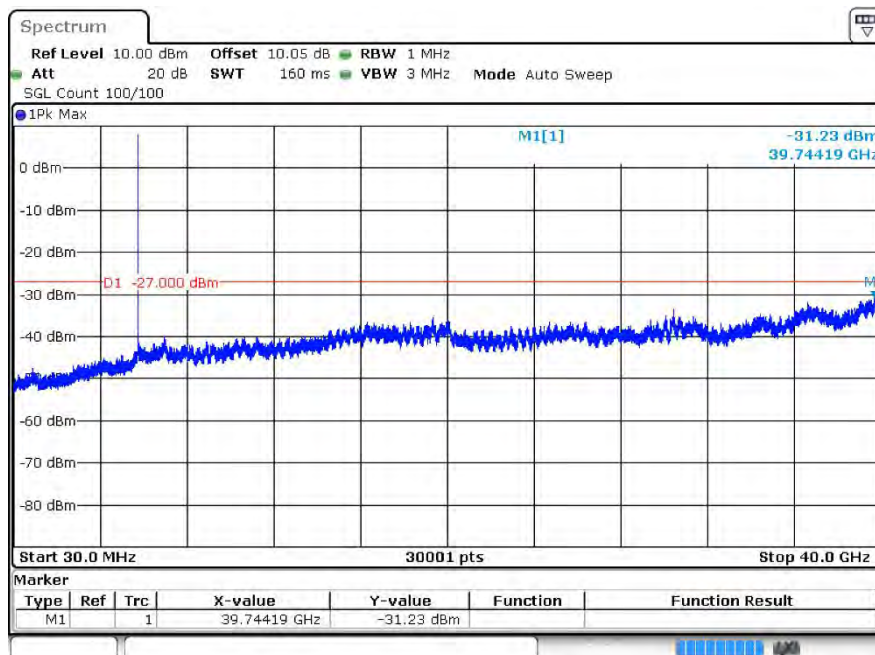


Tx. Spurious n20 5785MHz Ant1 Emission

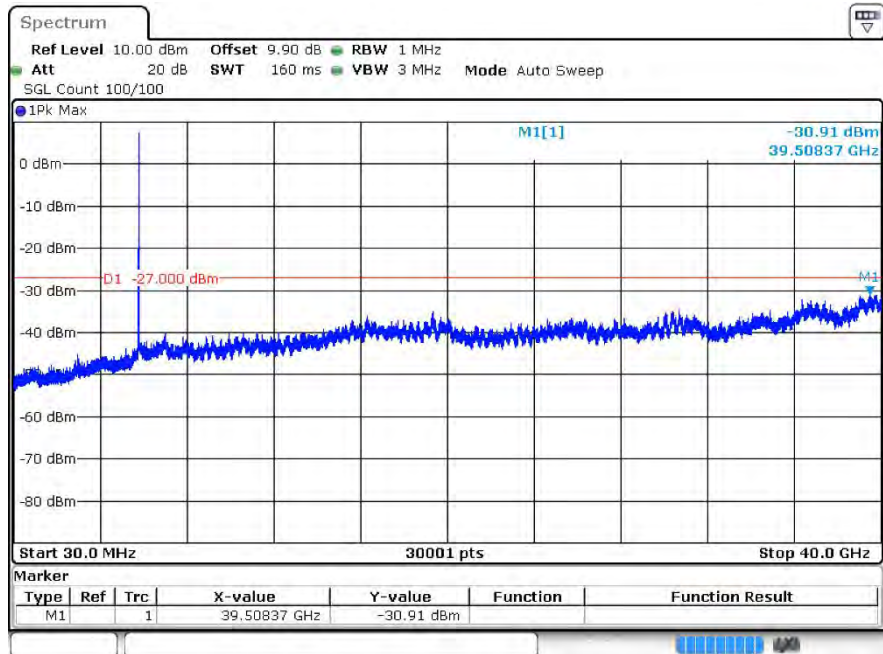


Tx. Spurious n20 5825MHz Ant1 Emission

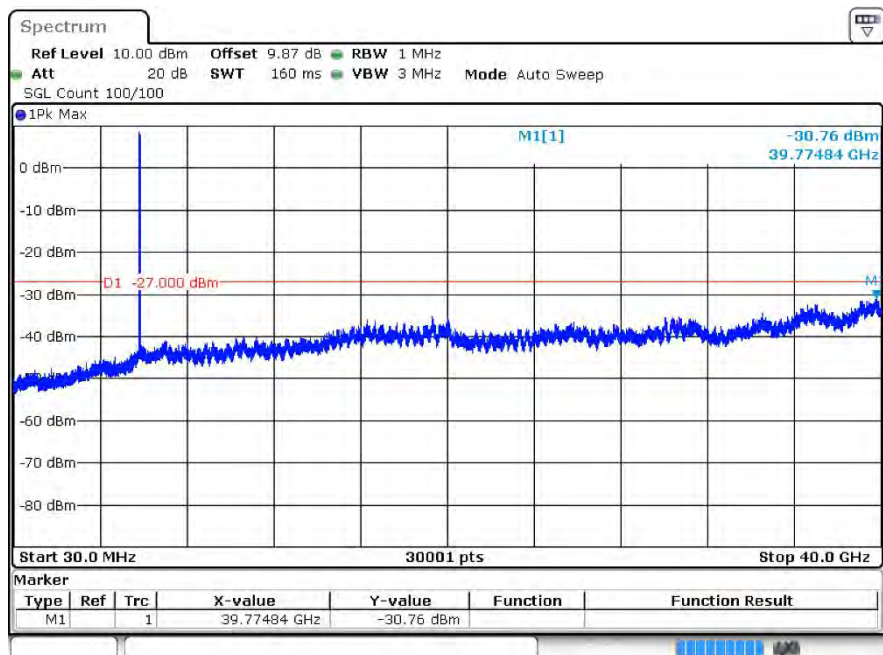

Tx. Spurious n40 5755MHz Ant1 Emission

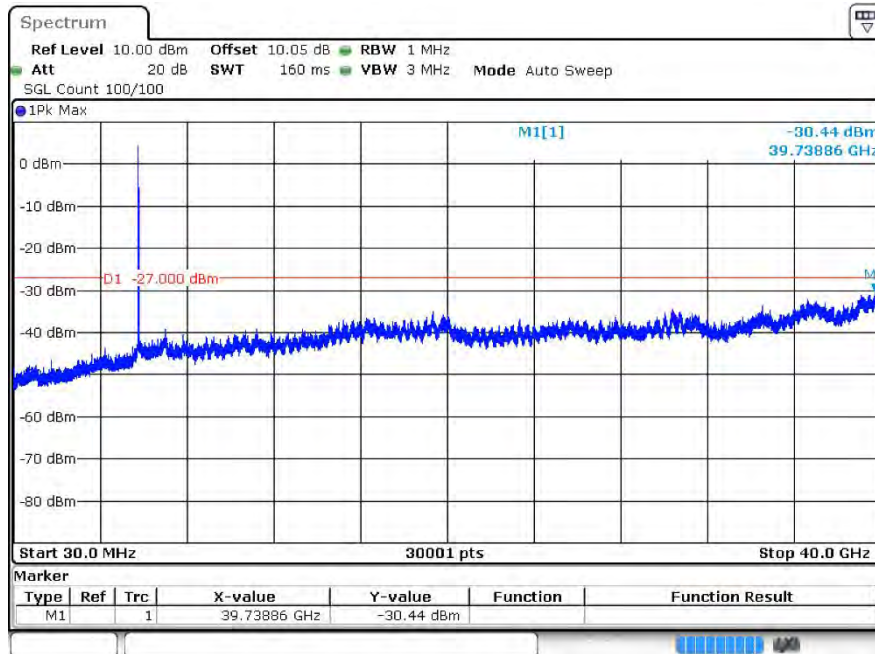


Tx. Spurious n40 5795MHz Ant1 Emission

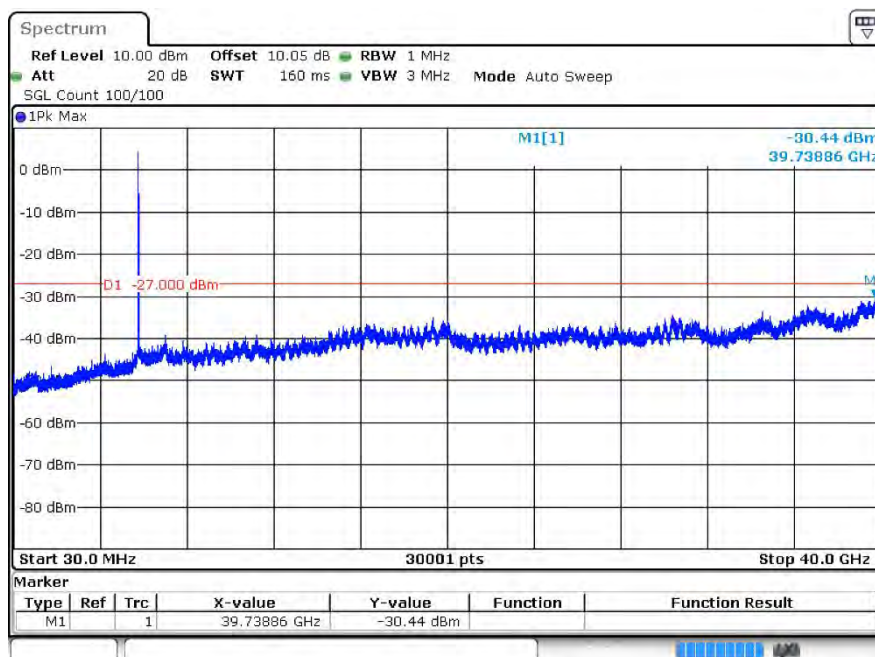





Tx. Spurious ac20 5745MHz Ant1 Emission

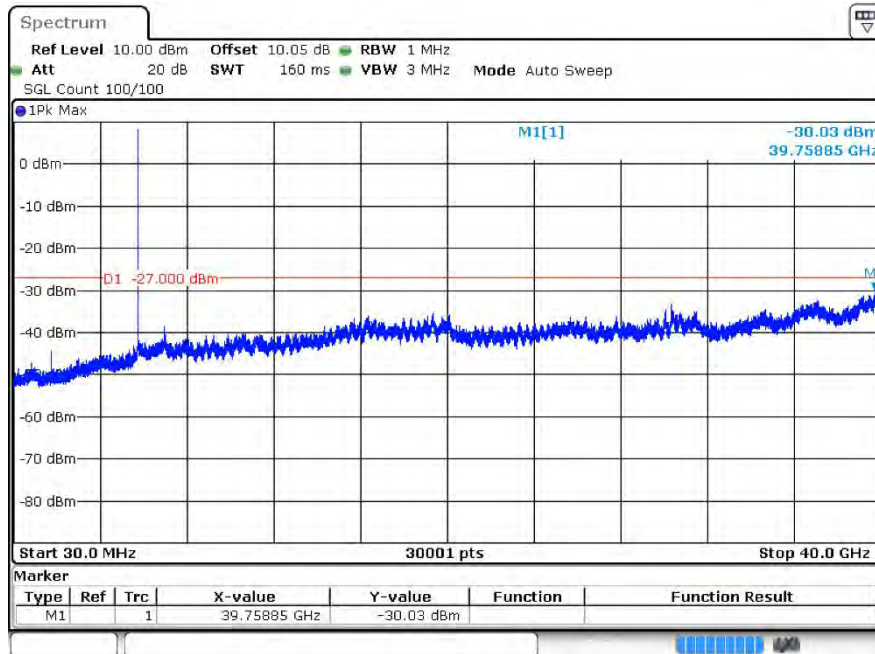


Tx. Spurious ac20 5785MHz Ant1 Emission

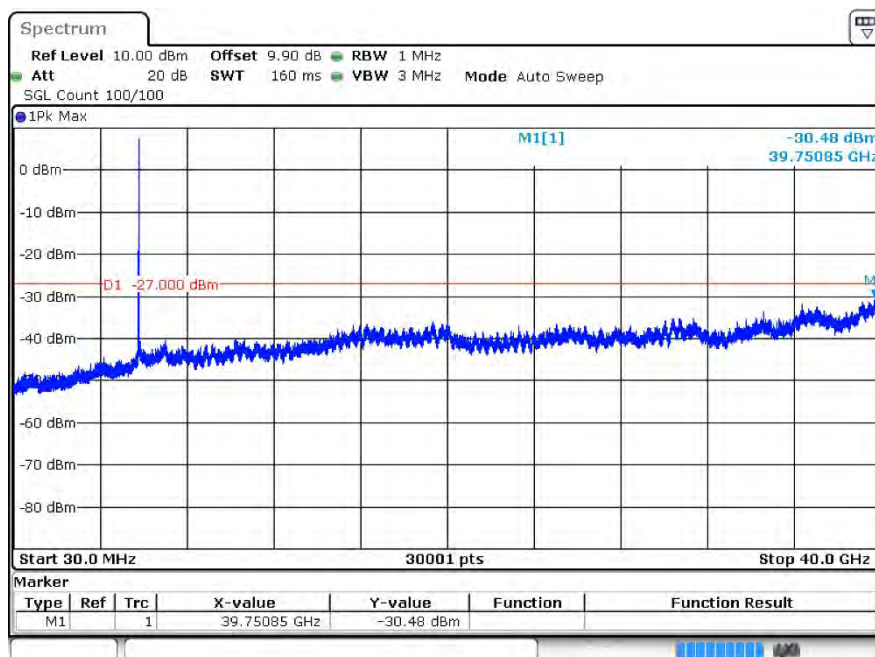


Tx. Spurious ac20 5825MHz Ant1 Emission

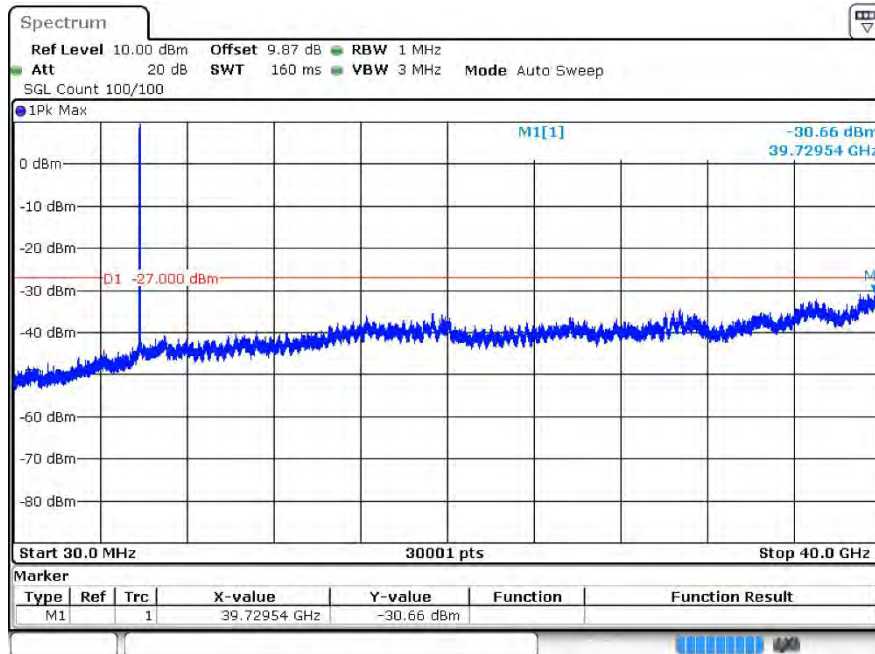


Tx. Spurious ac40 5755MHz Ant1 Emission

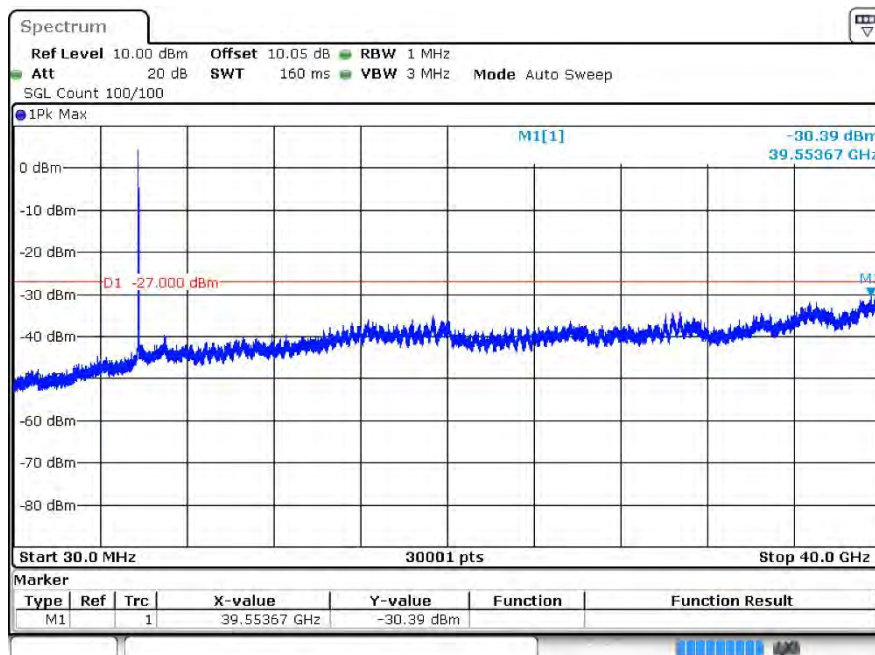

Tx. Spurious ac40 5795MHz Ant1 Emission

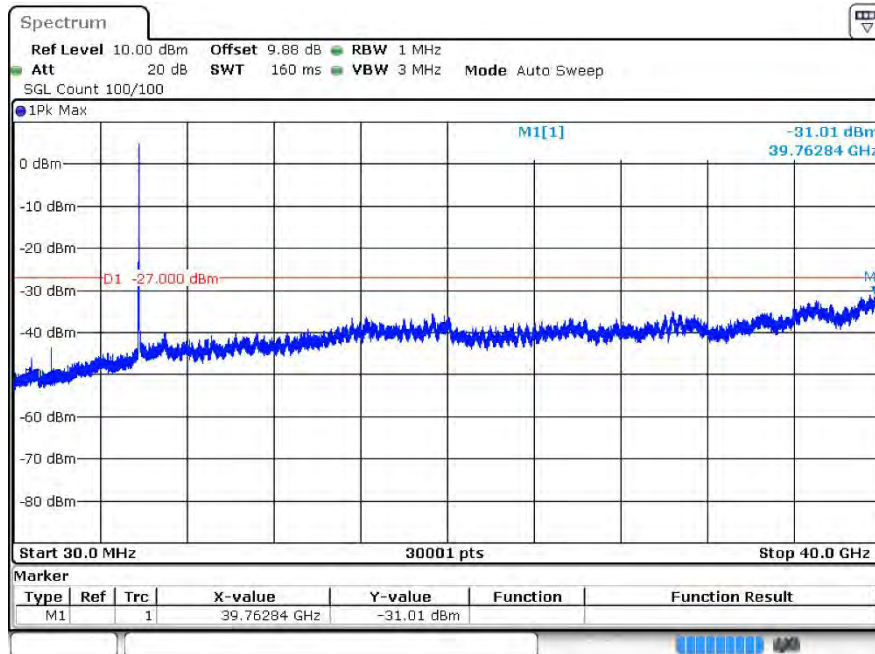


Tx. Spurious ac80 5775MHz Ant1 Emission

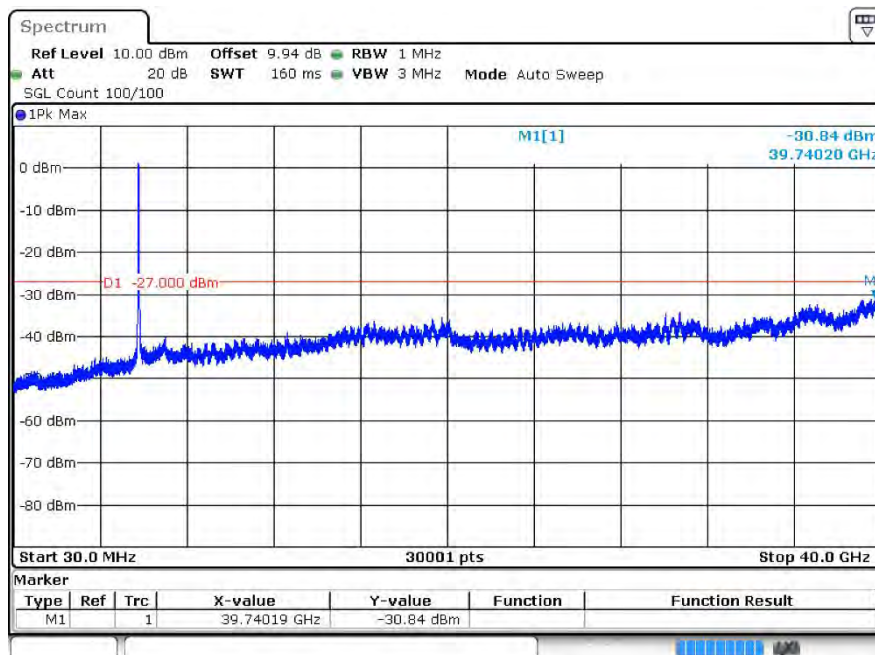





Tx. Spurious ax20 5745MHz Ant1 Emission

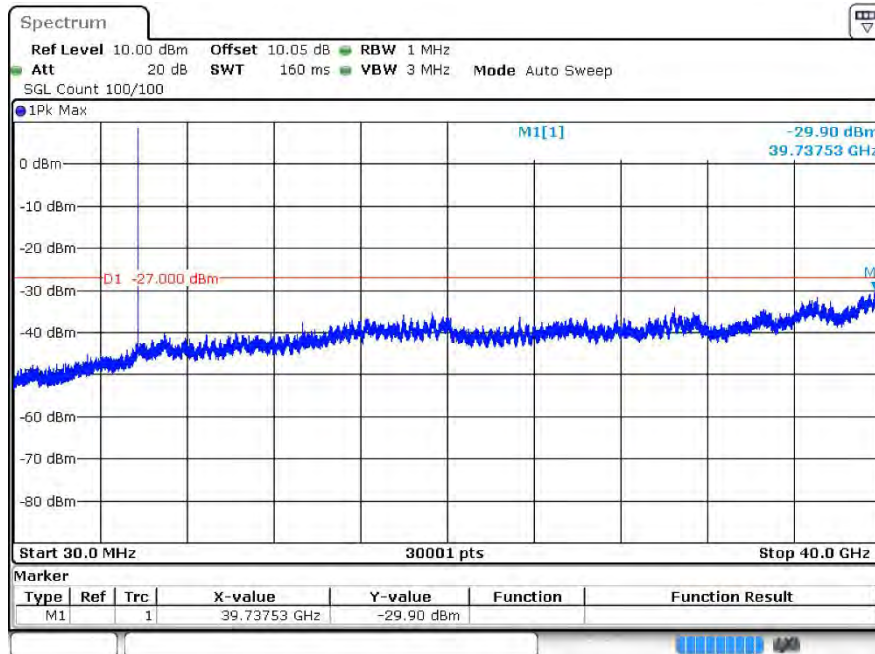


Tx. Spurious ax20 5785MHz Ant1 Emission

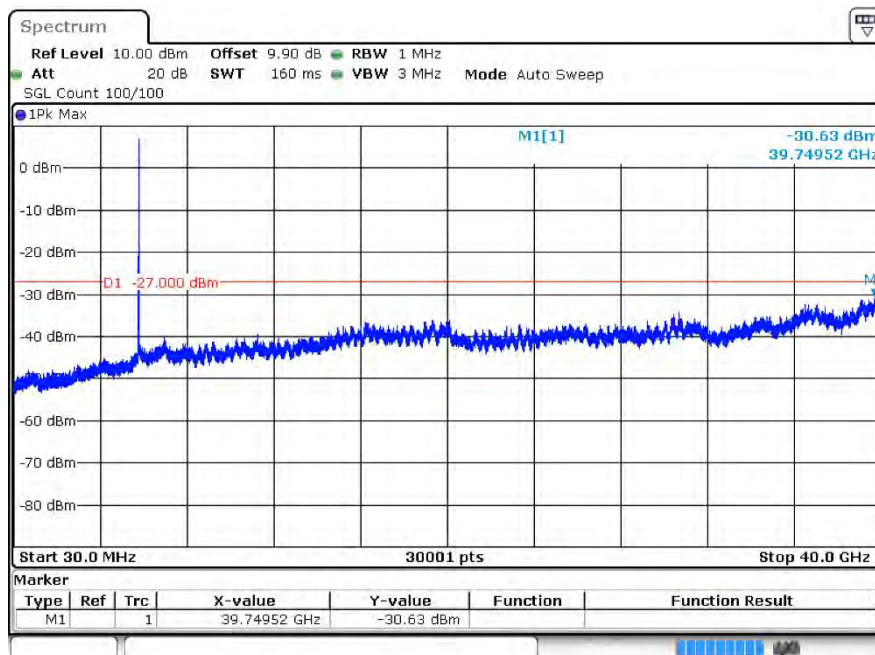


Tx. Spurious ax20 5825MHz Ant1 Emission

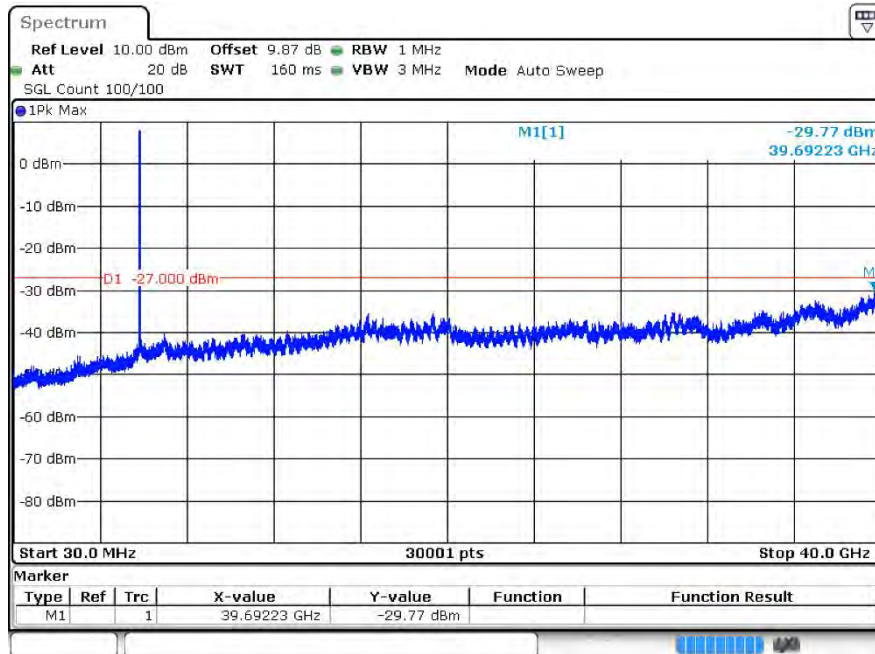


Tx. Spurious ax40 5755MHz Ant1 Emission

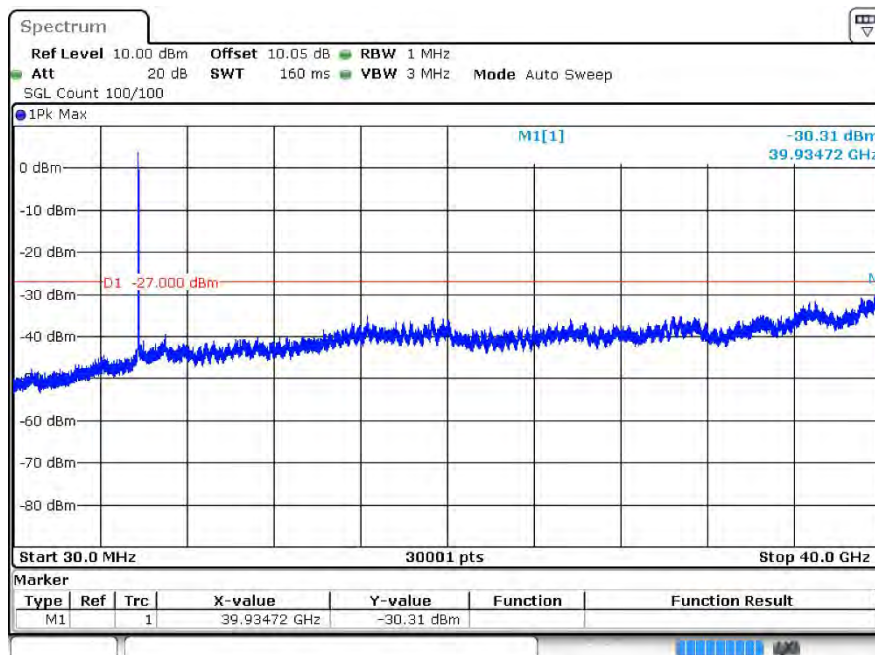

Tx. Spurious ax40 5795MHz Ant1 Emission

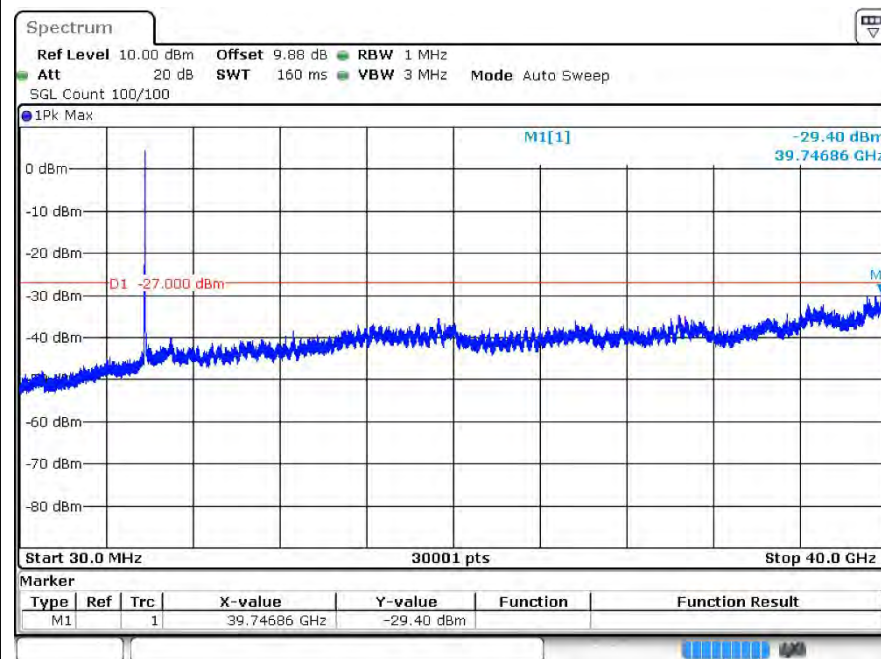

Tx. Spurious ax80 5775MHz Ant1 Emission

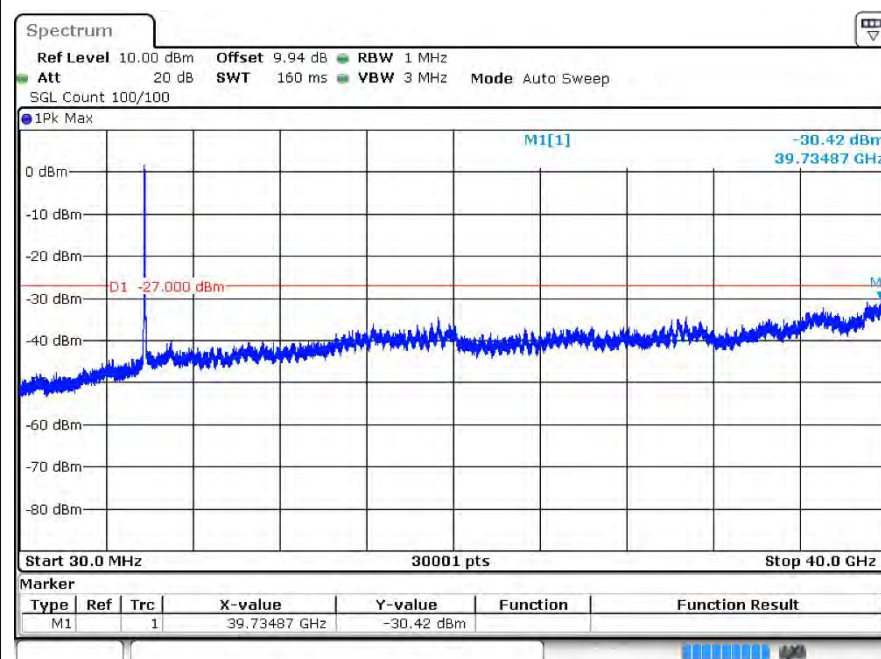

---The End---