



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ac20 | 5260 | Ant2 | 4787.04 | -55.32 | 2.51 | 0.28 | 42.70 | Average | 54   | Pass |
| NVNT | ac20 | 5260 | Ant2 | 5150    | -47.19 | 2.51 | -    | 50.55 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5260 | Ant2 | 5150    | -56.73 | 2.51 | 0.28 | 41.29 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350    | -41.86 | 2.51 | -    | 55.88 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350    | -52.52 | 2.51 | 0.28 | 45.50 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350.6  | -36.81 | 2.51 | -    | 60.93 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350    | -52.52 | 2.51 | 0.28 | 45.50 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5460    | -49.8  | 2.51 | -    | 48.22 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5460    | -57.84 | 2.51 | 0.28 | 39.90 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4500    | -51.34 | 2.51 | -    | 46.68 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4500    | -59.1  | 2.51 | 0.12 | 38.64 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4772.97 | -44.69 | 2.51 | -    | 53.17 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4772.97 | -52.89 | 2.51 | 0.12 | 44.85 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant2 | 5150    | -49.87 | 2.51 | -    | 47.99 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant2 | 5150    | -57.38 | 2.51 | 0.12 | 40.36 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350    | -40.1  | 2.51 | -    | 57.76 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350    | -53.73 | 2.51 | 0.12 | 44.01 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350    | -40.1  | 2.51 | -    | 57.76 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350.2  | -53.43 | 2.51 | 0.12 | 44.43 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5460    | -49.01 | 2.51 | -    | 48.73 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5460    | -57.42 | 2.51 | 0.12 | 40.44 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 4500    | -51.5  | 2.51 | -    | 46.24 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 4500    | -59.52 | 2.51 | 0.25 | 38.34 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5028.96 | -46.36 | 2.51 | -    | 51.38 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5149.02 | -55.86 | 2.51 | 0.25 | 42.13 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5150    | -46.5  | 2.51 | -    | 51.24 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5150    | -56.14 | 2.51 | 0.25 | 41.85 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5350    | -45.74 | 2.51 | -    | 52.00 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5350    | -54.57 | 2.51 | 0.25 | 43.42 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5355.75 | -42.66 | 2.51 | -    | 55.08 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5351.25 | -54.5  | 2.51 | 0.25 | 43.49 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5460    | -49.44 | 2.51 | -    | 48.30 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5460    | -58.04 | 2.51 | 0.25 | 39.95 | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Restrict Band NVNT a 5260MHz Ant2 Peak

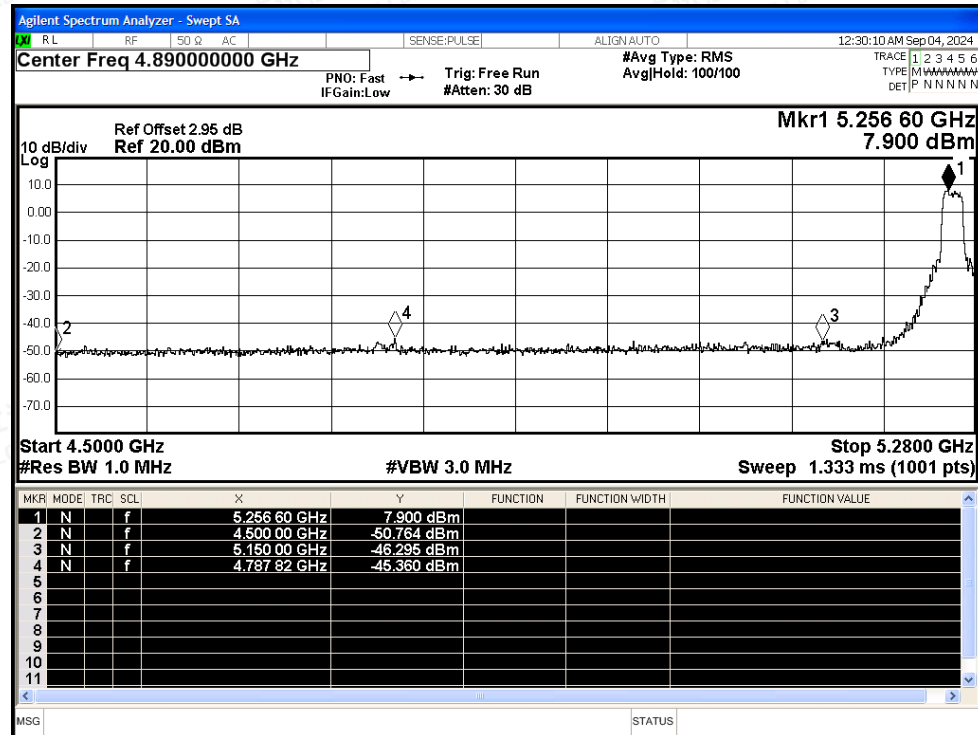

## Restrict Band NVNT a 5260MHz Ant2 Average

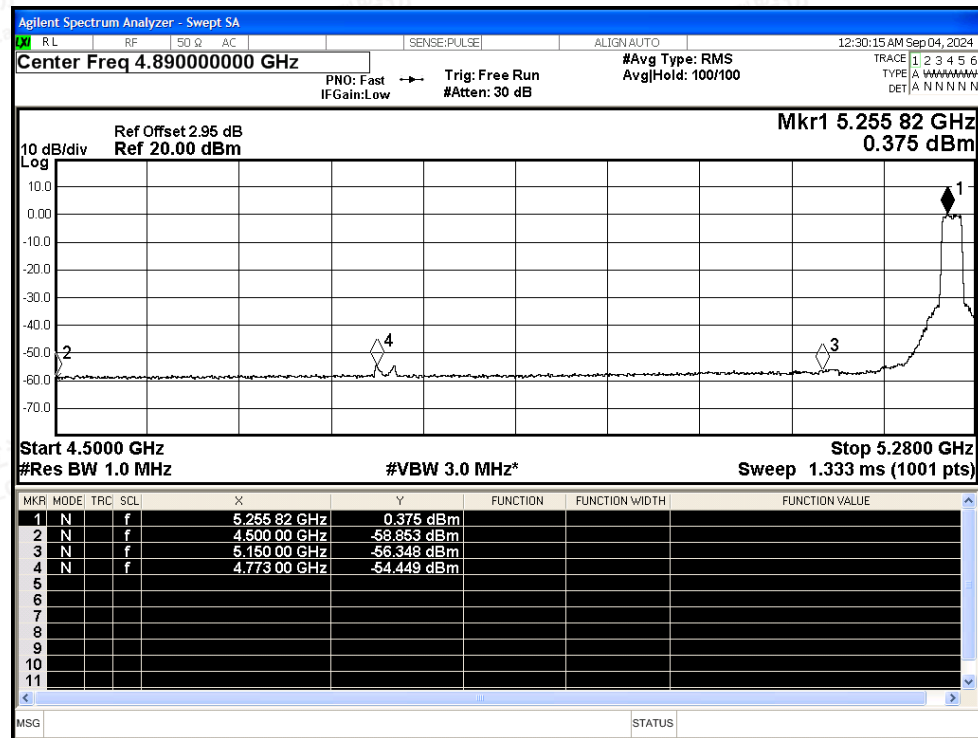

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5320MHz Ant2 Peak

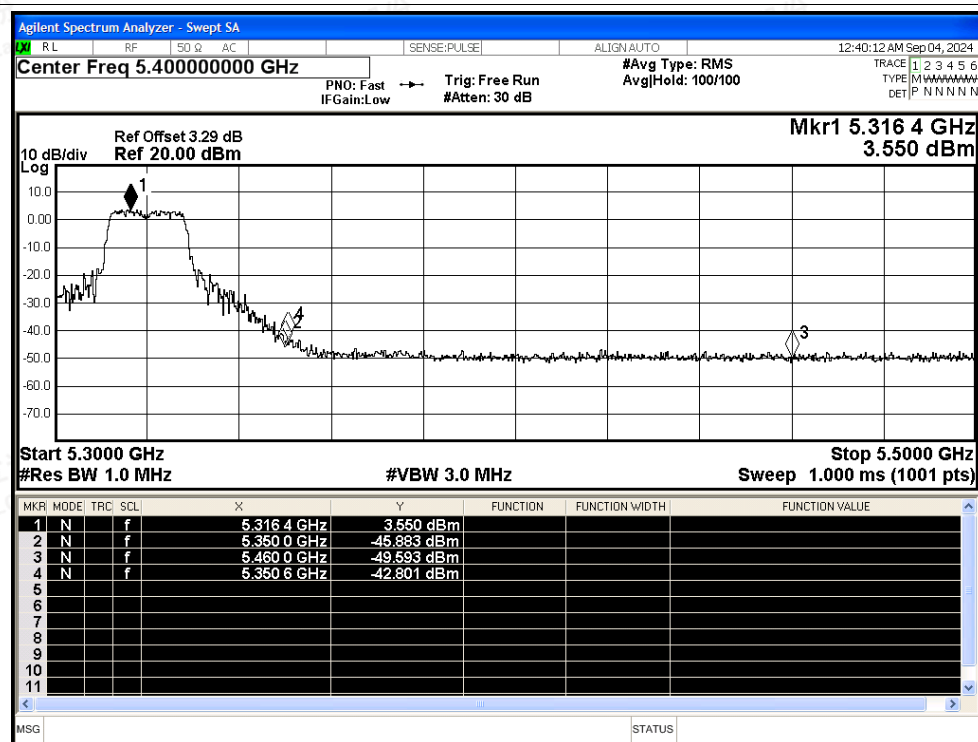

## Restrict Band NVNT a 5320MHz Ant2 Average

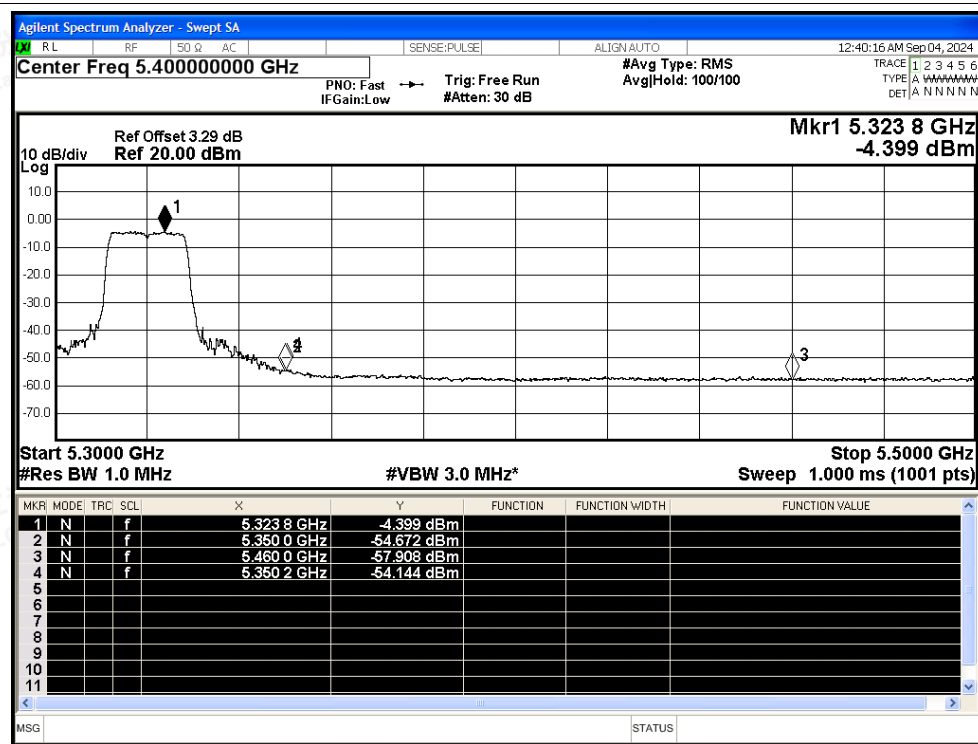

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5260MHz Ant2 Peak

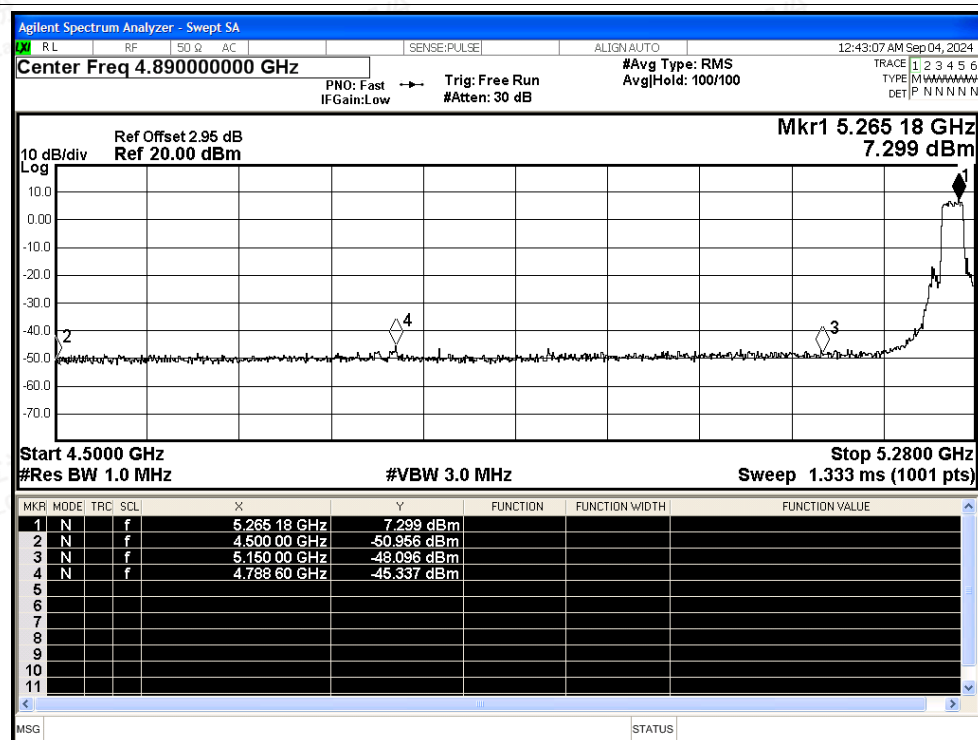

## Restrict Band NVNT n20 5260MHz Ant2 Average

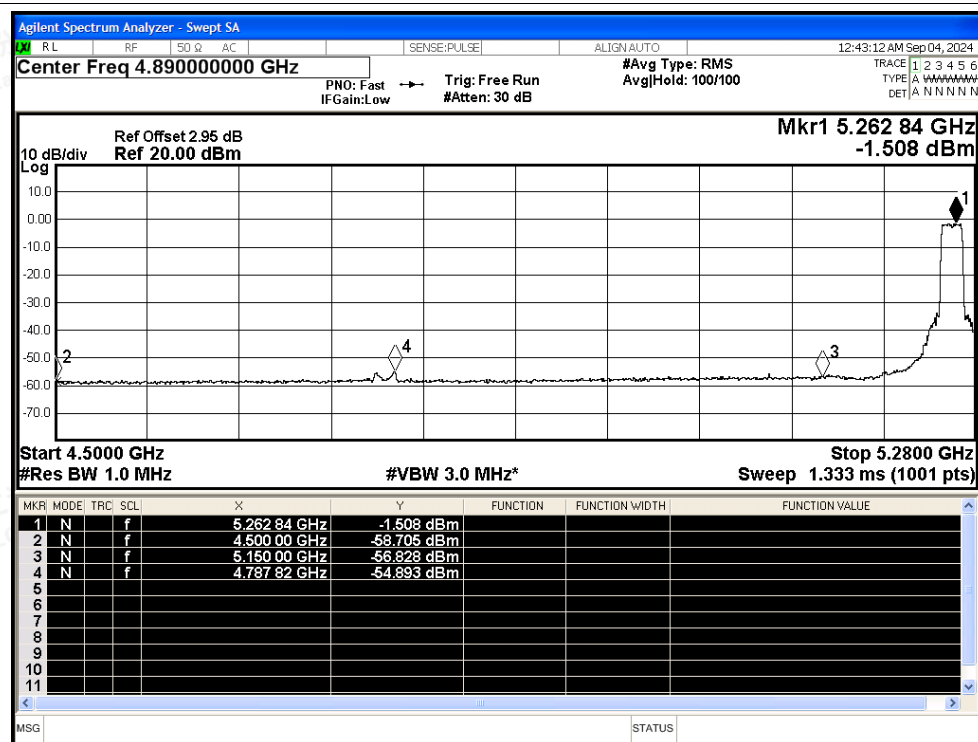

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5320MHz Ant2 Peak

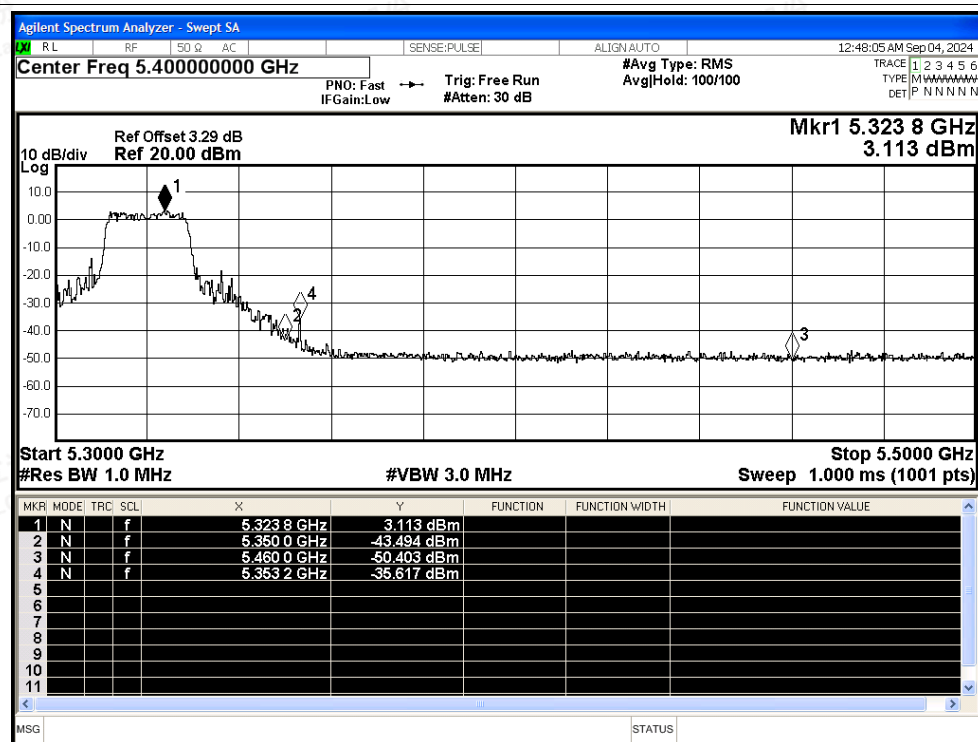

## Restrict Band NVNT n20 5320MHz Ant2 Average

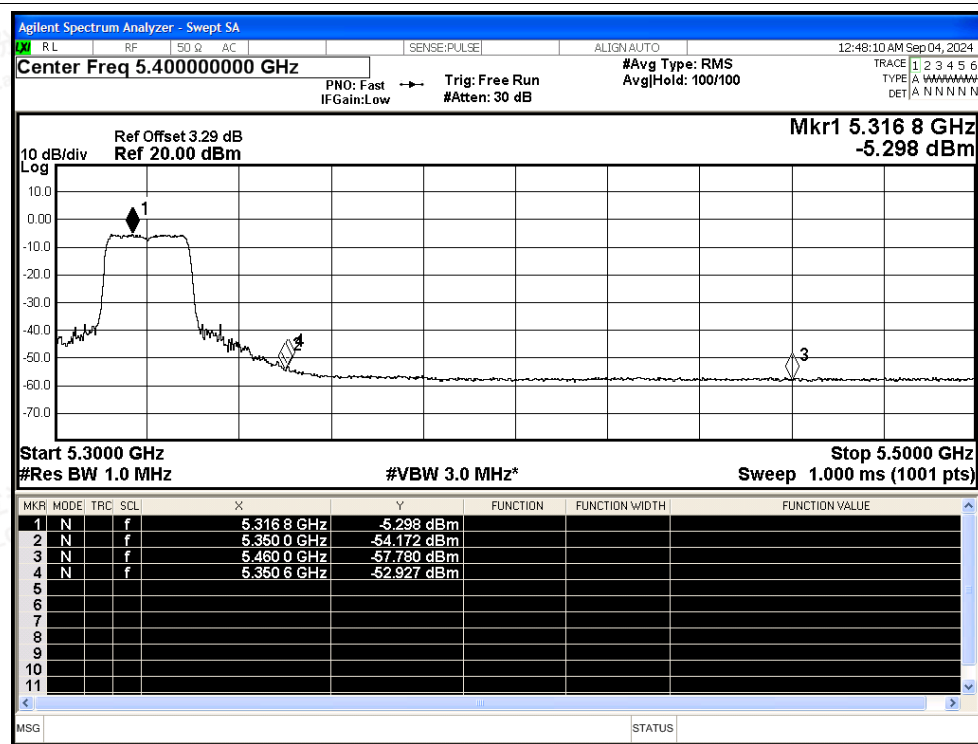

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5270MHz Ant2 Peak

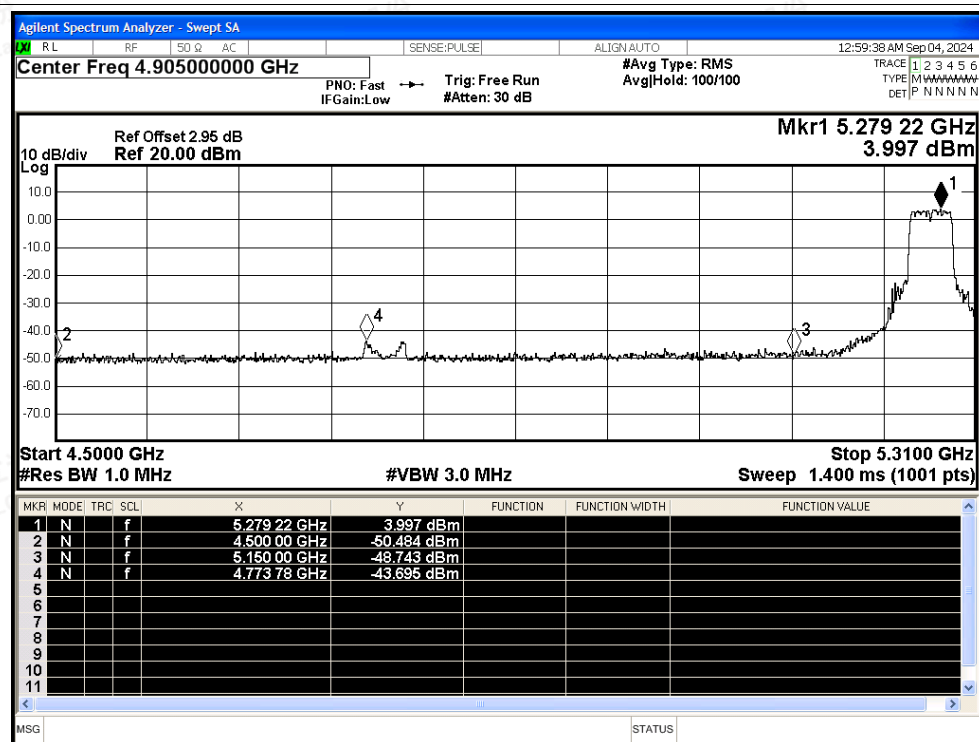

## Restrict Band NVNT n40 5270MHz Ant2 Average

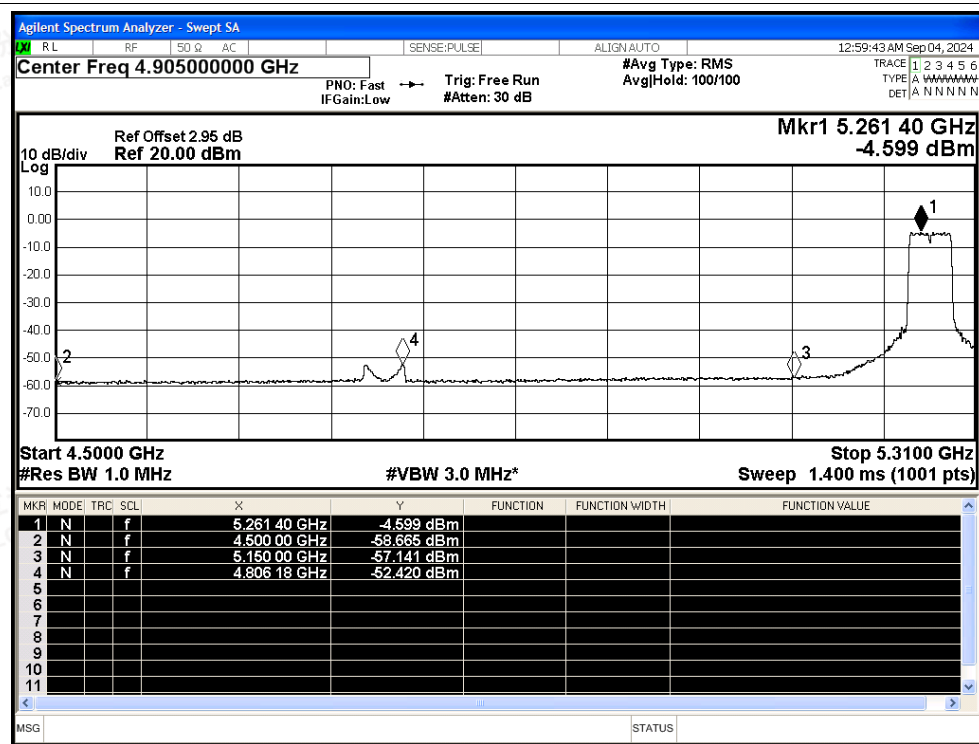

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5310MHz Ant2 Peak

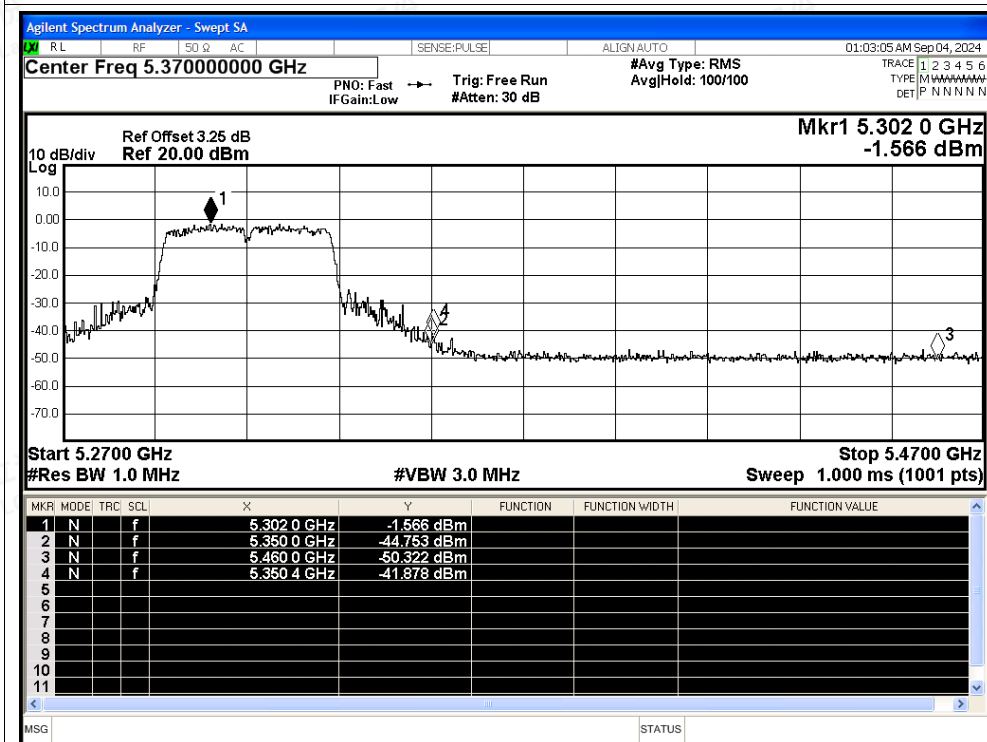

## Restrict Band NVNT n40 5310MHz Ant2 Average

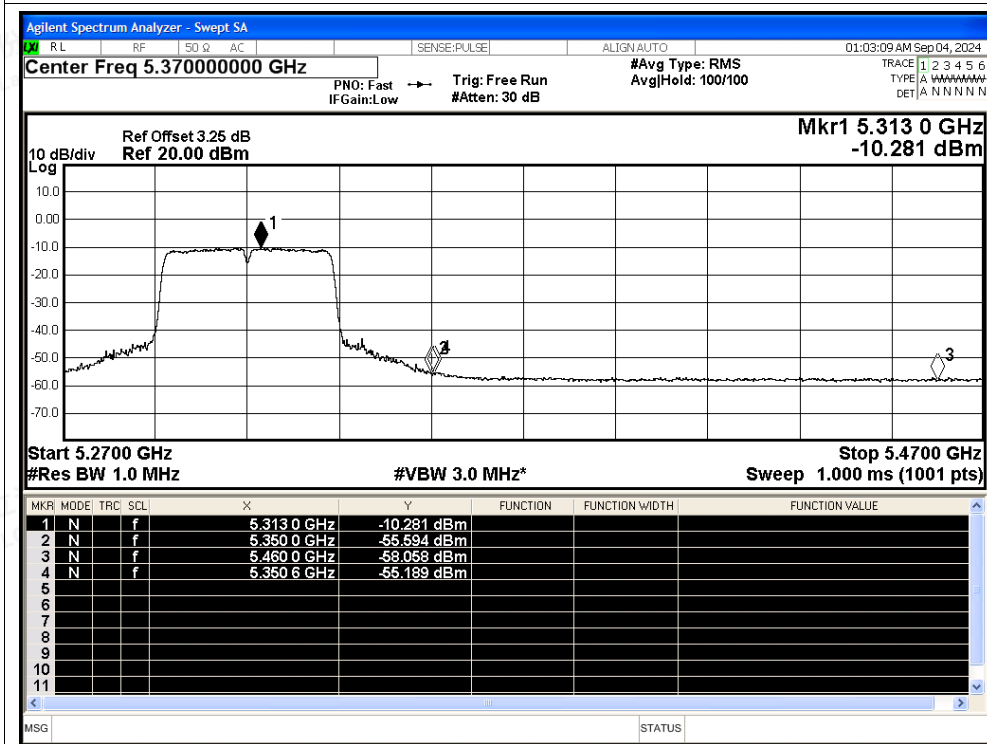

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5260MHz Ant2 Peak

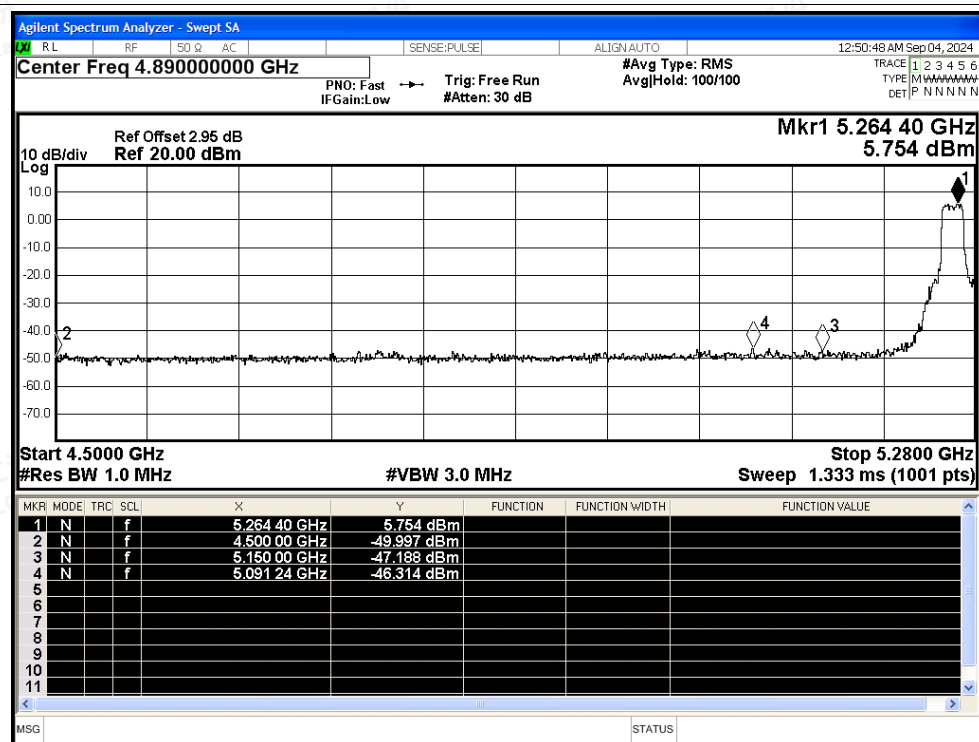

## Restrict Band NVNT ac20 5260MHz Ant2 Average

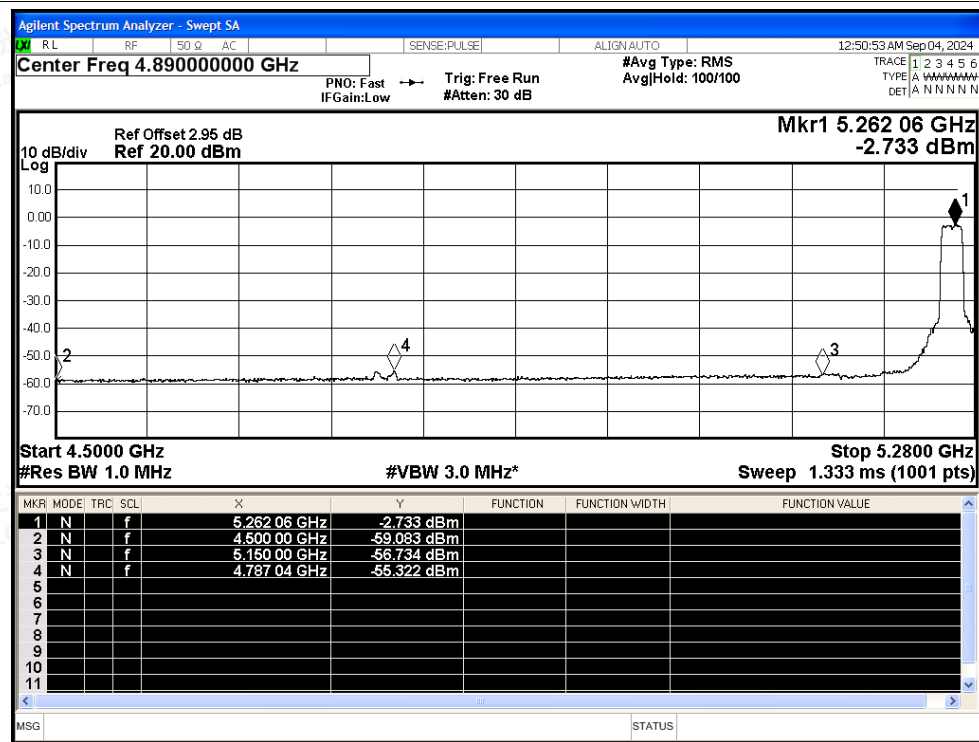

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5320MHz Ant2 Peak

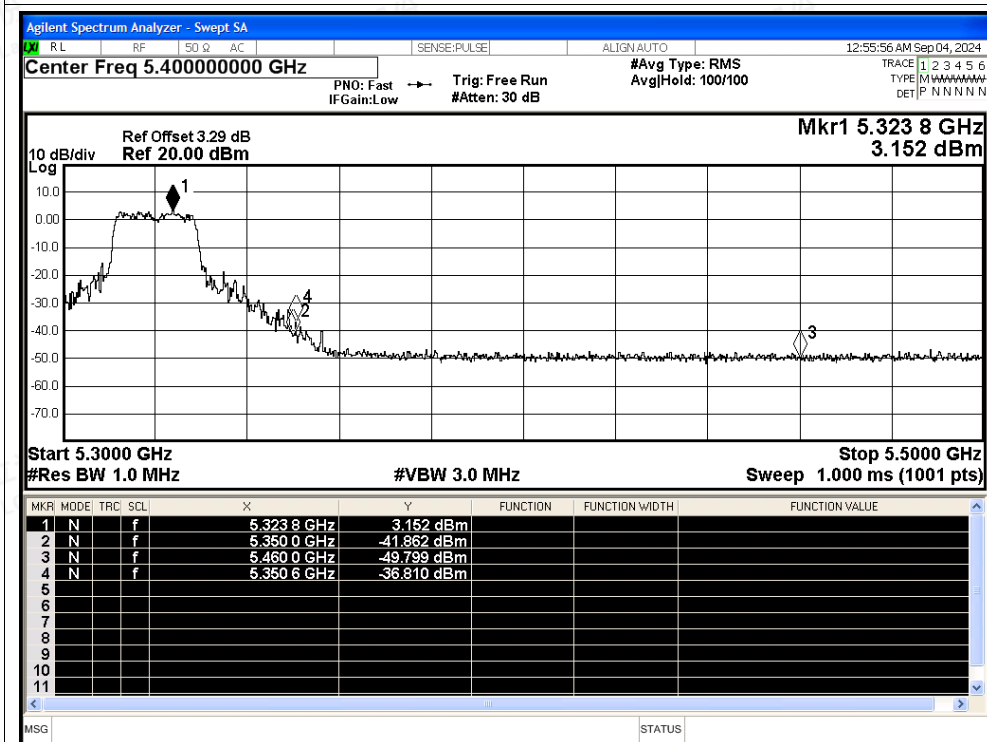

## Restrict Band NVNT ac20 5320MHz Ant2 Average

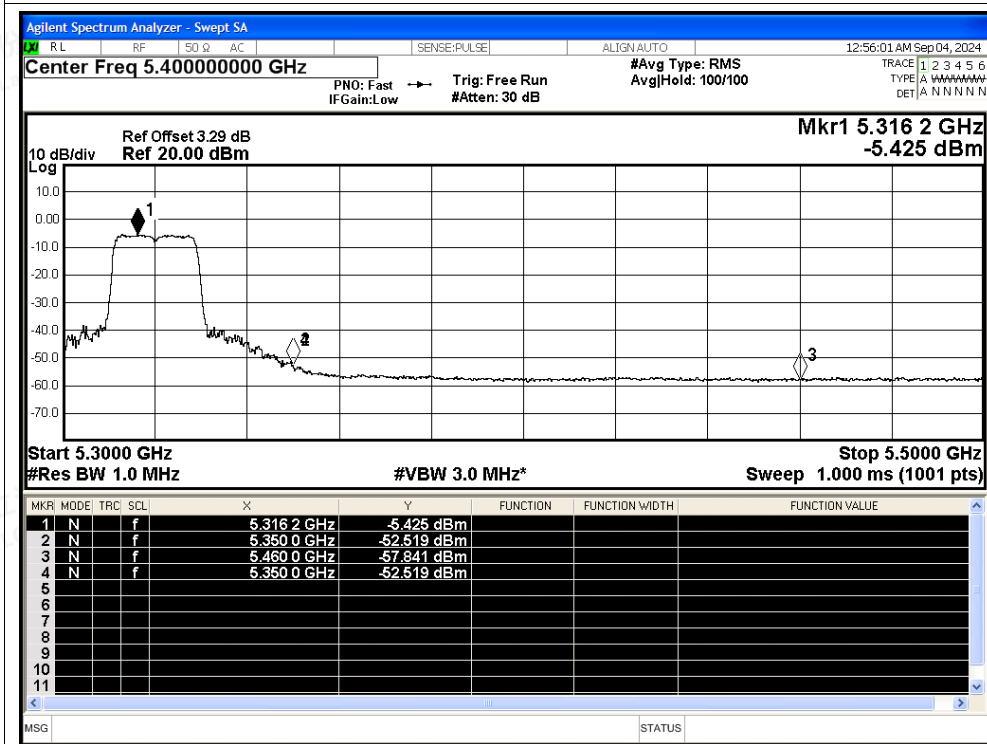

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5270MHz Ant2 Peak

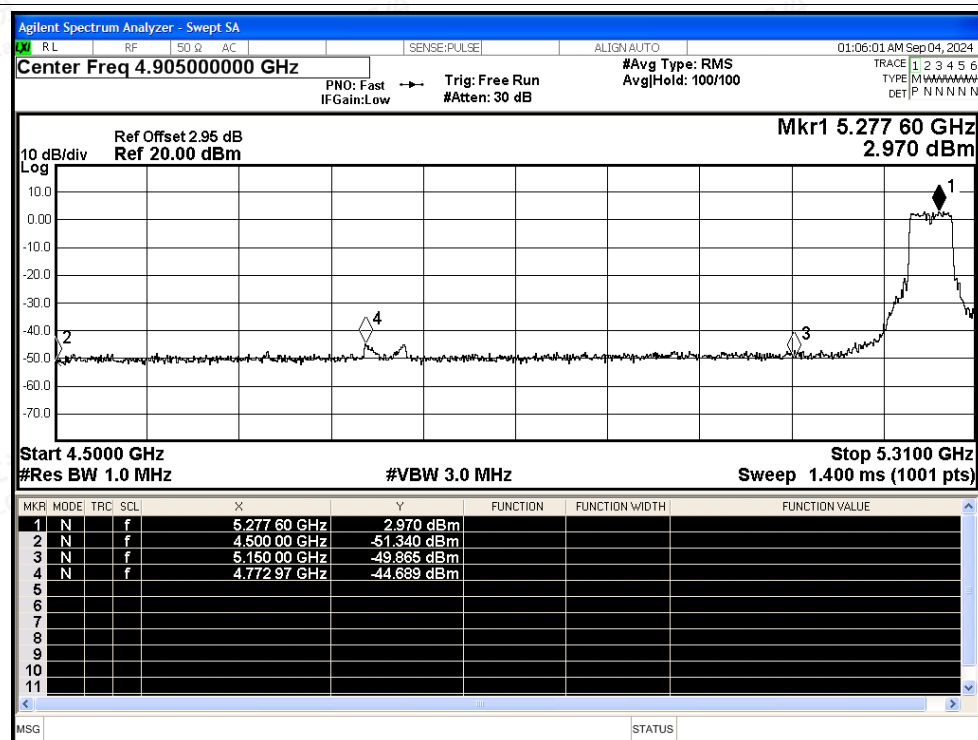

## Restrict Band NVNT ac40 5270MHz Ant2 Average

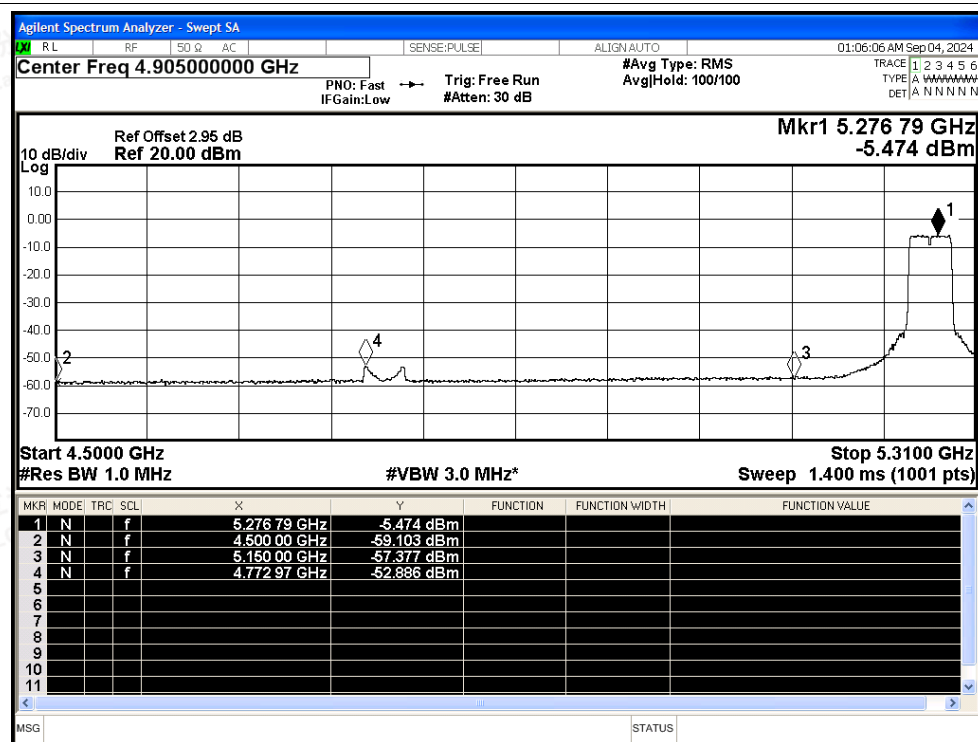

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5310MHz Ant2 Peak

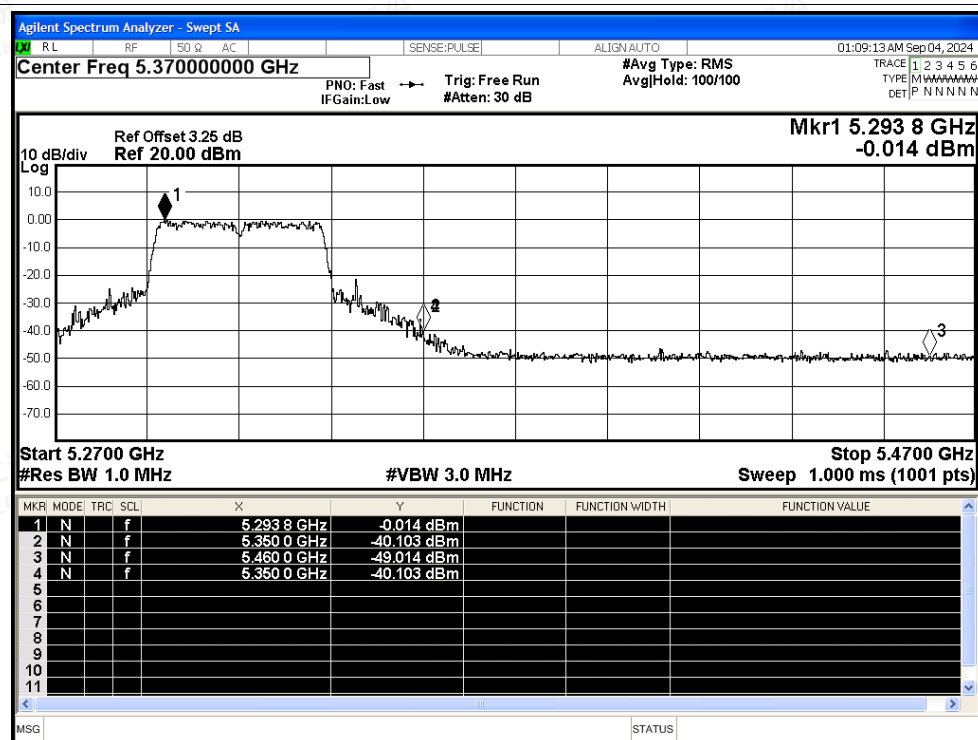

## Restrict Band NVNT ac40 5310MHz Ant2 Average

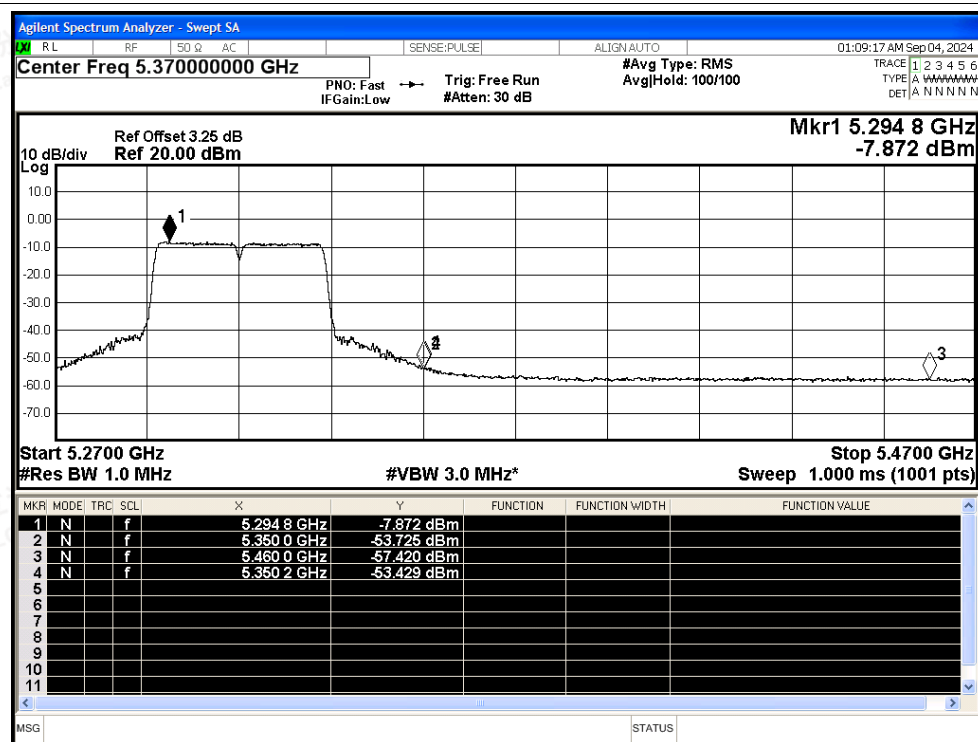

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5290MHz Ant2 Peak

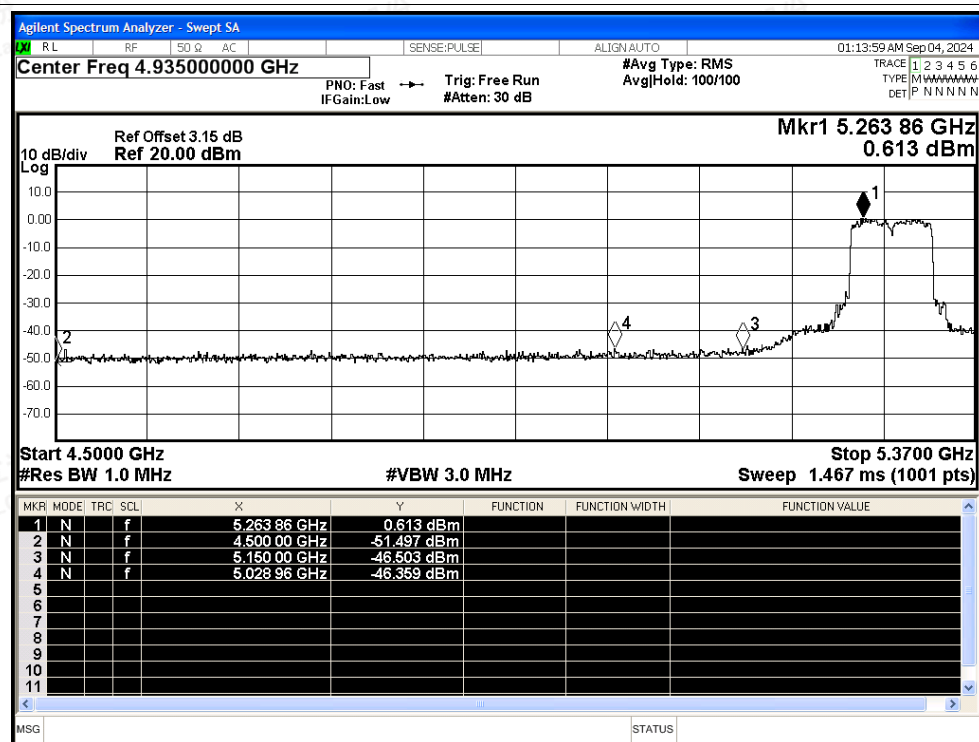

## Restrict Band NVNT ac80 5290MHz Ant2 Average

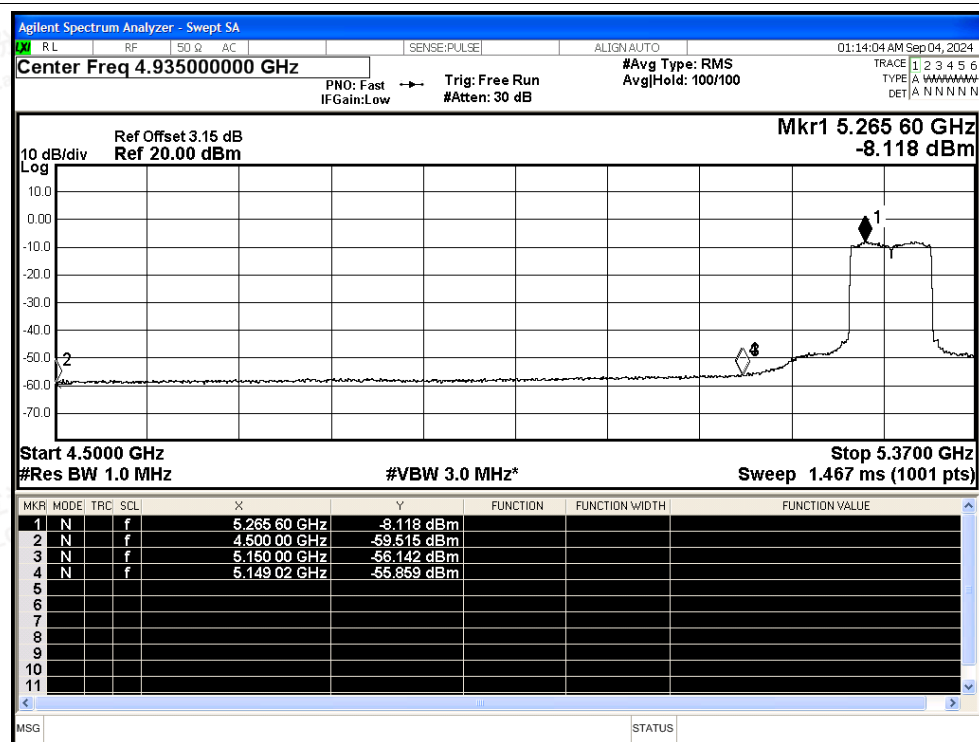

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5290MHz Ant2 Peak

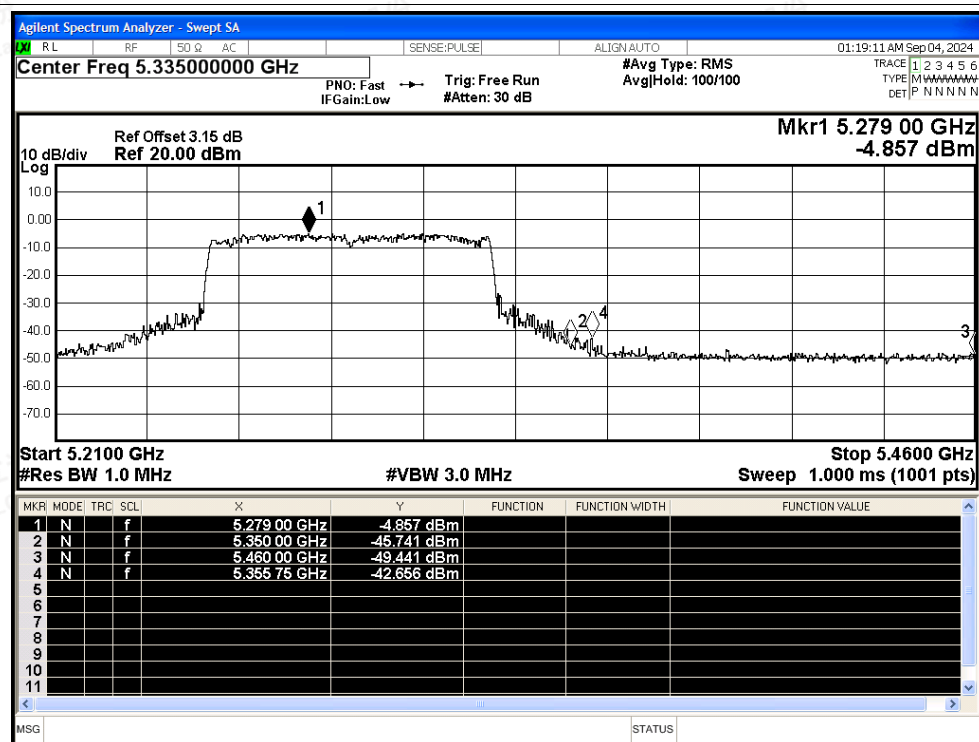

## Restrict Band NVNT ac80 5290MHz Ant2 Average

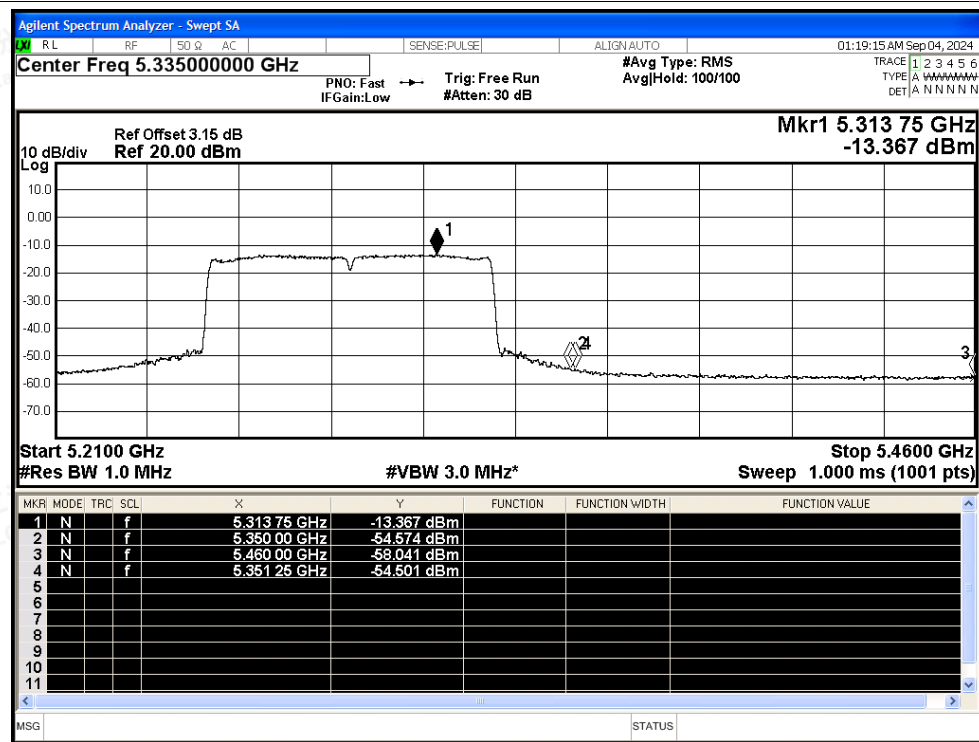

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## MIMO

| Condition | Mode | Frequency (MHz) | Spur Freq (MHz) | Ant1 Power (dBm) | Ant2 Power (dBm) | Gain (dBi) | E (dBuV/m) | Detector | Limit (dBuV/m) | Verdict |
|-----------|------|-----------------|-----------------|------------------|------------------|------------|------------|----------|----------------|---------|
| NVNT      | n20  | 5260            | 4500            | -50.37           | -50.96           | 5.52       | 53.10      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5260            | 4500            | -59.2            | -58.71           | 5.52       | 44.81      | Average  | 54             | Pass    |
| NVNT      | n20  | 5260            | 4786.26         | -45.7            | -45.34           | 5.52       | 58.24      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5260            | 4787.82         | -53.55           | -54.89           | 5.52       | 49.59      | Average  | 54             | Pass    |
| NVNT      | n20  | 5260            | 5150            | -48.37           | -48.1            | 5.52       | 55.52      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5260            | 5150            | -56.44           | -56.83           | 5.52       | 47.13      | Average  | 54             | Pass    |
| NVNT      | n20  | 5320            | 5350            | -45.83           | -43.49           | 5.52       | 59.25      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5320            | 5350            | -55.72           | -54.17           | 5.52       | 48.88      | Average  | 54             | Pass    |
| NVNT      | n20  | 5320            | 5352.4          | -41.31           | -35.62           | 5.52       | 66.16      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5320            | 5350.2          | -55.6            | -52.93           | 5.52       | 49.69      | Average  | 54             | Pass    |
| NVNT      | n20  | 5320            | 5460            | -49.07           | -50.4            | 5.52       | 54.07      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5320            | 5460            | -58.06           | -57.78           | 5.52       | 45.84      | Average  | 54             | Pass    |
| NVNT      | n40  | 5270            | 4500            | -50.82           | -50.48           | 5.52       | 53.11      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5270            | 4500            | -59.34           | -58.67           | 5.52       | 44.77      | Average  | 54             | Pass    |
| NVNT      | n40  | 5270            | 4772.97         | -43.55           | -43.7            | 5.52       | 60.13      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5270            | 4806.99         | -51.67           | -52.42           | 5.52       | 51.73      | Average  | 54             | Pass    |
| NVNT      | n40  | 5270            | 5150            | -49.05           | -48.74           | 5.52       | 54.87      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5270            | 5150            | -57.16           | -57.14           | 5.52       | 46.61      | Average  | 54             | Pass    |
| NVNT      | n40  | 5310            | 5350            | -42.95           | -44.75           | 5.52       | 60.00      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5310            | 5350            | -55.97           | -55.59           | 5.52       | 47.98      | Average  | 54             | Pass    |
| NVNT      | n40  | 5310            | 5350.2          | -42.45           | -41.88           | 5.52       | 61.60      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5310            | 5352            | -55.35           | -55.19           | 5.52       | 48.49      | Average  | 54             | Pass    |
| NVNT      | n40  | 5310            | 5460            | -49.54           | -50.32           | 5.52       | 53.85      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5310            | 5460            | -57.94           | -58.06           | 5.52       | 45.76      | Average  | 54             | Pass    |
| NVNT      | ac20 | 5260            | 4500            | -51.49           | -50              | 5.52       | 53.08      | Peak     | 68.2           | Pass    |
| NVNT      | ac20 | 5260            | 4500            | -58.75           | -59.08           | 5.52       | 44.85      | Average  | 54             | Pass    |
| NVNT      | ac20 | 5260            | 4787.04         | -45.97           | -46.31           | 5.52       | 57.62      | Peak     | 68.2           | Pass    |
| NVNT      | ac20 | 5260            | 4787.82         | -54.45           | -55.32           | 5.52       | 48.89      | Average  | 54             | Pass    |
| NVNT      | ac20 | 5260            | 5150            | -48.49           | -47.19           | 5.52       | 55.97      | Peak     | 68.2           | Pass    |
| NVNT      | ac20 | 5260            | 5150            | -56.47           | -56.73           | 5.52       | 47.16      | Average  | 54             | Pass    |
| NVNT      | ac20 | 5320            | 5350            | -45.34           | -41.86           | 5.52       | 60.50      | Peak     | 68.2           | Pass    |
| NVNT      | ac20 | 5320            | 5350            | -54.95           | -52.52           | 5.52       | 50.19      | Average  | 54             | Pass    |
| NVNT      | ac20 | 5320            | 5350.6          | -41.68           | -36.81           | 5.52       | 65.16      | Peak     | 68.2           | Pass    |
| NVNT      | ac20 | 5320            | 5351            | -53.55           | -52.52           | 5.52       | 50.75      | Average  | 54             | Pass    |
| NVNT      | ac20 | 5320            | 5460            | -48.83           | -49.8            | 5.52       | 54.47      | Peak     | 68.2           | Pass    |
| NVNT      | ac20 | 5320            | 5460            | -57.57           | -57.84           | 5.52       | 46.05      | Average  | 54             | Pass    |
| NVNT      | ac40 | 5310            | 4500            | -51.53           | -51.34           | 5.52       | 52.32      | Peak     | 68.2           | Pass    |
| NVNT      | ac40 | 5310            | 4500            | -59.18           | -59.1            | 5.52       | 44.62      | Average  | 54             | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |         |        |        |      |       |         |      |      |
|------|------|------|---------|--------|--------|------|-------|---------|------|------|
| NVNT | ac40 | 5310 | 4806.99 | -43.79 | -44.69 | 5.52 | 59.54 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 4807.8  | -52.81 | -52.89 | 5.52 | 50.91 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5150    | -48.49 | -49.87 | 5.52 | 54.63 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5150    | -56.94 | -57.38 | 5.52 | 46.60 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5350    | -45.98 | -40.1  | 5.52 | 61.65 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5350    | -56.24 | -53.73 | 5.52 | 48.95 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5350.4  | -43.35 | -40.1  | 5.52 | 62.33 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5351.4  | -55.82 | -53.43 | 5.52 | 49.30 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5460    | -50.99 | -49.01 | 5.52 | 53.87 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5460    | -57.59 | -57.42 | 5.52 | 46.25 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 4500    | -50.2  | -51.5  | 5.52 | 52.96 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 4500    | -59.03 | -59.52 | 5.52 | 44.49 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5141.19 | -45.37 | -46.36 | 5.52 | 57.92 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5149.89 | -55.28 | -55.86 | 5.52 | 48.20 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5150    | -45.61 | -46.5  | 5.52 | 57.73 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5150    | -55.28 | -56.14 | 5.52 | 48.07 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5350    | -41.35 | -45.74 | 5.52 | 60.75 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5350    | -54.64 | -54.57 | 5.52 | 49.15 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5350    | -41.35 | -42.66 | 5.52 | 61.80 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5350    | -54.64 | -54.5  | 5.52 | 49.19 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5460    | -50.72 | -49.44 | 5.52 | 53.72 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5460    | -57.49 | -58.04 | 5.52 | 46.00 | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## E.5 Frequency Stability

| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5260            | Ant1    | 5260                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5300            | Ant1    | 5300                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | n20  | 5300            | Ant1    | 5299.96                  | -40000               | -7.55           | 25          | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5260            | Ant1    | 5260                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5300            | Ant1    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | ac20 | 5320            | Ant1    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5270            | Ant1    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5310            | Ant1    | 5309.96                  | -40000               | -7.53           | 25          | Pass    |
| NVNT      | ac80 | 5290            | Ant1    | 5290                     | 0                    | 0               | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Freq. Stability NVNT a 5260MHz Ant1

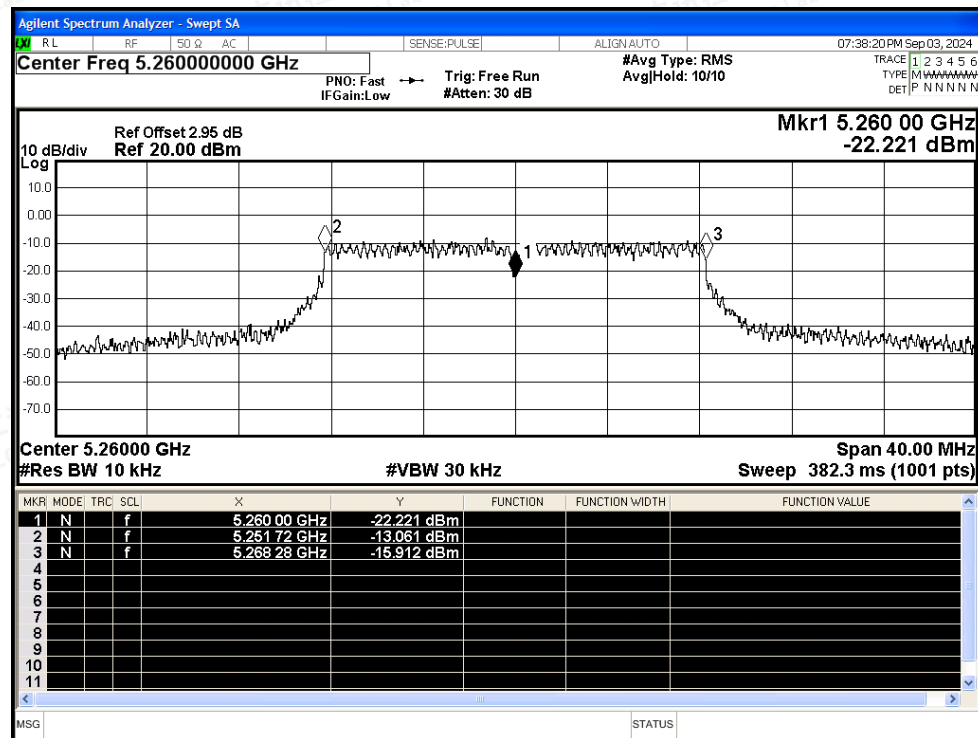

## Freq. Stability NVNT a 5300MHz Ant1

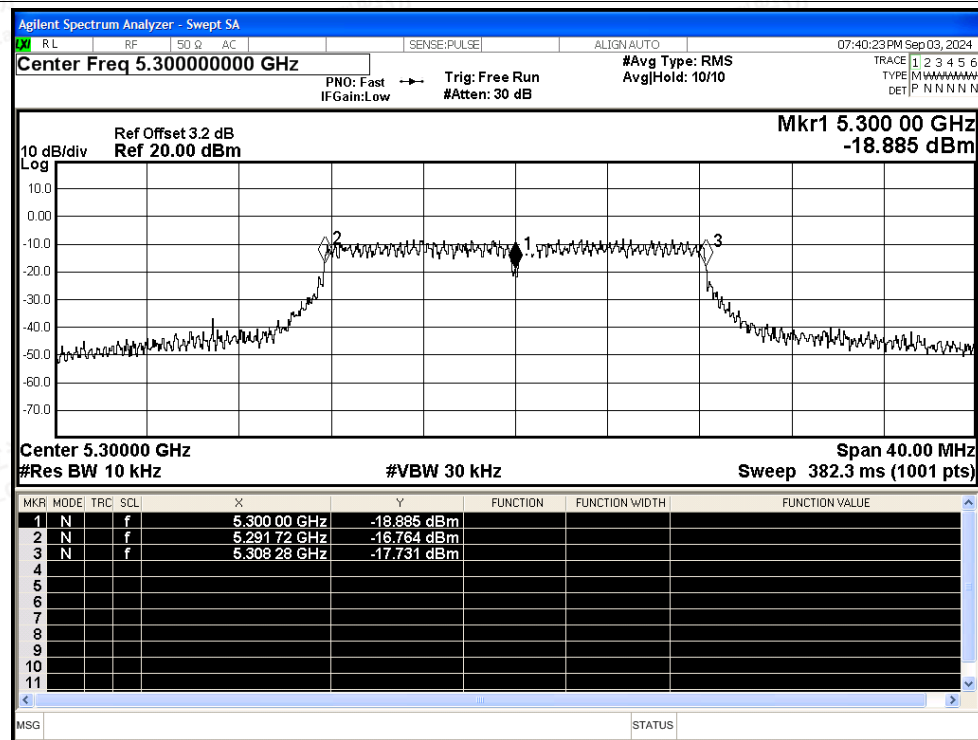

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5320MHz Ant1

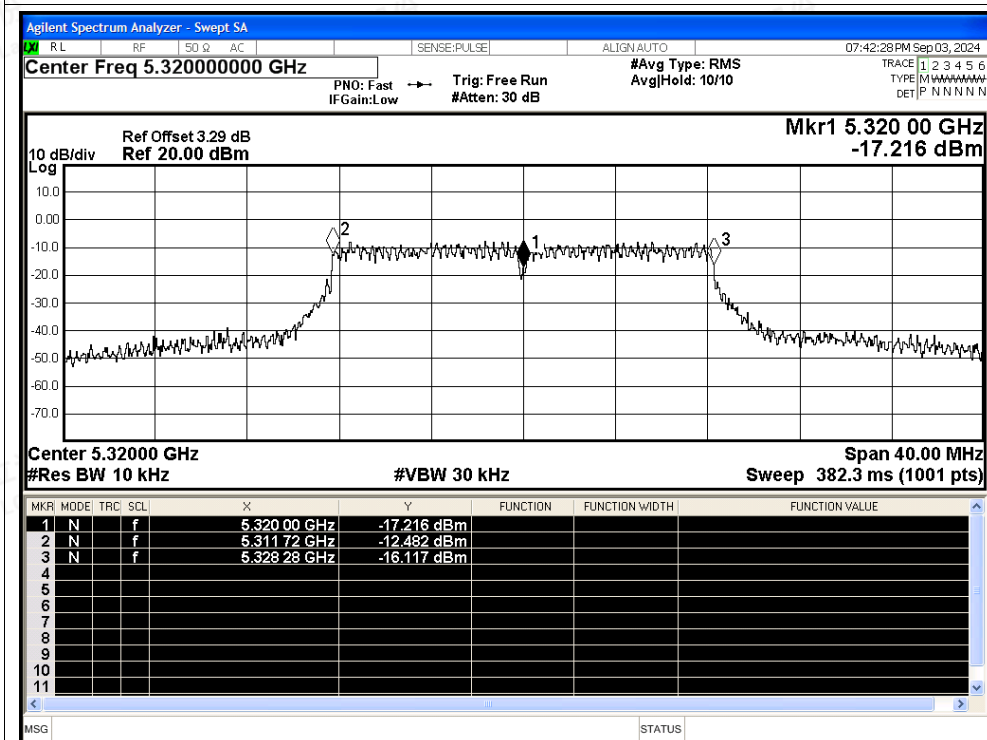

## Freq. Stability NVNT n20 5260MHz Ant1

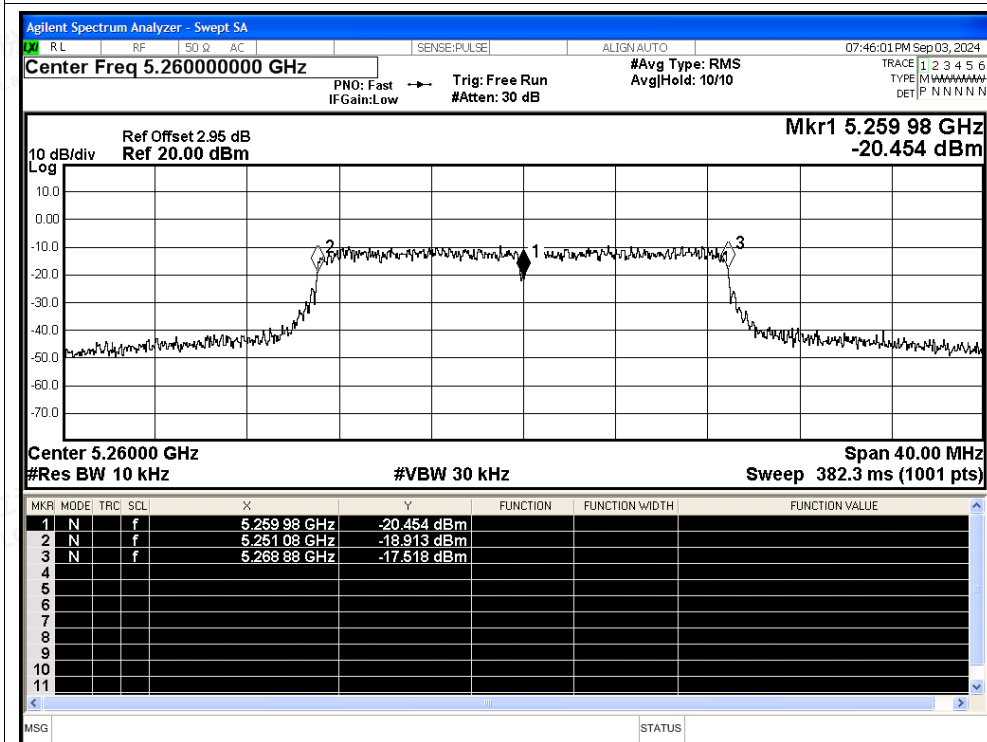

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5300MHz Ant1

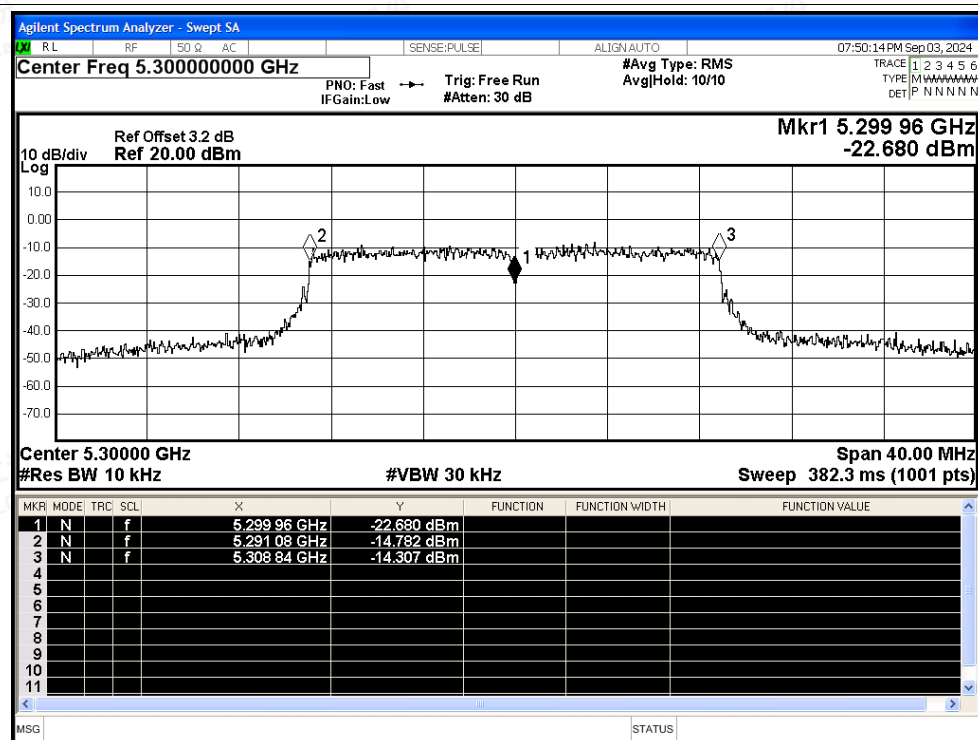

## Freq. Stability NVNT n20 5320MHz Ant1

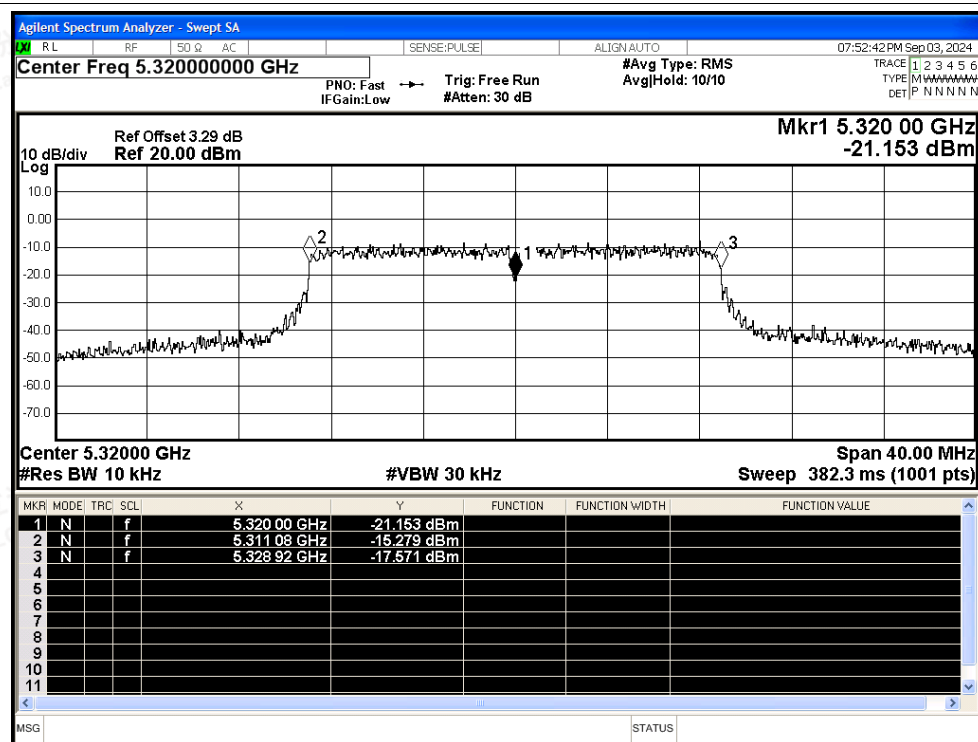

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5270MHz Ant1

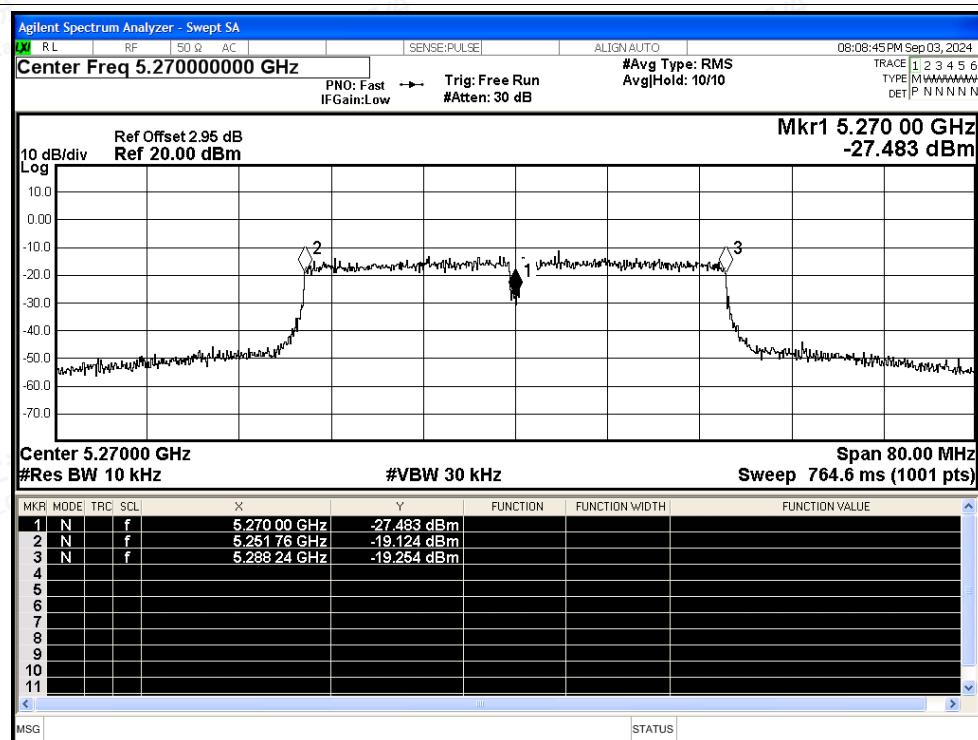

## Freq. Stability NVNT n40 5310MHz Ant1

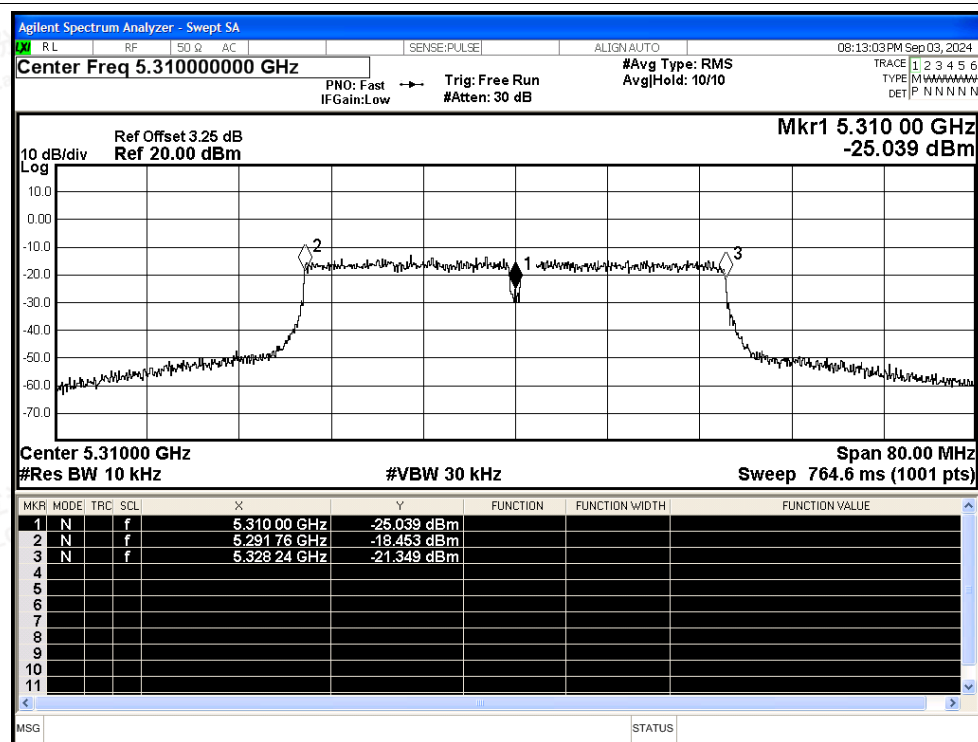

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5260MHz Ant1

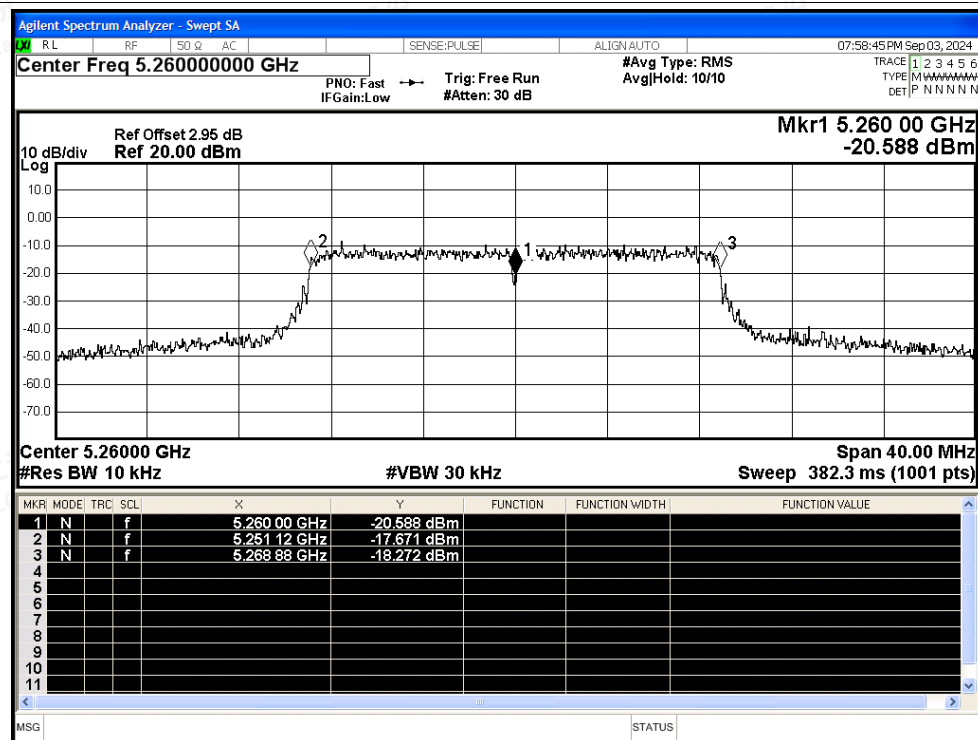

## Freq. Stability NVNT ac20 5300MHz Ant1

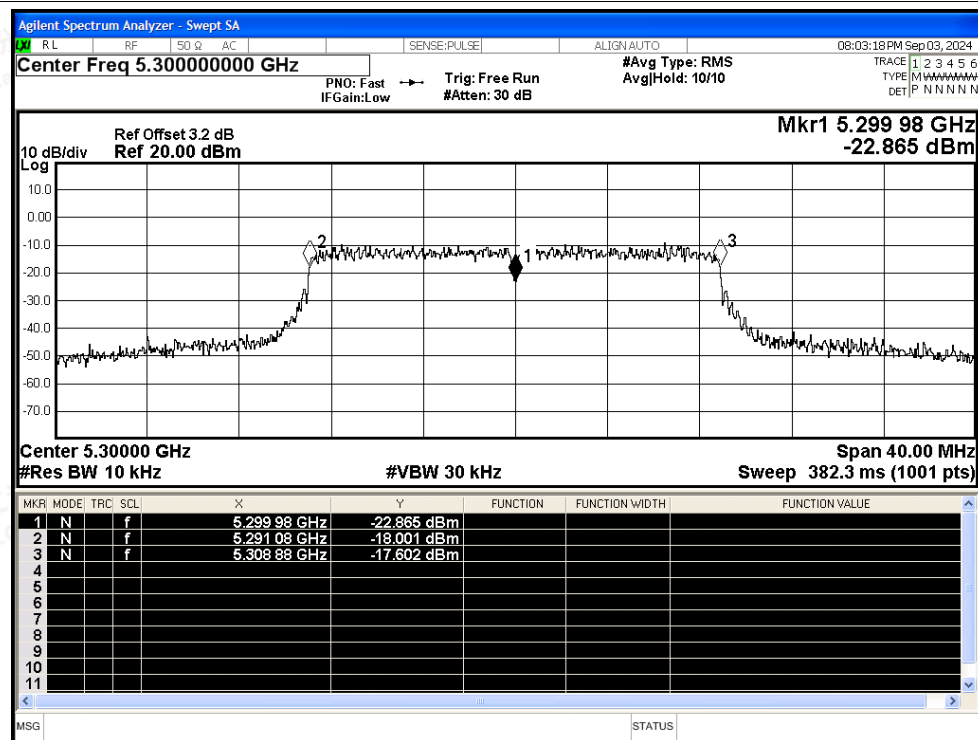

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5320MHz Ant1

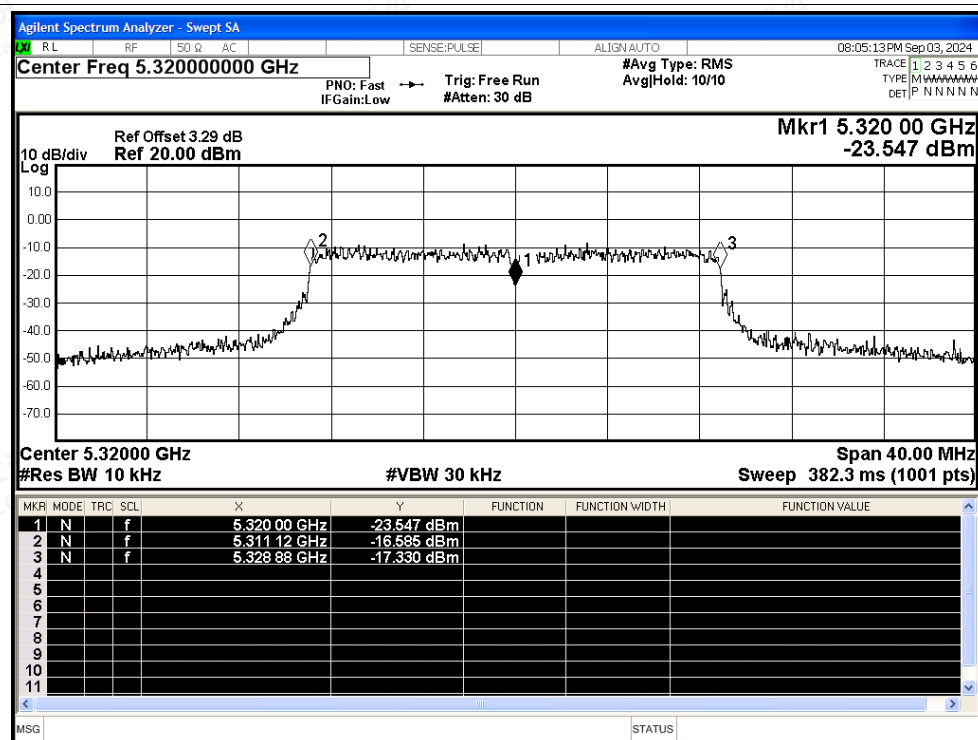

## Freq. Stability NVNT ac40 5270MHz Ant1

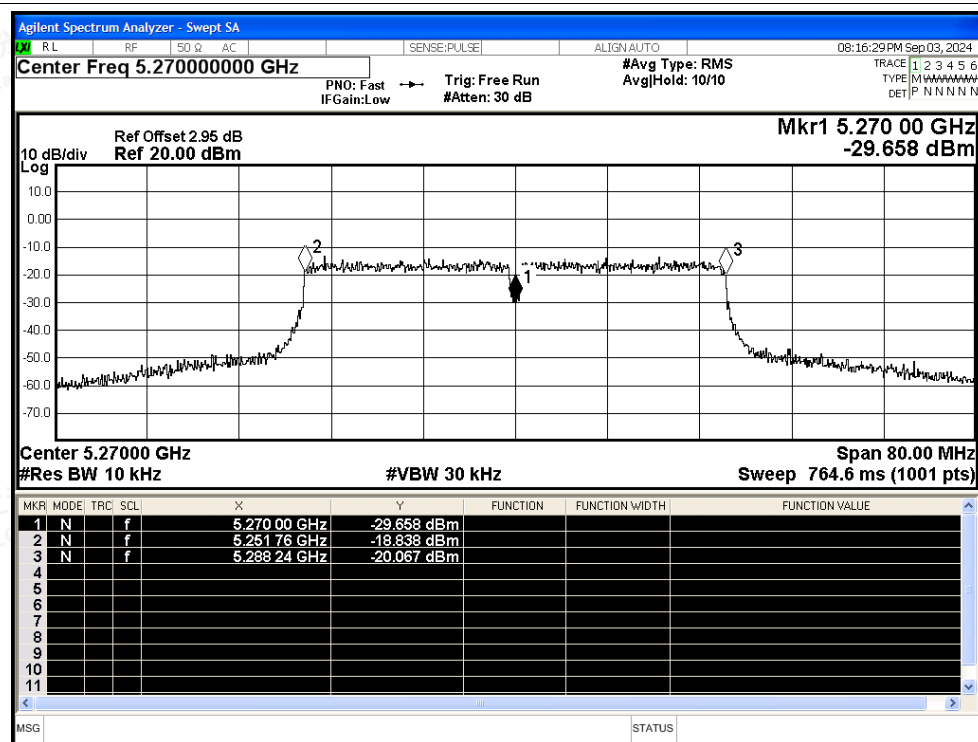

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5310MHz Ant1

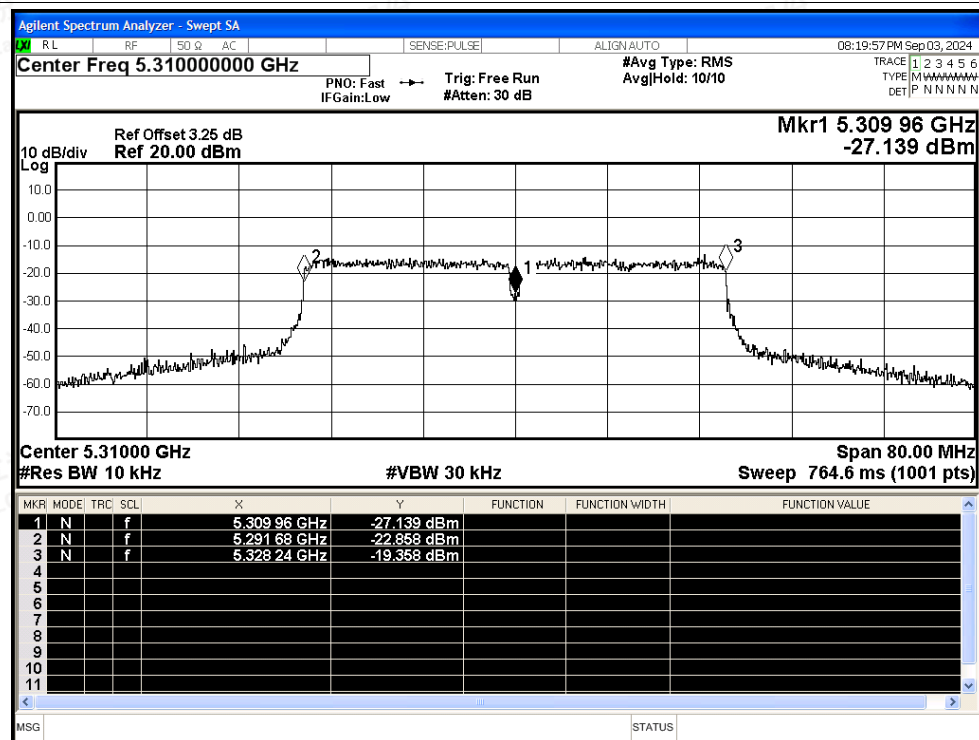

## Freq. Stability NVNT ac80 5290MHz Ant1

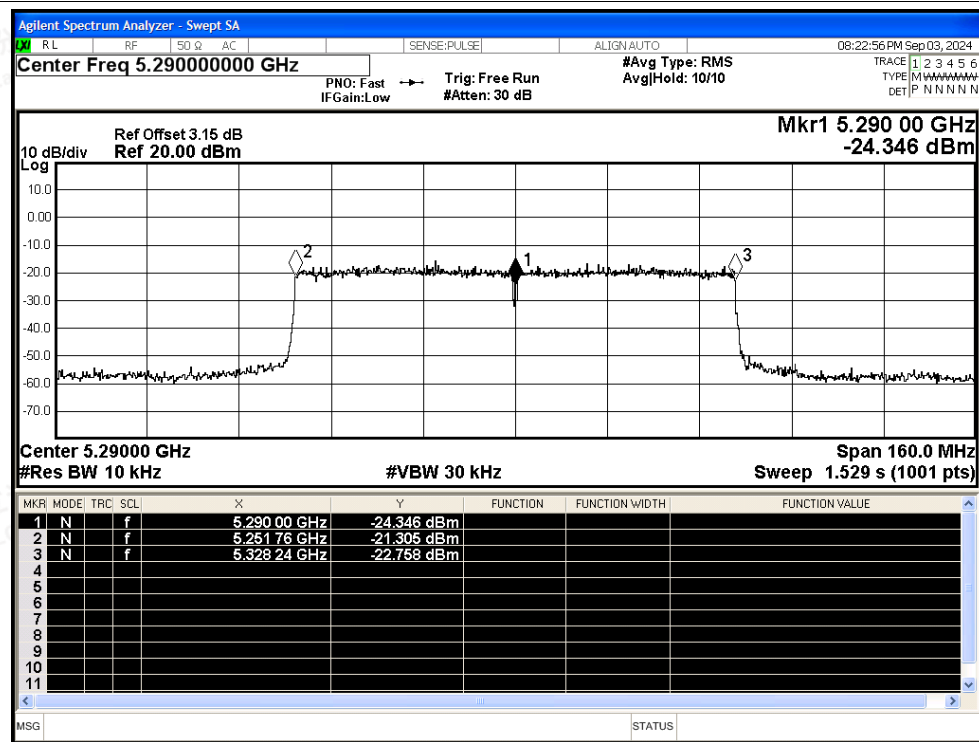

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5260            | Ant2    | 5260                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5300            | Ant2    | 5300                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5320            | Ant2    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5260            | Ant2    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | n20  | 5300            | Ant2    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | n20  | 5320            | Ant2    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | n40  | 5270            | Ant2    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | n40  | 5310            | Ant2    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5260            | Ant2    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ac20 | 5300            | Ant2    | 5299.96                  | -40000               | -7.55           | 25          | Pass    |
| NVNT      | ac20 | 5320            | Ant2    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | ac40 | 5270            | Ant2    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5310            | Ant2    | 5309.96                  | -40000               | -7.53           | 25          | Pass    |
| NVNT      | ac80 | 5290            | Ant2    | 5290                     | 0                    | 0               | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT a 5260MHz Ant2

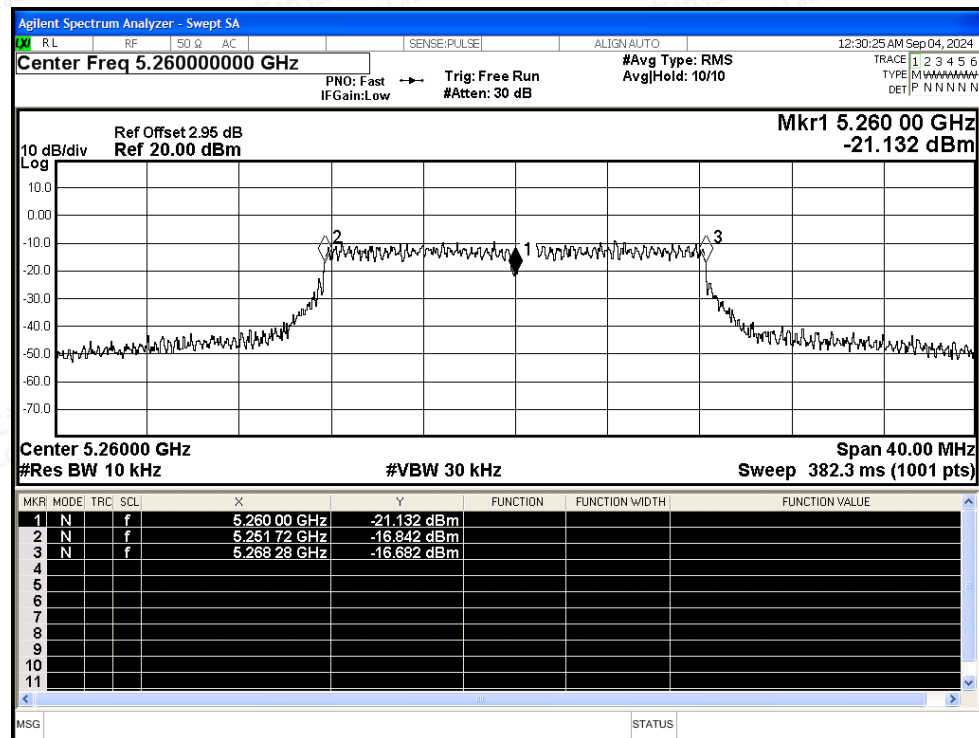

## Freq. Stability NVNT a 5300MHz Ant2

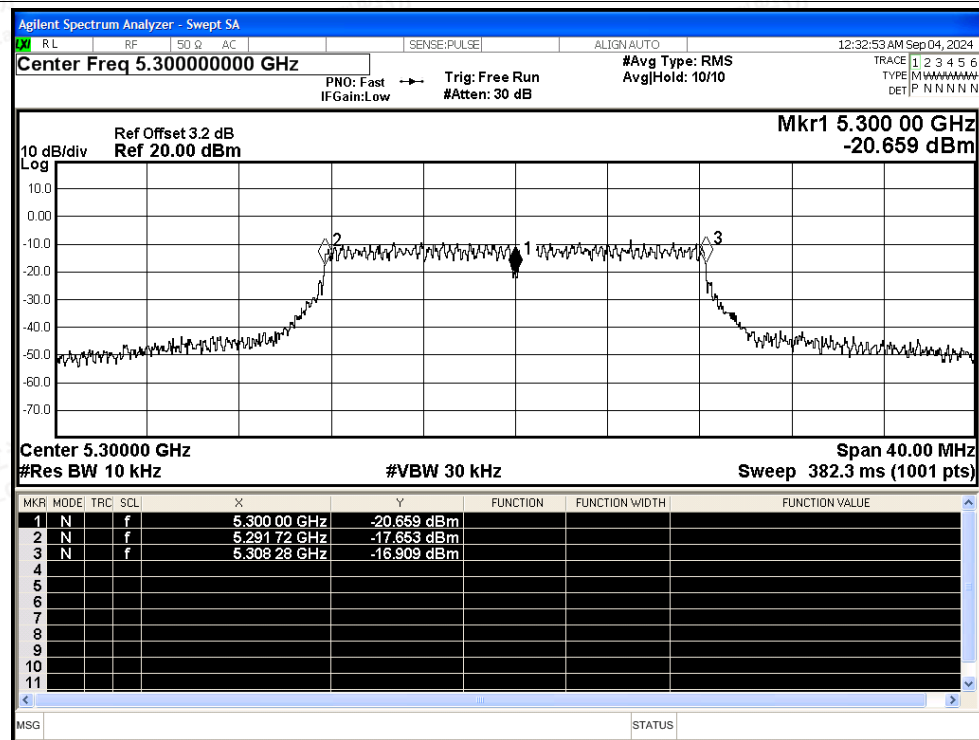

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5320MHz Ant2

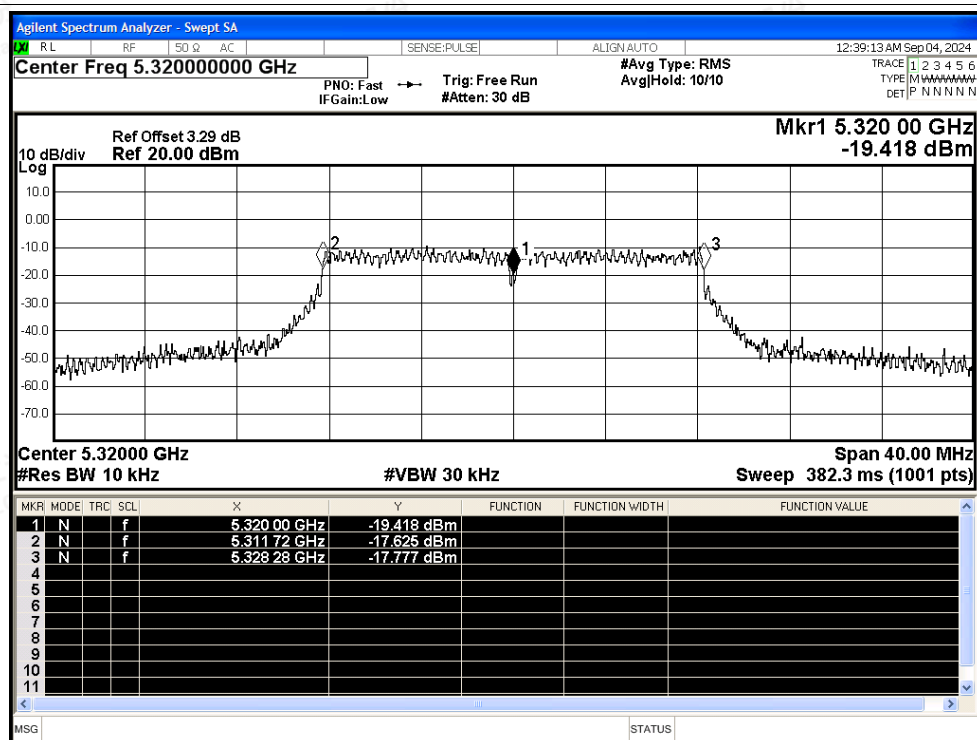

## Freq. Stability NVNT n20 5260MHz Ant2

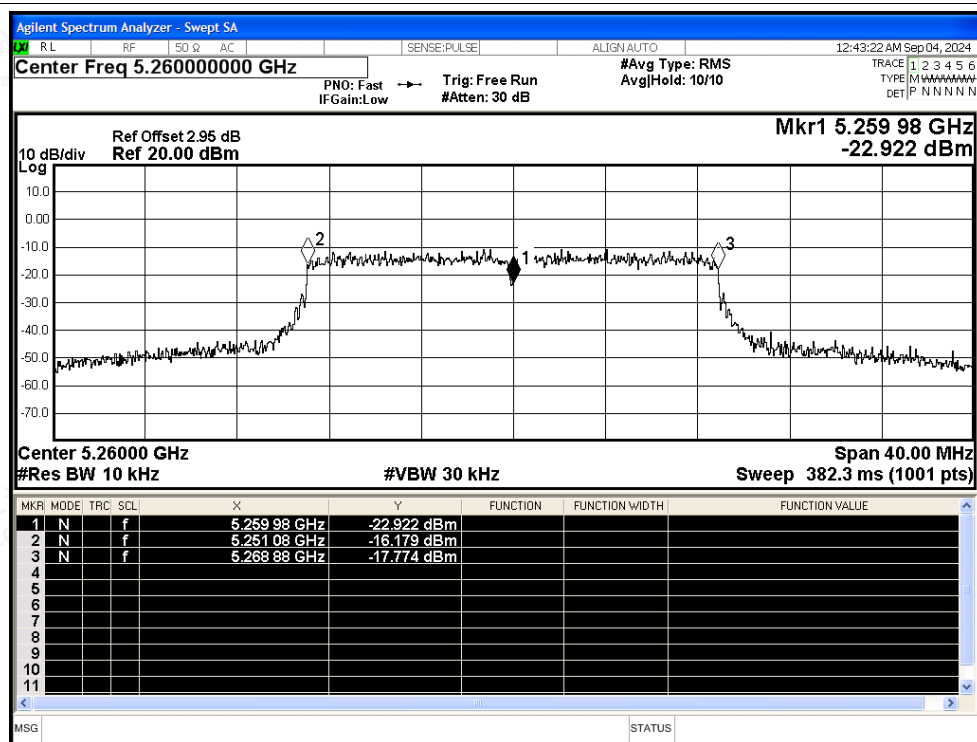

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5300MHz Ant2

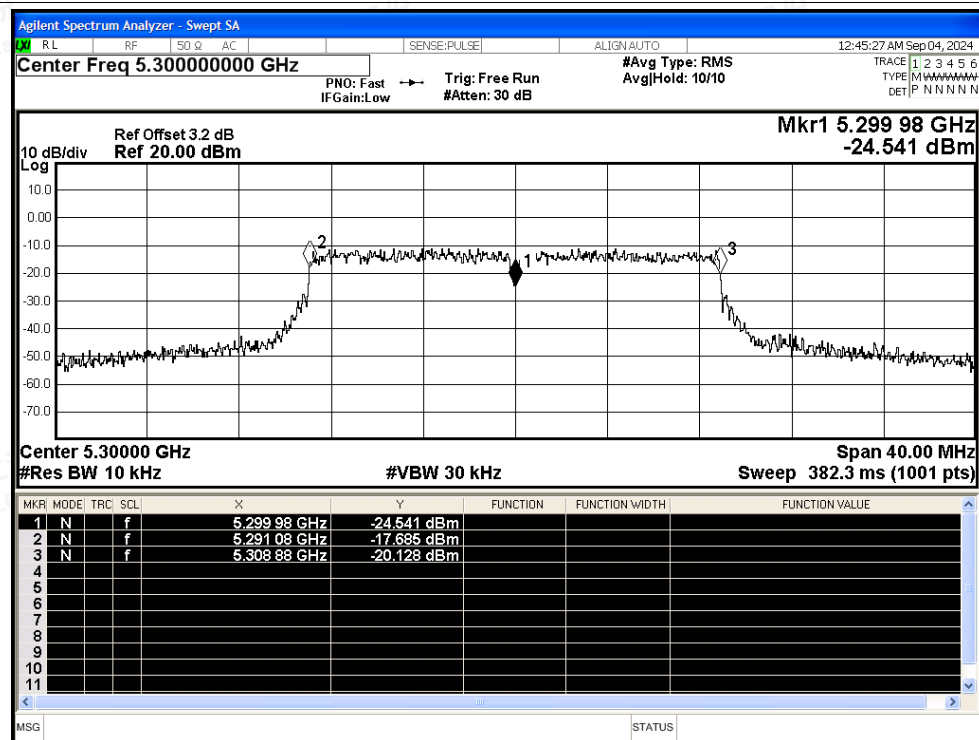

## Freq. Stability NVNT n20 5320MHz Ant2

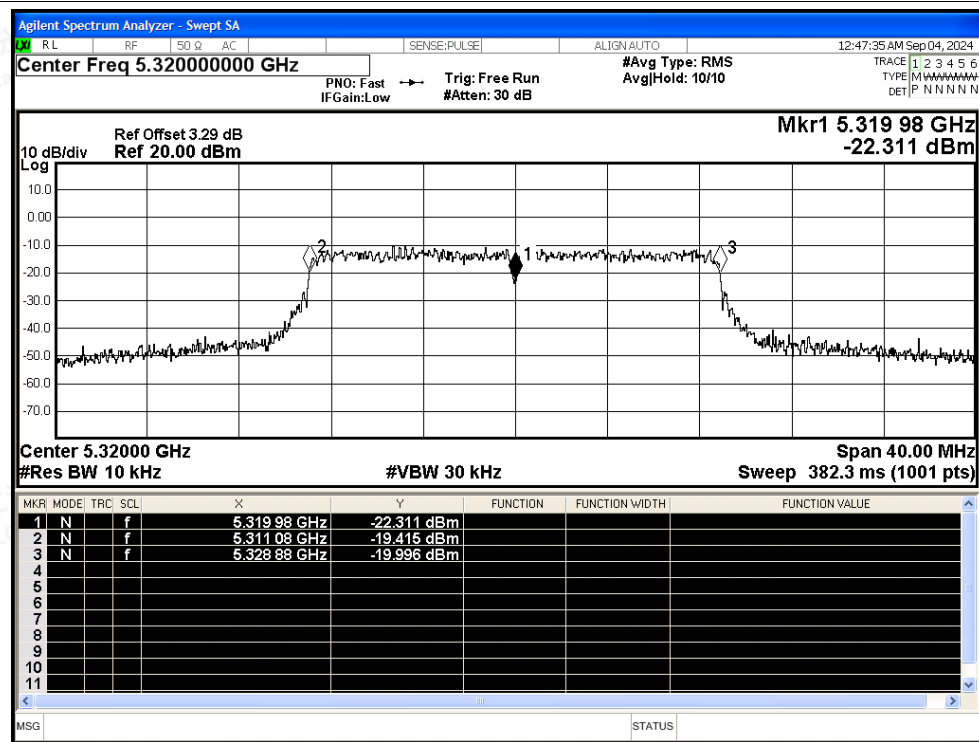

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5270MHz Ant2

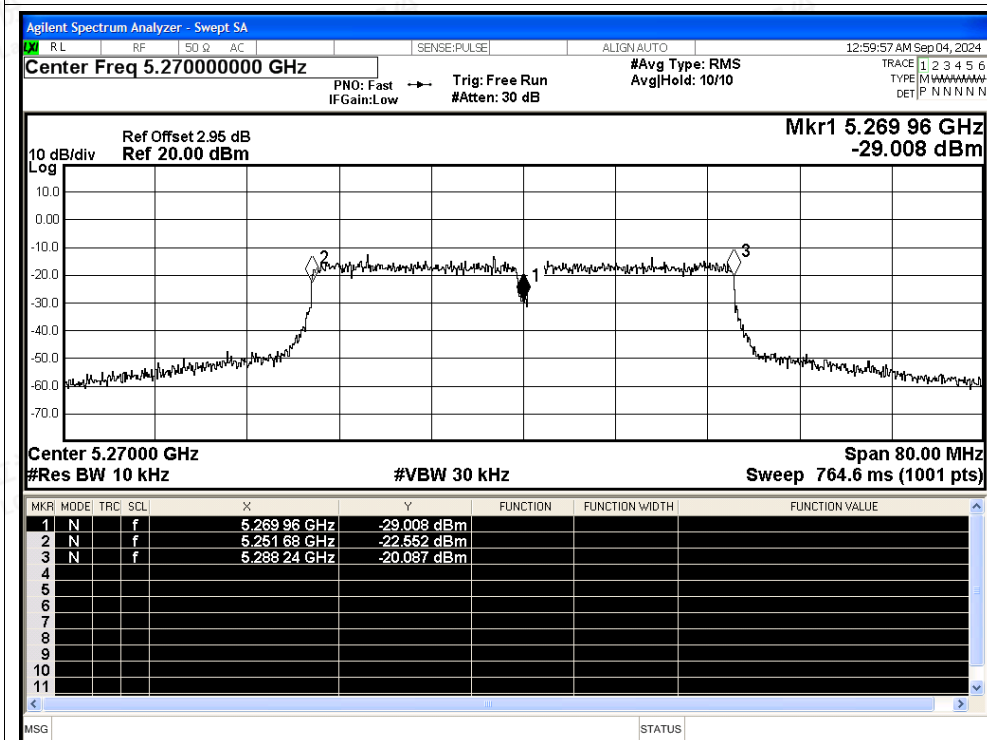

## Freq. Stability NVNT n40 5310MHz Ant2

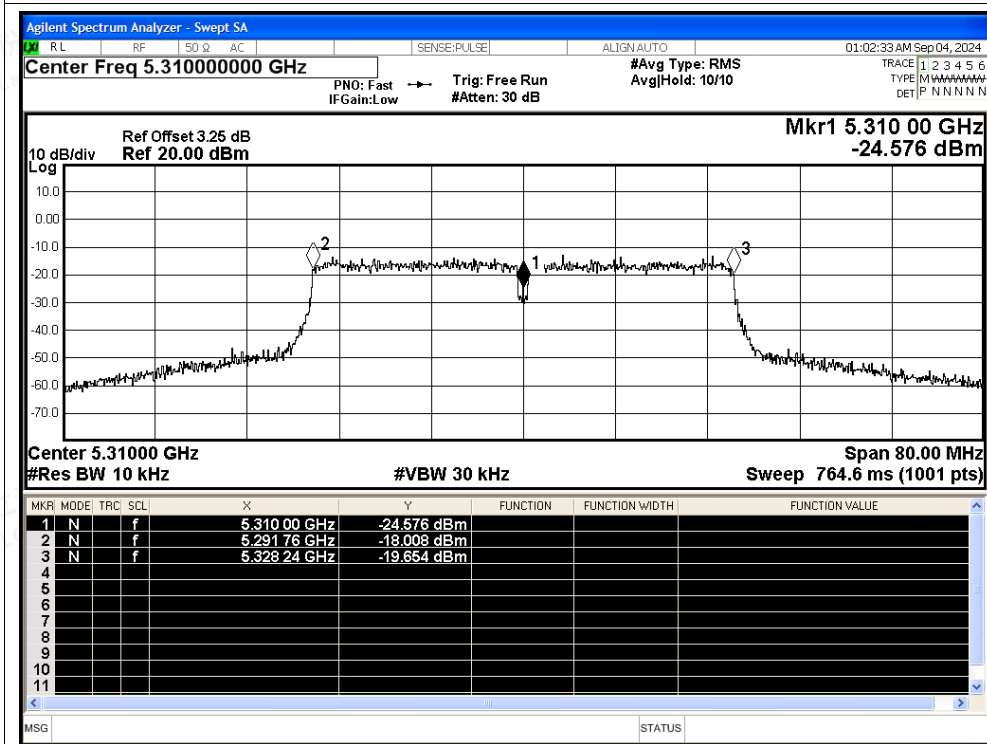

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5260MHz Ant2

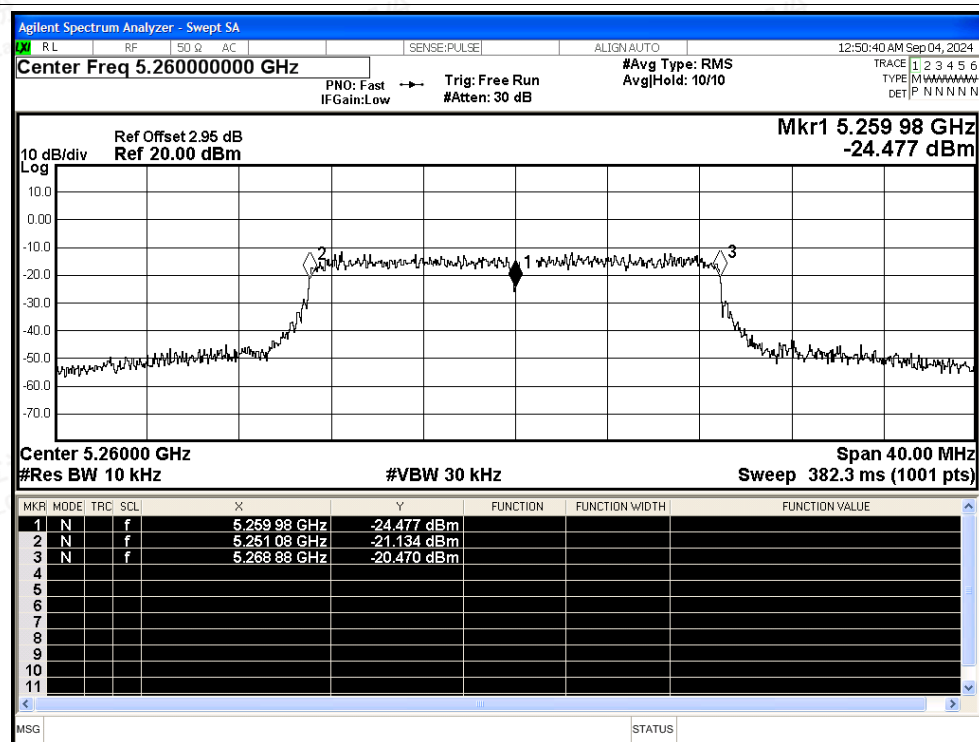

## Freq. Stability NVNT ac20 5300MHz Ant2

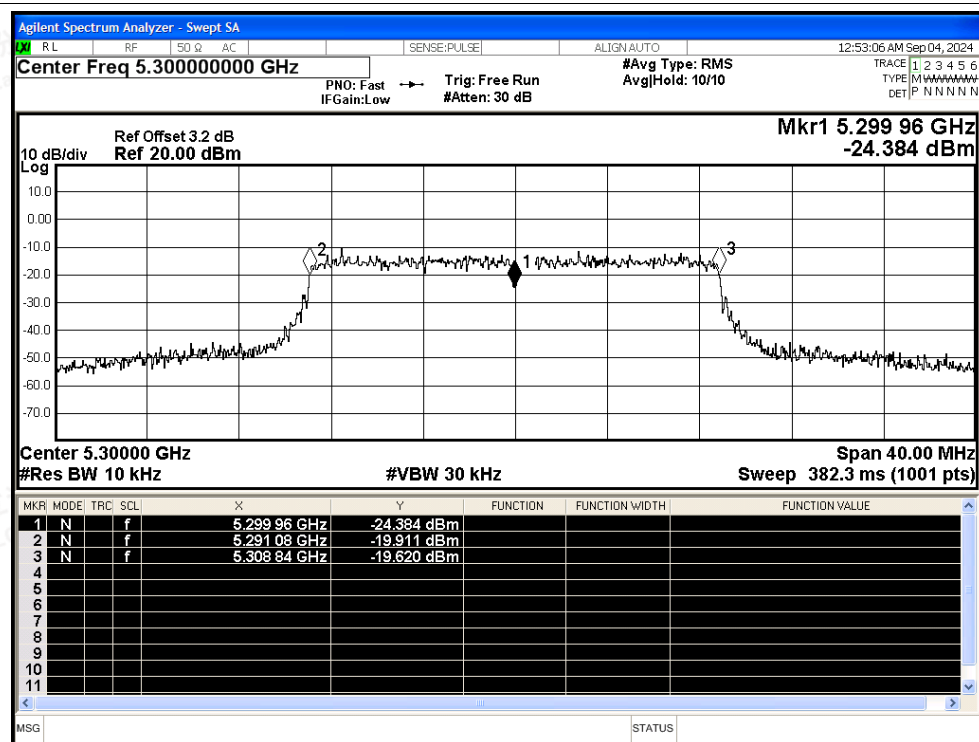

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5320MHz Ant2

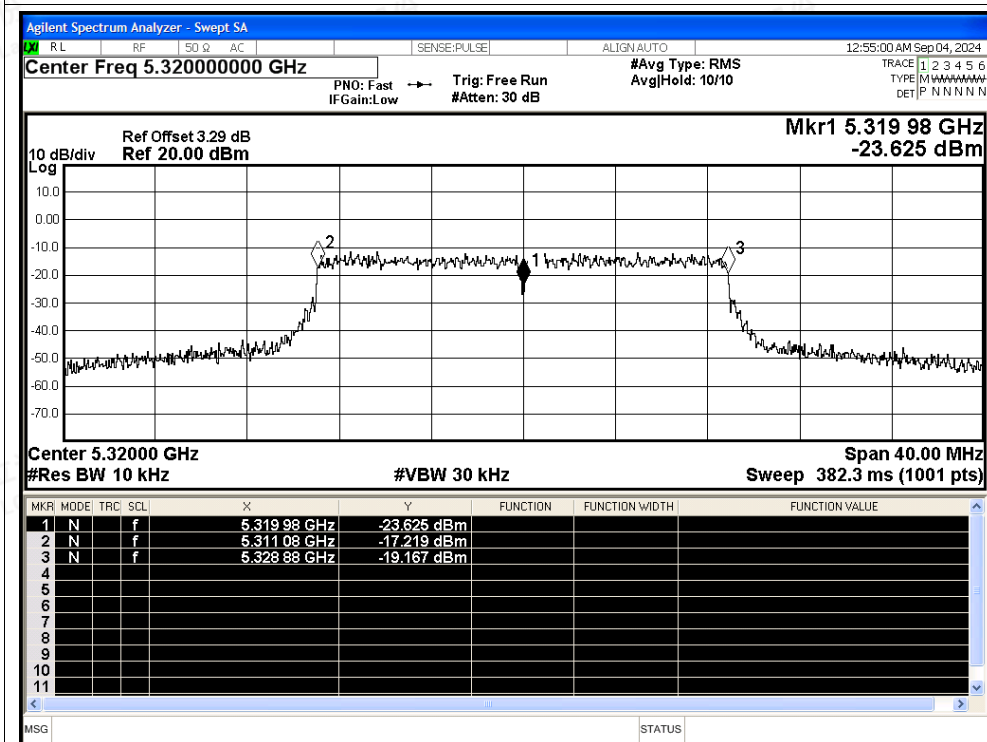

## Freq. Stability NVNT ac40 5270MHz Ant2

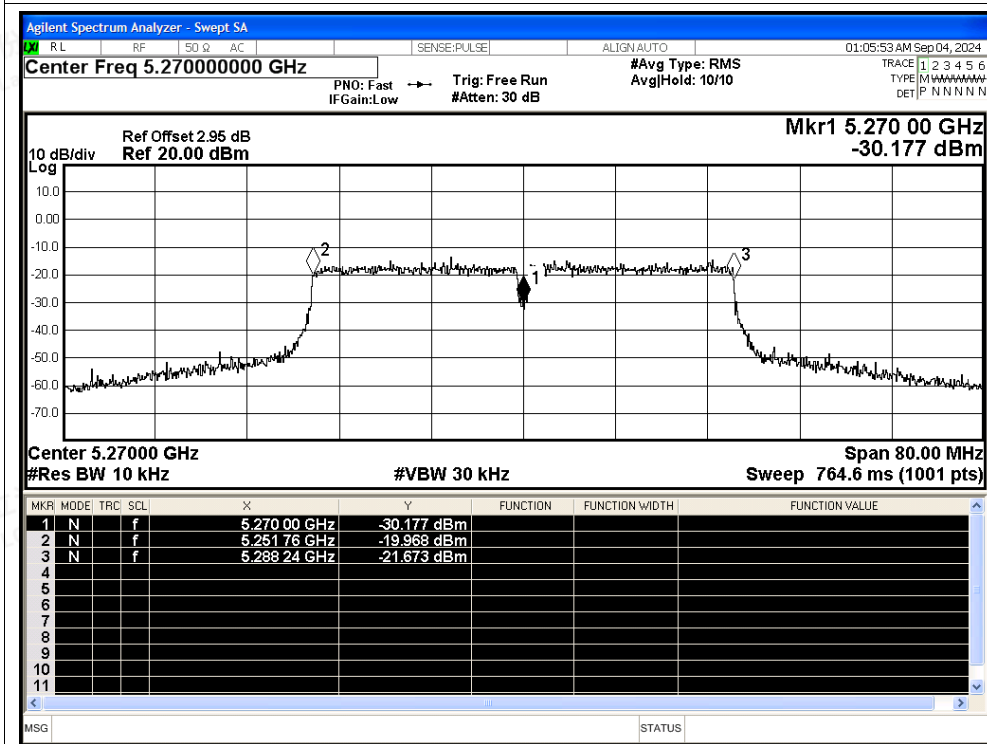

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5310MHz Ant2

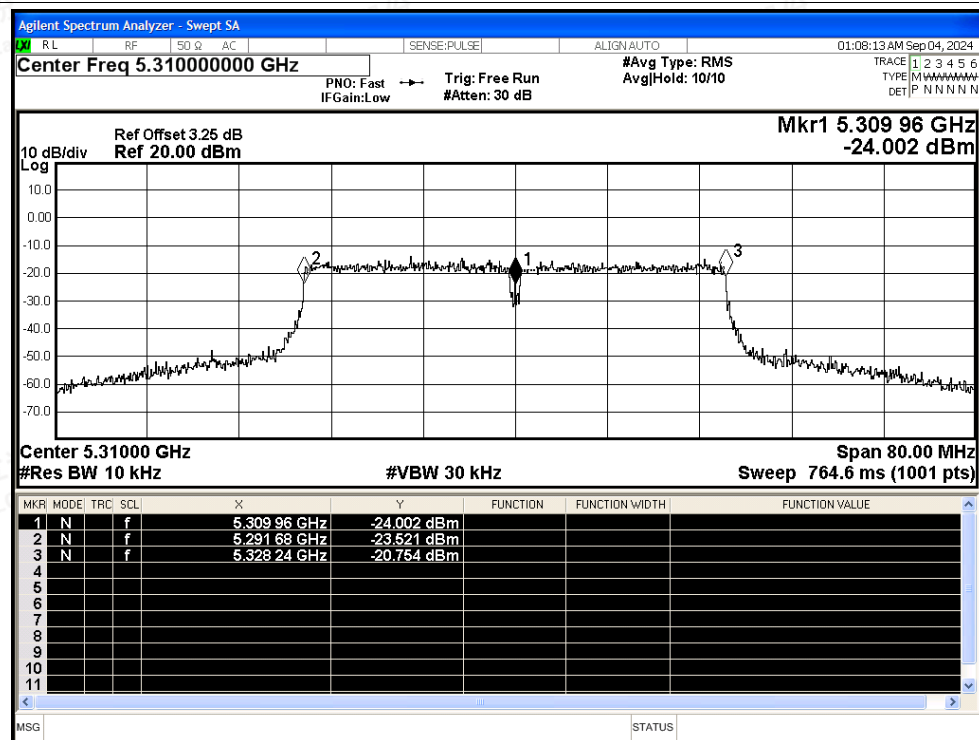

## Freq. Stability NVNT ac80 5290MHz Ant2

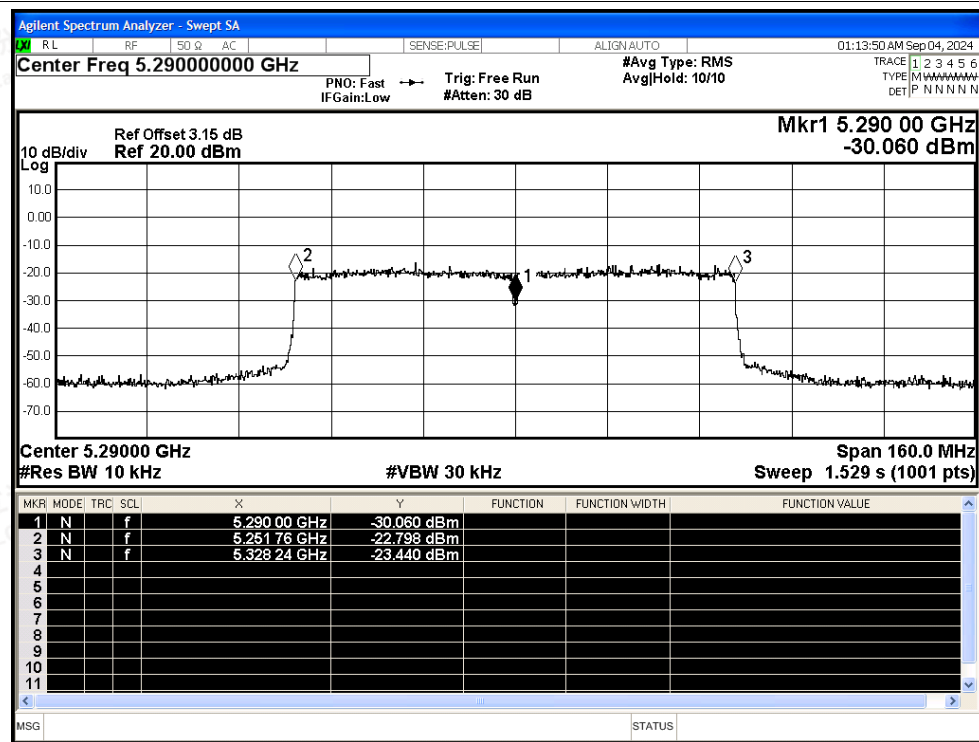

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## E.6 Duty Cycle


| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5260            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5300            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5320            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | n20  | 5260            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5300            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5320            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n40  | 5270            | Ant1    | 97.23          | 0.12                   | 0.46      |
| NVNT      | n40  | 5310            | Ant1    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac20 | 5260            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5300            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5320            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5270            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac40 | 5310            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac80 | 5290            | Ant1    | 94.32          | 0.25                   | 0.97      |






## Test Graphs

## Duty Cycle NVNT a 5260MHz Ant1

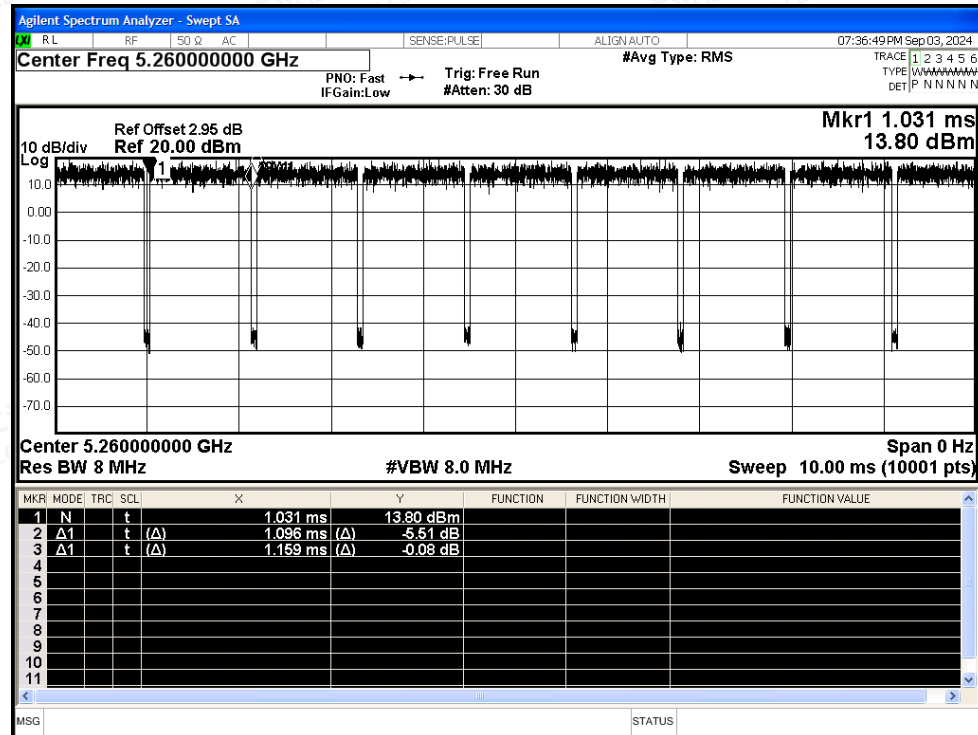

## Duty Cycle NVNT a 5300MHz Ant1

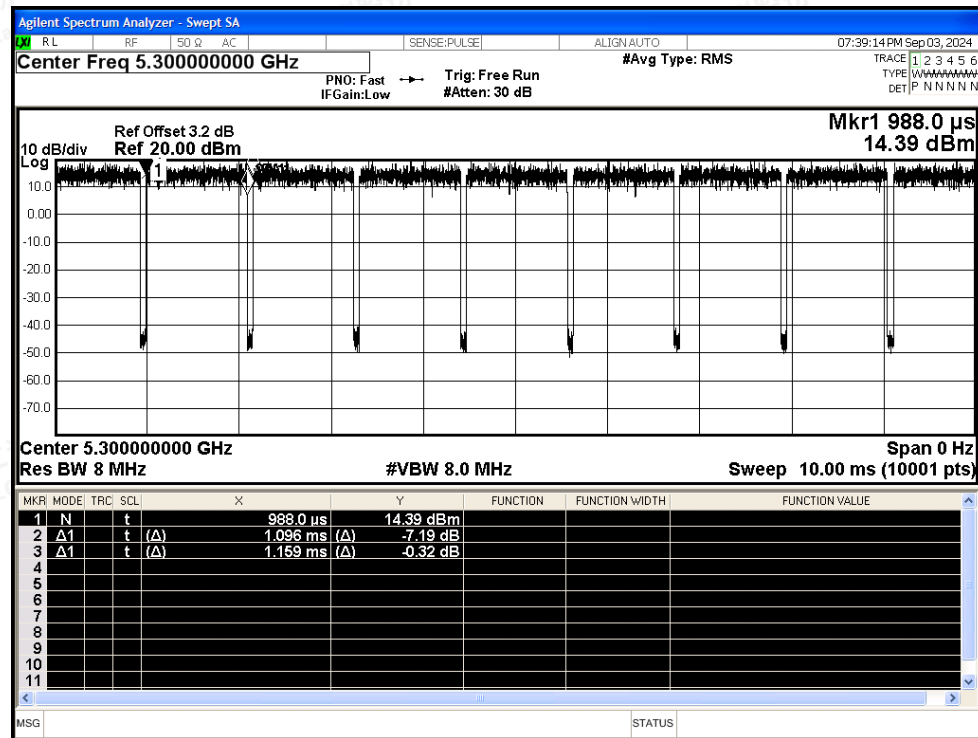

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5320MHz Ant1

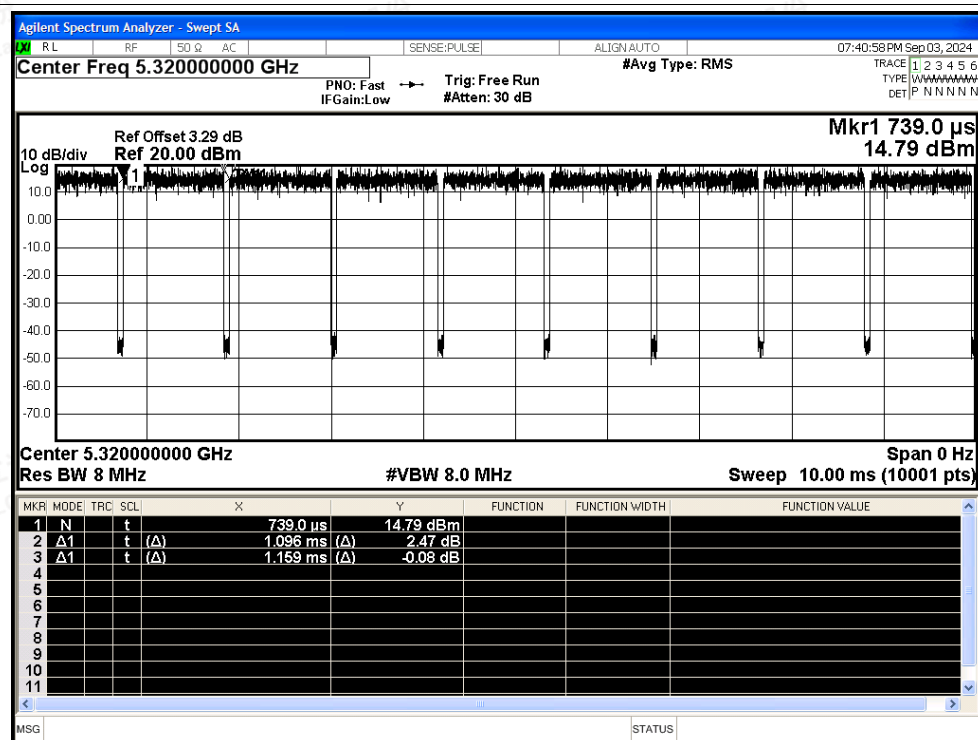

## Duty Cycle NVNT n20 5260MHz Ant1

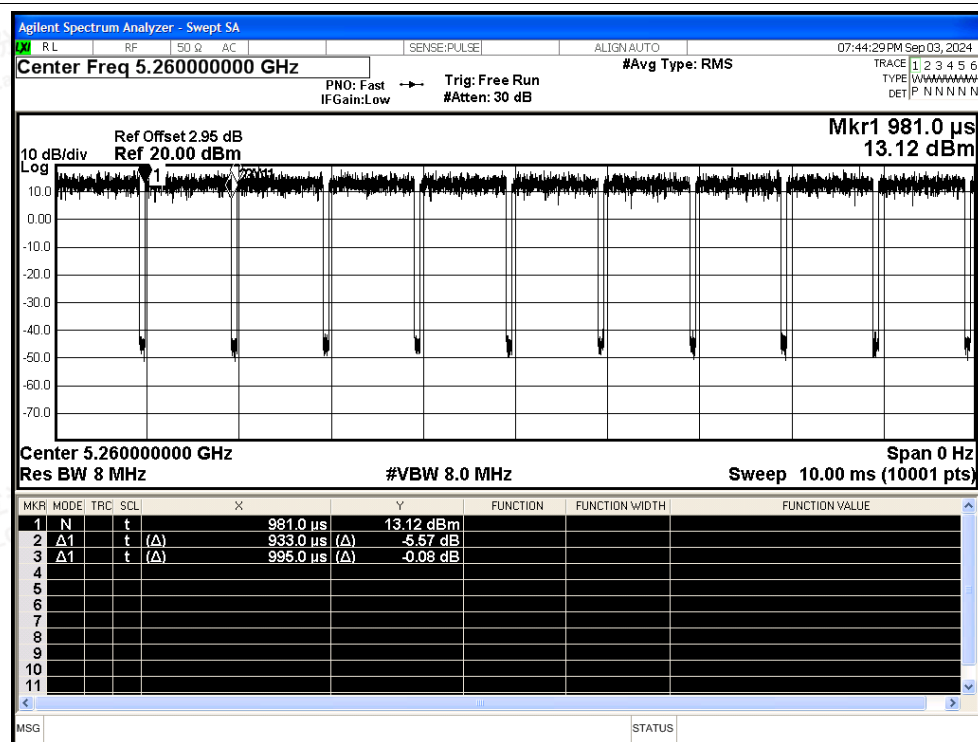

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5300MHz Ant1

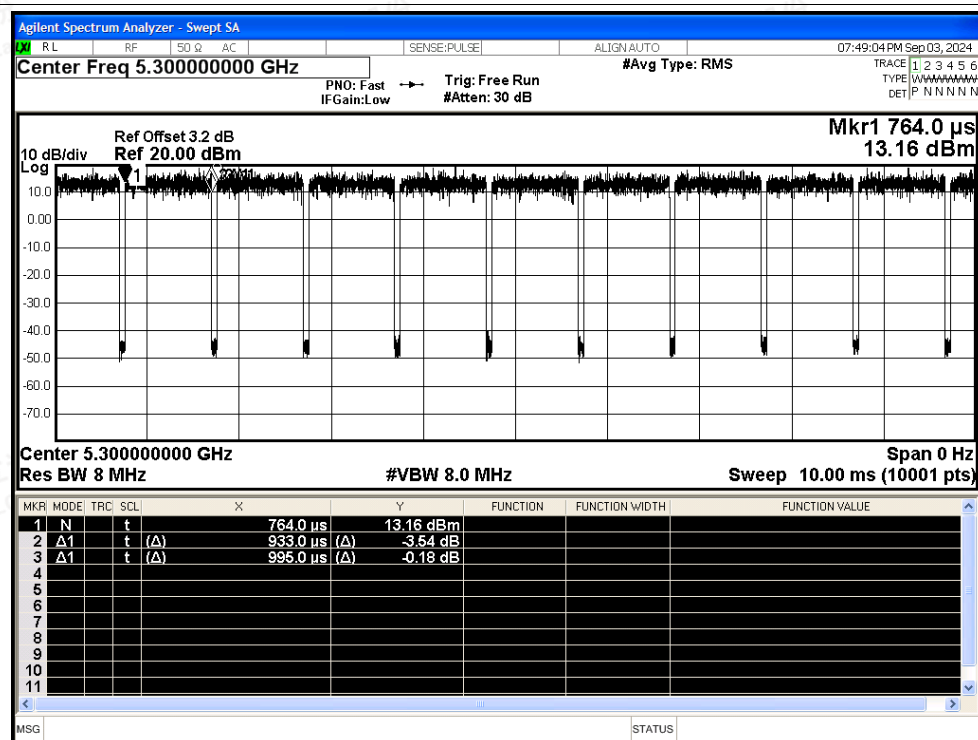

## Duty Cycle NVNT n20 5320MHz Ant1

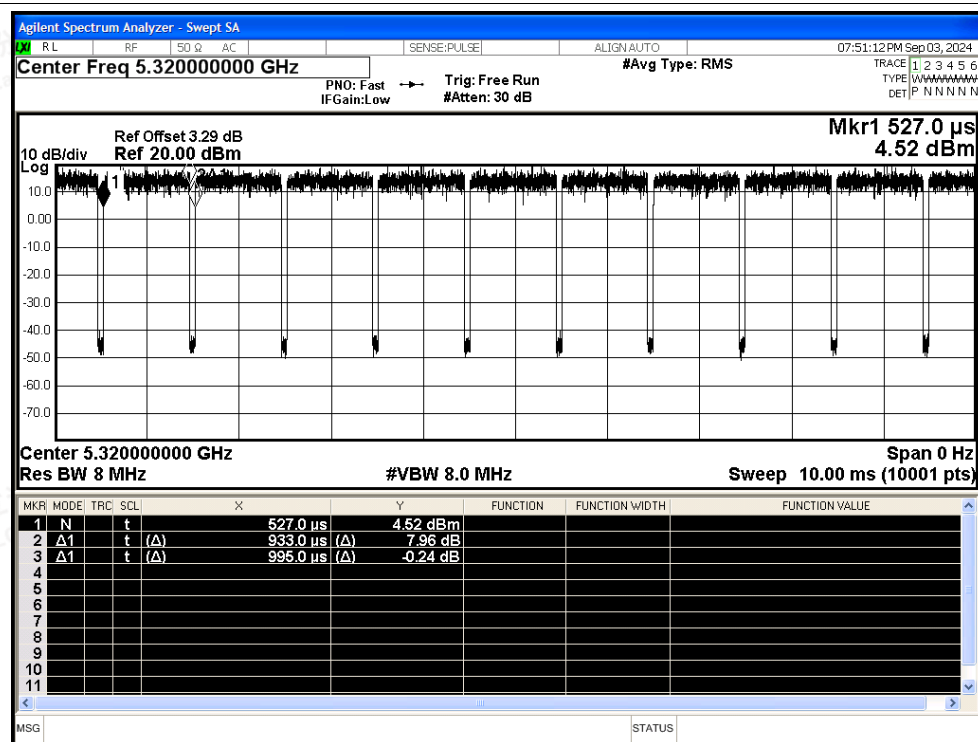

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5270MHz Ant1

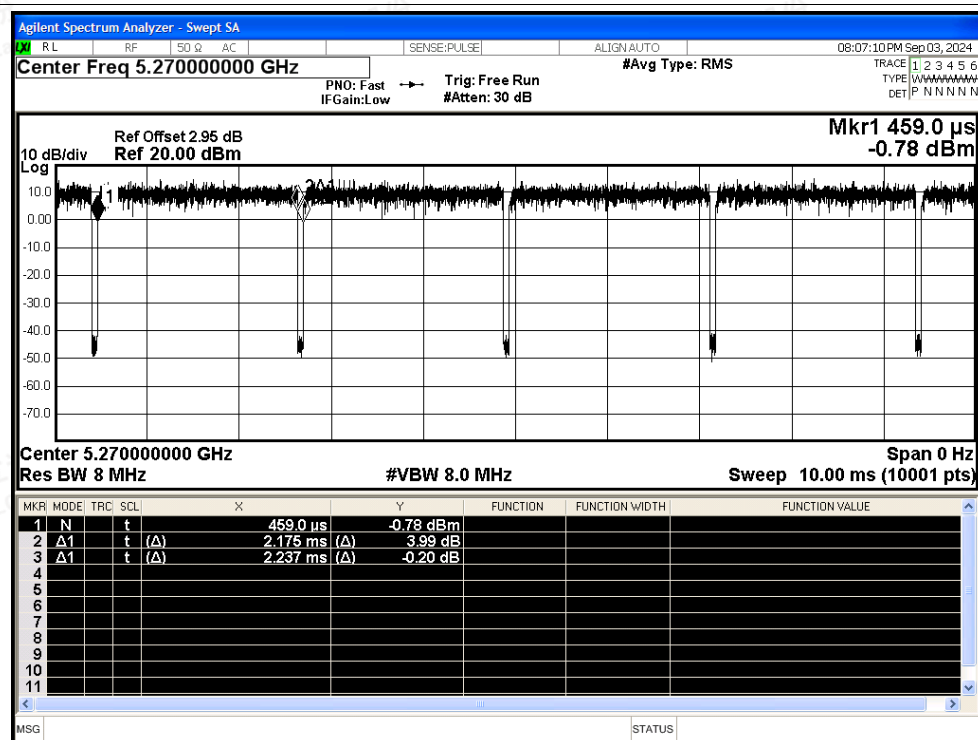

## Duty Cycle NVNT n40 5310MHz Ant1

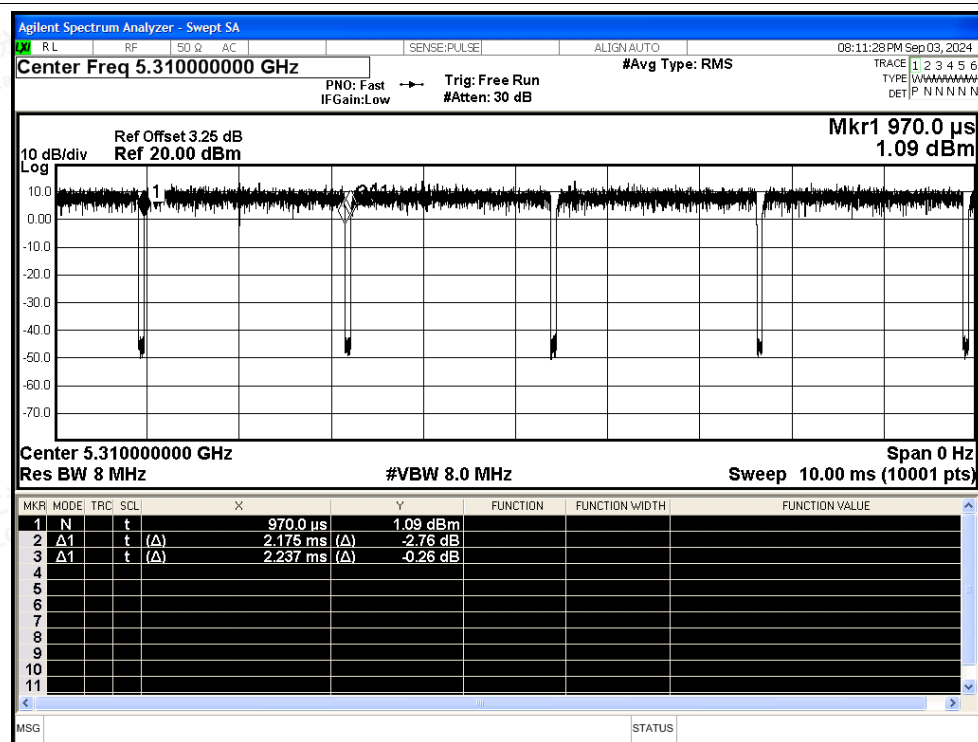

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5260MHz Ant1

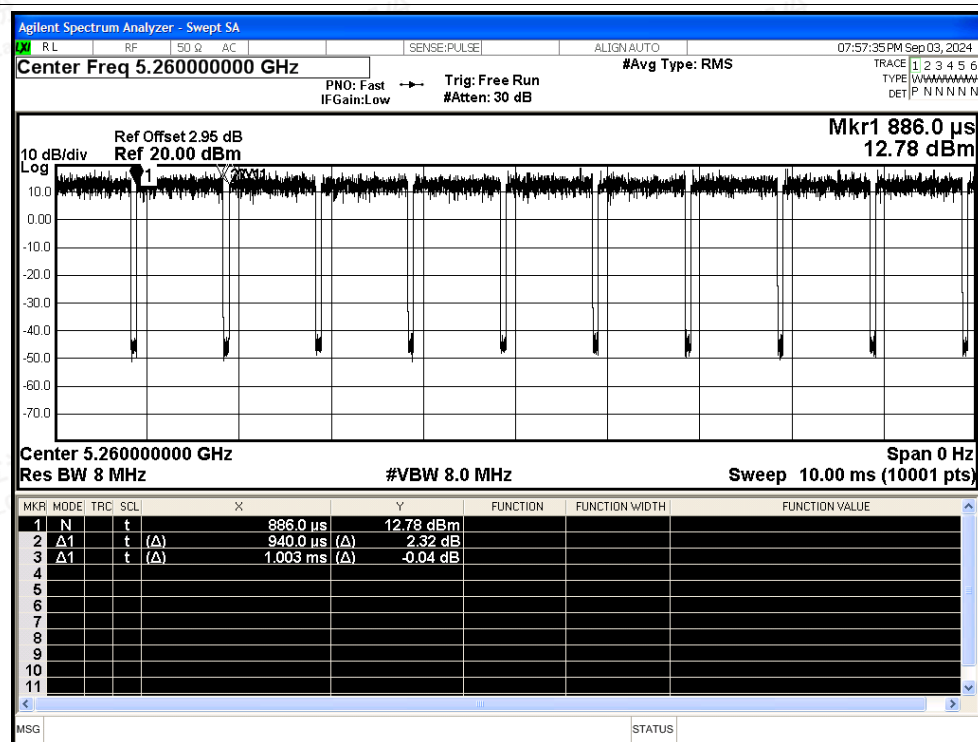

## Duty Cycle NVNT ac20 5300MHz Ant1

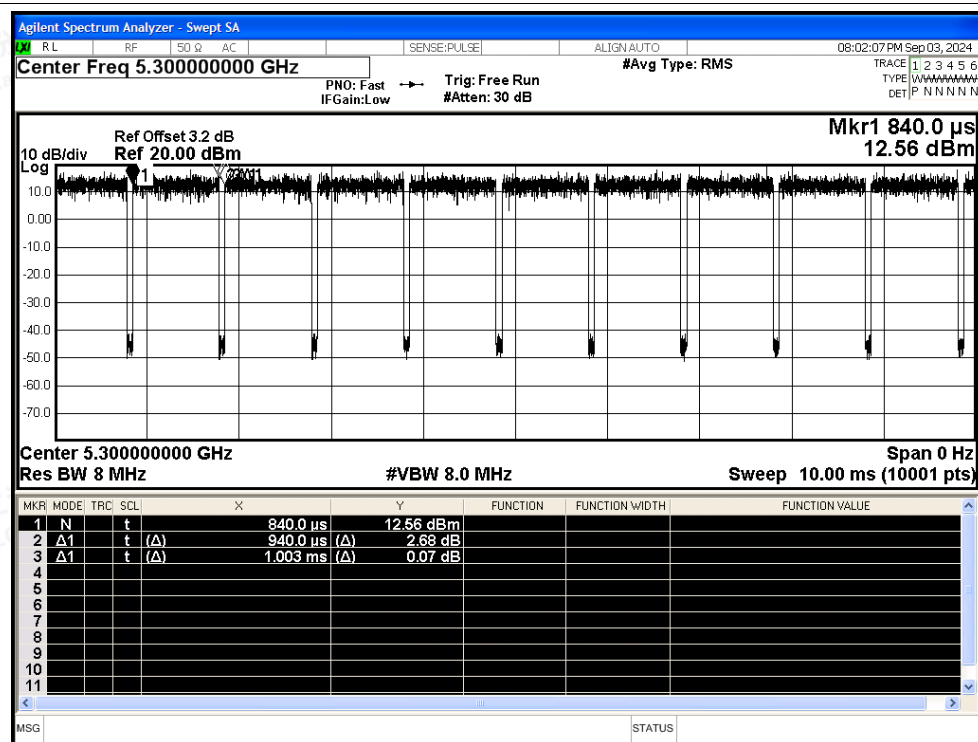

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5320MHz Ant1

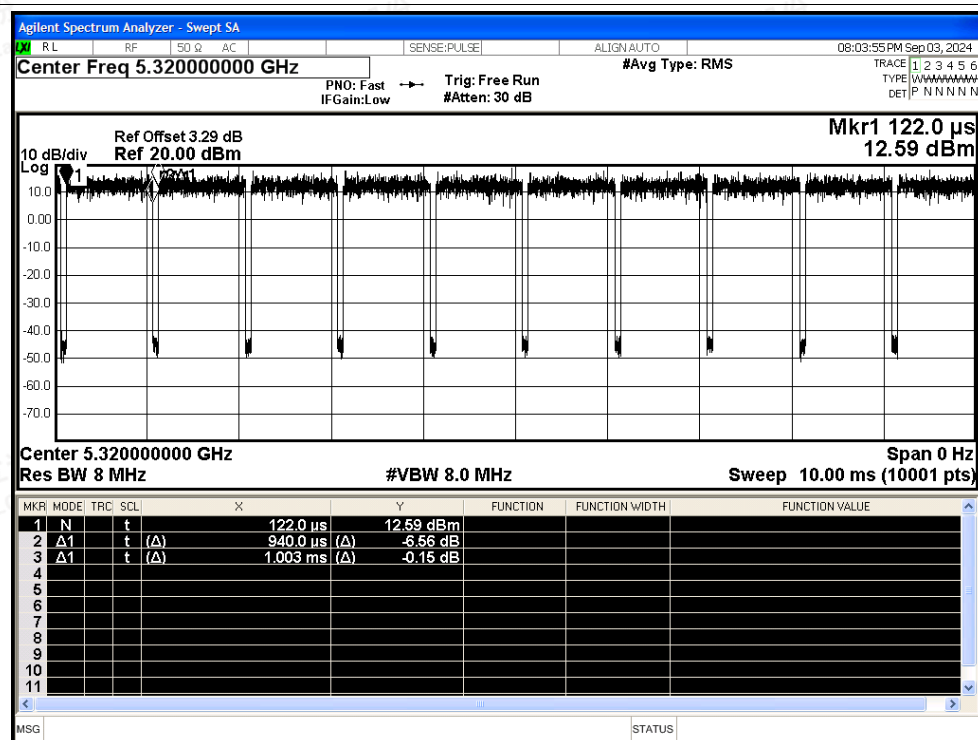

## Duty Cycle NVNT ac40 5270MHz Ant1

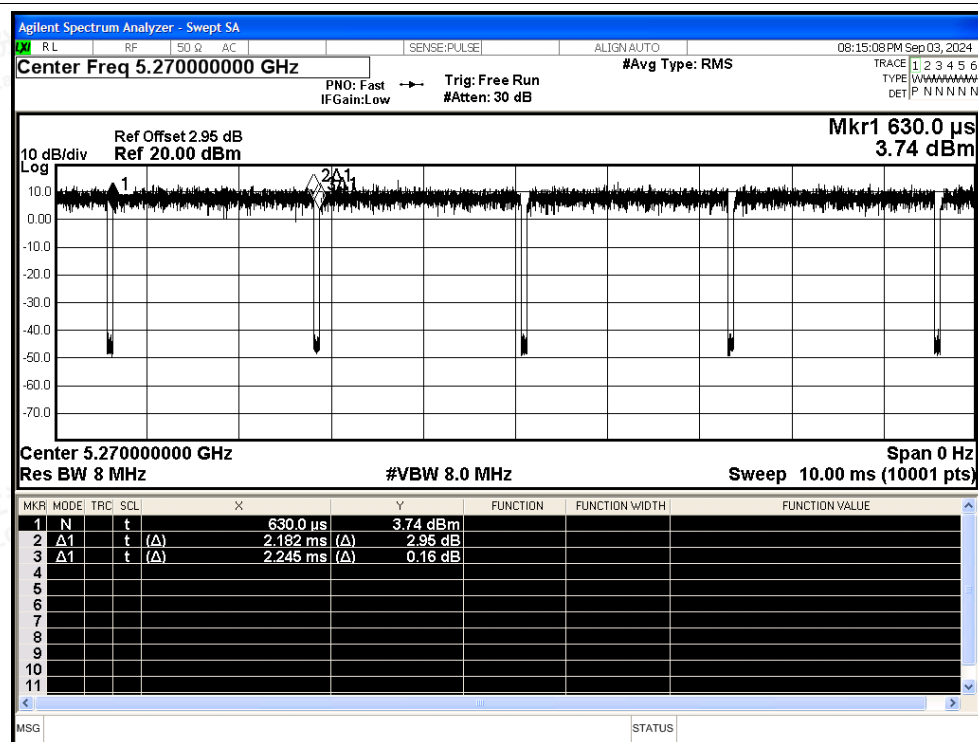

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5310MHz Ant1

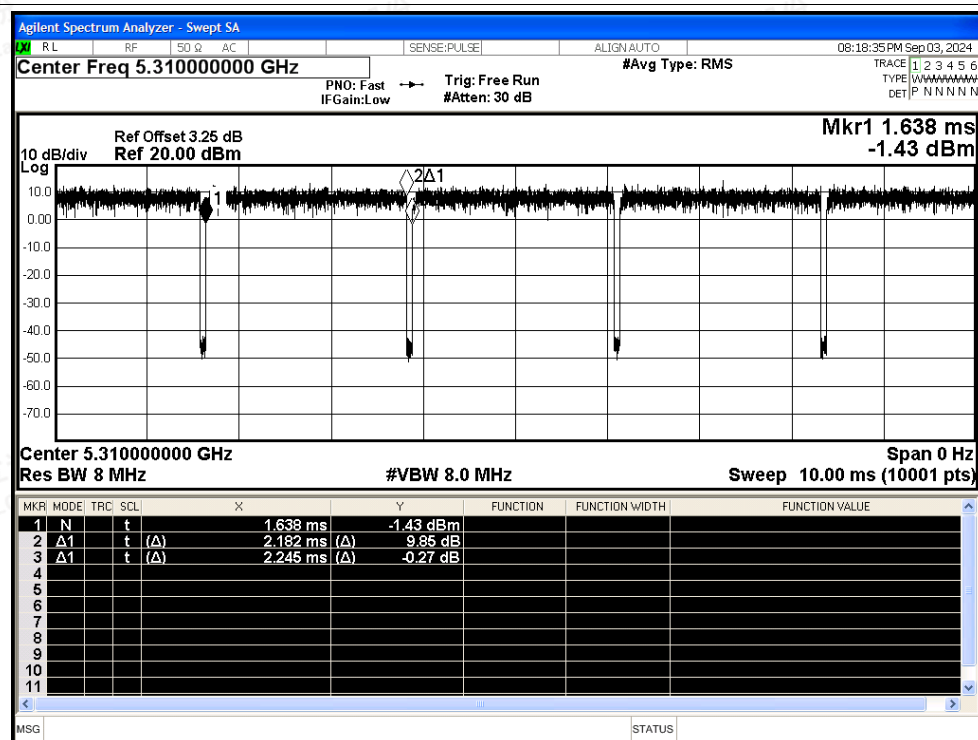

## Duty Cycle NVNT ac80 5290MHz Ant1

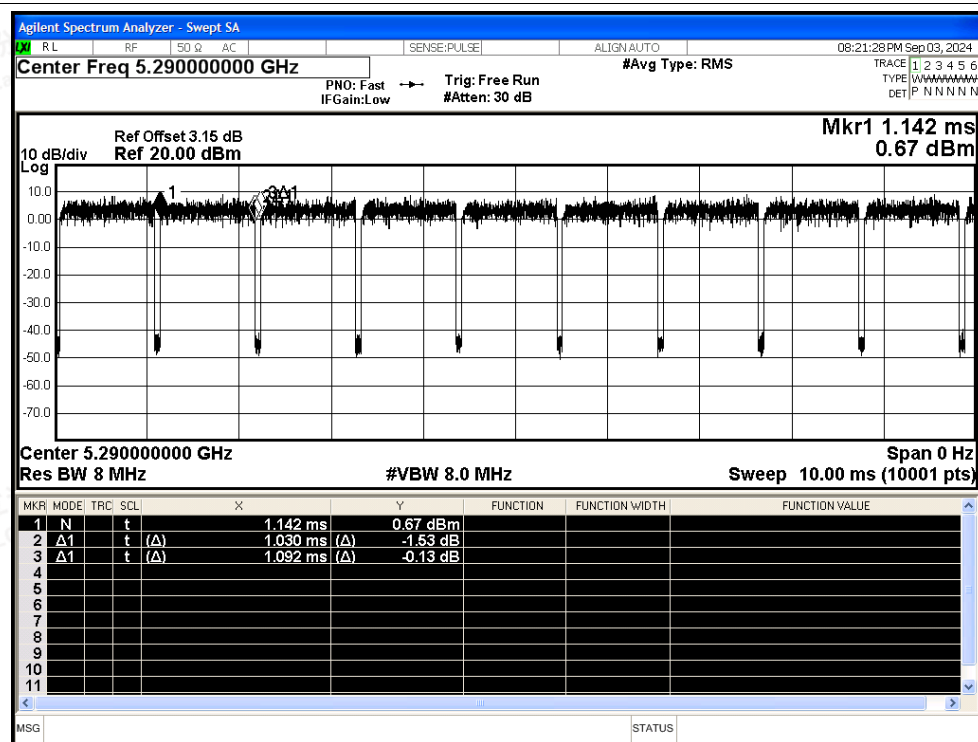

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5260            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5300            | Ant2    | 94.65          | 0.24                   | 0.91      |
| NVNT      | a    | 5320            | Ant2    | 94.65          | 0.24                   | 0.91      |
| NVNT      | n20  | 5260            | Ant2    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5300            | Ant2    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5320            | Ant2    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n40  | 5270            | Ant2    | 97.18          | 0.12                   | 0.46      |
| NVNT      | n40  | 5310            | Ant2    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac20 | 5260            | Ant2    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5300            | Ant2    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5320            | Ant2    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5270            | Ant2    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac40 | 5310            | Ant2    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac80 | 5290            | Ant2    | 94.32          | 0.25                   | 0.97      |






## Test Graphs

## Duty Cycle NVNT a 5260MHz Ant2

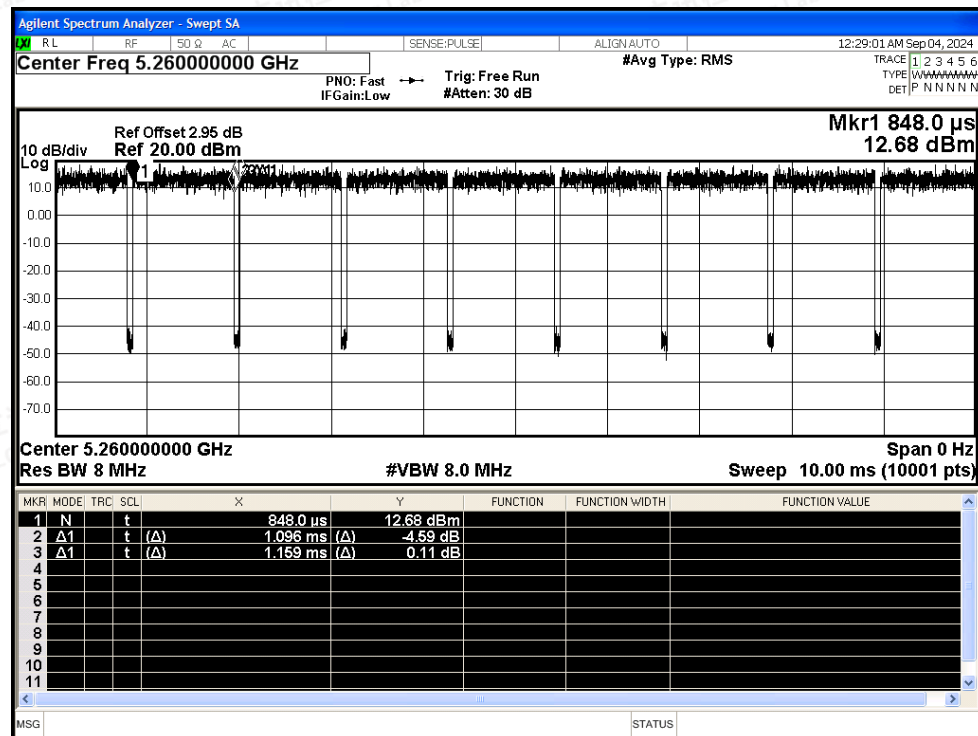

## Duty Cycle NVNT a 5300MHz Ant2

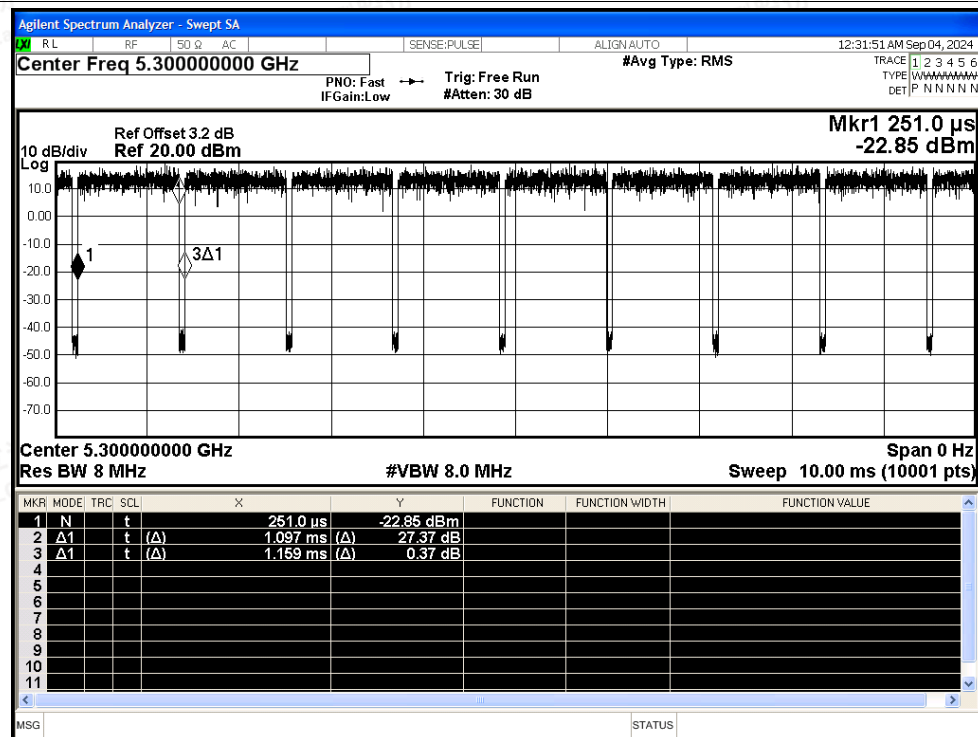

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5320MHz Ant2

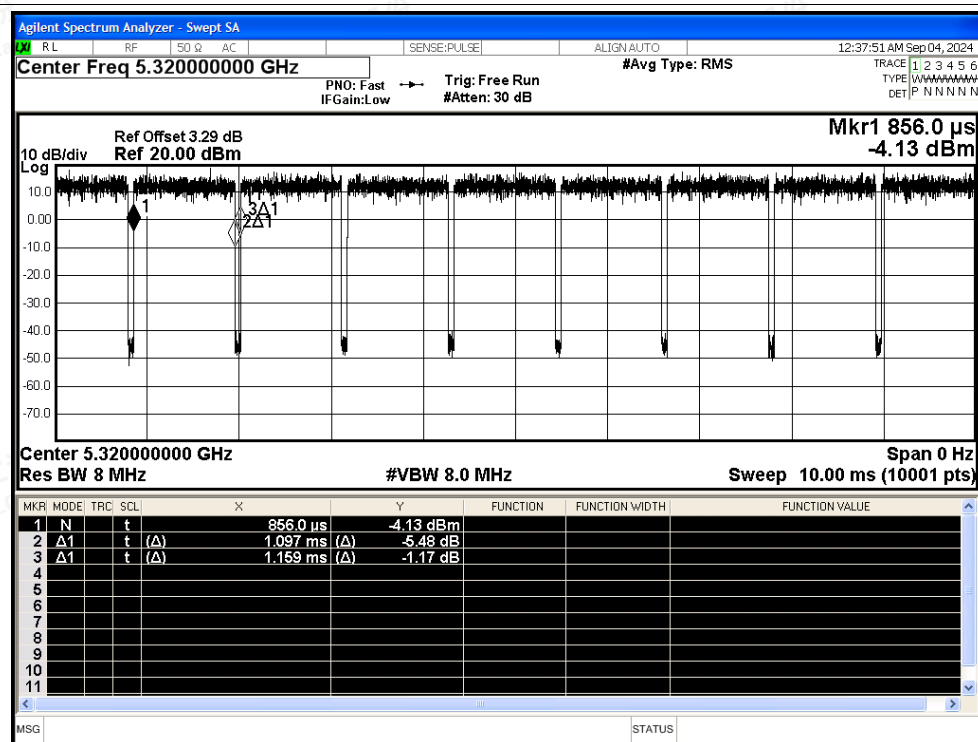

## Duty Cycle NVNT n20 5260MHz Ant2

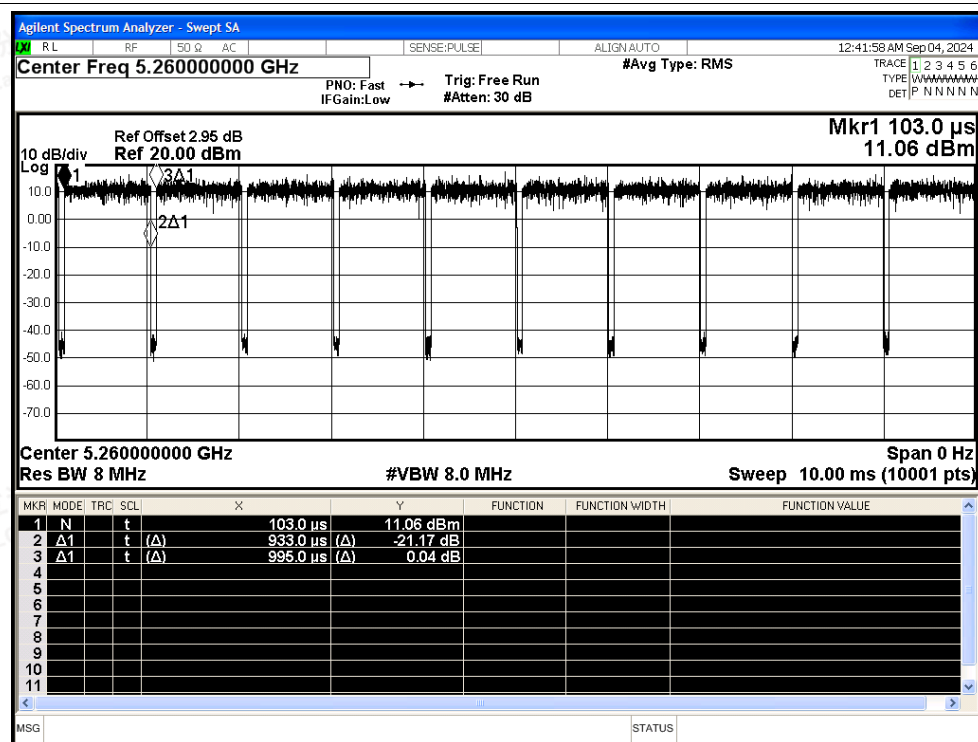

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5300MHz Ant2

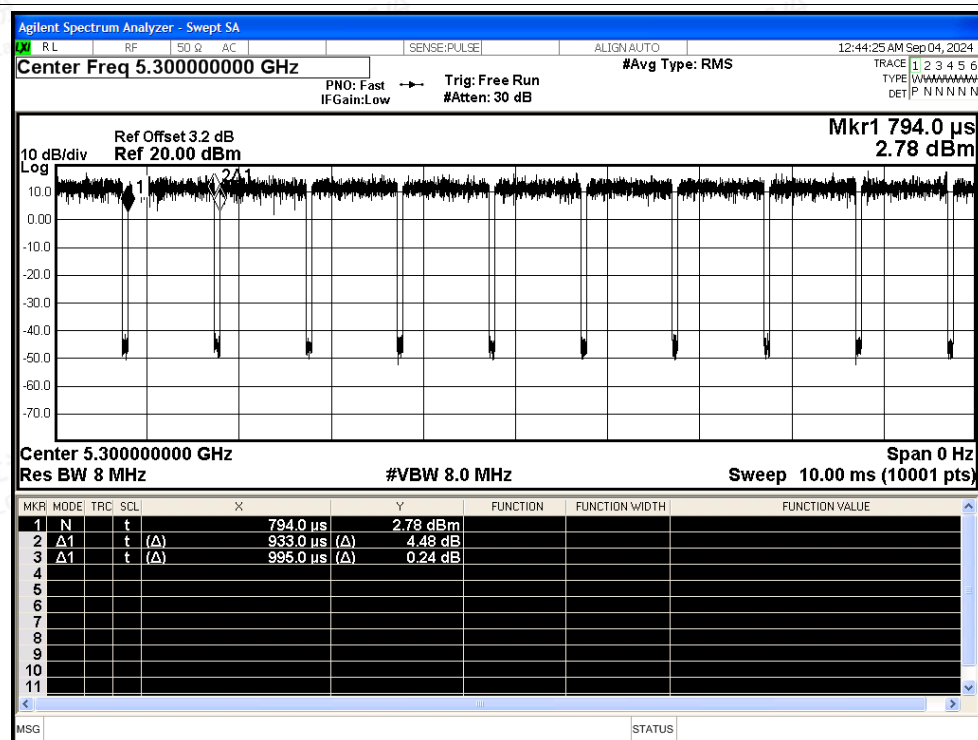

## Duty Cycle NVNT n20 5320MHz Ant2

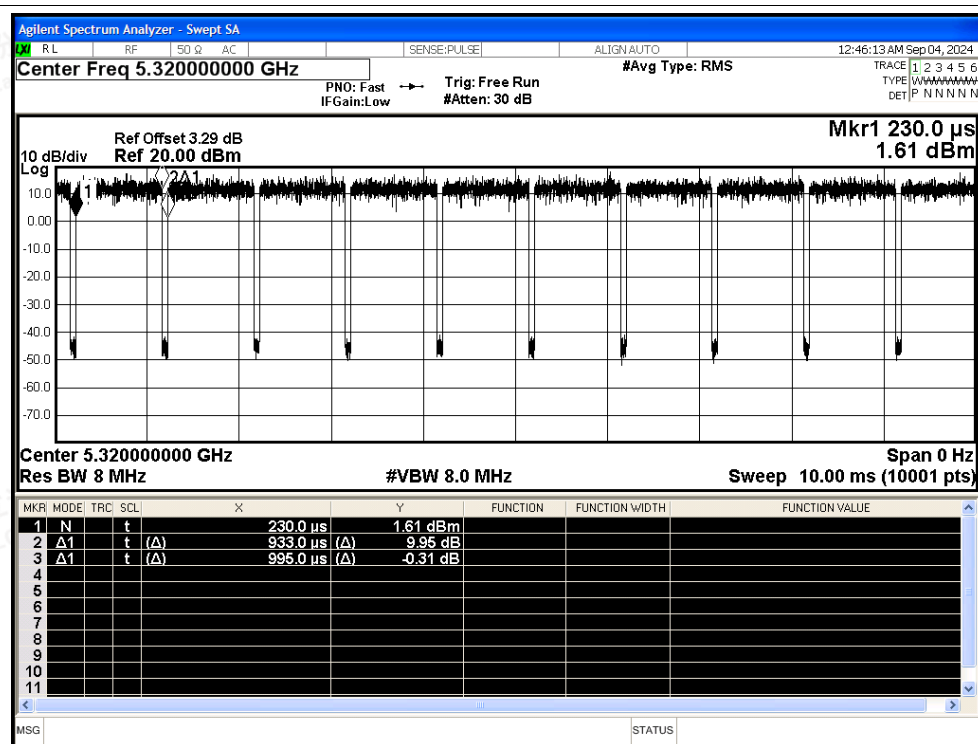

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5270MHz Ant2

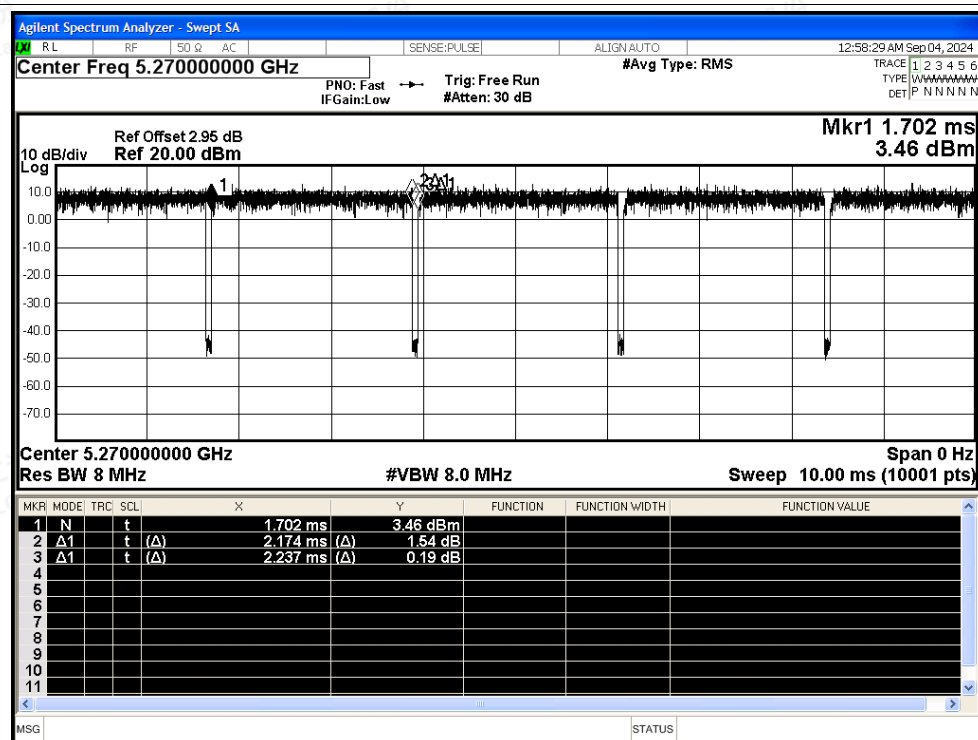

## Duty Cycle NVNT n40 5310MHz Ant2

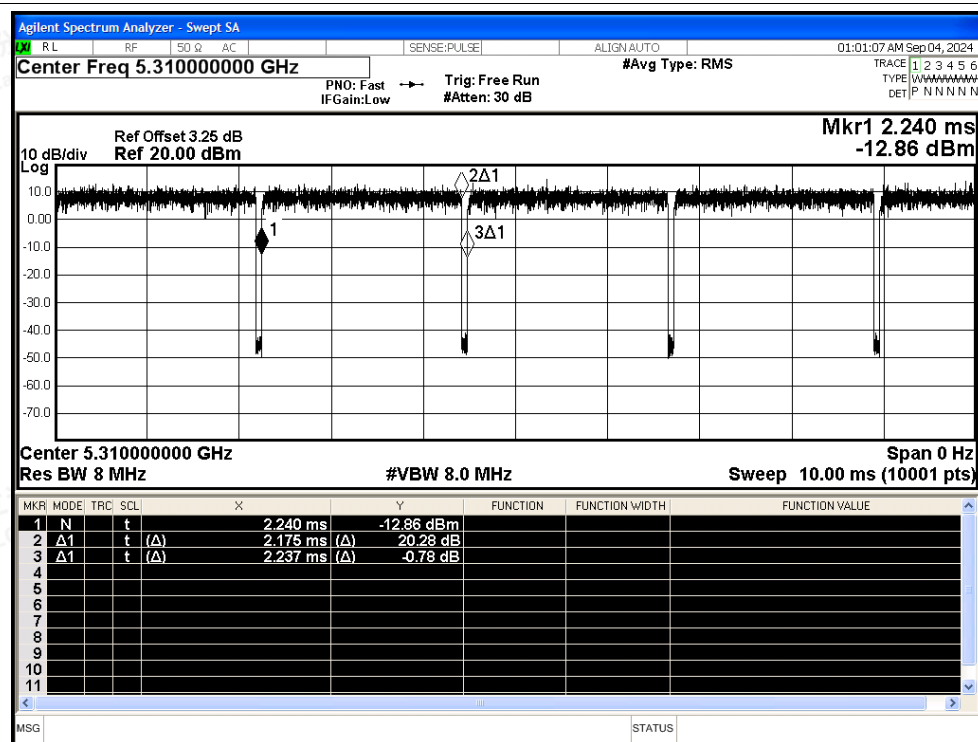

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5260MHz Ant2

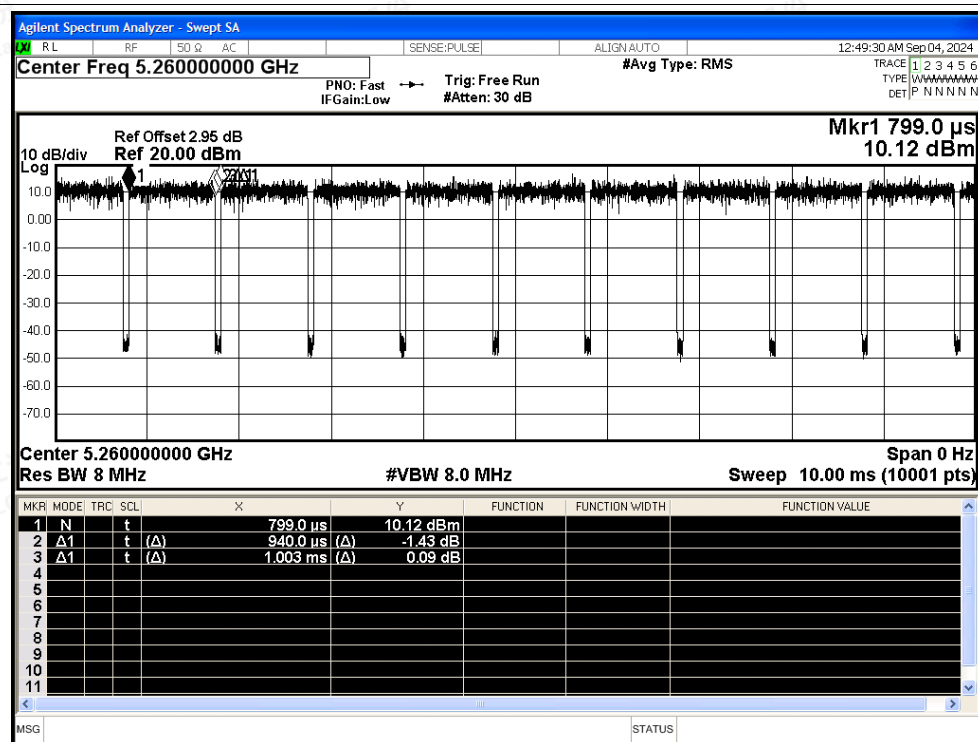

## Duty Cycle NVNT ac20 5300MHz Ant2

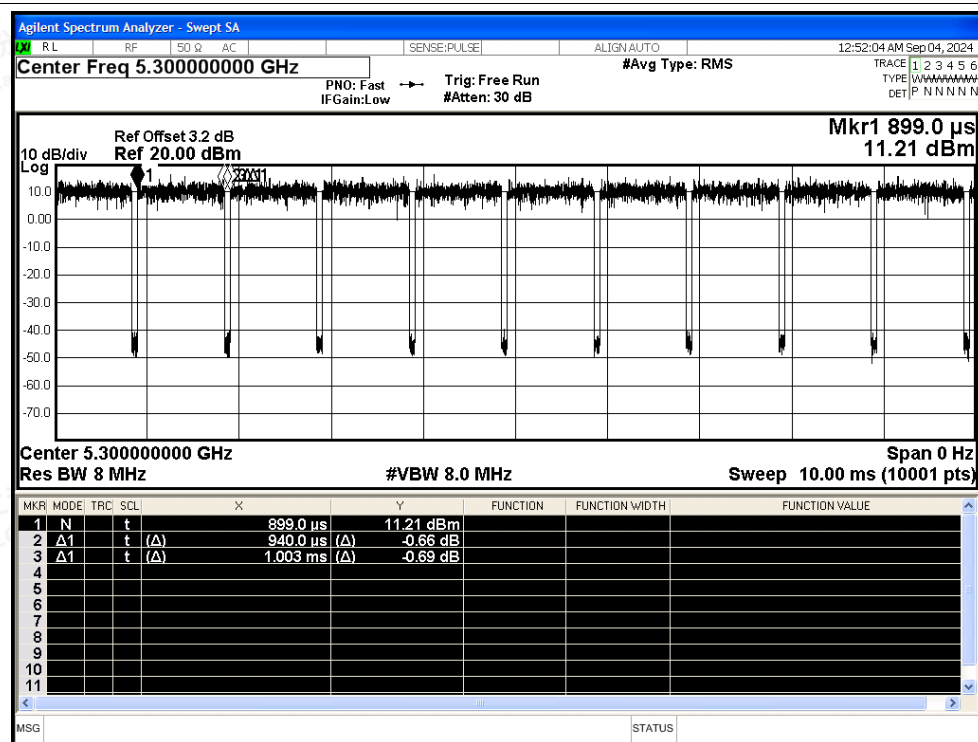

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5320MHz Ant2

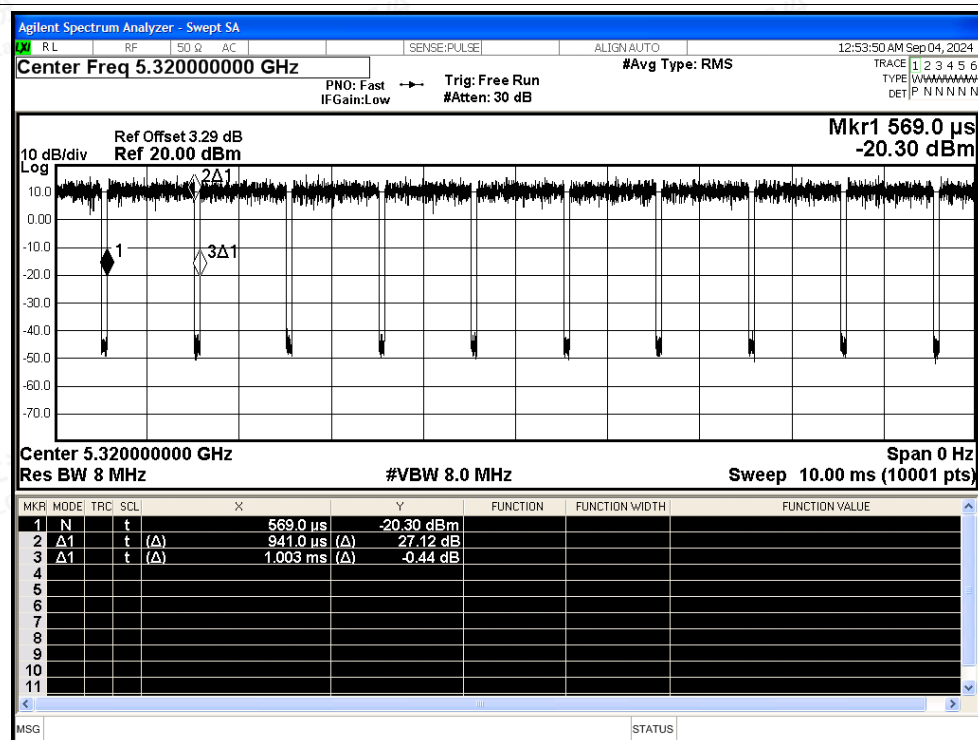

## Duty Cycle NVNT ac40 5270MHz Ant2

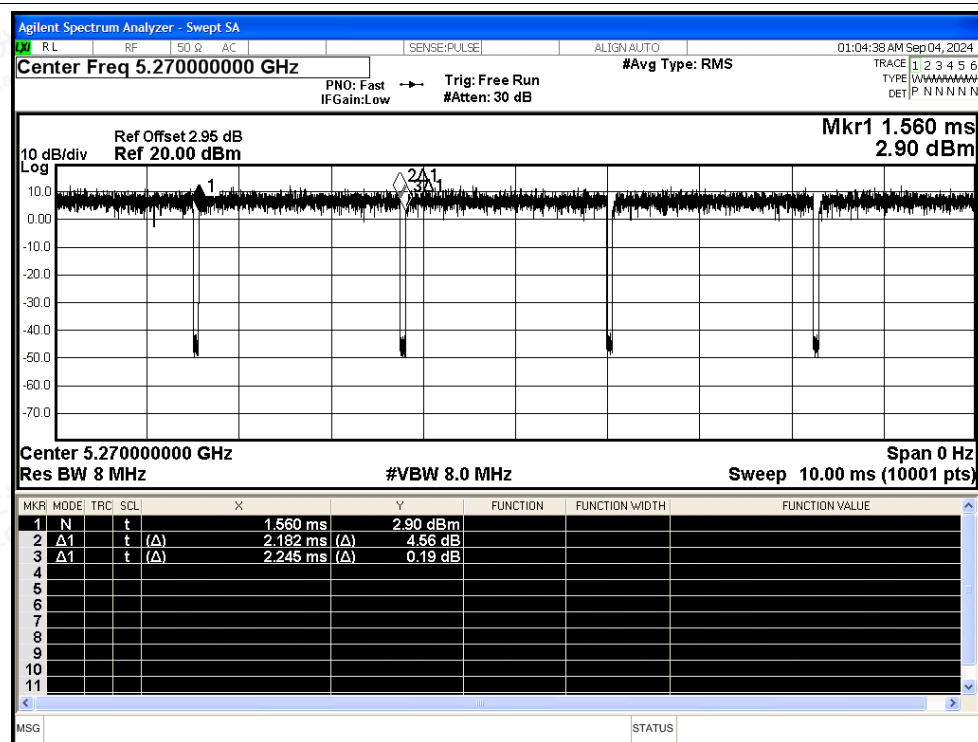

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5310MHz Ant2

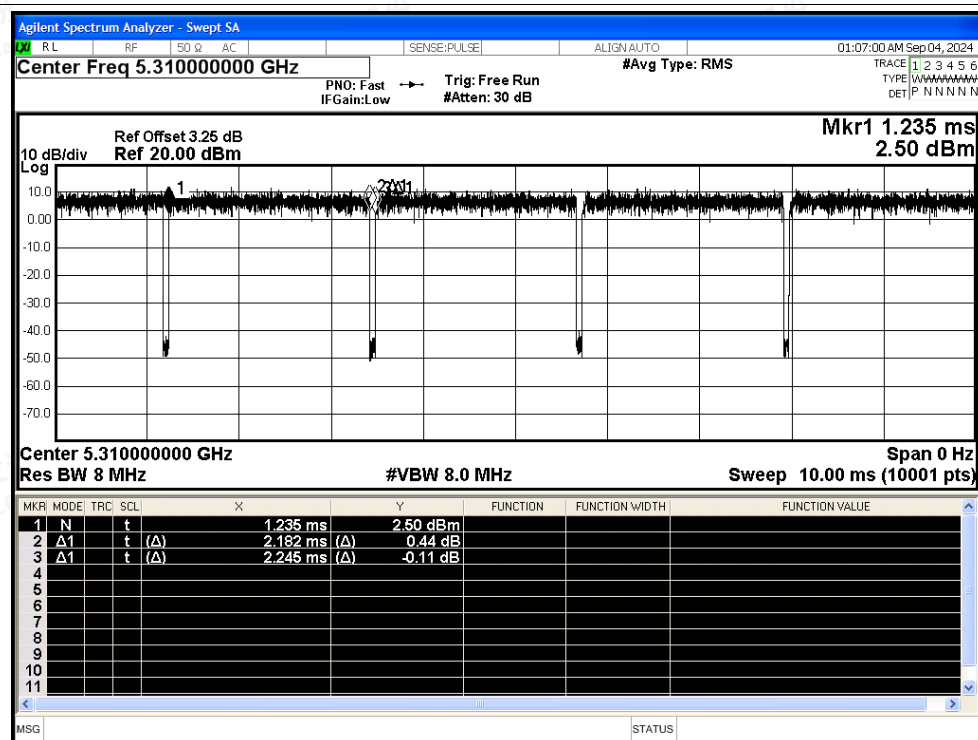

## Duty Cycle NVNT ac80 5290MHz Ant2

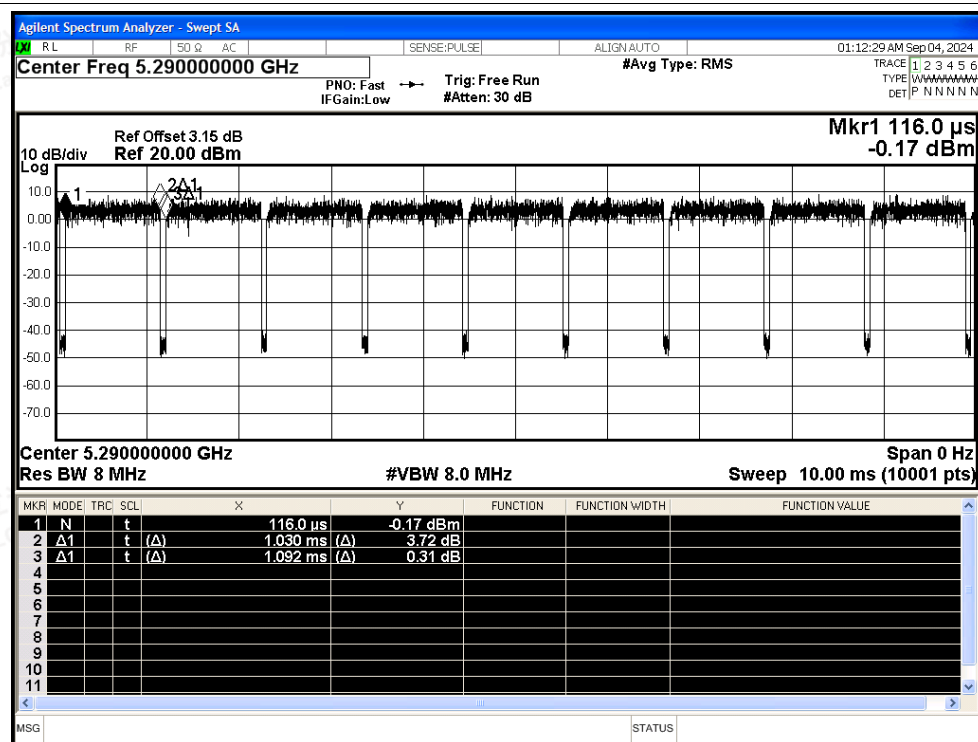

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity