

FCC Part 27

Spurious emissions at antenna terminals

n41 , Normal

Mode	Value (dBm)	Limit (dBm)	Result
n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.65	-25	Pass
n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM QPSK_RB1@23 30MHz_26.9GHz	-32.57	-25	Pass
n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM QPSK_RB24@0 30MHz_26.9GHz	-31.47	-25	Pass
n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.04	-25	Pass
n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@23 30MHz_26.9GHz	-32.18	-25	Pass
n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB24@0 30MHz_26.9GHz	-32.2	-25	Pass
n41_10MHz_30kHz_2685MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.6	-25	Pass
n41_10MHz_30kHz_2685MHz_DFT-s-OFDM QPSK_RB1@23 30MHz_26.9GHz	-32.26	-25	Pass
n41_10MHz_30kHz_2685MHz_DFT-s-OFDM QPSK_RB24@0 30MHz_26.9GHz	-32.25	-25	Pass
n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.71	-25	Pass
n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM QPSK_RB1@37 30MHz_26.9GHz	-32.15	-25	Pass
n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM QPSK_RB36@0 30MHz_26.9GHz	-32.44	-25	Pass
n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.54	-25	Pass
n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@37 30MHz_26.9GHz	-32.1	-25	Pass
n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB36@0 30MHz_26.9GHz	-32.32	-25	Pass
n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.1	-25	Pass
n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM QPSK_RB1@37 30MHz_26.9GHz	-32.03	-25	Pass
n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM QPSK_RB36@0 30MHz_26.9GHz	-32.48	-25	Pass
n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.04	-25	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM QPSK_RB1@50 30MHz_26.9GHz	-32.66	-25	Pass
n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_26.9GHz	-32.02	-25	Pass
n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.1	-25	Pass
n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@50 30MHz_26.9GHz	-32.44	-25	Pass
n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_26.9GHz	-32.52	-25	Pass
n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.27	-25	Pass
n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM QPSK_RB1@50 30MHz_26.9GHz	-32.27	-25	Pass
n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_26.9GHz	-32.51	-25	Pass
n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.17	-25	Pass
n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_26.9GHz	-32.38	-25	Pass
n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_26.9GHz	-32.49	-25	Pass
n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.11	-25	Pass
n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_26.9GHz	-32.6	-25	Pass
n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_26.9GHz	-31.8	-25	Pass
n41_40MHz_30kHz_2670MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.54	-25	Pass
n41_40MHz_30kHz_2670MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_26.9GHz	-32.31	-25	Pass
n41_40MHz_30kHz_2670MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_26.9GHz	-32.59	-25	Pass
n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.37	-25	Pass
n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_26.9GHz	-31.79	-25	Pass
n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_26.9GHz	-32.37	-25	Pass
n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.5	-25	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_26.9GHz	-32.69	-25	Pass
n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_26.9GHz	-32.65	-25	Pass
n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.38	-25	Pass
n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_26.9GHz	-32.45	-25	Pass
n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_26.9GHz	-32.41	-25	Pass
n41_60MHz_30kHz_2526MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-31.93	-25	Pass
n41_60MHz_30kHz_2526MHz_DFT-s-OFDM QPSK_RB1@161 30MHz_26.9GHz	-32.51	-25	Pass
n41_60MHz_30kHz_2526MHz_DFT-s-OFDM QPSK_RB162@0 30MHz_26.9GHz	-32.17	-25	Pass
n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.37	-25	Pass
n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@161 30MHz_26.9GHz	-32.59	-25	Pass
n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB162@0 30MHz_26.9GHz	-32.44	-25	Pass
n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.41	-25	Pass
n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM QPSK_RB1@161 30MHz_26.9GHz	-32.37	-25	Pass
n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM QPSK_RB162@0 30MHz_26.9GHz	-32.43	-25	Pass
n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.22	-25	Pass
n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM QPSK_RB1@216 30MHz_26.9GHz	-31.85	-25	Pass
n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM QPSK_RB216@0 30MHz_26.9GHz	-31.91	-25	Pass
n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32	-25	Pass
n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@216 30MHz_26.9GHz	-32.45	-25	Pass
n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB216@0 30MHz_26.9GHz	-32.24	-25	Pass
n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.16	-25	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM QPSK_RB1@216 30MHz_26.9GHz	-32.17	-25	Pass
n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM QPSK_RB216@0 30MHz_26.9GHz	-32.2	-25	Pass
n41_90MHz_30kHz_2541MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.09	-25	Pass
n41_90MHz_30kHz_2541MHz_DFT-s-OFDM QPSK_RB1@244 30MHz_26.9GHz	-32.27	-25	Pass
n41_90MHz_30kHz_2541MHz_DFT-s-OFDM QPSK_RB243@0 30MHz_26.9GHz	-32.51	-25	Pass
n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.52	-25	Pass
n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@244 30MHz_26.9GHz	-32.6	-25	Pass
n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB243@0 30MHz_26.9GHz	-32.11	-25	Pass
n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.35	-25	Pass
n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM QPSK_RB1@244 30MHz_26.9GHz	-32.32	-25	Pass
n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM QPSK_RB243@0 30MHz_26.9GHz	-32.44	-25	Pass
n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.5	-25	Pass
n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM QPSK_RB1@272 30MHz_26.9GHz	-32.42	-25	Pass
n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM QPSK_RB270@0 30MHz_26.9GHz	-32.62	-25	Pass
n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32.54	-25	Pass
n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@272 30MHz_26.9GHz	-32.48	-25	Pass
n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB270@0 30MHz_26.9GHz	-31.95	-25	Pass
n41_100MHz_30kHz_2640MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz	-32	-25	Pass
n41_100MHz_30kHz_2640MHz_DFT-s-OFDM QPSK_RB1@272 30MHz_26.9GHz	-32.29	-25	Pass
n41_100MHz_30kHz_2640MHz_DFT-s-OFDM QPSK_RB270@0 30MHz_26.9GHz	-32.46	-25	Pass

n66 , Normal

Mode	Value (dBm)	Limit (dBm)	Result
n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-24.01	-13	Pass
n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_17.8GHz	-23.7	-13	Pass
n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_17.8GHz	-23.91	-13	Pass
n66_5MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_17.8GHz	-22.94	-13	Pass
n66_5MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_17.8GHz	-23.97	-13	Pass
n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.36	-13	Pass
n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_17.8GHz	-24.42	-13	Pass
n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_17.8GHz	-24.15	-13	Pass
n66_10MHz_15kHz_1715MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-24.28	-13	Pass
n66_10MHz_15kHz_1715MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_17.8GHz	-23.81	-13	Pass
n66_10MHz_15kHz_1715MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_17.8GHz	-23.88	-13	Pass
n66_10MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_17.8GHz	-23.07	-13	Pass
n66_10MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_17.8GHz	-23.75	-13	Pass
n66_10MHz_15kHz_1775MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-24.24	-13	Pass
n66_10MHz_15kHz_1775MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_17.8GHz	-23.08	-13	Pass
n66_10MHz_15kHz_1775MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_17.8GHz	-23.63	-13	Pass
n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.36	-13	Pass
n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_17.8GHz	-24.13	-13	Pass
n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_17.8GHz	-24.04	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n66_15MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.22	-13	Pass
n66_15MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_17.8GHz	-22.52	-13	Pass
n66_15MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_17.8GHz	-23.84	-13	Pass
n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_17.8GHz	-23.38	-13	Pass
n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_17.8GHz	-23.85	-13	Pass
n66_20MHz_15kHz_1720MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.55	-13	Pass
n66_20MHz_15kHz_1720MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_17.8GHz	-23.89	-13	Pass
n66_20MHz_15kHz_1720MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_17.8GHz	-23.81	-13	Pass
n66_20MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_17.8GHz	-23.61	-13	Pass
n66_20MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_17.8GHz	-24.13	-13	Pass
n66_20MHz_15kHz_1770MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_17.8GHz	-23.33	-13	Pass
n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.62	-13	Pass
n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_17.8GHz	-24.33	-13	Pass
n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_17.8GHz	-23.3	-13	Pass
n66_25MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.07	-13	Pass
n66_25MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_17.8GHz	-23.93	-13	Pass
n66_25MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_17.8GHz	-24.19	-13	Pass
n66_30MHz_15kHz_1725MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.86	-13	Pass
n66_30MHz_15kHz_1725MHz_DFT-s-OFDM QPSK_RB1@159 30MHz_17.8GHz	-23.62	-13	Pass
n66_30MHz_15kHz_1725MHz_DFT-s-OFDM QPSK_RB160@0 30MHz_17.8GHz	-23.39	-13	Pass
n66_30MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-24.09	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n66_30MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@159 30MHz_17.8GHz	-23.41	-13	Pass
n66_30MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB160@0 30MHz_17.8GHz	-22.63	-13	Pass
n66_30MHz_15kHz_1765MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.93	-13	Pass
n66_30MHz_15kHz_1765MHz_DFT-s-OFDM QPSK_RB1@159 30MHz_17.8GHz	-23.84	-13	Pass
n66_30MHz_15kHz_1765MHz_DFT-s-OFDM QPSK_RB160@0 30MHz_17.8GHz	-23.47	-13	Pass
n66_40MHz_15kHz_1730MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.33	-13	Pass
n66_40MHz_15kHz_1730MHz_DFT-s-OFDM QPSK_RB1@215 30MHz_17.8GHz	-23.76	-13	Pass
n66_40MHz_15kHz_1730MHz_DFT-s-OFDM QPSK_RB216@0 30MHz_17.8GHz	-22.85	-13	Pass
n66_40MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-24.02	-13	Pass
n66_40MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@215 30MHz_17.8GHz	-23.94	-13	Pass
n66_40MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB216@0 30MHz_17.8GHz	-24.03	-13	Pass
n66_40MHz_15kHz_1760MHz_DFT-s-OFDM QPSK_RB216@0 30MHz_17.8GHz	-24.12	-13	Pass
n66_5MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.29	-13	Pass
n66_10MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-24.17	-13	Pass
n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.26	-13	Pass
n66_20MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.76	-13	Pass
n66_20MHz_15kHz_1770MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.91	-13	Pass
n66_20MHz_15kHz_1770MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_17.8GHz	-23.74	-13	Pass
n66_40MHz_15kHz_1760MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.91	-13	Pass
n66_40MHz_15kHz_1760MHz_DFT-s-OFDM QPSK_RB1@215 30MHz_17.8GHz	-24.17	-13	Pass
n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz	-23.63	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_17.8GHz	-23.56	-13	Pass
n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_17.8GHz	-23.41	-13	Pass


n71 , Normal

Mode	Value (dBm)	Limit (dBm)	Result
n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-25.23	-13	Pass
n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_6.98GHz	-24.94	-13	Pass
n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_6.98GHz	-24.93	-13	Pass
n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-25.06	-13	Pass
n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_6.98GHz	-24	-13	Pass
n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_6.98GHz	-24.54	-13	Pass
n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-24.06	-13	Pass
n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_6.98GHz	-20.98	-13	Pass
n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_6.98GHz	-24.96	-13	Pass
n71_10MHz_15kHz_668MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-24.11	-13	Pass
n71_10MHz_15kHz_668MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_6.98GHz	-24.56	-13	Pass
n71_10MHz_15kHz_668MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_6.98GHz	-24.31	-13	Pass
n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-25.18	-13	Pass
n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_6.98GHz	-25.22	-13	Pass
n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_6.98GHz	-25.03	-13	Pass
n71_10MHz_15kHz_693MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-24.56	-13	Pass
n71_10MHz_15kHz_693MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_6.98GHz	-24.38	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n71_10MHz_15kHz_693MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_6.98GHz	-24.86	-13	Pass
n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-23.99	-13	Pass
n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_6.98GHz	-24.66	-13	Pass
n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_6.98GHz	-24.97	-13	Pass
n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-24.62	-13	Pass
n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_6.98GHz	-24.67	-13	Pass
n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_6.98GHz	-24.54	-13	Pass
n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-25.1	-13	Pass
n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_6.98GHz	-25.1	-13	Pass
n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_6.98GHz	-24.66	-13	Pass
n71_20MHz_15kHz_673MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-24.75	-13	Pass
n71_20MHz_15kHz_673MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_6.98GHz	-23.99	-13	Pass
n71_20MHz_15kHz_673MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_6.98GHz	-24.67	-13	Pass
n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-22.86	-13	Pass
n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_6.98GHz	-24.12	-13	Pass
n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_6.98GHz	-23.95	-13	Pass
n71_20MHz_15kHz_688MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz	-24.77	-13	Pass
n71_20MHz_15kHz_688MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_6.98GHz	-24.57	-13	Pass
n71_20MHz_15kHz_688MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_6.98GHz	-25.13	-13	Pass


n41 , Normal

n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

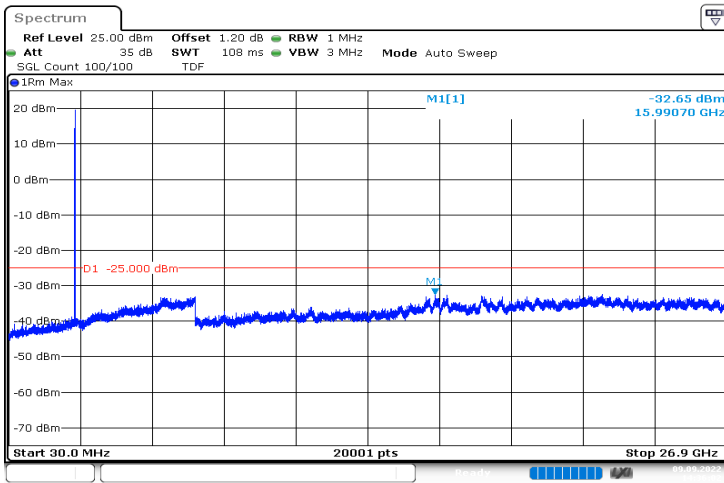


Date: 9.SEP.2022 14:36:02

n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM
QPSK_RB1@23|30MHz_26.9GHz

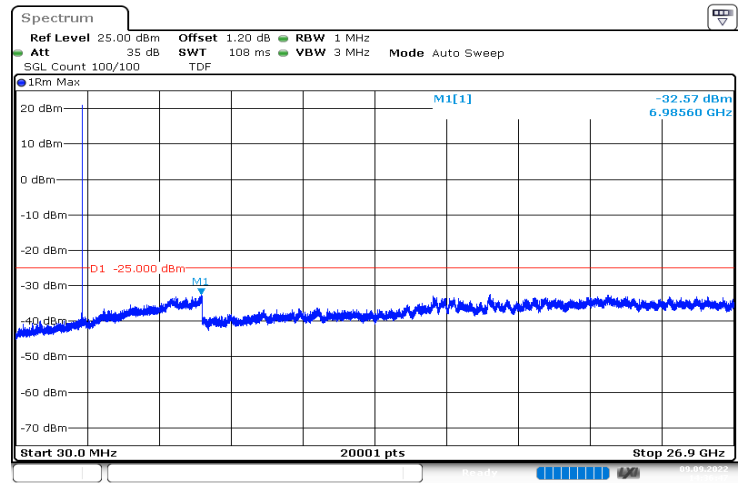


Date: 9.SEP.2022 14:36:47

n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM
QPSK_RB24@0|30MHz_26.9GHz

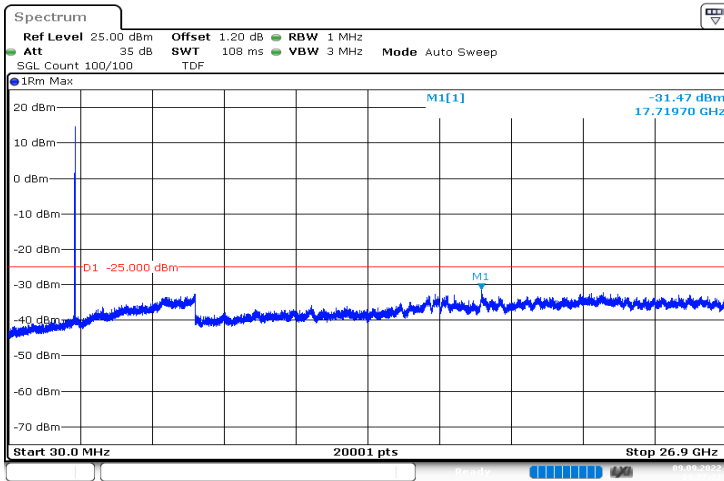


Date: 9.SEP.2022 14:37:31

n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

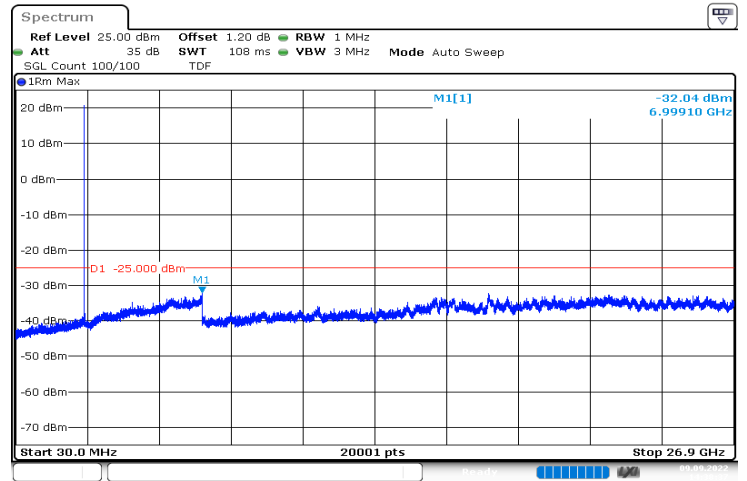


Date: 9.SEP.2022 14:38:37

n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@23|30MHz_26.9GHz

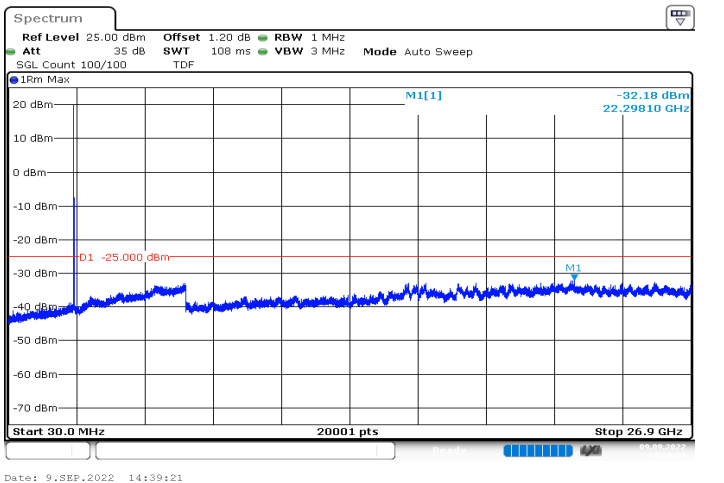


Date: 9.SEP.2022 14:39:21

n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB24@0|30MHz_26.9GHz

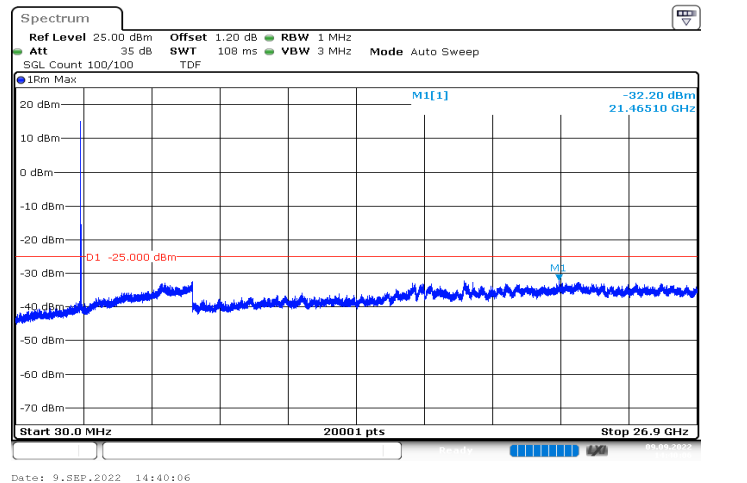


Date: 9.SEP.2022 14:40:06

n41_10MHz_30kHz_2685MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

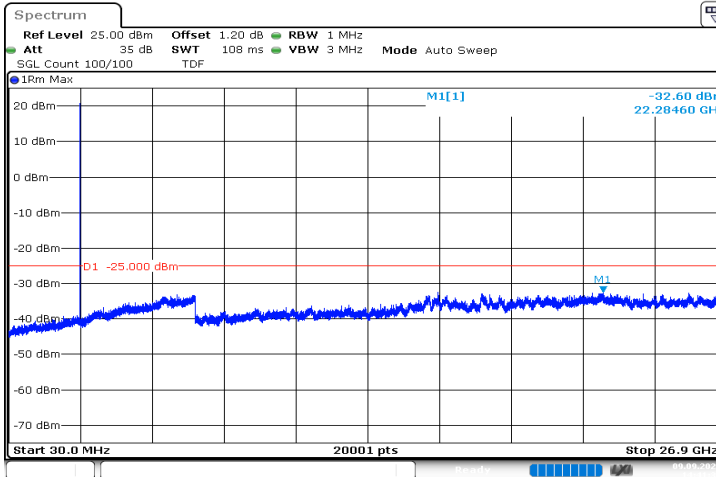


Date: 9.SEP.2022 14:41:32

n41_10MHz_30kHz_2685MHz_DFT-s-OFDM
QPSK_RB1@23|30MHz_26.9GHz

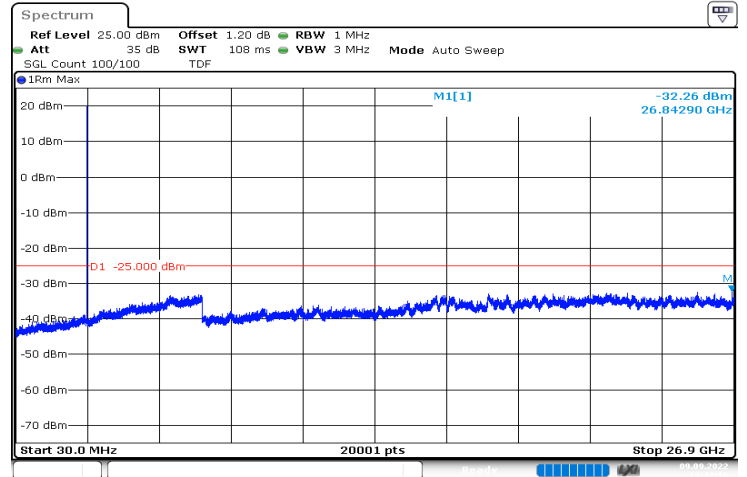


Date: 9.SEP.2022 14:42:16

n41_10MHz_30kHz_2685MHz_DFT-s-OFDM
QPSK_RB24@0|30MHz_26.9GHz

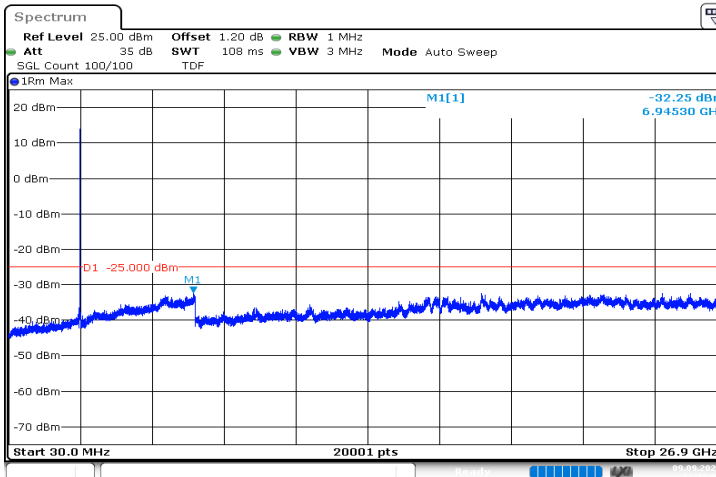


Date: 9.SEP.2022 14:43:01

n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

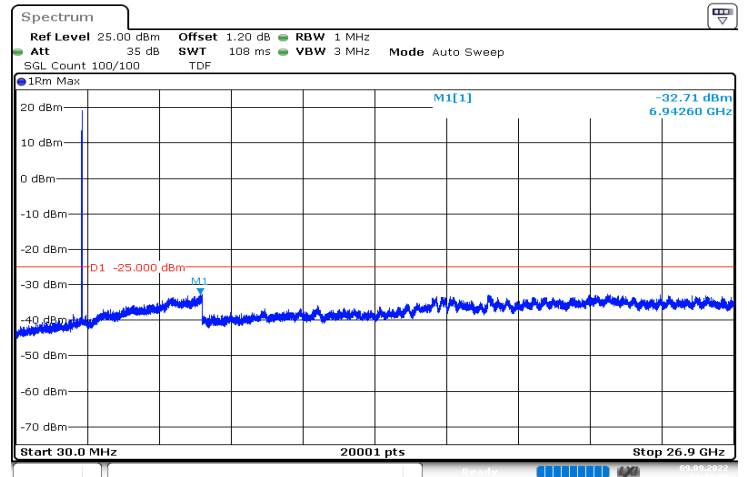


Date: 9.SEP.2022 14:44:08

n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM
QPSK_RB1@37|30MHz_26.9GHz

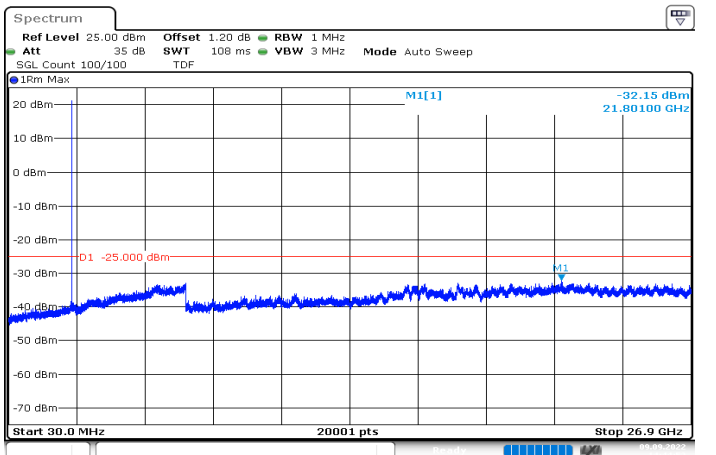


Date: 9.SEP.2022 14:44:52

n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM
QPSK_RB36@0|30MHz_26.9GHz

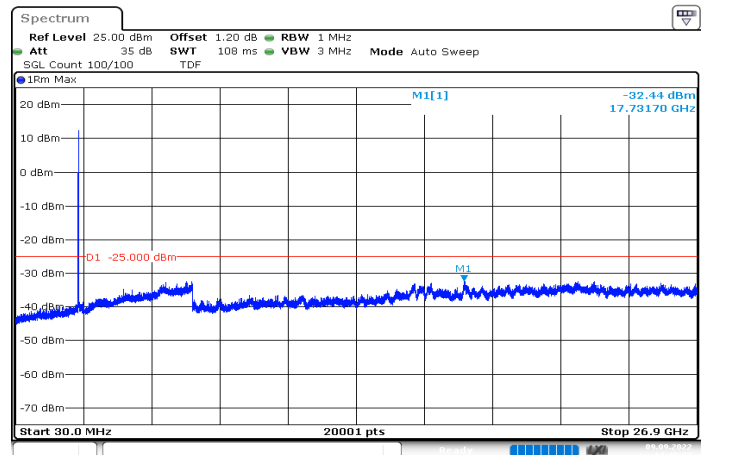


Date: 9.SEP.2022 14:45:38

n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

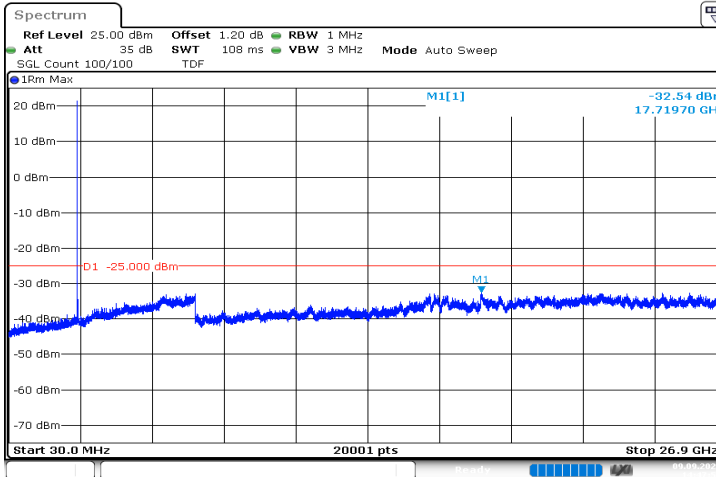


Date: 9.SEP.2022 14:47:51

n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@37|30MHz_26.9GHz

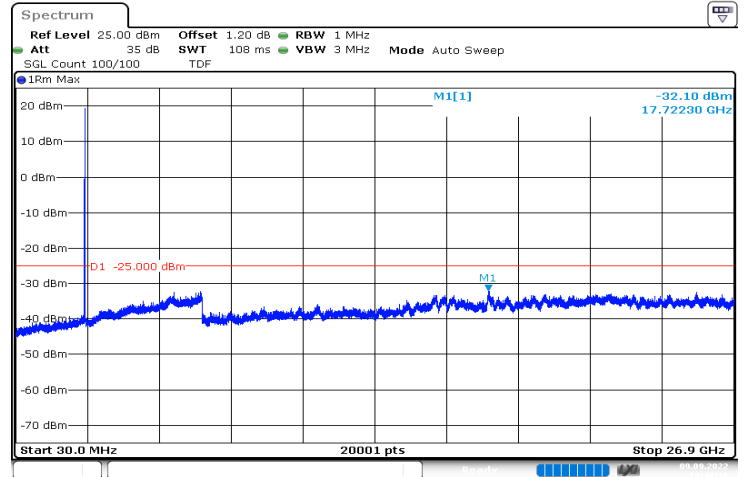


Date: 9.SEP.2022 14:48:36

n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB36@0|30MHz_26.9GHz

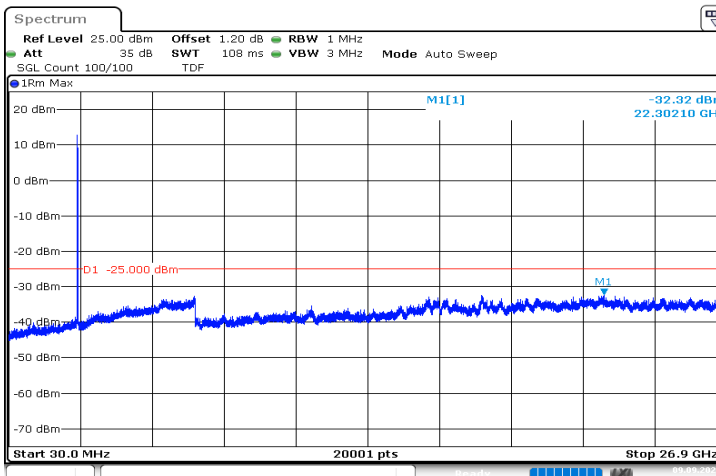


Date: 9.SEP.2022 14:49:21

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

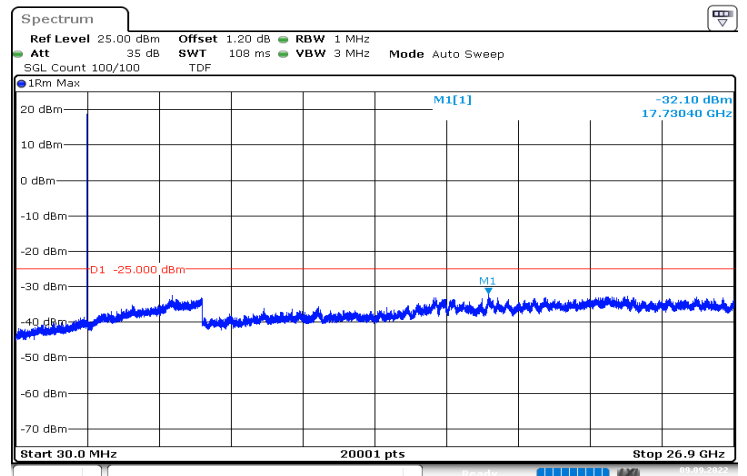


Date: 9.SEP.2022 14:50:47

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB1@37|30MHz_26.9GHz

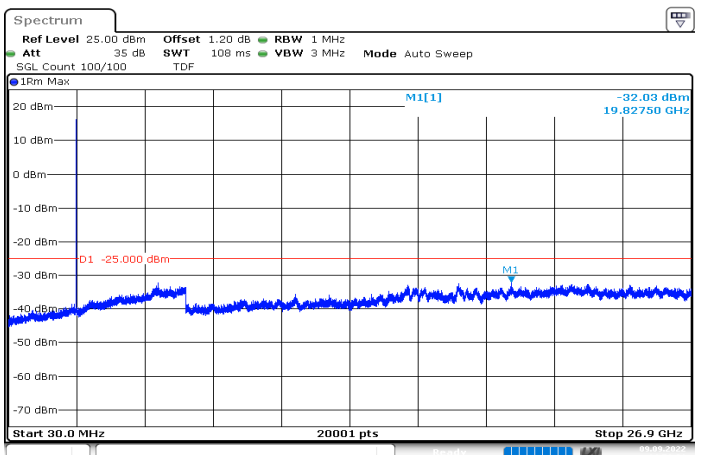


Date: 9.SEP.2022 14:51:31

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB36@0|30MHz_26.9GHz

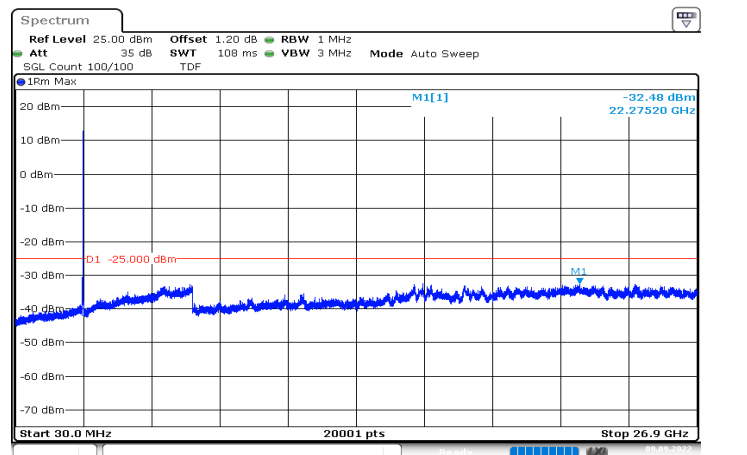


Date: 9.SEP.2022 14:52:16

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

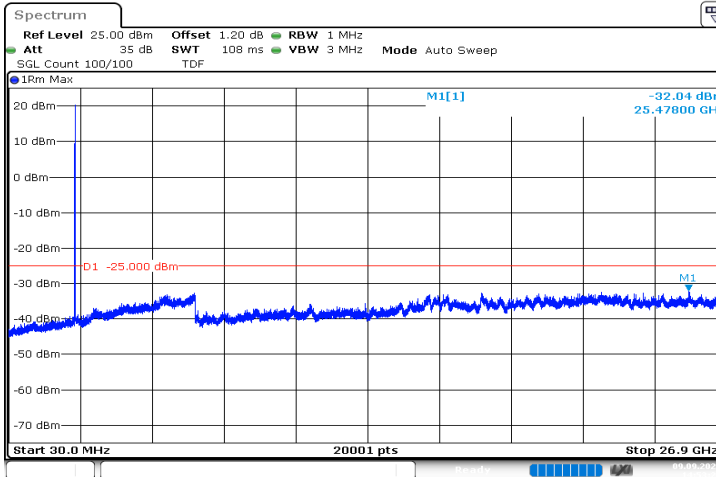


Date: 9.SEP.2022 14:53:23

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB1@50|30MHz_26.9GHz

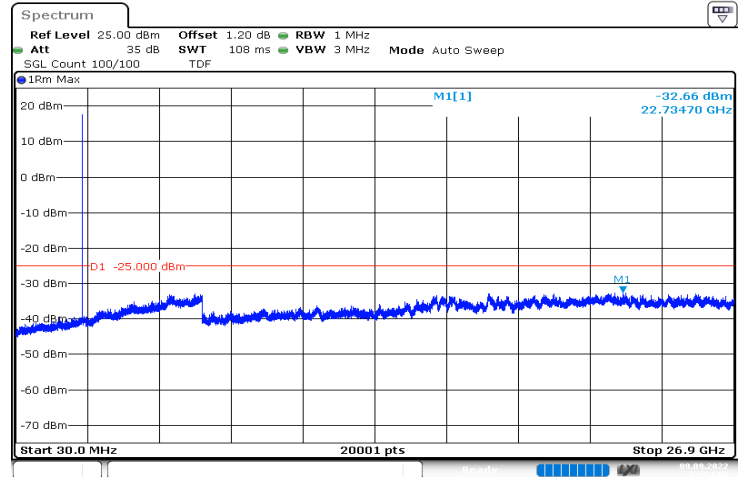


Date: 9.SEP.2022 14:54:08

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_26.9GHz

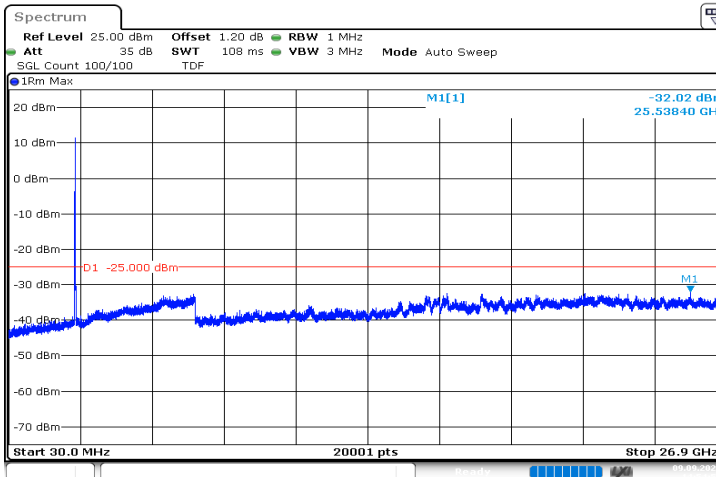


Date: 9.SEP.2022 14:54:52

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

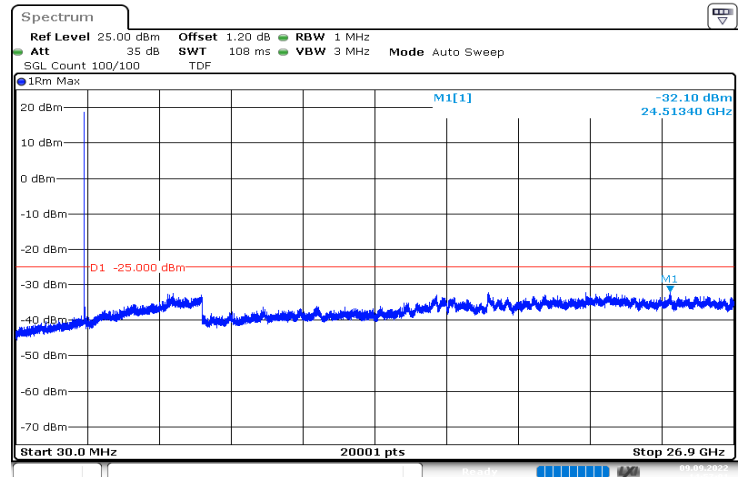


Date: 9.SEP.2022 14:57:01

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@50|30MHz_26.9GHz

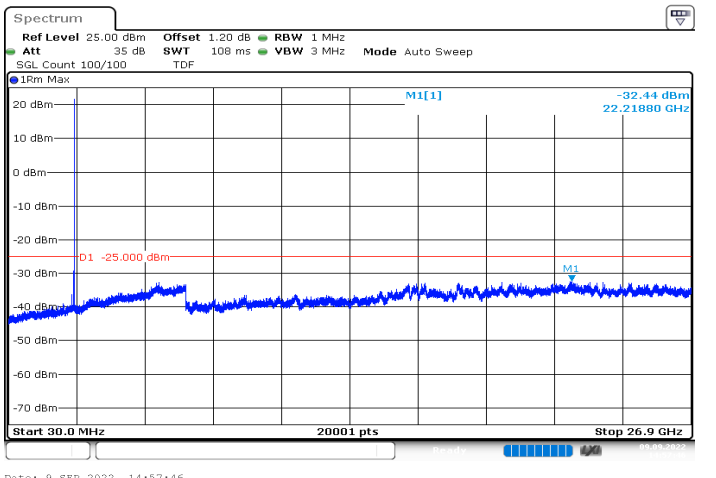


Date: 9.SEP.2022 14:57:46

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_26.9GHz

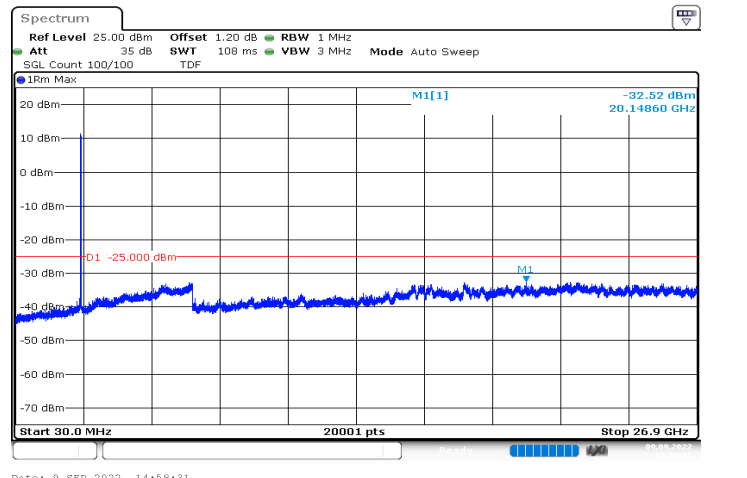


Date: 9.SEP.2022 14:58:31

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

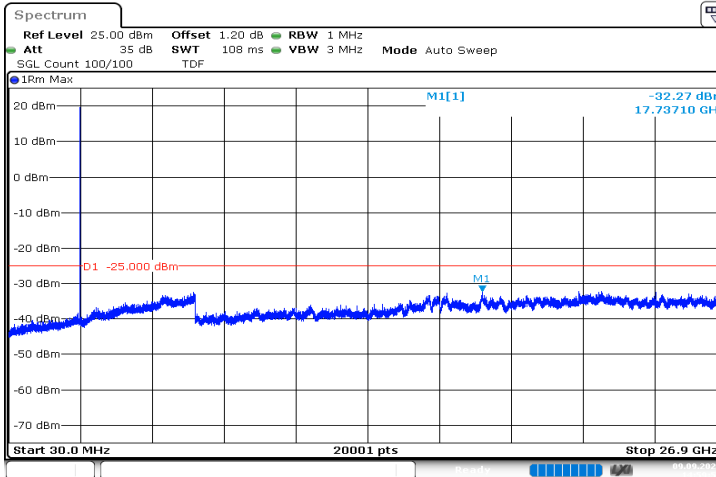


Date: 9.SEP.2022 14:59:56

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB1@50|30MHz_26.9GHz

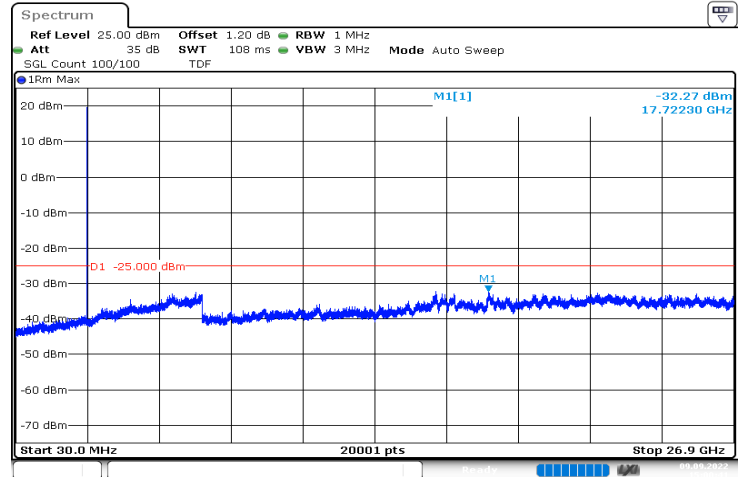


Date: 9.SEP.2022 15:00:41

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_26.9GHz

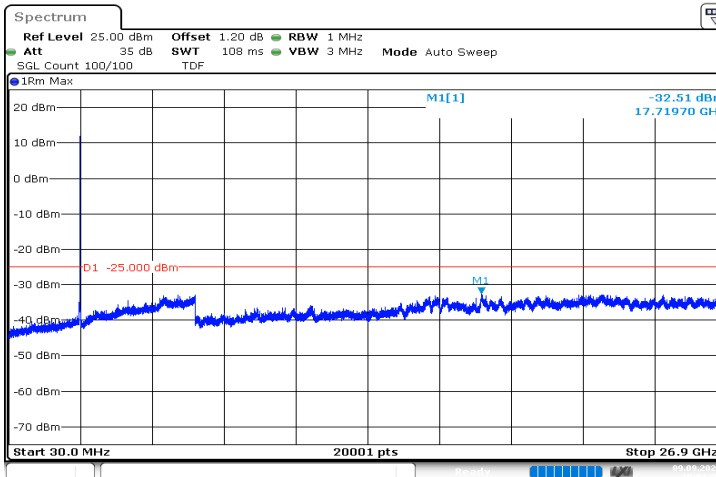


Date: 9.SEP.2022 15:01:25

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

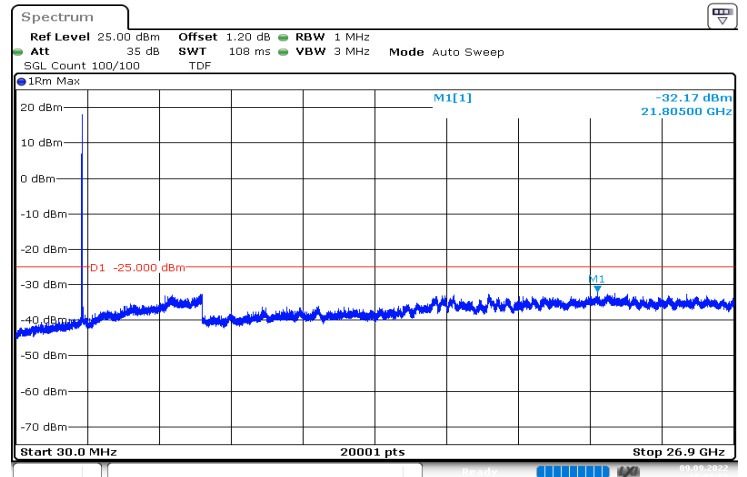


Date: 9.SEP.2022 15:02:52

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_26.9GHz

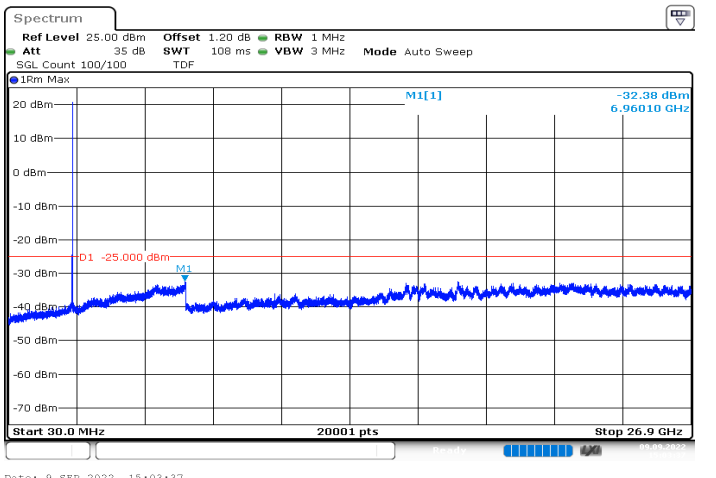


Date: 9.SEP.2022 15:03:37

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_26.9GHz

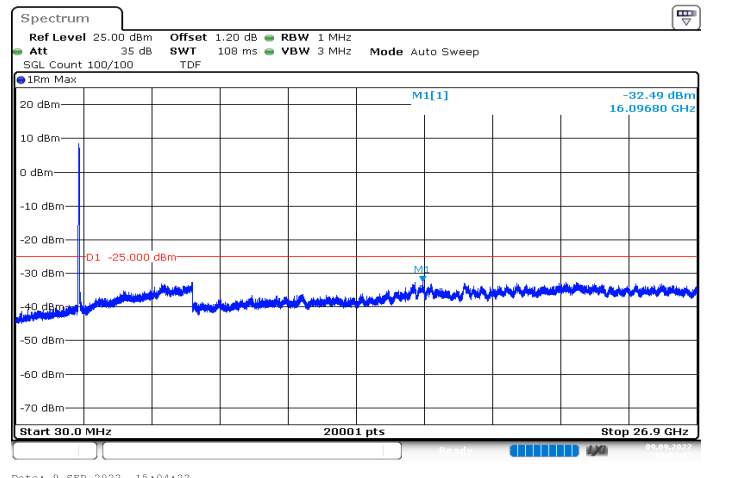


Date: 9.SEP.2022 15:04:22

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

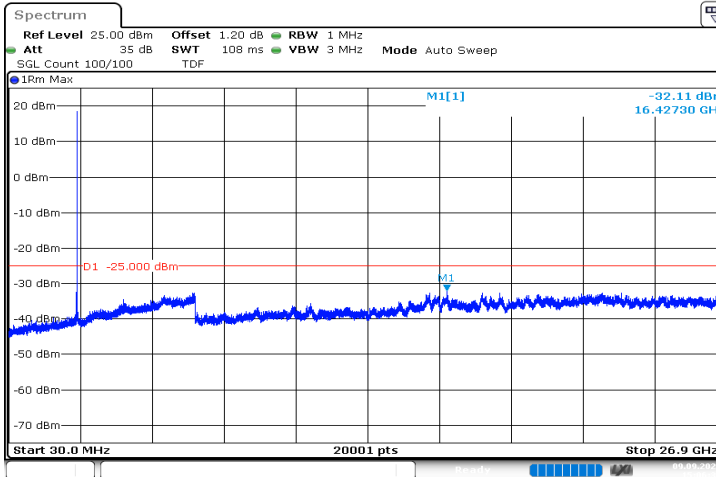


Date: 9.SEP.2022 15:06:31

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_26.9GHz

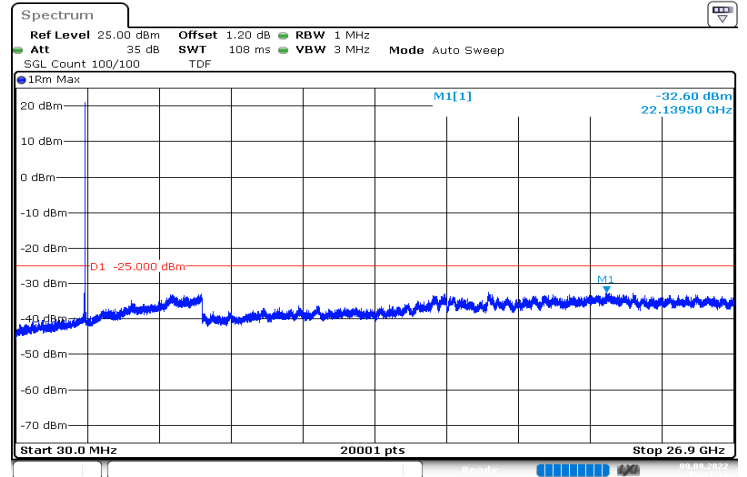


Date: 9.SEP.2022 15:07:16

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_26.9GHz

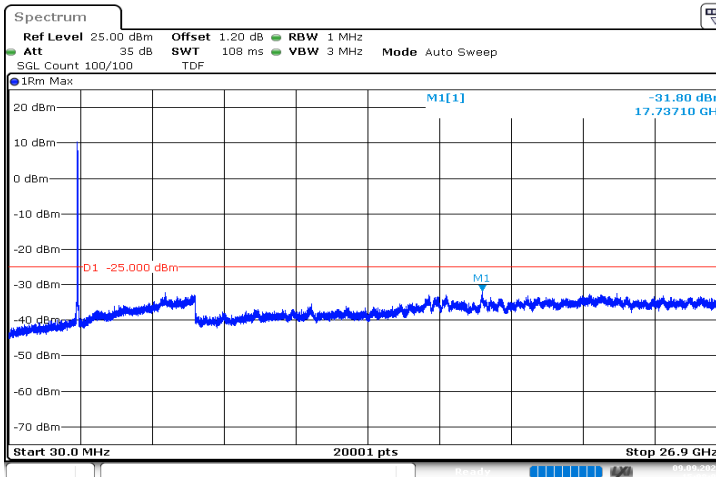


Date: 9.SEP.2022 15:08:01

n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

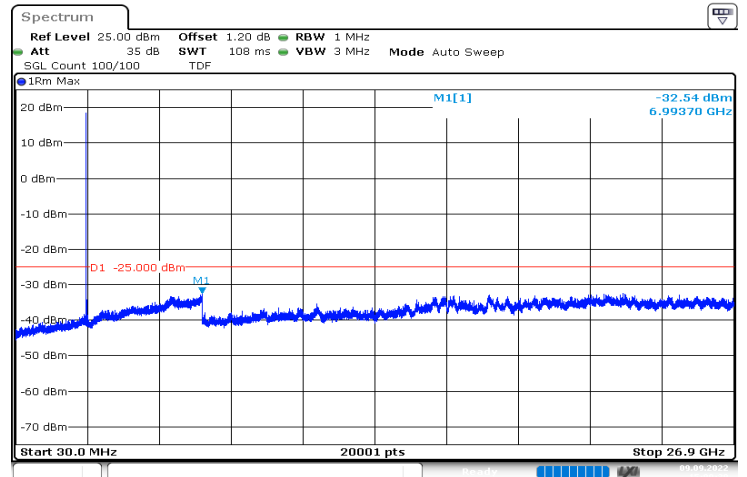


Date: 9.SEP.2022 15:09:39

n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_26.9GHz

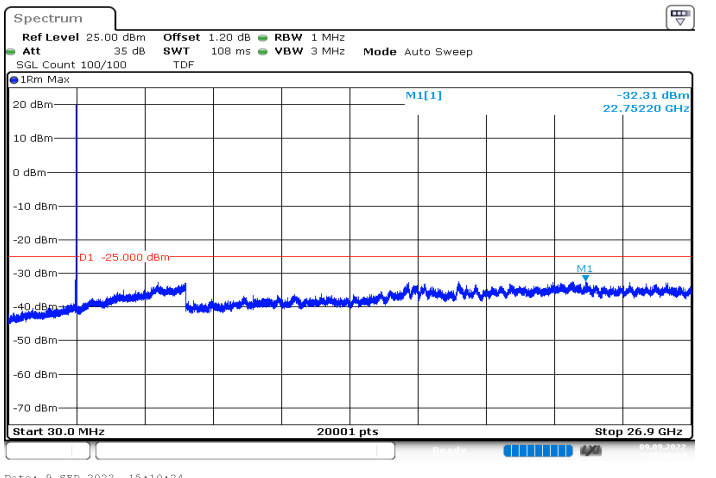


Date: 9.SEP.2022 15:10:24

n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_26.9GHz

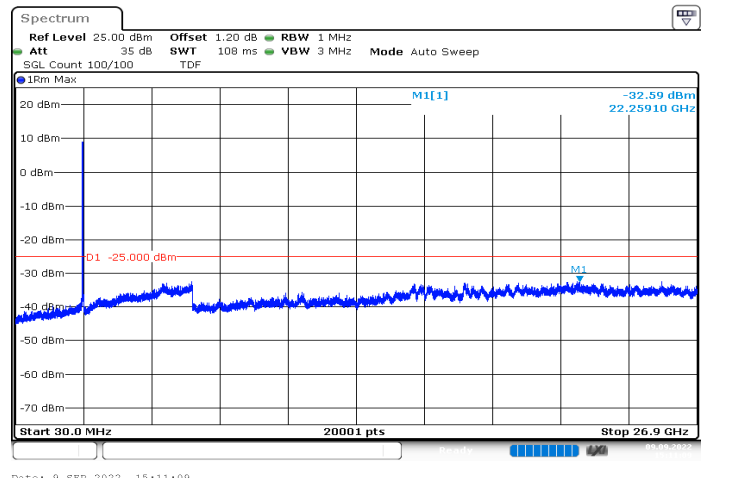


Date: 9.SEP.2022 15:11:09

n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

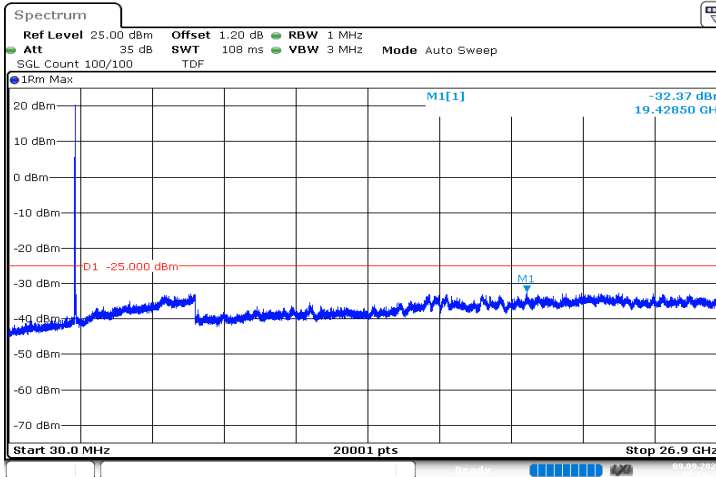


Date: 9.SEP.2022 15:12:36

n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB1@132|30MHz_26.9GHz

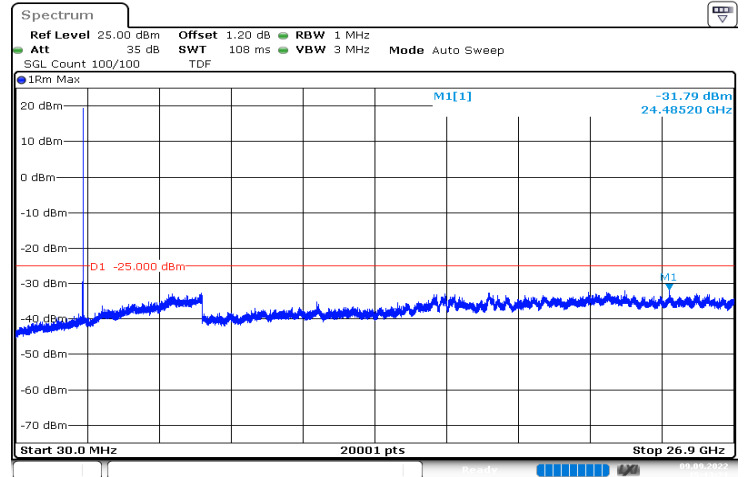


Date: 9.SEP.2022 15:13:21

n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB128@0|30MHz_26.9GHz

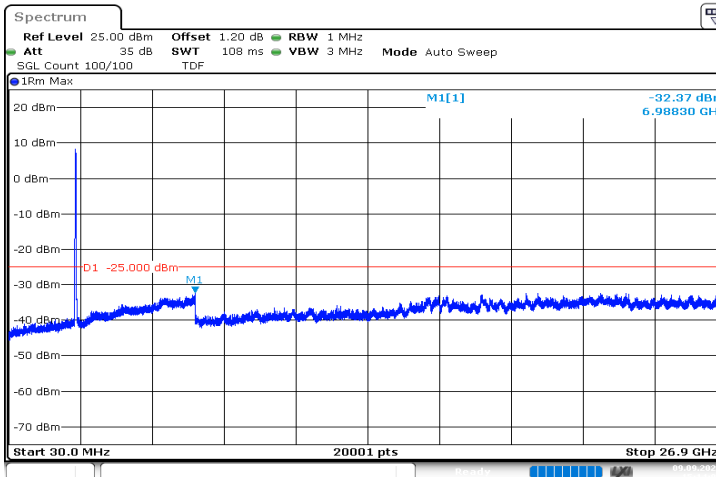


Date: 9.SEP.2022 15:14:05

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

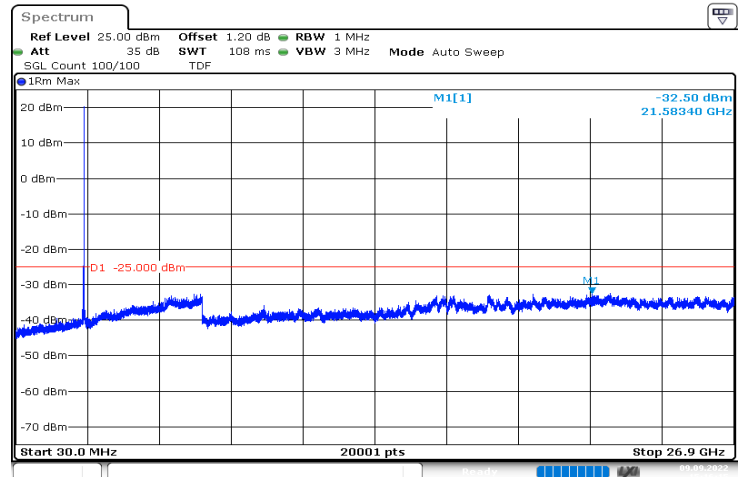


Date: 9.SEP.2022 15:16:15

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@132|30MHz_26.9GHz

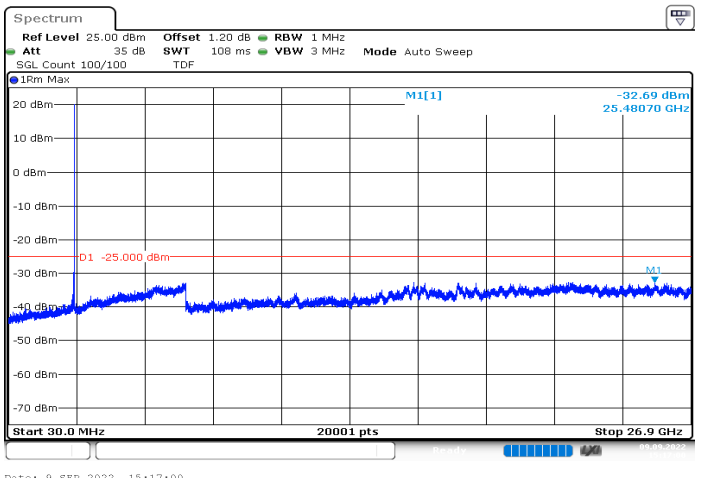


Date: 9.SEP.2022 15:17:00

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB128@0|30MHz_26.9GHz

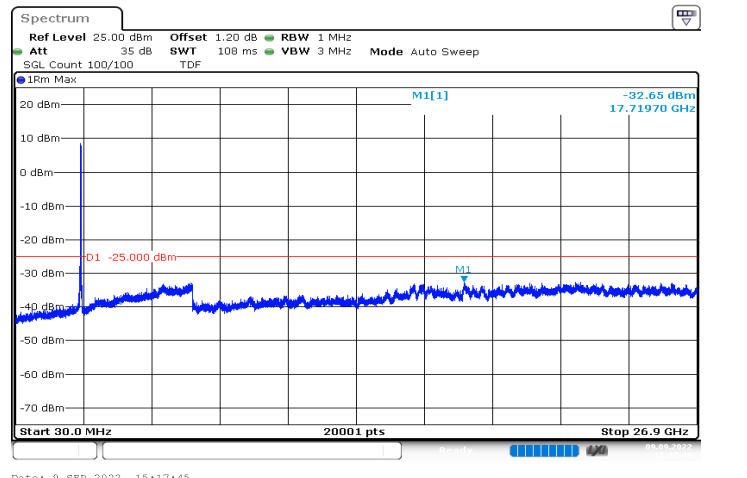


Date: 9.SEP.2022 15:17:45

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

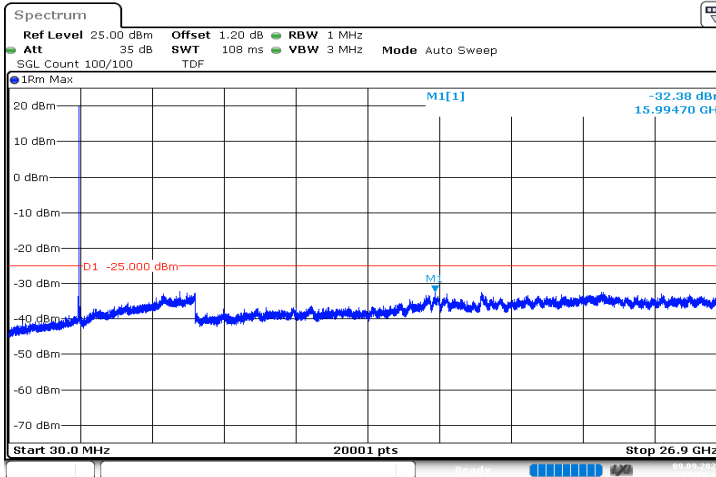


Date: 9.SEP.2022 15:19:11

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB1@132|30MHz_26.9GHz

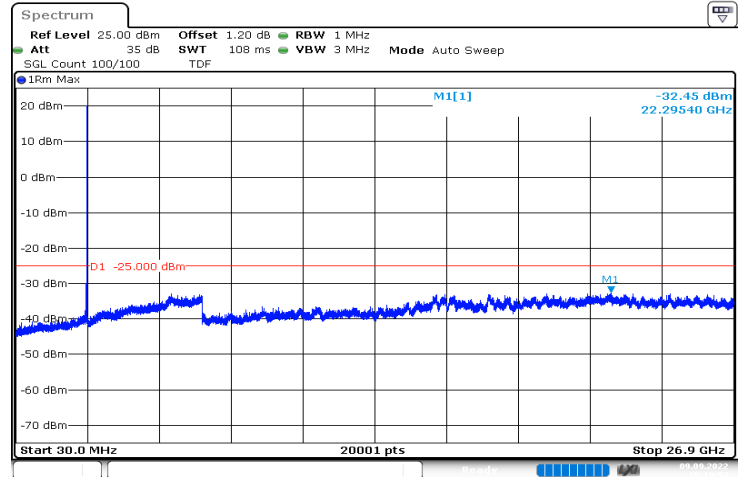


Date: 9.SEP.2022 15:19:57

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB128@0|30MHz_26.9GHz

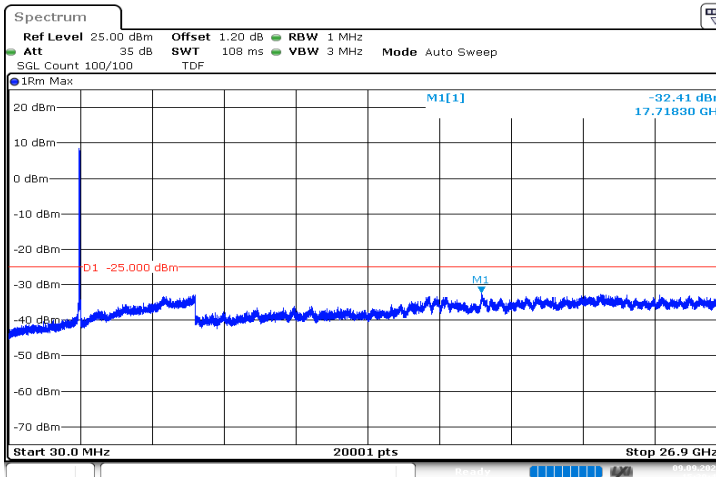


Date: 9.SEP.2022 15:20:42

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

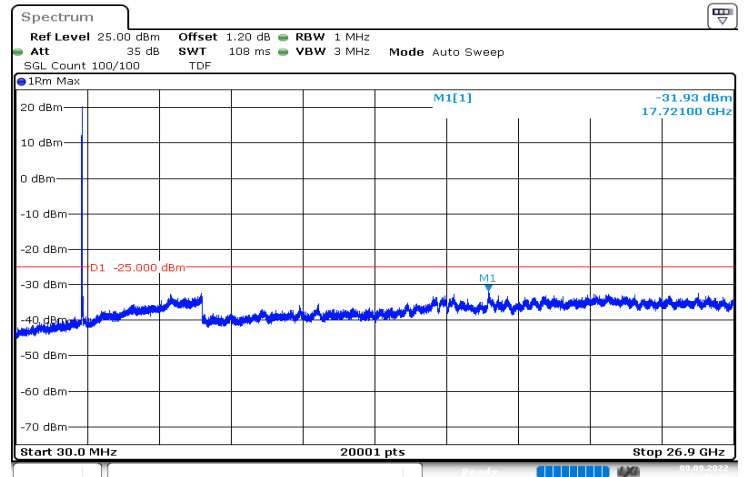


Date: 9.SEP.2022 15:21:50

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB1@161|30MHz_26.9GHz

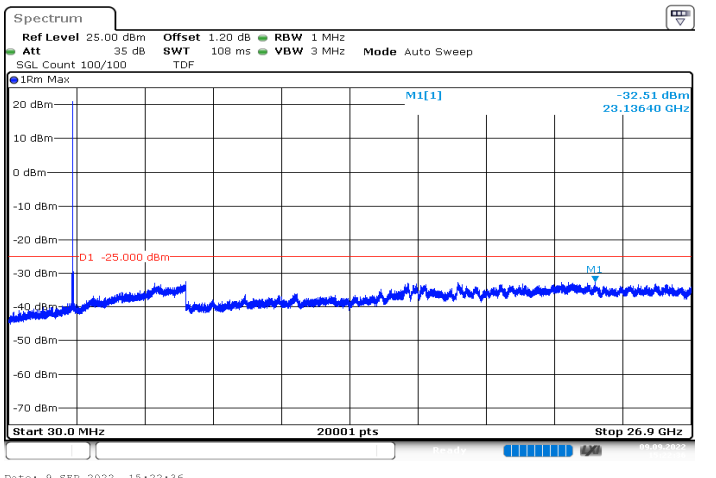


Date: 9.SEP.2022 15:22:36

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB162@0|30MHz_26.9GHz

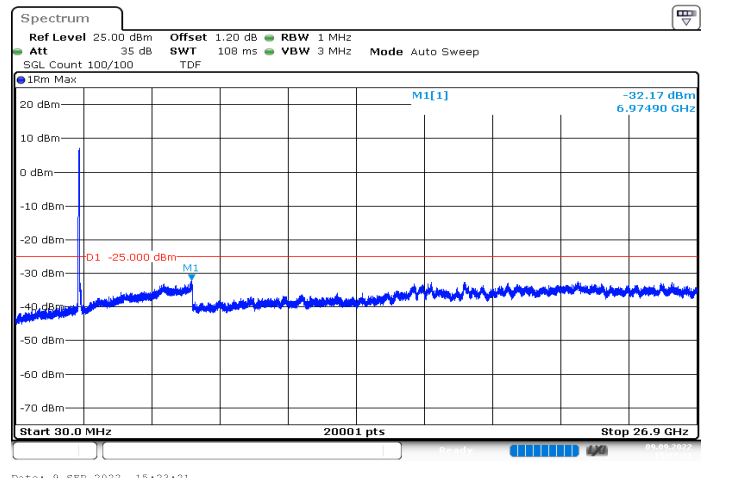


Date: 9.SEP.2022 15:23:21

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

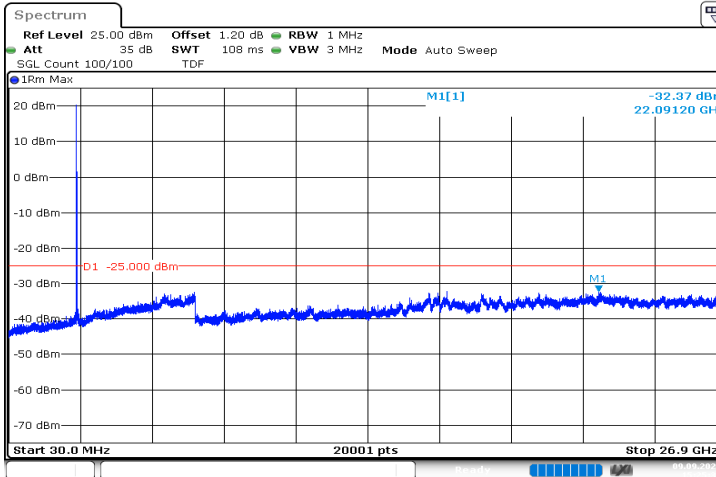


Date: 9.SEP.2022 15:25:32

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@161|30MHz_26.9GHz

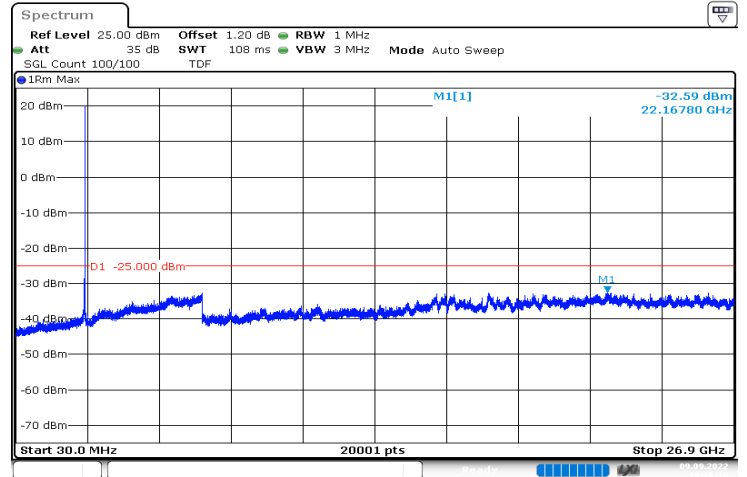


Date: 9.SEP.2022 15:26:18

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB162@0|30MHz_26.9GHz

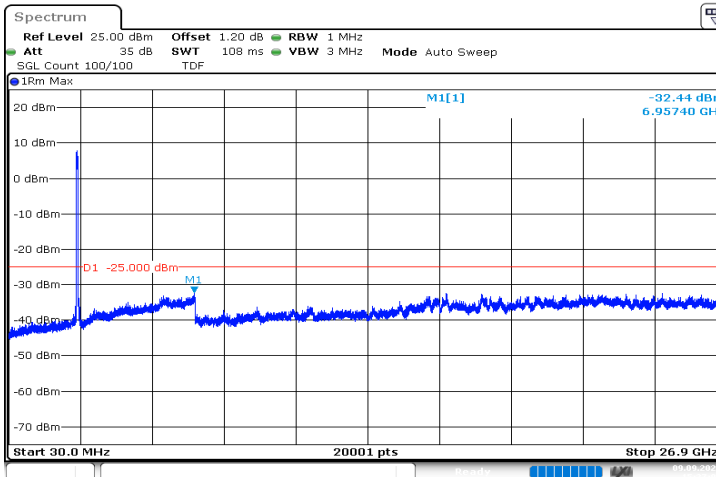


Date: 9.SEP.2022 15:27:03

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

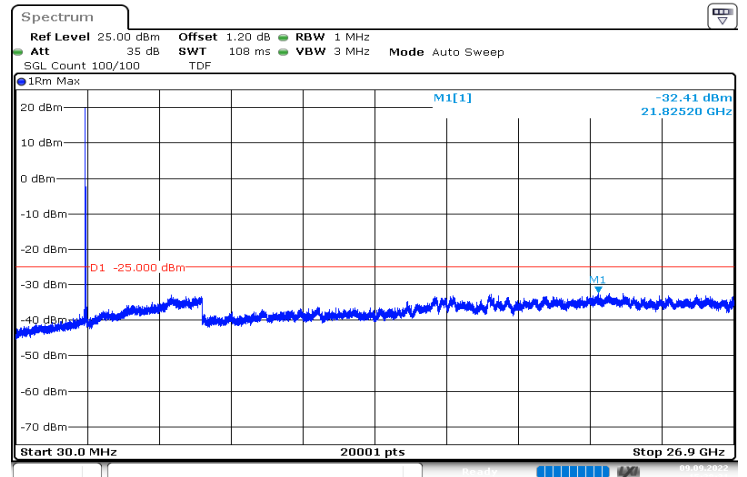


Date: 9.SEP.2022 15:28:31

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB1@161|30MHz_26.9GHz

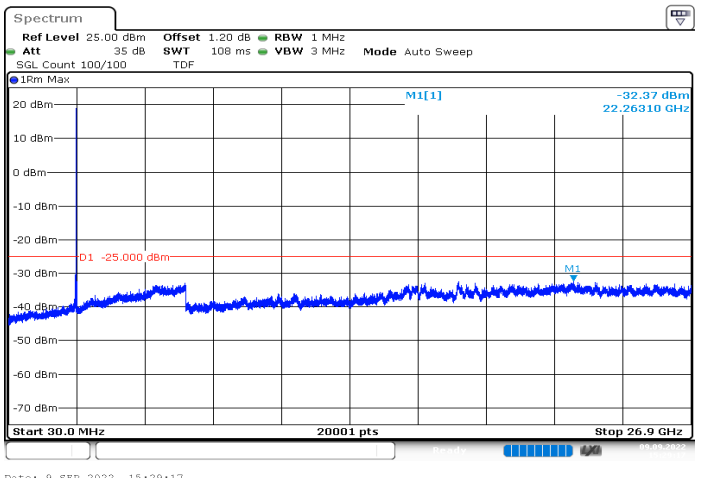


Date: 9.SEP.2022 15:29:17

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB162@0|30MHz_26.9GHz

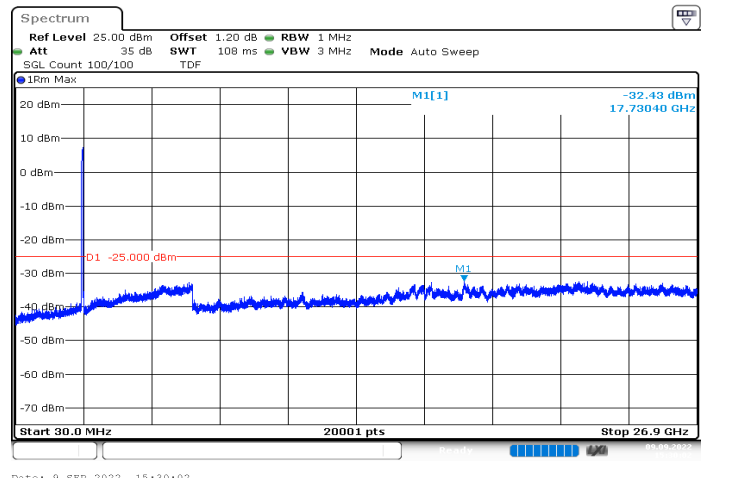


Date: 9.SEP.2022 15:30:02

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

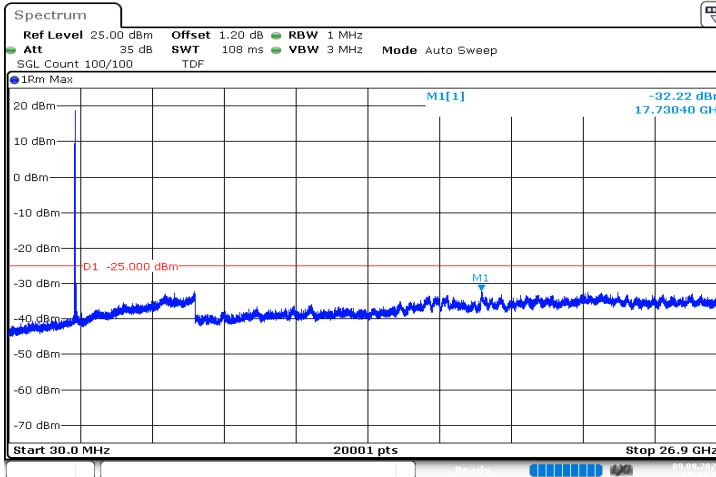


Date: 9.SEP.2022 15:31:10

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB1@216|30MHz_26.9GHz

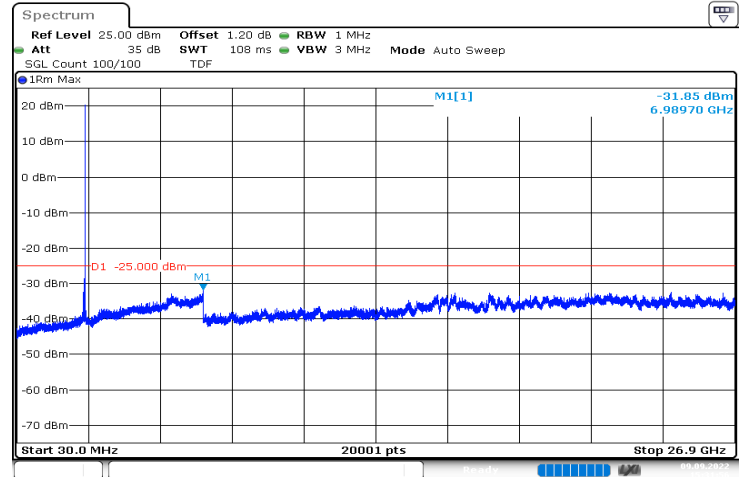


Date: 9.SEP.2022 15:31:56

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB216@0|30MHz_26.9GHz

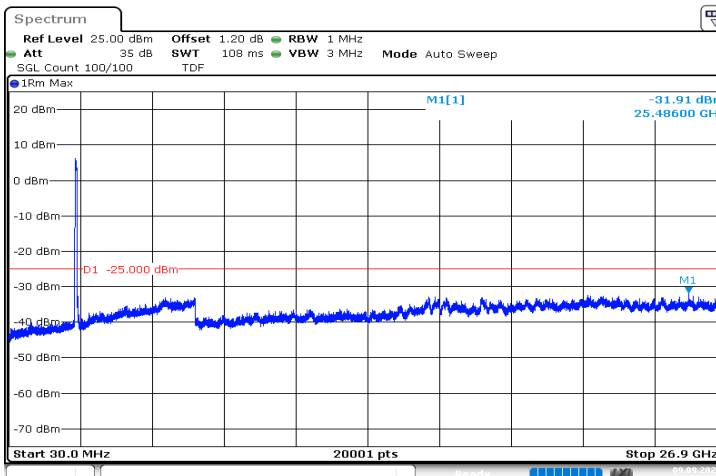


Date: 9.SEP.2022 15:32:41

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

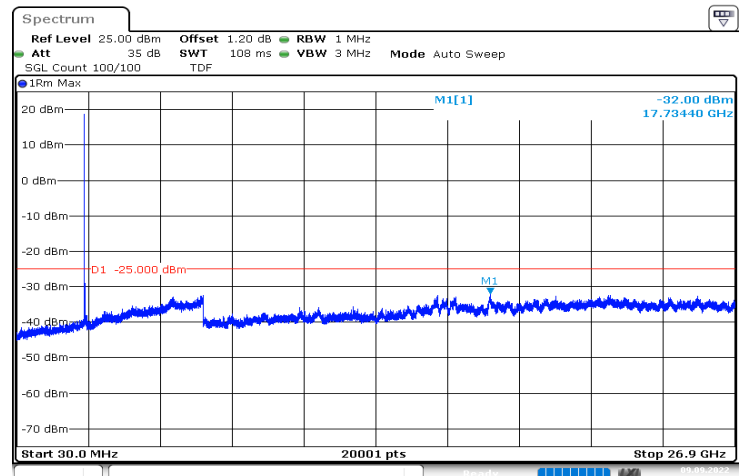


Date: 9.SEP.2022 15:34:52

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@216|30MHz_26.9GHz

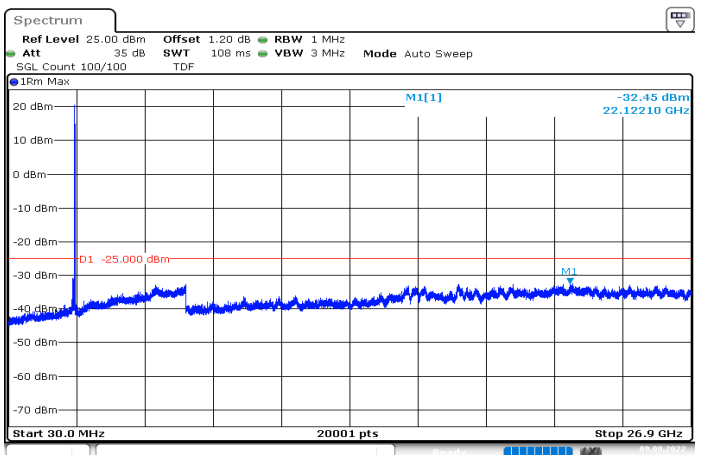


Date: 9.SEP.2022 15:35:38

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB216@0|30MHz_26.9GHz

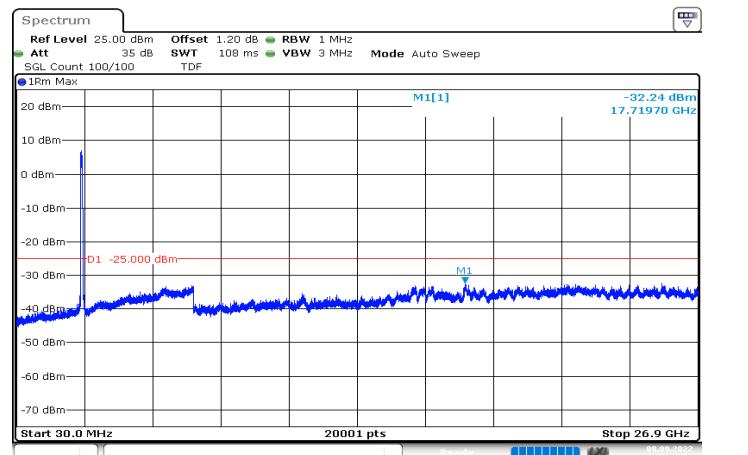


Date: 9.SEP.2022 15:36:23

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

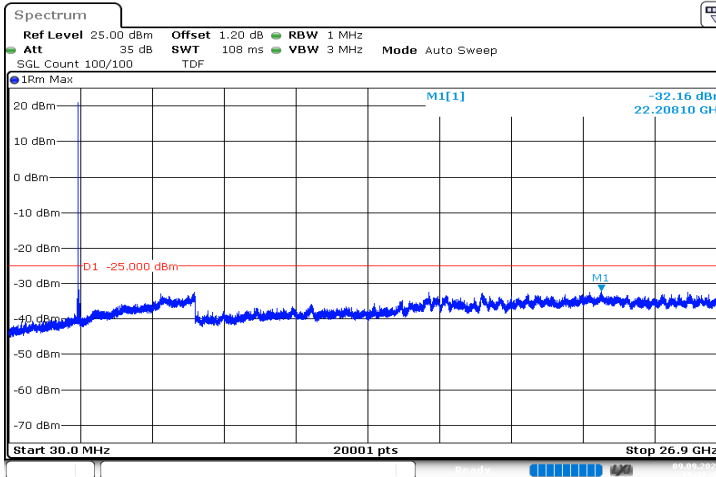


Date: 9.SEP.2022 15:37:50

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB1@216|30MHz_26.9GHz

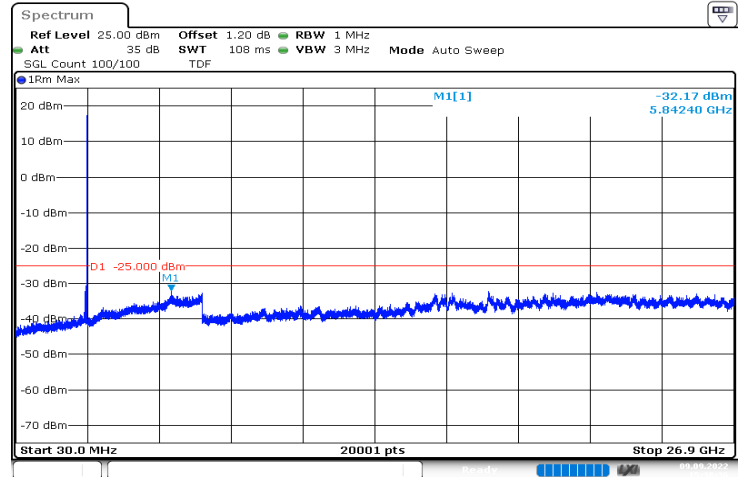


Date: 9.SEP.2022 15:38:36

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB216@0|30MHz_26.9GHz

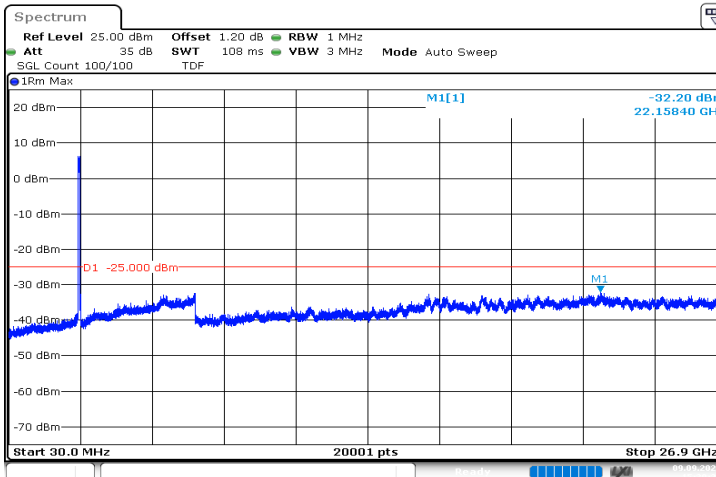


Date: 9.SEP.2022 15:39:21

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

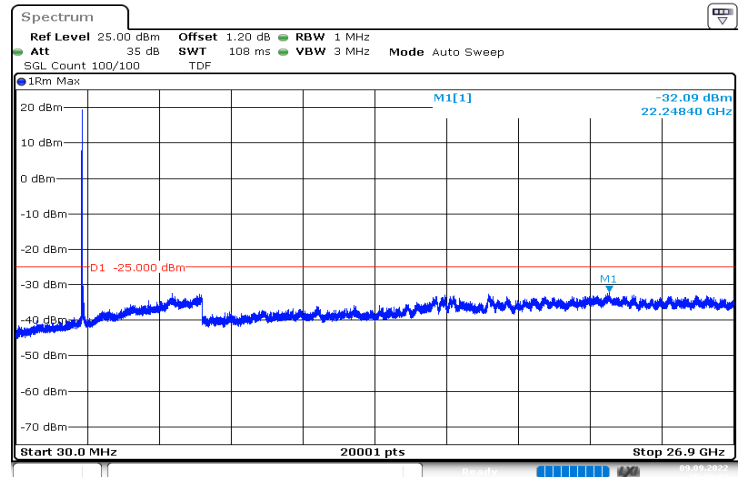


Date: 9.SEP.2022 15:40:32

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB1@244|30MHz_26.9GHz

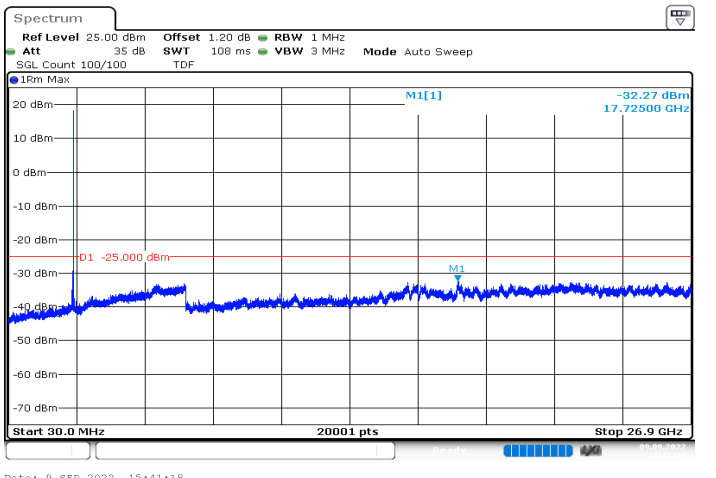


Date: 9.SEP.2022 15:41:18

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB243@0|30MHz_26.9GHz

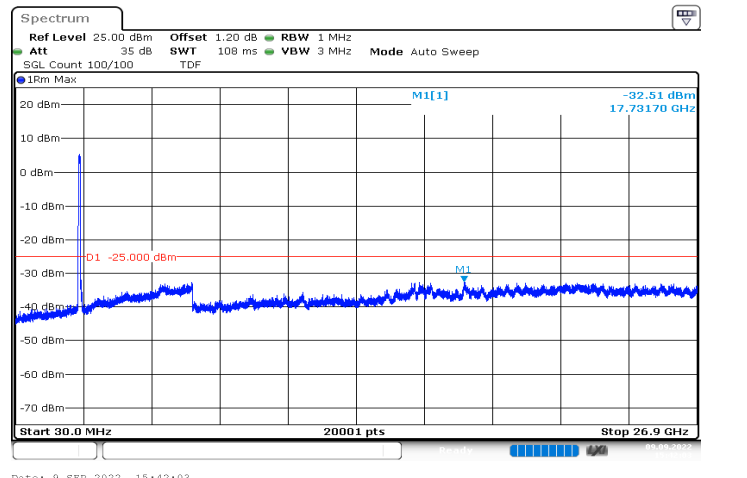


Date: 9.SEP.2022 15:42:03

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

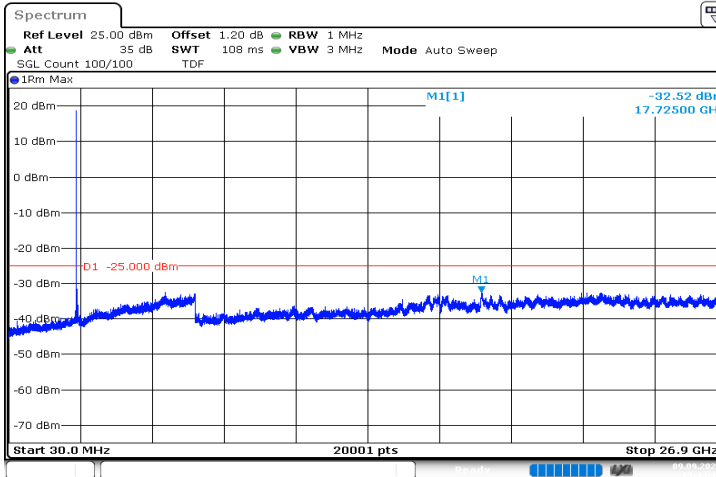


Date: 9.SEP.2022 15:44:15

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@244|30MHz_26.9GHz

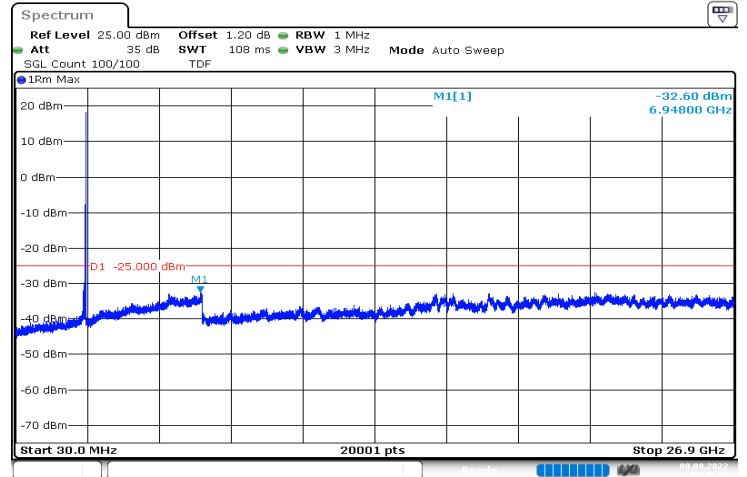


Date: 9.SEP.2022 15:45:01

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB243@0|30MHz_26.9GHz

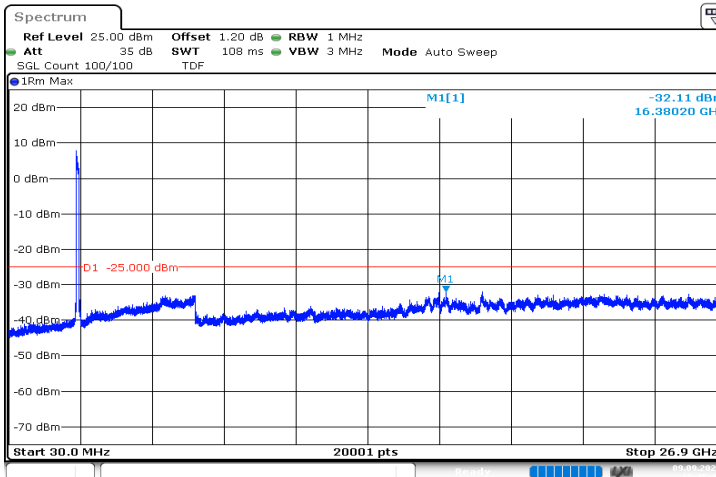


Date: 9.SEP.2022 15:45:47

n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

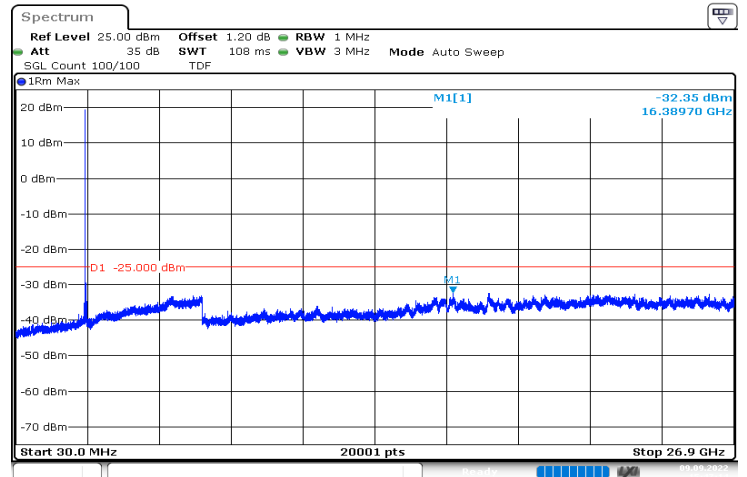


Date: 9.SEP.2022 15:47:15

n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM
QPSK_RB1@244|30MHz_26.9GHz

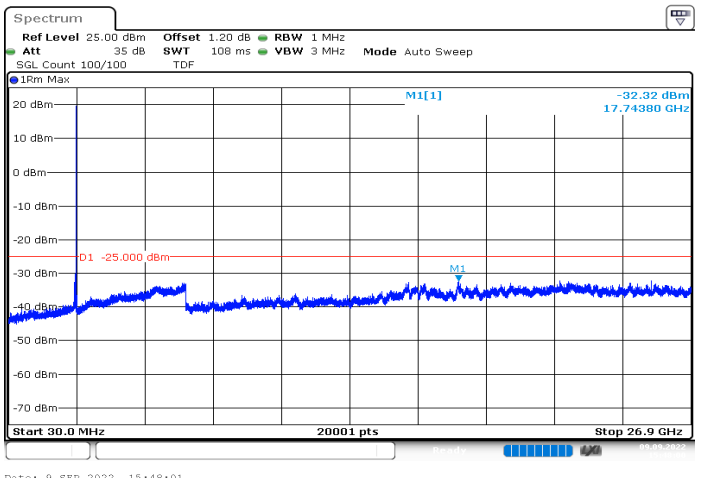


Date: 9.SEP.2022 15:48:01

n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM
QPSK_RB243@0|30MHz_26.9GHz

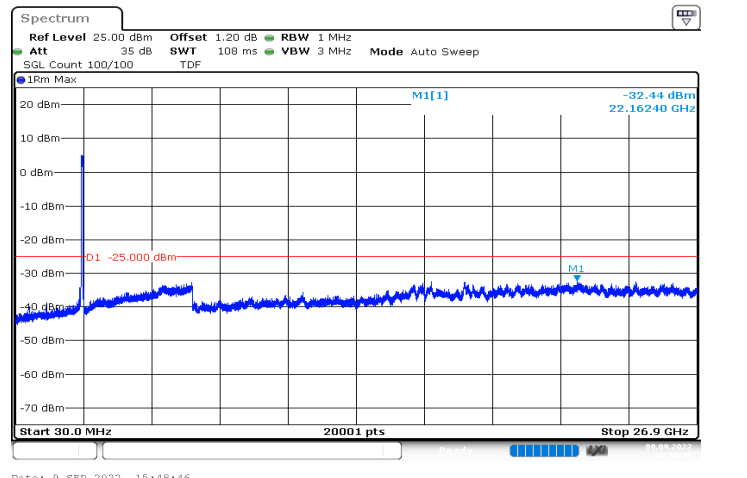


Date: 9.SEP.2022 15:48:46

n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM_QPSK_RB1@0|30MHz_26.9GHz

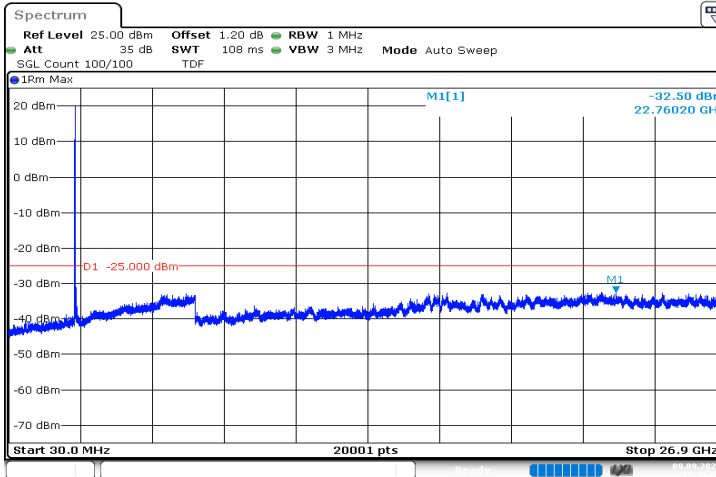


Date: 9.SEP.2022 15:49:56

n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM_QPSK_RB1@272|30MHz_26.9GHz

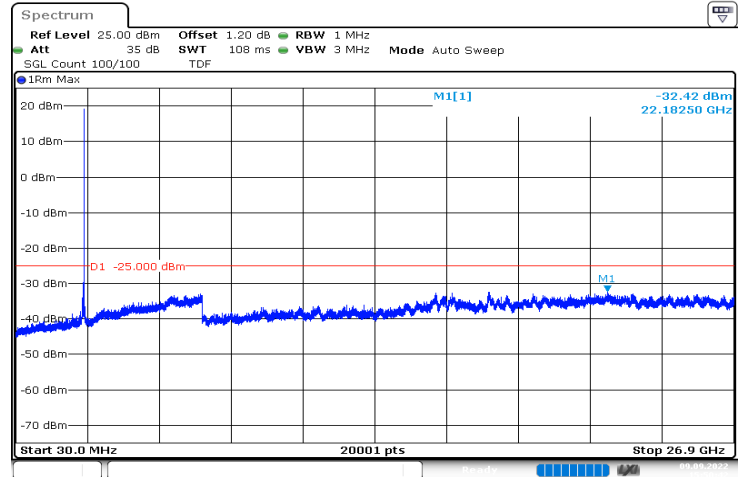


Date: 9.SEP.2022 15:50:42

n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM_QPSK_RB270@0|30MHz_26.9GHz

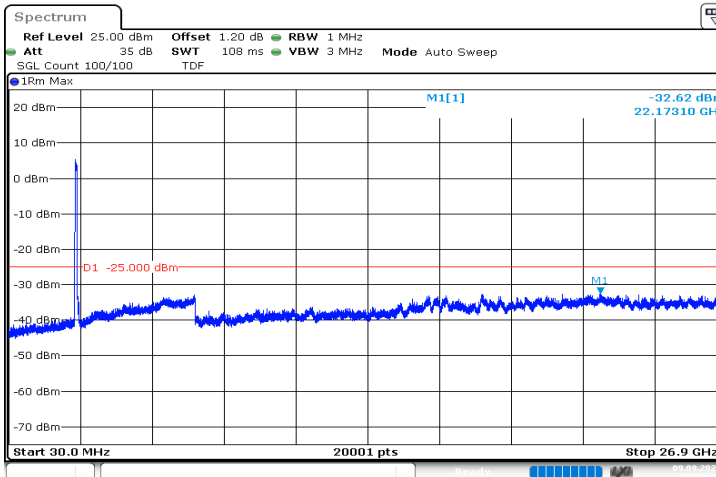


Date: 9.SEP.2022 15:51:28

n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM_QPSK_RB1@0|30MHz_26.9GHz

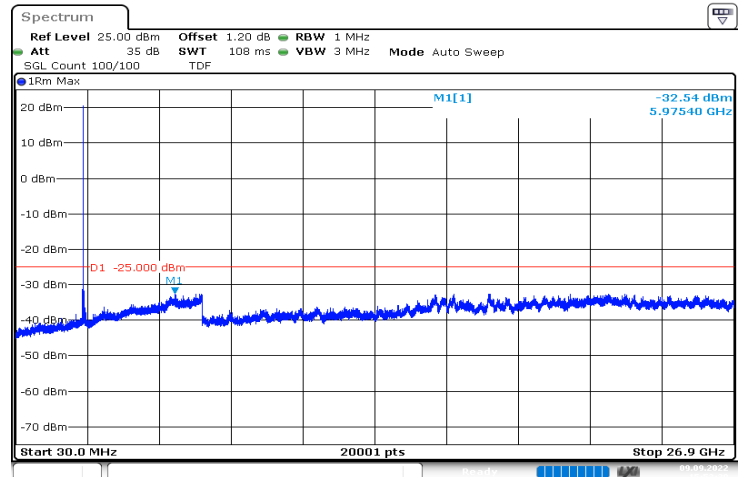


Date: 9.SEP.2022 15:53:40

n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM_QPSK_RB1@272|30MHz_26.9GHz

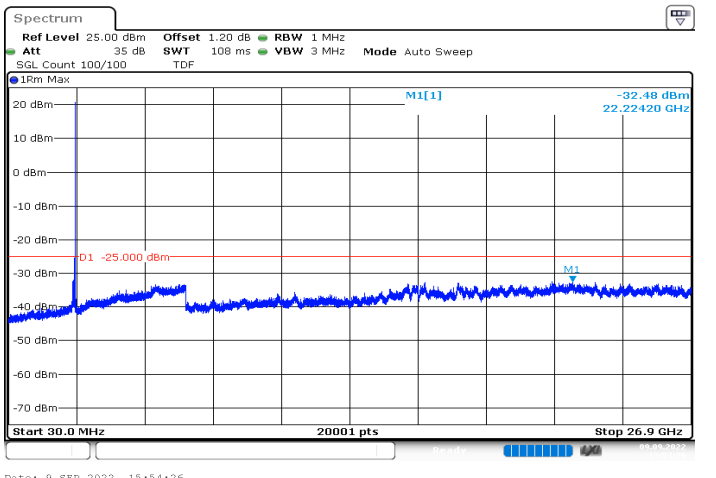


Date: 9.SEP.2022 15:54:26

n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM_QPSK_RB270@0|30MHz_26.9GHz

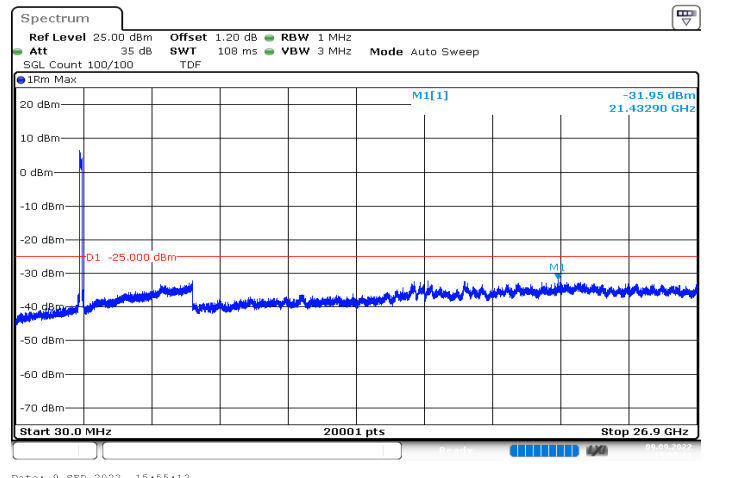


Date: 9.SEP.2022 15:55:12

n41_100MHz_30kHz_2640MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_26.9GHz

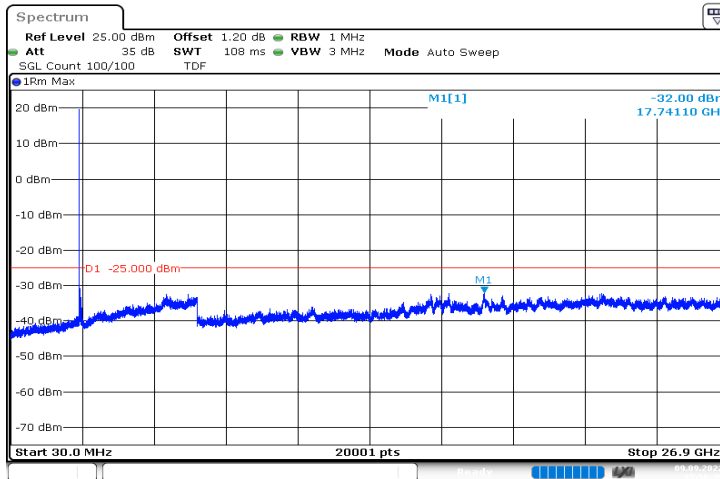


Date: 9.SEP.2022 15:56:40

n41_100MHz_30kHz_2640MHz_DFT-s-OFDM
QPSK_RB1@272|30MHz_26.9GHz

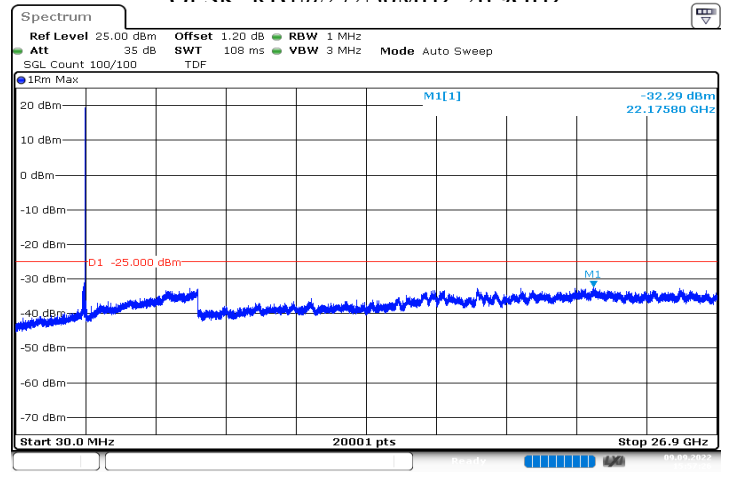

Date: 9.SEP.2022 15:57:26


n41_100MHz_30kHz_2640MHz_DFT-s-OFDM
QPSK_RB270@0|30MHz_26.9GHz

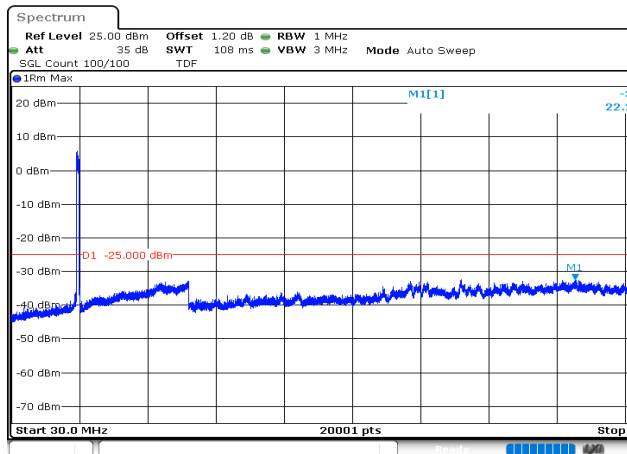

Date: 9.SEP.2022 15:58:11


n66 , Normal

n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

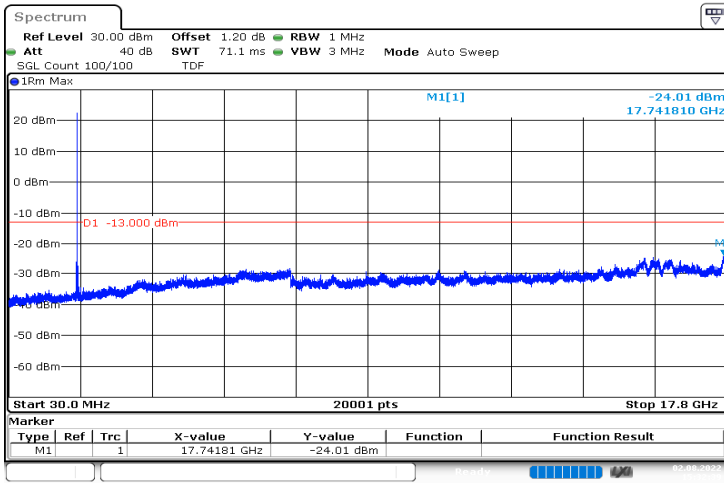


Date: 2.AUG.2022 15:32:39

n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_17.8GHz

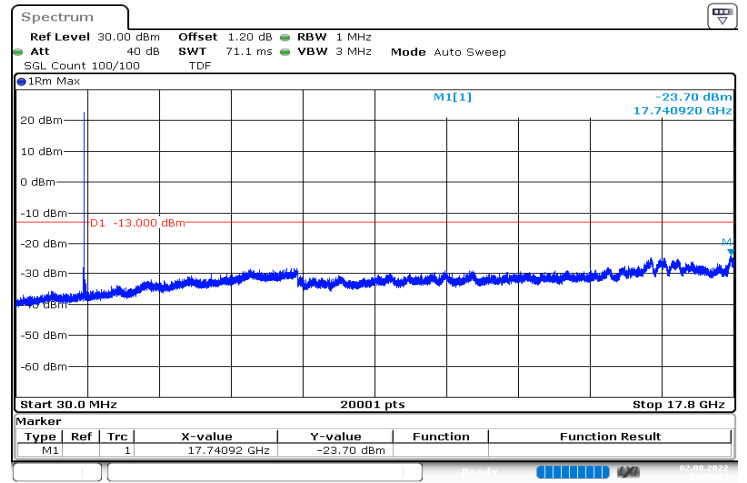


Date: 2.AUG.2022 15:33:13

n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_17.8GHz

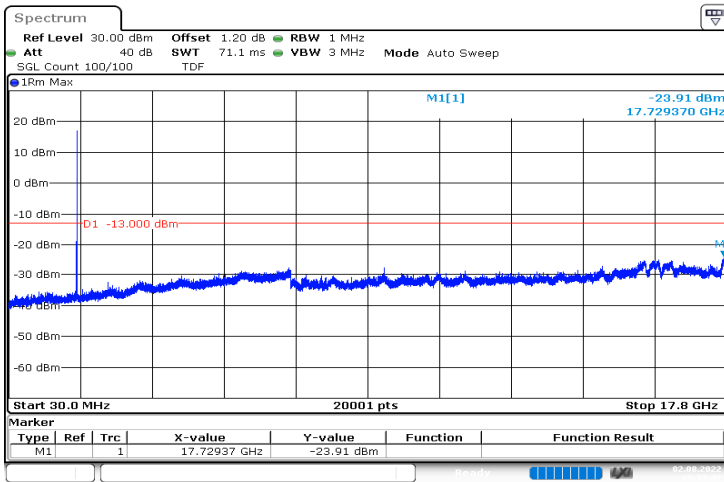


Date: 2.AUG.2022 15:33:47

n66_5MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_17.8GHz

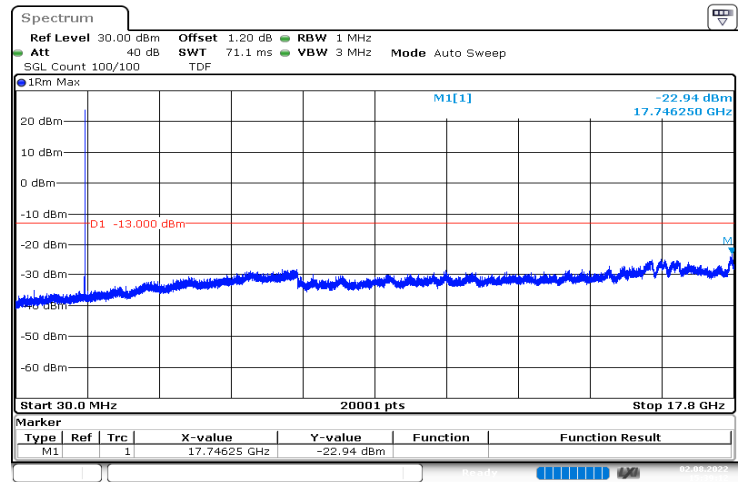


Date: 2.AUG.2022 15:39:13

n66_5MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_17.8GHz

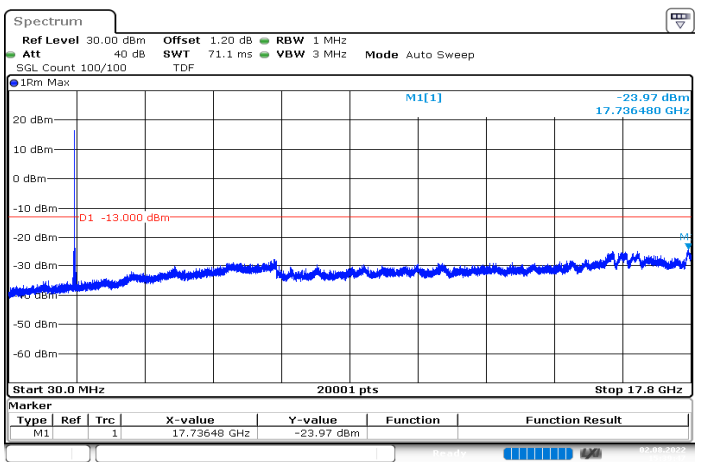


Date: 2.AUG.2022 15:39:48

n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

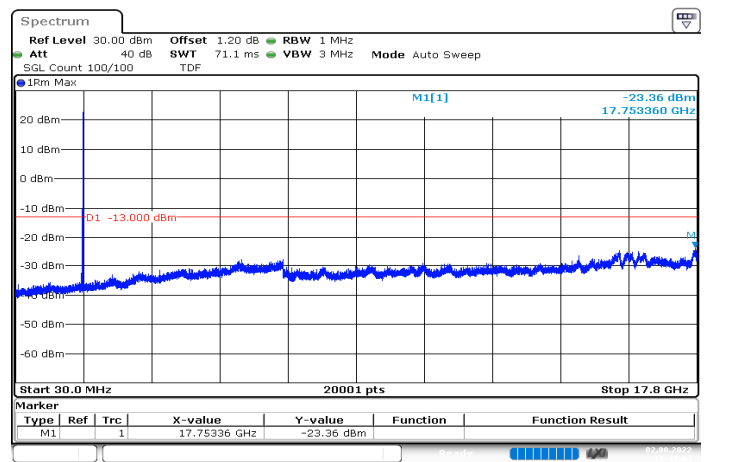


Date: 2.AUG.2022 15:41:04

n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_17.8GHz

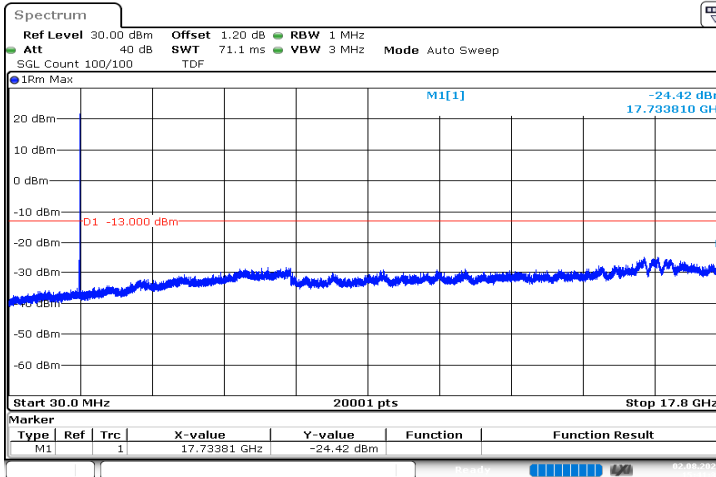


Date: 2.AUG.2022 15:41:39

n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_17.8GHz

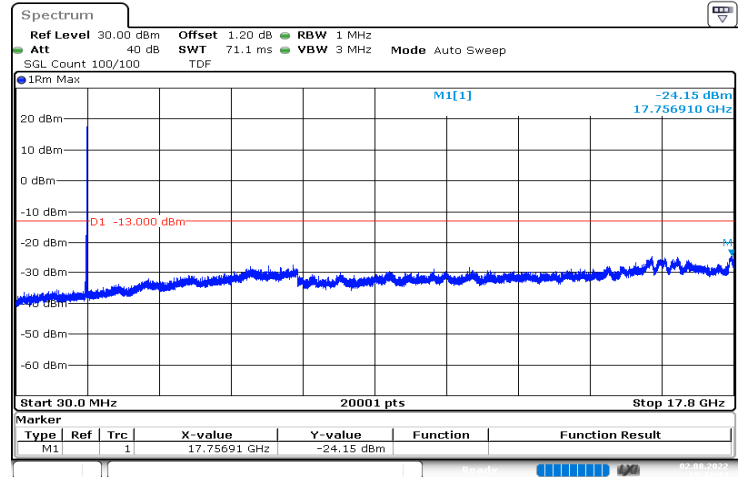


Date: 2.AUG.2022 15:42:13

n66_10MHz_15kHz_1715MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

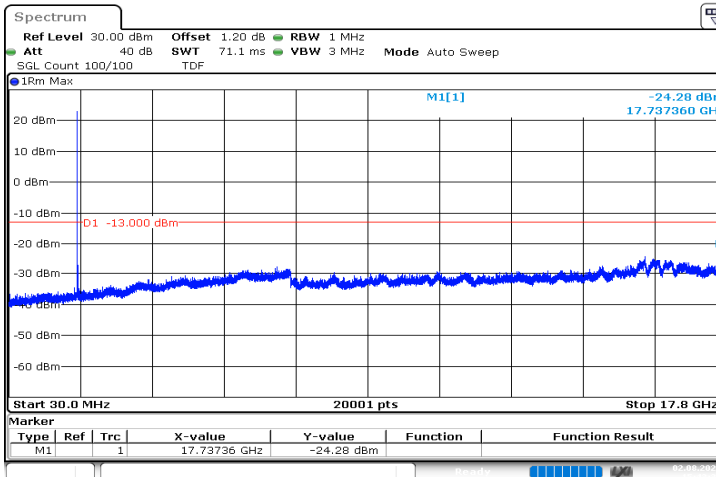


Date: 2.AUG.2022 15:43:31

n66_10MHz_15kHz_1715MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_17.8GHz

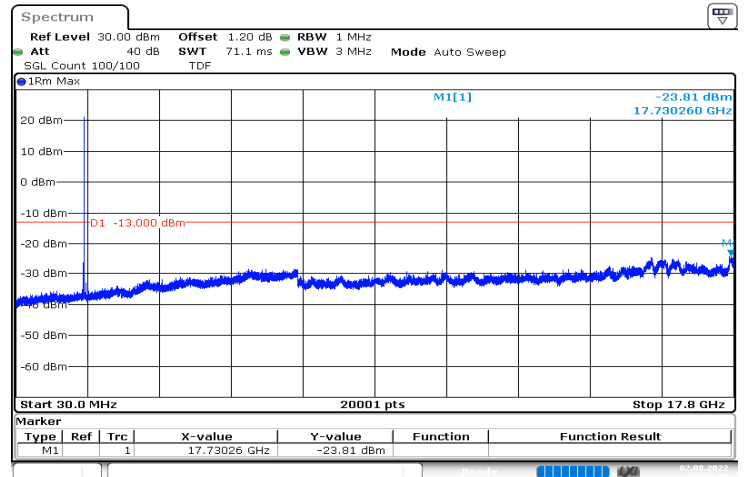


Date: 2.AUG.2022 15:44:06

n66_10MHz_15kHz_1715MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_17.8GHz

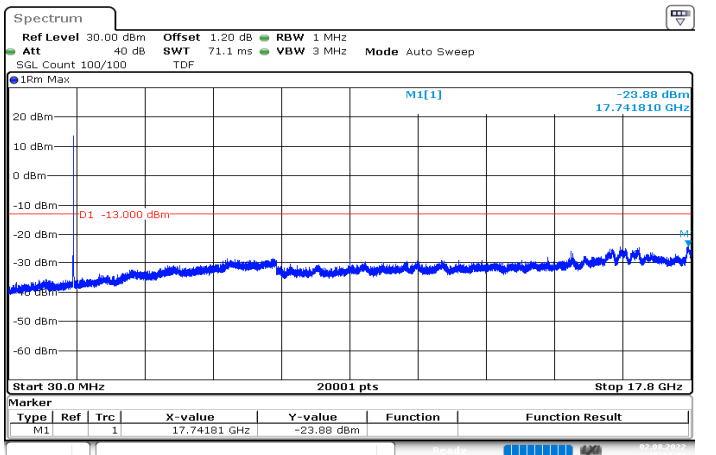


Date: 2.AUG.2022 15:44:41

n66_10MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_17.8GHz

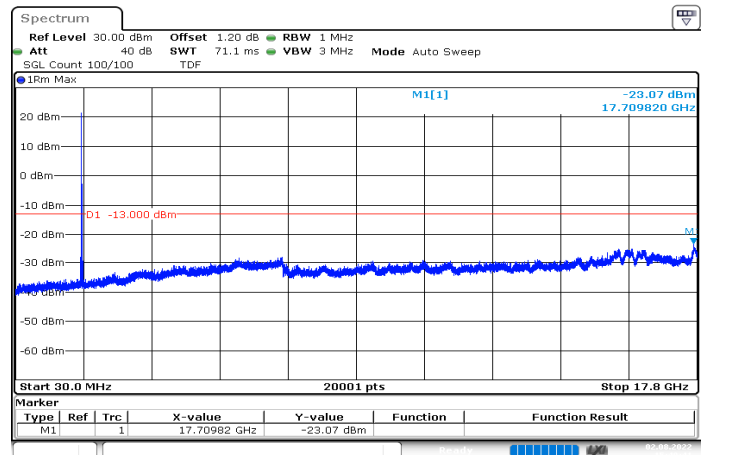


Date: 2.AUG.2022 15:48:42

n66_10MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_17.8GHz

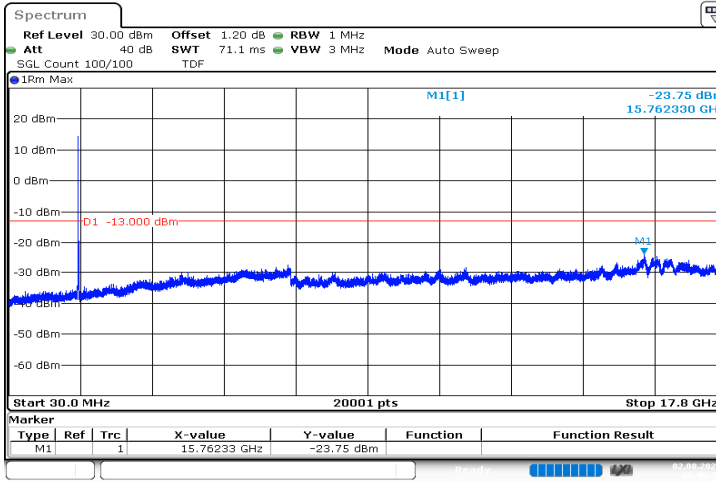


Date: 2.AUG.2022 15:49:17

n66_10MHz_15kHz_1775MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

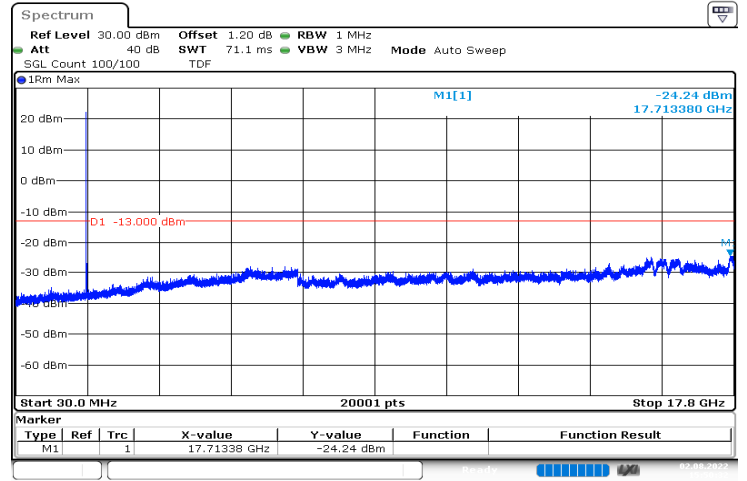


Date: 2.AUG.2022 15:50:33

n66_10MHz_15kHz_1775MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_17.8GHz

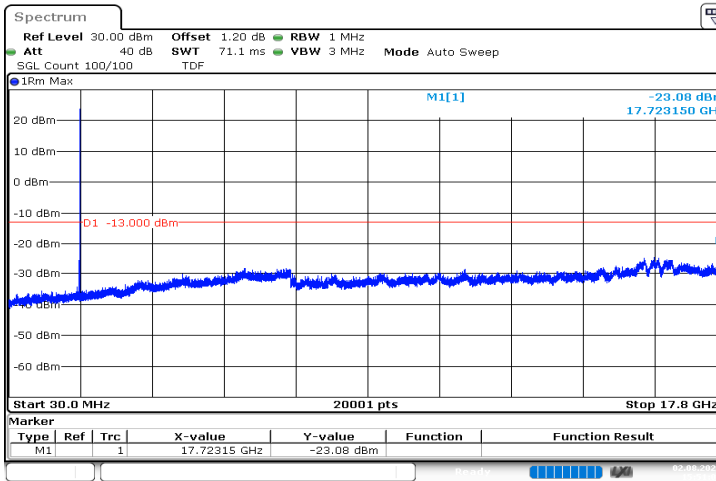


Date: 2.AUG.2022 15:51:08

n66_10MHz_15kHz_1775MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_17.8GHz

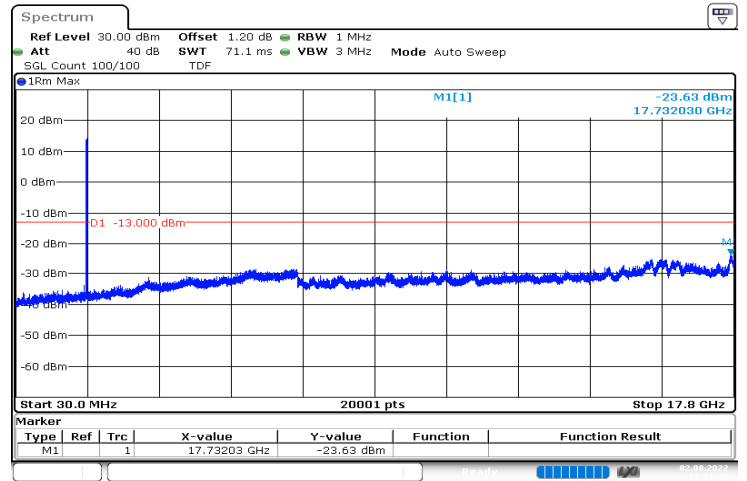


Date: 2.AUG.2022 15:51:43

n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

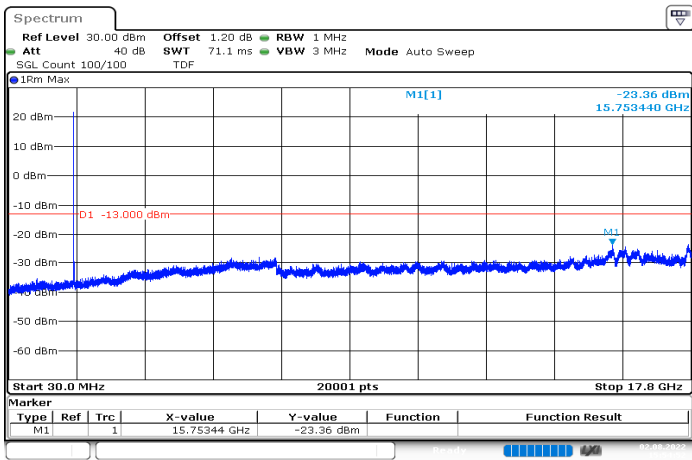


Date: 2.AUG.2022 15:54:52

n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_17.8GHz

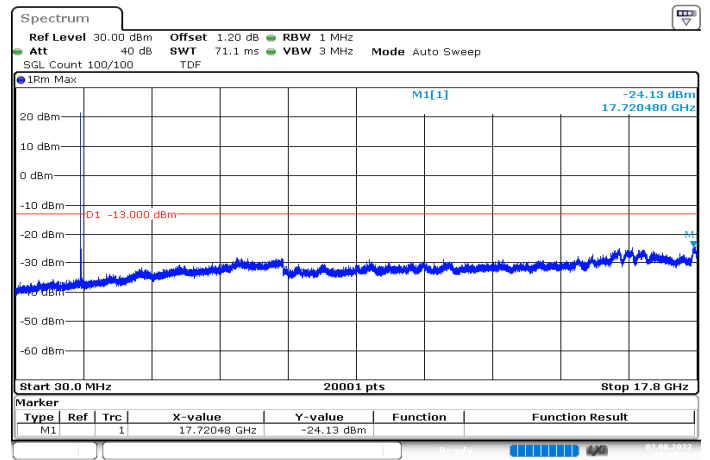


Date: 2.AUG.2022 15:55:27

n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_17.8GHz

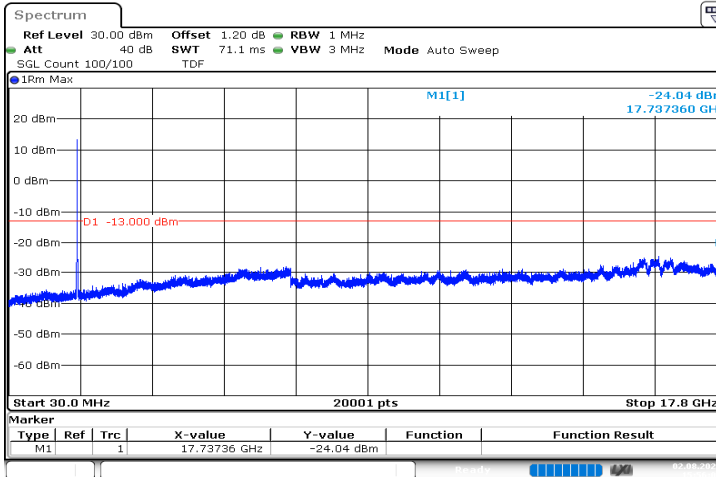


Date: 2.AUG.2022 15:56:02

n66_15MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

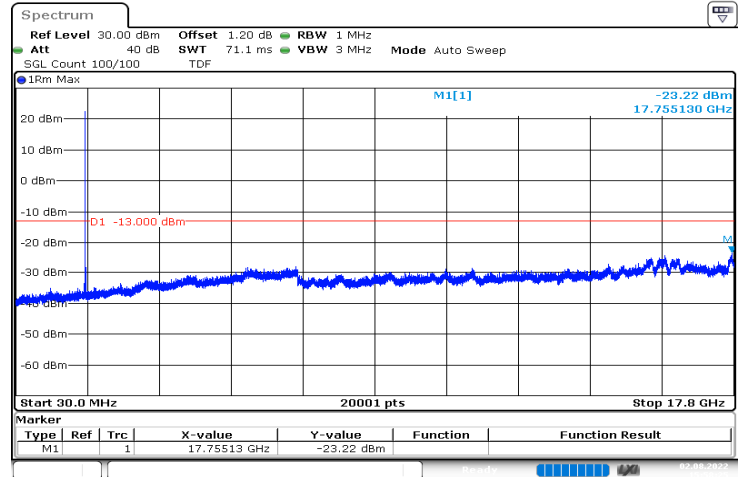


Date: 2.AUG.2022 15:58:25

n66_15MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_17.8GHz

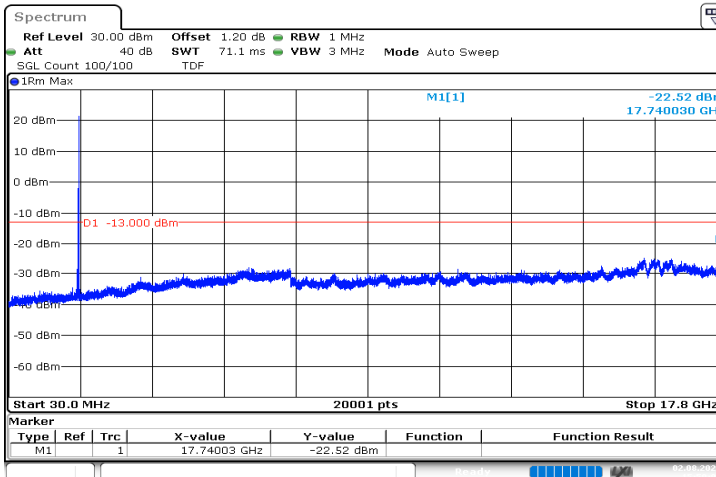


Date: 2.AUG.2022 15:59:01

n66_15MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_17.8GHz

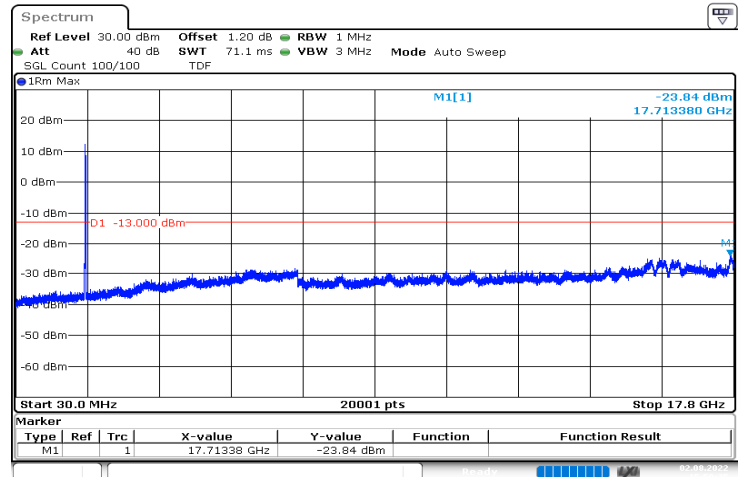


Date: 2.AUG.2022 15:59:36

n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_17.8GHz

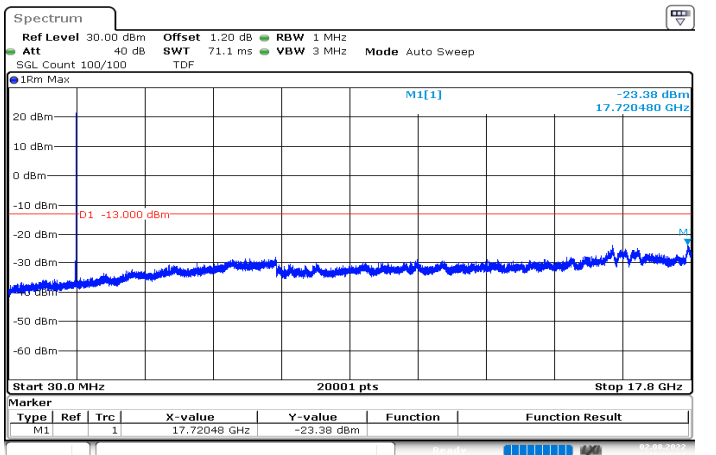


Date: 2.AUG.2022 16:02:35

n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_17.8GHz

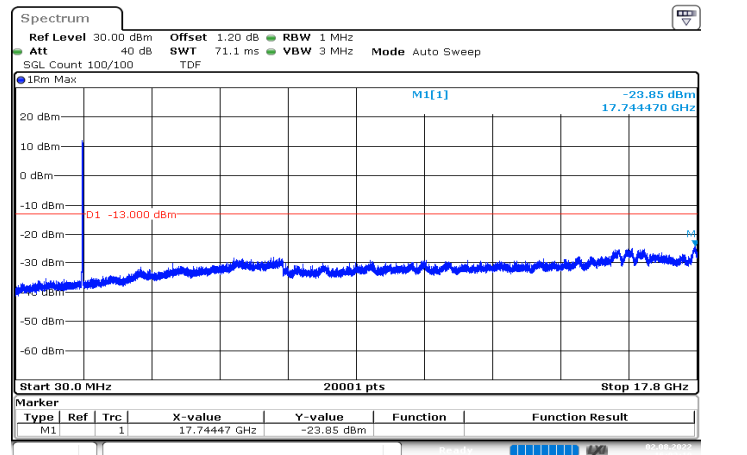


Date: 2.AUG.2022 16:03:10

n66_20MHz_15kHz_1720MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

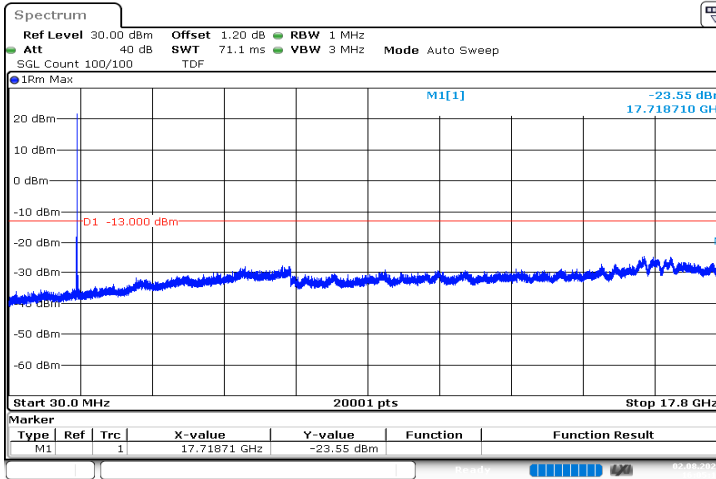


Date: 2.AUG.2022 16:05:12

n66_20MHz_15kHz_1720MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_17.8GHz

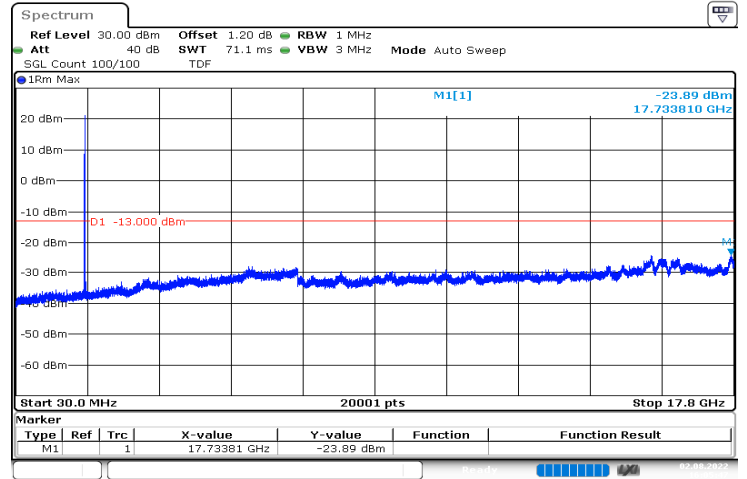


Date: 2.AUG.2022 16:05:47

n66_20MHz_15kHz_1720MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_17.8GHz

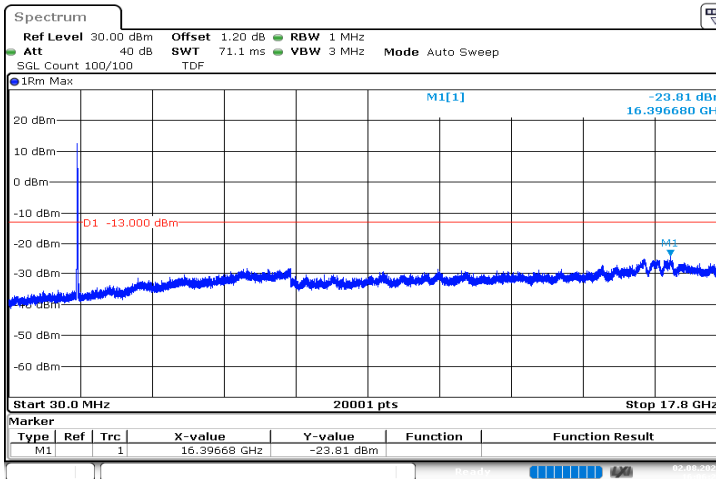


Date: 2.AUG.2022 16:06:22

n66_20MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_17.8GHz

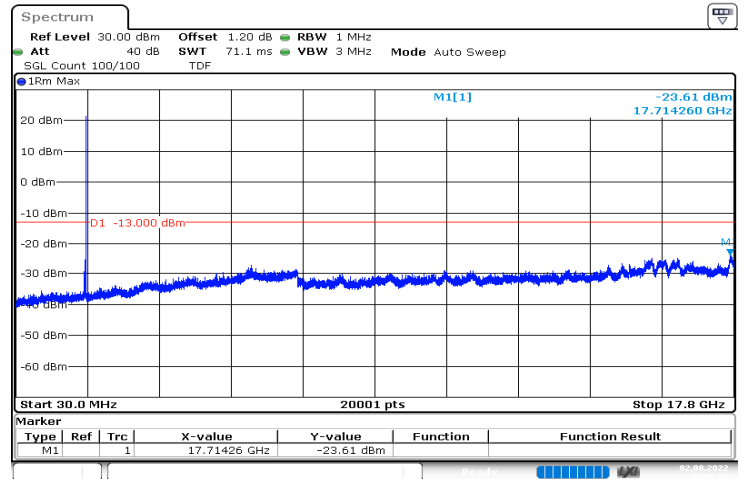


Date: 2.AUG.2022 16:09:22

n66_20MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_17.8GHz

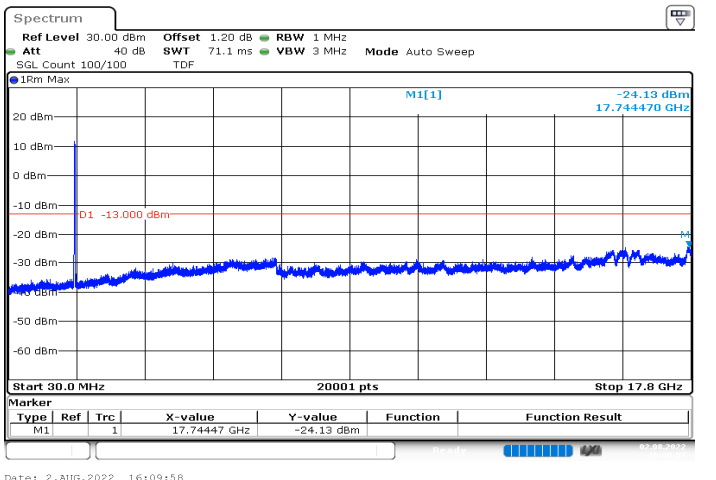


Date: 2.AUG.2022 16:09:58

n66_20MHz_15kHz_1770MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_17.8GHz

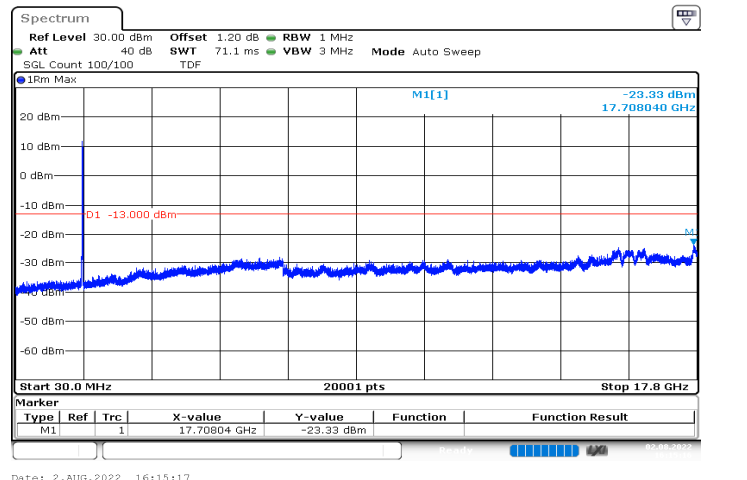


Date: 2.AUG.2022 16:15:17

n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

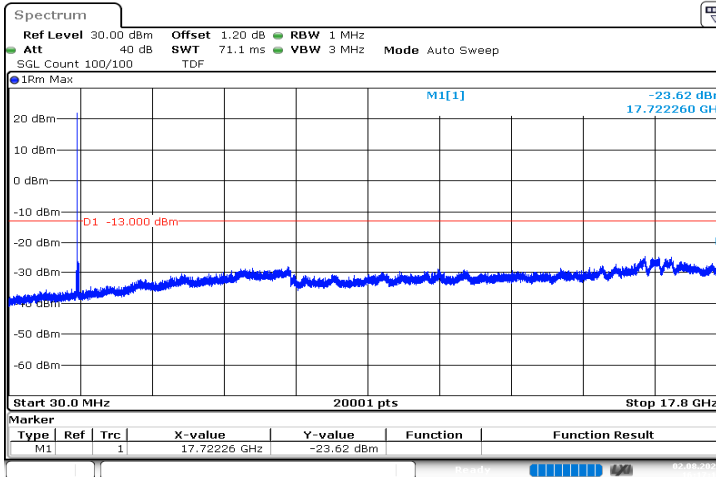


Date: 2.AUG.2022 16:17:19

n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM
QPSK_RB1@132|30MHz_17.8GHz

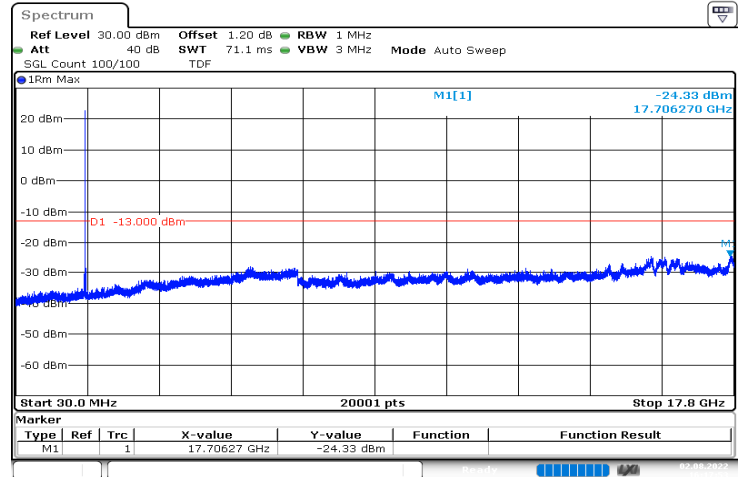


Date: 2.AUG.2022 16:17:54

n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM
QPSK_RB128@0|30MHz_17.8GHz

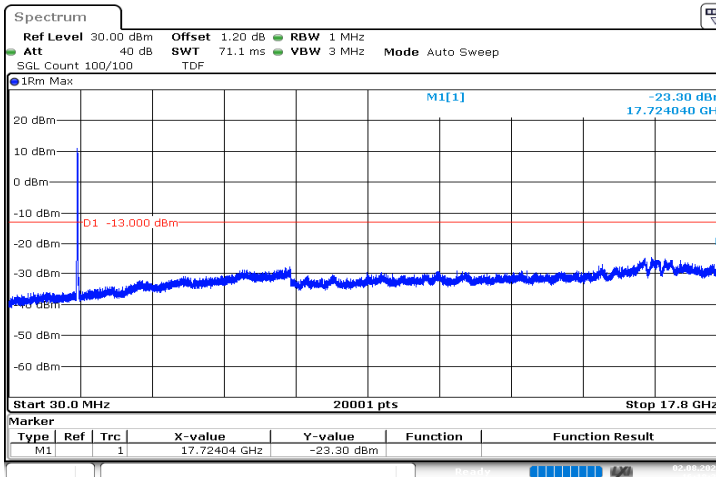


Date: 2.AUG.2022 16:18:29

n66_25MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

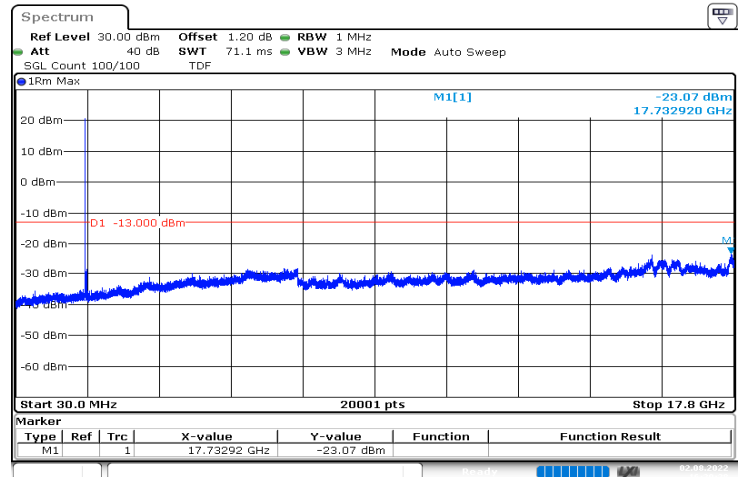


Date: 2.AUG.2022 16:20:29

n66_25MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@132|30MHz_17.8GHz

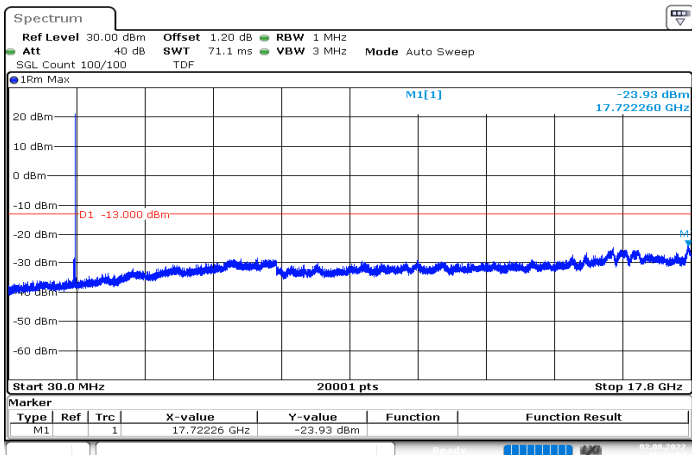


Date: 2.AUG.2022 16:21:04

n66_25MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB128@0|30MHz_17.8GHz

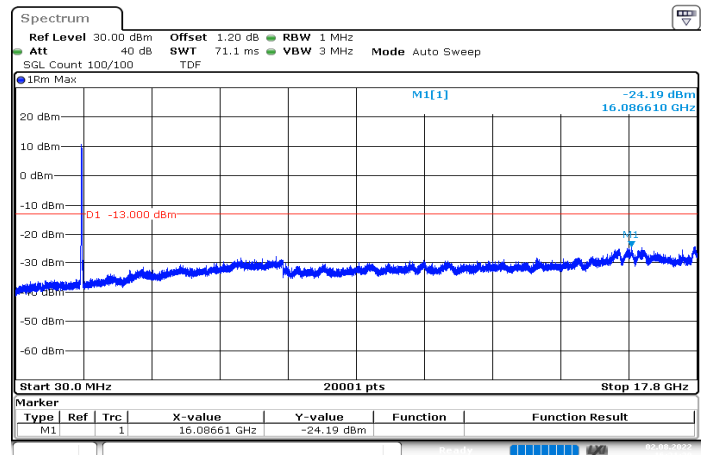


Date: 2.AUG.2022 16:21:39

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

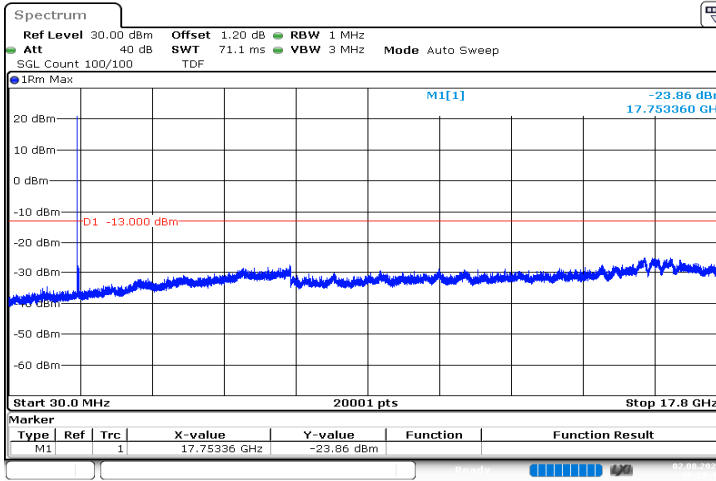


Date: 2.AUG.2022 16:29:46

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB1@159|30MHz_17.8GHz

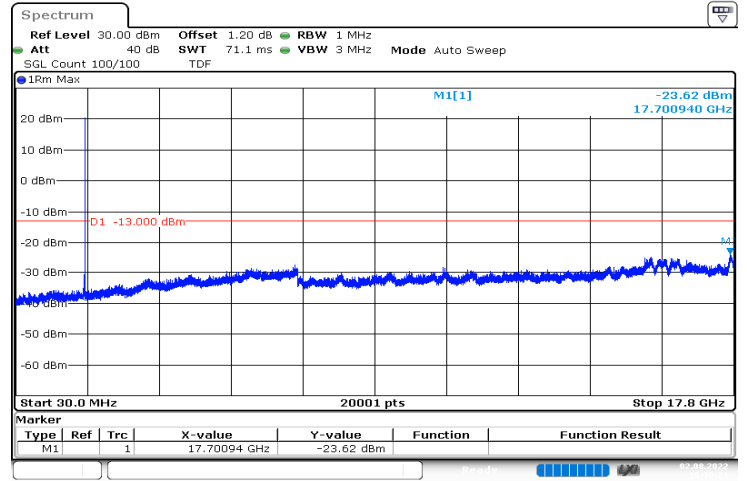


Date: 2.AUG.2022 16:30:21

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB160@0|30MHz_17.8GHz

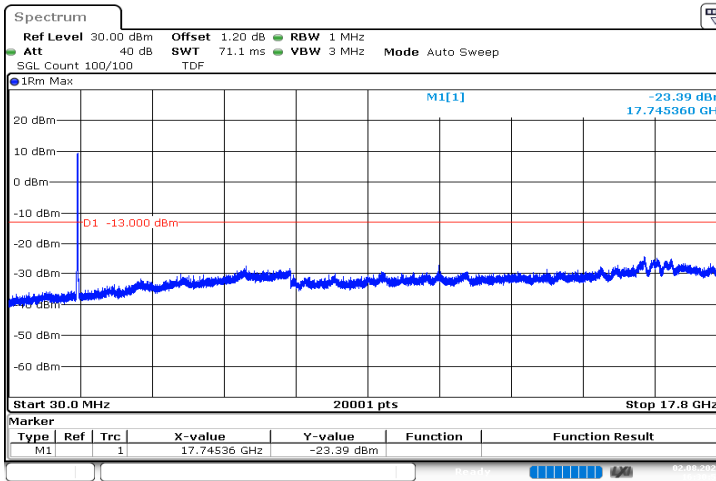


Date: 2.AUG.2022 16:30:56

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

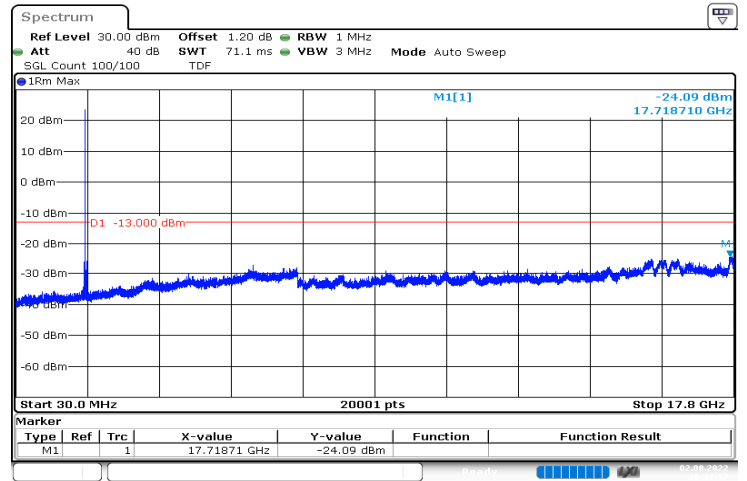


Date: 2.AUG.2022 16:32:57

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@159|30MHz_17.8GHz

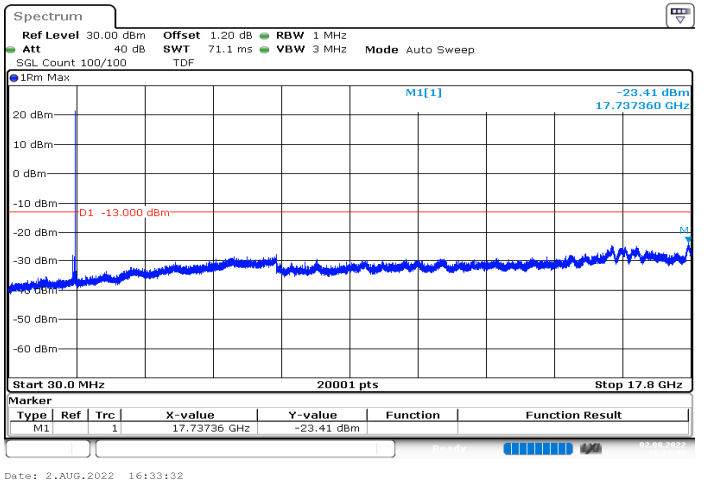


Date: 2.AUG.2022 16:33:32

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB160@0|30MHz_17.8GHz

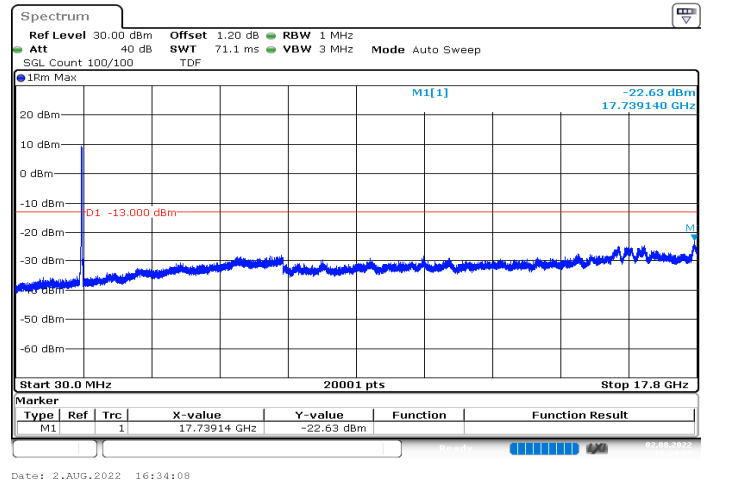


Date: 2.AUG.2022 16:34:08

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

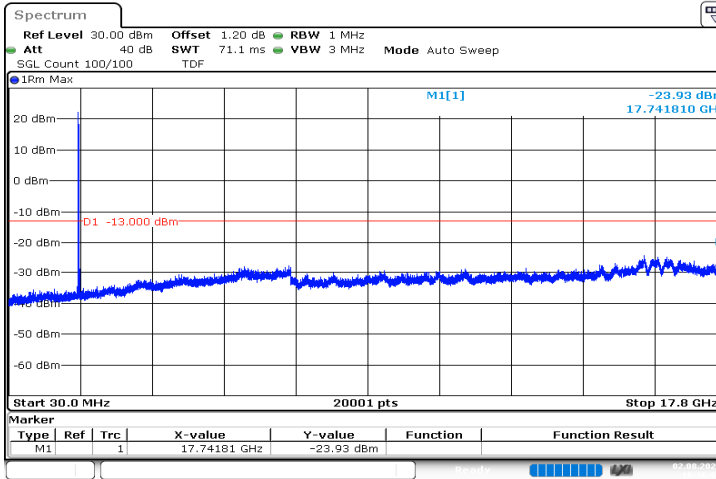


Date: 2.AUG.2022 16:36:08

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB1@159|30MHz_17.8GHz

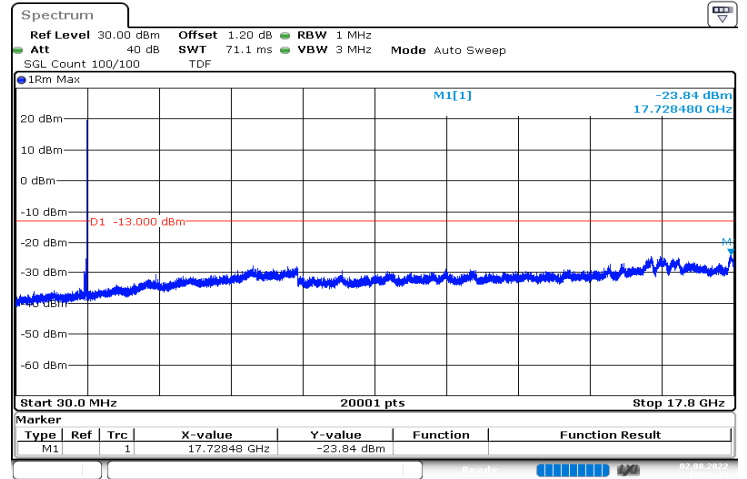


Date: 2.AUG.2022 16:36:44

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB160@0|30MHz_17.8GHz

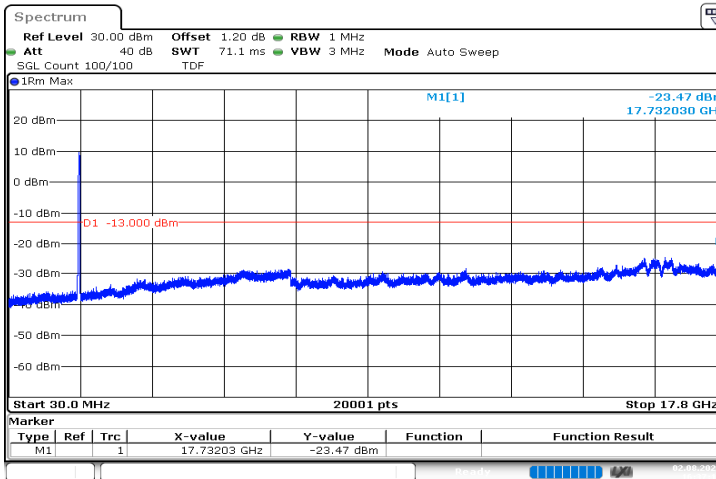


Date: 2.AUG.2022 16:37:19

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

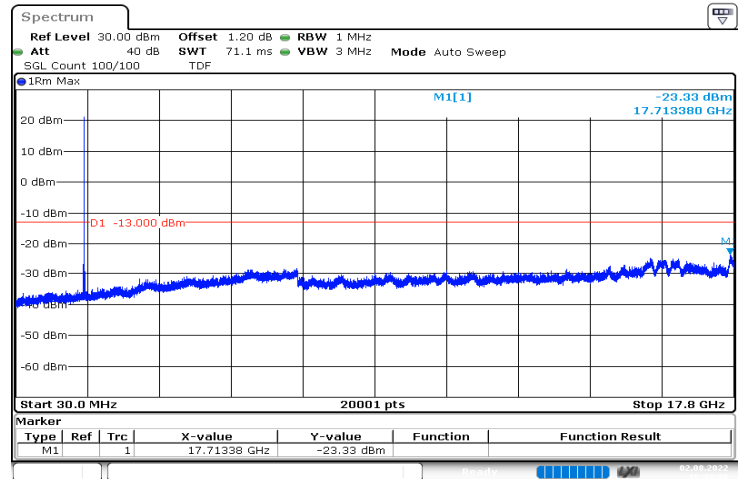


Date: 2.AUG.2022 16:38:37

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB1@215|30MHz_17.8GHz

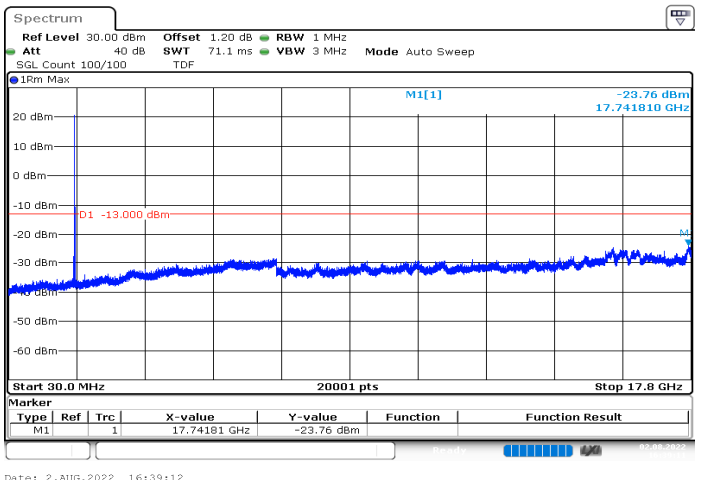


Date: 2.AUG.2022 16:39:12

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB216@0|30MHz_17.8GHz

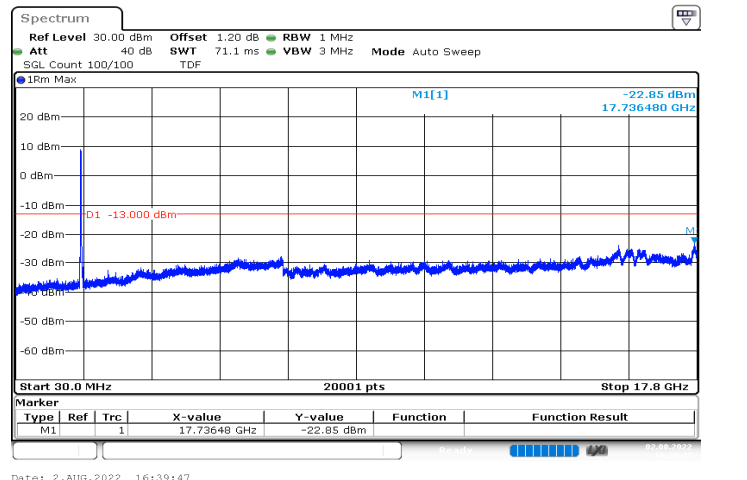


Date: 2.AUG.2022 16:39:47

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

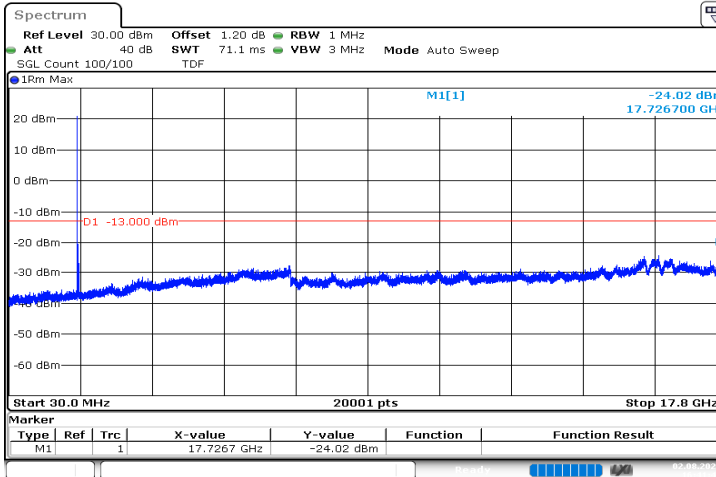


Date: 2.AUG.2022 16:41:49

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@215|30MHz_17.8GHz

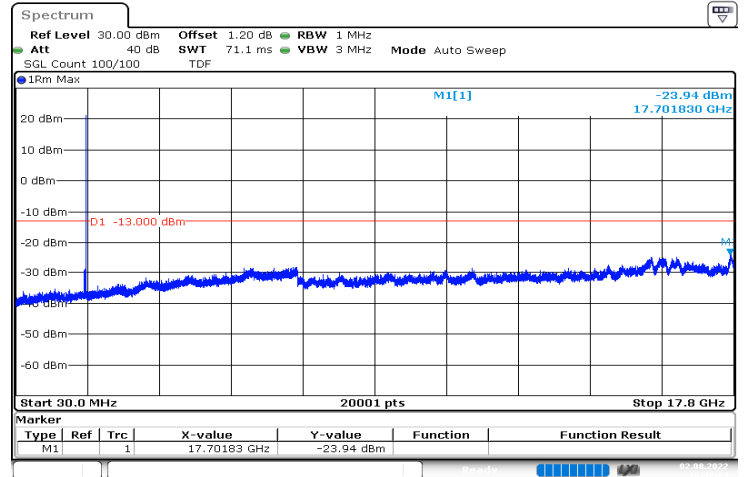


Date: 2.AUG.2022 16:42:24

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB216@0|30MHz_17.8GHz

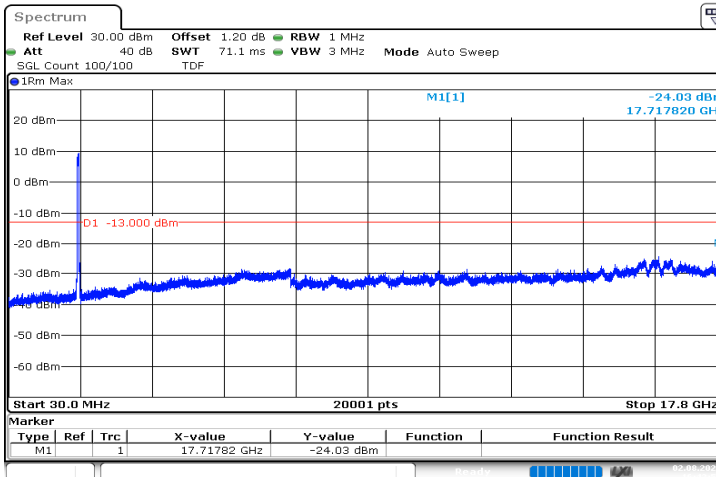


Date: 2.AUG.2022 16:42:59

n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB216@0|30MHz_17.8GHz

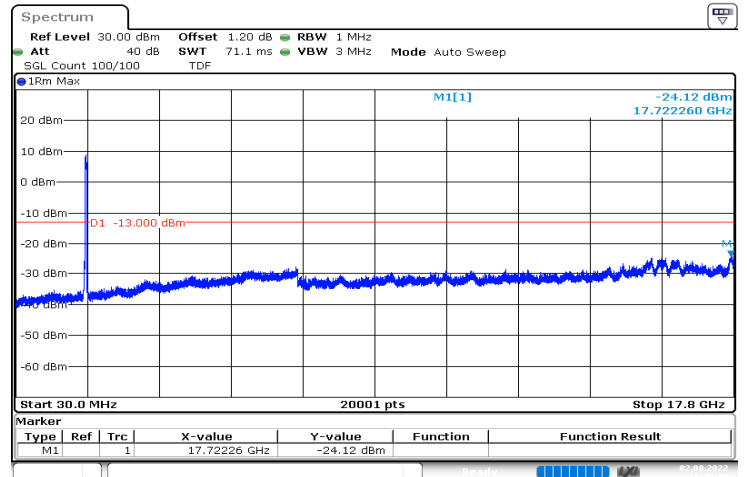


Date: 2.AUG.2022 16:49:04

n66_5MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

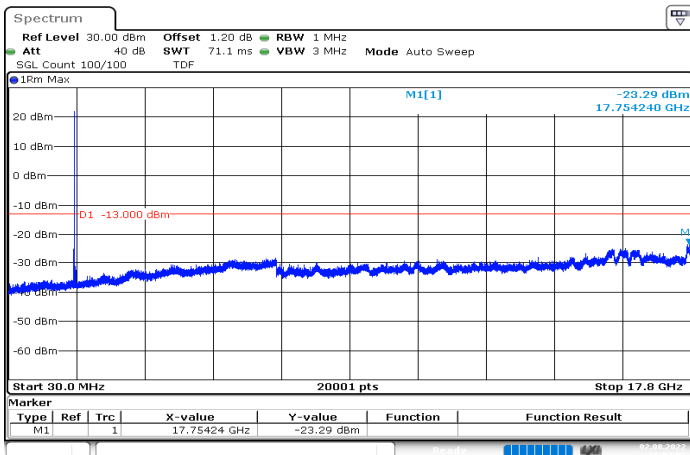


Date: 2.AUG.2022 17:54:03

n66_10MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

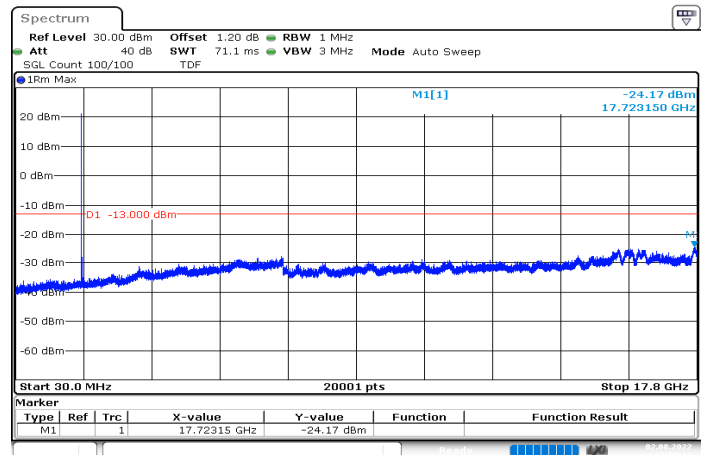


Date: 2.AUG.2022 17:55:20

n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

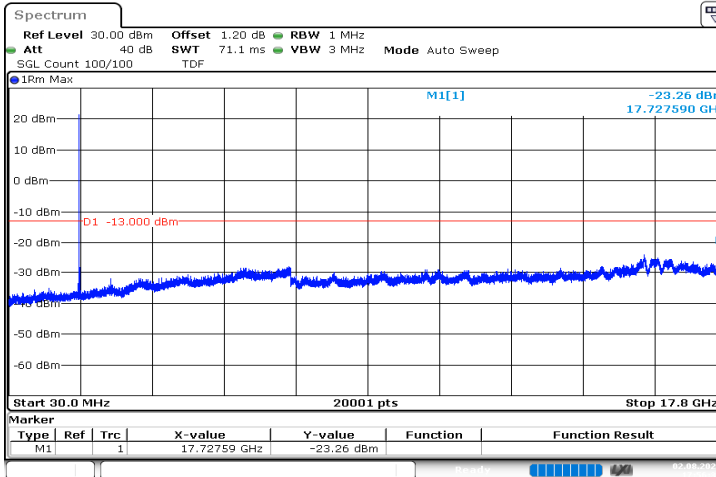


Date: 2.AUG.2022 17:56:36

n66_20MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

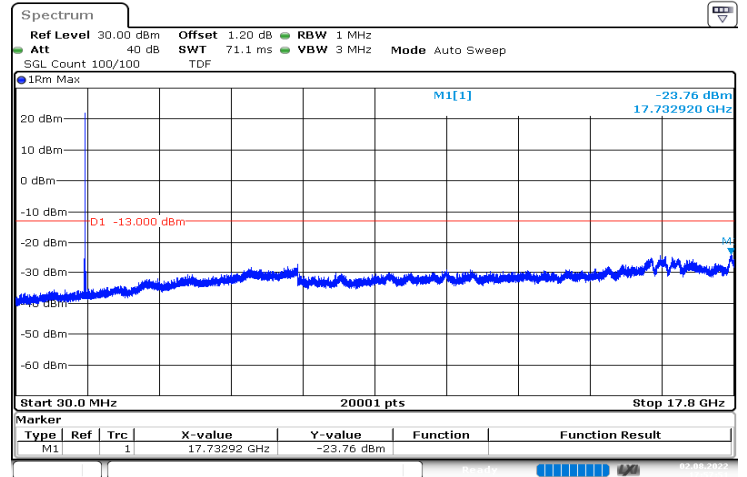


Date: 2.AUG.2022 17:57:52

n66_20MHz_15kHz_1770MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

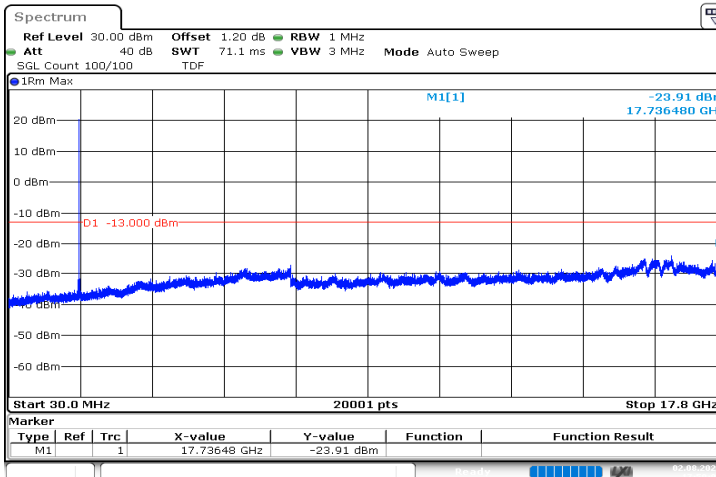


Date: 2.AUG.2022 17:59:07

n66_20MHz_15kHz_1770MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_17.8GHz

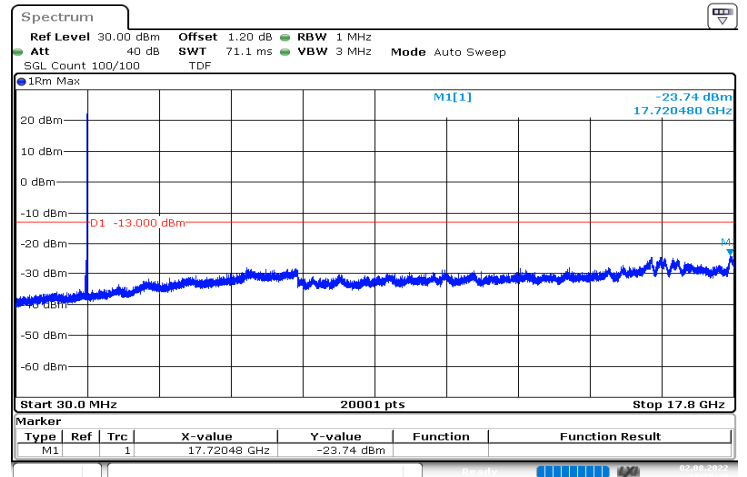


Date: 2.AUG.2022 17:59:41

n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

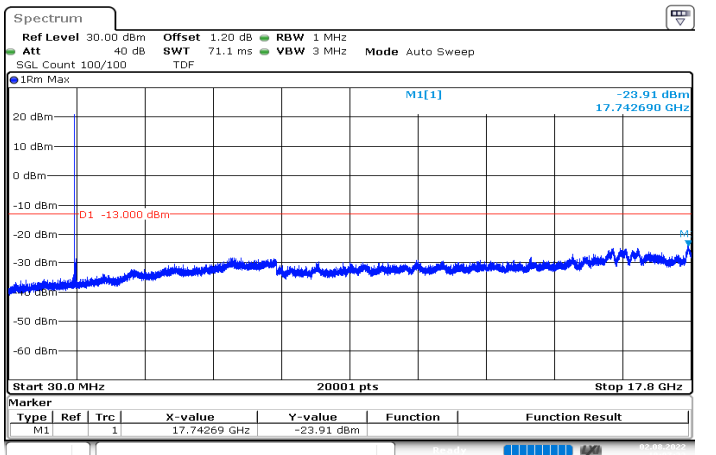


Date: 2.AUG.2022 18:07:23

n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB1@215|30MHz_17.8GHz

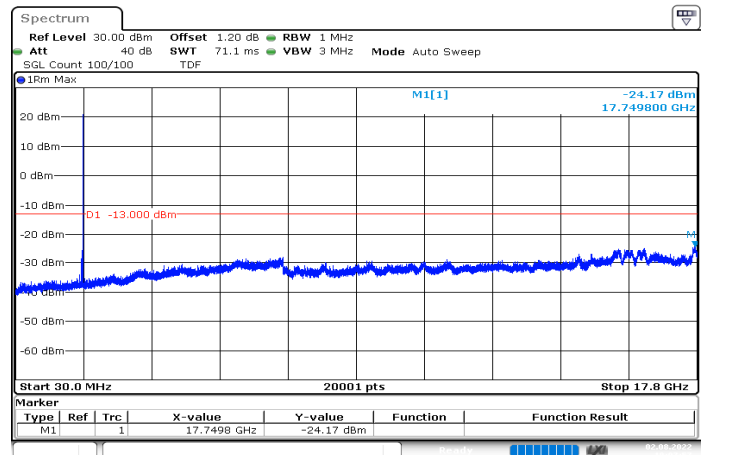


Date: 2.AUG.2022 18:07:58

n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_17.8GHz

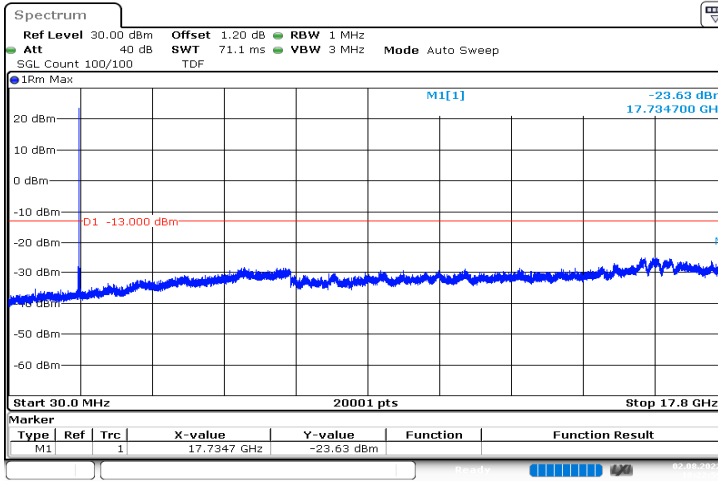


Date: 2.AUG.2022 18:23:00

n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM
QPSK_RB128@0|30MHz_17.8GHz

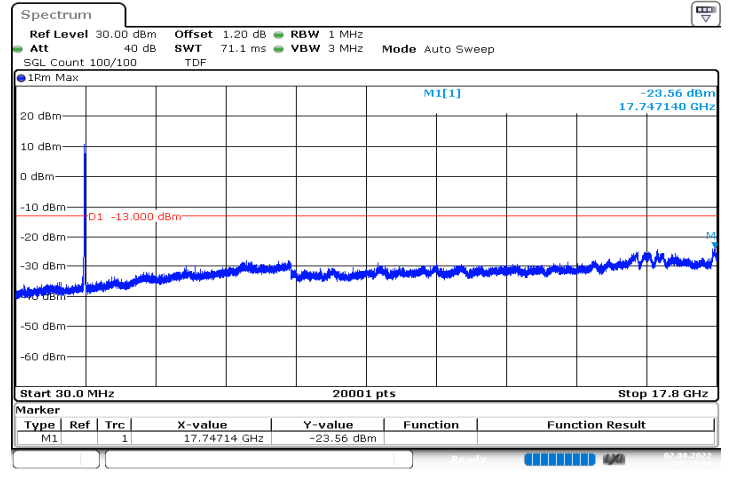

Date: 2.AUG.2022 18:23:36


n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM
QPSK_RB1@132|30MHz_17.8GHz

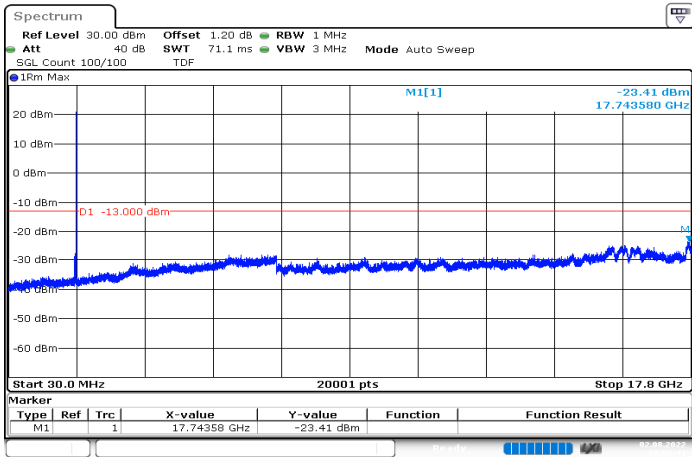

Date: 2.AUG.2022 19:52:42


n71 , Normal

n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

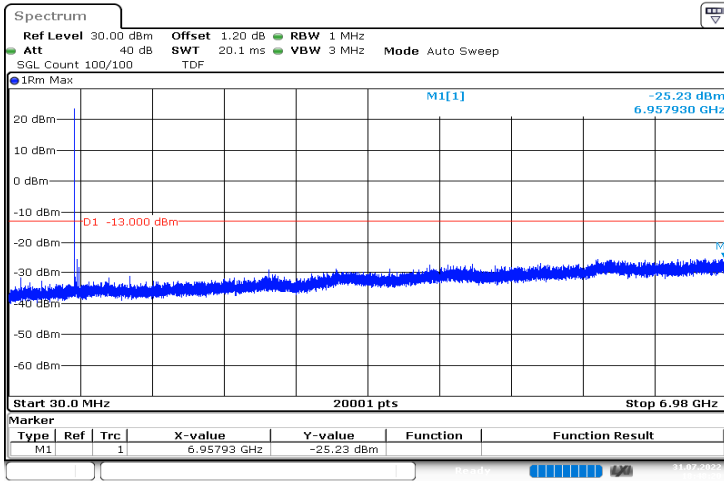


Date: 31.JUL.2022 18:48:21

n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_6.98GHz

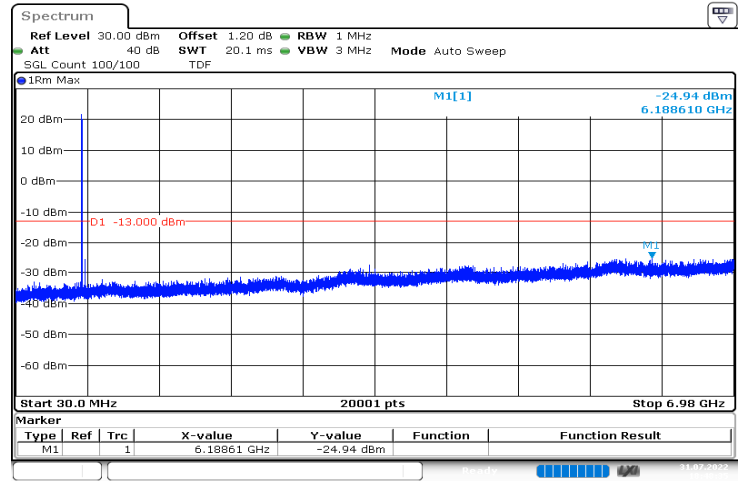


Date: 31.JUL.2022 18:48:35

n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_6.98GHz

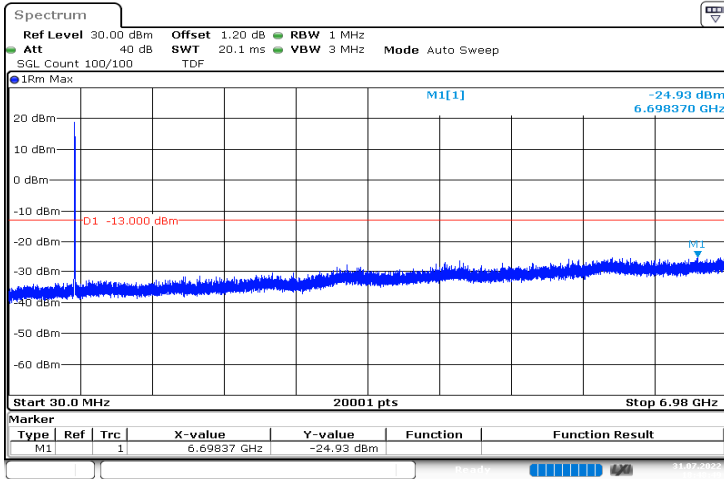


Date: 31.JUL.2022 18:48:49

n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

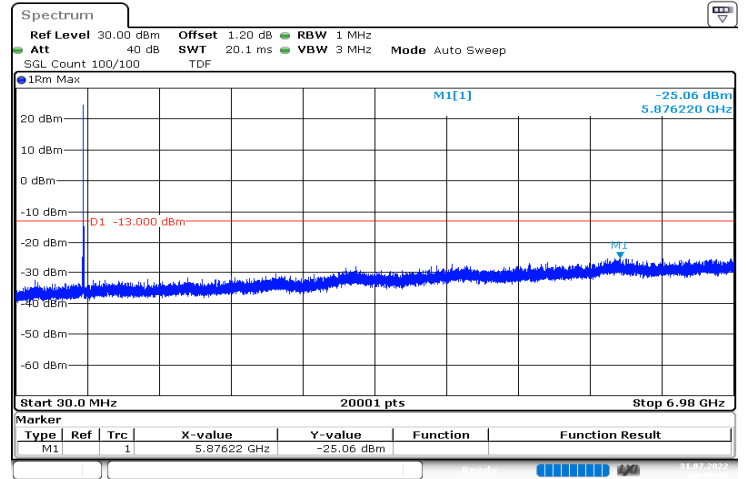


Date: 31.JUL.2022 18:49:46

n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_6.98GHz

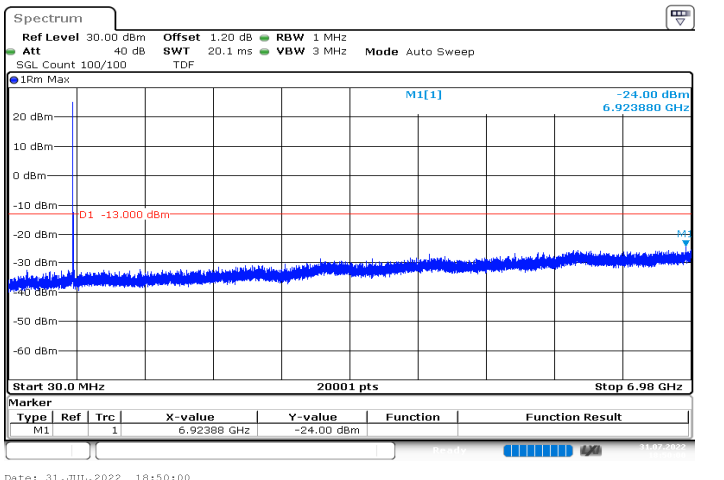


Date: 31.JUL.2022 18:50:00

n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_6.98GHz

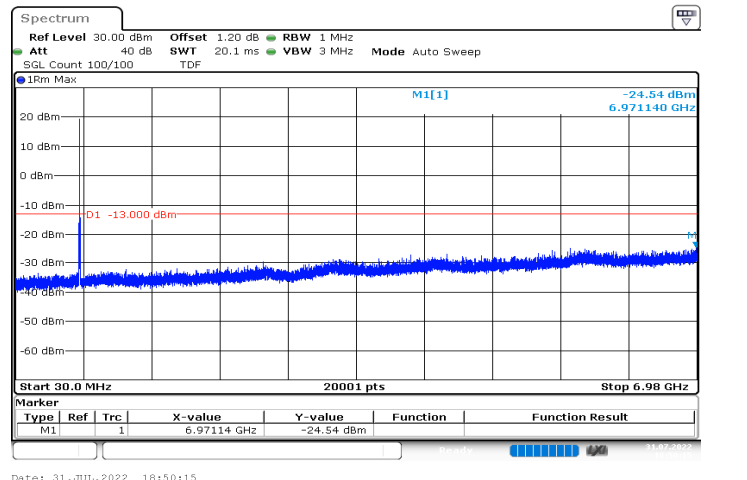


Date: 31.JUL.2022 18:50:15

n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

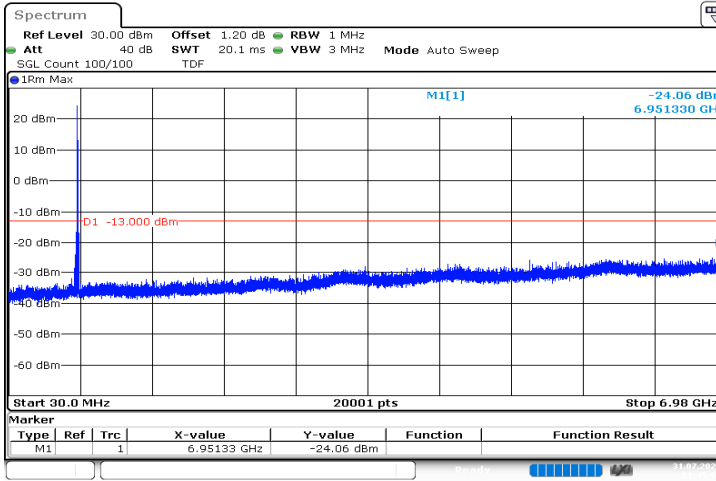


Date: 31.JUL.2022 21:45:02

n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_6.98GHz

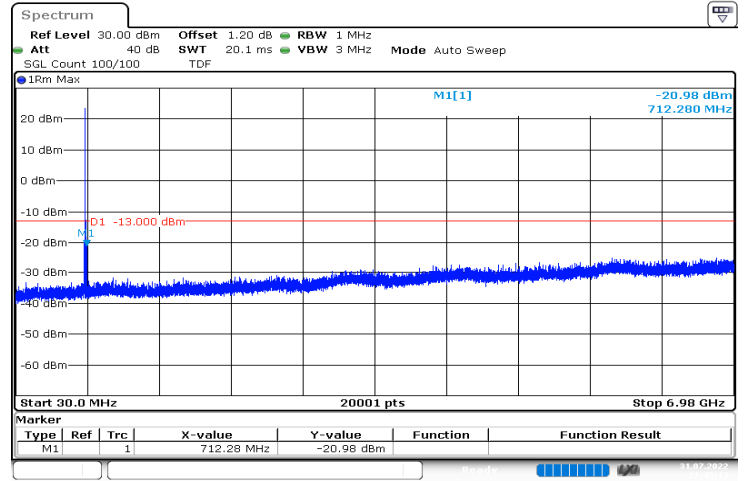


Date: 31.JUL.2022 21:45:13

n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_6.98GHz

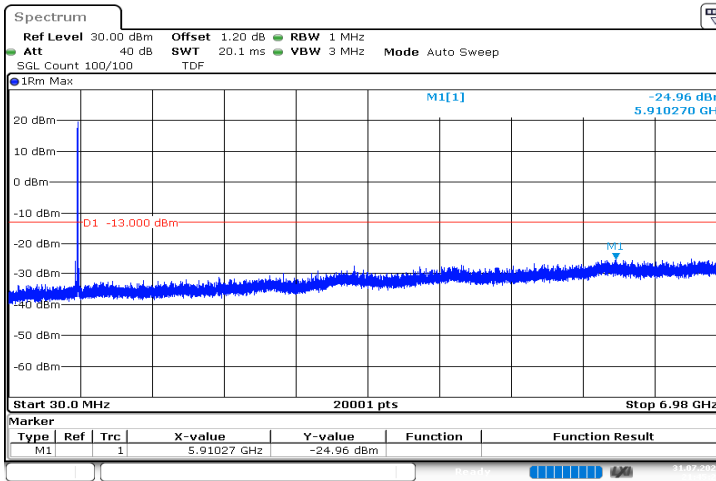


Date: 31.JUL.2022 21:45:25

n71_10MHz_15kHz_668MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

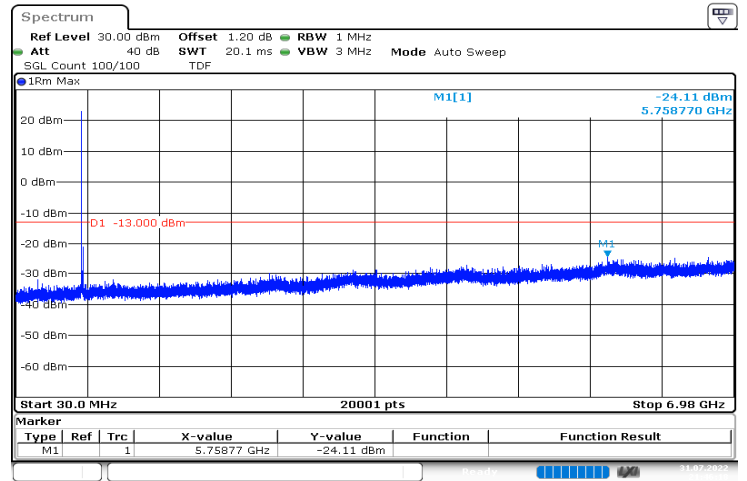


Date: 31.JUL.2022 21:46:19

n71_10MHz_15kHz_668MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_6.98GHz

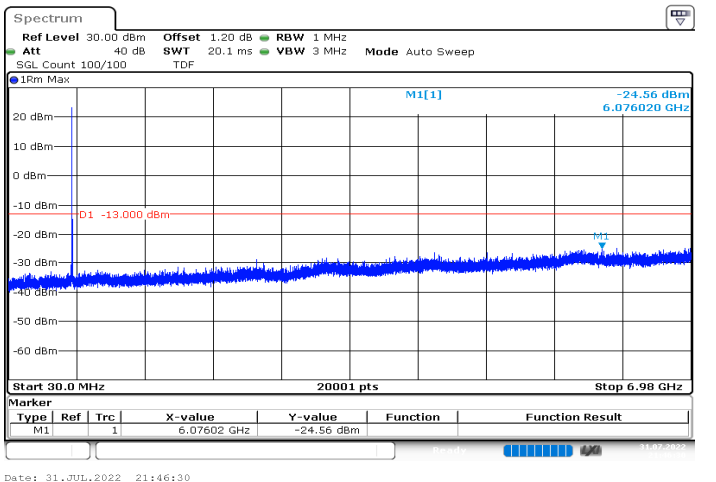


Date: 31.JUL.2022 21:46:30

n71_10MHz_15kHz_668MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_6.98GHz

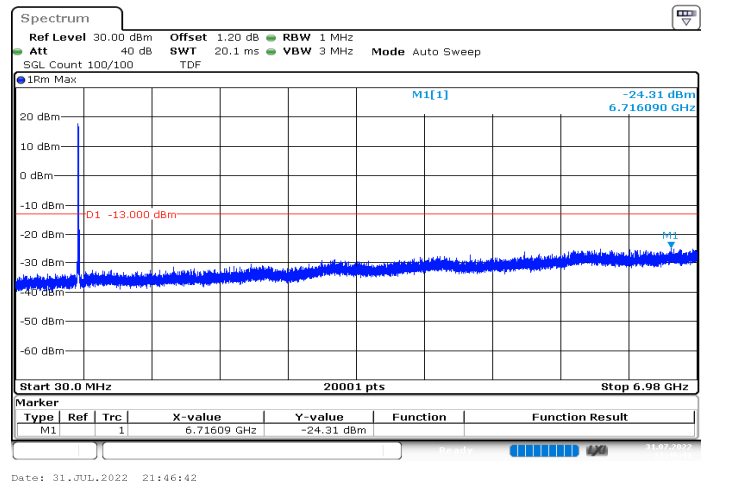


Date: 31.JUL.2022 21:46:42

n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

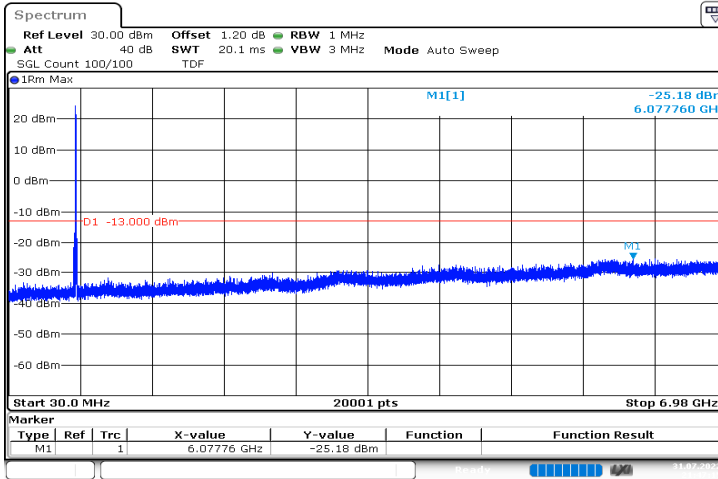


Date: 31.JUL.2022 21:47:15

n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_6.98GHz

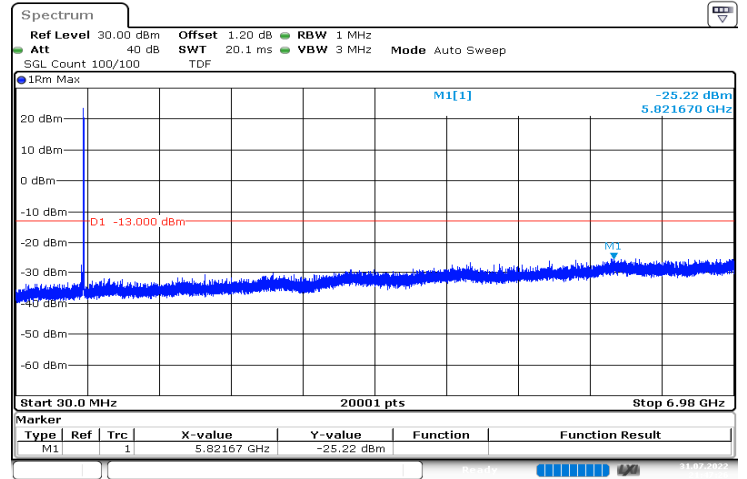


Date: 31.JUL.2022 21:47:27

n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_6.98GHz

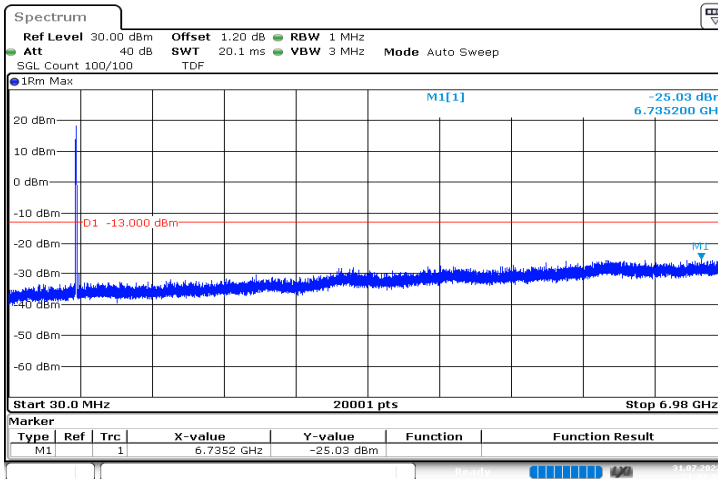


Date: 31.JUL.2022 21:47:39

n71_10MHz_15kHz_693MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

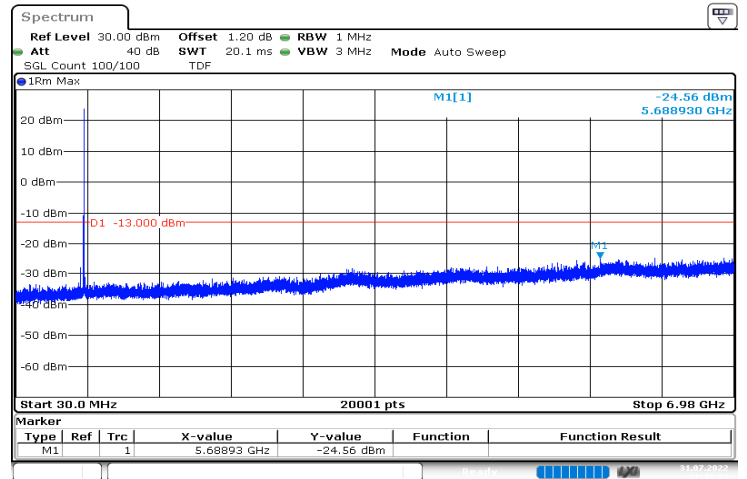


Date: 31.JUL.2022 21:48:33

n71_10MHz_15kHz_693MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_6.98GHz

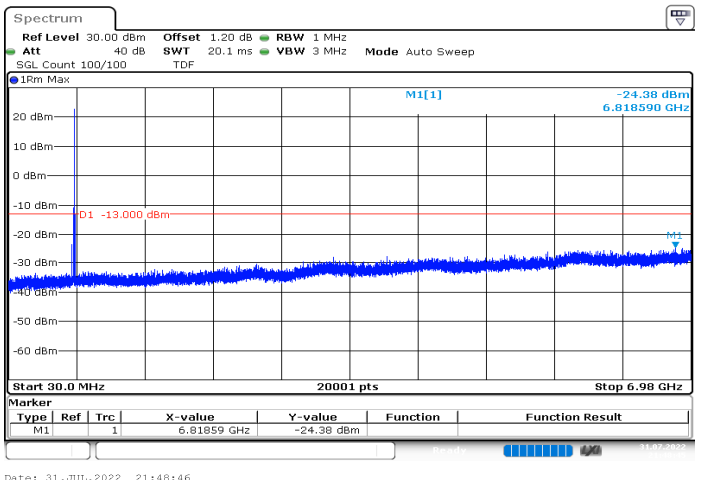


Date: 31.JUL.2022 21:48:46

n71_10MHz_15kHz_693MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_6.98GHz

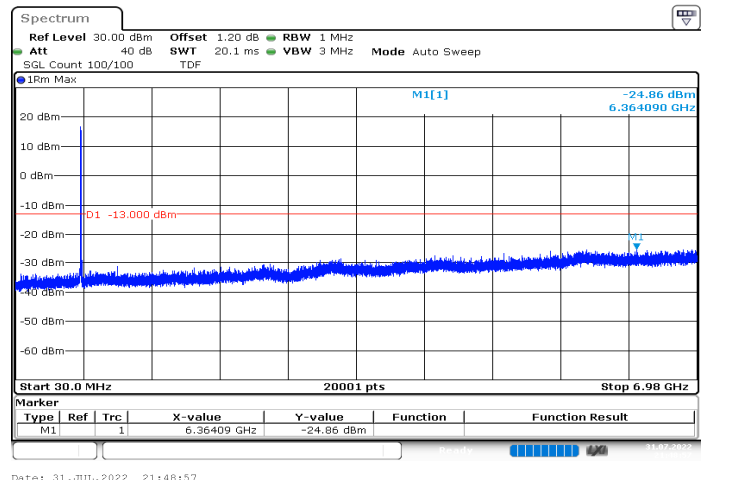


Date: 31.JUL.2022 21:48:57


n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

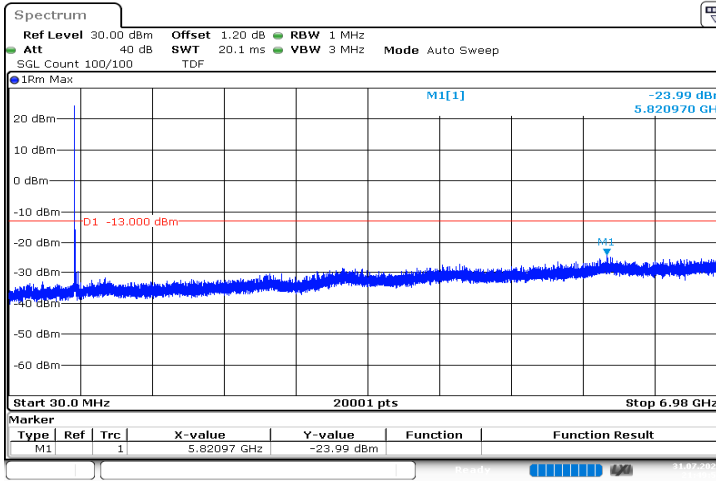


n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_6.98GHz

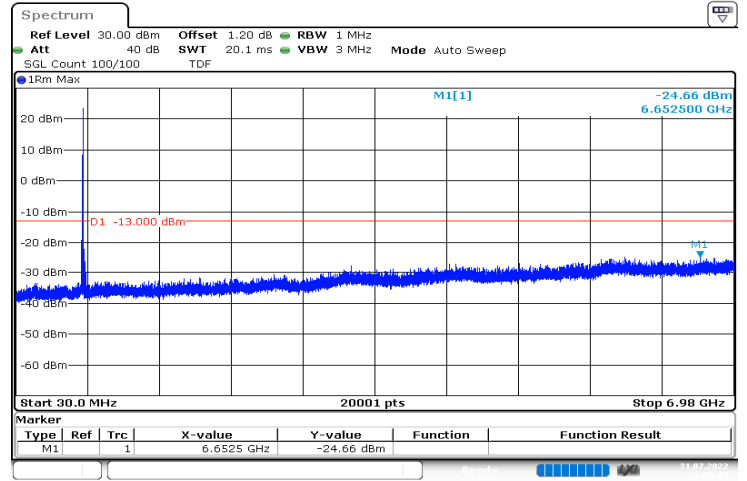


n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_6.98GHz

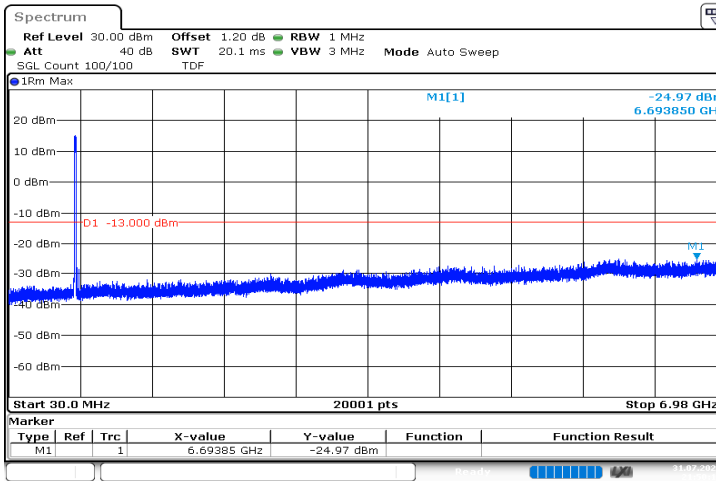


n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_6.98GHz

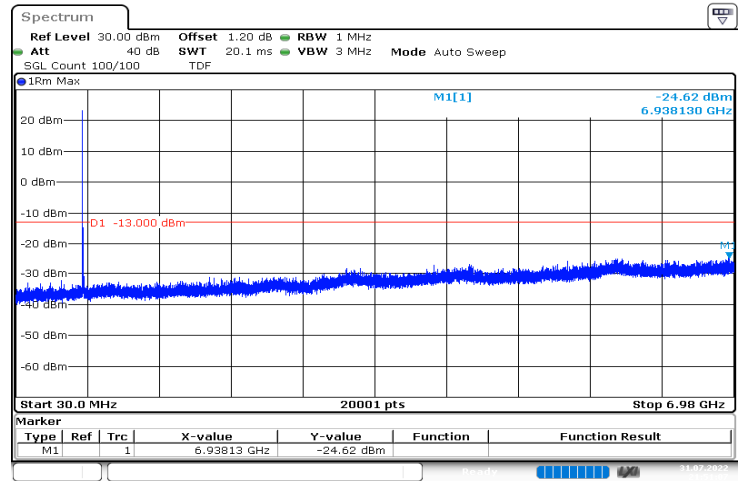


n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_6.98GHz

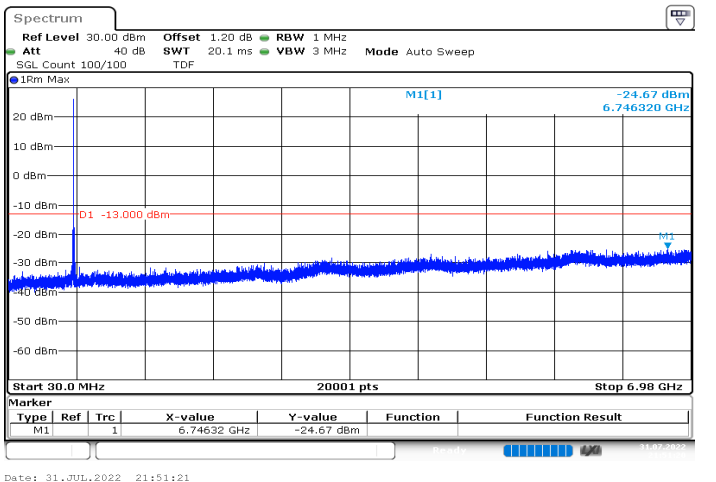

n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_6.98GHz

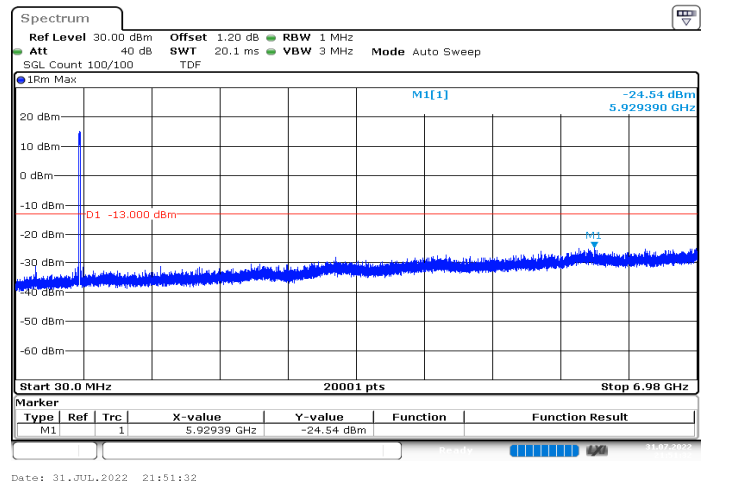


n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

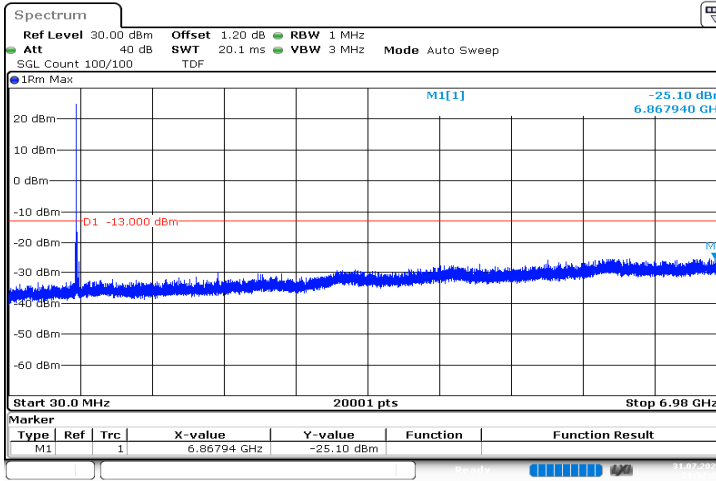


Date: 31.JUL.2022 21:52:24

n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_6.98GHz

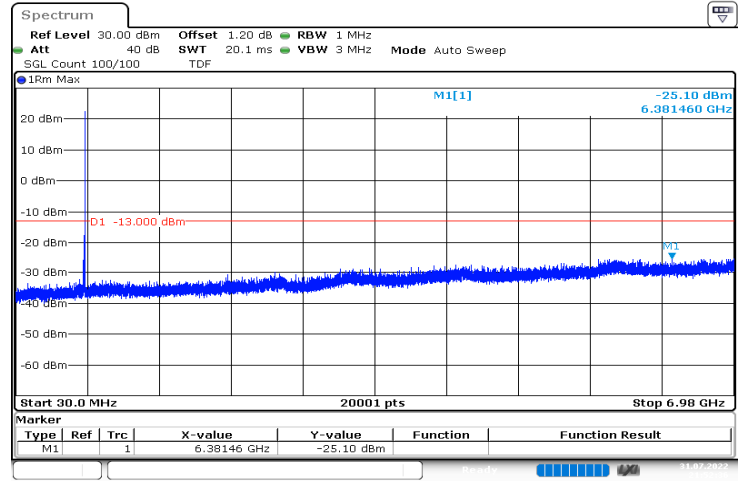


Date: 31.JUL.2022 21:52:36

n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_6.98GHz

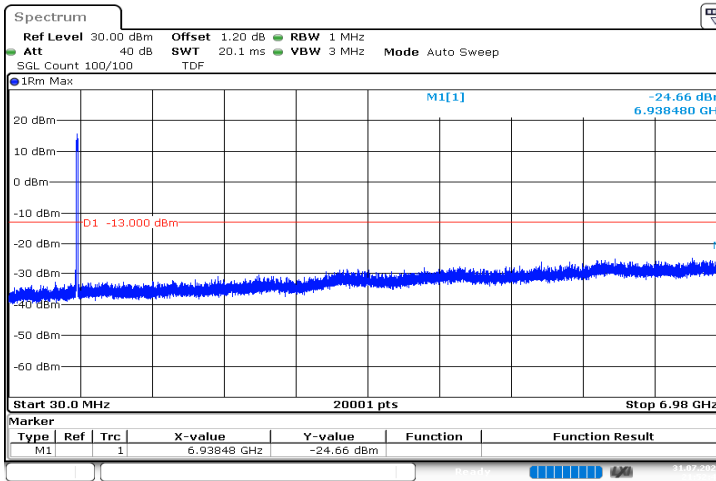


Date: 31.JUL.2022 21:52:48

n71_20MHz_15kHz_673MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

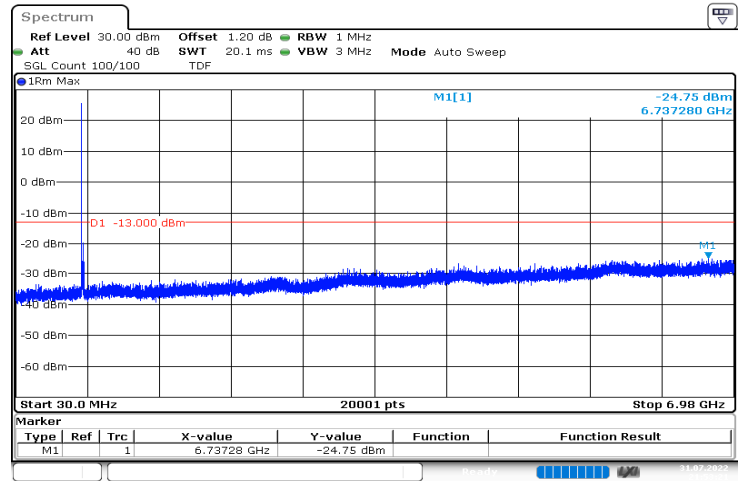


Date: 31.JUL.2022 21:53:22

n71_20MHz_15kHz_673MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_6.98GHz

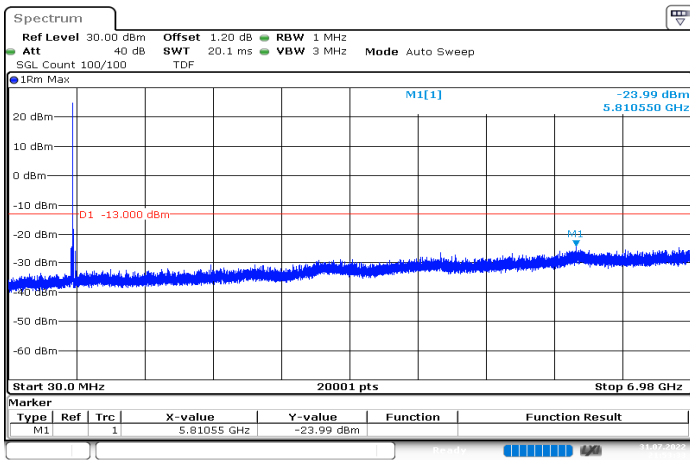


Date: 31.JUL.2022 21:53:34

n71_20MHz_15kHz_673MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_6.98GHz

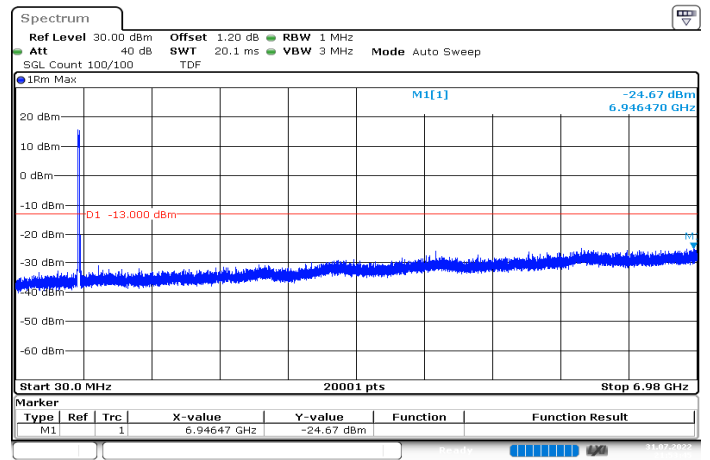


Date: 31.JUL.2022 21:53:46

n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

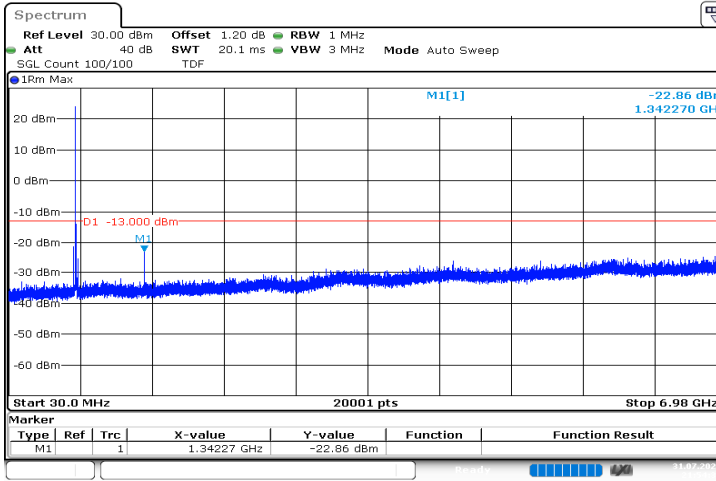


Date: 31.JUL.2022 21:54:38

n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_6.98GHz

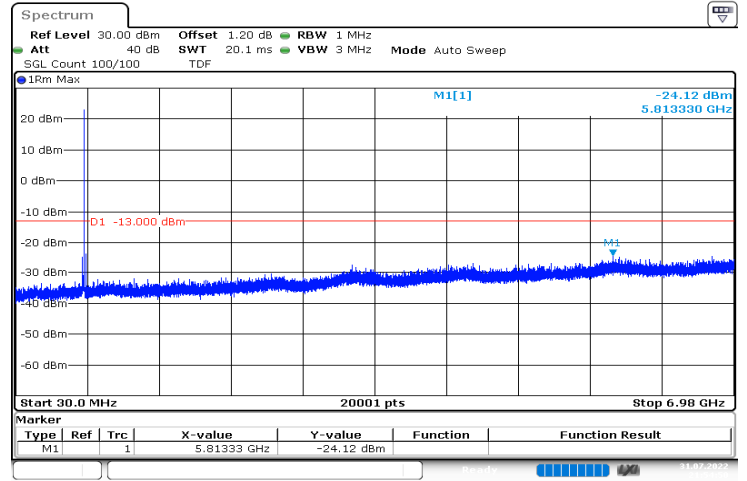


Date: 31.JUL.2022 21:54:50

n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_6.98GHz

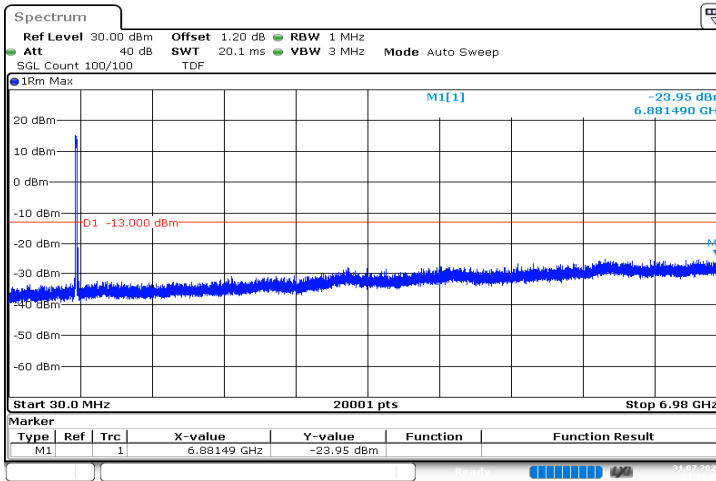


Date: 31.JUL.2022 21:55:02

n71_20MHz_15kHz_688MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_6.98GHz

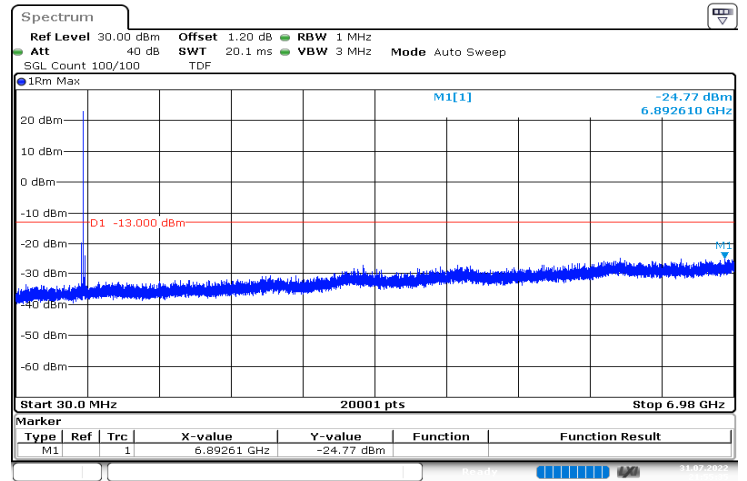


Date: 31.JUL.2022 21:55:35

n71_20MHz_15kHz_688MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_6.98GHz

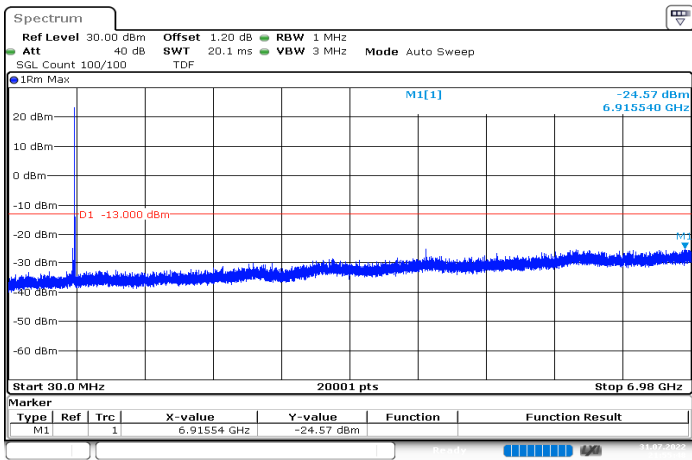

Date: 31.JUL.2022 21:55:48

n71_20MHz_15kHz_688MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_6.98GHz

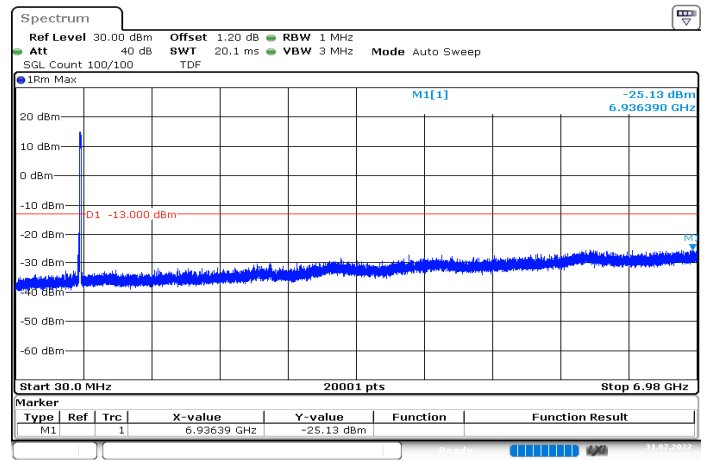

Date: 31.JUL.2022 21:56:00