

Fig.27

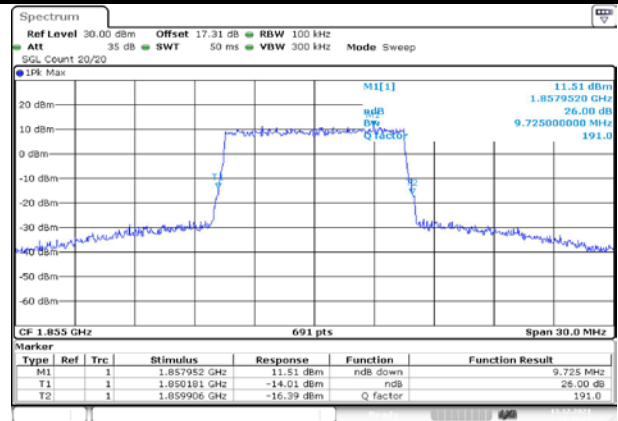


Fig.28

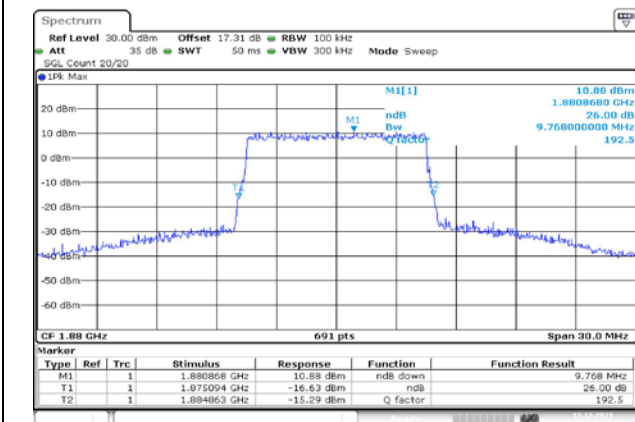


Fig.29

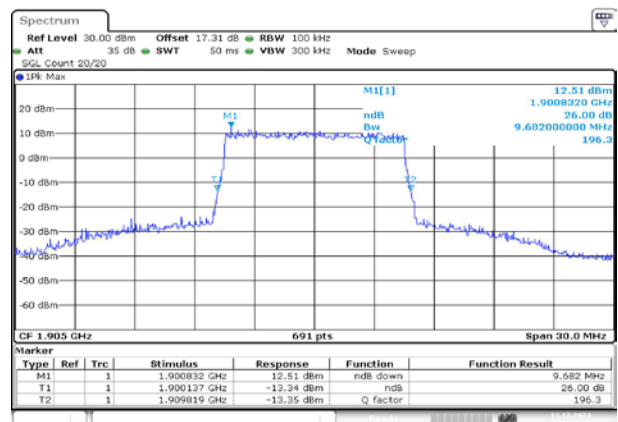


Fig.30

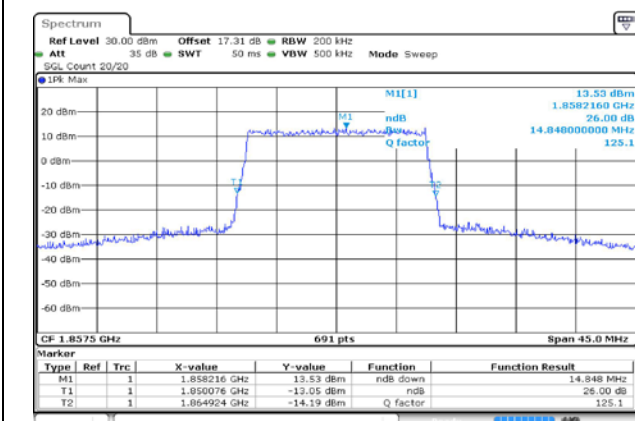


Fig.31

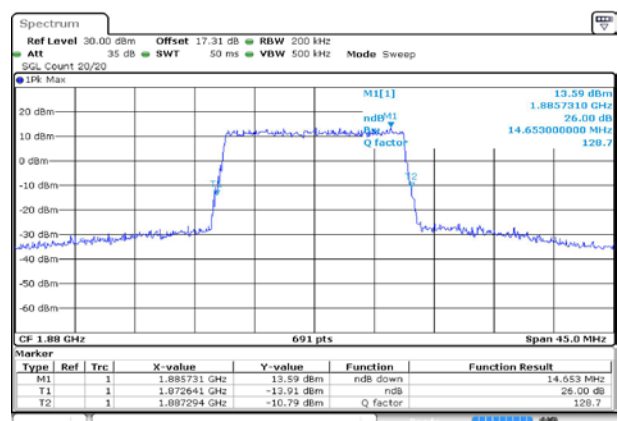


Fig.32

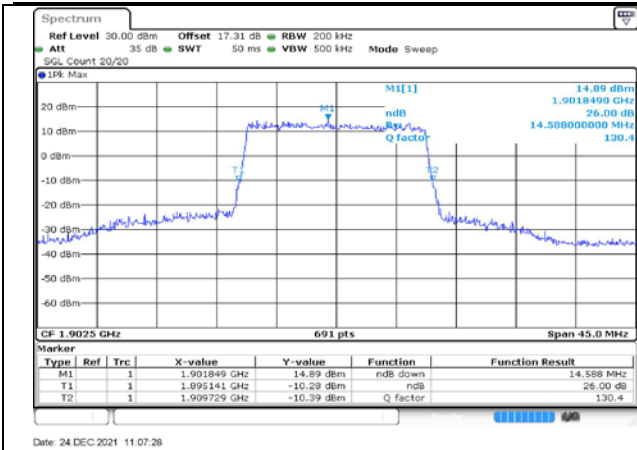


Fig.33

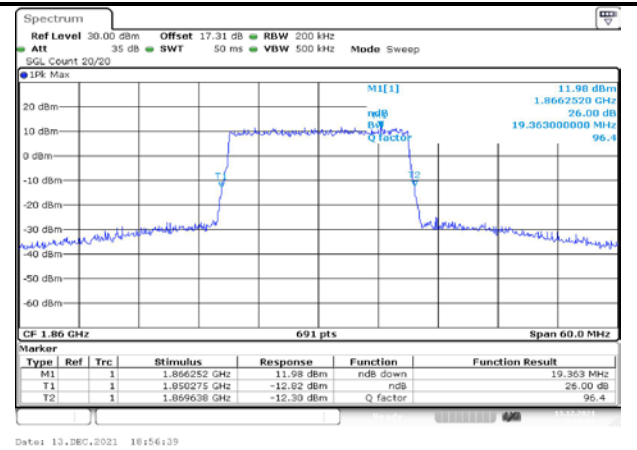


Fig.34

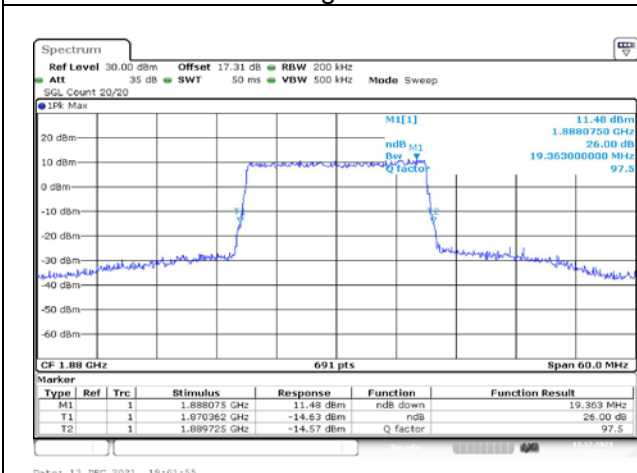


Fig.35

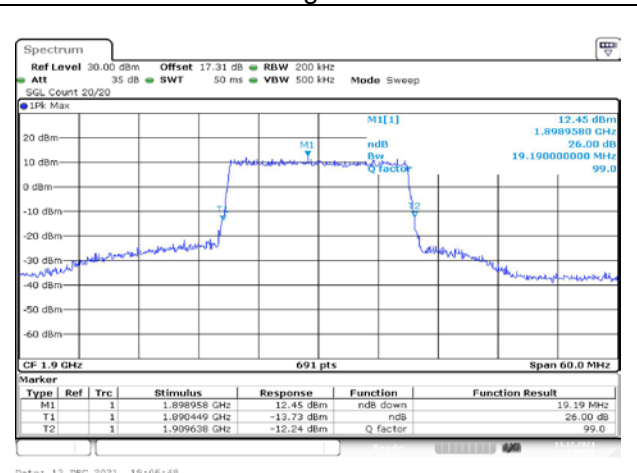


Fig.36

Test Mode: 64QAM

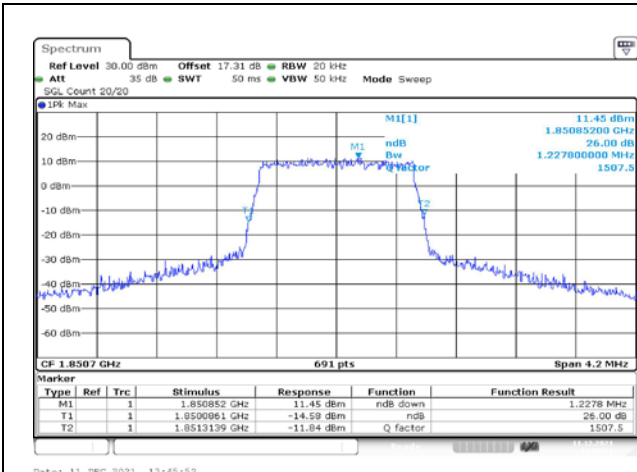


Fig.37

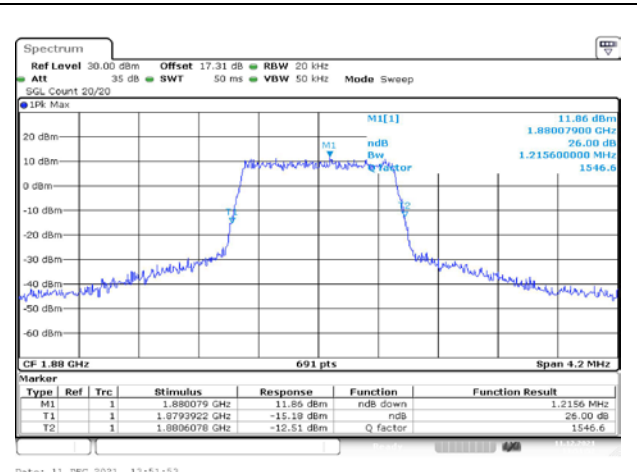


Fig.38

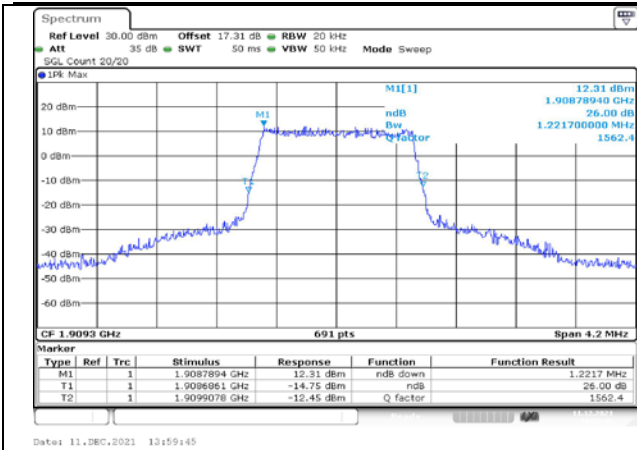


Fig.39

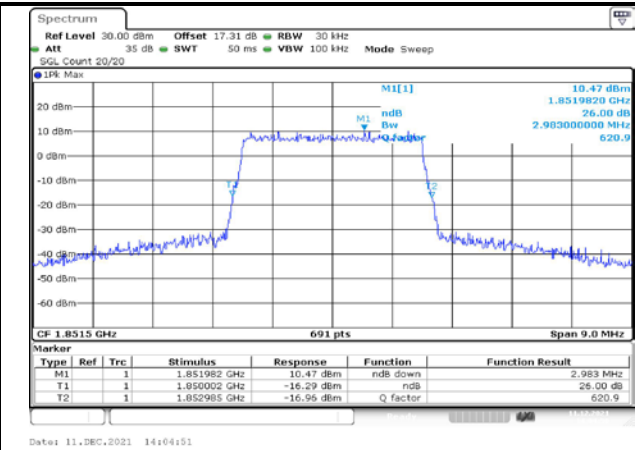


Fig.40

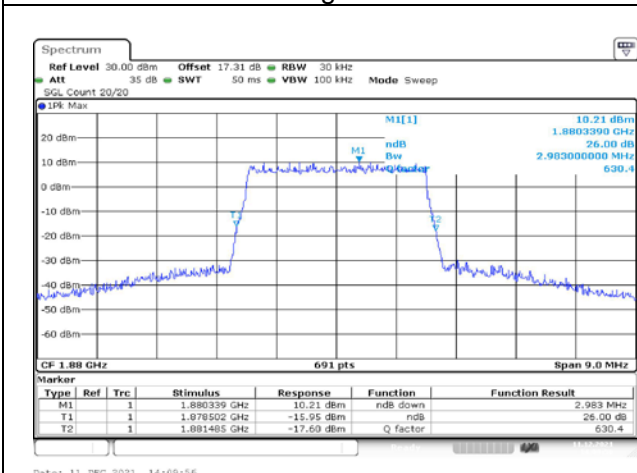


Fig.41

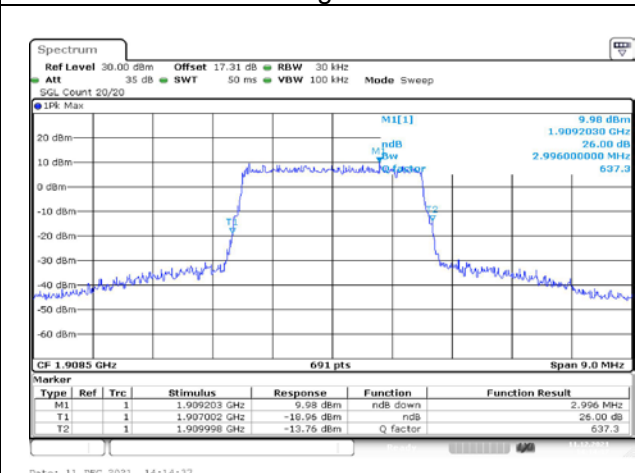


Fig.42

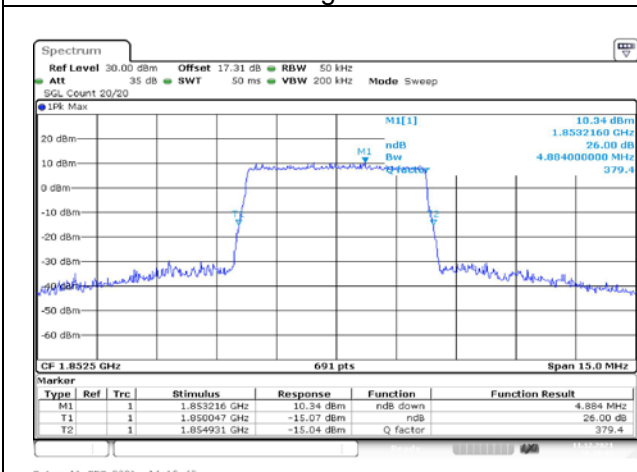


Fig.43

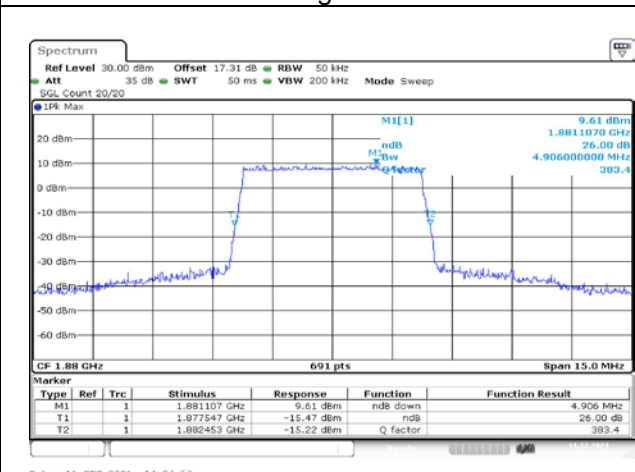


Fig.44

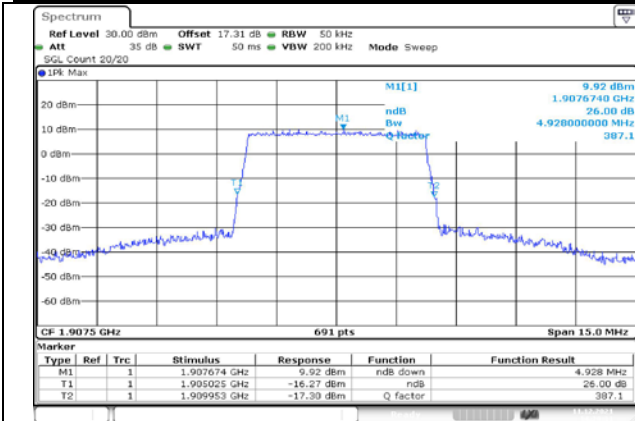


Fig.45

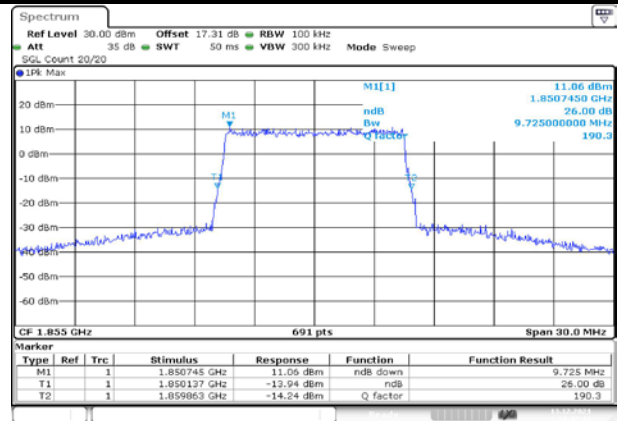


Fig.46

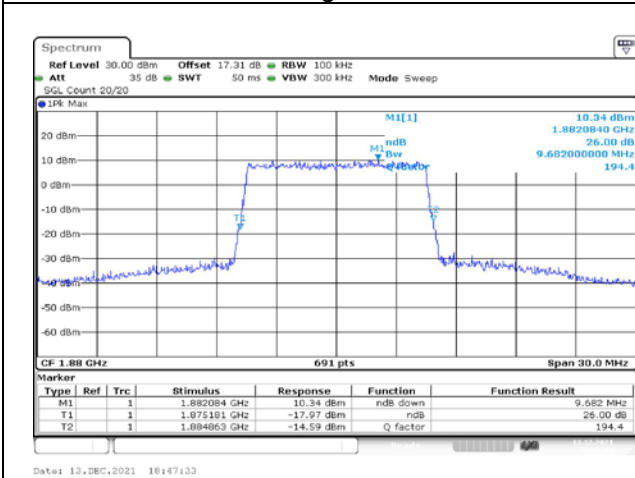


Fig.47

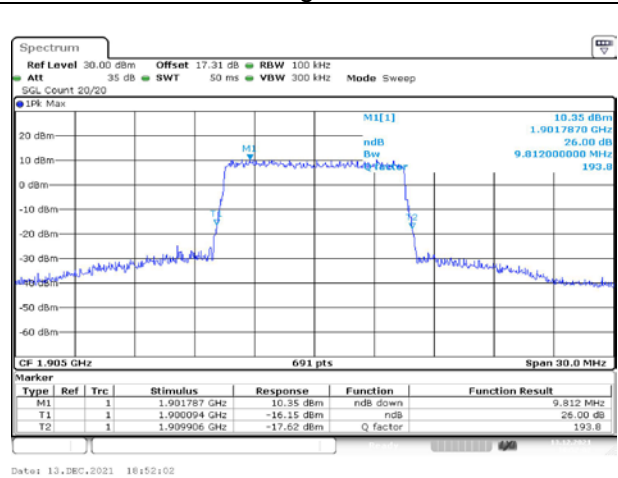


Fig.48

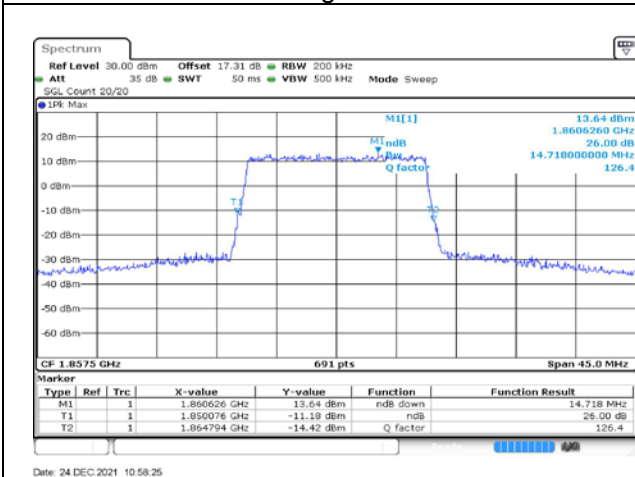


Fig.49

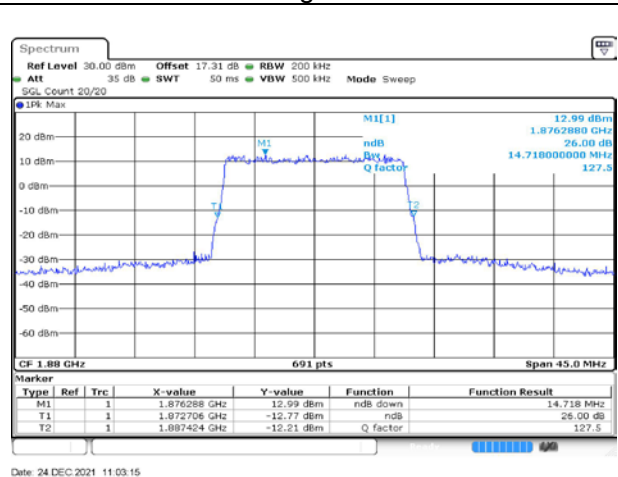


Fig.50

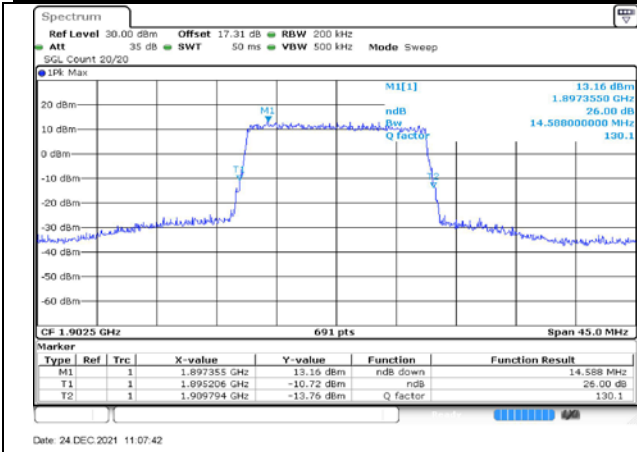


Fig.51

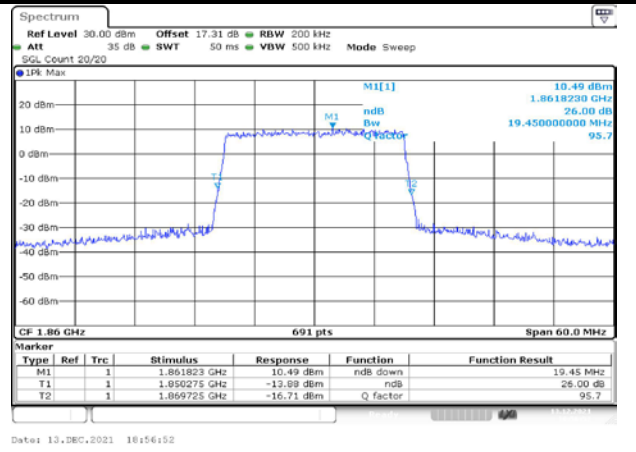


Fig.52

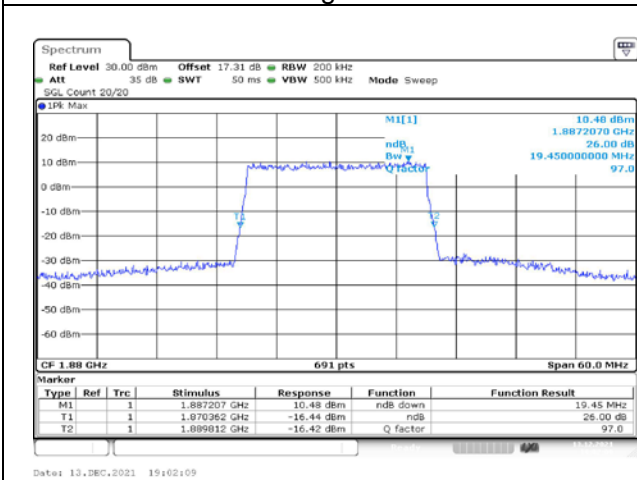


Fig.53

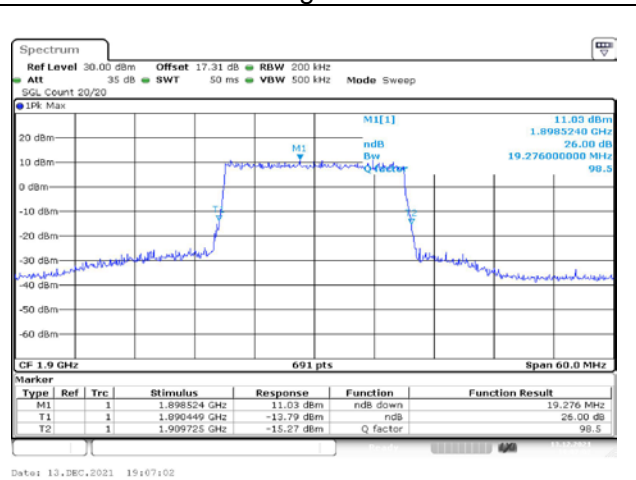


Fig.54

#### 4 Peak-Average Ratio

Band	Carrier frequency (MHz)	Channel	BW (MHz)	RB Size	RB Offset	QPSK	16-QAM	64-QAM
2	1850.7	18607	1.4	1	5	Fig.1	Fig.2	Fig.3
2	1850.7	18607	1.4	6	0	Fig.4	Fig.5	Fig.6
2	1880	18900	1.4	1	5	Fig.7	Fig.8	Fig.9
2	1880	18900	1.4	6	0	Fig.10	Fig.11	Fig.12
2	1909.3	19193	1.4	1	5	Fig.13	Fig.14	Fig.15
2	1909.3	19193	1.4	6	0	Fig.16	Fig.17	Fig.18
2	1851.5	18615	3	1	14	Fig.19	Fig.20	Fig.21
2	1851.5	18615	3	15	0	Fig.22	Fig.23	Fig.24
2	1880	18900	3	1	14	Fig.25	Fig.26	Fig.27
2	1880	18900	3	15	0	Fig.28	Fig.29	Fig.30
2	1908.5	19185	3	1	14	Fig.31	Fig.32	Fig.33
2	1908.5	19185	3	15	0	Fig.34	Fig.35	Fig.36
2	1852.5	18625	5	1	24	Fig.37	Fig.38	Fig.39
2	1852.5	18625	5	25	0	Fig.40	Fig.41	Fig.42
2	1880	18900	5	1	24	Fig.43	Fig.44	Fig.45
2	1880	18900	5	25	0	Fig.46	Fig.47	Fig.48
2	1907.5	19175	5	1	24	Fig.49	Fig.50	Fig.51
2	1907.5	19175	5	25	0	Fig.52	Fig.53	Fig.54
2	1855	18650	10	1	49	Fig.55	Fig.56	Fig.57
2	1855	18650	10	50	0	Fig.58	Fig.59	Fig.60
2	1880	18900	10	1	49	Fig.61	Fig.62	Fig.63
2	1880	18900	10	50	0	Fig.64	Fig.65	Fig.66
2	1905	19150	10	1	49	Fig.67	Fig.68	Fig.69
2	1905	19150	10	50	0	Fig.70	Fig.71	Fig.72
2	1857.5	18675	15	1	74	Fig.73	Fig.74	Fig.75
2	1857.5	18675	15	75	0	Fig.76	Fig.77	Fig.78
2	1880	18900	15	1	74	Fig.79	Fig.80	Fig.81
2	1880	18900	15	75	0	Fig.82	Fig.83	Fig.84
2	1902.5	19125	15	1	74	Fig.85	Fig.86	Fig.87
2	1902.5	19125	15	75	0	Fig.88	Fig.89	Fig.90
2	1860	18700	20	1	99	Fig.91	Fig.92	Fig.93
2	1860	18700	20	100	0	Fig.94	Fig.95	Fig.96
2	1880	18900	20	1	99	Fig.97	Fig.98	Fig.99
2	1880	18900	20	100	0	Fig.100	Fig.101	Fig.102
2	1900	19100	20	1	99	Fig.103	Fig.104	Fig.105
2	1900	19100	20	100	0	Fig.106	Fig.107	Fig.108

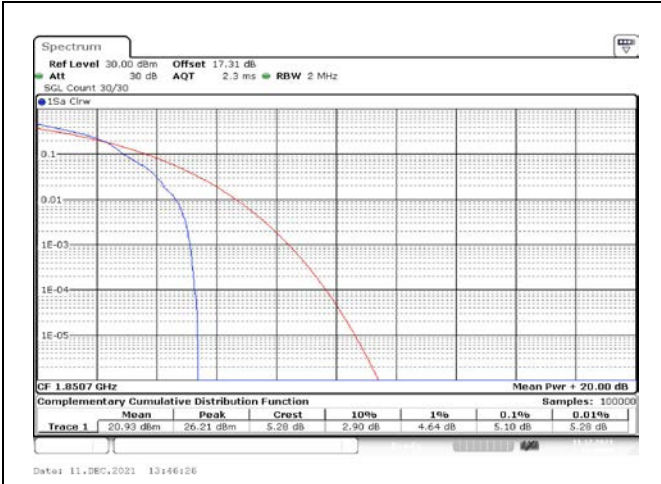


Fig.1

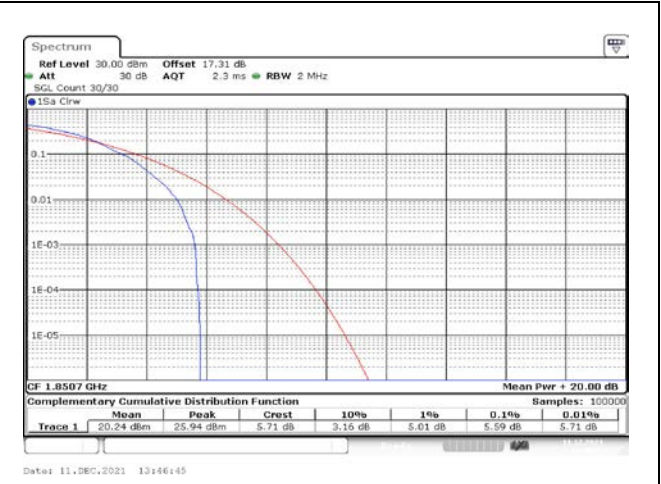


Fig.2

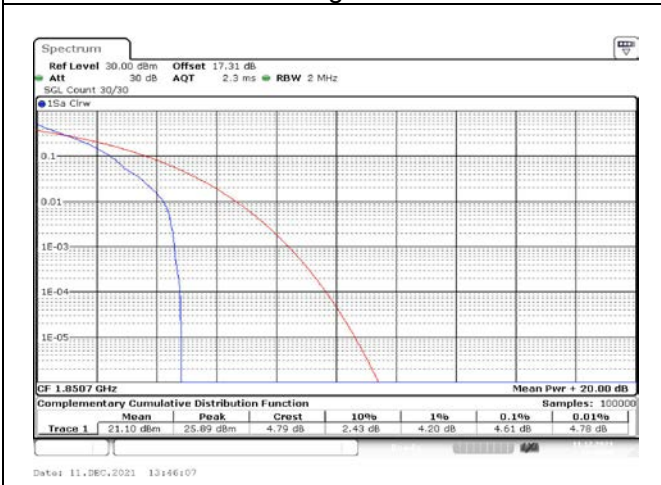


Fig.3

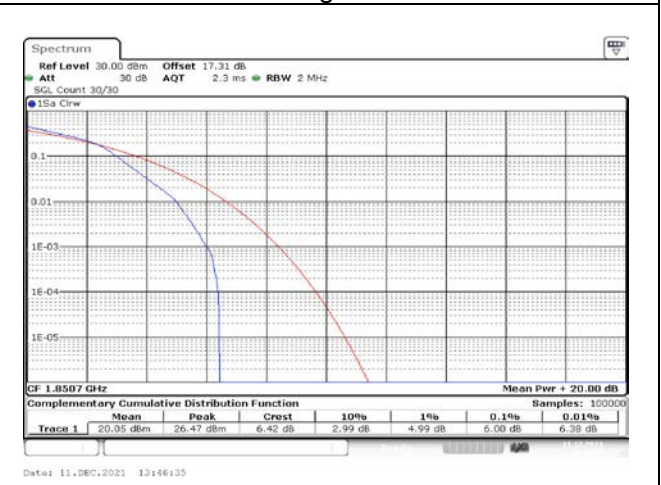


Fig.4

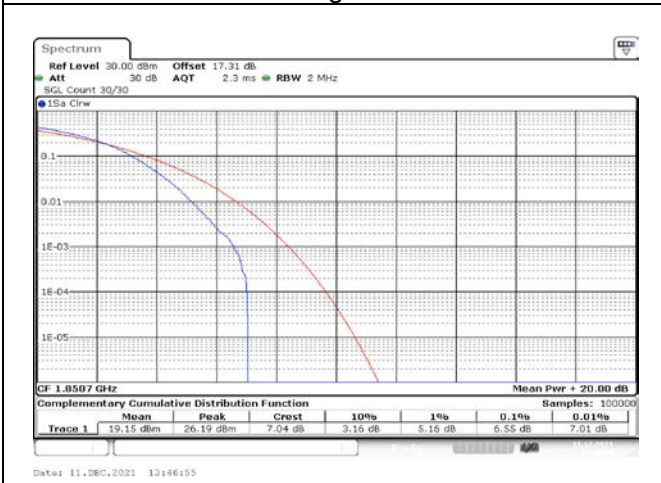


Fig.5

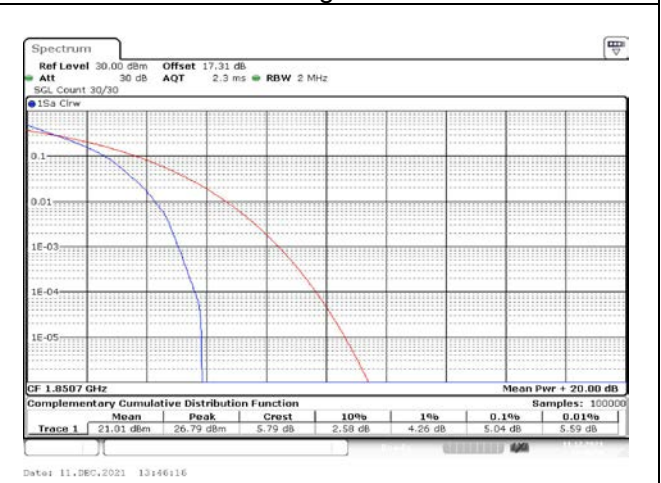


Fig.6



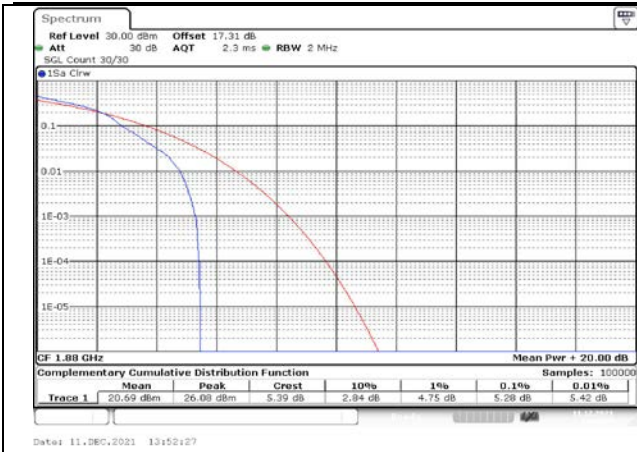


Fig.7

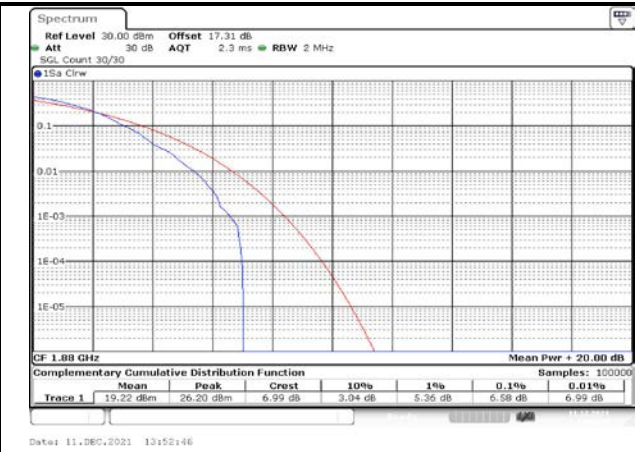


Fig.8

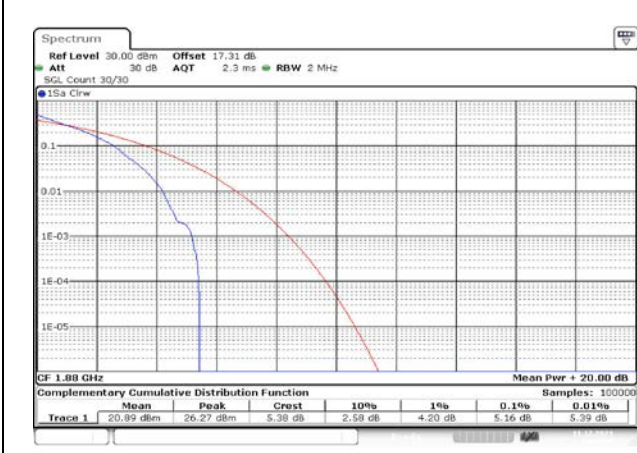


Fig.9

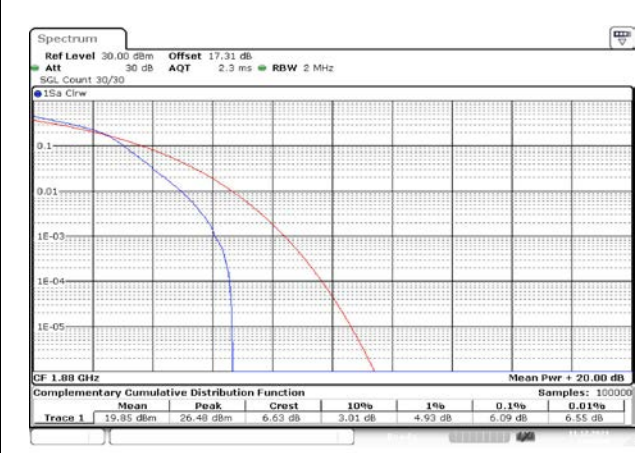


Fig.10

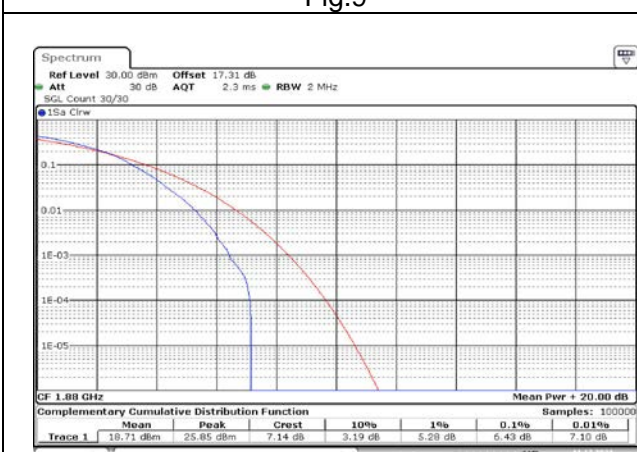


Fig.11

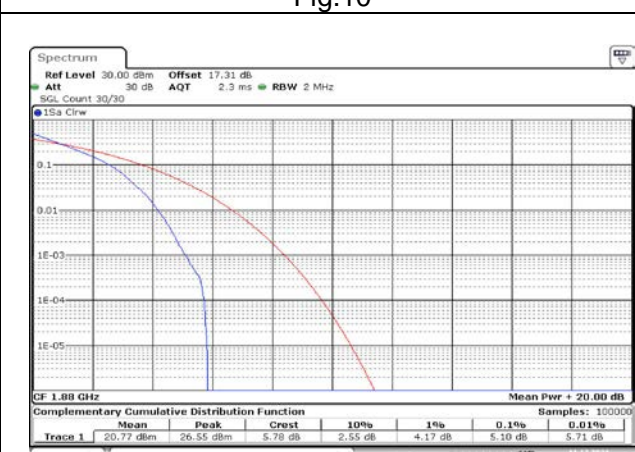


Fig.12



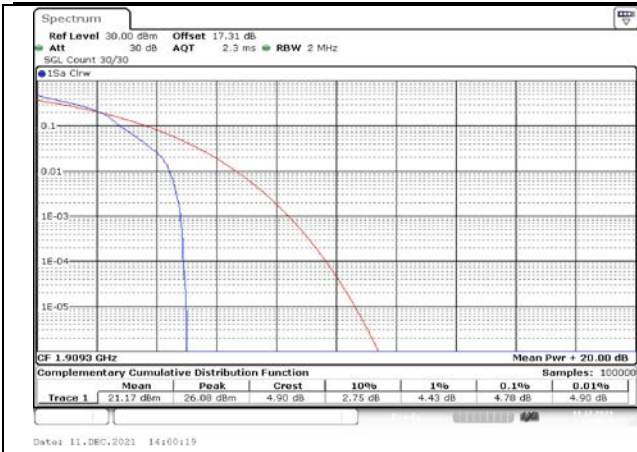


Fig.13

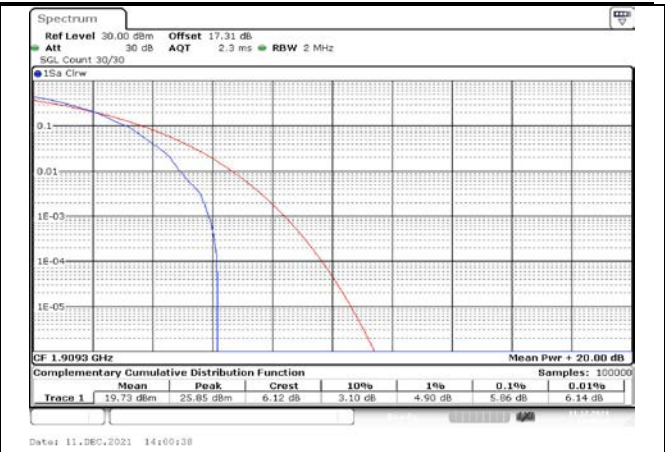


Fig.14

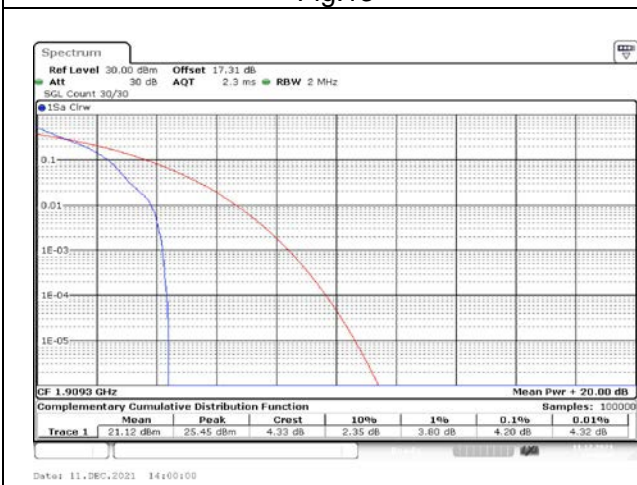


Fig.15

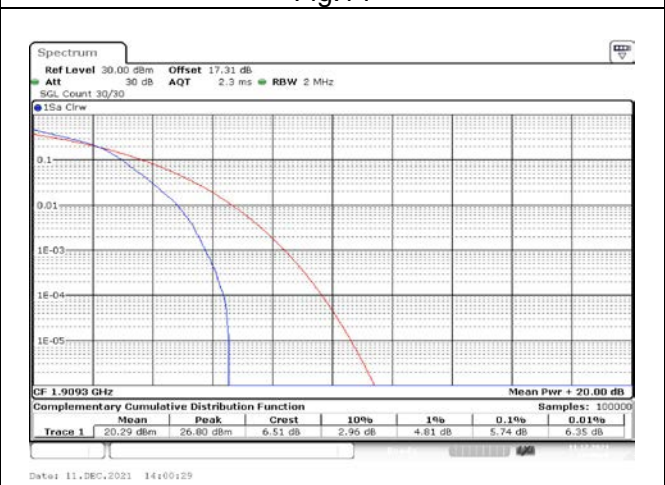


Fig.16

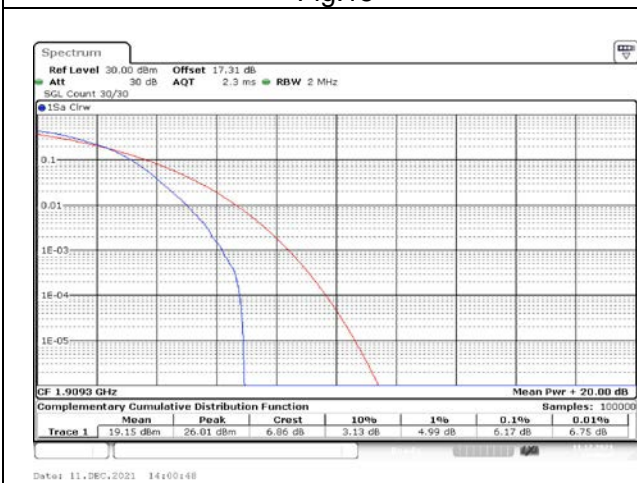


Fig.17

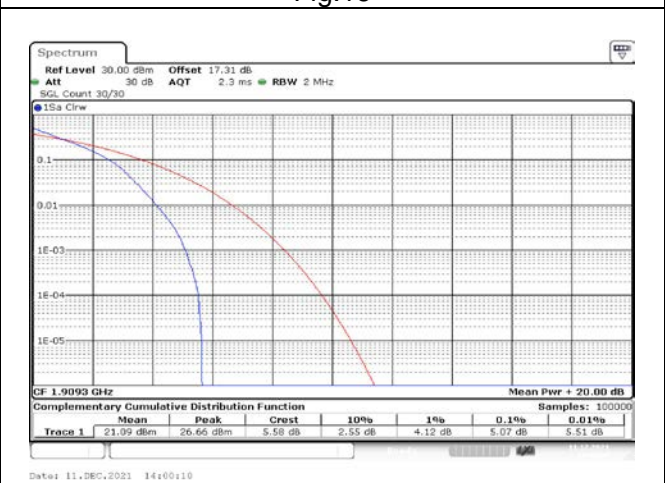


Fig.18

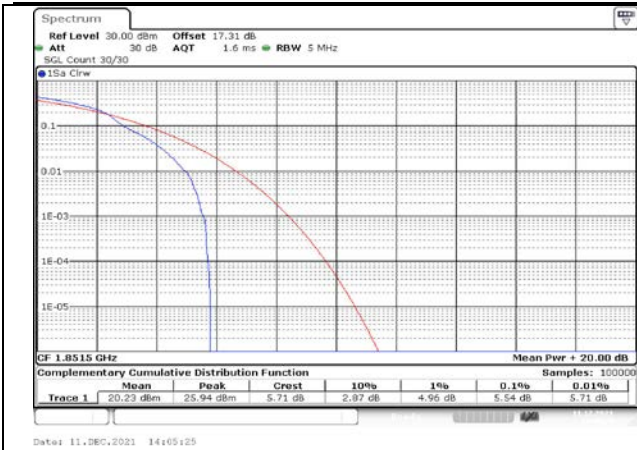


Fig.19

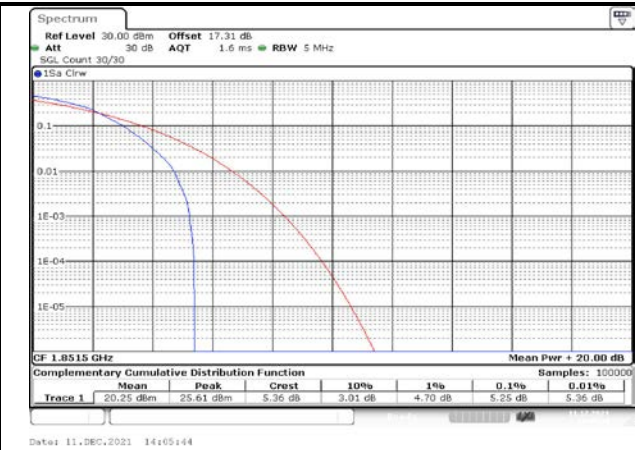


Fig.20

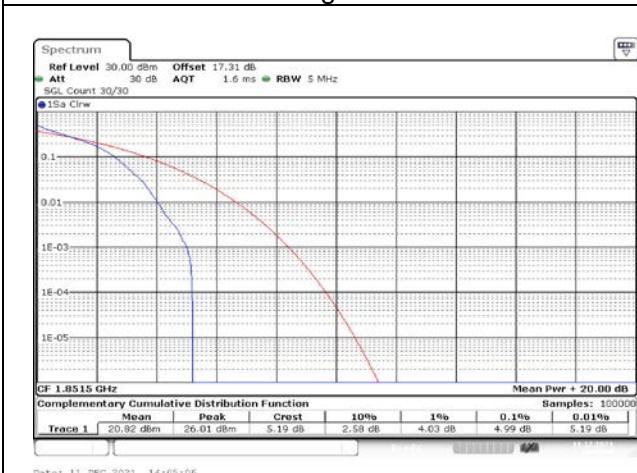


Fig.21

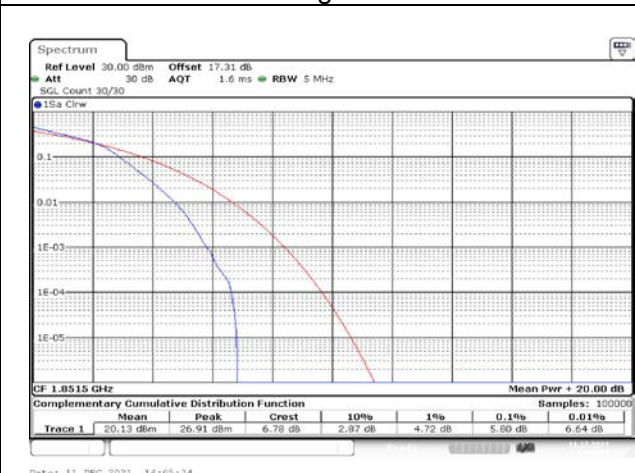


Fig.22

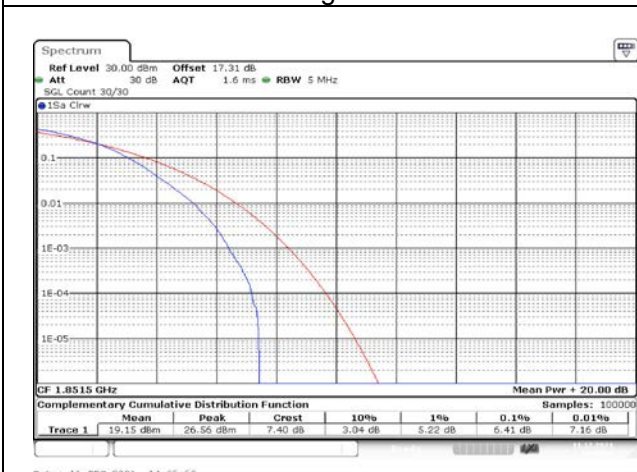


Fig.23

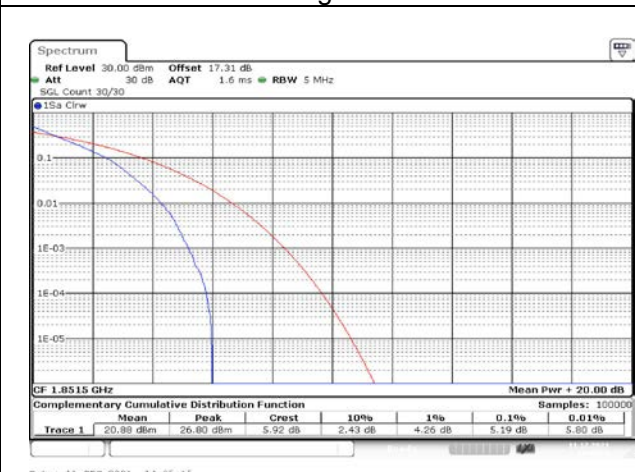


Fig.24

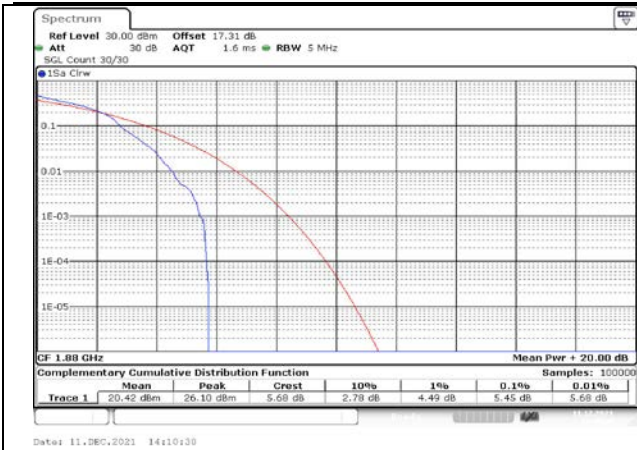


Fig.25

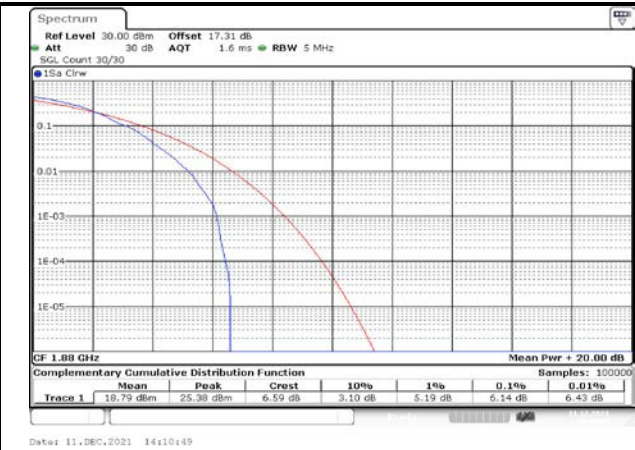


Fig.26

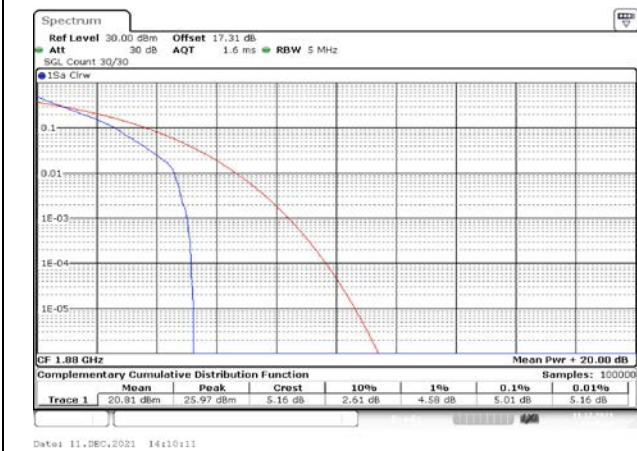


Fig.27

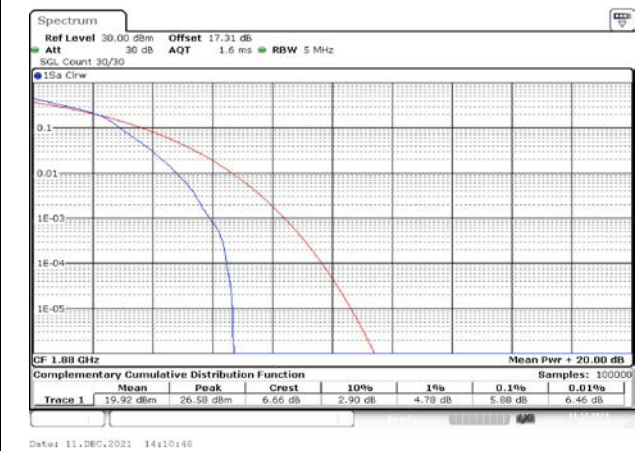


Fig.28

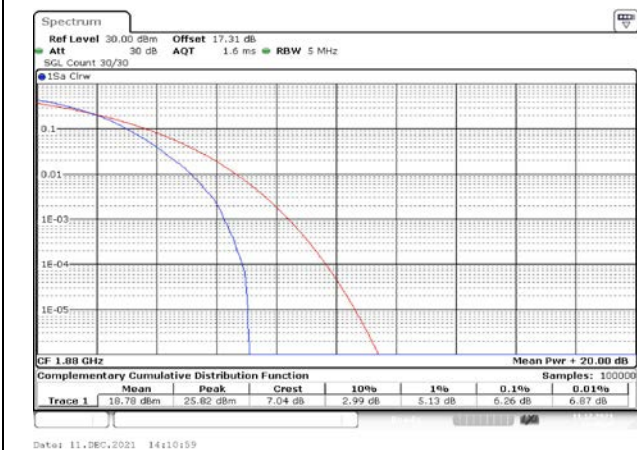


Fig.29

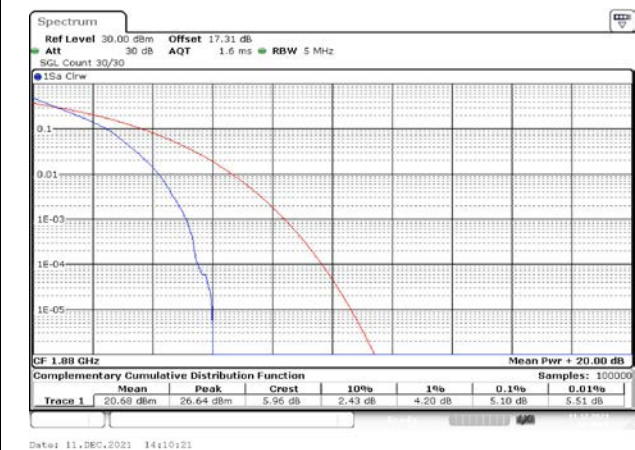


Fig.30





Fig.31

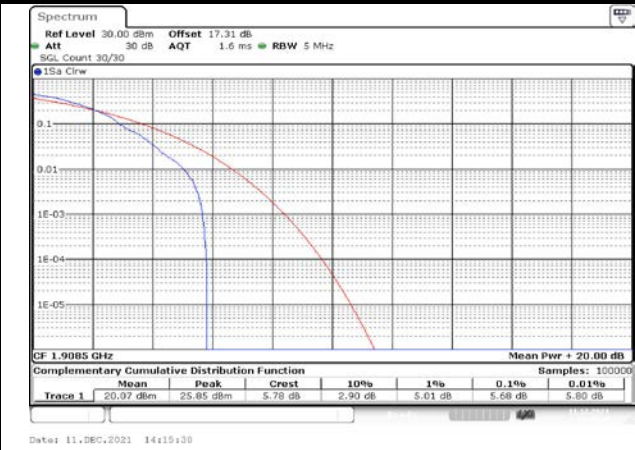


Fig.32

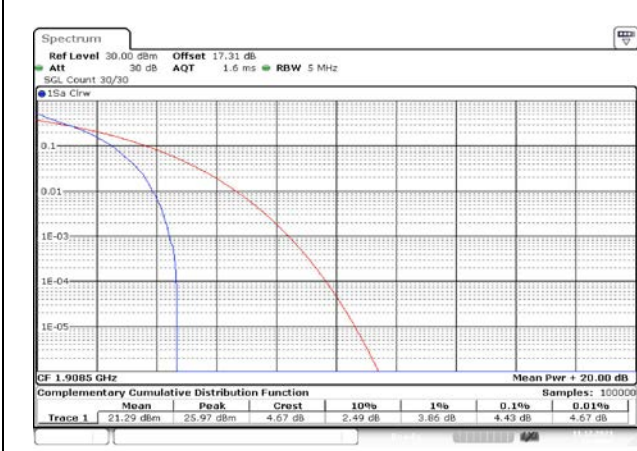


Fig.33

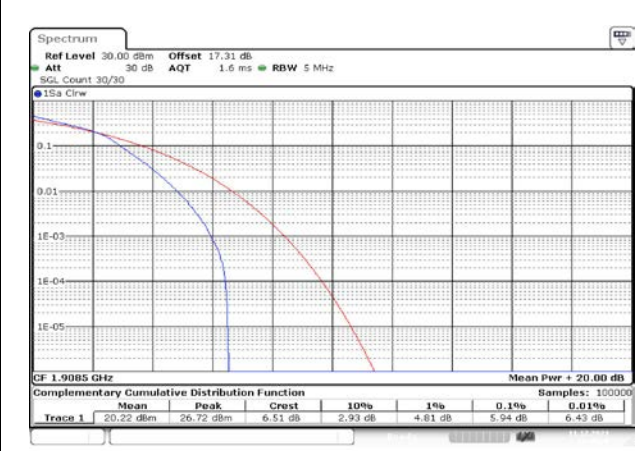


Fig.34

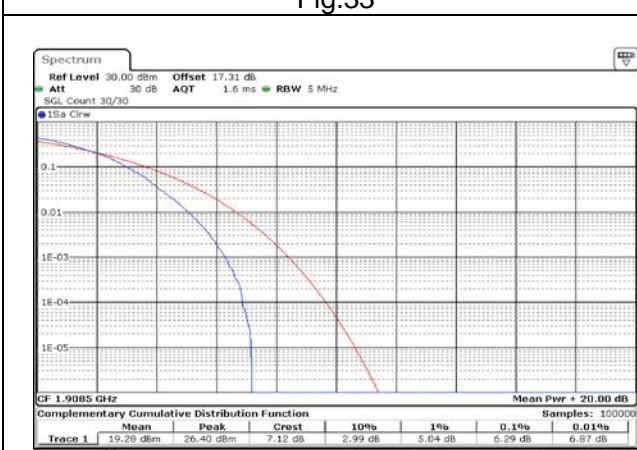


Fig.35

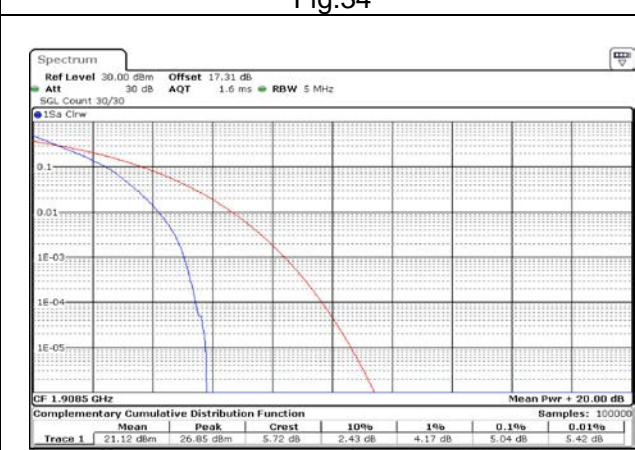


Fig.36

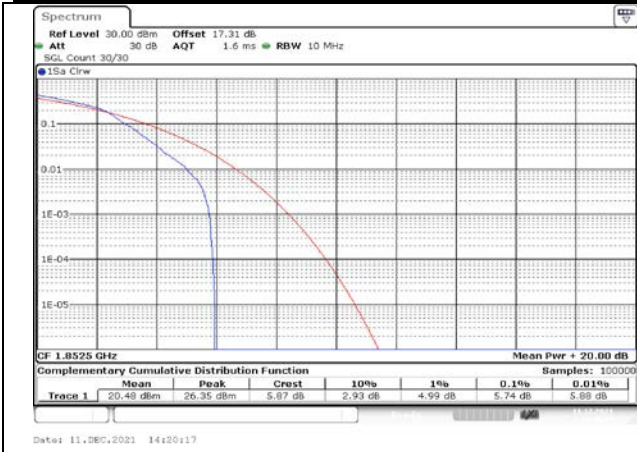


Fig.37

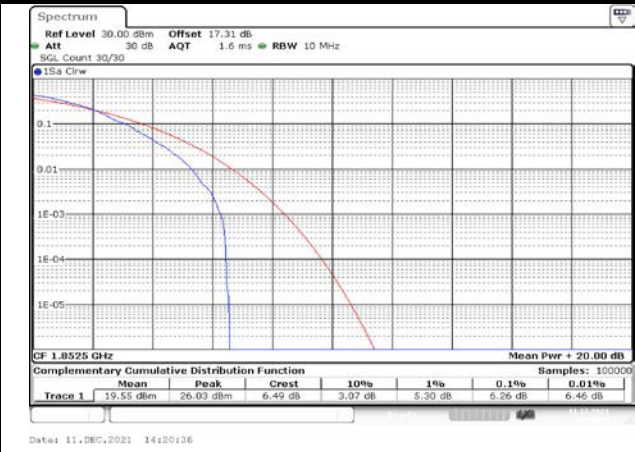


Fig.38

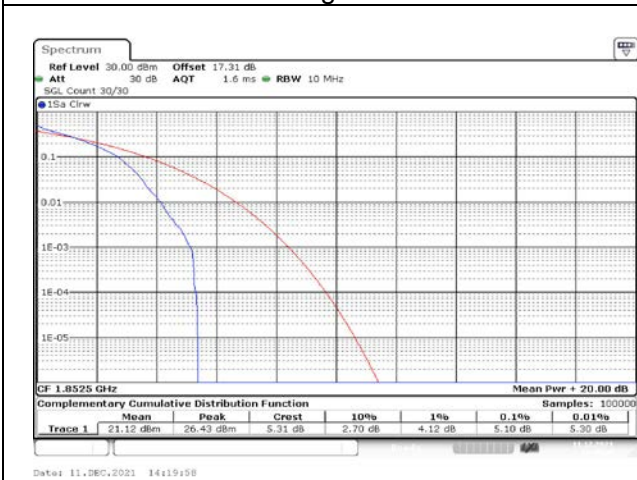


Fig.39

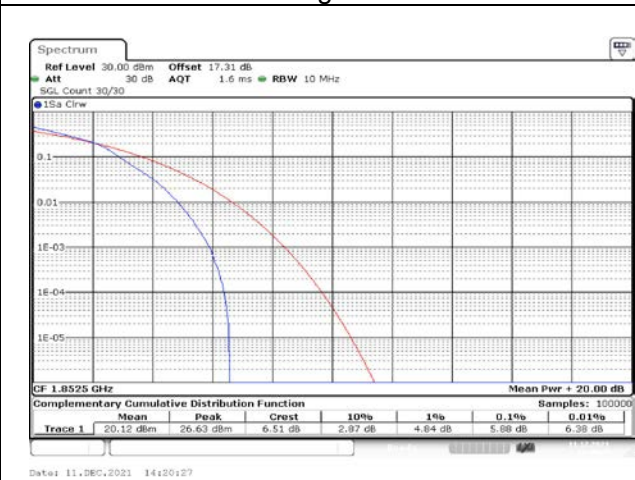


Fig.40

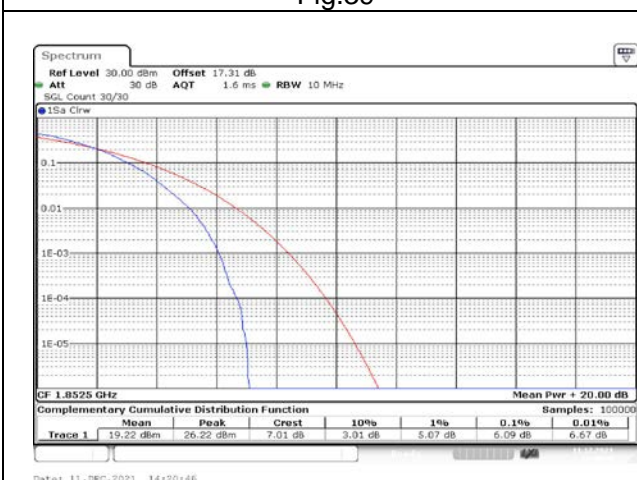


Fig.41

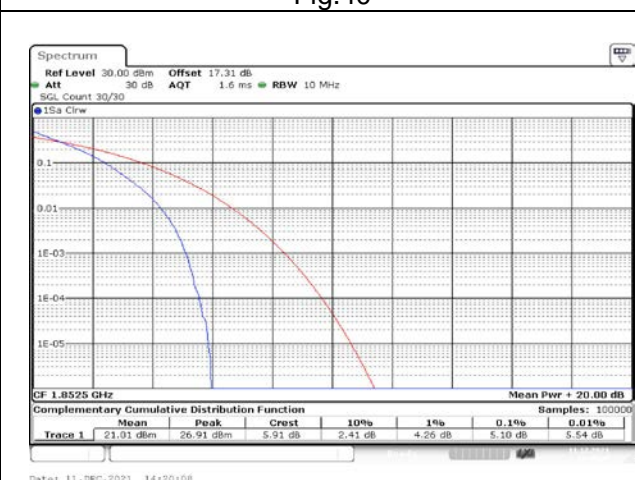


Fig.42

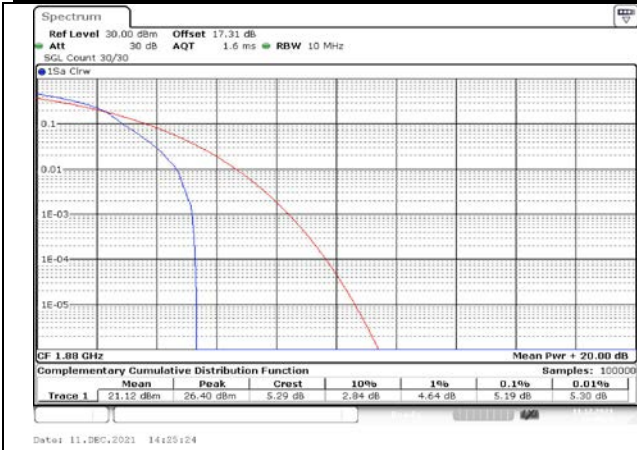


Fig.43

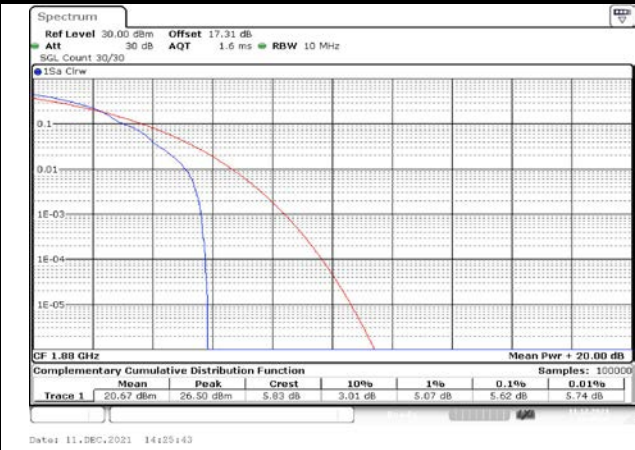


Fig.44

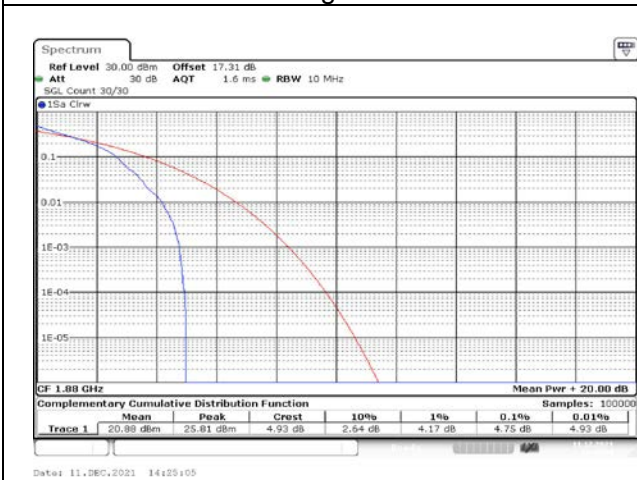


Fig.45

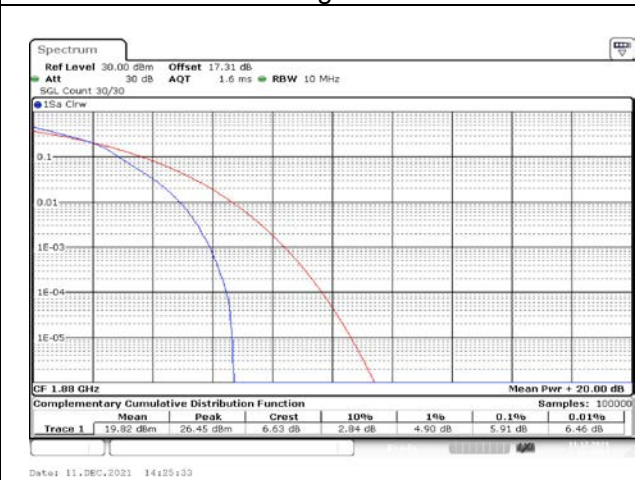


Fig.46

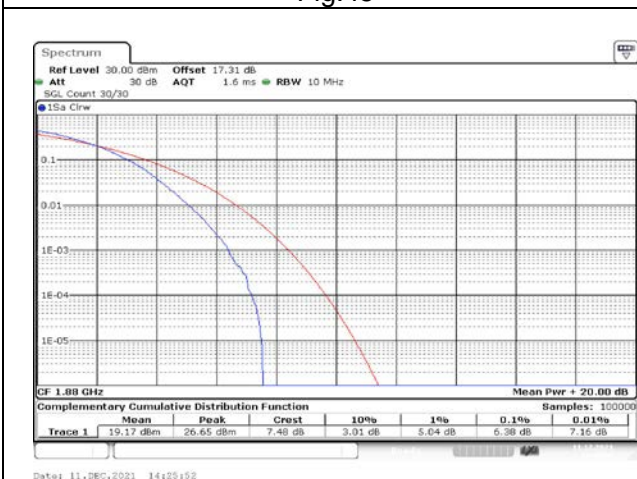


Fig.47

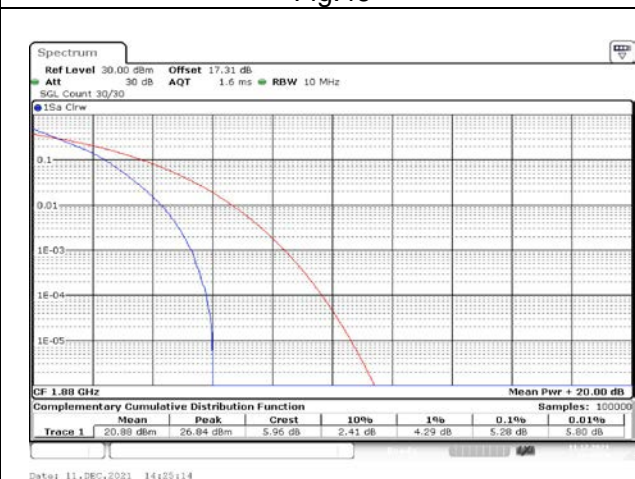


Fig.48



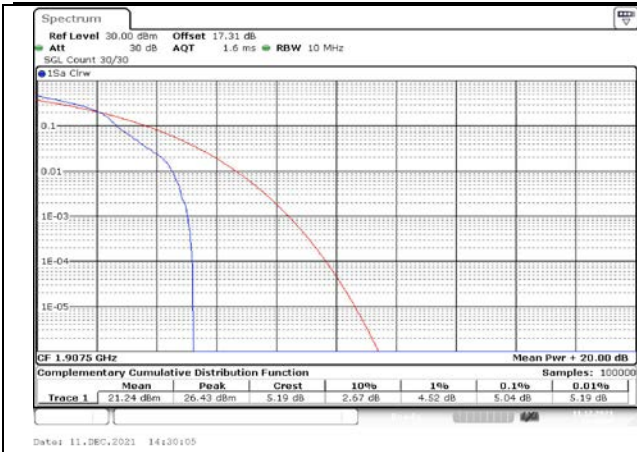


Fig.49

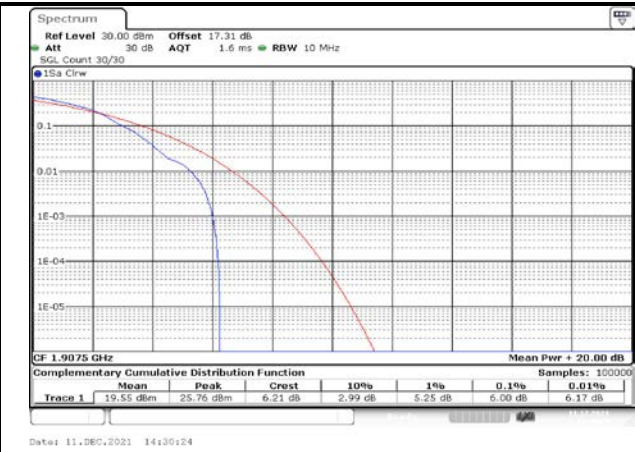


Fig.50

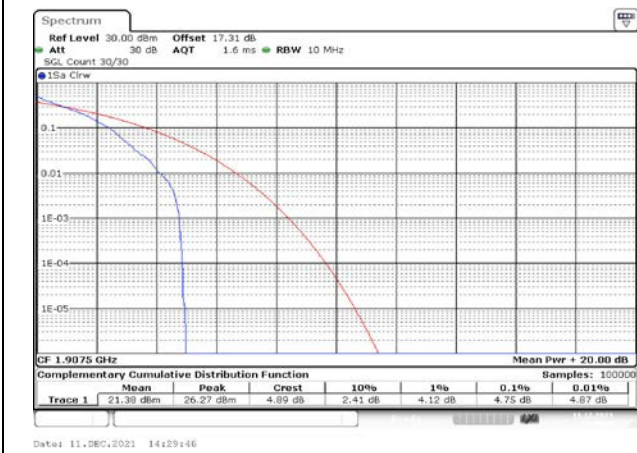


Fig.51

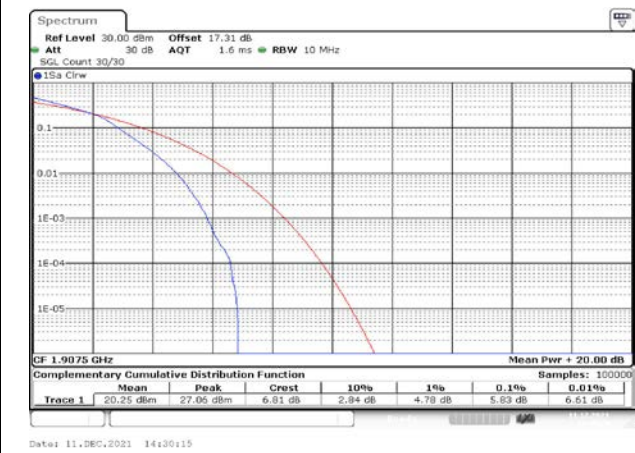


Fig.52

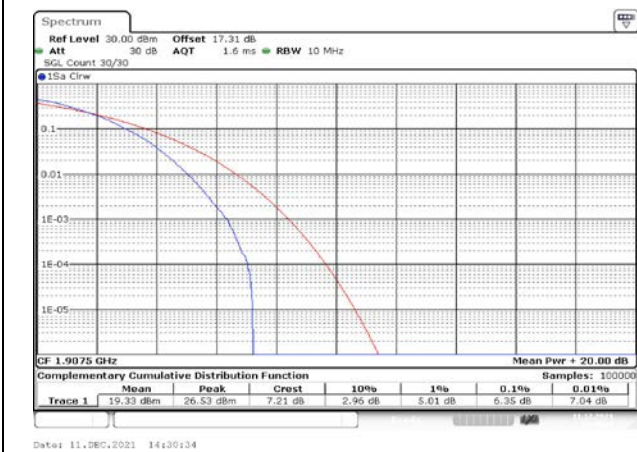


Fig.53

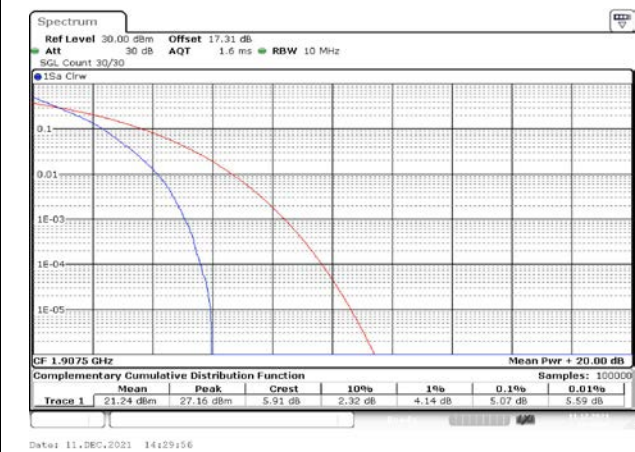


Fig.54



Fig.55

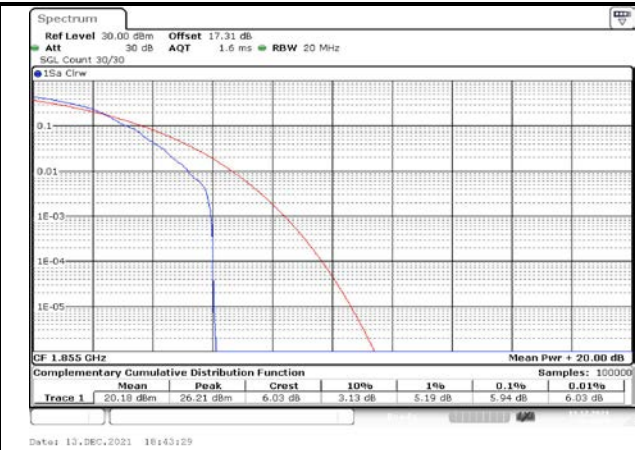


Fig.56

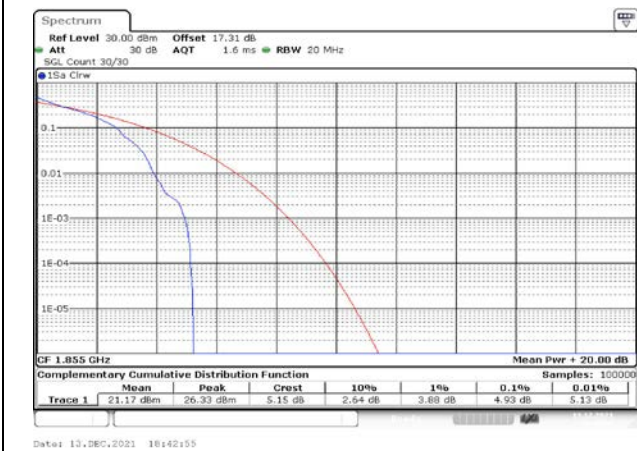


Fig.57

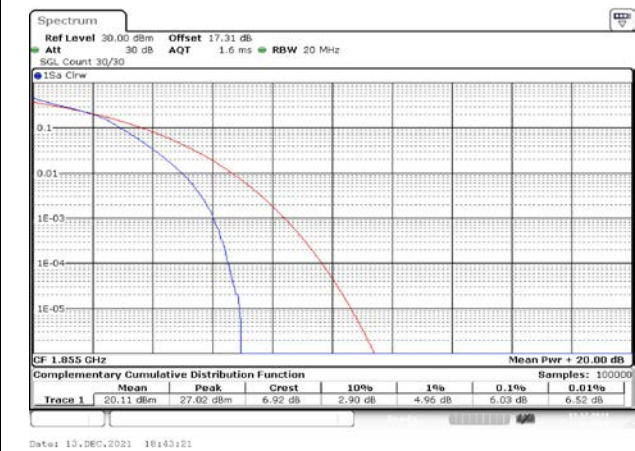


Fig.58

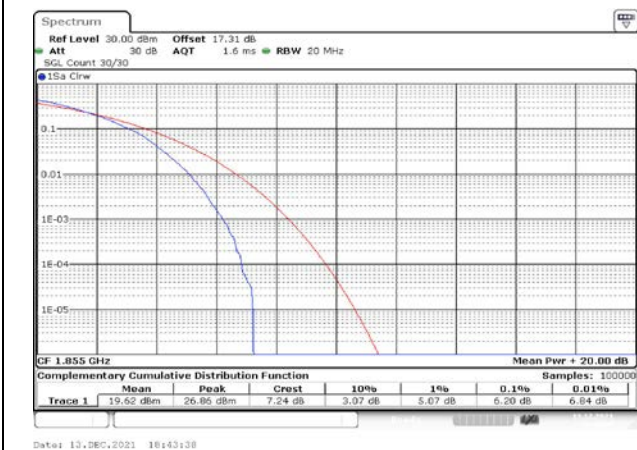


Fig.59

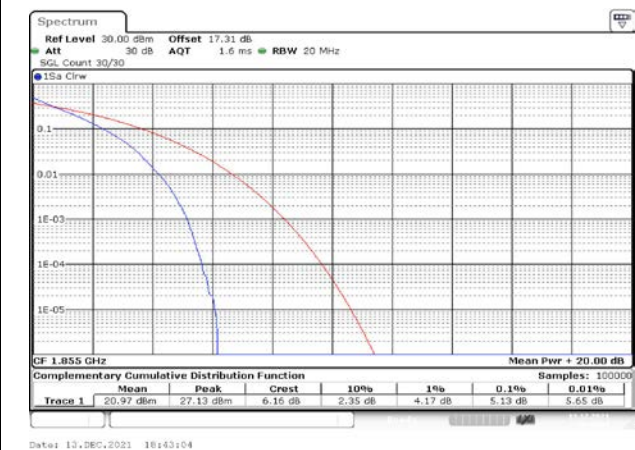


Fig.60

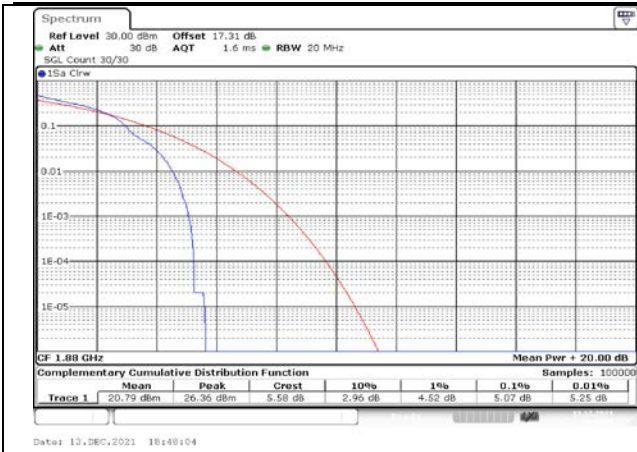


Fig.61

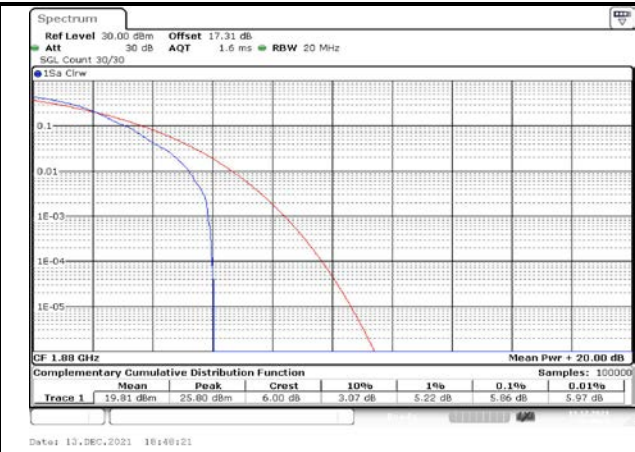


Fig.62

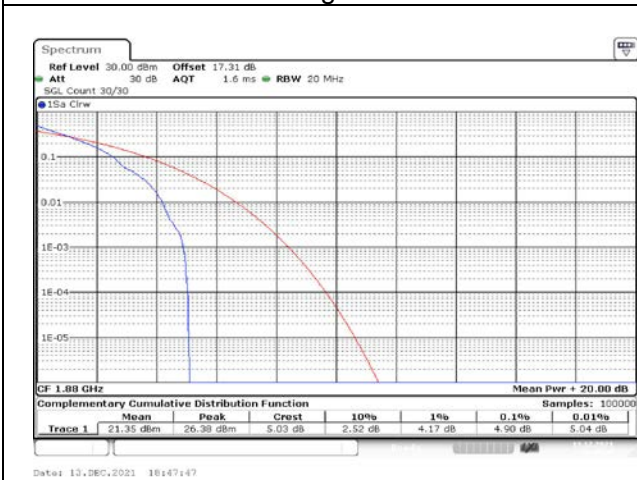


Fig.63

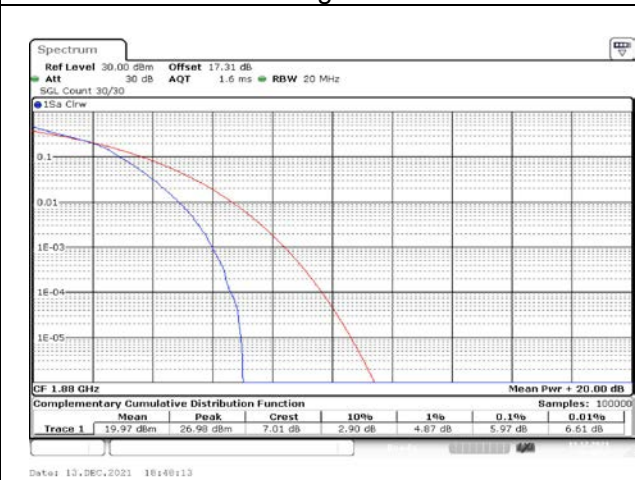


Fig.64

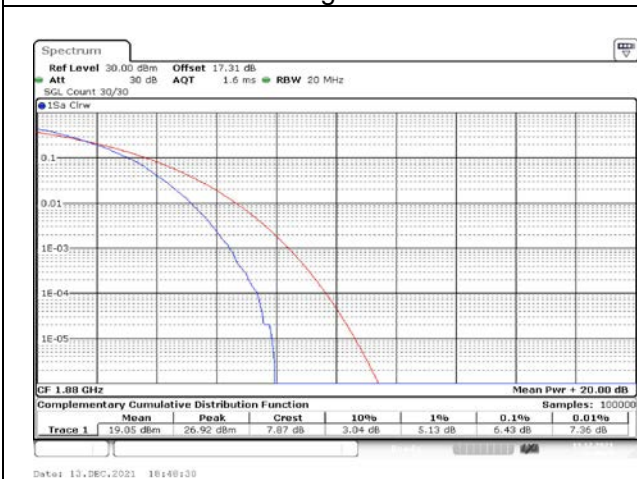


Fig.65

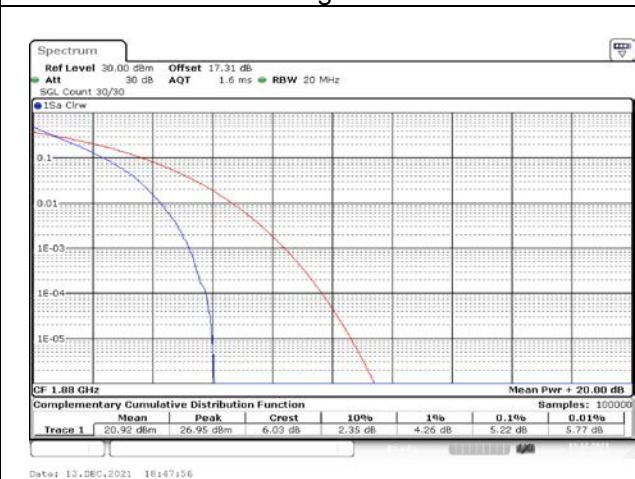


Fig.66



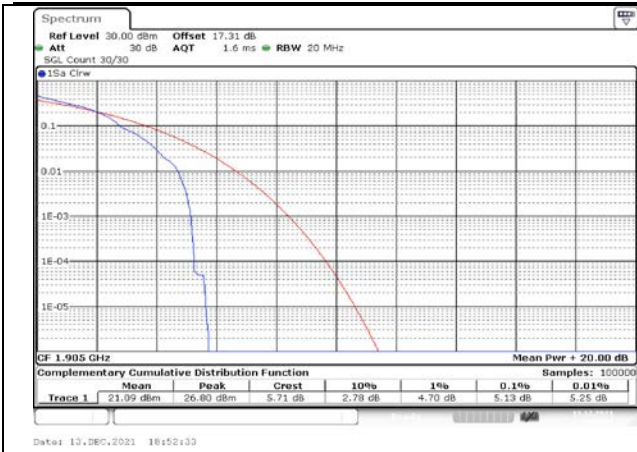


Fig.67

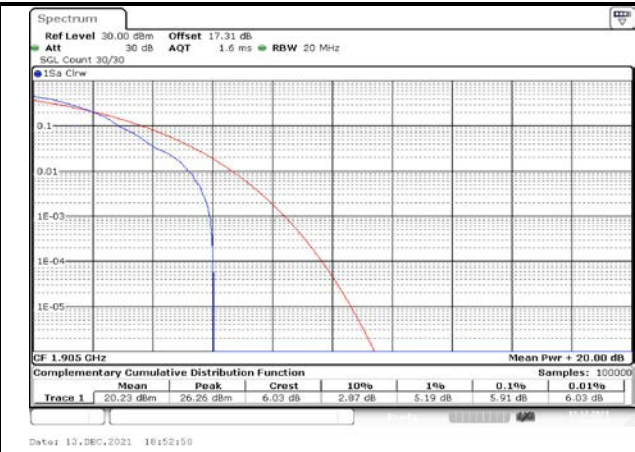


Fig.68

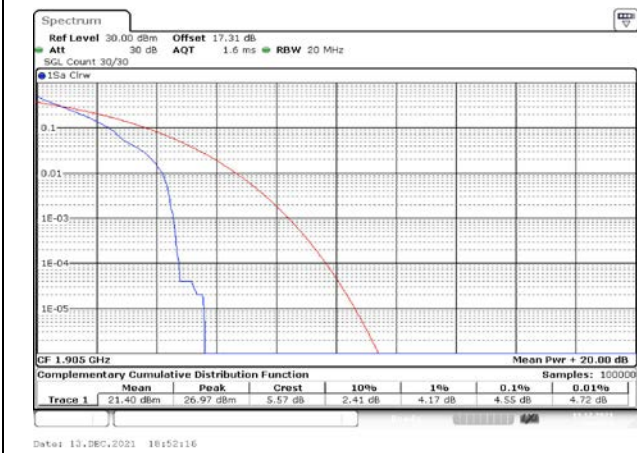


Fig.69

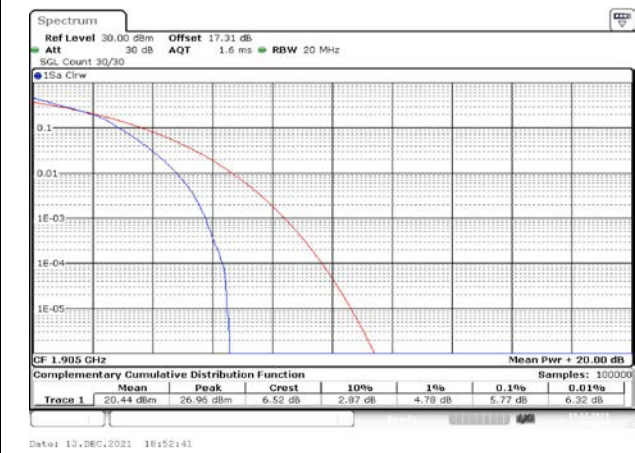


Fig.70

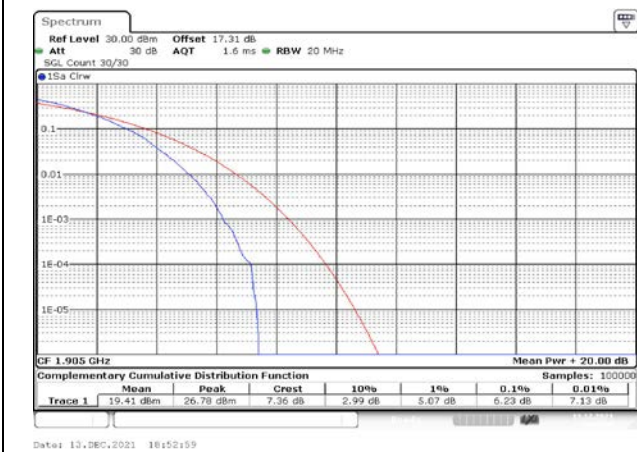


Fig.71

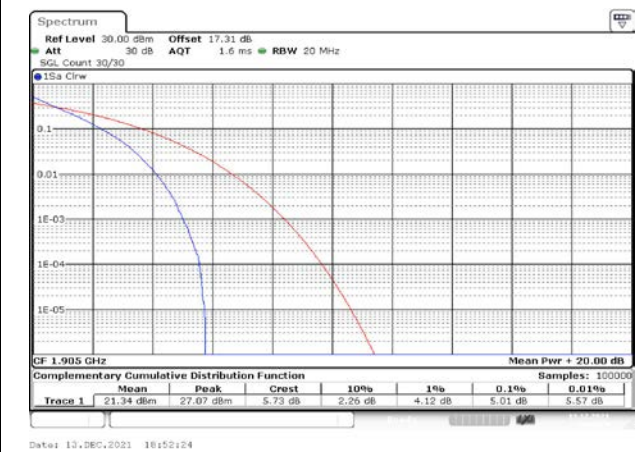


Fig.72



Fig.73

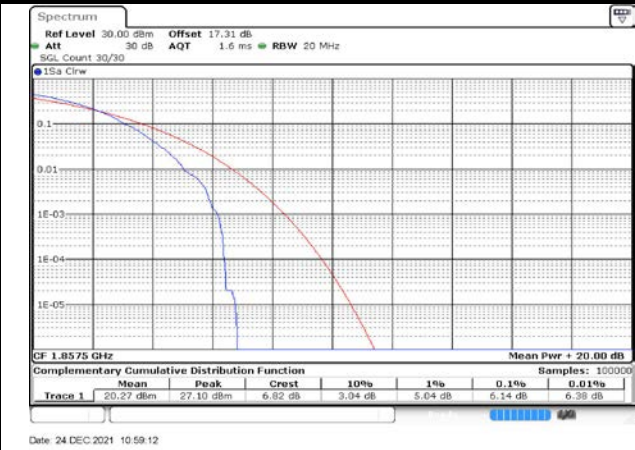


Fig.74

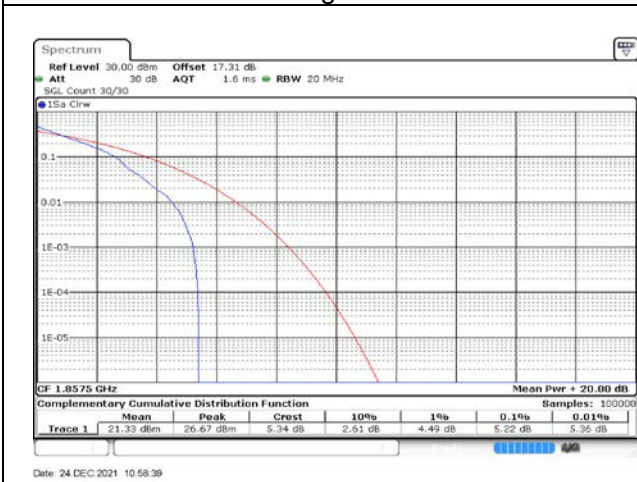


Fig.75

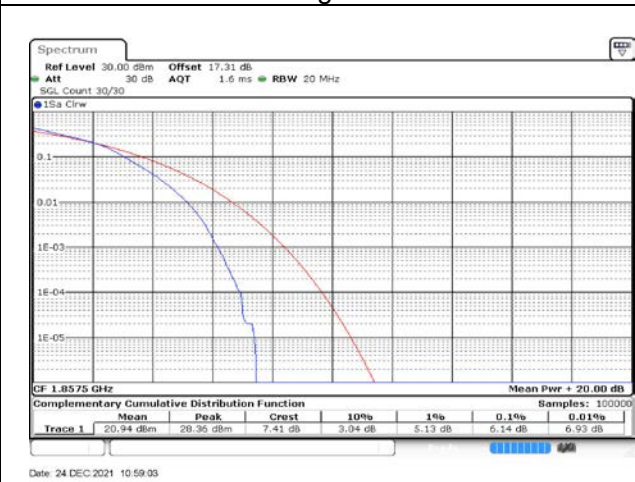


Fig.76

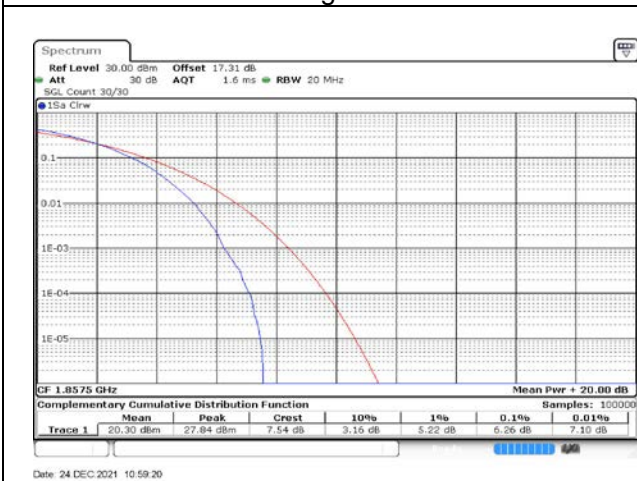


Fig.77

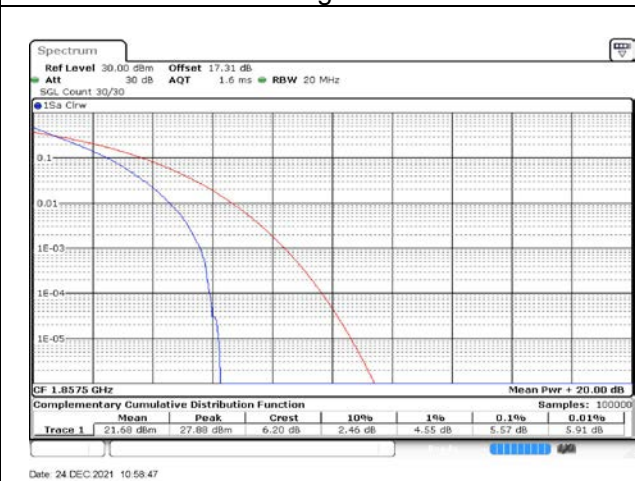


Fig.78

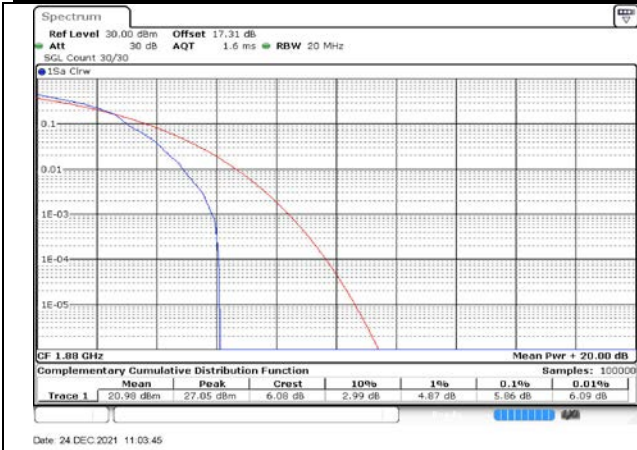


Fig.79

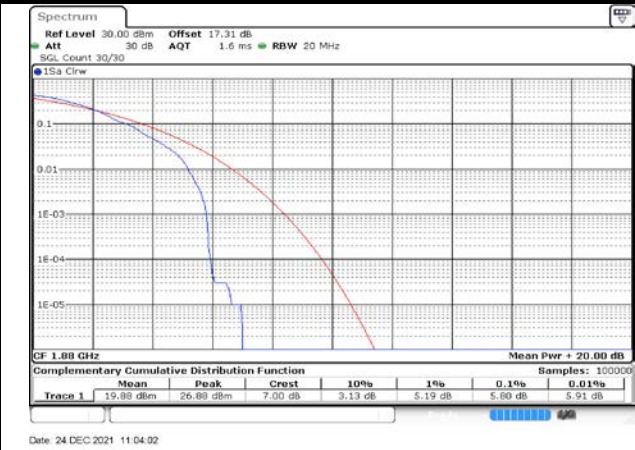


Fig.80

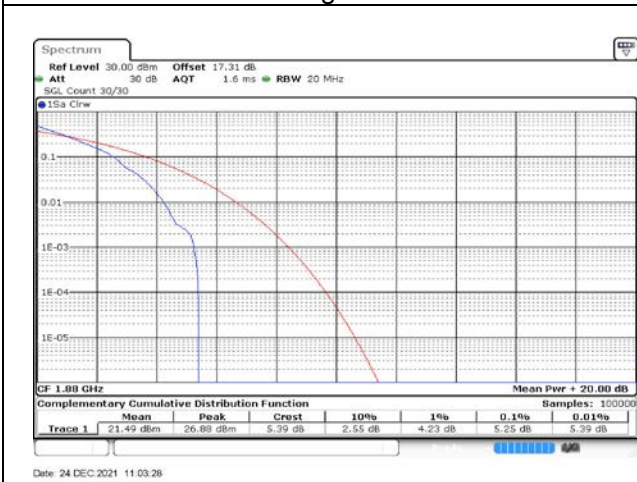


Fig.81

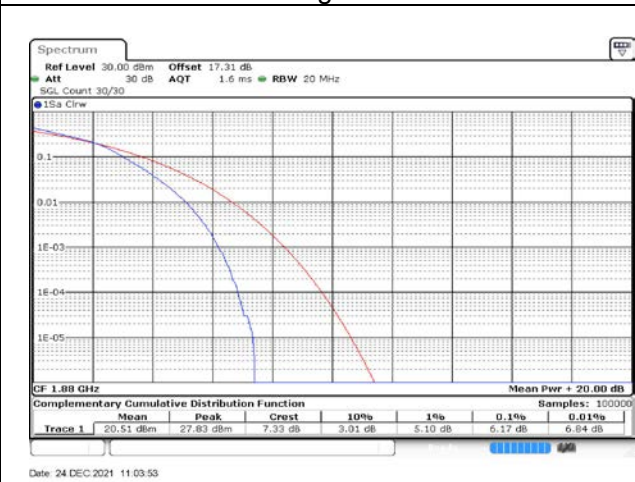


Fig.82

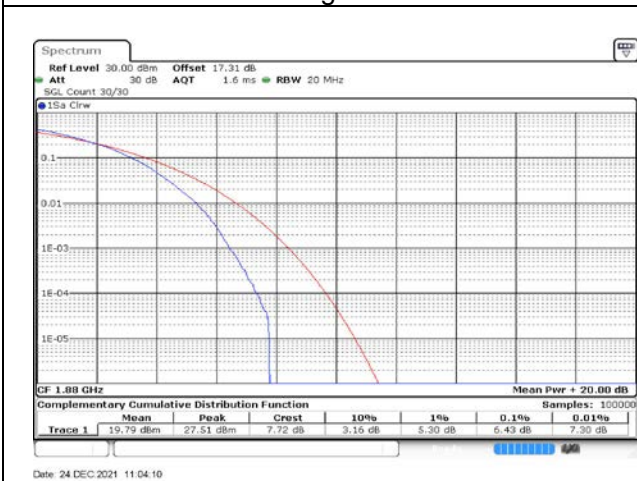


Fig.83

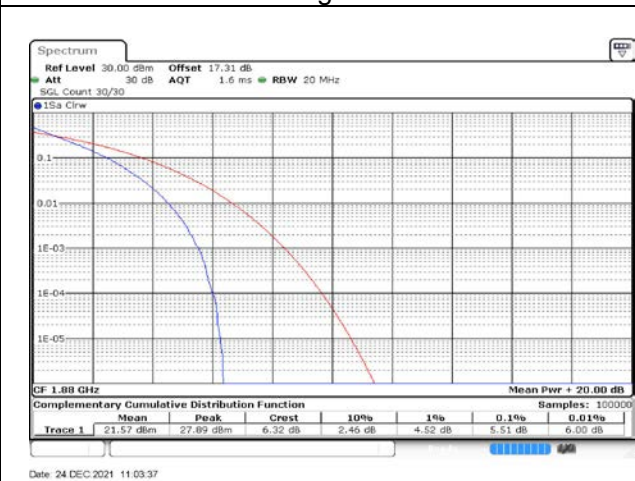


Fig.84