




Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5535	43.54	19.82	63.36	68.2	-4.84	PK
		5654.5	41.39	19.67	61.06	71.54	-10.48	PK
		5785	87.86	20.45	108.31	N/A	N/A	PK
		5878	41.13	20.82	61.95	102.97	-41.02	PK
		5987.5	40.04	20.98	61.02	68.2	-7.18	PK
		* 11570	29.24	19.07	48.31	74	-25.69	PK
Vertical	@	5535	40.75	19.82	60.57	68.2	-7.63	PK
		5675.5	40.15	19.7	59.85	87.11	-27.26	PK
		5785	83.98	20.45	104.43	N/A	N/A	PK
		5922	40.22	20.96	61.18	70.41	-9.23	PK
		5952	40.34	20.95	61.29	68.2	-6.91	PK
		* 11570	30.03	19.07	49.1	74	-24.9	PK

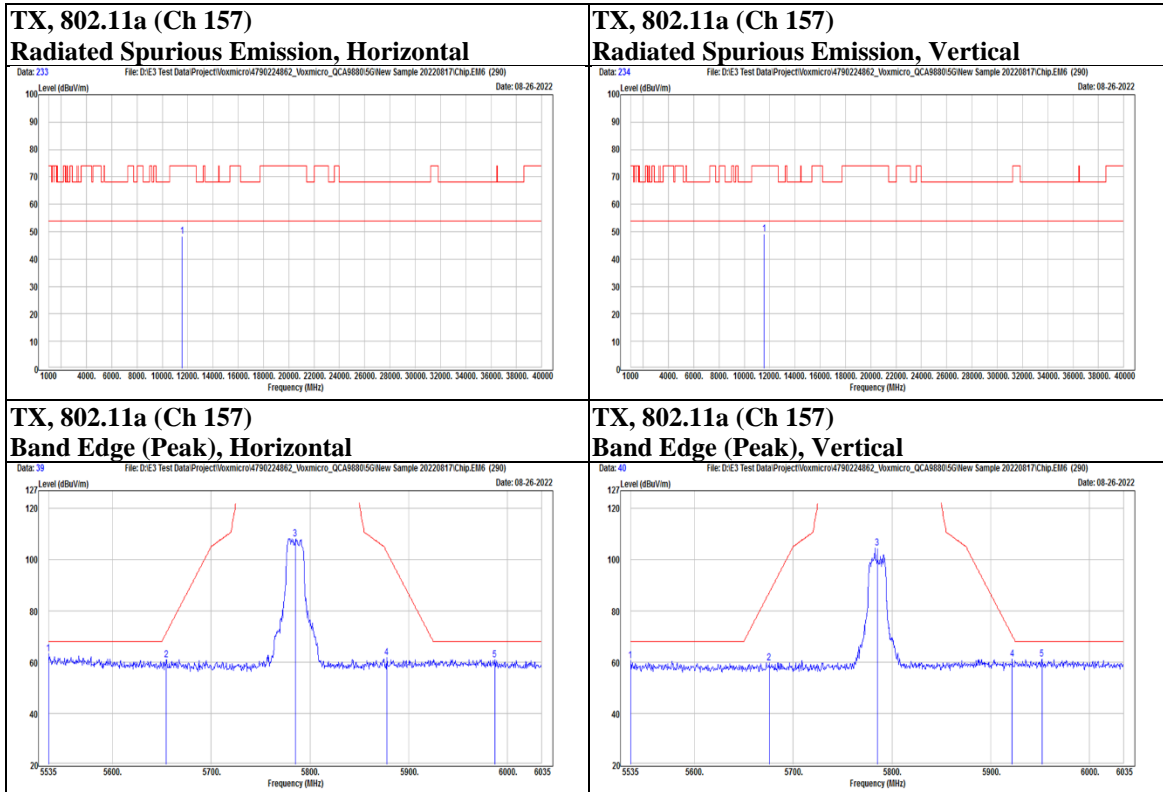

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	86.33	20.58	106.91	N/A	N/A	PK
		5880.5	40.66	20.84	61.5	101.11	-39.61	PK
		5943.5	40.23	20.94	61.17	68.2	-7.03	PK
	*	11650	29.93	18.83	48.76	74	-25.24	PK
Vertical	@	5825	79.61	20.58	100.19	N/A	N/A	PK
		5922	41.51	20.96	62.47	70.41	-7.94	PK
		5943	41.19	20.94	62.13	68.2	-6.07	PK
	*	11650	28.54	18.83	47.37	74	-26.63	PK

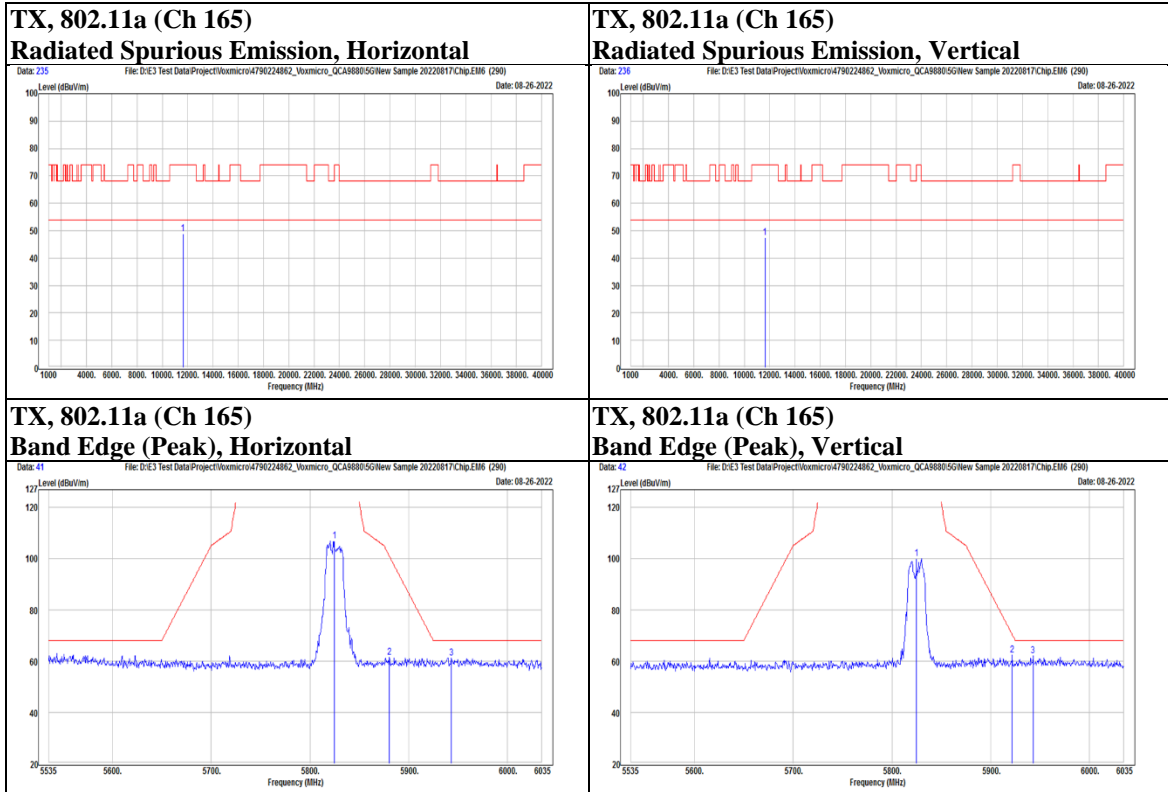

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 132 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5081.2	30.5	19.31	49.81	54	-4.19	AVG
		5116.55	43.93	19.43	63.36	74	-10.64	PK
	@	5180	90.81	19.31	110.12	N/A	N/A	PK
	@	5180	80.48	19.31	99.79	N/A	N/A	AVG
	*	10360	29.89	17.51	47.4	68.2	-20.8	PK
Vertical		5099.75	30.13	19.44	49.57	54	-4.43	AVG
		5137.9	42.74	19.4	62.14	74	-11.86	PK
	@	5180	79.95	19.31	99.26	N/A	N/A	PK
	@	5180	70.39	19.31	89.7	N/A	N/A	AVG
	*	10360	29.55	17.51	47.06	68.2	-21.14	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

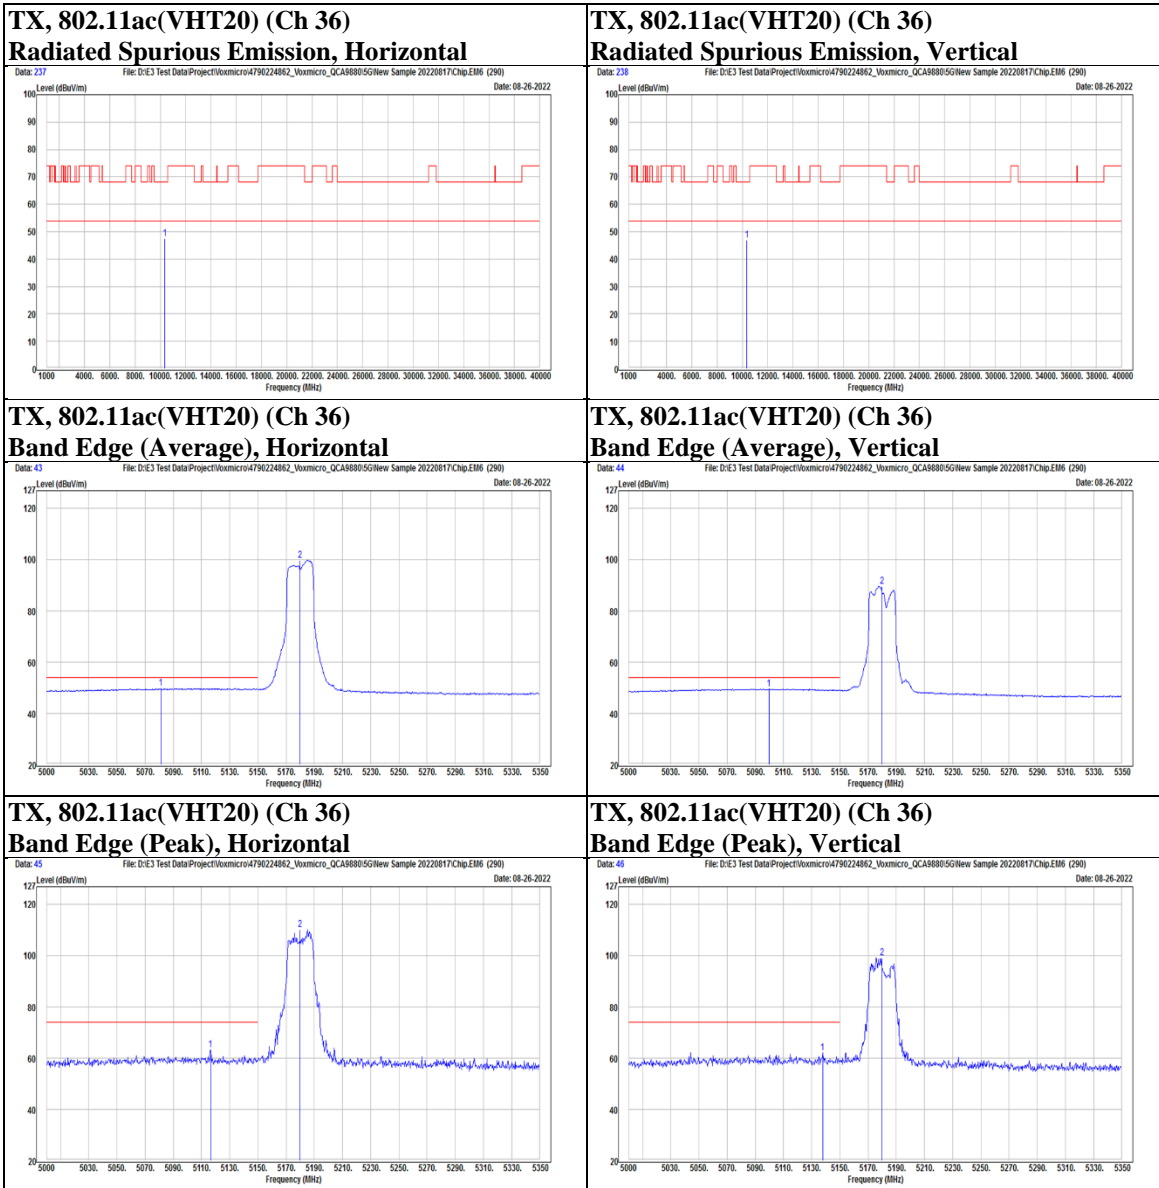

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 134 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5086.1	42.17	19.35	61.52	74	-12.48	PK
		5116.55	30.28	19.43	49.71	54	-4.29	AVG
	@	5220	90.35	19.12	109.47	N/A	N/A	PK
	@	5220	80.53	19.12	99.65	N/A	N/A	AVG
	*	10440	29.19	17.81	47	68.2	-21.2	PK
Vertical		5060.55	30.37	19.16	49.53	54	-4.47	AVG
		5117.95	41.95	19.43	61.38	74	-12.62	PK
	@	5220	79.68	19.12	98.8	N/A	N/A	PK
	@	5220	70.63	19.12	89.75	N/A	N/A	AVG
	*	10440	29.12	17.81	46.93	68.2	-21.27	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

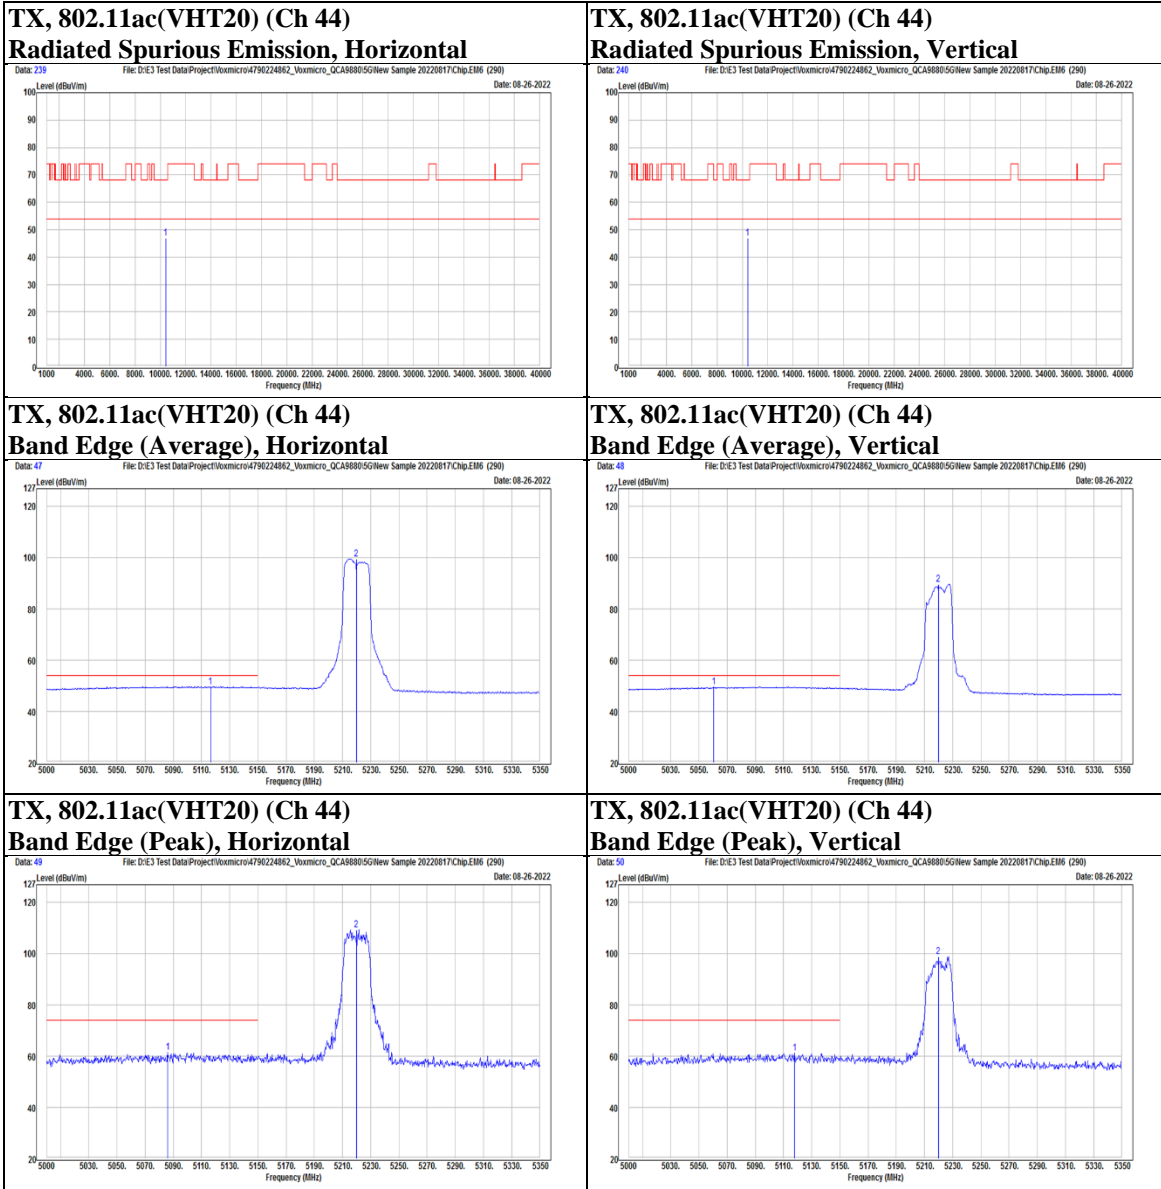

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 136 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5063	42.81	19.18	61.99	74	-12.01	PK
		5115.15	30.31	19.43	49.74	54	-4.26	AVG
	@	5240	88.46	18.97	107.43	N/A	N/A	PK
	@	5240	79.59	18.97	98.56	N/A	N/A	AVG
	*	10480	29.86	17.92	47.78	68.2	-20.42	PK
Vertical		5025.9	43.36	18.87	62.23	74	-11.77	PK
		5105	30.16	19.44	49.6	54	-4.4	AVG
	@	5240	80.53	18.97	99.5	N/A	N/A	PK
	@	5240	70.2	18.97	89.17	N/A	N/A	AVG
	*	10480	28.82	17.92	46.74	68.2	-21.46	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

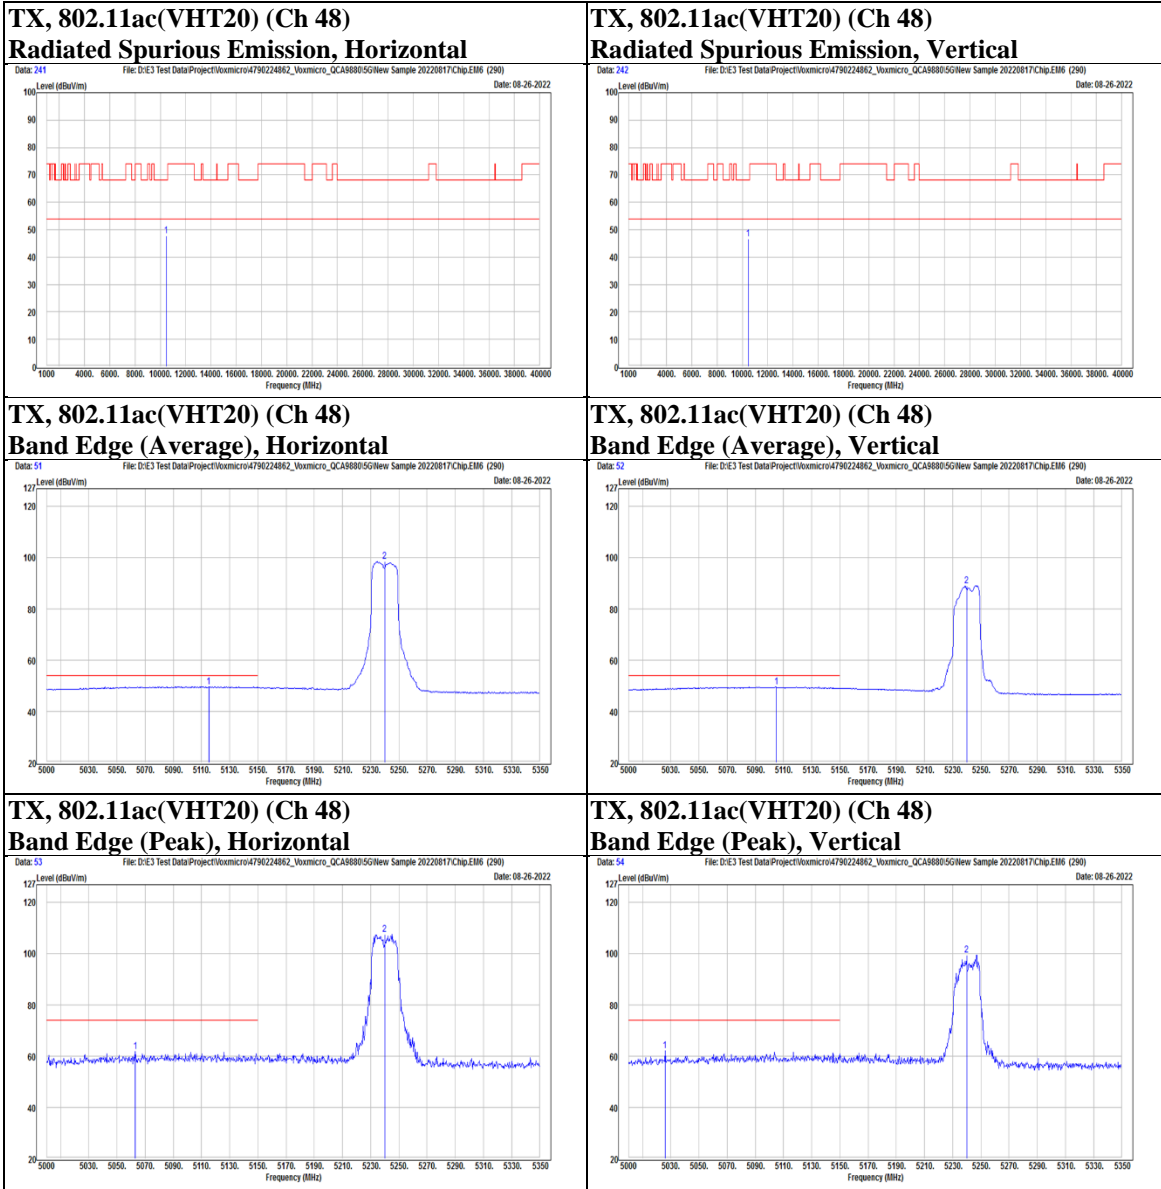

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 138 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	90.46	18.88	109.34	N/A	N/A	PK
	@	5260	80.16	18.88	99.04	N/A	N/A	AVG
		5417.7	40.99	19.35	60.34	74	-13.66	PK
		5449.2	29.03	19.51	48.54	54	-5.46	AVG
	*	10520	29.39	17.99	47.38	68.2	-20.82	PK
Vertical	@	5260	80.17	18.88	99.05	N/A	N/A	PK
	@	5260	70.62	18.88	89.5	N/A	N/A	AVG
		5356.8	40.28	19.05	59.33	74	-14.67	PK
		5454.6	28.36	19.54	47.9	54	-6.1	AVG
	*	10520	29.07	17.99	47.06	68.2	-21.14	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

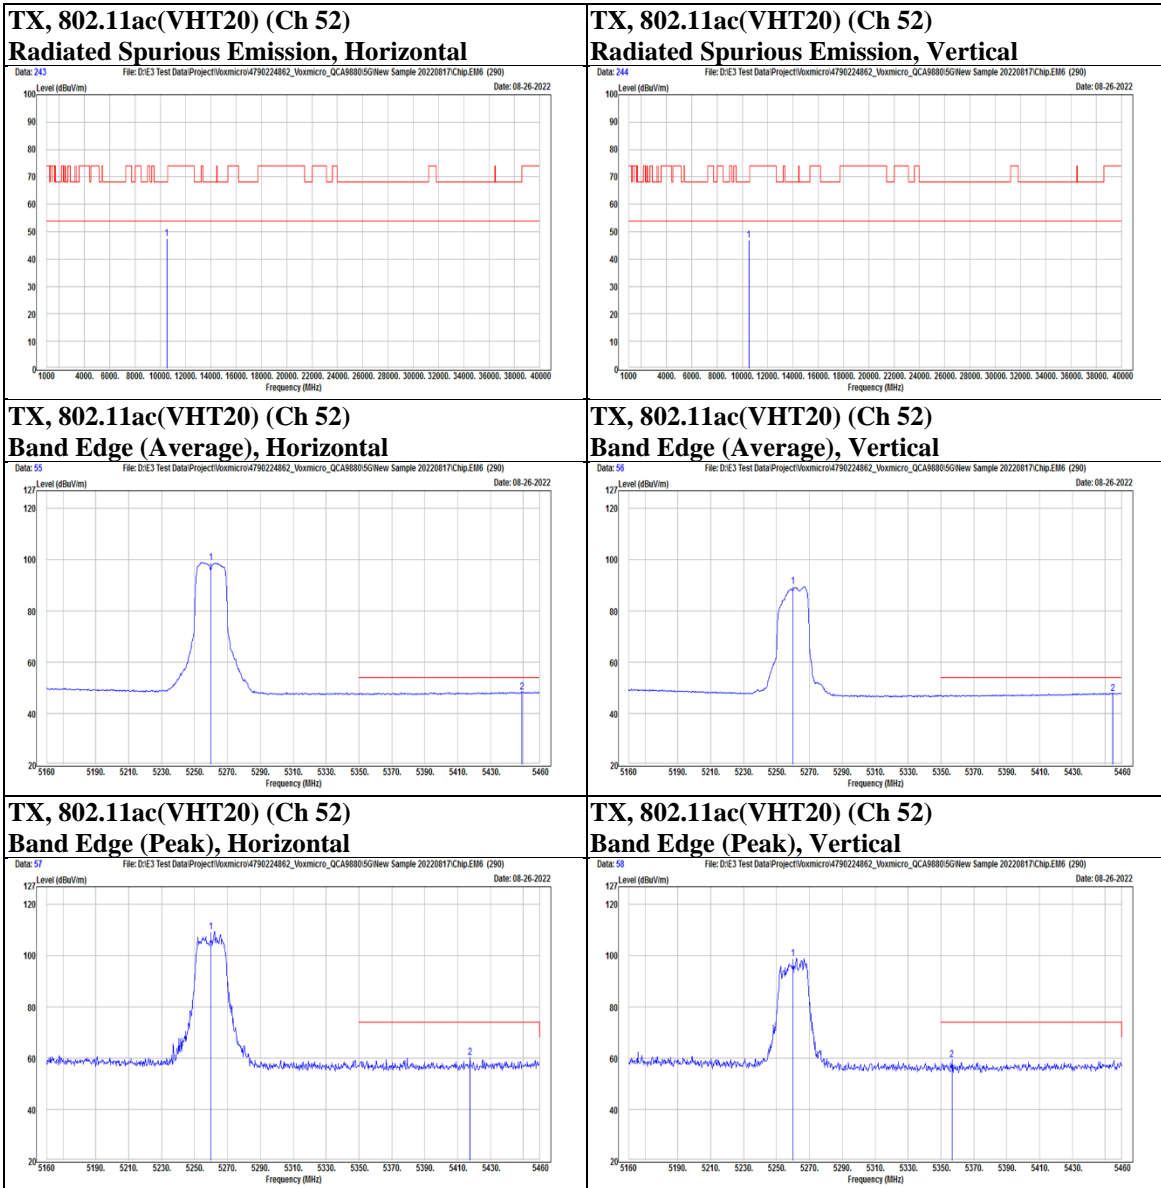

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 140 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	90.03	18.77	108.8	N/A	N/A	PK
	@	5300	80.58	18.77	99.35	N/A	N/A	AVG
		5449.2	29.24	19.51	48.75	54	-5.25	AVG
		5459.7	39.98	19.57	59.55	74	-14.45	PK
	*	10600	29.58	18.04	47.62	68.2	-20.58	PK
Vertical	@	5300	80.27	18.77	99.04	N/A	N/A	PK
	@	5300	71.25	18.77	90.02	N/A	N/A	AVG
		5415	39.89	19.34	59.23	74	-14.77	PK
		5451.9	28.39	19.53	47.92	54	-6.08	AVG
	*	10600	29.33	18.04	47.37	68.2	-20.83	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

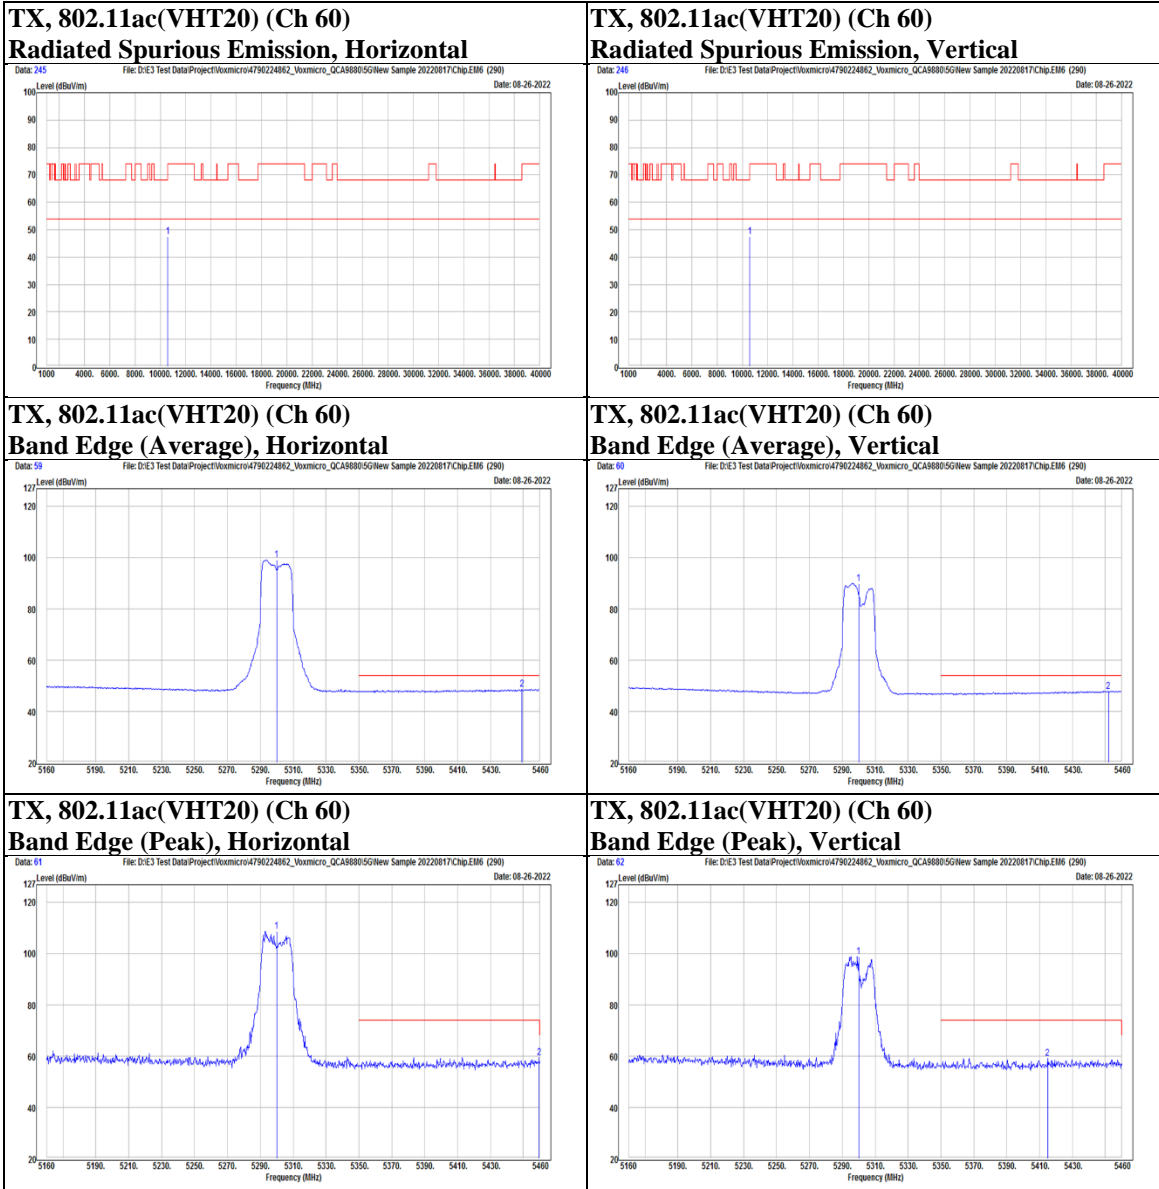

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 142 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	89.54	18.86	108.4	N/A	N/A	PK
	@	5320	80.59	18.86	99.45	N/A	N/A	AVG
		5448.6	28.93	19.5	48.43	54	-5.57	AVG
		5452.8	39.28	19.53	58.81	74	-15.19	PK
	*	10640	29.7	18.03	47.73	74	-26.27	PK
Vertical	@	5320	81.92	18.86	100.78	N/A	N/A	PK
	@	5320	71.74	18.86	90.6	N/A	N/A	AVG
		5374.2	40.54	19.14	59.68	74	-14.32	PK
		5451.6	28.35	19.53	47.88	54	-6.12	AVG
	*	10640	29.3	18.03	47.33	74	-26.67	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

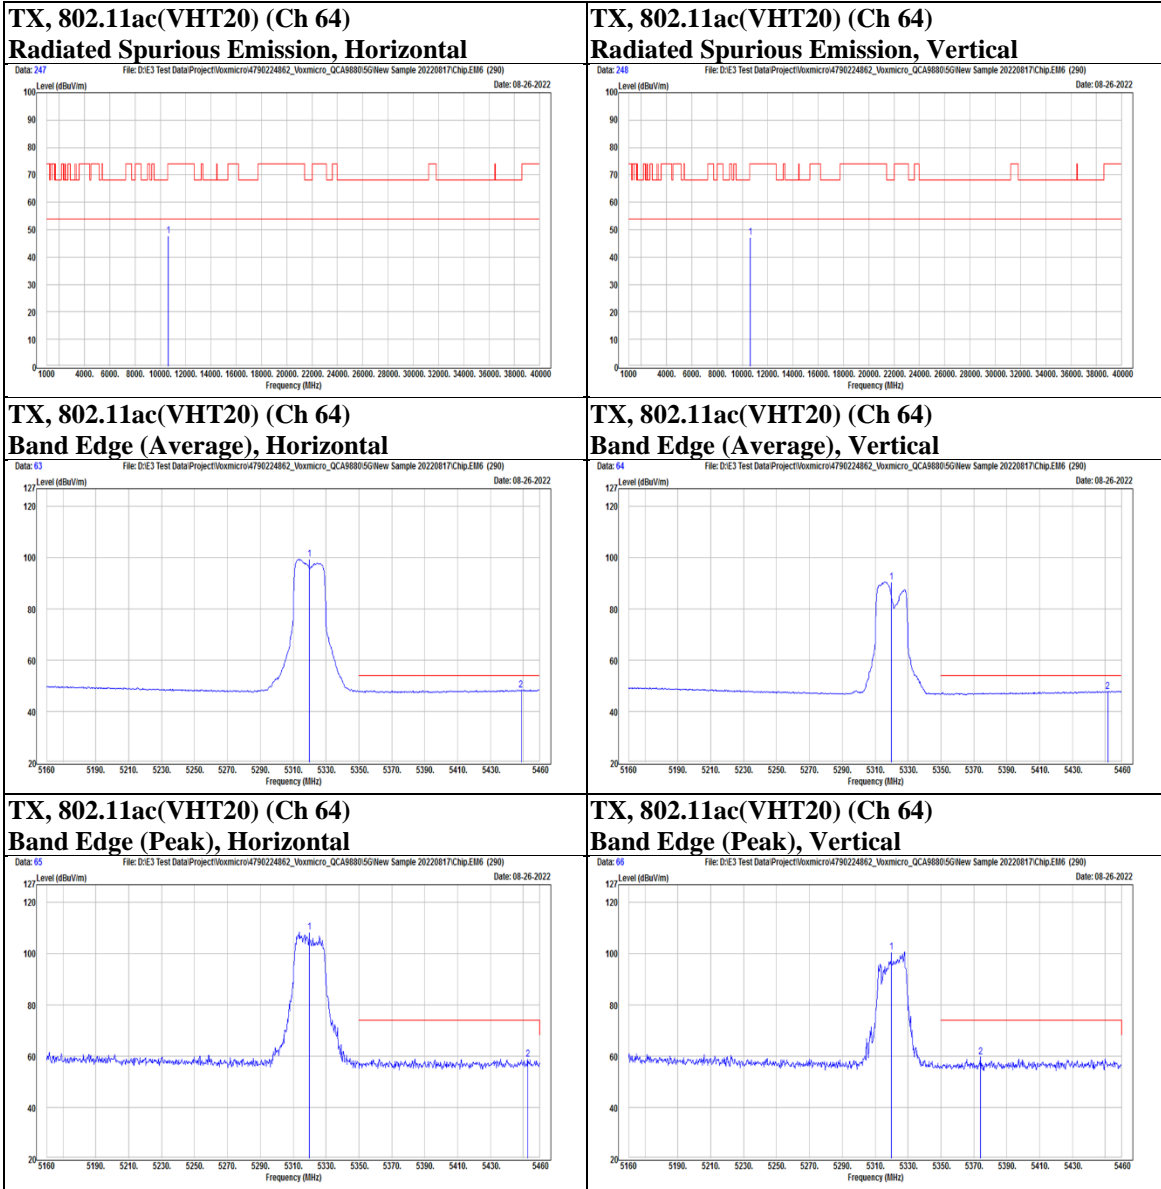

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 144 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5443.4	40.13	19.49	59.62	74	-14.38	PK
		5454.6	29.58	19.54	49.12	54	-4.88	AVG
		5470	39.52	19.62	59.14	68.2	-9.06	PK
	@	5500	87.71	19.77	107.48	N/A	N/A	PK
	@	5500	79.49	19.77	99.26	N/A	N/A	AVG
	*	11000	30.4	18.41	48.81	74	-25.19	PK
Vertical		5428.7	41.02	19.41	60.43	74	-13.57	PK
		5455.65	28.53	19.54	48.07	54	-5.93	AVG
		5460.2	38.19	19.57	57.76	68.2	-10.44	PK
	@	5500	81.34	19.77	101.11	N/A	N/A	PK
	@	5500	74.23	19.77	94	N/A	N/A	AVG
	*	11000	29.91	18.41	48.32	74	-25.68	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

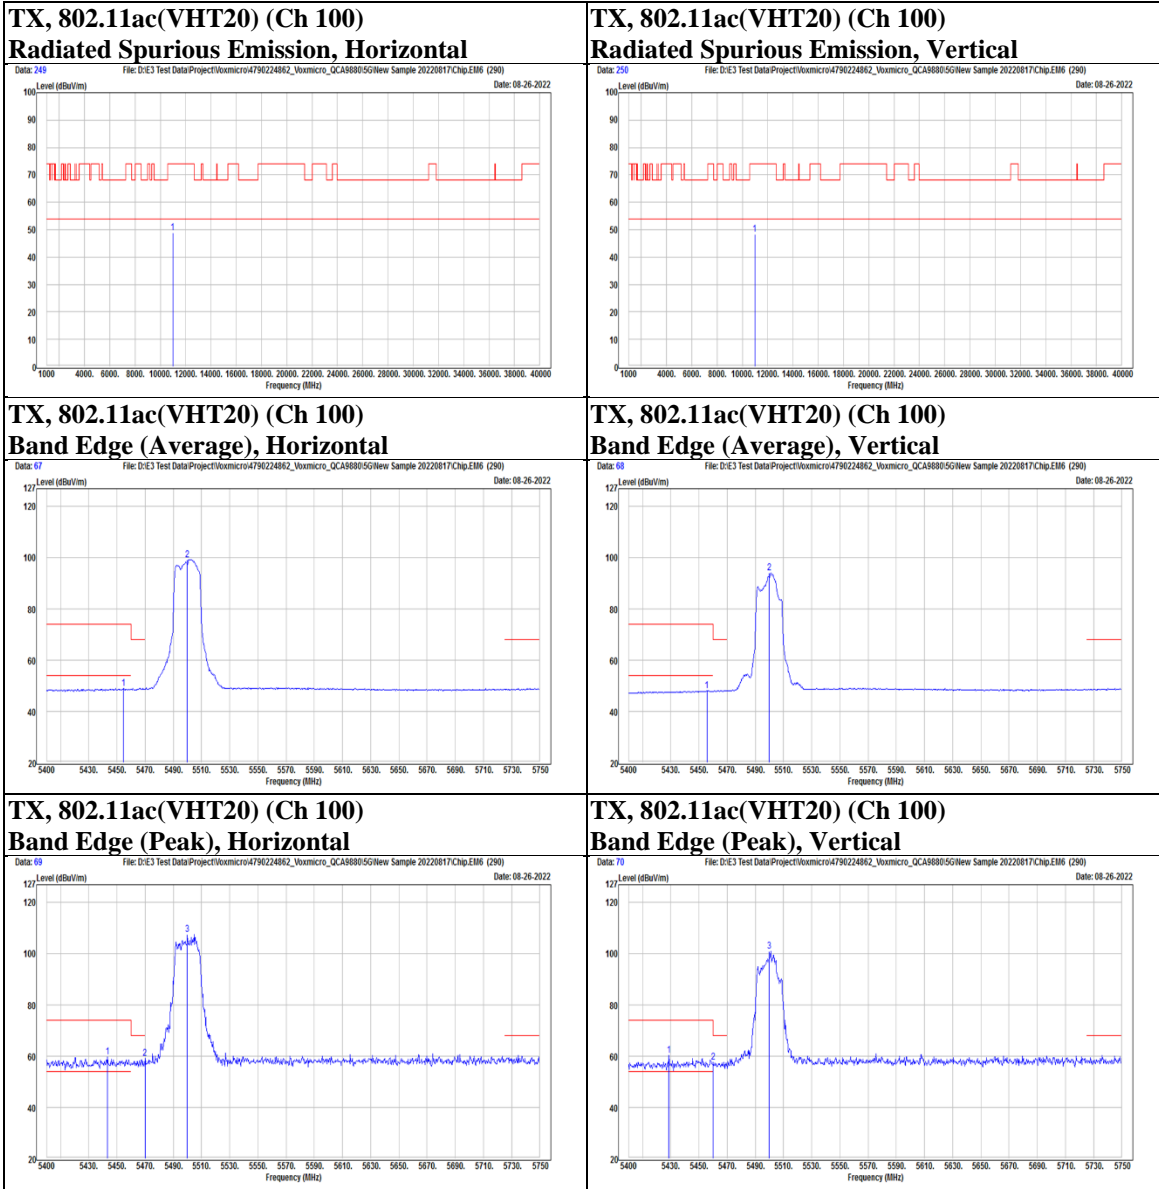



Test report No. : 4790224862-US-R1-V0
Page : 146 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5453.2	30.22	19.53	49.75	54	-4.25	AVG
		5456.35	40.35	19.55	59.9	74	-14.1	PK
		5461.95	40.43	19.58	60.01	68.2	-8.19	PK
	@	5580	87.28	19.76	107.04	N/A	N/A	PK
	@	5580	77.99	19.76	97.75	N/A	N/A	AVG
		5738.8	40.27	20.09	60.36	68.2	-7.84	PK
	*	11160	30.91	18.47	49.38	74	-24.62	PK
Vertical		5439.9	28.81	19.47	48.28	54	-5.72	AVG
		5443.05	40.46	19.49	59.95	74	-14.05	PK
		5467.9	39.19	19.61	58.8	68.2	-9.4	PK
	@	5580	79.05	19.76	98.81	N/A	N/A	PK
	@	5580	70.52	19.76	90.28	N/A	N/A	AVG
		5748.25	40.34	20.19	60.53	68.2	-7.67	PK
	*	11160	29.9	18.47	48.37	74	-25.63	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

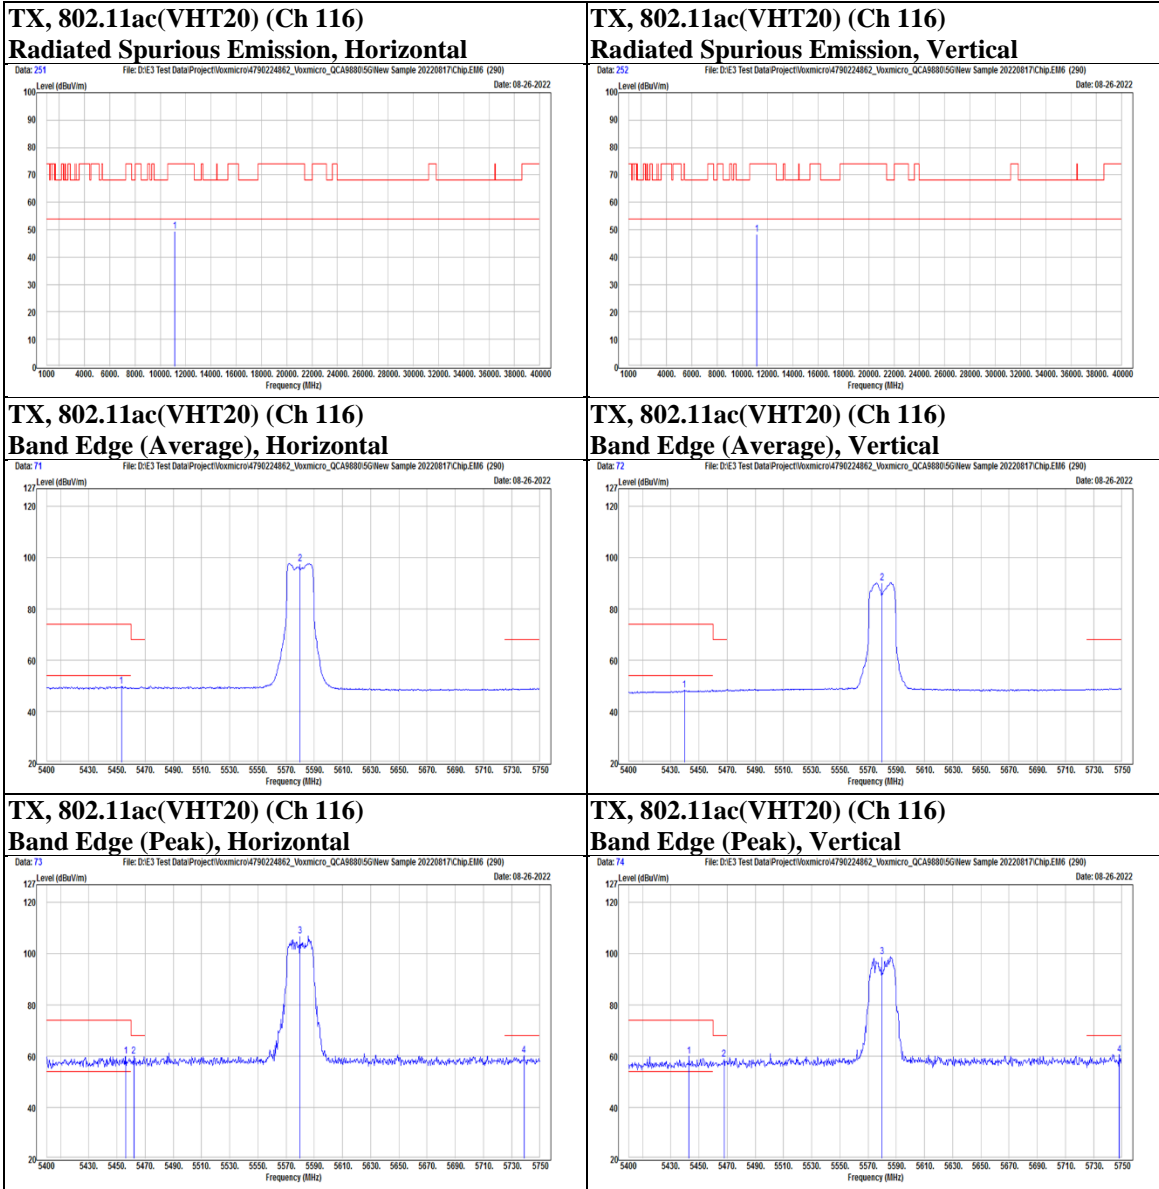



Test report No. : 4790224862-US-R1-V0
Page : 148 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5456.7	29.49	19.55	49.04	54	-4.96	AVG
	@	5700	81.51	19.73	101.24	N/A	N/A	PK
	@	5700	70.99	19.73	90.72	N/A	N/A	AVG
	*	5745.1	39.82	20.15	59.97	68.2	-8.23	PK
Vertical		11400	30.68	18.85	49.53	74	-24.47	PK
		5458.8	28.53	19.57	48.1	54	-5.9	AVG
	@	5700	73.65	19.73	93.38	N/A	N/A	PK
	@	5700	64.33	19.73	84.06	N/A	N/A	AVG
	*	5731.8	39.98	20.02	60	68.2	-8.2	PK
	11400	29.89	18.85	48.74	74	-25.26	PK	


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0

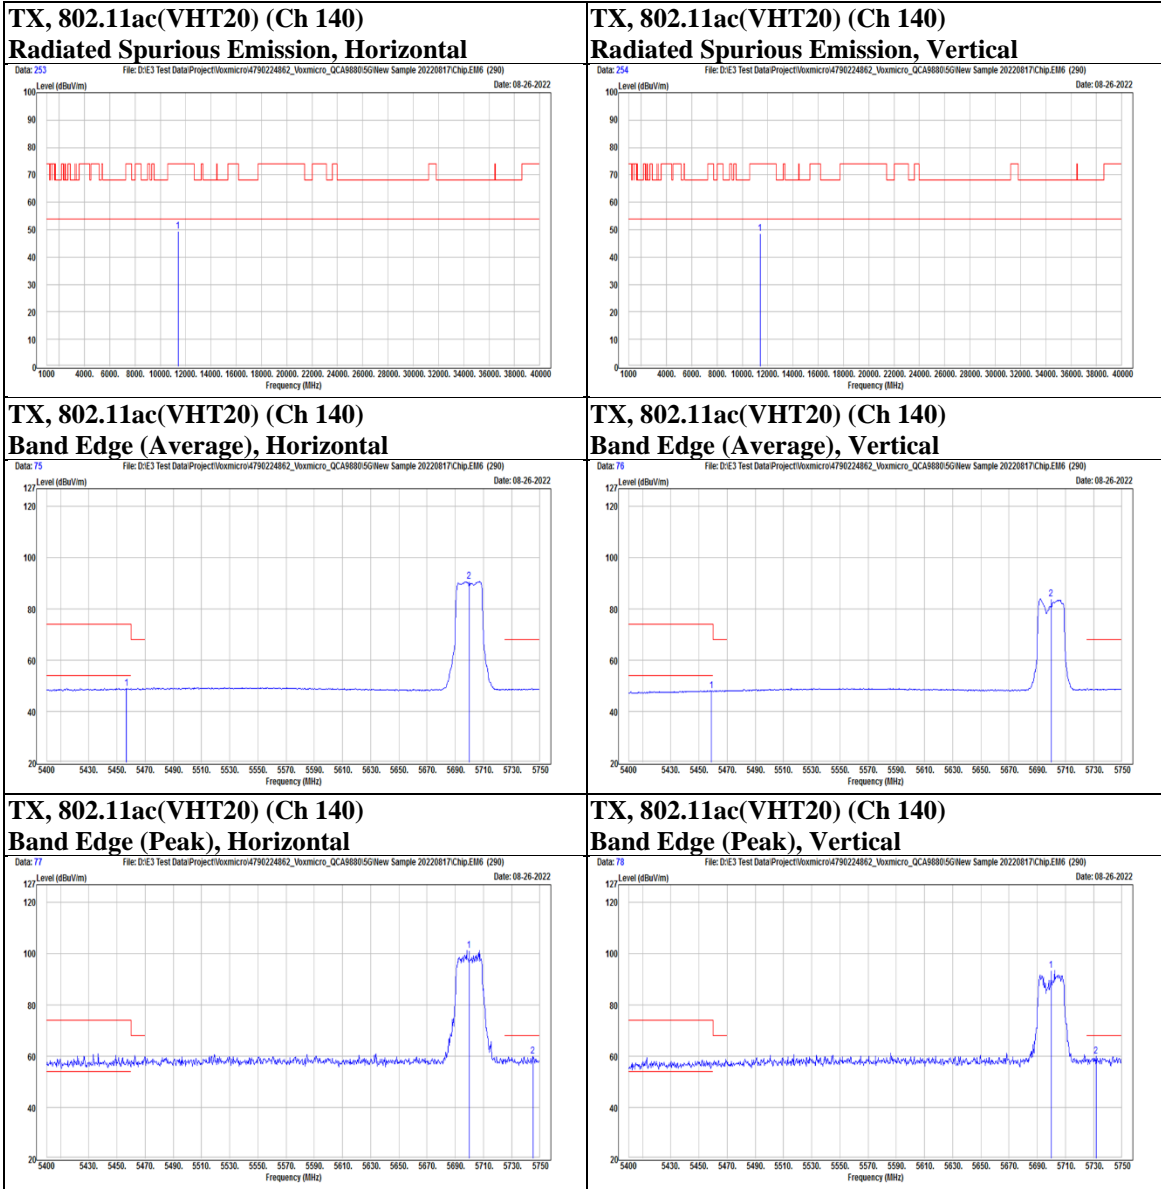



Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5557.5	44.08	19.81	63.89	68.2	-4.31	PK
		5700	40.66	19.73	60.39	105.2	-44.81	PK
	@	5745	89.68	20.15	109.83	N/A	N/A	PK
	*	11490	29.5	19.33	48.83	74	-25.17	PK
Vertical		5561.5	40.8	19.8	60.6	68.2	-7.6	PK
		5677	39.9	19.7	59.6	88.22	-28.62	PK
	@	5745	84.01	20.15	104.16	N/A	N/A	PK
	*	11490	29.31	19.33	48.64	74	-25.36	PK

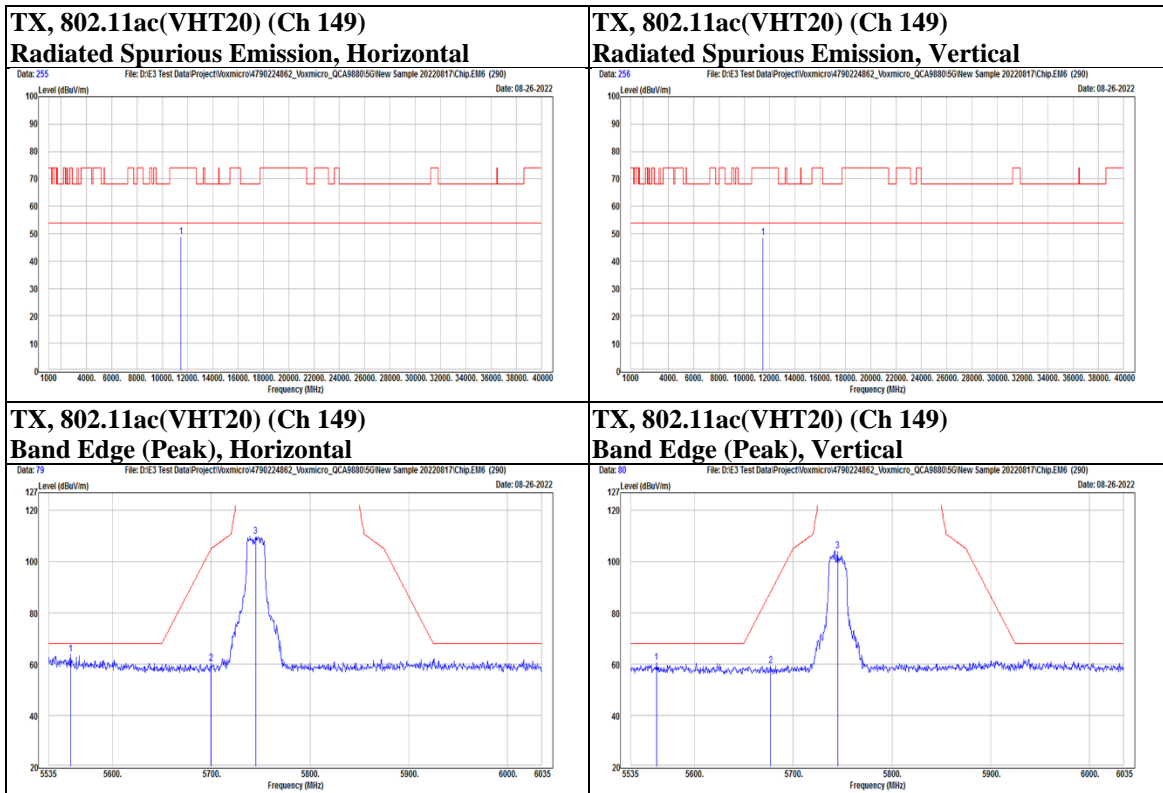

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5543	42.93	19.82	62.75	68.2	-5.45	PK
		5687	40.84	19.71	60.55	95.61	-35.06	PK
		5785	88.36	20.45	108.81	N/A	N/A	PK
		5876.5	40.21	20.81	61.02	104.09	-43.07	PK
		5934.5	40.19	20.95	61.14	68.2	-7.06	PK
		* 11570	30.2	19.07	49.27	74	-24.73	PK
Vertical	@	5601.5	40.6	19.71	60.31	68.2	-7.89	PK
		5652.5	40.71	19.67	60.38	70.06	-9.68	PK
		5785	81.65	20.45	102.1	N/A	N/A	PK
		5902	40.22	20.98	61.2	85.18	-23.98	PK
		5929	40.57	20.95	61.52	68.2	-6.68	PK
		* 11570	29.48	19.07	48.55	74	-25.45	PK

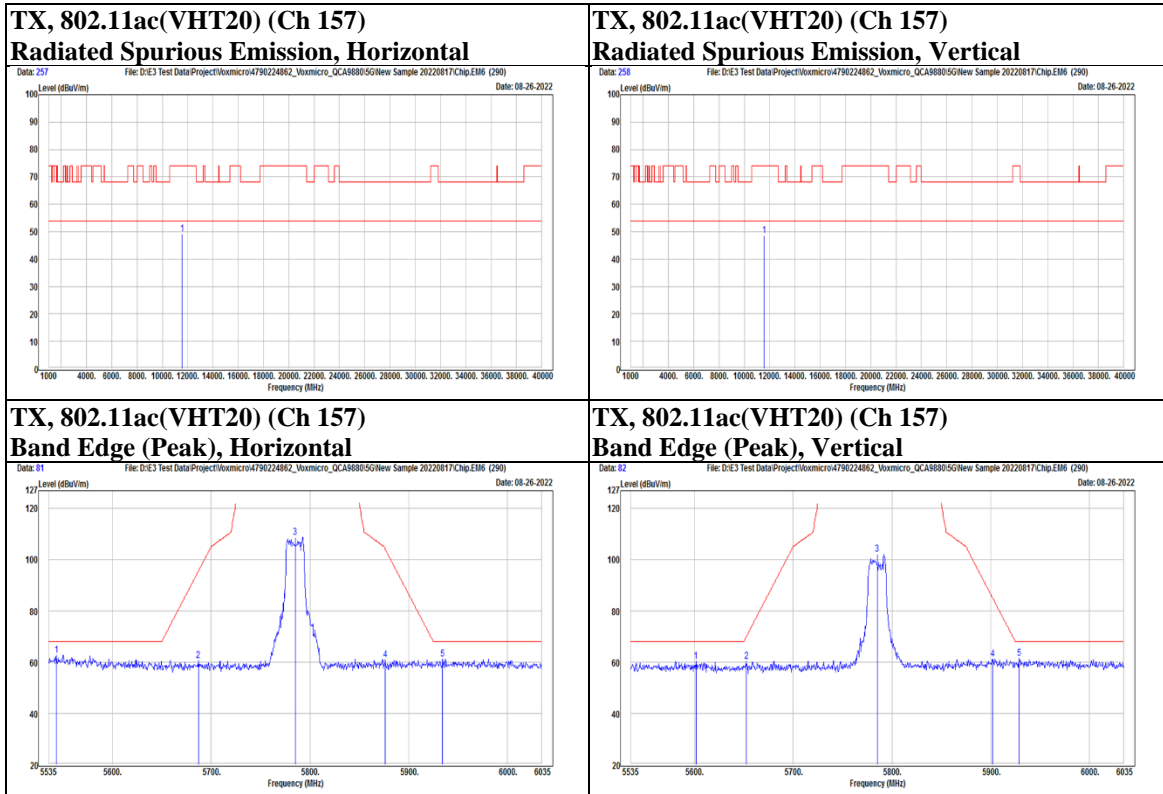

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	84.89	20.58	105.47	N/A	N/A	PK
		5895	41.68	20.94	62.62	90.36	-27.74	PK
		5932.5	40.89	20.96	61.85	68.2	-6.35	PK
	*	11650	30.07	18.83	48.9	74	-25.1	PK
Vertical	@	5825	78.02	20.58	98.6	N/A	N/A	PK
		5881	41.09	20.85	61.94	100.74	-38.8	PK
		5975.5	40.97	20.97	61.94	68.2	-6.26	PK
	*	11650	29.19	18.83	48.02	74	-25.98	PK

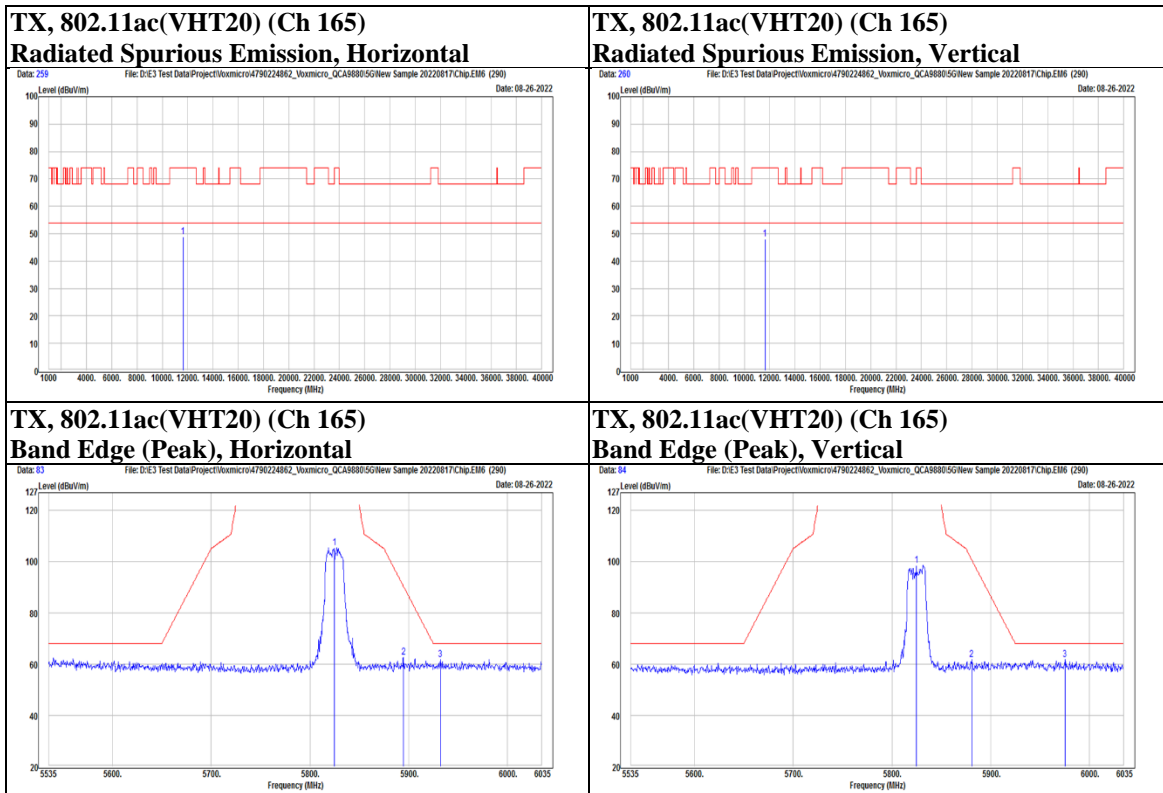

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 153 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5099.05	30.59	19.43	50.02	54	-3.98	AVG
		5114.8	41.88	19.43	61.31	74	-12.69	PK
	@	5190	83.49	19.29	102.78	N/A	N/A	PK
	@	5190	73.79	19.29	93.08	N/A	N/A	AVG
	*	10380	29.43	17.61	47.04	68.2	-21.16	PK
Vertical		5091.35	30.68	19.38	50.06	54	-3.94	AVG
		5115.15	43.05	19.43	62.48	74	-11.52	PK
	@	5190	72.66	19.29	91.95	N/A	N/A	PK
	@	5190	63.34	19.29	82.63	N/A	N/A	AVG
	*	10380	29.92	17.61	47.53	68.2	-20.67	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

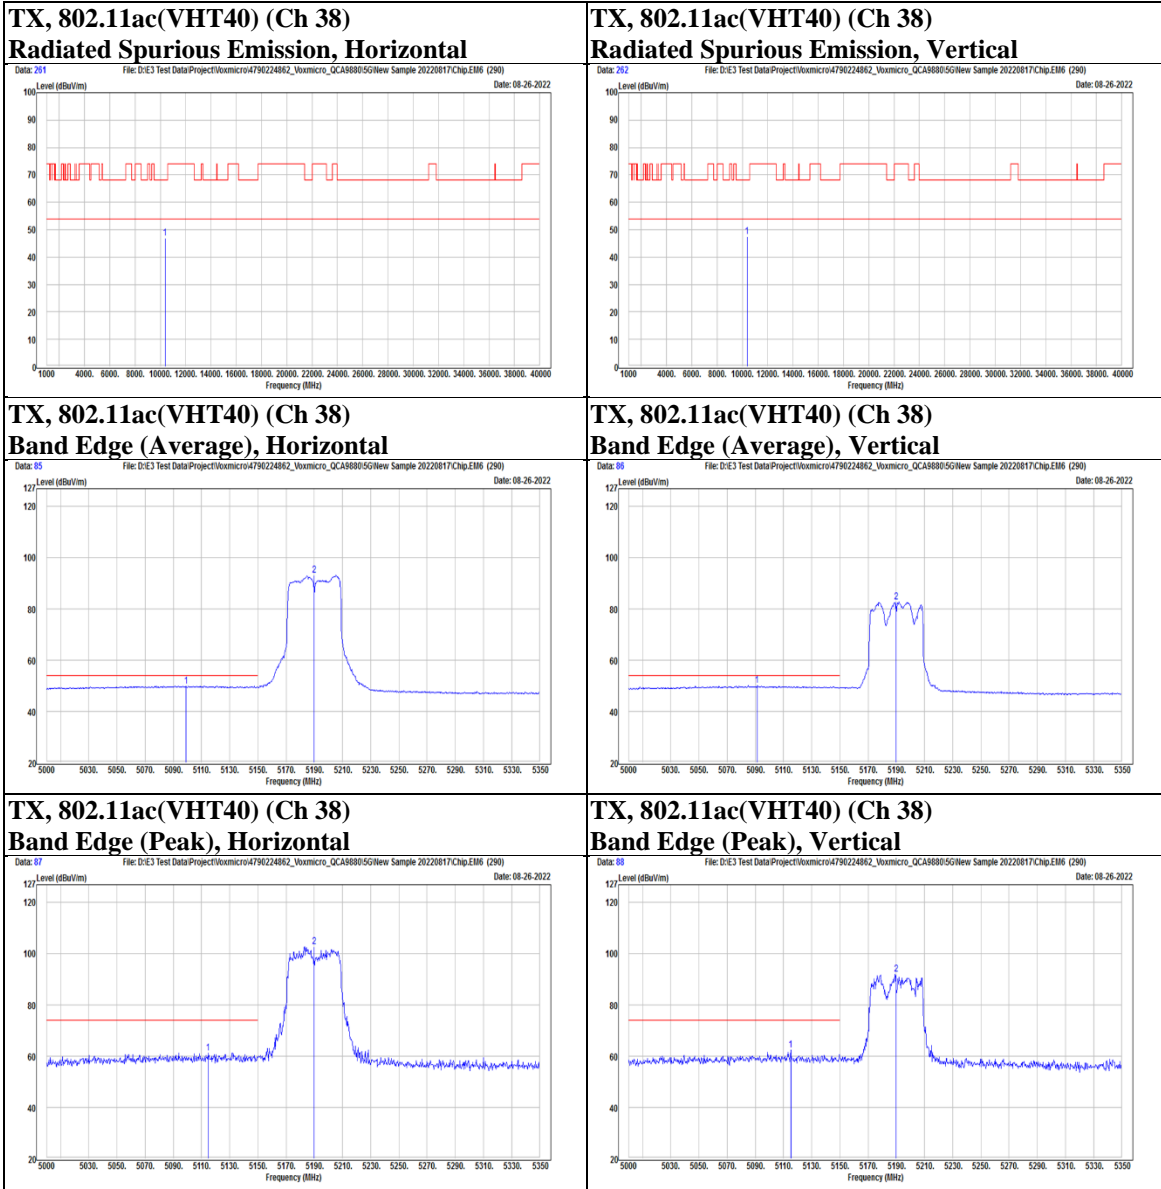

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 155 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5068.6	43.44	19.22	62.66	74	-11.34	PK
		5114.45	30.6	19.43	50.03	54	-3.97	AVG
	@	5230	89.8	19.05	108.85	N/A	N/A	PK
	@	5230	78.74	19.05	97.79	N/A	N/A	AVG
	*	10460	29.47	17.87	47.34	68.2	-20.86	PK
Vertical		5084	42.67	19.33	62	74	-12	PK
		5098	30.75	19.43	50.18	54	-3.82	AVG
	@	5230	80.12	19.05	99.17	N/A	N/A	PK
	@	5230	70.76	19.05	89.81	N/A	N/A	AVG
	*	10460	30.22	17.87	48.09	68.2	-20.11	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

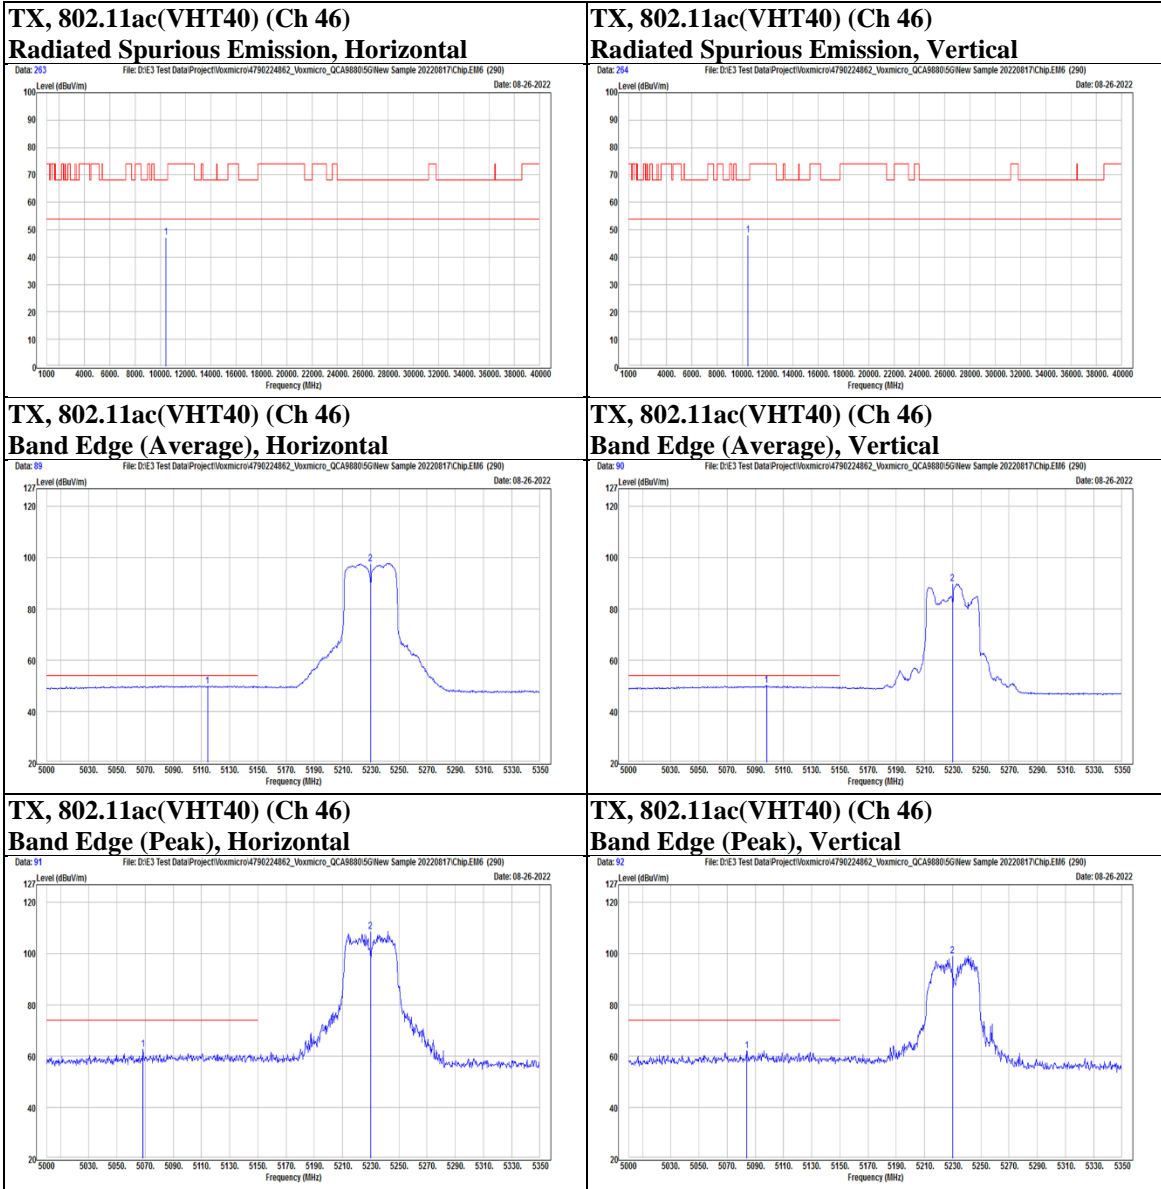

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 157 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	89.4	18.85	108.25	N/A	N/A	PK
	@	5270	78.98	18.85	97.83	N/A	N/A	AVG
		5369.4	40.48	19.12	59.6	74	-14.4	PK
		5448	29.19	19.5	48.69	54	-5.31	AVG
	*	10540	29.61	18.01	47.62	68.2	-20.58	PK
Vertical	@	5270	79.97	18.85	98.82	N/A	N/A	PK
	@	5270	70.11	18.85	88.96	N/A	N/A	AVG
		5442	40.78	19.48	60.26	74	-13.74	PK
		5459.7	28.74	19.57	48.31	54	-5.69	AVG
	*	10540	29.75	18.01	47.76	68.2	-20.44	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

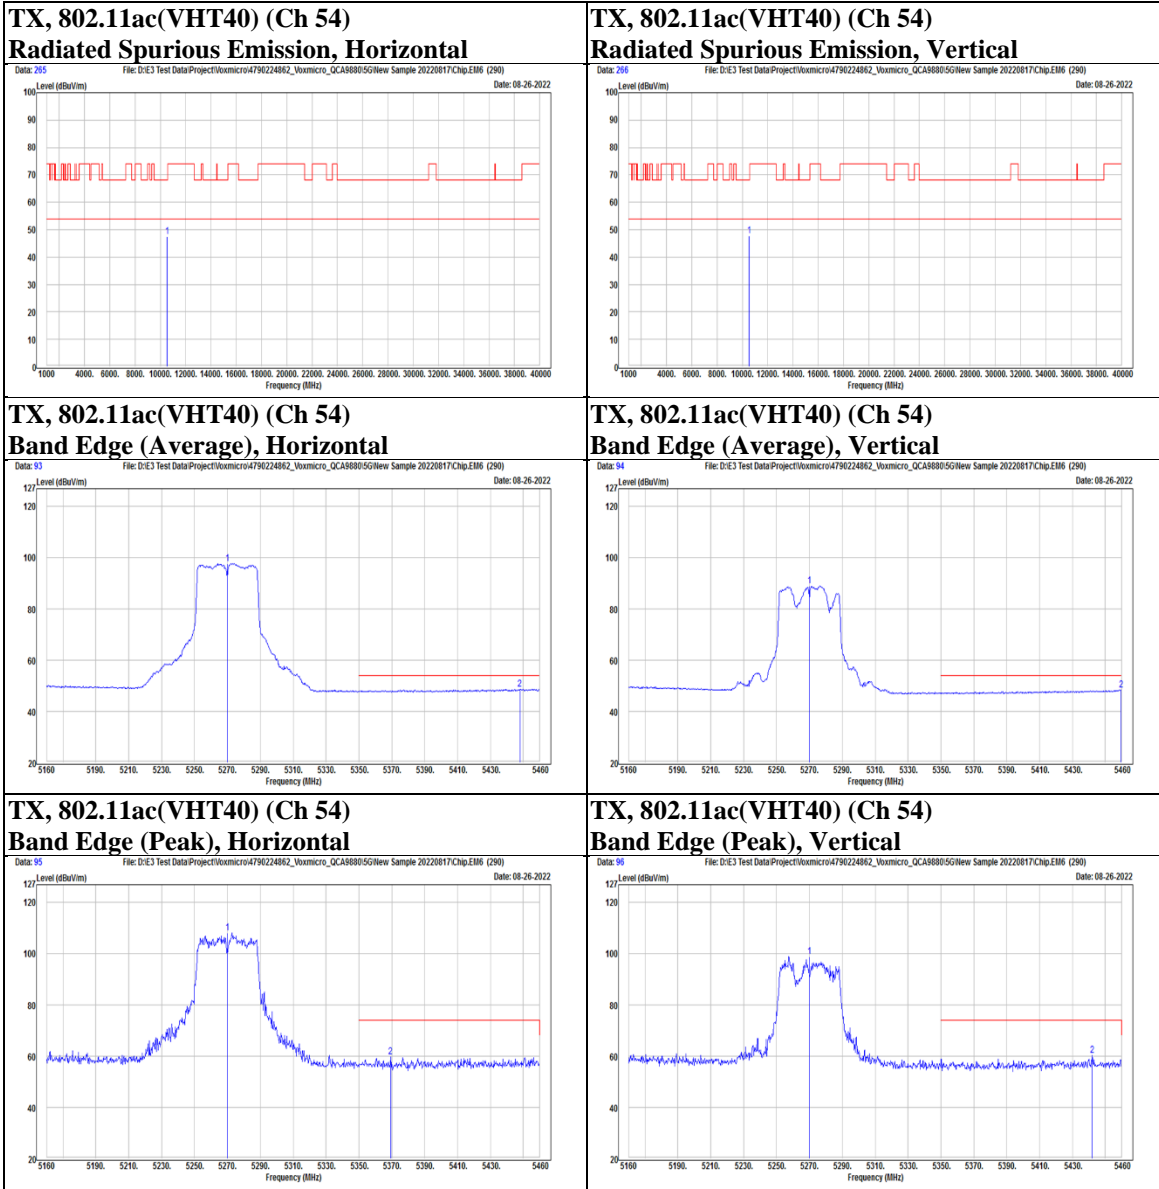

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 159 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	62
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	85.25	18.81	104.06	N/A	N/A	PK
	@	5310	75.18	18.81	93.99	N/A	N/A	AVG
		5350.5	29.49	19.01	48.5	54	-5.5	AVG
		5379.3	40.96	19.16	60.12	74	-13.88	PK
	*	10620	29.3	18.04	47.34	74	-26.66	PK
Vertical	@	5310	75.04	18.81	93.85	N/A	N/A	PK
	@	5310	66.09	18.81	84.9	N/A	N/A	AVG
		5442.9	40.57	19.49	60.06	74	-13.94	PK
		5454	28.62	19.54	48.16	54	-5.84	AVG
	*	10620	29.37	18.04	47.41	74	-26.59	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

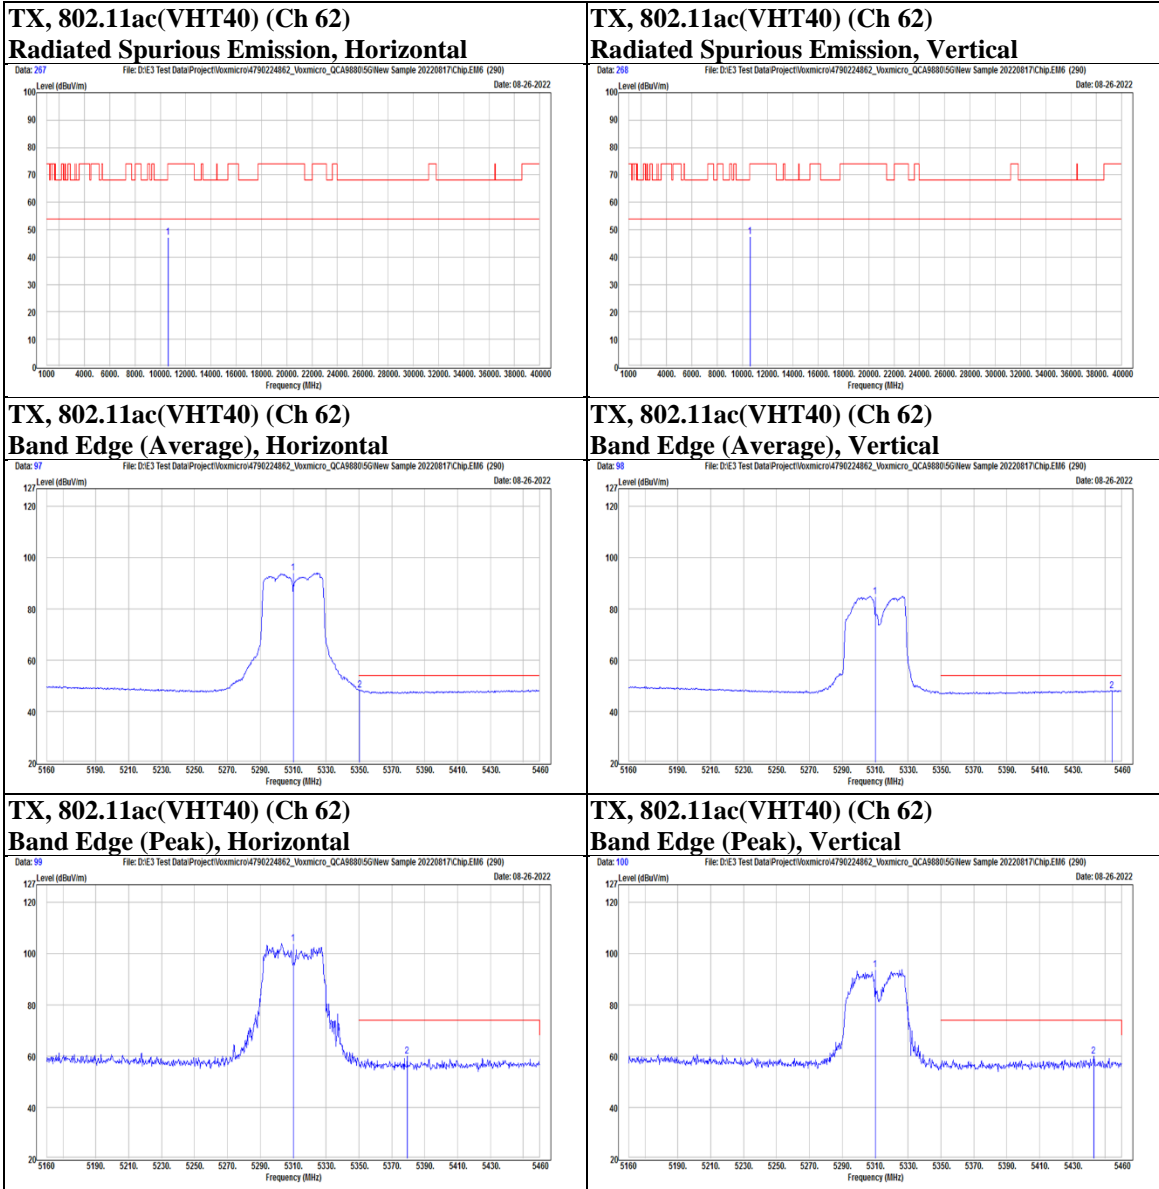

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 161 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5445.85	40.12	19.5	59.62	74	-14.38	PK
		5450.75	29.55	19.52	49.07	54	-4.93	AVG
		5468.95	40.47	19.62	60.09	68.2	-8.11	PK
	@	5510	84.28	19.78	104.06	N/A	N/A	PK
	@	5510	74.49	19.78	94.27	N/A	N/A	AVG
	*	11020	30.95	18.42	49.37	74	-24.63	PK
Vertical		5450.05	41.69	19.51	61.2	74	-12.8	PK
		5457.05	28.75	19.55	48.3	54	-5.7	AVG
		5464.75	38.86	19.59	58.45	68.2	-9.75	PK
	@	5510	77.82	19.78	97.6	N/A	N/A	PK
	@	5510	68.51	19.78	88.29	N/A	N/A	AVG
	*	11020	29.67	18.42	48.09	74	-25.91	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

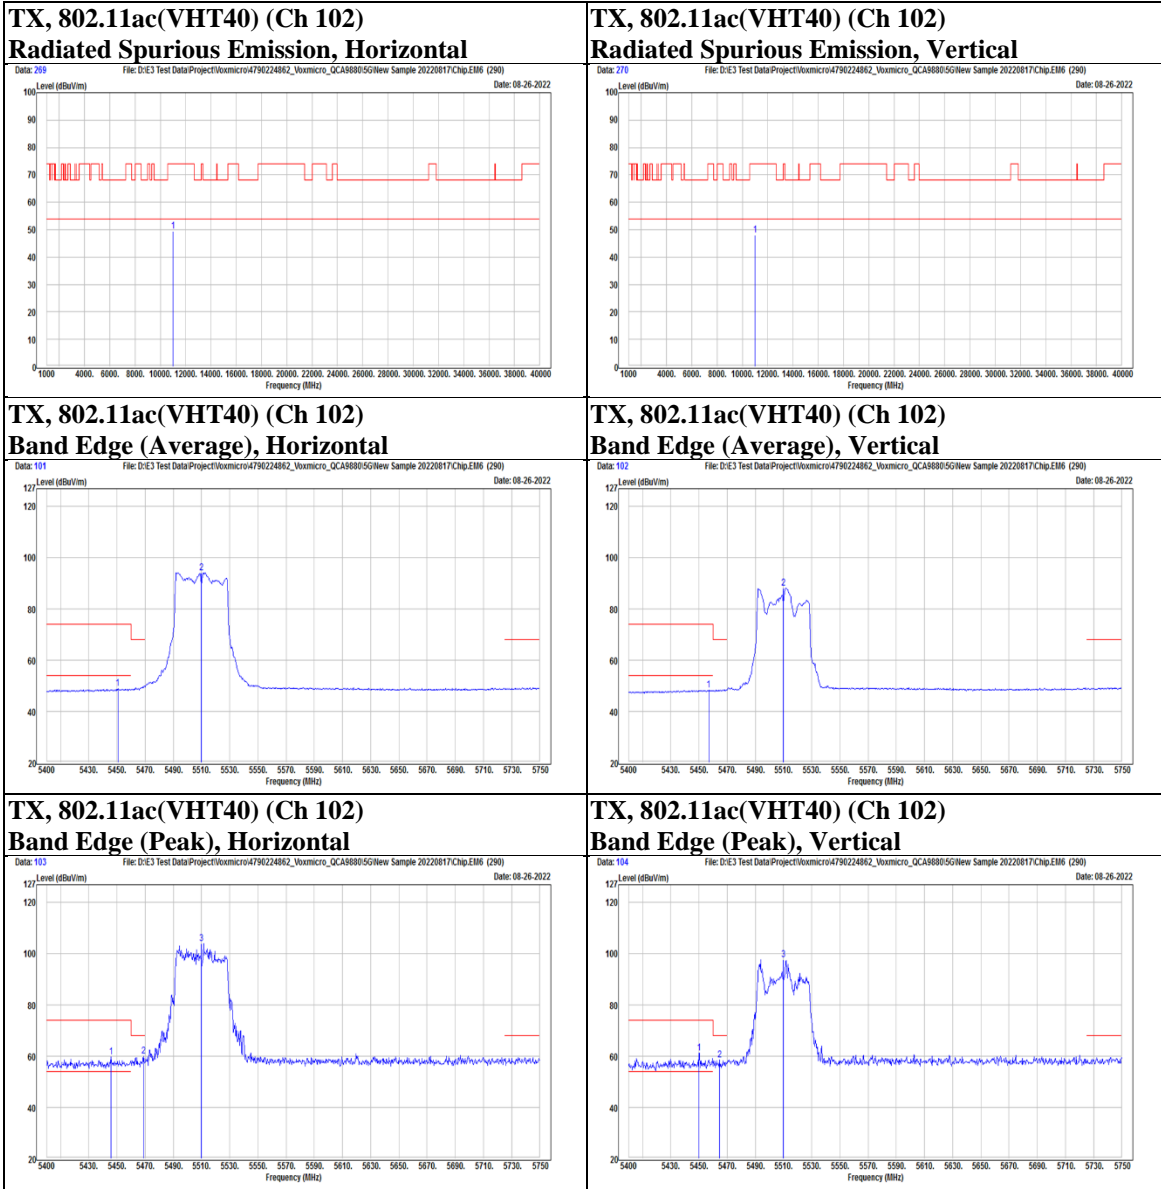

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 163 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	110
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5453.55	29.32	19.53	48.85	54	-5.15	AVG
		5456	40.24	19.54	59.78	74	-14.22	PK
		5462.3	40.39	19.58	59.97	68.2	-8.23	PK
	@	5550	83.9	19.83	103.73	N/A	N/A	PK
	@	5550	75.03	19.83	94.86	N/A	N/A	AVG
		5744.05	40.39	20.14	60.53	68.2	-7.67	PK
	*	11100	29.94	18.45	48.39	74	-25.61	PK
Vertical		5451.45	28.72	19.53	48.25	54	-5.75	AVG
		5453.2	39.56	19.53	59.09	74	-14.91	PK
		5469.65	38.53	19.62	58.15	68.2	-10.05	PK
	@	5550	76.67	19.83	96.5	N/A	N/A	PK
	@	5550	67.62	19.83	87.45	N/A	N/A	AVG
		5733.55	40.86	20.04	60.9	68.2	-7.3	PK
	*	11100	30.41	18.45	48.86	74	-25.14	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0