




Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5536	45.23	19.81	65.04	68.2	-3.16	PK
		5679.5	40.94	19.7	60.64	90.07	-29.43	PK
		5745	91.96	20.15	112.11	N/A	N/A	PK
		7660	41.43	10.75	52.18	74	-21.82	PK
		11490	29.5	19.33	48.83	74	-25.17	PK
Vertical	@	5588.5	41.14	19.74	60.88	68.2	-7.32	PK
		5668	40.81	19.69	60.5	81.56	-21.06	PK
		5745	87.35	20.15	107.5	N/A	N/A	PK
		7660	35.49	10.75	46.24	74	-27.76	PK
		11490	29.94	19.33	49.27	74	-24.73	PK

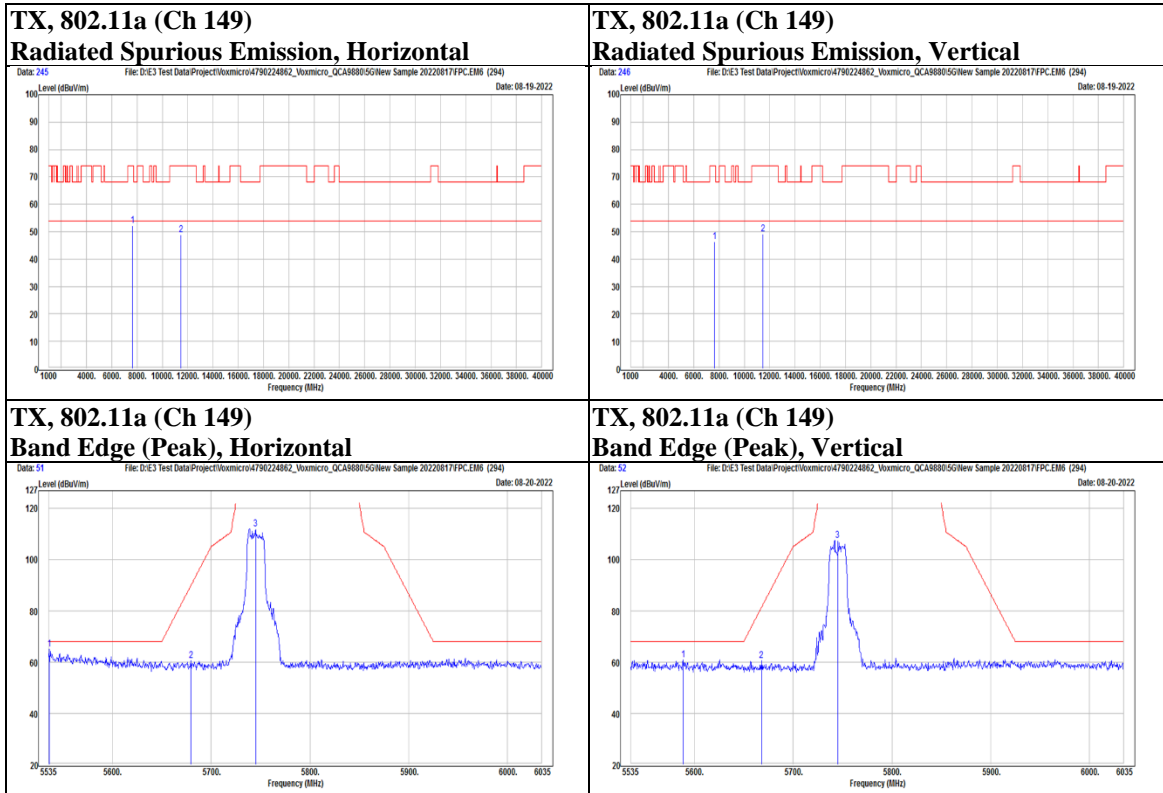

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5549.5	44.66	19.83	64.49	68.2	-3.71	PK
		5681	41.03	19.7	60.73	91.18	-30.45	PK
	@	5785	91.42	20.45	111.87	N/A	N/A	PK
		5875	41.28	20.8	62.08	105.2	-43.12	PK
		5939.5	39.78	20.95	60.73	68.2	-7.47	PK
		7713.3	38.12	10.69	48.81	74	-25.19	PK
Vertical	*	11570	29.23	19.07	48.3	74	-25.7	PK
		5636.5	41.22	19.68	60.9	68.2	-7.3	PK
		5666.5	40.32	19.69	60.01	80.45	-20.44	PK
	@	5785	86.22	20.45	106.67	N/A	N/A	PK
		5911	40.57	20.97	61.54	78.53	-16.99	PK
		5988	41.16	20.98	62.14	68.2	-6.06	PK
		7713.3	33.4	10.69	44.09	74	-29.91	PK
	* 11570	29.56	19.07	48.63	74	-25.37	PK	

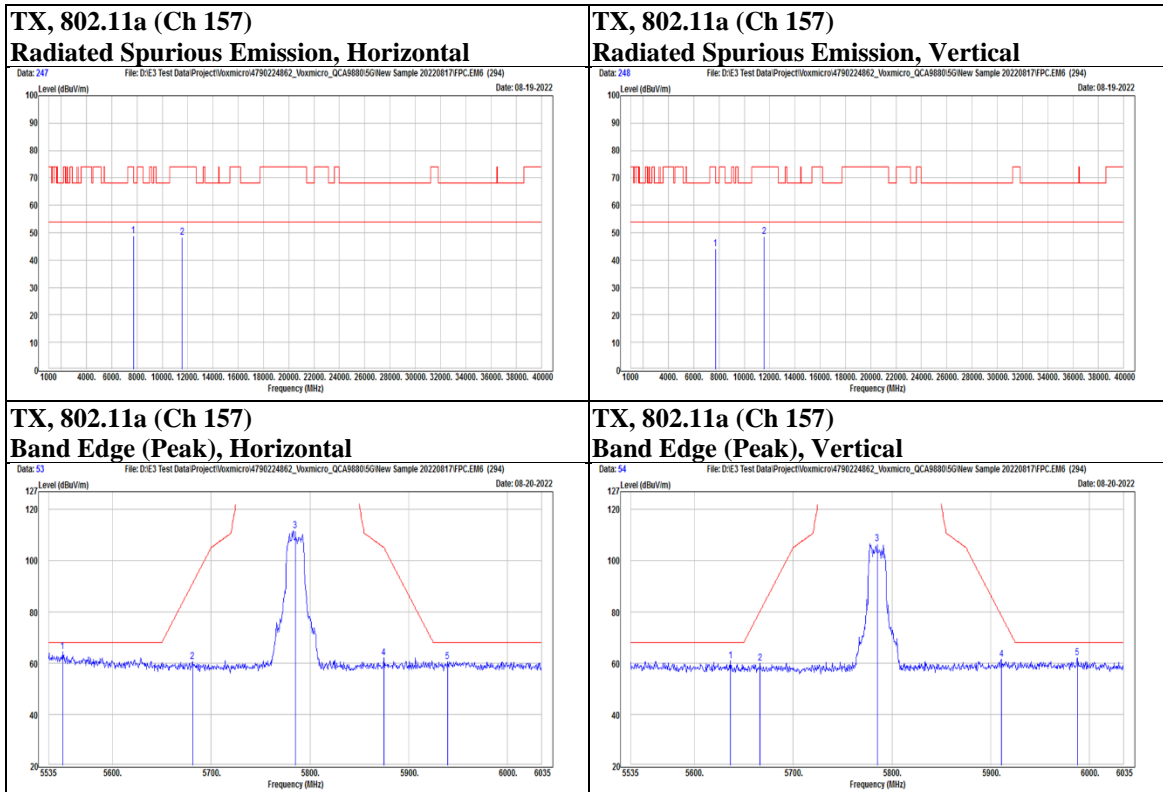

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5537.5	44.1	19.81	63.91	68.2	-4.29	PK
		5663	42.27	19.68	61.95	77.85	-15.9	PK
	@	5825	88.59	20.58	109.17	N/A	N/A	PK
		5894	40.58	20.93	61.51	91.1	-29.59	PK
		5949	40.57	20.94	61.51	68.2	-6.69	PK
		7766.7	38.21	10.9	49.11	68.2	-19.09	PK
	*	11650	29.61	18.83	48.44	74	-25.56	PK
Vertical		5552.5	41.12	19.83	60.95	68.2	-7.25	PK
		5674	39.79	19.7	59.49	86	-26.51	PK
	@	5825	82.08	20.58	102.66	N/A	N/A	PK
		5911.5	39.91	20.97	60.88	78.16	-17.28	PK
		5952	40.9	20.95	61.85	68.2	-6.35	PK
		7766.7	32.85	10.9	43.75	68.2	-24.45	PK
	*	11650	30.26	18.83	49.09	74	-24.91	PK

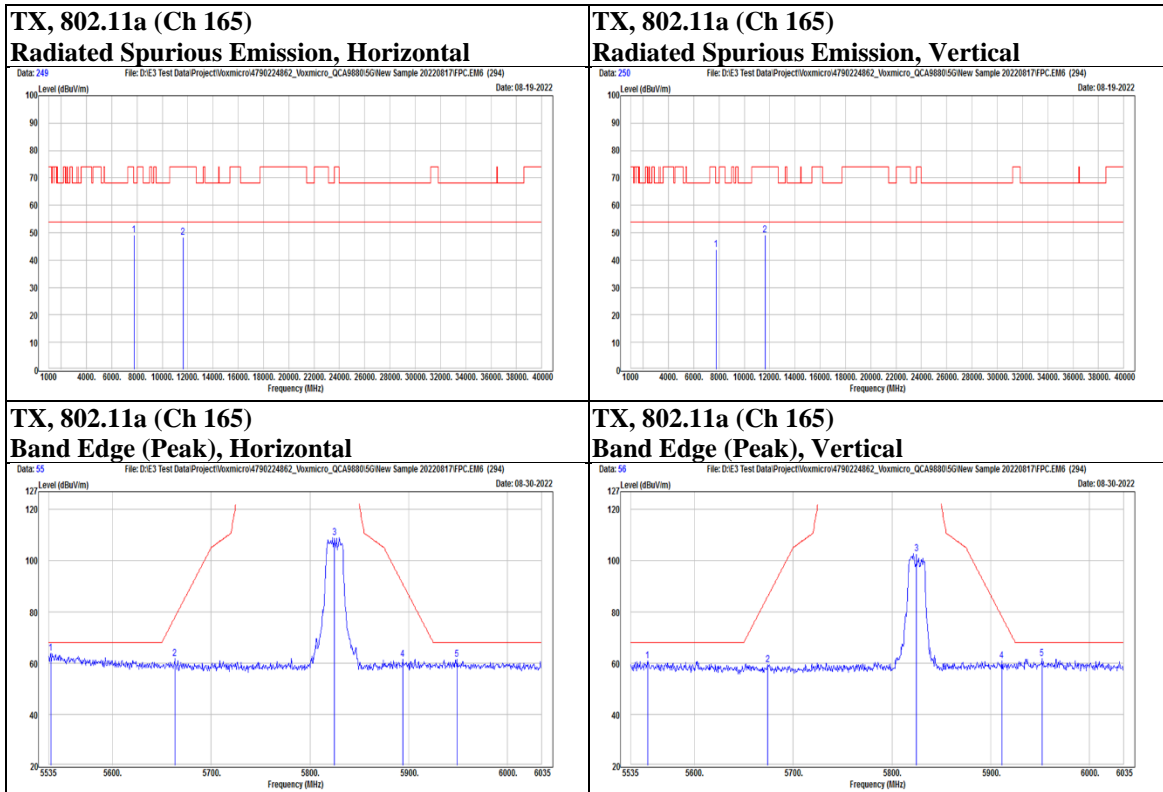

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 200 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5086.1	30.82	19.35	50.17	54	-3.83	AVG
		5149.1	42.18	19.4	61.58	74	-12.42	PK
	@	5180	86.85	19.31	106.16	N/A	N/A	PK
	@	5180	78.68	19.31	97.99	N/A	N/A	AVG
		6906.7	56.43	8.36	64.79	68.2	-3.41	PK
	*	10360	29.54	17.51	47.05	68.2	-21.15	PK
Vertical		5026.25	42.3	18.87	61.17	74	-12.83	PK
		5117.25	30.49	19.44	49.93	54	-4.07	AVG
	@	5180	81.84	19.31	101.15	N/A	N/A	PK
	@	5180	74.1	19.31	93.41	N/A	N/A	AVG
		6906.7	50.29	8.36	58.65	68.2	-9.55	PK
	*	10360	30.11	17.51	47.62	68.2	-20.58	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

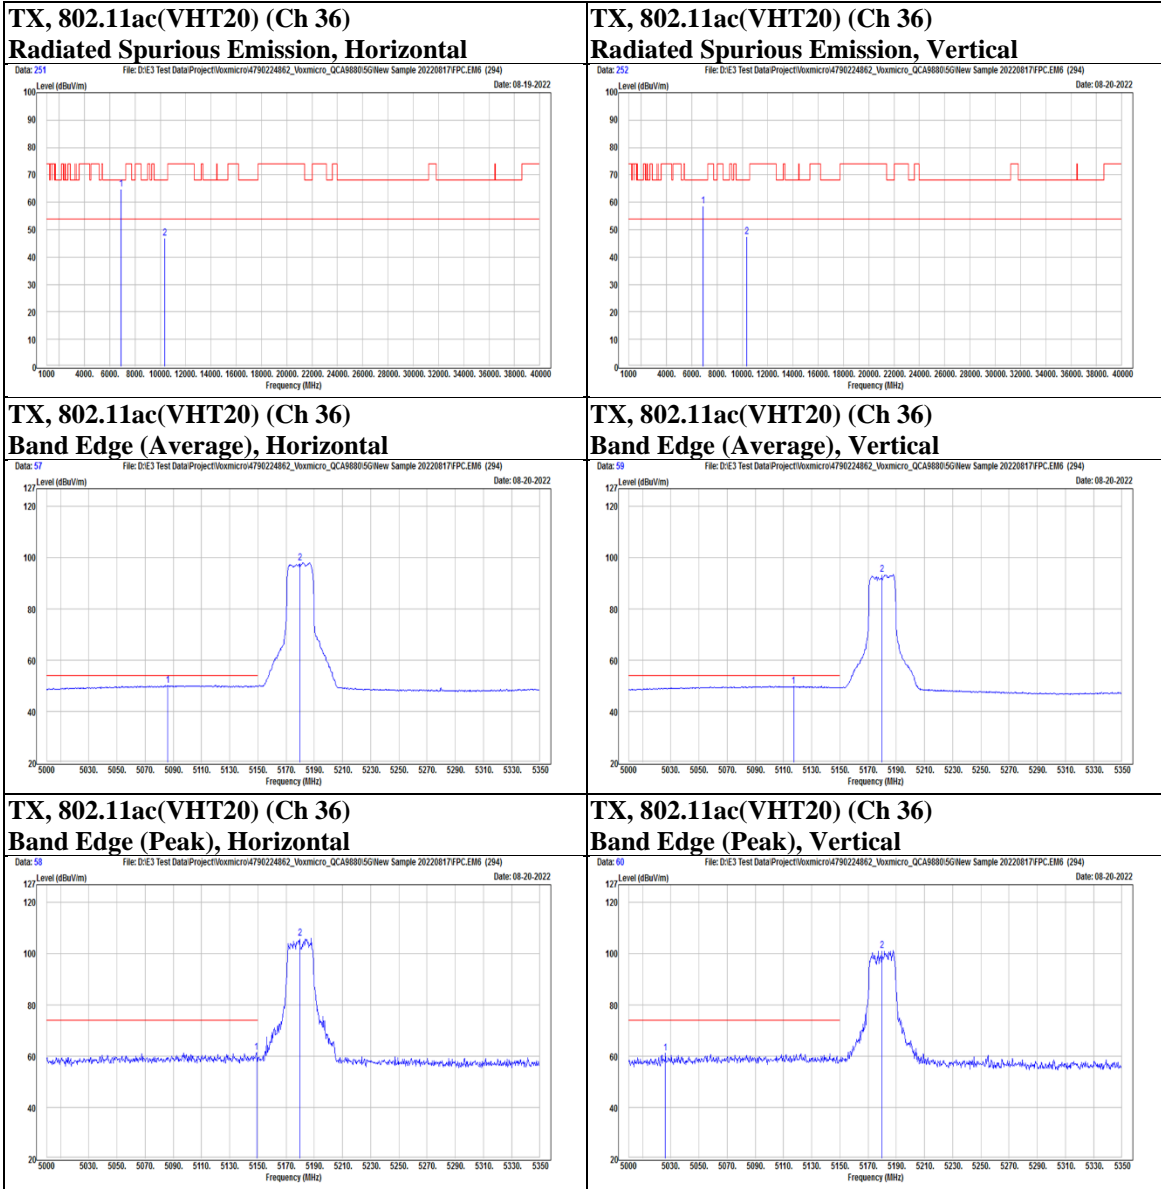

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 202 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5100.8	30.69	19.44	50.13	54	-3.87	AVG
		5103.95	42.14	19.44	61.58	74	-12.42	PK
	@	5220	88.32	19.12	107.44	N/A	N/A	PK
	@	5220	79.77	19.12	98.89	N/A	N/A	AVG
		6960	56.19	8.61	64.8	68.2	-3.4	PK
	*	10440	30.43	17.81	48.24	68.2	-19.96	PK
Vertical		5108.85	30.39	19.43	49.82	54	-4.18	AVG
		5117.95	41.65	19.43	61.08	74	-12.92	PK
	@	5220	84.96	19.12	104.08	N/A	N/A	PK
	@	5220	77.62	19.12	96.74	N/A	N/A	AVG
		6960	45.17	8.61	53.78	68.2	-14.42	PK
	*	10440	30.66	17.81	48.47	68.2	-19.73	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

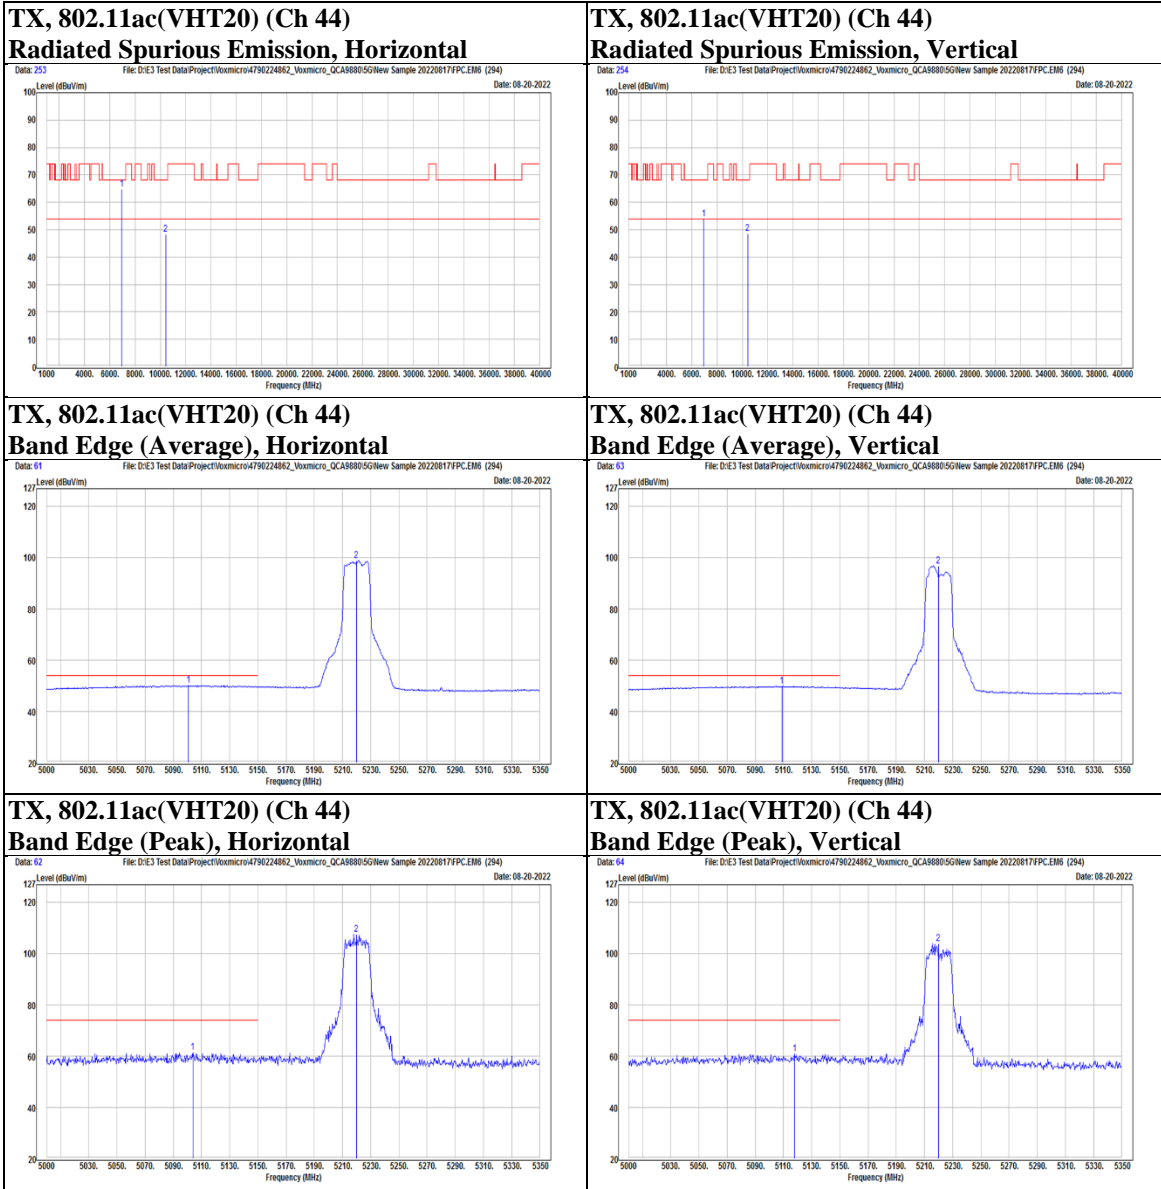

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 204 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5100.8	30.76	19.44	50.2	54	-3.8	AVG
		5146.65	42.12	19.41	61.53	74	-12.47	PK
	@	5240	88.98	18.97	107.95	N/A	N/A	PK
	@	5240	79.87	18.97	98.84	N/A	N/A	AVG
		6986.7	53.75	8.69	62.44	68.2	-5.76	PK
	*	10480	30.95	17.92	48.87	68.2	-19.33	PK
Vertical		5115.5	30.4	19.43	49.83	54	-4.17	AVG
		5125.65	41.6	19.42	61.02	74	-12.98	PK
	@	5240	86.35	18.97	105.32	N/A	N/A	PK
	@	5240	77.27	18.97	96.24	N/A	N/A	AVG
		6986.7	43.22	8.69	51.91	68.2	-16.29	PK
	*	10480	30.75	17.92	48.67	68.2	-19.53	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

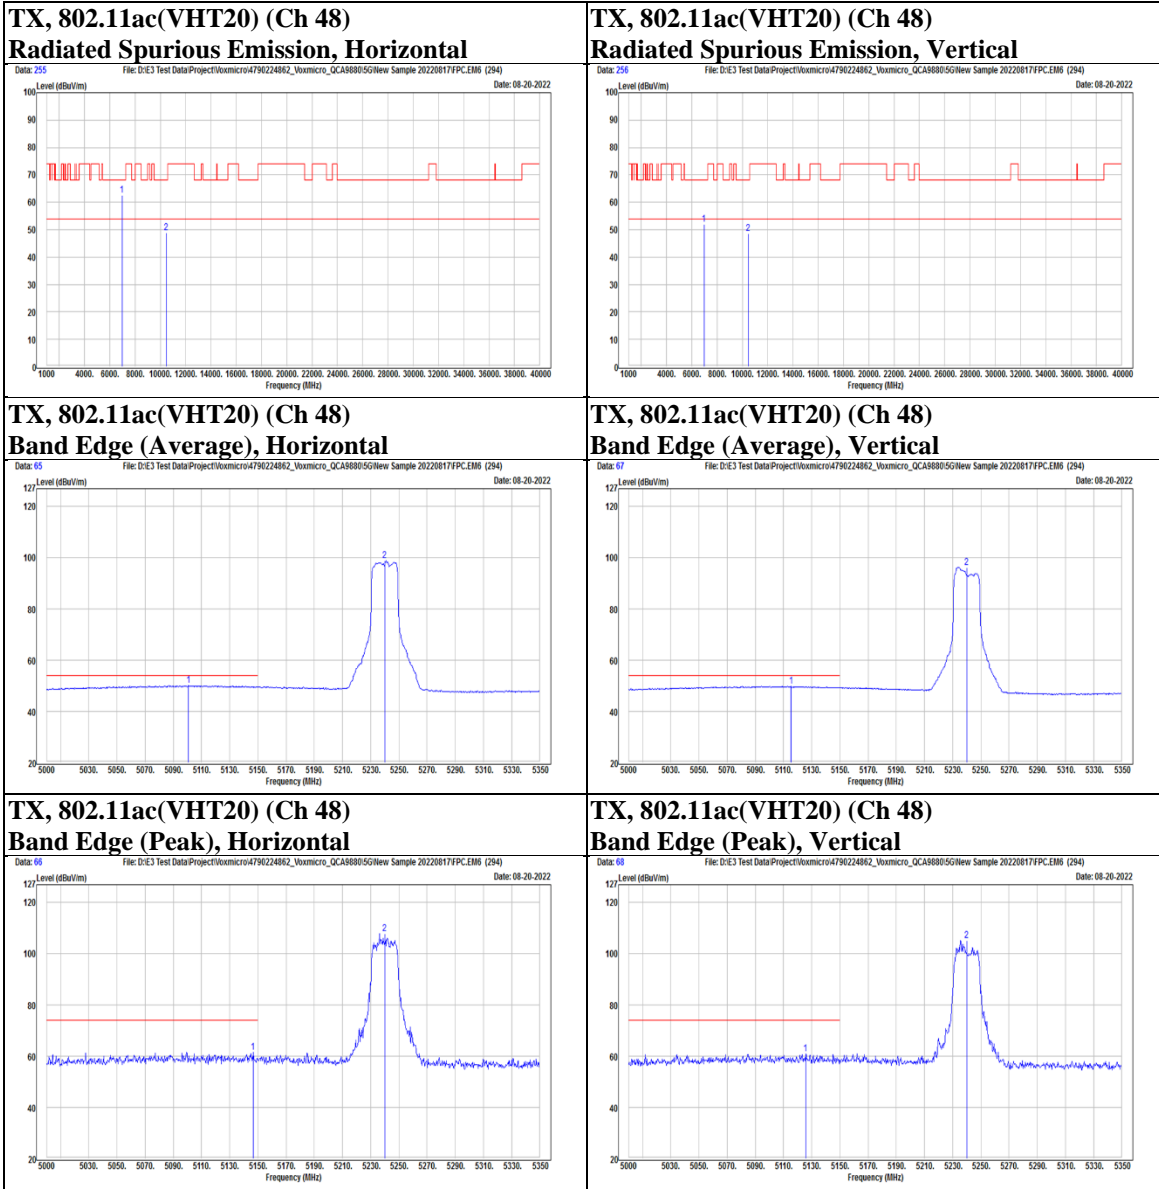

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 206 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	88.26	18.88	107.14	N/A	N/A	PK
	@	5260	81.18	18.88	100.06	N/A	N/A	AVG
		5419.2	39.94	19.36	59.3	74	-14.7	PK
		5439.9	29.24	19.47	48.71	54	-5.29	AVG
		7013.3	52.08	8.86	60.94	68.2	-7.26	PK
	*	10520	30.13	17.99	48.12	68.2	-20.08	PK
Vertical	@	5260	86.44	18.88	105.32	N/A	N/A	PK
	@	5260	78.49	18.88	97.37	N/A	N/A	AVG
		5427	39.02	19.4	58.42	74	-15.58	PK
		5457.3	28.54	19.55	48.09	54	-5.91	AVG
		7013.3	44.5	8.86	53.36	68.2	-14.84	PK
	*	10520	30.92	17.99	48.91	68.2	-19.29	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

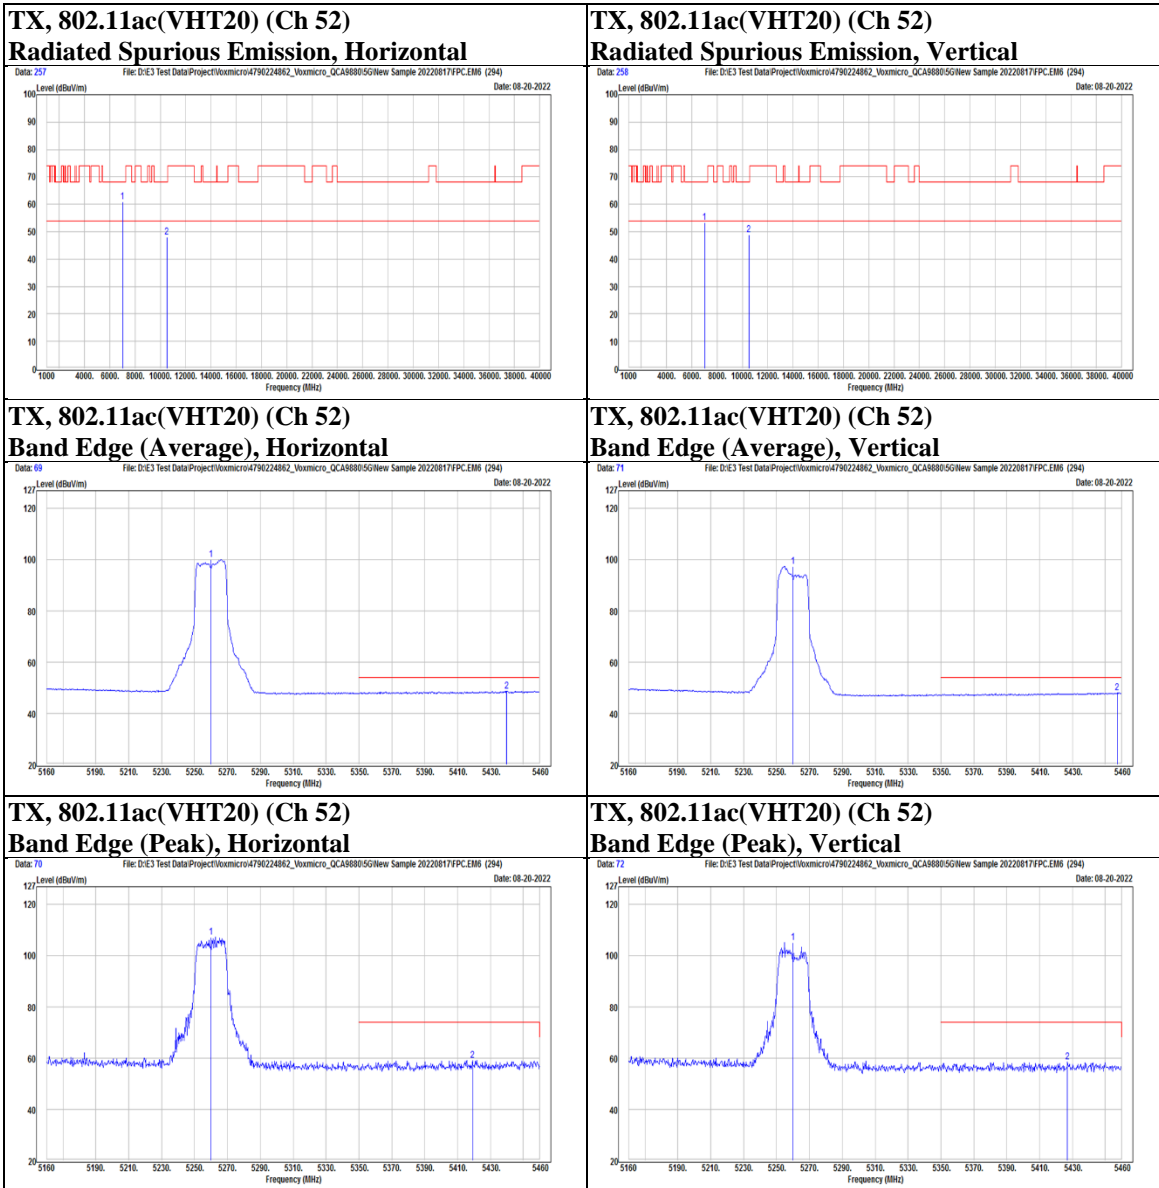

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 208 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	88.71	18.77	107.48	N/A	N/A	PK
	@	5300	81.36	18.77	100.13	N/A	N/A	AVG
		5388.6	40.64	19.2	59.84	74	-14.16	PK
		5457.6	29.48	19.55	49.03	54	-4.97	AVG
		7066.7	49.23	9.33	58.56	68.2	-9.64	PK
	*	10600	31.11	18.04	49.15	68.2	-19.05	PK
Vertical	@	5300	85.02	18.77	103.79	N/A	N/A	PK
	@	5300	77.17	18.77	95.94	N/A	N/A	AVG
		5368.5	39.73	19.11	58.84	74	-15.16	PK
		5439.9	28.56	19.47	48.03	54	-5.97	AVG
		7066.7	43.15	9.33	52.48	68.2	-15.72	PK
	*	10600	30.88	18.04	48.92	68.2	-19.28	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

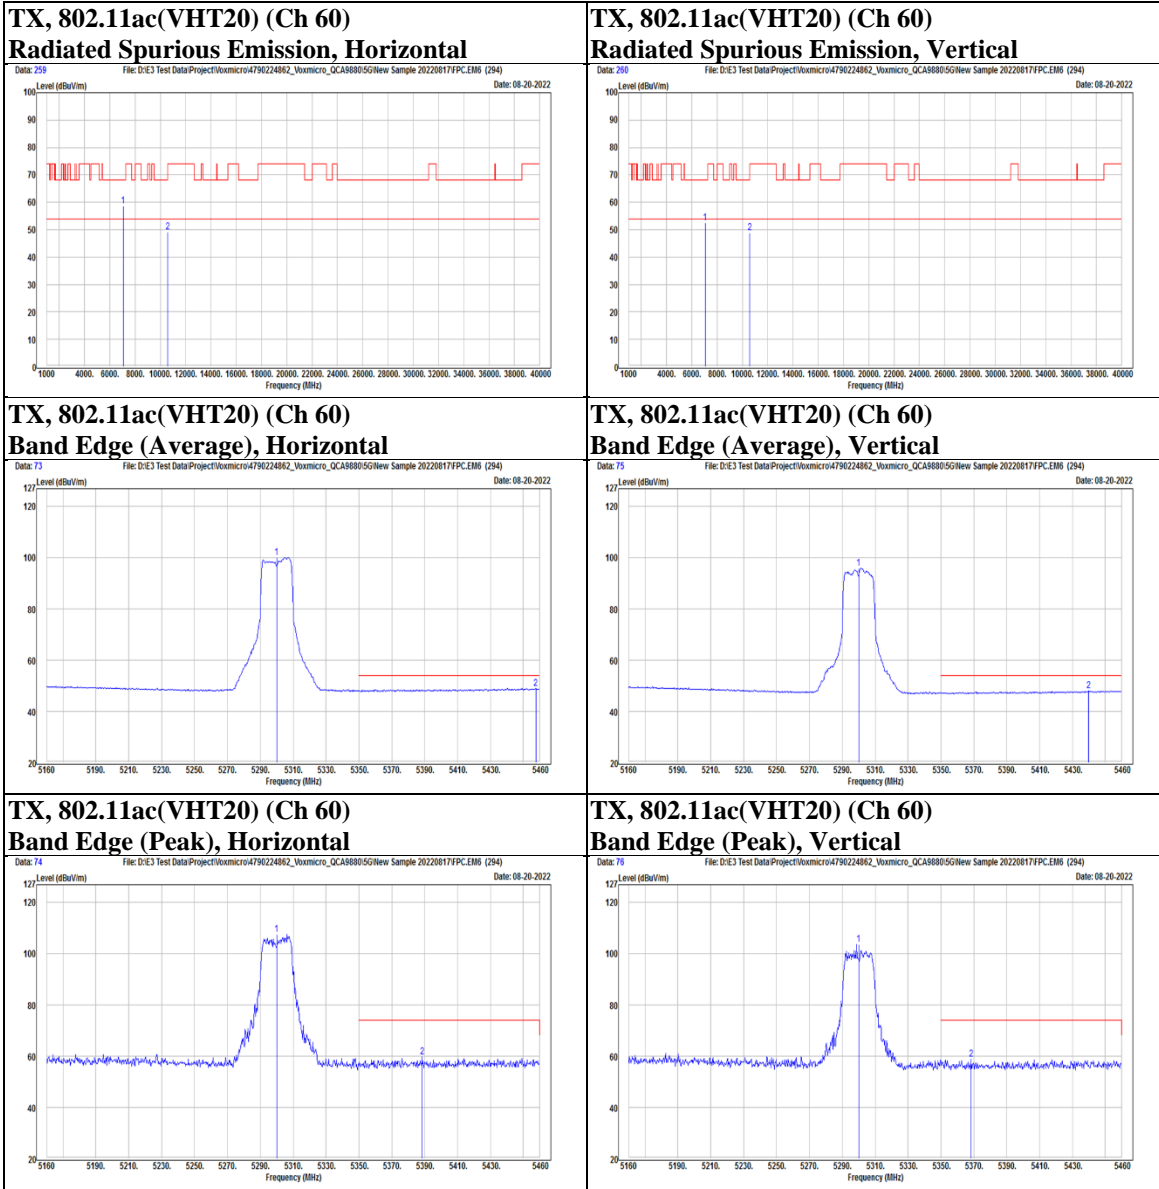

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 210 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	91.01	18.86	109.87	N/A	N/A	PK
	@	5320	82.42	18.86	101.28	N/A	N/A	AVG
		5394.3	40.83	19.24	60.07	74	-13.93	PK
		5439.9	29.37	19.47	48.84	54	-5.16	AVG
		7093.3	47.68	9.53	57.21	68.2	-10.99	PK
	*	10640	30.26	18.03	48.29	74	-25.71	PK
Vertical	@	5320	85.1	18.86	103.96	N/A	N/A	PK
	@	5320	77.15	18.86	96.01	N/A	N/A	AVG
		5428.5	39.71	19.41	59.12	74	-14.88	PK
		5459.7	28.45	19.57	48.02	54	-5.98	AVG
		7093.3	38.89	9.53	48.42	68.2	-19.78	PK
	*	10640	30.49	18.03	48.52	74	-25.48	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 64)
Radiated Spurious Emission, Horizontal

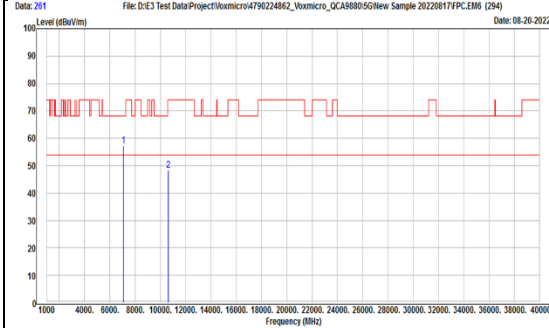


TX, 802.11ac(VHT20) (Ch 64)
Radiated Spurious Emission, Vertical

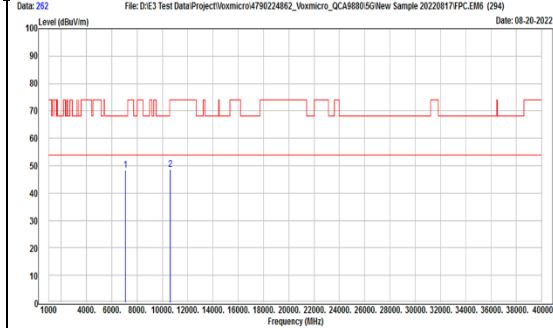


TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Average), Horizontal

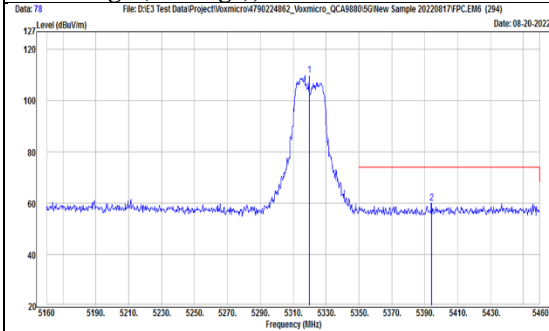


TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Average), Vertical

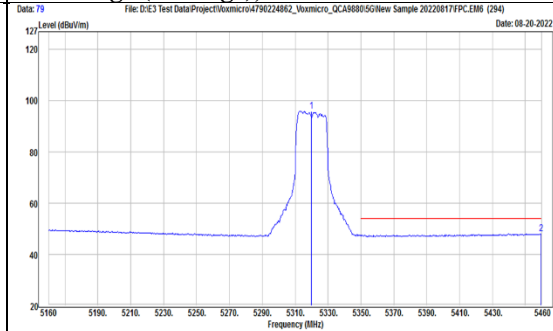

TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Peak), Horizontal

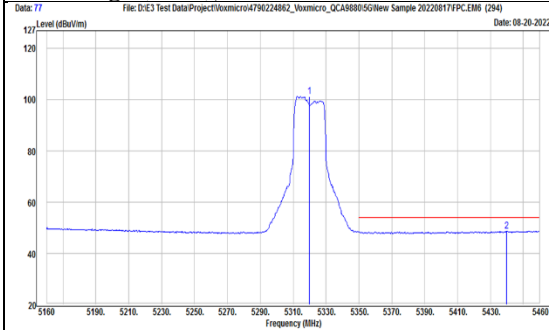

TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Peak), Vertical

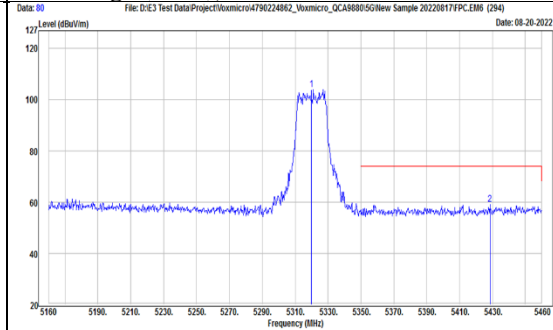

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5447.25	39.84	19.5	59.34	74	-14.66	PK
		5455.65	29.56	19.54	49.1	54	-4.9	AVG
		5461.95	40	19.58	59.58	68.2	-8.62	PK
	@	5500	89.79	19.77	109.56	N/A	N/A	PK
	@	5500	81.64	19.77	101.41	N/A	N/A	AVG
		7333.3	40.08	10.32	50.4	74	-23.6	PK
	*	11000	30.61	18.41	49.02	74	-24.98	PK
Vertical		5446.9	39.96	19.5	59.46	74	-14.54	PK
		5447.6	28.59	19.5	48.09	54	-5.91	AVG
		5464.4	39.19	19.59	58.78	68.2	-9.42	PK
	@	5500	88.58	19.77	108.35	N/A	N/A	PK
	@	5500	79.65	19.77	99.42	N/A	N/A	AVG
		7333.3	33.9	10.32	44.22	74	-29.78	PK
	*	11000	30.91	18.41	49.32	74	-24.68	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

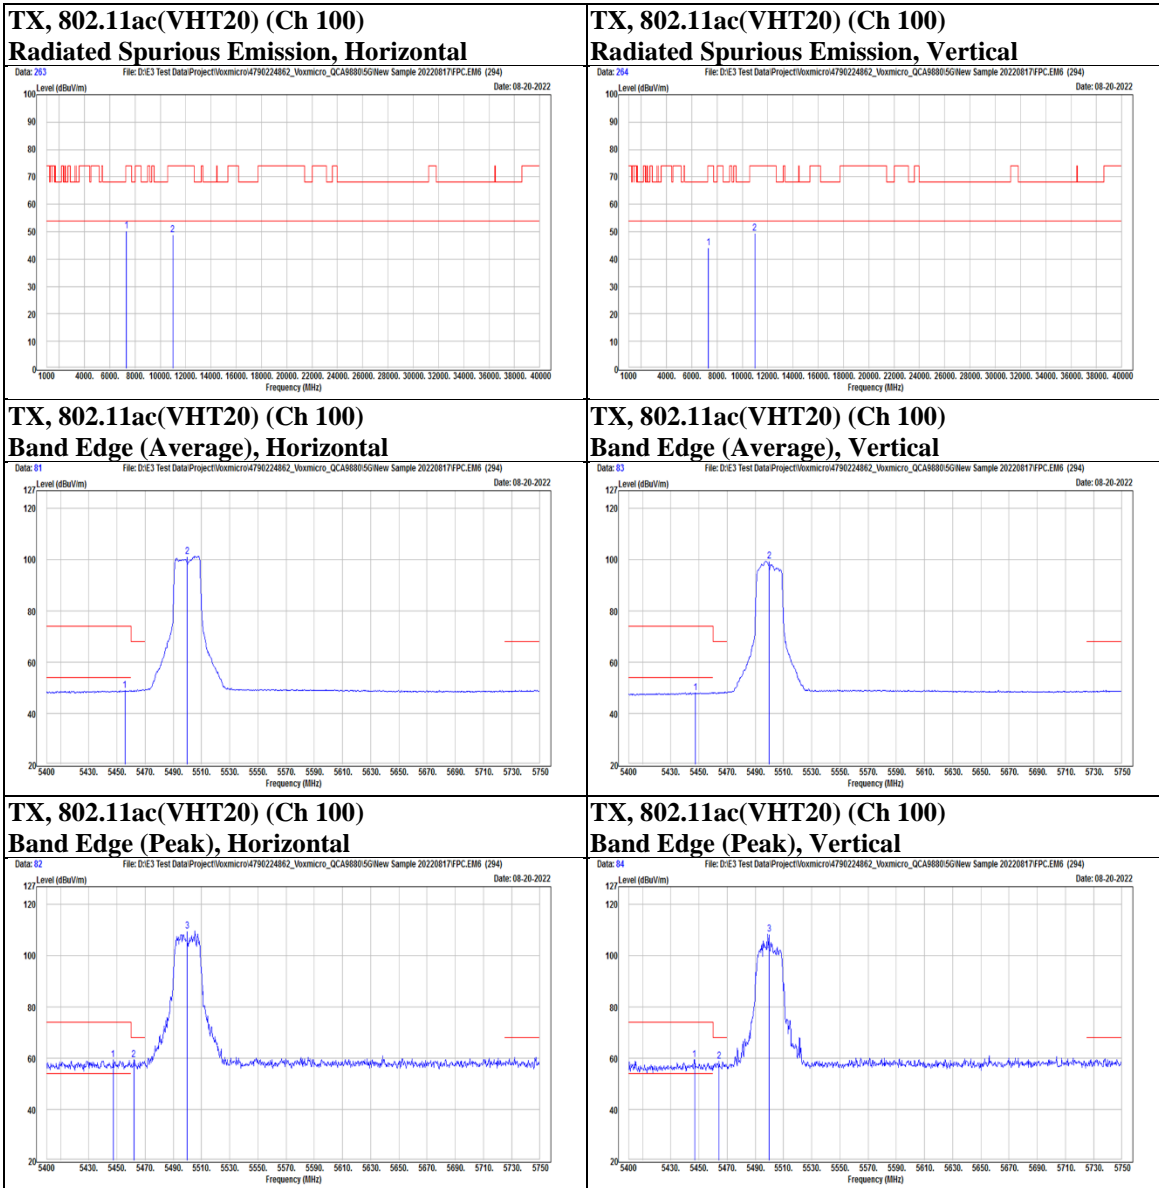

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 214 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5407	41.49	19.31	60.8	74	-13.2	PK
		5439.9	32.58	19.47	52.05	54	-1.95	AVG
		5464.05	42.41	19.59	62	68.2	-6.2	PK
	@	5580	88.54	19.76	108.3	N/A	N/A	PK
	@	5580	80.69	19.76	100.45	N/A	N/A	AVG
		5736	40.23	20.07	60.3	68.2	-7.9	PK
		7440	38.39	10.73	49.12	74	-24.88	PK
	*	11160	30.58	18.47	49.05	74	-24.95	PK
Vertical		5433.95	40.05	19.44	59.49	74	-14.51	PK
		5439.9	30.2	19.47	49.67	54	-4.33	AVG
		5465.1	38.88	19.59	58.47	68.2	-9.73	PK
	@	5580	82.06	19.76	101.82	N/A	N/A	PK
	@	5580	74.42	19.76	94.18	N/A	N/A	AVG
		5727.25	40.08	19.99	60.07	68.2	-8.13	PK
		7440	33.63	10.73	44.36	74	-29.64	PK
	*	11160	31.25	18.47	49.72	74	-24.28	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

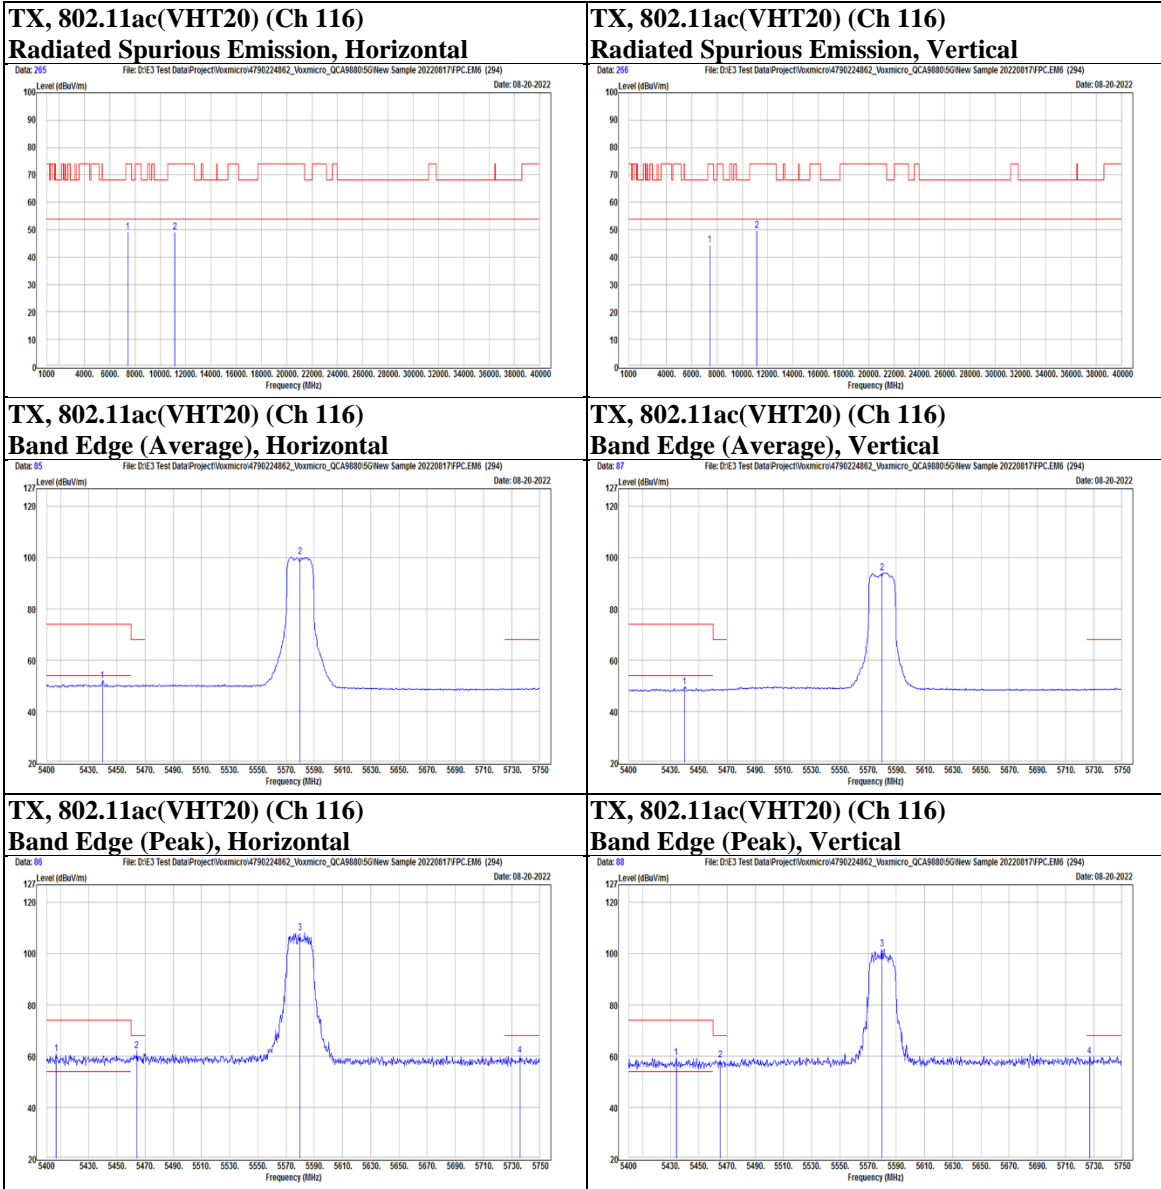

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 216 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5439.9	33.31	19.47	52.78	54	-1.22	AVG
	@	5700	89.28	19.73	109.01	N/A	N/A	PK
	@	5700	81.58	19.73	101.31	N/A	N/A	AVG
		5725	41.25	19.96	61.21	68.2	-6.99	PK
		7600	37.87	10.89	48.76	74	-25.24	PK
	*	11400	29.77	18.85	48.62	74	-25.38	PK
Vertical		5439.9	30.81	19.47	50.28	54	-3.72	AVG
	@	5700	83.46	19.73	103.19	N/A	N/A	PK
	@	5700	75.3	19.73	95.03	N/A	N/A	AVG
		5725	40.13	19.96	60.09	68.2	-8.11	PK
		7600	32.9	10.89	43.79	74	-30.21	PK
	*	11400	29.98	18.85	48.83	74	-25.17	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0

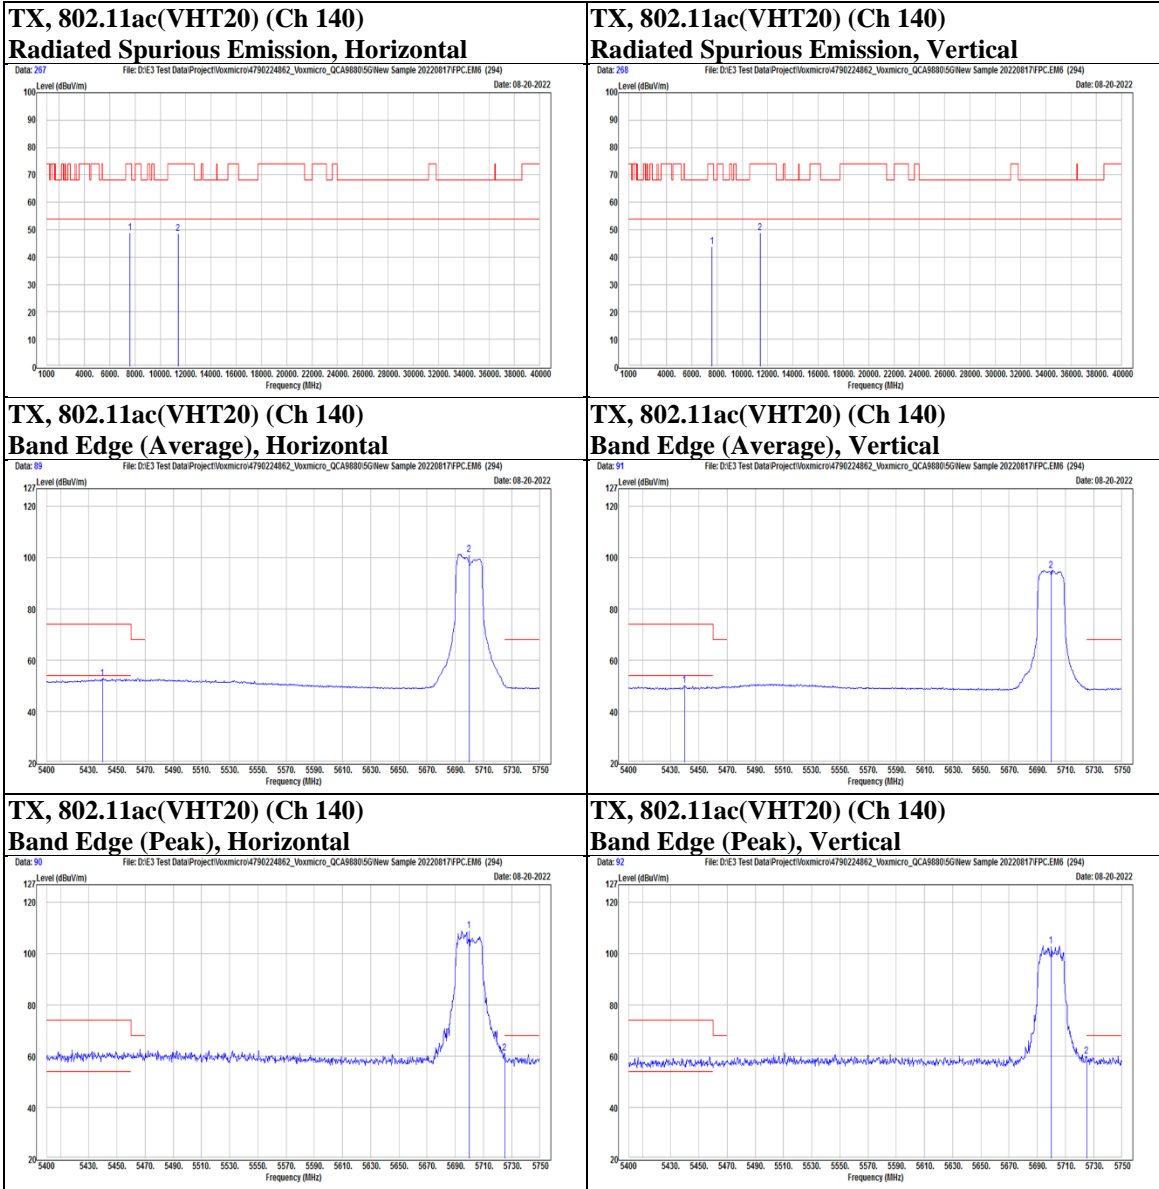



Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5538	43.49	19.82	63.31	68.2	-4.89	PK
		5693.5	40.61	19.72	60.33	100.41	-40.08	PK
		5745	91.6	20.15	111.75	N/A	N/A	PK
		7660	40.96	10.75	51.71	74	-22.29	PK
		11490	30.03	19.33	49.36	74	-24.64	PK
Vertical	@	5548	42.04	19.83	61.87	68.2	-6.33	PK
		5666	39.88	19.69	59.57	80.08	-20.51	PK
		5745	86.18	20.15	106.33	N/A	N/A	PK
		7660	33.16	10.75	43.91	74	-30.09	PK
		11490	29.95	19.33	49.28	74	-24.72	PK

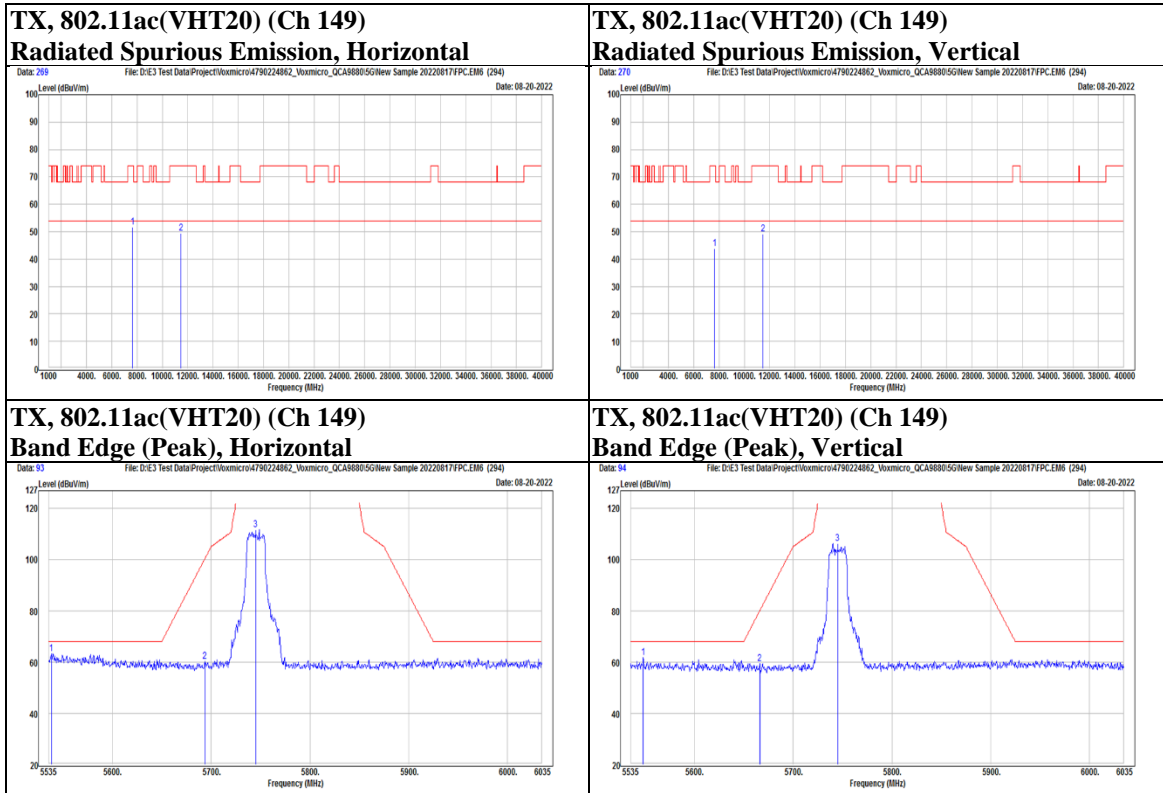

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5555	44.82	19.82	64.64	68.2	-3.56	PK
		5652	41.13	19.67	60.8	69.69	-8.89	PK
	@	5785	91.49	20.45	111.94	N/A	N/A	PK
		5876	40.59	20.81	61.4	104.46	-43.06	PK
		6011.5	40.68	20.99	61.67	68.2	-6.53	PK
		7713.3	38.07	10.69	48.76	74	-25.24	PK
	*	11570	30.59	19.07	49.66	74	-24.34	PK
Vertical		5535.5	41.85	19.82	61.67	68.2	-6.53	PK
		5679.5	40.89	19.7	60.59	90.07	-29.48	PK
	@	5785	85	20.45	105.45	N/A	N/A	PK
		5913	39.67	20.96	60.63	77.05	-16.42	PK
		5936	40.73	20.95	61.68	68.2	-6.52	PK
		7713.3	33.64	10.69	44.33	74	-29.67	PK
	*	11570	31.14	19.07	50.21	74	-23.79	PK

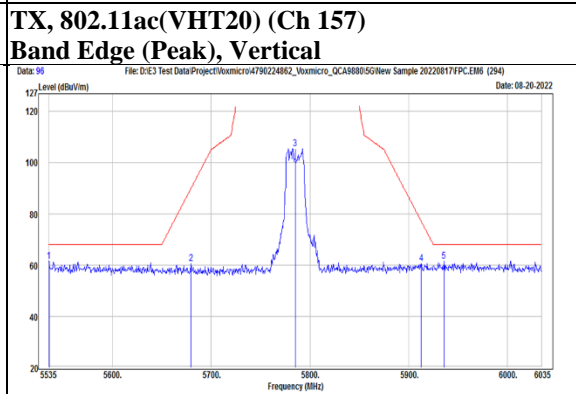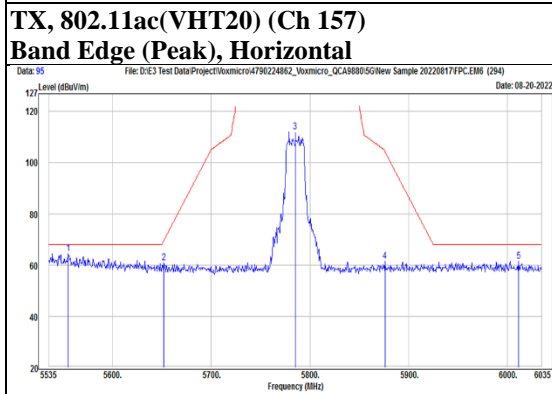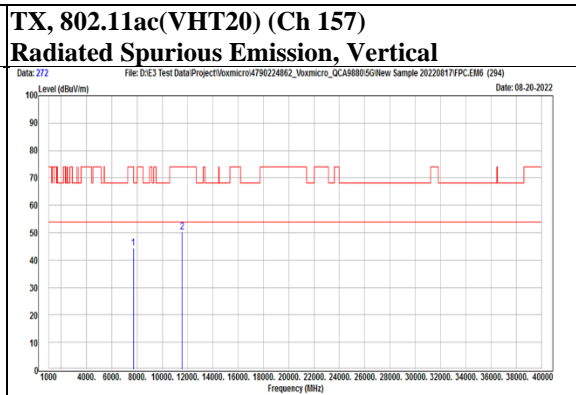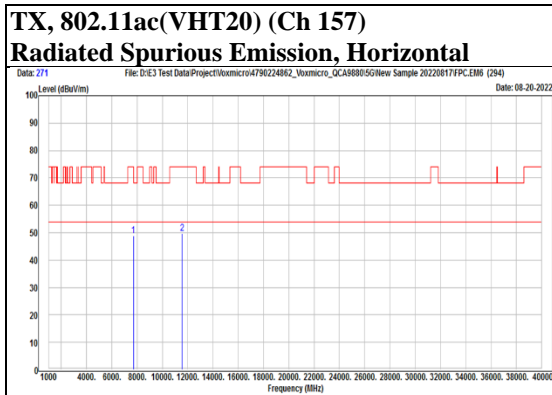

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5547	43.73	19.83	63.56	68.2	-4.64	PK
		5698	40.77	19.72	60.49	103.73	-43.24	PK
	@	5825	88.68	20.58	109.26	N/A	N/A	PK
		5878.5	40.04	20.83	60.87	102.6	-41.73	PK
		5985	41.64	20.98	62.62	68.2	-5.58	PK
		7766	36.53	10.89	47.42	68.2	-20.78	PK
	*	11650	29.73	18.83	48.56	74	-25.44	PK
Vertical		5581	41.58	19.76	61.34	68.2	-6.86	PK
		5697.5	40.41	19.72	60.13	103.36	-43.23	PK
	@	5825	82.37	20.58	102.95	N/A	N/A	PK
		5876.5	40.32	20.81	61.13	104.09	-42.96	PK
		5980.5	40.26	20.97	61.23	68.2	-6.97	PK
		7766.7	33.17	10.9	44.07	68.2	-24.13	PK
	*	11650	29.16	18.83	47.99	74	-26.01	PK

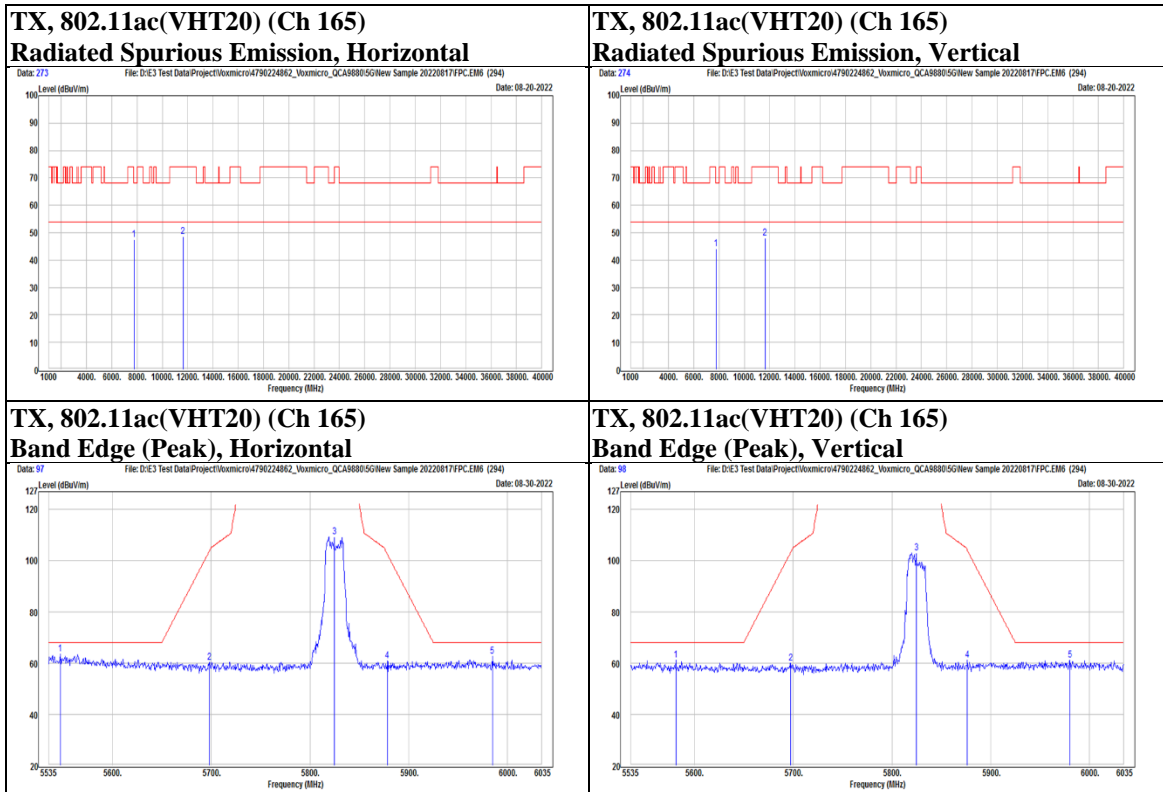

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 221 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5147.7	42.08	19.4	61.48	74	-12.52	PK
		5149.8	33.78	19.4	53.18	54	-0.82	AVG
	@	5190	84.12	19.29	103.41	N/A	N/A	PK
	@	5190	75.58	19.29	94.87	N/A	N/A	AVG
		6920	52.65	8.42	61.07	68.2	-7.13	PK
	*	10380	30.47	17.61	48.08	68.2	-20.12	PK
Vertical		5112	42.11	19.44	61.55	74	-12.45	PK
		5149.45	31.9	19.4	51.3	54	-2.7	AVG
	@	5190	80.39	19.29	99.68	N/A	N/A	PK
	@	5190	71.96	19.29	91.25	N/A	N/A	AVG
		6920	44.43	8.42	52.85	68.2	-15.35	PK
	*	10380	30.54	17.61	48.15	68.2	-20.05	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

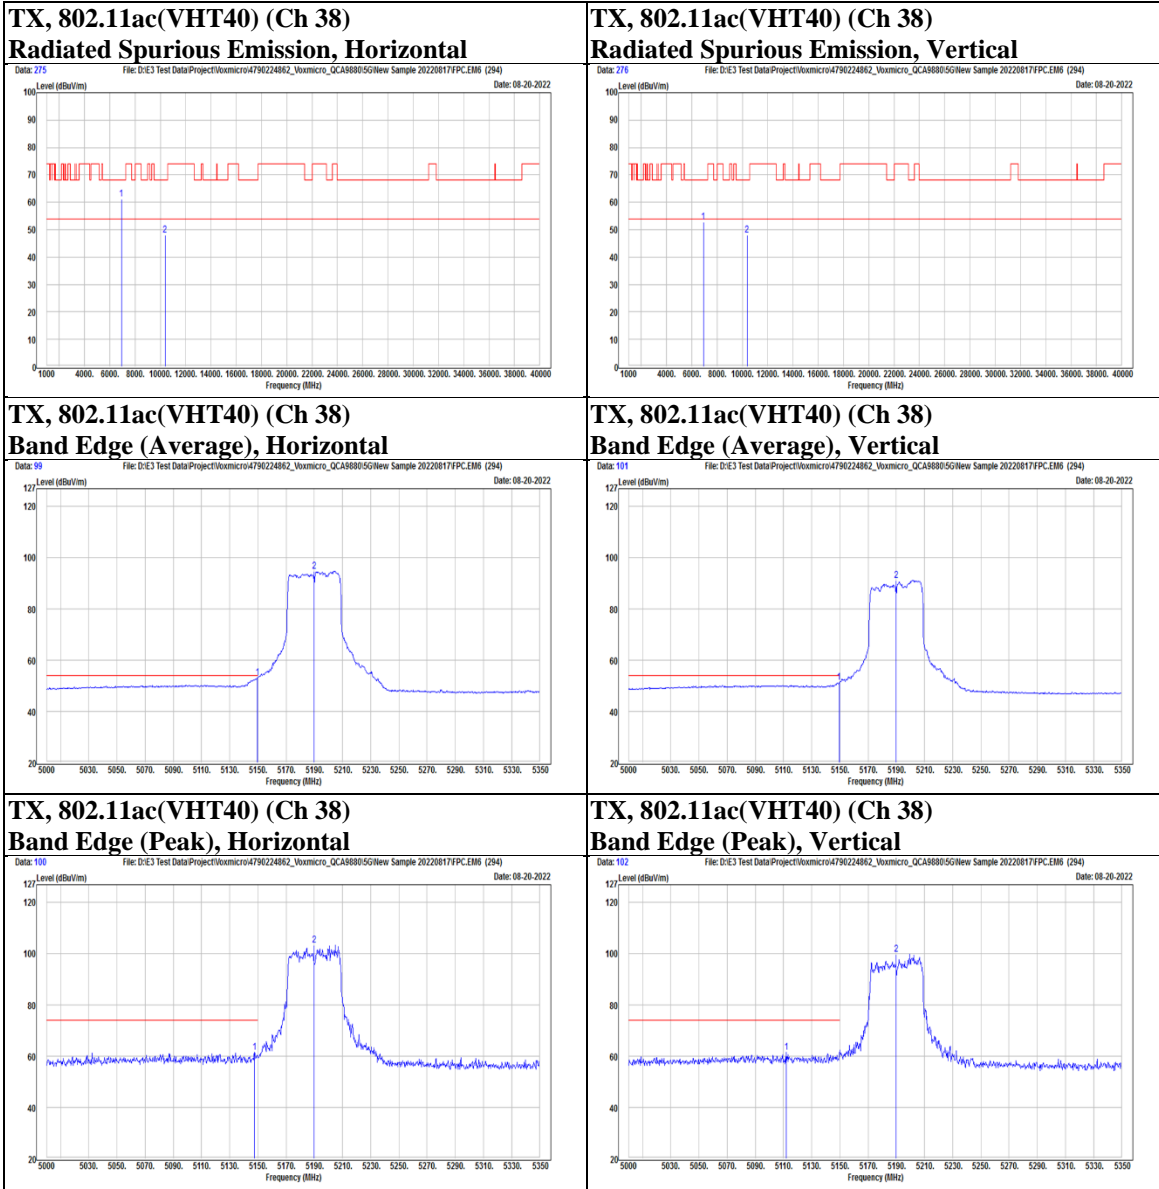

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 223 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5022.05	42.79	18.83	61.62	74	-12.38	PK
		5125.65	31.04	19.42	50.46	54	-3.54	AVG
	@	5230	88.55	19.05	107.6	N/A	N/A	PK
	@	5230	80.75	19.05	99.8	N/A	N/A	AVG
		6973.3	55.55	8.65	64.2	68.2	-4	PK
	*	10460	32.37	17.87	50.24	68.2	-17.96	PK
Vertical		5062.3	42.03	19.17	61.2	74	-12.8	PK
		5131.6	30.88	19.42	50.3	54	-3.7	AVG
	@	5230	86.97	19.05	106.02	N/A	N/A	PK
	@	5230	79.01	19.05	98.06	N/A	N/A	AVG
		6973.3	45.01	8.65	53.66	68.2	-14.54	PK
	*	10460	29.61	17.87	47.48	68.2	-20.72	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

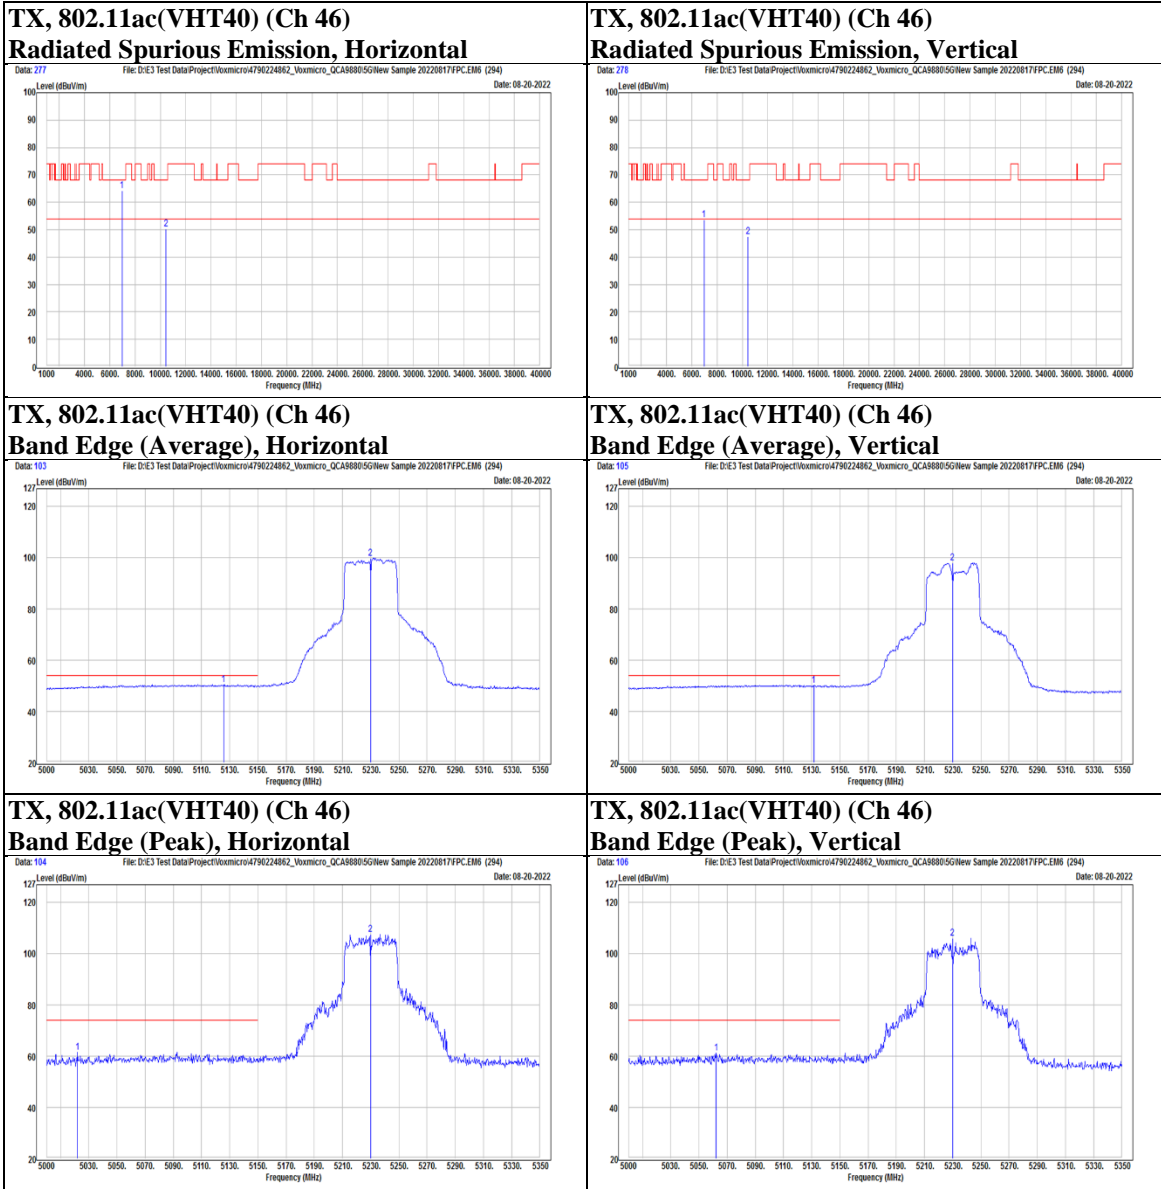

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 225 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	89.64	18.85	108.49	N/A	N/A	PK
	@	5270	81.75	18.85	100.6	N/A	N/A	AVG
		5394	41.28	19.24	60.52	74	-13.48	PK
		5439.9	32.46	19.47	51.93	54	-2.07	AVG
		7026.7	54.13	8.98	63.11	68.2	-5.09	PK
	*	10540	30.01	18.01	48.02	68.2	-20.18	PK
Vertical	@	5270	86.77	18.85	105.62	N/A	N/A	PK
	@	5270	77.57	18.85	96.42	N/A	N/A	AVG
		5397.6	29.67	19.26	48.93	54	-5.07	AVG
		5442.3	39.92	19.48	59.4	74	-14.6	PK
		7026.7	47.51	8.98	56.49	68.2	-11.71	PK
	*	10540	30.22	18.01	48.23	68.2	-19.97	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

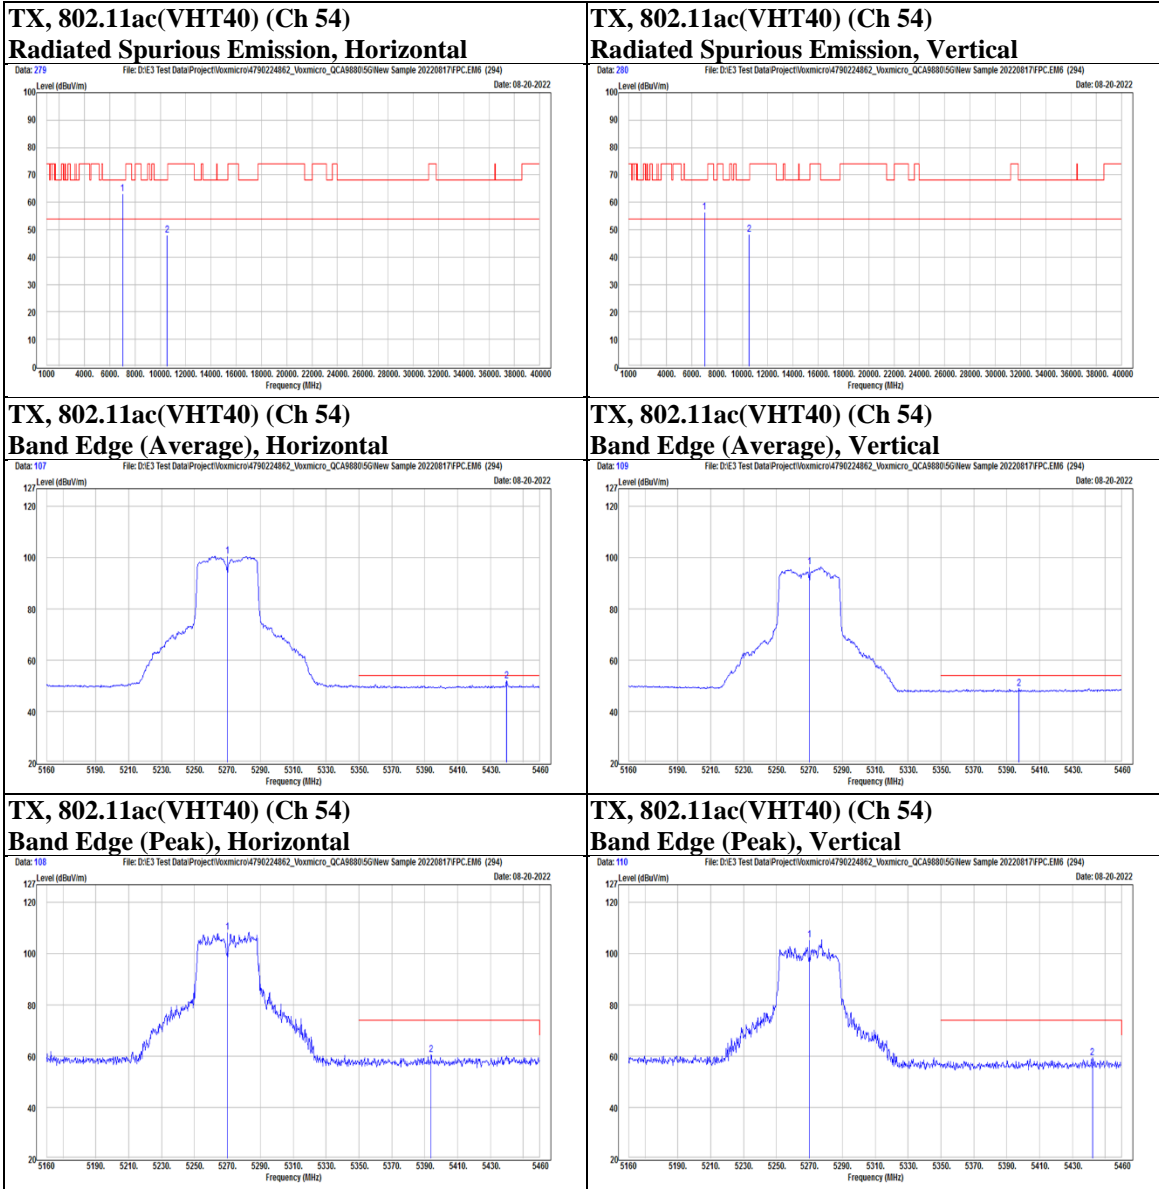



Test report No. : 4790224862-US-R1-V0
Page : 227 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	62
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	88.3	18.81	107.11	N/A	N/A	PK
	@	5310	79.71	18.81	98.52	N/A	N/A	AVG
		5350.2	34.28	19.01	53.29	54	-0.71	AVG
		5357.1	43.57	19.05	62.62	74	-11.38	PK
		7080	43.56	9.43	52.99	68.2	-15.21	PK
	*	10620	30.6	18.04	48.64	74	-25.36	PK
Vertical	@	5310	82.67	18.81	101.48	N/A	N/A	PK
	@	5310	73.98	18.81	92.79	N/A	N/A	AVG
		5350.2	31.91	19.01	50.92	54	-3.08	AVG
		5428.2	39.97	19.41	59.38	74	-14.62	PK
		7080	36.49	9.43	45.92	68.2	-22.28	PK
	*	10620	31.18	18.04	49.22	74	-24.78	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

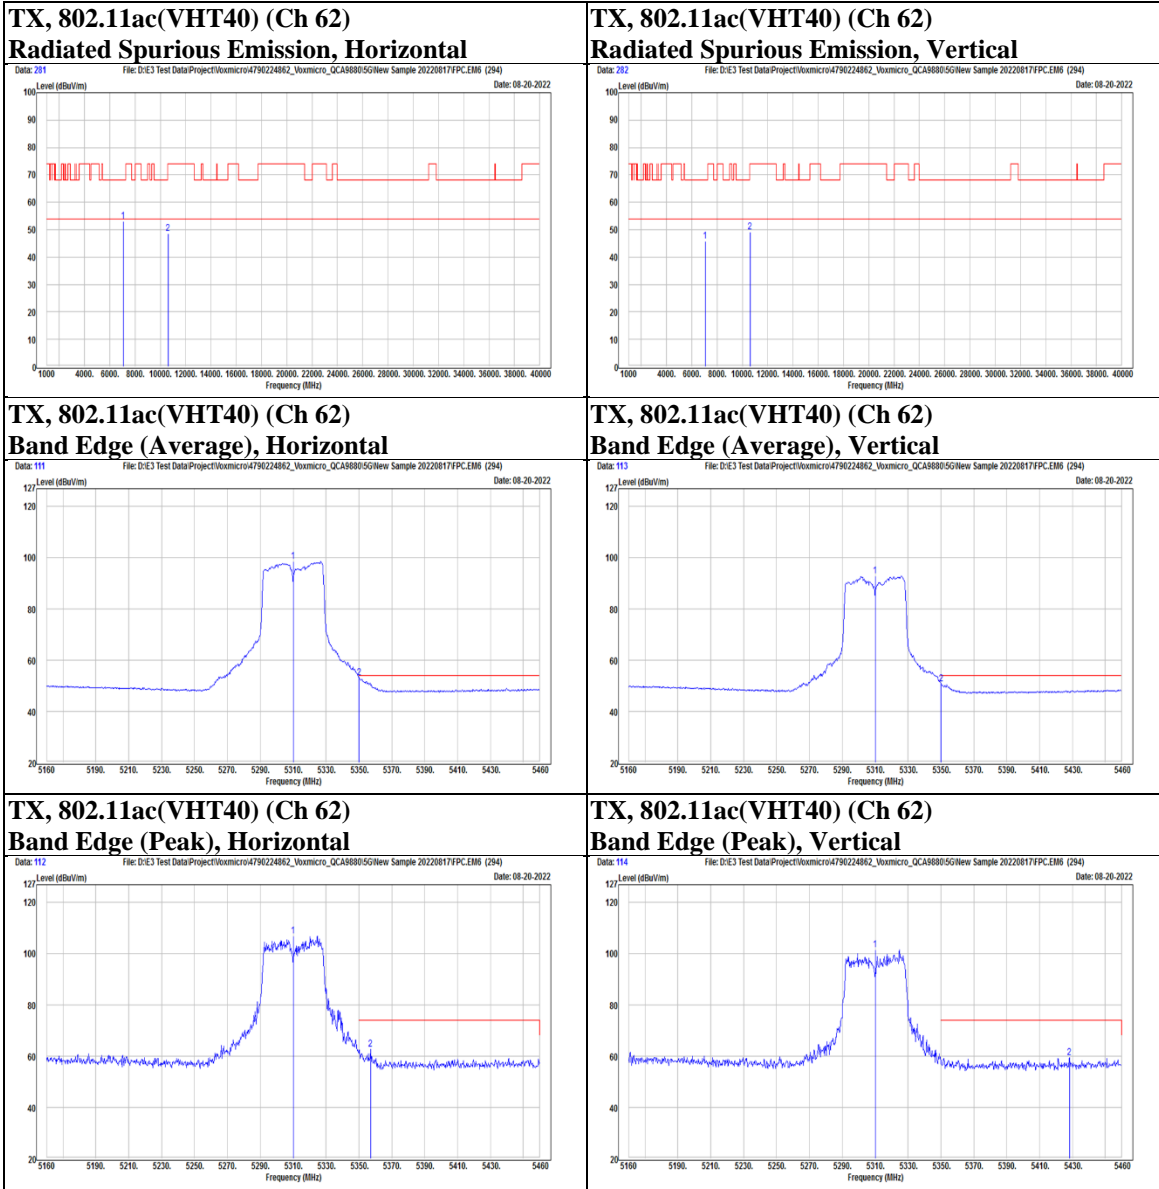

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790224862-US-R1-V0
Page : 229 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5432.2	40.09	19.43	59.52	74	-14.48	PK
		5459.85	31.55	19.57	51.12	54	-2.88	AVG
		5466.85	46.05	19.61	65.66	68.2	-2.54	PK
	@	5510	87.75	19.78	107.53	N/A	N/A	PK
	@	5510	79.79	19.78	99.57	N/A	N/A	AVG
		7346.7	38.81	10.33	49.14	74	-24.86	PK
	*	11020	31.45	18.42	49.87	74	-24.13	PK
Vertical		5430.8	39.86	19.42	59.28	74	-14.72	PK
		5459.5	29.42	19.57	48.99	54	-5.01	AVG
		5469.65	43.64	19.62	63.26	68.2	-4.94	PK
	@	5510	84.23	19.78	104.01	N/A	N/A	PK
	@	5510	77.16	19.78	96.94	N/A	N/A	AVG
		7346.7	33.58	10.33	43.91	74	-30.09	PK
	*	11020	29.94	18.42	48.36	74	-25.64	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0