

Report No.: SEWA2209000044RG06

Rev.: 01 Page: 1 of 85

TEST REPORT

Application No.: SEWA2209000044RG

Applicant: Gosuncn Technology Group Co., Ltd.

Address of Applicant: 6F, 2819 KaiChuang Blvd., Science Town, Huangpu District, Guangzhou City,

Guangdong, China.

Manufacturer: Gosuncn Technology Group Co., Ltd.

Address of Manufacturer: 6F, 2819 KaiChuang Blvd., Science Town, Huangpu District, Guangzhou City,

Guangdong, China.

EUT Description: Automatic Database Diagnostic Monitor (LTE OBD II Hotspot)

Model No.: GD506

Trade Mark: GOSUNCN

FCC ID: 2APNR-GD506

Standards: FCC 47 CFR Part 2, Subpart J

FCC 47 CFR Part 15, Subpart E

Date of Receipt: 2022/09/20

Date of Test: 2022/10/08 to 2022/12/29

Date of Issue: 2022/12/29

Test Result : PASS *

* In the configuration tested, the EUT detailed in this report complied with the standards specified above.

Authorized Signature:

Panta Sun Wireless Laboratory Manager



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.spx.and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx.
Attention is drawn to the limitation of liability, indemification and jurisdiction issues define therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration forgery or faisification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

South of No. 6 Plant, No. 1, Runsteng Read, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone
中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

0 t (86–512) 62992980 0 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 2 of 85

1 Version

| Revision Record | | | | |
|-----------------|---------|------------|----------|----------|
| Version | Chapter | Date | Modifier | Remark |
| 01 | | 2022/12/29 | | Original |

| Prepared By | (Ives Cheng) / Test Engineer |
|-------------|------------------------------|
| Checked By | (Well Wei) / Reviewer |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 ww t (86–512) 62992980 sgs



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 3 of 85

2 Test Summary

| Test Item | Band ^[1] | FCC rules | Test Requirer | ments | Test | Result |
|-----------------------------------|--------------------------------|--------------|---|---|--------------------|--------|
| | | No. | | | Nosuit | |
| Dynamic Frequency Selection | Band II- A Band II- C | rules No. | DFS Detection Thresholds: Maximum Transmit Power EIRP ≥ 200 milliwatt EIRP < 300 milliwatt and power spectral density < 10 dBm/MHz EIRP < 300 milliwatt that do not meet the power spectral density requirement Note 1: This is the level at the input of the receiver assuming a 0 dB Note 2: Throughout these test procedures an additional 1 dB has be test transmission waveforms to account for variations in measureme the test signal is at or above the detection threshold level to trigger a Note3: EIRP is based on the highest antenna gain. For MIMO device 62311 Dol. DFS Response Requiremer Parameter Non-occupancy period Channel Availability Check Time Channel Move Time Channel Closting Transmission Time VNII Detection Bandwidth Note 1: Channel Move Time and the Channel Closting Trans Radar Type 0. The measurement timing begins at the end of the control of the | Value (See Notes 1, 2, and 3) -64 dBm -64 dBm -64 dBm -64 dBm is receive antenname and deel to the amplitude of the not equipment. This will ensure that DFS response. Value Minimum 30 minutes 60 seconds 10 seconds See Note 1. 200 milliseconds + an aggregate of 60 milliseconds over remaining 10 second period. See Notes 1 and 2. Minimum 100% of the U-NII 99% transmission power bandwidth. See Note 3. 3. mission Time should be performed with exact Type 0 burst. | Result Clause 4.1 | Result |
| | | | Note 2: The Channel Classing Transmission Time is comprised beginning of the Channel Move Time plus any additional inter- facilitate a Channel move (an aggregate of 60 milliseconds) du period. The aggregate duration of control signals will not count Note 3: During the U-VII Detection Bandwidth detection test, frequency step the minimum percentage of detection is 90 pero no data traffic. | nittent control signals required to ring the remainder of the 10 second quiet periods in between transmissions. radar type 0 should be used. For each | | |

Note 1:

Band II-A: 5250-5350MHz Band II-C: 5470-5725MHz



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 4 of 85

Contents

| 1 | Vers | ion | 2 |
|---|------|---|----|
| 2 | Test | Summary | 3 |
| 3 | Gen | eral Information | 5 |
| | 3.1 | Details of Client | 5 |
| | 3.2 | Test Location | 5 |
| | 3.3 | Test Facility | 5 |
| | 3.4 | General Description of EUT | 6 |
| | 3.5 | Test Environment and Mode | 8 |
| | 3.6 | Description of Support Units | 8 |
| | 3.7 | Worst-case configuration and mode | 8 |
| 4 | Test | results and Measurement Data | 9 |
| | 4.1 | Dynamic Frequency Selection | 9 |
| | | 4.1.1 DFS Measurement Configuration | 9 |
| | | 4.1.2 DFS Threshold level | 9 |
| | | 4.1.3 Power-on cycle | 9 |
| | | 4.1.4 User Access Restrctions | 9 |
| | | 4.1.5 Channel Loading/Data Streaming | 9 |
| | | 4.1.6 Conducted Setup of Calibration of DFS Detection Threshold Level | 10 |
| | | 4.1.7 Test Setup | 10 |
| | | 4.1.8 Applicability of DFS Requirements Prior to Use of a Cahannel | 11 |
| | | 4.1.9 Applicability of DFS Requirements During Normal Operation | 11 |
| | | 4.1.10 DFS Detection Thresholds | 12 |
| | | 4.1.11 Response Requirements | 12 |
| | | 4.1.12 Short Pulse Radar Test Waveforms | 13 |
| | | 4.1.13 Long Pulse Radar Test Waveform | 15 |
| | | 4.1.14 Frequency Hopping Radar Test Waveform | 15 |
| 5 | Mea | surement Uncertainty (95% confidence levels, k=2) | 16 |
| 6 | Equi | pment List | 17 |
| 7 | Phot | tographs - Setup Photos | 18 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 5 of 85

3 General Information

3.1 Details of Client

| Applicant: | Gosuncn Technology Group Co., Ltd. |
|--------------------------|---|
| Address of Applicant: | 6F, 2819 KaiChuang Blvd., Science Town, Huangpu District, Guangzhou City, Guangdong, China. |
| Manufacturer: | Gosuncn Technology Group Co., Ltd. |
| Address of Manufacturer: | 6F, 2819 KaiChuang Blvd., Science Town, Huangpu District, Guangzhou City, Guangdong, China. |

3.2 Test Location

| Company: | SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd. |
|----------------|--|
| Address: | South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone |
| Post code: | 215000 |
| Test engineer: | Ives Cheng |

3.3 Test Facility

The test facility is recognized, certified, or accredited by the following organizations:

• A2LA (Certificate No. 6336.01)

SGS-CSTC STANDARDS TECHNICAL SERVICES (SUZHOU) CO., LTD. is accredited by the American Association for Laboratory Accreditation(A2LA). Certificate No. 6336.01.

Innovation, Science and Economic Development Canada

SGS-CSTC STANDARDS TECHNICAL SERVICES (SUZHOU) CO., LTD. has been recognized by ISED as an accredited testing laboratory.

CAB identifier: CN0120.

IC#: 27594.

• FCC –Designation Number: CN1312

SGS-CSTC STANDARDS TECHNICAL SERVICES (SUZHOU) CO., LTD. has been recognized as an

accredited testing laboratory. Designation Number: CN1312.

Test Firm Registration Number: 717327



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents at <a href="http://www.sgs.com/en/Terms-and-Conditions/Terms-and-Co

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 w t (86–512) 62992980 sg



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 6 of 85

3.4 General Description of EUT

| EUT Description: | Automatic Database Diagnostic Monitor (LTE OBD II Hotspot) | | |
|--|---|---|--|
| Model No.: | GD506 | | |
| Trade Mark: | GOSUNCN | | |
| Hardware Version: | GD506.H01 | ı | |
| Software Version: | MDM_GEN | I_GD506V1.1.1B01 | |
| IMEI: | 861240040 | 116519 | |
| | 802.11a: | 20 MHz channel bandwidth | |
| WLAN Mode Supported: | 802.11n: | 20 MHz / 40 MHz channel bandwidth | |
| | 802.11ac: | 20 MHz / 40 MHz / 80 MHz channel bandwidth | |
| Operation Frequency: | 5250MHz to 5470MHz to | | |
| | 802.11a: | OFDM (BPSK, QPSK, 16QAM, 64QAM) | |
| Modulation Type: | 802.11n: | OFDM (BPSK, QPSK, 16QAM, 64QAM) | |
| | 802.11ac: | OFDM (BPSK, QPSK, 16QAM, 64QAM, 256QAM) | |
| | 20MHz: | 802.11a/n(HT20)/ac(VHT20) | |
| Channel Spacing: | 40MHz: | 802.11n(HT40)/ac(VHT40) | |
| | 80MHz: | 802.11ac(VHT80) | |
| Antenna Type: | Internal Ant | tenna | |
| | 5250MHz to 5350MHz: 6.85dBi(Ant2) 5470MHz to 5725MHz: 7.35dBi(Ant2) | | |
| Antenna Gain: | Note: The antenna gain are derived from the gain information report provided by the manufacturer. | | |
| | ⊠ SISO | 802.11a/n/ac | |
| | | CDD: 802.11a/n/ac: Tx & Rx | |
| Smart System: | ☐ MIMO | STBC: 802.11n/ac: Tx & Rx | |
| | | TXBF: 802.11n/ac: Tx & Rx | |
| | Diversity | / 802.11a: Tx & Rx | |
| DFS Function: | Master | | |
| | Slave with radar detection Slave without radar detection | | |
| RF Cable: | 2dB | | |
| Remark: As above information is p suitability, reliability or/an | | confirmed by the applicant. SGS is not liable to the accuracy, the information. | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues define therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration riggery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, **Contact United Company Advisors and Company

South of No. 6 Pfart, No. 1, Runsheng Read, Suchou Industrial Park, Suchou Area, China (liangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 www.sgs t (86–512) 62992980 sgs.china



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 7 of 85

Remark:

In FCC 15.31, for each band in which the device can be operated with the device operating at the number of frequencies in each band specified in the following table, and the selected channel to perform the test as below:

| Frequency Range of Operation Operating Frequency Range (in each Band) | Number of Measurement Frequencies Required | Location of Measurement Frequency in Band of Operation |
|---|---|---|
| 1 MHz or less | 1 | centre |
| 1 MHz to 10 MHz | 2 | 1 near high end, 1 near low end |
| Greater than 10 MHz | 3 | 1 near high end, 1 near centre |

| For UNII Band II-A: | | | | |
|-------------------------|---------------------|----------------|--|--|
| Mode | Channel | Frequency(MHz) | | |
| IEEE 802.11a/n/ac 20MHz | The Lowest channel | 5260 | | |
| | The Middle channel | 5280 | | |
| | The Highest channel | 5320 | | |
| 1555 000 44 4 400 41 | The Lowest channel | 5270 | | |
| IEEE 802.11n/ac 40MHz | The Highest channel | 5310 | | |
| IEEE 802.11ac 80MHz | The Middle channel | 5290 | | |

| For UNII Band II-C: | | | | |
|-------------------------|---------------------|----------------|--|--|
| Mode | Channel | Frequency(MHz) | | |
| IEEE 802.11a/n/ac 20MHz | The Lowest channel | 5500 | | |
| | The Middle channel | 5580 | | |
| | The Highest channel | 5700 | | |
| | The Lowest channel | 5510 | | |
| IEEE 802.11n/ac 40MHz | The Middle channel | 5550 | | |
| | The Highest channel | 5670 | | |
| IEEE 802.11ac 80MHz | The Lowest channel | 5530 | | |
| | The Highest channel | 5610 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents a thite://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest settent of the law. Unless otherwise stated the results of the company of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest settent of the law. Unless otherwise stated the results of the company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) testing inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or remail: Content of the content of

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区河胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 www t (86–512) 62992980 sgs



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 8 of 85

3.5 Test Environment and Mode

| Environment Parameter | 101.0 kPa Selected Values During Tests | |
|-----------------------|--|----|
| Relative Humidity | 44-60 % RH Ambient | |
| Value | Temperature(℃) Voltage(V | |
| NTNV | 22~23 | 12 |

Remark:

NV: Normal VoltageNT: Normal Temperature

3.6 Description of Support Units

| Description | Manufacturer | Model No. | |
|---|------------------------------------|--------------------------------------|--|
| Mother board* | Gosuncn Technology Group Co., Ltd. | VX6080 | |
| Router | ASUS | GT-AXE11000 (FCC ID MSQ-RTAXJF00) | |
| Remark: the information with"*" are provided by client. | | | |

3.7 Worst-case configuration and mode

Low data rate was used to test on antenna port conducted tests and radiated spurious emissions since it has the highest maximum power. Following are the worst-case data rates set for test:

| Modulation Type | SISO - Data Rate | MIMO - Data Rate |
|-------------------|------------------|------------------|
| 802.11a | 6 Mbps | / |
| 802.11n (HT 20) | MCS0 (6.5 Mbps) | / |
| 802.11n (HT 40) | MCS0 (13.5 Mbps) | / |
| 802.11ac (VHT 20) | MCS0 (6.5 Mbps) | / |
| 802.11ac (VHT 40) | MCS0 (13.5 Mbps) | / |
| 802.11ac (VHT 80) | MCS0 (29.3 Mbps) | / |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and juryisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or faisification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest serior of the law Liness otherwise stated the resum on: To checke autherities of testing linesection report & certificate, please contact us at telephone: (86-755) 83071443, remail: CR. Doccheck@ass.com or testing linesection report & certificate, please contact us at telephone: (86-755) 83071443,

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区河胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 www.sg t (86–512) 62992980 sgs.chii



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 9 of 85

4 Test results and Measurement Data

4.1 Dynamic Frequency Selection

4.1.1 DFS Measurement Configuration

| Test Condition | Conducted Measurement Use 50Ohms to connect cable/connector calibration and testing, Use ANT2 port |
|----------------|--|
| | for testing. Refer to Section 4.1.7 for test connection. |

4.1.2 DFS Threshold level

| DFS Threshold level:(-54.65)dBm | | |
|---|--|--|
| The Interference Radar Detection Threshold Level is: | | |
| (Band II-C: -62dBm + 7.35dBi + 0dB = -54.65dBm); | | |
| That had been taken into account the output power range and antenna gain. | | |

4.1.3 Power-on cycle

The time required for the Master Device and/or Client Device to complete its power-on cycle(19S).

4.1.4 User Access Restrctions

DFS Controls(Hardware or software) related to radar detection are NOT accessible to the user. Manufacturer statement confirming that information regarding the parameters of the detected Radar Waveforms is not available to the end user.

4.1.5 Channel Loading/Data Streaming

| | The dara file(MPEG-4) has been transmitting in a streaming mode. |
|-------------|---|
| \boxtimes | Softeare to ping the client is permitted to simuate data transfer with random ping intervals. |
| \boxtimes | Minimum channel loading of approximately 17%. |
| | Unicast protocol has been used. |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents a thite://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the resum on: To checke autherities of the sample(s) tested and such sample(s) are retained for 30 days only.

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区河胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 w t (86–512) 62992980 s




Report No.: SEWA2209000044RG06


Rev.: 01

Page: 10 of 85

4.1.6 Conducted Setup of Calibration of DFS Detection Threshold Level

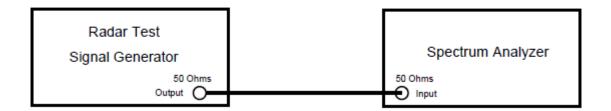

4.1.7 Test Setup

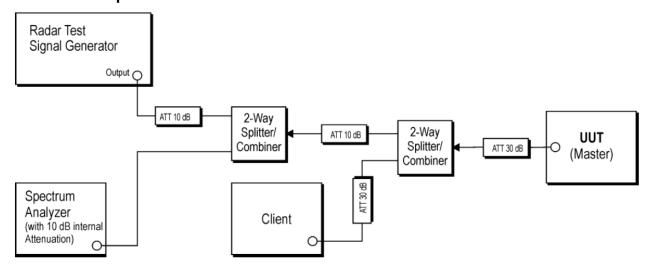



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sqs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents a thitp://www.sqs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and juryisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest settent of the law. Unless otherwise stated the resumble of the company of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest settent of the law. Unless otherwise stated the resumble of the content or appearance contact us at telephone: (86-755) 8307 1443, or email: CN Deocheck the authentic Wiscons and the content or appearance contact us at telephone: (86-755) 8307 1443, or email: CN Deocheck Wiscons come.

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区河胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 www t (86–512) 62992980 sgs.



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 11 of 85

4.1.8 Applicability of DFS Requirements Prior to Use of a Cahannel

| | DFS Operational mode | | |
|---------------------------------|----------------------|----------------------|-------------------|
| Requirement | | Client Without Radar | Client With Radar |
| | Master | Detection | Detection |
| Non-Occupancy Period | Yes | Not required | Yes |
| DFS Detection Threshold | Yes | Not required | Yes |
| Channel Availability Check Time | Yes | Not required | Not required |
| U-NII Detection Bandwidth | Yes | Not required | Yes |

4.1.9 Applicability of DFS Requirements During Normal Operation

| | DFS Operational mode | | |
|---------------------------------|------------------------------------|----------------------|--|
| Requirement | Master Device or Client with Radar | Client Without Radar | |
| | Detection | Detection | |
| DFS Detection Threshold | Yes | Not required | |
| Channel Availability Check Time | Yes | Yes | |
| Channel Move Time | Yes | Yes | |
| U-NII Detection Bandwidth | Yes | Not required | |

| Additional requirements for devices with | Master Device or Client with Radar | Client Without Radar |
|---|-------------------------------------|--|
| multiple bandwidth modes | Detection | Detection |
| U-NII Detection Bandwidth and Statistical Performance Check | All BW modes must be tested | Not required |
| Channel Move Time and Channel Closing Transmission Time | Test using widest BW mode available | Test using the widest BW mode available for the link |
| All other tests | Any single BW mode | Not required |

Note: Frequencies selected for statistical performance check (Section 7.8.4) should include several frequencies within the radar detection bandwidth and frequencies near the edge of the radar detection bandwidth. For 802.11 devices it is suggested to select frequencies in each of the bonded 20 MHz channels and the channel center frequency.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-en-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Clients' instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest except of the law Lunies stated the results shown in this lest report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

South of No. 6 Pfant, No. 1, Runsheng Read, Suzhou Industria Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

215000 t (86–512) 62992980 215000 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 12 of 85

4.1.10 DFS Detection Thresholds

| Maximum Transmit Power | Value (See Notes 1, 2, and 3) |
|---|-------------------------------|
| EIRP ≥ 200 milliwatt | -64 dBm |
| EIRP < 200 milliwatt and | -62 dBm |
| power spectral density < 10 dBm/MHz | |
| EIRP < 200 milliwatt that do not meet the power | -64 dBm |
| spectral density requirement | |

Note 1: This is the level at the input of the receiver assuming a 0 dBi receive antenna.

Note 2: Throughout these test procedures an additional 1 dB has been added to the amplitude of the test transmission waveforms to account for variations in measurement equipment. This will ensure that the test signal is at or above the detection threshold level to trigger a DFS response.

Note3: EIRP is based on the highest antenna gain. For MIMO devices refer to KDB Publication 662911 D01.

4.1.11 Response Requirements

| Parameter | Value |
|-----------------------------------|--|
| Non-occupancy period | Minimum 30 minutes |
| Channel Availability Check Time | 60 seconds |
| Channel Move Time | 10 seconds See Note 1. |
| Channel Closing Transmission Time | 200 milliseconds + an aggregate of 60 milliseconds over remaining 10 second period. See Notes 1 and 2. |
| U-NII Detection Bandwidth | Minimum 100% of the U-NII 99% transmission power bandwidth. See Note 3. |

Note 1: Channel Move Time and the Channel Closing Transmission Time should be performed with Radar Type 0. The measurement timing begins at the end of the Radar Type 0 burst.

Note 2: The Channel Closing Transmission Time is comprised of 200 milliseconds starting at the beginning of the Channel Move Time plus any additional intermittent control signals required to facilitate a Channel move (an aggregate of 60 milliseconds) during the remainder of the 10 second period. The aggregate duration of control signals will not count quiet periods in between transmissions.

Note 3: During the U-NII Detection Bandwidth detection test, radar type 0 should be used. For each frequency step the minimum percentage of detection is 90 percent. Measurements are performed with no data traffic.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.appx and, for electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-en-Document.appx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extend of the law Luless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing inspection report & certificate, please contact us at telephone: (86-755) 83071443,

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zore 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区洞胜路1号的6号厂房南部 蟛绵: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 13 of 85

4.1.12 Short Pulse Radar Test Waveforms

| Radar Type | Pulse Width (µsec) | PRI(µsec) | Number of Pulses | Minimum Percentage of Successful Detection | Minimum Number of Trials |
|---------------|-----------------------------|--|--|---|--------------------------------|
| 0 | 1 | 1428 | 18 | See Note 1 | See Note 1 |
| 1 | 1 | Test A: 15 unique PRI values randomly selected from the list of 23 PRI values in Table 5a Test B: 15 unique PRI values randomly selected within the range of 518-3066 µsec, with a minimum increment of 1 µsec, excluding PRI values selected in Test A | $ \operatorname{Roundup} \left\{ \left(\frac{1}{360} \right). \atop \left(\frac{19 \cdot 10^6}{\operatorname{PRI}_{\mu \text{sec}}} \right) \right\} $ | 60% | 30 |
| 2 | 1-5 | 150-230 | 23-29 | 60% | 30 |
| 3 | 6-10 | 200-500 | 16-18 | 60% | 30 |
| 4 | 11-20 | 200-500 | 12-16 | 60% | 30 |
| Aggreg | Aggregate (Radar Types 1-4) | | | 80% | 120 |

Note 1: Short Pulse Radar Type 0 should be used for the detection bandwidth test, channel move time, and channel closing time tests.

A minimum of 30 unique waveforms are required for each of the Short Pulse Radar Types 2 through 4. If more than 30 waveforms are used for Short Pulse Radar Types 2 through 4, then each additional waveform must also be unique and not repeated from the previous waveforms. If more than 30 waveforms are used for Short Pulse Radar Type 1, then each additional waveform is generated with Test B and must also be unique and not repeated from the previous waveforms in Tests A or B.

For example if in Short Pulse Radar Type 1 Test B a PRI of 3066 µsec is selected, the number of pulses

would be 6 1 19 10 Roundup
$$\left\{ \left(\frac{1}{360} \right) \cdot \left(\frac{19 \cdot 10^6}{3066} \right) \right\}$$
 Round up $\{17.2\} = 18$.

Table 5a - Pulse Repetition Intervals Values for Test A



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.sax and for electronic format documents subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of iniability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) stated and such sample(s) are retained for 30 days only.

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 • 苏州 • 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 14 of 85

| Pulse Repetition Frequency | Pulse Repetition Frequency | Pulse Repetition Interval |
|----------------------------|----------------------------|---------------------------|
| Number | (Pulses Per Second) | (Microseconds) |
| 1 | 1930.5 | 518 |
| 2 | 1858.7 | 538 |
| 3 | 1792.1 | 558 |
| 4 | 1730.1 | 578 |
| 5 | 1672.2 | 598 |
| 6 | 1618.1 | 618 |
| 7 | 1567.4 | 638 |
| 8 | 1519.8 | 658 |
| 9 | 1474.9 | 678 |
| 10 | 1432.7 | 698 |
| 11 | 1392.8 | 718 |
| 12 | 1355 | 738 |
| 13 | 1319.3 | 758 |
| 14 | 1285.3 | 778 |
| 15 | 1253.1 | 798 |
| 16 | 1222.5 | 818 |
| 17 | 1193.3 | 838 |
| 18 | 1165.6 | 858 |
| 19 | 1139 | 878 |
| 20 | 1113.6 | 898 |
| 21 | 1089.3 | 918 |
| 22 | 1066.1 | 938 |
| 23 | 326.2 | 3066 |

The aggregate is the average of the percentage of successful detections of Short Pulse Radar Types 1-4. For example, the following table indicates how to compute the aggregate of percentage of successful detections.

| Radar Type | Number of Trials | Number of Successful Detections | Minimum Percentage of Successful Detection |
|---|------------------|----------------------------------|--|
| 1 | 35 | 29 | 82.9% |
| 2 | 30 | 18 | 60% |
| 3 | 30 | 27 | 90% |
| 4 | 50 | 44 | 88% |
| Aggregate (82.9% + 60% + 90% + 88%)/4 = 80.2% | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printe overleaf, available on request or accessible at https://www.sgs.com/en/Ferms-and-Conditions.aspx and, for electronic format documents subject to Terms and Conditions for Electronic Document.aspx Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of intervention only and within the limitst Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to transaction from exercising all their rights and obligations under the transaction document does not exonerate parties to transaction from exercising all their rights and obligations under the transaction forcement cannot be reproduce except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extent of the law Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention T. Ocheck the authenticity of testing diverse that the company of t

South of No. 6 Pfart, No. 1, Runsheng Read, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Fee Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 15 of 85

4.1.13 Long Pulse Radar Test Waveform

| Radar Type | Pulse Width (µsec) | Chirp Width (MHz) | PRI (µsec) | Number of Pulses per <i>Burst</i> | Number of Bursts | Minimum Percentage of Successful Detection | Minimum Number of Trials |
|---------------|--------------------------|-------------------------|------------|---|---------------------|--|--------------------------------|
| 5 | 50-100 | 5-20 | 1000-2000 | 1-3 | 8-20 | 80% | 30 |

Each waveform is defined as follows:

- 1) The transmission period for the Long Pulse Radar test signal is 12 seconds.
- 2) There are a total of 8 to 20 Bursts in the 12 second period, with the number of Bursts being randomly chosen. This number is Burst Count.
- 3) Each Burst consists of 1 to 3 pulses, with the number of pulses being randomly chosen. Each Burst within the 12 second sequence may have a different number of pulses.
- 4) The pulse width is between 50 and 100 microseconds, with the pulse width being randomly chosen. Each pulse within a Burst will have the same pulse width. Pulses in different Bursts may have different pulse widths.
- 5) Each pulse has a linear frequency modulated chirp between 5 and 20 MHz, with the chirp width being randomly chosen. Each pulse within a transmission period will have the same chirp width. The chirp is centered on the pulse. For example, with a radar frequency of 5300 MHz and a 20 MHz chirped signal, the chirp starts at 5290 MHz and ends at 5310 MHz.
- 6) If more than one pulse is present in a Burst, the time between the pulses will be between 1000 and 2000 microseconds, with the time being randomly chosen. If three pulses are present in a Burst, the random time interval between the first and second pulses is chosen independently of the random time interval between the second and third pulses.
- 7) The 12 second transmission period is divided into even intervals. The number of intervals is equal to Burst Count. Each interval is of length (12,000,000 / Burst Count) microseconds. Each interval contains one Burst. The start time for the Burst, relative to the beginning of the interval, is between 1 and [(12,000,000 / Burst Count) (Total Burst Length) + (One Random PRI Interval)] microseconds, with the start time being randomly chosen. The step interval for the start time is 1 microsecond. The start time for each Burst is chosen randomly.

4.1.14 Frequency Hopping Radar Test Waveform

| Radar Type | Pulse Width (µsec) | Chirp Width (MHz) | PRI (µsec) | Number of Pulses per <i>Burst</i> | Number of Bursts | Minimum Percentage of Successful Detection | Minimum Number of Trials |
|---------------|--------------------------|-------------------------|------------|---|---------------------|--|--------------------------------|
| 6 | 1 | 333 | 9 | 0.333 | 300 | 70% | 30 |

For the Frequency Hopping Radar Type, the same Burst parameters are used for each waveform. The hopping sequence is different for each waveform and a 100-length segment is selected from the hopping sequence defined by the following algorithm: If a segment does not contain at least 1 frequency within the U-NII Detection Bandwidth of the UUT, then that segment is not used.

The detailed test data see: Appendix



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx. and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-en-Document.aspx. and the state of the state of

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 16 of 85

5 Measurement Uncertainty (95% confidence levels, k=2)

| No. | Item | Measurement Uncertainty |
|-----|-----------------|-------------------------|
| 1 | Radio Frequency | ±1.0 % |

Remark:

The U_{lab} (lab Uncertainty) is less than U_{cispr/ETSI} (CISPR/ETSI Uncertainty), so the test results

- compliance is deemed to occur if no measured disturbance level exceeds the disturbance limit;
- non-compliance is deemed to occur if any measured disturbance level exceeds the disturbance limit.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents a thite://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest settent of the law. Unless otherwise stated the results of the company of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest settent of the law. Unless otherwise stated the results of the company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) tested and such sample(s) are retained for 30 days only.

**Total Content of the Company of the sample (s) testing inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or remail: Content of the content of

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone
中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 17 of 85

6 Equipment List

| U Equipment List | | | | | | | | |
|--|-------------------|---------------------------------|---------------|--------------------------|---------------------------|--|--|--|
| | | RF Test Eq | uipment | | | | | |
| Equipment | Manufacturer | Model No. | Inventory No. | Cal Date (yyyy/mm/dd) | Cal Due Date (yyyy/mm/dd) | | | |
| Shielding Room | Brilliant-emc | N/A | SUWI-04-01-06 | 2021/05/08 | 2024/05/07 | | | |
| Temperature and humidity meter | MingGao | TH101B | SUWI-01-01-07 | 2022/02/16 | 2023/02/15 | | | |
| Signal Analyzer | ROHDE &SCHWARZ | FSV3030 | SUWI-01-02-02 | 2022/05/17 | 2023/05/16 | | | |
| Measurement Software | Tonscend | JS1120-3 Test System V3.1.55 | SUWI-02-09-09 | NCR | NCR | | | |
| DC Power Supply | HYELEC | HY3005B | SUWI-01-18-01 | 2022/02/15 | 2023/02/14 | | | |
| Signal Analyzer | ROHDE &SCHWARZ | FSW43 | SUWI-01-02-04 | 2022/05/28 | 2023/05/27 | | | |
| Power meter | Anritsu | ML2495A | SUWI-01-31-01 | 2021/12/04 | 2022/12/03 | | | |
| | 7 | | | 2022/11/23 | 2023/11/22 | | | |
| Pulse power | A | MA2411B | SUWI-01-32-01 | 2021/12/04 | 2022/12/03 | | | |
| sensor | Anritsu | WAZ411D | | 2022/11/23 | 2023/11/22 | | | |
| MXG Vector signal genitor | KEYSIGHT | N5182B | SUWI-01-38-01 | 2022/02/14 | 2023/02/13 | | | |
| Temperature Chamber | ESPEC | SU-242 | SUWI-01-13-01 | 2022/02/15 | 2023/02/14 | | | |
| Wideband Radio Communication Tester | ROHDE &SCHWARZ | CMW500 | SUWI-01-16-05 | 2022/02/14 | 2023/02/13 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 18 of 85

7 Photographs - Setup Photos

Refer to Appendix A.2 WLAN Setup Photos.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printe overleaf, available on request or accessible at https://www.sgs.com/en/Ferms-and-Conditions.aspx and, for electronic format documents subject to Terms and Conditions for Electronic Document.aspx Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of intervention only and within the limitst Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to transaction from exercising all their rights and obligations under the transaction document does not exonerate parties to transaction from exercising all their rights and obligations under the transaction forcement cannot be reproduce except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extent of the law Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention T. Ocheck the authenticity of testing diverse that the company of t

South of No. 6 Pfant, No. 1, Runsheng Road, Suchou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 19 of 85

Appendix



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printe overleaf, available on request or accessible at http://www.sgs.com/en/Terms.and-Conditions.apx and for electronic format documents subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-en-Document.aspx Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document I advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduce except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content of appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are refunded for 30 days only.

or email: CN.Doccheck@sgs.com | South of No. 6 Plant, No. 1, Runsheng Read, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 t (86–512) 62992980 www.sgsg

中国 • 苏州 • 中国(江苏)自由贸易试验区苏州上业园区润胜路(号的6号厂房南部 邮编: 215000



Report No.: SEWA2209000044RG06

Rev.: 01

20 of 85 Page:

DFS Detection Thresholds Test Result

| TestMode | Frequency[dbm] | Radar Type | Result | Gain | Limit[dbm] | Verdict |
|------------|----------------|---------------|--------|------|------------|---------|
| | | Type0 | -54.81 | 7.35 | -54.65 | PASS |
| | | Type1 | -54.78 | 7.35 | -54.65 | PASS |
| | | Type2 | -54.71 | 7.35 | -54.65 | PASS |
| 11ac80SISO | 5530 | Type3 | -54.78 | 7.35 | -54.65 | PASS |
| | | Type4 | -54.66 | 7.35 | -54.65 | PASS |
| | | Type5 | -54.86 | 7.35 | -54.65 | PASS |
| | | Type6 | -55.09 | 7.35 | -54.65 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国・苏州・中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86-512) 62992980 t (86-512) 62992980




Report No.: SEWA2209000044RG06

Rev.: 01

Page: 21 of 85

Test Graphs

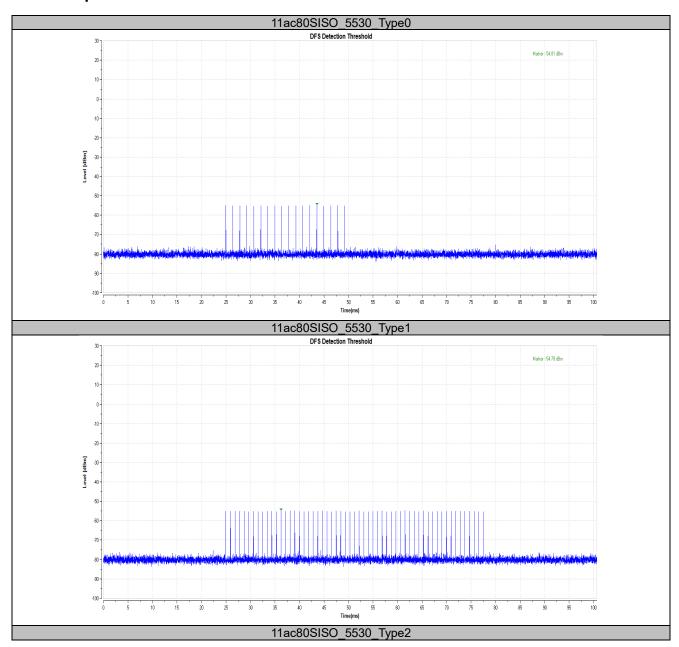



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents at <a href="http://www.sgs.com/en/Terms-and-Conditions-and-Conditions-and-Conditions-And-Conditions-


South of No. 6 Plant, No. 1, Runshang Rosad, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 • 苏州 • 中国(江苏)自由贸易试验区苏州片区苏州工业园区河胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

22 of 85 Page:

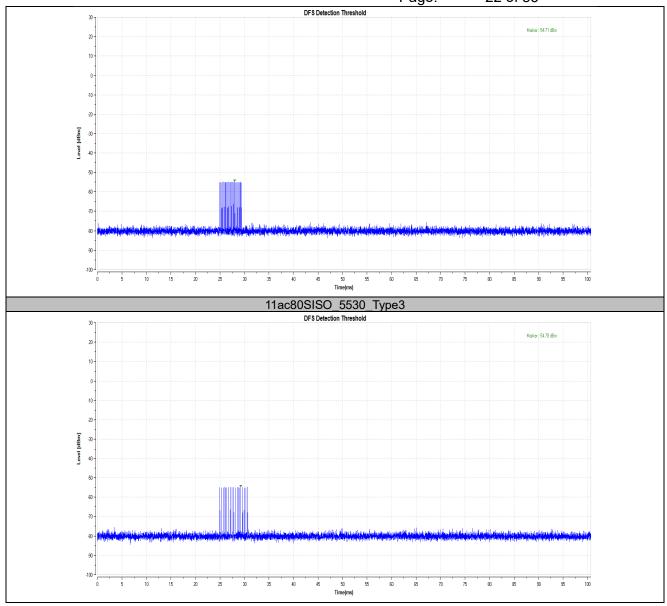



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents a thittp://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000


t (86-512) 62992980

t (86-512) 62992980 www.sgsgroup.com.cn sgs.china@sgs.com



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 23 of 85

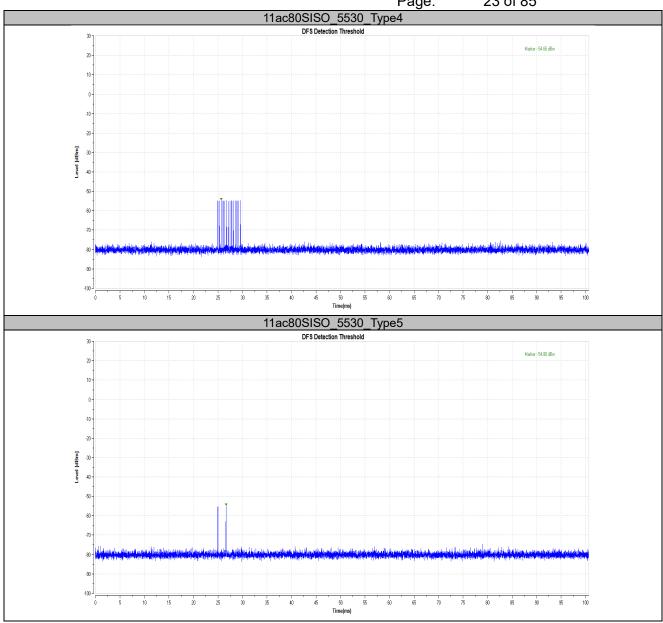




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents at <a href="http://www.sgs.com/en/Terms-and-Conditions-and-Conditions-and-Conditions-And-Conditions-

South of No. 6 Pfart, No. 1, Runsheng Read, Suchou Industrial Park, Suchou Area, China (liangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 w t (86–512) 62992980 sg



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 24 of 85

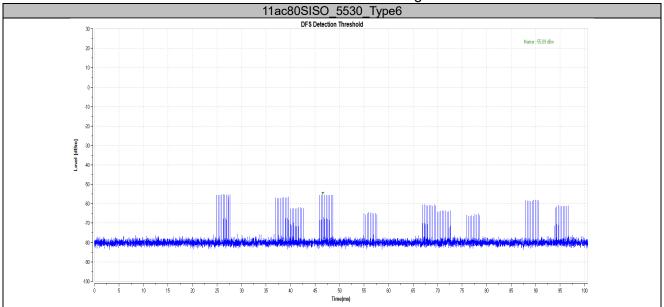



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, Chine (Jiangsu) Pillot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 v t (86–512) 62992980 s




Report No.: SEWA2209000044RG06

Rev.: 01

Page: 25 of 85

Data Traffic Plot Test Graphs

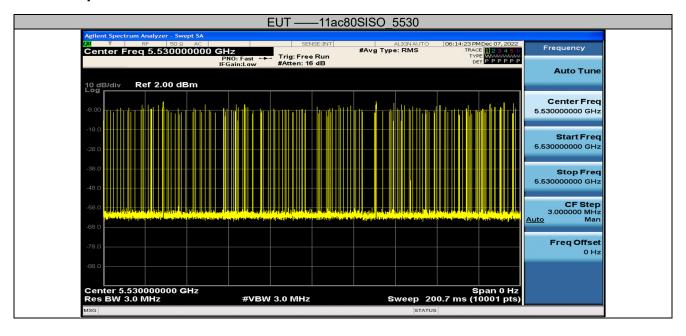



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com


South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区河胜路1号的6号厂房南部 邮编: 215000



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 26 of 85

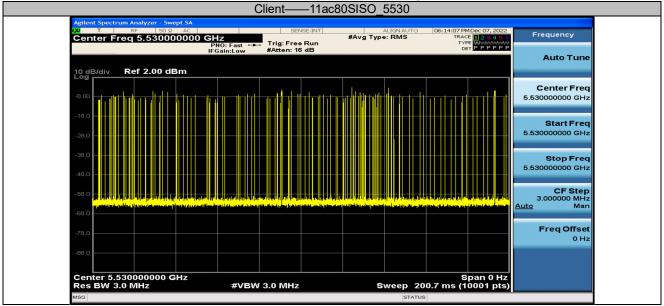



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com


South of No. 6 Pfart, No. 1, Runsheng Read, Suchou Industrial Park, Suchou Area, China (liangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 27 of 85

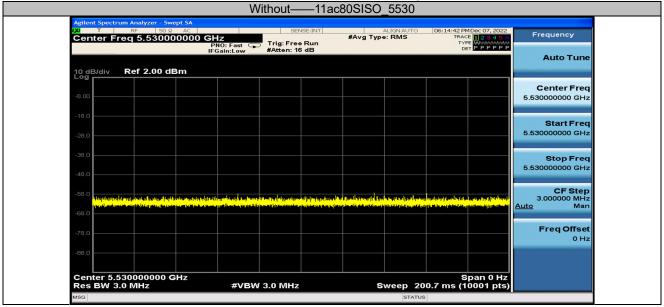



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents at <a href="http://www.sgs.com/en/Terms-and-Conditions-and-Conditions-and-Conditions-And-Conditions-

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000

中国 • 苏州 • 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000



Report No.: SEWA2209000044RG06

Rev.: 01

28 of 85 Page:

Channel Loading Test Result

| TestMode | Frequency[MHz] | Result | Limit [%] | Verdict |
|------------|----------------|--------|-----------|---------|
| 11ac80SISO | 5530 | 19.63 | 17 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86-512) 62992980 t (86-512) 62992980




Report No.: SEWA2209000044RG06

Rev.: 01

Page: 29 of 85

Test Graphs

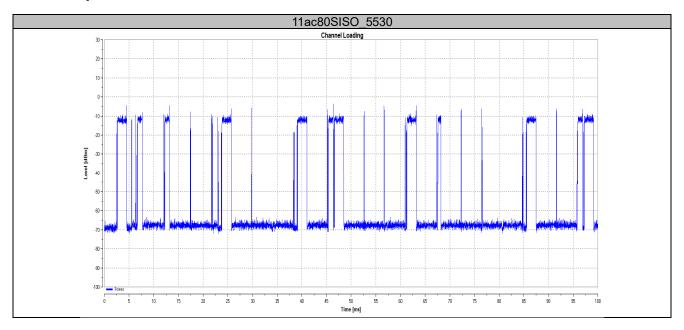



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CND occheck@ss.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suzhou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 30 of 85

Channel Availability Check Time Test Result

| TestMode | Frequency[MHz] | Result | Verdict |
|------------|----------------|----------------|---------|
| 11ac80SISO | 5530 | See test Graph | PASS |

| TestMode | Frequency[MHz] | Result | Verdict |
|------------|----------------|----------------|---------|
| 11ac80SISO | 5530 | See test Graph | PASS |

| TestMode | Frequency[MHz] | Result | Verdict |
|------------|----------------|----------------|---------|
| 11ac80SISO | 5530 | See test Graph | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falisfication of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ss.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 w t (86–512) 62992980 s




Report No.: SEWA2209000044RG06

Rev.: 01

Page: 31 of 85

Test Graphs

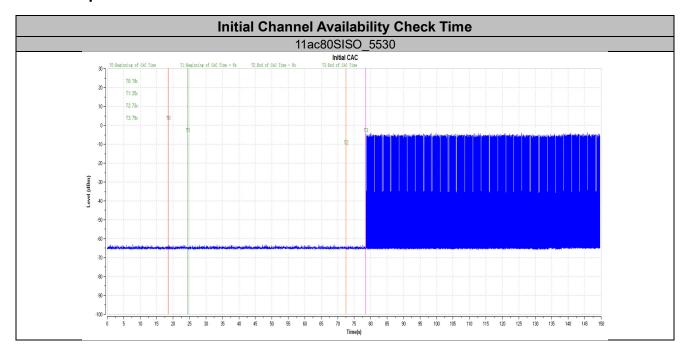



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 • 苏州 • 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86–512) 62992980 sgs.china@sgs.com


www.sgsgroup.com.cn



Report No.: SEWA2209000044RG06

Rev.: 01

32 of 85 Page:

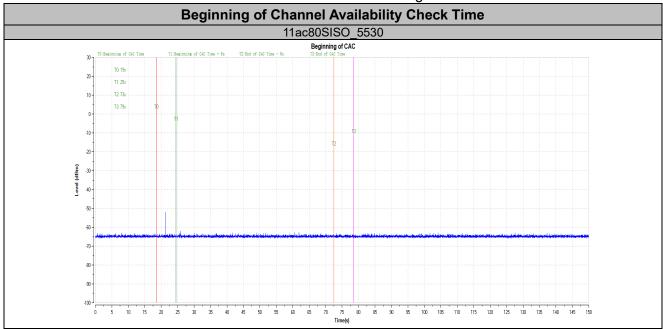



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 • 苏州 • 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86–512) 62992980 sgs.china@sgs.com


www.sgsgroup.com.cn



Report No.: SEWA2209000044RG06

Rev.: 01

33 of 85 Page:

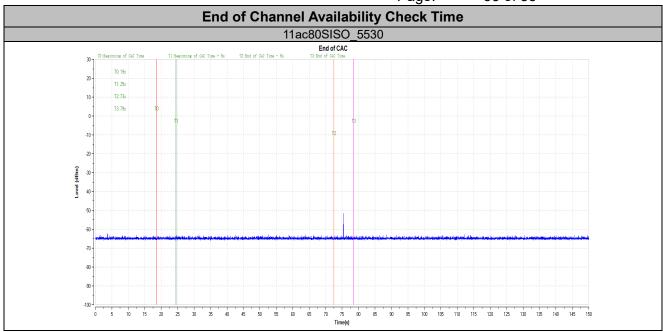



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 • 苏州 • 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86–512) 62992980 sgs.china@sgs.com

www.sgsgroup.com.cn



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 34 of 85

Channel Move Time and Channel Closing Transmission Time Test Result

| TestMode | Frequency[MHz] | CCTT[ms] | Limit[ms] | CMT[ms] | Limit[ms] | Verdict |
|------------|----------------|----------|-----------|---------|-----------|---------|
| 11ac80SISO | 5530 | 200+55.9 | 200+60 | 998.1 | 10000 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falisfication of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ss.com

South of No. 6 Pfant, No. 1, Runsheng Road, Suchou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000




Report No.: SEWA2209000044RG06

Rev.: 01

Page: 35 of 85

Test Graphs

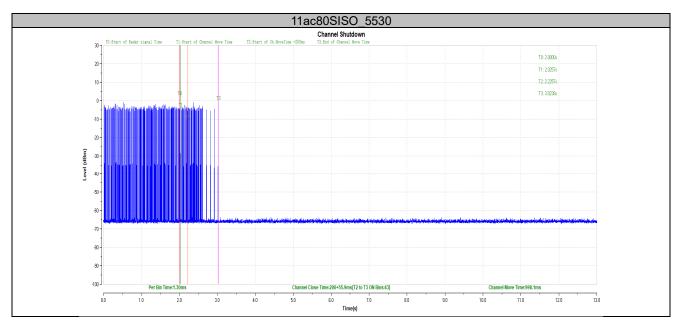



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Pfant, No. 1, Runsheng Road, Suchou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 36 of 85

Non-Occupancy Period

Test Result

| TestMode | Frequency[MHz] | Result | Limit[s] | Verdict |
|------------|----------------|----------------|----------|---------|
| 11ac80SISO | 5530 | see test graph | ≥1800 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falisfication of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ss.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Infustrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 wv t (86–512) 62992980 sg




Report No.: SEWA2209000044RG06

Rev.: 01

Page: 37 of 85

Test Graphs

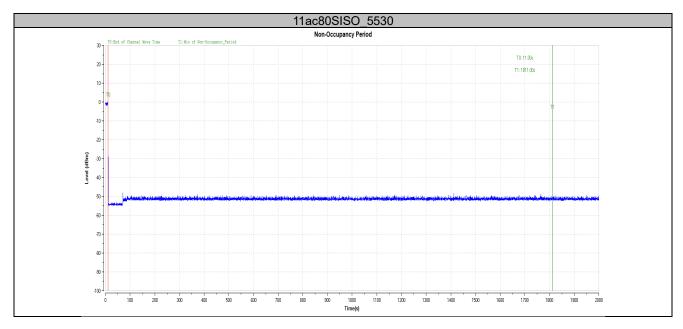



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CND occheck@ss.com

South of No. 6 Pfart, No. 1, Runsheng Road, Suchou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 38 of 85

U-NII Detection Bandwidth

Test Result

| TestMode | Frequency[MHz] | FL[MHz] | FH[MHz] | Detection Bandwidth [MHz] | OCB [MHz] | Ratio [%] | Limit [%] | Verdict |
|------------|----------------|---------|---------|---------------------------|--------------|--------------|--------------|---------|
| 11ac20SISO | 5500 | 5490 | 5510 | 20 | 18.858 | 106.05 | ≥100 | PASS |
| 11ac40SISO | 5510 | 5490 | 5530 | 40 | 36.337 | 110.08 | ≥100 | PASS |
| 11ac80SISO | 5530 | 5490 | 5570 | 80 | 76.350 | 104.77 | ≥100 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falisfication of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ss.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 39 of 85

| T (| | Б. | T | T : 1 | T : 1 | T : 1 | T ago | | | 71 00 | T : 1 | T : 1 | D :: |
|------------|------------------|-------|----------|--------------|--------------|----------|----------|----------|----------|---------------------------------------|--------------|-------|-------|
| Test | Frequency[MHz] | Radar | Trial | Trial | Trial | Trial | Trial | Trial | Trial | Trial | Trial | Trial | Ratio |
| Mode | r roquonoy[mni2] | Freq. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | (%) |
| | | 5485 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5486 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5487 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5488 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5489 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5490 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5495 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 1100000100 | 5500 | 5500 | | 1 | 1 | 1 | 1 | | 1 | 1 | 1 | 1 | 100 |
| 1180203130 | 11ac20SISO 5500 | | 1 | | | | | 1 | | | | | |
| | | 5505 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5510 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5511 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5512 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5513 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5514 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5515 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5485 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5486 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5487 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5488 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5489 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5490 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5495 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5500 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5505 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 11ac40SISO | 5510 | 5510 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 1180405150 | 5510 | | | 1 | 1 | 1 | | | | 1 | 1 | 1 | |
| | | 5515 | 1 | | | | 1 | 1 | 1 | | | | 100 |
| | | 5520 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5525 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5530 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5531 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5532 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5533 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5534 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5535 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5485 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5486 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5487 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5488 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5489 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| | | 5490 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5495 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5500 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5505 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5510 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 11ac80SISO | 5530 | 5515 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 1140003130 | 3330 | | | | | | | | | | | | |
| | | 5520 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5525 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5530 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5535 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5540 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5545 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5550 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5555 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5560 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| | | 5565 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 1 | | | <u> </u> | <u> </u> | <u> </u> | <u> </u> | <u> </u> | <u> </u> | <u> </u> | · · · · · · · · · · · · · · · · · · · | <u> </u> | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 www t (86–512) 62992980 sgs.c



Report No.: SEWA2209000044RG06

01 Rev.:

40 of 85 Page:

| 5570 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
|------|---|---|---|---|---|---|---|---|---|---|-----|
| 5571 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 5572 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 5573 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 5574 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 5575 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国。苏州。中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86-512) 62992980 t (86-512) 62992980




Report No.: SEWA2209000044RG06

Rev.: 01

Page: 41 of 85

Test Graphs

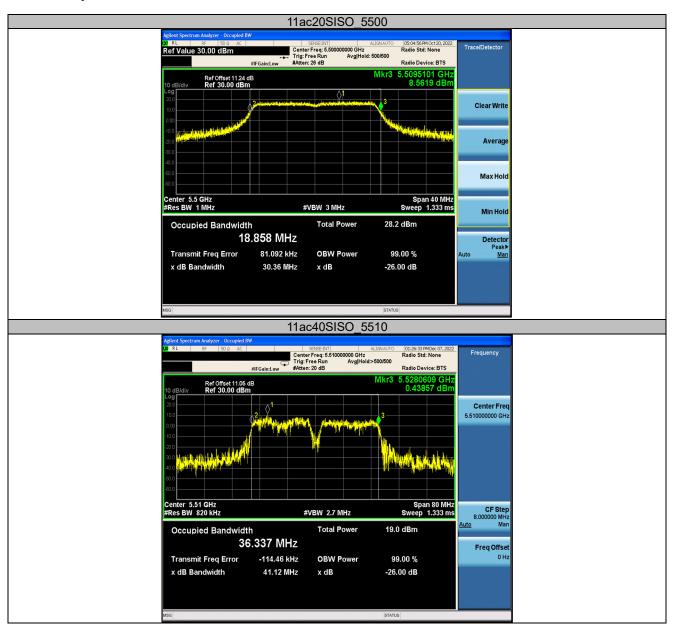

11ac80SISO 5530



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at https://www.sgs.com/en/Terms-and-Conditions.aspx.and, for electronic Documents at https://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx.and, and, for electronic Documents at <a href="https://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx.and. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or faisification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest exclaimed for 30 days only.

Attention To chie the produced provided the sample(s) lested and such sample(s) are retained for 30 days only.

The sample of the sample of the sample(s) lested and such sample(s) are retained for 30 days only.

The sample of the sample of the sample (s) lested and such sample(s) are retained for 30 days only.

The sample of the sample (s) lested and such sample(s) are retained for 30 days only.

The sample of the sample (s) lested and such sample(s) are retained for 30 days only.

South of No. 6 Plant, No. 1, Runshang Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国·苏州·中国(江苏)自由贸易试验区苏州片区苏州工业园区洞胜路1号的6号厂房南部 邮编: 215000


t (86–512) 62992980 www.sgsgroup.com.cn t (86–512) 62992980 sgs.china@sgs.com



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 42 of 85

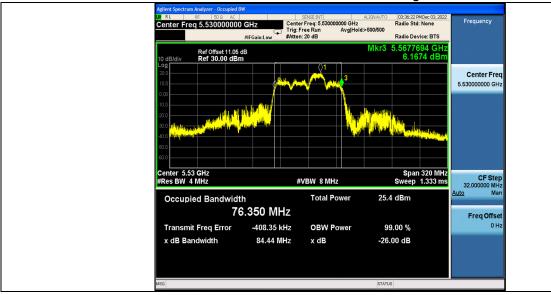



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CND occheck@ss.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区河胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 www.sgsgroup.com.cn t (86–512) 62992980 sgs.china@sgs.com



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 43 of 85

Statistical Performance check

Test Result

| TestMode | Frequency[MHz] | Radar Type | Pass Times | Fail Times | Probability (%) | Limit (%) | Verdict |
|------------|----------------|------------|---------------|---------------|--------------------|--------------|---------|
| | | Type1 | 30 | 0 | 100.00 | 60 | PASS |
| | | Type2 | 30 | 0 | 100.00 | 60 | PASS |
| | | Type3 | 28 | 2 | 93.33 | 60 | PASS |
| 11ac20SISO | 5500 | Type4 | 30 | 0 | 100.00 | 60 | PASS |
| | | Type 1-4 | | | 98.33 | 80 | PASS |
| | | Type5 | 29 | 1 | 96.67 | 80 | PASS |
| | | Type6 | 30 | 0 | 100.00 | 70 | PASS |
| | | Type1 | 29 | 1 | 96.67 | 60 | PASS |
| | 5510 | Type2 | 30 | 0 | 100.00 | 60 | PASS |
| | | Type3 | 29 | 1 | 96.67 | 60 | PASS |
| 11ac40SISO | | Type4 | 30 | 0 | 100.00 | 60 | PASS |
| | | Type 1-4 | | | 98.33 | 80 | PASS |
| | | Type5 | 29 | 1 | 96.67 | 80 | PASS |
| | | Type6 | 30 | 0 | 100.00 | 70 | PASS |
| | | Type1 | 28 | 2 | 93.33 | 60 | PASS |
| | | Type2 | 30 | 0 | 100.00 | 60 | PASS |
| | | Type3 | 30 | 0 | 100.00 | 60 | PASS |
| 11ac80SISO | 5530 | Type4 | 26 | 4 | 86.67 | 60 | PASS |
| | | Type 1-4 | | | 95.00 | 80 | PASS |
| | | Type5 | 30 | 0 | 100.00 | 80 | PASS |
| | | Type6 | 30 | 0 | 100.00 | 70 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

01 Rev.:

44 of 85 Page:

| TestMode | Frequency[MHz] | Radar Type | Trial ID | Pulse width(µs) | PRI(µs) | Pulses per Burst | Detection (1: Yes; 0: No) |
|------------|----------------|------------|-------------|--------------------|---------|---------------------|------------------------------|
| | | Type1 | 0 | 1.0 | 938.0 | 57 | 1 |
| | | Type1 | 1 | 1.0 | 698.0 | 76 | 1 |
| | | Type1 | 2 | 1.0 | 618.0 | 86 | 1 |
| | | Type1 | 3 | 1.0 | 538.0 | 99 | 1 |
| | | Type1 | 4 | 1.0 | 878.0 | 61 | 1 |
| | | Type1 | 5 | 1.0 | 3066.0 | 18 | 1 |
| | | Type1 | 6 | 1.0 | 638.0 | 83 | 1 |
| | | Type1 | 7 | 1.0 | 918.0 | 58 | 1 |
| | | Type1 | 8 | 1.0 | 838.0 | 63 | 1 |
| | | Type1 | 9 | 1.0 | 858.0 | 62 | 1 |
| | | Type1 | 10 | 1.0 | 798.0 | 67 | 1 |
| | | Type1 | 11 | 1.0 | 718.0 | 74 | 1 |
| | | Type1 | 12 | 1.0 | 578.0 | 92 | 1 |
| | | Type1 | 13 | 1.0 | 598.0 | 89 | 1 |
| | | Type1 | 14 | 1.0 | 558.0 | 95 | 1 |
| | | Type1 | 15 | 1.0 | 2536.0 | 21 | 1 |
| | | Type1 | 16 | 1.0 | 966.0 | 55 | 1 |
| | | Type1 | 17 | 1.0 | 827.0 | 64 | 1 |
| | | Type1 | 18 | 1.0 | 2501.0 | 22 | 1 |
| | | Type1 | 19 | 1.0 | 2595.0 | 21 | 1 |
| | | Type1 | 20 | 1.0 | 1114.0 | 48 | 1 |
| | | Type1 | 21 | 1.0 | 1302.0 | 40 | 1 |
| | | Type1 | 22 | 1.0 | 3045.0 | 18 | 1 |
| | | | 23 | 1.0 | | 33 | 1 |
| | | Type1 | 24 | | 1624.0 | | 1 |
| | | Type1 | | 1.0 | 2878.0 | 19 | • |
| | | Type1 | 25 | 1.0 | 1027.0 | 52 | 1 |
| | | Type1 | 26 | 1.0 | 2485.0 | 22 | 1 |
| | | Type1 | 27 | 1.0 | 1600.0 | 33 | 1 |
| | | Type1 | 28 | 1.0 | 1172.0 | 46 | 1 |
| | | Type1 | 29 | 1.0 | 1177.0 | 45 | 1 |
| | | Type2 | 0 | 3.2 | 179.0 | 26 | 1 |
| | | Type2 | 1 | 1.1 | 207.0 | 23 | 1 |
| | | Type2 | 2 | 2.1 | 230.0 | 24 | 1 |
| | | Type2 | 3 | 4.8 | 200.0 | 29 | 1 |
| | | Type2 | 4 | 3.9 | 214.0 | 28 | 1 |
| | | Type2 | 5 | 2.9 | 222.0 | 26 | 1 |
| | | Type2 | 6 | 3.2 | 204.0 | 26 | 1 |
| | | Type2 | 7 | 2.5 | 192.0 | 25 | 1 |
| | | Type2 | 8 | 3.1 | 164.0 | 26 | 1 |
| | | Type2 | 9 | 1.2 | 156.0 | 23 | 1 |
| | | Type2 | 10 | 3.9 | 210.0 | 27 | 1 |
| | | Type2 | 11 | 4.6 | 201.0 | 29 | 1 |
| | | Type2 | 12 | 3.2 | 162.0 | 26 | 1 |
| | | Type2 | 13 | 2.2 | 197.0 | 25 | 1 |
| | | Type2 | 14 | 4.5 | 163.0 | 29 | 1 |
| | | Type2 | 15 | 3.0 | 203.0 | 26 | 1 |
| | | Type2 | 16 | 5.0 | 168.0 | 29 | 1 |
| | | Type2 | 17 | 2.4 | 217.0 | 25 | 1 |
| | | Type2 | 18 | 2.9 | 191.0 | 26 | 1 |
| | | Type2 | 19 | 2.3 | 166.0 | 25 | 1 |
| | | Type2 | 20 | 3.7 | 150.0 | 27 | 1 |
| | | Type2 | 21 | 2.2 | 176.0 | 25 | 1 |
| | | Type2 | 22 | 4.9 | 195.0 | 29 | 1 |
| | | Type2 | 23 | 2.9 | 202.0 | 26 | 1 |
| 11ac20SISO | 5500 | Type2 | 24 | 2.5 | 178.0 | 25 | 1 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国。苏州。中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86-512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

45 of 85 Page:

| | | | Page: | 45 01 85 | |
|----------------|--------|------|-------|----------|---|
| Type2 | 25 | 1.1 | 206.0 | 23 | 1 |
| Type2 | 26 | 3.8 | 155.0 | 27 | 1 |
| Type2 | 27 | 4.7 | 157.0 | 29 | 1 |
| Type2 | 28 | 2.4 | 224.0 | 25 | 1 |
| Type2 | 29 | 4.2 | 159.0 | 28 | 1 |
| Type3 | 0 | 8.2 | 355.0 | 17 | 1 |
| Type3 | 1 | 6.1 | 487.0 | 16 | 1 |
| Type3 | 2 | 7.1 | 344.0 | 16 | 1 |
| Type3 | 3 | 9.8 | 288.0 | 18 | 1 |
| | 4 | 8.9 | 230.0 | 18 | 1 |
| Type3 | | | | | |
| Type3 | 5 | 7.9 | 432.0 | 17 | 1 |
| Type3 | 6 7 | 8.2 | 207.0 | 17 | 1 |
| Type3 | | 7.5 | 443.0 | 17 | 0 |
| Type3 | 8 | 8.1 | 439.0 | 17 | 1 |
| Type3 | 9 | 6.2 | 223.0 | 16 | 0 |
| Type3 | 10 | 8.9 | 208.0 | 18 | 1 |
| Type3 | 11 | 9.6 | 463.0 | 18 | 1 |
| Type3 | 12 | 8.2 | 441.0 | 17 | 1 |
| Type3 | 13 | 7.2 | 323.0 | 16 | 1 |
| Type3 | 14 | 9.5 | 297.0 | 18 | 1 |
| Type3 | 15 | 8.0 | 412.0 | 17 | 1 |
| Type3 | 16 | 10.0 | 324.0 | 18 | 1 |
| Type3 | 17 | 7.4 | 271.0 | 17 | 1 |
| Type3 | 18 | 7.9 | 349.0 | 17 | 1 |
| Type3 | 19 | 7.3 | 409.0 | 16 | 1 |
| Type3 | 20 | 8.7 | 373.0 | 18 | 1 |
| Type3 | 21 | 7.2 | 254.0 | 16 | 1 |
| Type3 | 22 | 9.9 | 274.0 | 18 | 1 |
| Type3 | 23 | 7.9 | 278.0 | 17 | 1 |
| Type3 | 24 | 7.5 | 317.0 | 17 | 1 |
| Type3 | 25 | 6.1 | 260.0 | 16 | 1 |
| Type3 | 26 | 8.8 | 211.0 | 18 | 1 |
| Type3 | 27 | 9.7 | 272.0 | 18 | 1 |
| Type3 | 28 | 7.4 | 264.0 | 17 | 1 |
| Type3 | 29 | 9.2 | 284.0 | 18 | 1 |
| Type4 | 0 | 16.0 | 355.0 | 14 | 1 |
| Type4 | 1 | 11.3 | 487.0 | 12 | 1 |
| Type4 | 2 | 13.5 | 344.0 | 13 | 1 |
| Type4 | 3 | 19.4 | 288.0 | 16 | 1 |
| | 4 | 17.5 | 230.0 | 15 | 1 |
| Type4 Type4 | 5 | 15.3 | 432.0 | 14 | 1 |
| | | | | 14 | ' |
| Type4 | 6 | 15.9 | 207.0 | 13 | 1 |
| Type4 | 7 | 14.3 | 443.0 | | |
| Type4 | 8 | 15.8 | 439.0 | 14 | 1 |
| Type4 | 9 | 11.5 | 223.0 | 12 | 1 |
| Type4 | 10 | 17.4 | 208.0 | 15 | 1 |
| Type4 | 11 | 19.0 | 463.0 | 16 | 1 |
| Type4 | 12 | 16.0 | 441.0 | 14 | 1 |
| Type4 | 13 | 13.8 | 323.0 | 13 | 1 |
| Type4 | 14 | 18.9 | 297.0 | 16 | 1 |
| Type4 | 15 | 15.5 | 412.0 | 14 | 1 |
| Type4 | 16 | 19.9 | 324.0 | 16 | 1 |
| Type4 | 17 | 14.1 | 271.0 | 13 | 1 |
| Type4 | 18 | 15.2 | 349.0 | 14 | 1 |
| Type4 | 19 | 13.8 | 409.0 | 13 | 1 |
| Type4 | 20 | 17.1 | 373.0 | 15 | 1 |
| Type4 | 21 | 13.8 | 254.0 | 13 | 1 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国・苏州・中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86-512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 46 of 85

| | | | | | i agc. | 1 0 01 03 | |
|------------|------|-------|----|------|--------|----------------------|----------|
| | | Type4 | 22 | 19.8 | 274.0 | 16 | 1 |
| | | Type4 | 23 | 15.3 | 278.0 | 14 | 1 |
| | | Type4 | 24 | 14.5 | 317.0 | 13 | 1 |
| | | Type4 | 25 | 11.3 | 260.0 | 12 | 1 |
| | | Type4 | 26 | 17.3 | 211.0 | 15 | 1 |
| | | Type4 | 27 | 19.2 | 272.0 | 16 | 1 |
| | | Type4 | 28 | 14.2 | 264.0 | 13 | 1 |
| | | Type4 | 29 | 18.2 | 284.0 | 15 | 1 |
| | | Type1 | 0 | 1.0 | 938.0 | 57 | 1 |
| | | Type1 | 1 | 1.0 | 698.0 | 76 | 0 |
| | | Type1 | 2 | 1.0 | 618.0 | 86 | 1 |
| | | | 3 | 1.0 | 538.0 | 99 | 1 |
| | | Type1 | | | 878.0 | | |
| | | Type1 | 4 | 1.0 | | 61 | 1 |
| | | Type1 | 5 | 1.0 | 3066.0 | 18 | 1 |
| | | Type1 | 6 | 1.0 | 638.0 | 83 | 1 |
| | | Type1 | 7 | 1.0 | 918.0 | 58 | 1 |
| | | Type1 | 8 | 1.0 | 838.0 | 63 | 1 |
| | | Type1 | 9 | 1.0 | 858.0 | 62 | 1 |
| | | Type1 | 10 | 1.0 | 798.0 | 67 | 1 |
| | | Type1 | 11 | 1.0 | 718.0 | 74 | 1 |
| | | Type1 | 12 | 1.0 | 578.0 | 92 | 1 |
| | | Type1 | 13 | 1.0 | 598.0 | 89 | 1 |
| | | Type1 | 14 | 1.0 | 558.0 | 95 | 1 |
| | | Type1 | 15 | 1.0 | 2536.0 | 21 | 1 |
| | | Type1 | 16 | 1.0 | 966.0 | 55 | 1 |
| | | Type1 | 17 | 1.0 | 827.0 | 64 | 1 |
| | | Type1 | 18 | 1.0 | 2501.0 | 22 | 1 |
| | | Type1 | 19 | 1.0 | 2595.0 | 21 | 1 |
| | | Type1 | 20 | 1.0 | 1114.0 | 48 | 1 |
| | | Type1 | 21 | 1.0 | 1302.0 | 41 | 1 |
| | | Type1 | 22 | 1.0 | 3045.0 | 18 | 1 |
| | | Type1 | 23 | 1.0 | 1624.0 | 33 | 1 |
| 11ac40SISO | 5510 | Type1 | 24 | 1.0 | 2878.0 | 19 | 1 |
| | | Type1 | 25 | 1.0 | 1027.0 | 52 | 1 |
| | | Type1 | 26 | 1.0 | 2485.0 | 22 | 1 |
| | | Type1 | 27 | 1.0 | 1600.0 | 33 | 1 |
| | | Type1 | 28 | 1.0 | 1172.0 | 46 | 1 |
| | | Type1 | 29 | 1.0 | 1177.0 | 45 | 1 |
| | | Type2 | 0 | 3.2 | 179.0 | 26 | 1 |
| | | Type2 | 1 | 1.1 | 207.0 | 23 | 1 |
| | | Type2 | 2 | 2.1 | 230.0 | 24 | 1 |
| | | Type2 | 3 | 4.8 | 200.0 | 29 | 1 |
| | | Type2 | 4 | 3.9 | 214.0 | 28 | 1 |
| | | Type2 | 5 | 2.9 | 222.0 | 26 | 1 |
| | | Type2 | 6 | 3.2 | 204.0 | 26 | 1 |
| | | Type2 | 7 | 2.5 | 192.0 | 25 | 1 |
| | | Type2 | 8 | 3.1 | 164.0 | 26 | 1 |
| | | Type2 | 9 | 1.2 | 156.0 | 23 | 1 |
| | | Type2 | 10 | 3.9 | 210.0 | 27 | 1 |
| | | Type2 | 11 | 4.6 | 201.0 | 29 | 1 |
| | | Type2 | 12 | 3.2 | 162.0 | 26 | 1 |
| | | Type2 | 13 | 2.2 | 197.0 | 25 | 1 |
| | | Type2 | 14 | 4.5 | 163.0 | 29 | 1 |
| | | Type2 | 15 | 3.0 | 203.0 | 26 | 1 |
| | | Type2 | 16 | 5.0 | 168.0 | 29 | <u> </u> |
| | | | 17 | | 217.0 | 25 | 1 |
| | | Type2 | | 2.4 | | | |
| | | Type2 | 18 | 2.9 | 191.0 | 26 | 1 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 w t (86–512) 62992980 s



Report No.: SEWA2209000044RG06

Rev.: 01

47 of 85 Page:

| | | | Page: | 47 01 85 | |
|-------|----|------|-------|----------|---|
| Type2 | 19 | 2.3 | 166.0 | 25 | 1 |
| Type2 | 20 | 3.7 | 150.0 | 27 | 1 |
| Type2 | 21 | 2.2 | 176.0 | 25 | 1 |
| Type2 | 22 | 4.9 | 195.0 | 29 | 1 |
| Type2 | 23 | 2.9 | 202.0 | 26 | 1 |
| | 24 | 2.5 | 178.0 | 25 | 1 |
| Type2 | | | | | |
| Type2 | 25 | 1.1 | 206.0 | 23 | 1 |
| Type2 | 26 | 3.8 | 155.0 | 27 | 1 |
| Type2 | 27 | 4.7 | 157.0 | 29 | 1 |
| Type2 | 28 | 2.4 | 224.0 | 25 | 1 |
| Type2 | 29 | 4.2 | 159.0 | 28 | 1 |
| Type3 | 0 | 8.2 | 355.0 | 17 | 1 |
| Type3 | 1 | 6.1 | 487.0 | 16 | 1 |
| Type3 | 2 | 7.1 | 344.0 | 16 | 1 |
| Type3 | 3 | 9.8 | 288.0 | 18 | 1 |
| Type3 | 4 | 8.9 | 230.0 | 18 | 1 |
| Type3 | 5 | 7.9 | 432.0 | 17 | 1 |
| Type3 | 6 | 8.2 | 207.0 | 17 | 1 |
| Type3 | 7 | 7.5 | 443.0 | 17 | 1 |
| Type3 | 8 | 8.1 | 439.0 | 17 | 1 |
| | 9 | 6.2 | | | |
| Type3 | | | 223.0 | 16 | 1 |
| Type3 | 10 | 8.9 | 208.0 | 18 | 1 |
| Type3 | 11 | 9.6 | 463.0 | 18 | 1 |
| Type3 | 12 | 8.2 | 441.0 | 17 | 0 |
| Type3 | 13 | 7.2 | 323.0 | 16 | 1 |
| Type3 | 14 | 9.5 | 297.0 | 18 | 1 |
| Type3 | 15 | 8.0 | 412.0 | 17 | 1 |
| Type3 | 16 | 10.0 | 324.0 | 18 | 1 |
| Type3 | 17 | 7.4 | 271.0 | 17 | 1 |
| Type3 | 18 | 7.9 | 349.0 | 17 | 1 |
| Type3 | 19 | 7.3 | 409.0 | 16 | 1 |
| Type3 | 20 | 8.7 | 373.0 | 18 | 1 |
| Type3 | 21 | 7.2 | 254.0 | 16 | 1 |
| Type3 | 22 | 9.9 | 274.0 | 18 | 1 |
| | 23 | 7.9 | | 17 | 1 |
| Type3 | | | 278.0 | | |
| Type3 | 24 | 7.5 | 317.0 | 17 | 1 |
| Type3 | 25 | 6.1 | 260.0 | 16 | 1 |
| Type3 | 26 | 8.8 | 211.0 | 18 | 1 |
| Type3 | 27 | 9.7 | 272.0 | 18 | 1 |
| Type3 | 28 | 7.4 | 264.0 | 17 | 1 |
| Type3 | 29 | 9.2 | 284.0 | 18 | 1 |
| Type4 | 0 | 16.0 | 355.0 | 14 | 1 |
| Type4 | 1 | 11.3 | 487.0 | 12 | 1 |
| Type4 | 2 | 13.5 | 344.0 | 13 | 1 |
| Type4 | 3 | 19.4 | 288.0 | 16 | 1 |
| Type4 | 4 | 17.5 | 230.0 | 15 | 1 |
| Type4 | 5 | 15.3 | 432.0 | 14 | 1 |
| Type4 | 6 | 15.9 | 207.0 | 14 | 1 |
| Type4 | 7 | 14.3 | 443.0 | 13 | 1 |
| | 8 | 15.8 | 439.0 | 14 | 1 |
| Type4 | 9 | | | 12 | |
| Type4 | | 11.5 | 223.0 | | 1 |
| Type4 | 10 | 17.4 | 208.0 | 15 | 1 |
| Type4 | 11 | 19.0 | 463.0 | 16 | 1 |
| Type4 | 12 | 16.0 | 441.0 | 14 | 1 |
| Type4 | 13 | 13.8 | 323.0 | 13 | 1 |
| Type4 | 14 | 18.9 | 297.0 | 16 | 1 |
| Type4 | 15 | 15.5 | 412.0 | 14 | 1 |
| | | | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国・苏州・中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86–512) 62992980 sgs.china@sgs.com

www.sgsgroup.com.cn



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 48 of 85

| | | | | | Page: | 48 of 85 | |
|------------|------|----------------|----------|--------------|----------------|----------|----------|
| | | Type4 | 16 | 19.9 | 324.0 | 16 | 1 |
| | | Type4 | 17 | 14.1 | 271.0 | 13 | 1 |
| | | Type4 | 18 | 15.2 | 349.0 | 14 | 1 |
| | | Type4 | 19 | 13.8 | 409.0 | 13 | 1 |
| | | Type4 | 20 | 17.1 | 373.0 | 15 | 1 |
| | | Type4 | 21 | 13.8 | 254.0 | 13 | 1 |
| | | Type4 | 22 | 19.8 | 274.0 | 16 | 1 |
| | | Type4 Type4 | 23 24 | 15.3 14.5 | 278.0 317.0 | 14 13 | <u> </u> |
| | | Type4 | 25 | 11.3 | 260.0 | 12 | 1 |
| | | Type4 | 26 | 17.3 | 211.0 | 15 | 1 |
| | | Type4 | 27 | 19.2 | 272.0 | 16 | 1 |
| | | Type4 | 28 | 14.2 | 264.0 | 13 | 1 |
| | | Type4 | 29 | 18.2 | 284.0 | 15 | 1 |
| | | Type1 | 0 | 1.0 | 938.0 | 57 | 1 |
| | | Type1 | 1 | 1.0 | 698.0 | 76 | 1 |
| | | Type1 | 2 | 1.0 | 618.0 | 86 | 1 |
| | | Type1 | 3 | 1.0 | 538.0 | 99 | 1 |
| | | Type1 | 4 | 1.0 | 878.0 | 61 | 1 |
| | | Type1 | 5 | 1.0 | 3066.0 | 18 | 1 |
| | | Type1 | 6 | 1.0 | 638.0 | 83 | 1 |
| | | Type1 | 7 | 1.0 | 918.0 | 58 | 1 |
| | | Type1 | 8 | 1.0 | 838.0 | 63 | 1 |
| | | Type1 | 9 | 1.0 | 858.0 | 62 | 0 |
| | | Type1 | 10 | 1.0 | 798.0 | 67 | 1 |
| | | | 11 | 1.0 | 718.0 | 74 | 1 |
| | | Type1 | 12 | 1.0 | | 92 | 0 |
| | | Type1 | | | 578.0 | | |
| | | Type1 | 13 | 1.0 1.0 | 598.0 | 89 | 1 |
| | | Type1 | 14 | | 558.0 | 95 | |
| | | Type1 | 15 | 1.0 | 2536.0 | 21 | 1 |
| | | Type1 | 16 | 1.0 | 966.0 | 55 | 1 |
| | | Type1 | 17 | 1.0 | 827.0 | 64 | 1 |
| 11ac80SISO | 5530 | Type1 | 18 | 1.0 | 2501.0 | 22 | 1 |
| | | Type1 | 19 | 1.0 | 2595.0 | 21 | 1 |
| | | Type1 | 20 | 1.0 | 1114.0 | 48 | 1 |
| | | Type1 | 21 | 1.0 | 1302.0 | 41 | 1 |
| | | Type1 | 22 | 1.0 | 3045.0 | 18 | 1 |
| | | Type1 | 23 | 1.0 | 1624.0 | 33 | 1 |
| | | Type1 | 24 | 1.0 | 2878.0 | 19 | 1 |
| | | Type1 | 25 | 1.0 | 1027.0 | 52 | 1 |
| | | Type1 | 26 | 1.0 | 2485.0 | 22 | 1 |
| | | Type1 | 27 | 1.0 | 1600.0 | 33 | 1 |
| | | Type1 | 28 | 1.0 | 1172.0 | 46 | 1 |
| | | Type1 | 29 | 1.0 | 1177.0 | 45 | 1 |
| | | Type2 | 0 | 3.2 | 179.0 | 26 | 1 |
| | | Type2 | 1 | 1.1 | 207.0 | 23 | 1 |
| | | Type2 | 2 | 2.1 | 230.0 | 24 | 1 |
| | | Type2 | 3 | 4.8 | 200.0 | 29 | 1 |
| | | Type2 | 4 | 3.9 | 214.0 | 28 | 1 |
| | | Type2 | 5 | 2.9 | 222.0 | 26 | 1 |
| | | Type2 | 6 | 3.2 | 204.0 | 26 | 1 |
| | | 1 ypez | U | 5.2 | 204.0 | 20 | ı |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Infustrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 w t (86–512) 62992980 se



Report No.: SEWA2209000044RG06

Rev.: 01

| Page: | 49 of 85 |
|-------|----------|
| | |

| Type2 | 7 | 2.5 | 192.0 | 25 | 1 |
|-------|----|------|-------|----|---|
| Type2 | 8 | 3.1 | 164.0 | 26 | 1 |
| Type2 | 9 | 1.2 | 156.0 | 23 | 1 |
| Type2 | 10 | 3.9 | 210.0 | 27 | 1 |
| Type2 | 11 | 4.6 | 201.0 | 29 | 1 |
| Type2 | 12 | 3.2 | 162.0 | 26 | 1 |
| Type2 | 13 | 2.2 | 197.0 | 25 | 1 |
| Type2 | 14 | 4.5 | 163.0 | 29 | 1 |
| Type2 | 15 | 3.0 | 203.0 | 26 | 1 |
| Type2 | 16 | 5.0 | 168.0 | 29 | 1 |
| Type2 | 17 | 2.4 | 217.0 | 25 | 1 |
| Type2 | 18 | 2.9 | 191.0 | 26 | 1 |
| Type2 | 19 | 2.3 | 166.0 | 25 | 1 |
| Type2 | 20 | 3.7 | 150.0 | 27 | 1 |
| Type2 | 21 | 2.2 | 176.0 | 25 | 1 |
| Type2 | 22 | 4.9 | 195.0 | 29 | 1 |
| Type2 | 23 | 2.9 | 202.0 | 26 | 1 |
| Type2 | 24 | 2.5 | 178.0 | 25 | 1 |
| Type2 | 25 | 1.1 | 206.0 | 23 | 1 |
| Type2 | 26 | 3.8 | 155.0 | 27 | 1 |
| Type2 | 27 | 4.7 | 157.0 | 29 | 1 |
| Type2 | 28 | 2.4 | 224.0 | 25 | 1 |
| Type2 | 29 | 4.2 | 159.0 | 28 | 1 |
| Type3 | 0 | 8.2 | 355.0 | 17 | 1 |
| Type3 | 1 | 6.1 | 487.0 | 16 | 1 |
| Type3 | 2 | 7.1 | 344.0 | 16 | 1 |
| Type3 | 3 | 9.8 | 288.0 | 18 | 1 |
| Type3 | 4 | 8.9 | 230.0 | 18 | 1 |
| Type3 | 5 | 7.9 | 432.0 | 17 | 1 |
| Type3 | 6 | 8.2 | 207.0 | 17 | 1 |
| Type3 | 7 | 7.5 | 443.0 | 17 | 1 |
| Type3 | 8 | 8.1 | 439.0 | 17 | 1 |
| Type3 | 9 | 6.2 | 223.0 | 16 | 1 |
| Type3 | 10 | 8.9 | 208.0 | 18 | 1 |
| Type3 | 11 | 9.6 | 463.0 | 18 | 1 |
| Type3 | 12 | 8.2 | 441.0 | 17 | 1 |
| Type3 | 13 | 7.2 | 323.0 | 16 | 1 |
| Type3 | 14 | 9.5 | 297.0 | 18 | 1 |
| Type3 | 15 | 8.0 | 412.0 | 17 | 1 |
| Type3 | 16 | 10.0 | 324.0 | 18 | 1 |
| Type3 | 17 | 7.4 | 271.0 | 17 | 1 |
| Type3 | 18 | 7.9 | 349.0 | 17 | 1 |
| Type3 | 19 | 7.3 | 409.0 | 16 | 1 |
| Type3 | 20 | 8.7 | 373.0 | 18 | 1 |
| Type3 | 21 | 7.2 | 254.0 | 16 | 1 |
| Type3 | 22 | 9.9 | 274.0 | 18 | 1 |
| Type3 | 23 | 7.9 | 278.0 | 17 | 1 |
| Type3 | 24 | 7.5 | 317.0 | 17 | 1 |
| Type3 | 25 | 6.1 | 260.0 | 16 | 1 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Infustrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 50 of 85

| | Type3 | 26 | 8.8 | 211.0 | 18 | 1 |
|-----------------|-------|----|------|-------|----|---|
| | Type3 | 27 | 9.7 | 272.0 | 18 | 1 |
| | Type3 | 28 | 7.4 | 264.0 | 17 | 1 |
| | Type3 | 29 | 9.2 | 284.0 | 18 | 1 |
| | Type4 | 0 | 16.0 | 355.0 | 14 | 1 |
| | Type4 | 1 | 11.3 | 487.0 | 12 | 1 |
| | Type4 | 2 | 13.5 | 344.0 | 13 | 1 |
| | Type4 | 3 | 19.4 | 288.0 | 16 | 0 |
| | Type4 | 4 | 17.5 | 230.0 | 15 | 1 |
| | Type4 | 5 | 15.3 | 432.0 | 14 | 1 |
| | Type4 | 6 | 15.9 | 207.0 | 14 | 1 |
| | Type4 | 7 | 14.3 | 443.0 | 13 | 1 |
| | Type4 | 8 | 15.8 | 439.0 | 14 | 1 |
| | Type4 | 9 | 11.5 | 223.0 | 12 | 0 |
| | Type4 | 10 | 17.4 | 208.0 | 15 | 1 |
| | Type4 | 11 | 19.0 | 463.0 | 16 | 1 |
| | Type4 | 12 | 16.0 | 441.0 | 14 | 1 |
| | Type4 | 13 | 13.8 | 323.0 | 13 | 1 |
| | Type4 | 14 | 18.9 | 297.0 | 16 | 1 |
| | Type4 | 15 | 15.5 | 412.0 | 14 | 1 |
| | Type4 | 16 | 19.9 | 324.0 | 16 | 1 |
| | Type4 | 17 | 14.1 | 271.0 | 13 | 1 |
| | Type4 | 18 | 15.2 | 349.0 | 14 | 1 |
| | Type4 | 19 | 13.8 | 409.0 | 13 | 1 |
| | Type4 | 20 | 17.1 | 373.0 | 15 | 0 |
| | Type4 | 21 | 13.8 | 254.0 | 13 | 0 |
| | Type4 | 22 | 19.8 | 274.0 | 16 | 1 |
| | Type4 | 23 | 15.3 | 278.0 | 14 | 1 |
| | Type4 | 24 | 14.5 | 317.0 | 13 | 1 |
| | Type4 | 25 | 11.3 | 260.0 | 12 | 1 |
| | Type4 | 26 | 17.3 | 211.0 | 15 | 1 |
| | Type4 | 27 | 19.2 | 272.0 | 16 | 1 |
| | Type4 | 28 | 14.2 | 264.0 | 13 | 1 |
| | Type4 | 29 | 18.2 | 284.0 | 15 | 1 |
| | | | | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Infustrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 51 of 85

| | | | @FC | C_RLAN_ | DFS_SPC | _Radar_T | 5_SP2_Tr0@ |) | | | |
|------------|---------|-------|-------|---------|----------|----------|------------|-------|--------|--------|--------|
| | | Radar | Trial | Burst | Burst | Chirp | Number | Pulse | PRI1 | PRI2 | PRI3 |
| TestMode | Channel | Type | ID | ID | Offset | Width | Of | Width | | | _ |
| | | Type | טו ן | טו | (µs) | (MHz) | Pulses | (µs) | (µs) | (µs) | (µs) |
| 11ac20SISO | 5500 | Type5 | 0 | 0 | 636185.0 | 13 | 2 | 77.8 | 1665.0 | 1477.0 | |
| 11ac20SISO | 5500 | Type5 | 0 | 1 | 32674.0 | 13 | 1 | 51.9 | 1074.0 | | |
| 11ac20SISO | 5500 | Type5 | 0 | 2 | 226294.0 | 13 | 1 | 63.8 | 1584.0 | | |
| 11ac20SISO | 5500 | Type5 | 0 | 3 | 417976.0 | 13 | 3 | 96.6 | 1682.0 | 1786.0 | 1843.0 |
| 11ac20SISO | 5500 | Type5 | 0 | 4 | 611152.0 | 13 | 3 | 85.9 | 1795.0 | 1215.0 | 1729.0 |
| 11ac20SISO | 5500 | Type5 | 0 | 5 | 8789.0 | 13 | 2 | 73.7 | 1198.0 | 1549.0 | |
| 11ac20SISO | 5500 | Type5 | 0 | 6 | 201917.0 | 13 | 2 | 77.2 | 1837.0 | 1819.0 | |
| 11ac20SISO | 5500 | Type5 | 0 | 7 | 395530.0 | 13 | 2 | 68.4 | 1587.0 | 1114.0 | |
| 11ac20SISO | 5500 | Type5 | 0 | 8 | 588564.0 | 13 | 2 | 76.7 | 2000.0 | 1155.0 | |
| 11ac20SISO | 5500 | Type5 | 0 | 9 | 783794.0 | 13 | 1 | 53.2 | 1147.0 | | |
| 11ac20SISO | 5500 | Type5 | 0 | 10 | 177933.0 | 13 | 3 | 85.7 | 1433.0 | 1695.0 | 1394.0 |
| 11ac20SISO | 5500 | Type5 | 0 | 11 | 370624.0 | 13 | 3 | 94.3 | 1670.0 | 1426.0 | 1935.0 |
| 11ac20SISO | 5500 | Type5 | 0 | 12 | 564893.0 | 13 | 2 | 77.6 | 1294.0 | 1671.0 | |
| 11ac20SISO | 5500 | Type5 | 0 | 13 | 759583.0 | 13 | 1 | 65.7 | 1512.0 | | |
| 11ac20SISO | 5500 | Type5 | 0 | 14 | 154262.0 | 13 | 3 | 93.5 | 1444.0 | 1130.0 | 1468.0 |
| 11ac40SISO | 5510 | Type5 | 0 | 0 | 636185.0 | 13 | 2 | 77.8 | 1665.0 | 1477.0 | |
| 11ac40SISO | 5510 | Type5 | 0 | 1 | 32674.0 | 13 | 1 | 51.9 | 1074.0 | | |
| 11ac40SISO | 5510 | Type5 | 0 | 2 | 226294.0 | 13 | 1 | 63.8 | 1584.0 | | |
| 11ac40SISO | 5510 | Type5 | 0 | 3 | 417976.0 | 13 | 3 | 96.6 | 1682.0 | 1786.0 | 1843.0 |
| 11ac40SISO | 5510 | Type5 | 0 | 4 | 611152.0 | 13 | 3 | 85.9 | 1795.0 | 1215.0 | 1729.0 |
| 11ac40SISO | 5510 | Type5 | 0 | 5 | 8789.0 | 13 | 2 | 73.7 | 1198.0 | 1549.0 | |
| 11ac40SISO | 5510 | Type5 | 0 | 6 | 201917.0 | 13 | 2 | 77.2 | 1837.0 | 1819.0 | |
| 11ac40SISO | 5510 | Type5 | 0 | 7 | 395530.0 | 13 | 2 | 68.4 | 1587.0 | 1114.0 | |
| 11ac40SISO | 5510 | Type5 | 0 | 8 | 588564.0 | 13 | 2 | 76.7 | 2000.0 | 1155.0 | |
| 11ac40SISO | 5510 | Type5 | 0 | 9 | 783794.0 | 13 | 1 | 53.2 | 1147.0 | | |
| 11ac40SISO | 5510 | Type5 | 0 | 10 | 177933.0 | 13 | 3 | 85.7 | 1433.0 | 1695.0 | 1394.0 |
| 11ac40SISO | 5510 | Type5 | 0 | 11 | 370624.0 | 13 | 3 | 94.3 | 1670.0 | 1426.0 | 1935.0 |
| 11ac40SISO | 5510 | Type5 | 0 | 12 | 564893.0 | 13 | 2 | 77.6 | 1294.0 | 1671.0 | |
| 11ac40SISO | 5510 | Type5 | 0 | 13 | 759583.0 | 13 | 1 | 65.7 | 1512.0 | | |
| 11ac40SISO | 5510 | Type5 | 0 | 14 | 154262.0 | 13 | 3 | 93.5 | 1444.0 | 1130.0 | 1468.0 |
| 11ac80SISO | 5530 | Type5 | 0 | 0 | 636185.0 | 13 | 2 | 77.8 | 1665.0 | 1477.0 | |
| 11ac80SISO | 5530 | Type5 | 0 | 1 | 32674.0 | 13 | 1 | 51.9 | 1074.0 | | |
| 11ac80SISO | 5530 | Type5 | 0 | 2 | 226294.0 | 13 | 1 | 63.8 | 1584.0 | | |
| 11ac80SISO | 5530 | Type5 | 0 | 3 | 417976.0 | 13 | 3 | 96.6 | 1682.0 | 1786.0 | 1843.0 |
| 11ac80SISO | 5530 | Type5 | 0 | 4 | 611152.0 | 13 | 3 | 85.9 | 1795.0 | 1215.0 | 1729.0 |
| 11ac80SISO | 5530 | Type5 | 0 | 5 | 8789.0 | 13 | 2 | 73.7 | 1198.0 | 1549.0 | |
| 11ac80SISO | 5530 | Type5 | 0 | 6 | 201917.0 | 13 | 2 | 77.2 | 1837.0 | 1819.0 | |
| 11ac80SISO | 5530 | Type5 | 0 | 7 | 395530.0 | 13 | 2 | 68.4 | 1587.0 | 1114.0 | |
| 11ac80SISO | 5530 | Type5 | 0 | 8 | 588564.0 | 13 | 2 | 76.7 | 2000.0 | 1155.0 | |
| 11ac80SISO | 5530 | Type5 | 0 | 9 | 783794.0 | 13 | 1 | 53.2 | 1147.0 | | |
| 11ac80SISO | 5530 | Type5 | 0 | 10 | 177933.0 | 13 | 3 | 85.7 | 1433.0 | 1695.0 | 1394.0 |
| 11ac80SISO | 5530 | Type5 | 0 | 11 | 370624.0 | 13 | 3 | 94.3 | 1670.0 | 1426.0 | 1935.0 |
| 11ac80SISO | 5530 | Type5 | 0 | 12 | 564893.0 | 13 | 2 | 77.6 | 1294.0 | 1671.0 | |
| 11ac80SISO | 5530 | Type5 | 0 | 13 | 759583.0 | 13 | 1 | 65.7 | 1512.0 | | |
| 11ac80SISO | 5530 | Type5 | 0 | 14 | 154262.0 | 13 | 3 | 93.5 | 1444.0 | 1130.0 | 1468.0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 52 of 85

| | | | @FC | C_RLAN_ | _DFS_SPC_ | Radar_T | 5_SP2_Tr1@ | ! | | | |
|------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 1 | 0 | 653020.0 | 5 | 2 | 75.0 | 1880.0 | 1527.0 | |
| 11ac20SISO | 5500 | Type5 | 1 | 1 | 1015643.0 | 5 | 3 | 99.4 | 1401.0 | 1262.0 | 1257.0 |
| 11ac20SISO | 5500 | Type5 | 1 | 2 | 1379398.0 | 5 | 2 | 67.4 | 1531.0 | 1403.0 | |
| 11ac20SISO | 5500 | Type5 | 1 | 3 | 245489.0 | 5 | 2 | 73.6 | 1449.0 | 1041.0 | |
| 11ac20SISO | 5500 | Type5 | 1 | 4 | 609113.0 | 5 | 1 | 65.9 | 1432.0 | | |
| 11ac20SISO | 5500 | Type5 | 1 | 5 | 970852.0 | 5 | 3 | 83.8 | 1356.0 | 1292.0 | 1419.0 |
| 11ac20SISO | 5500 | Type5 | 1 | 6 | 1335913.0 | 5 | 1 | 65.5 | 1543.0 | - | |
| 11ac20SISO | 5500 | Type5 | 1 | 7 | 200406.0 | 5 | 3 | 98.6 | 1548.0 | 1796.0 | 1728.0 |
| 11ac40SISO | 5510 | Type5 | 1 | 0 | 653020.0 | 5 | 2 | 75.0 | 1880.0 | 1527.0 | |
| 11ac40SISO | 5510 | Type5 | 1 | 1 | 1015643.0 | 5 | 3 | 99.4 | 1401.0 | 1262.0 | 1257.0 |
| 11ac40SISO | 5510 | Type5 | 1 | 2 | 1379398.0 | 5 | 2 | 67.4 | 1531.0 | 1403.0 | |
| 11ac40SISO | 5510 | Type5 | 1 | 3 | 245489.0 | 5 | 2 | 73.6 | 1449.0 | 1041.0 | |
| 11ac40SISO | 5510 | Type5 | 1 | 4 | 609113.0 | 5 | 1 | 65.9 | 1432.0 | - | |
| 11ac40SISO | 5510 | Type5 | 1 | 5 | 970852.0 | 5 | 3 | 83.8 | 1356.0 | 1292.0 | 1419.0 |
| 11ac40SISO | 5510 | Type5 | 1 | 6 | 1335913.0 | 5 | 1 | 65.5 | 1543.0 | - | |
| 11ac40SISO | 5510 | Type5 | 1 | 7 | 200406.0 | 5 | 3 | 98.6 | 1548.0 | 1796.0 | 1728.0 |
| 11ac80SISO | 5530 | Type5 | 1 | 0 | 653020.0 | 5 | 2 | 75.0 | 1880.0 | 1527.0 | |
| 11ac80SISO | 5530 | Type5 | 1 | 1 | 1015643.0 | 5 | 3 | 99.4 | 1401.0 | 1262.0 | 1257.0 |
| 11ac80SISO | 5530 | Type5 | 1 | 2 | 1379398.0 | 5 | 2 | 67.4 | 1531.0 | 1403.0 | |
| 11ac80SISO | 5530 | Type5 | 1 | 3 | 245489.0 | 5 | 2 | 73.6 | 1449.0 | 1041.0 | |
| 11ac80SISO | 5530 | Type5 | 1 | 4 | 609113.0 | 5 | 1 | 65.9 | 1432.0 | | |
| 11ac80SISO | 5530 | Type5 | 1 | 5 | 970852.0 | 5 | 3 | 83.8 | 1356.0 | 1292.0 | 1419.0 |
| 11ac80SISO | 5530 | Type5 | 1 | 6 | 1335913.0 | 5 | 1 | 65.5 | 1543.0 | | |
| 11ac80SISO | 5530 | Type5 | 1 | 7 | 200406.0 | 5 | 3 | 98.6 | 1548.0 | 1796.0 | 1728.0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 ww t (86–512) 62992980 sgs



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 53 of 85

| | | | | | | | r ago. | | | | |
|------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|
| | | | @FC | C_RLAN_ | DFS_SPC_ | _Radar_T | 5_SP2_Tr2@ | 2 | | | |
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 2 | 0 | 409565.0 | 9 | 2 | 73.8 | 1806.0 | 1538.0 | |
| 11ac20SISO | 5500 | Type5 | 2 | 1 | 673692.0 | 9 | 2 | 69.5 | 1117.0 | 1649.0 | |
| 11ac20SISO | 5500 | Type5 | 2 | 2 | 938562.0 | 9 | 1 | 51.9 | 1651.0 | | |
| 11ac20SISO | 5500 | Type5 | 2 | 3 | 113209.0 | 9 | 3 | 84.6 | 1976.0 | 1032.0 | 1271.0 |
| 11ac20SISO | 5500 | Type5 | 2 | 4 | 376726.0 | 9 | 3 | 95.4 | 1060.0 | 1903.0 | 1388.0 |
| 11ac20SISO | 5500 | Type5 | 2 | 5 | 641212.0 | 9 | 2 | 68.0 | 1368.0 | 1351.0 | |
| 11ac20SISO | 5500 | Type5 | 2 | 6 | 903714.0 | 9 | 3 | 89.6 | 1338.0 | 1514.0 | 1573.0 |
| 11ac20SISO | 5500 | Type5 | 2 | 7 | 80863.0 | 9 | 2 | 81.9 | 1022.0 | 1689.0 | |
| 11ac20SISO | 5500 | Type5 | 2 | 8 | 344067.0 | 9 | 3 | 88.3 | 1810.0 | 1330.0 | 1838.0 |
| 11ac20SISO | 5500 | Type5 | 2 | 9 | 609331.0 | 9 | 1 | 53.7 | 1597.0 | | |
| 11ac20SISO | 5500 | Type5 | 2 | 10 | 871542.0 | 9 | 3 | 91.3 | 1961.0 | 1106.0 | 1001.0 |
| 11ac40SISO | 5510 | Type5 | 2 | 0 | 409565.0 | 9 | 2 | 73.8 | 1806.0 | 1538.0 | |
| 11ac40SISO | 5510 | Type5 | 2 | 1 | 673692.0 | 9 | 2 | 69.5 | 1117.0 | 1649.0 | |
| 11ac40SISO | 5510 | Type5 | 2 | 2 | 938562.0 | 9 | 1 | 51.9 | 1651.0 | | |
| 11ac40SISO | 5510 | Type5 | 2 | 3 | 113209.0 | 9 | 3 | 84.6 | 1976.0 | 1032.0 | 1271.0 |
| 11ac40SISO | 5510 | Type5 | 2 | 4 | 376726.0 | 9 | 3 | 95.4 | 1060.0 | 1903.0 | 1388.0 |
| 11ac40SISO | 5510 | Type5 | 2 | 5 | 641212.0 | 9 | 2 | 68.0 | 1368.0 | 1351.0 | |
| 11ac40SISO | 5510 | Type5 | 2 | 6 | 903714.0 | 9 | 3 | 89.6 | 1338.0 | 1514.0 | 1573.0 |
| 11ac40SISO | 5510 | Type5 | 2 | 7 | 80863.0 | 9 | 2 | 81.9 | 1022.0 | 1689.0 | |
| 11ac40SISO | 5510 | Type5 | 2 | 8 | 344067.0 | 9 | 3 | 88.3 | 1810.0 | 1330.0 | 1838.0 |
| 11ac40SISO | 5510 | Type5 | 2 | 9 | 609331.0 | 9 | 1 | 53.7 | 1597.0 | | |
| 11ac40SISO | 5510 | Type5 | 2 | 10 | 871542.0 | 9 | 3 | 91.3 | 1961.0 | 1106.0 | 1001.0 |
| 11ac80SISO | 5530 | Type5 | 2 | 0 | 409565.0 | 9 | 2 | 73.8 | 1806.0 | 1538.0 | |
| 11ac80SISO | 5530 | Type5 | 2 | 1 | 673692.0 | 9 | 2 | 69.5 | 1117.0 | 1649.0 | |
| 11ac80SISO | 5530 | Type5 | 2 | 2 | 938562.0 | 9 | 1 | 51.9 | 1651.0 | | |
| 11ac80SISO | 5530 | Type5 | 2 | 3 | 113209.0 | 9 | 3 | 84.6 | 1976.0 | 1032.0 | 1271.0 |
| 11ac80SISO | 5530 | Type5 | 2 | 4 | 376726.0 | 9 | 3 | 95.4 | 1060.0 | 1903.0 | 1388.0 |
| 11ac80SISO | 5530 | Type5 | 2 | 5 | 641212.0 | 9 | 2 | 68.0 | 1368.0 | 1351.0 | |
| 11ac80SISO | 5530 | Type5 | 2 | 6 | 903714.0 | 9 | 3 | 89.6 | 1338.0 | 1514.0 | 1573.0 |
| 11ac80SISO | 5530 | Type5 | 2 | 7 | 80863.0 | 9 | 2 | 81.9 | 1022.0 | 1689.0 | |
| 11ac80SISO | 5530 | Type5 | 2 | 8 | 344067.0 | 9 | 3 | 88.3 | 1810.0 | 1330.0 | 1838.0 |
| 11ac80SISO | 5530 | Type5 | 2 | 9 | 609331.0 | 9 | 1 | 53.7 | 1597.0 | | |
| 11ac80SISO | 5530 | Type5 | 2 | 10 | 871542.0 | 9 | 3 | 91.3 | 1961.0 | 1106.0 | 1001.0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 www t (86–512) 62992980 sgs



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 54 of 85

| | | | @FC | C_RLAN_ | _DFS_SPC_ | _Radar_T | 5_SP2_Tr3@ |) | | | |
|--------------------------|--------------|----------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|------------------|--------------|--------------|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 3 | 0 | 26541.0 | 19 | 2 | 68.1 | 1339.0 | 1355.0 | |
| 11ac20SISO | 5500 | Type5 | 3 | 1 | 171821.0 | 19 | 1 | 58.7 | 1251.0 | 4040.0 | |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 | 3 | 3 | 316229.0 | 19 19 | <u>2</u> 1 | 75.3 | 1136.0 1753.0 | 1640.0 | |
| 11ac20SISO | 5500 | Type5 Type5 | 3 | 4 | 461864.0 8677.0 | 19 | 3 | 56.4 99.7 | 1196.0 | 1708.0 | 1159.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 5 | 153995.0 | 19 | 1 | 57.7 | 1013.0 | 1700.0 | 1139.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 6 | 299238.0 | 19 | 1 | 59.5 | 1072.0 | | |
| 11ac20SISO | 5500 | Type5 | 3 | 7 | 443177.0 | 19 | 2 | 80.0 | 1482.0 | 1369.0 | |
| 11ac20SISO | 5500 | Type5 | 3 | 8 | 587671.0 | 19 | 2 | 82.0 | 1993.0 | 1197.0 | |
| 11ac20SISO | 5500 | Type5 | 3 | 9 | 135674.0 | 19 | 2 | 82.8 | 1883.0 | 1005.0 | |
| 11ac20SISO | 5500 | Type5 | 3 | 10 | 279928.0 | 19 | 3 | 88.0 | 1061.0 | 1928.0 | 1101.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 11 | 424279.0 | 19 | 3 | 93.2 | 1207.0 | 1907.0 | 1223.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 12 | 570132.0 | 19 | 2 | 70.4 | 1526.0 | 1360.0 | |
| 11ac20SISO | 5500 | Type5 | 3 | 13 | 117439.0 | 19 | 3 | 95.3 | 1171.0 | 1955.0 | 1775.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 14 | 262502.0 | 19 | 2 | 81.9 | 1690.0 | 1545.0 | |
| 11ac20SISO | 5500 | Type5 | 3 | 15 | 406573.0 | 19 | 3 | 98.5 | 1975.0 | 1169.0 | 1062.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 16 | 553328.0 | 19 | 1 | 65.0 | 1767.0 | | |
| 11ac20SISO | 5500 | Type5 | 3 | 17 | 99799.0 | 19 | 3 | 85.4 | 1011.0 | 1637.0 | 1425.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 18 | 244095.0 | 19 | 3 | 91.6 | 1878.0 | 1445.0 | 1325.0 |
| 11ac20SISO | 5500 | Type5 | 3 | 19 | 390012.0 | 19 | 2 | 67.3 | 1091.0 | 1218.0 | |
| 11ac40SISO | 5510 | Type5 | 3 | 0 | 26541.0 | 19 | 2 | 68.1 | 1339.0 | 1355.0 | |
| 11ac40SISO | 5510 | Type5 | 3 | 1 | 171821.0 | 19 | 1 | 58.7 | 1251.0 | 1640.0 | |
| 11ac40SISO | 5510 5510 | Type5 | 3 | 3 | 316229.0 | 19 19 | 2 1 | 75.3 | 1136.0 | 1640.0 | |
| 11ac40SISO 11ac40SISO | 5510 | Type5 Type5 | 3 | 4 | 461864.0 8677.0 | 19 | 3 | 56.4 99.7 | 1753.0 1196.0 | 1708.0 | 1159.0 |
| 11ac40SISO | 5510 | Type5 | 3 | 5 | 153995.0 | 19 | 1 | 57.7 | 1013.0 | | |
| 11ac40SISO | 5510 | Type5 | 3 | 6 | 299238.0 | 19 | 1 | 59.5 | 1072.0 | | |
| 11ac40SISO | 5510 | Type5 | 3 | 7 | 443177.0 | 19 | 2 | 80.0 | 1482.0 | 1369.0 | |
| 11ac40SISO | 5510 | Type5 | 3 | 8 | 587671.0 | 19 | 2 | 82.0 | 1993.0 | 1197.0 | |
| 11ac40SISO | 5510 | Type5 | 3 | 9 | 135674.0 | 19 | 2 | 82.8 | 1883.0 | 1005.0 | |
| 11ac40SISO | 5510 | Type5 | 3 | 10 | 279928.0 | 19 | 3 | 88.0 | 1061.0 | 1928.0 | 1101.0 |
| 11ac40SISO | 5510 | Type5 | 3 | 11 | 424279.0 | 19 | 3 | 93.2 | 1207.0 | 1907.0 | 1223.0 |
| 11ac40SISO | 5510 | Type5 | 3 | 12 | 570132.0 | 19 | 2 | 70.4 | 1526.0 | 1360.0 | |
| 11ac40SISO | 5510 | Type5 | 3 | 13 | 117439.0 | 19 | 3 | 95.3 | 1171.0 | 1955.0 | 1775.0 |
| 11ac40SISO | 5510 | Type5 | 3 | 14 | 262502.0 | 19 | 2 | 81.9 | 1690.0 | 1545.0 | |
| 11ac40SISO | 5510 | Type5 | 3 | 15 | 406573.0 | 19 | 3 | 98.5 | 1975.0 | 1169.0 | 1062.0 |
| 11ac40SISO | 5510 | Type5 | 3 | 16 | 553328.0 | 19 | 1 | 65.0 | 1767.0 | | |
| 11ac40SISO | 5510 | Type5 | 3 | 17 | 99799.0 | 19 | 3 | 85.4 | 1011.0 | 1637.0 | 1425.0 |
| 11ac40SISO | 5510 | Type5 | 3 | 18 | 244095.0 | 19 | 3 | 91.6 | 1878.0 | 1445.0 | 1325.0 |
| 11ac40SISO | 5510 | Type5 | 3 | 19 | 390012.0 | 19 | 2 | 67.3 | 1091.0 | 1218.0 | |
| 11ac80SISO | 5530 | Type5 | 3 | 0 | 26541.0 | 19 | 2 | 68.1 | 1339.0 | 1355.0 | |
| 11ac80SISO | 5530 | Type5 | 3 | 1 | 171821.0 | 19 | 1 | 58.7 | 1251.0 | 1640.0 | |
| 11ac80SISO 11ac80SISO | 5530 5530 | Type5 | 3 | 2 | 316229.0 461864.0 | 19 19 | 2 | 75.3 | 1136.0 | 1640.0 | |
| 11ac80SISO | 5530 5530 | Type5 Type5 | 3 | 3 4 | 8677.0 | 19 | 3 | 56.4 99.7 | 1753.0 1196.0 | 1708.0 | 1159.0 |
| 11ac80SISO | 5530 | Type5 | 3 | 5 | 153995.0 | 19 | 1 | 57.7 | 1013.0 | | |
| 11ac80SISO | 5530 | Type5 | 3 | 6 | 299238.0 | 19 | 1 | 59.5 | 1072.0 | | |
| 11ac80SISO | 5530 | Type5 | 3 | 7 | 443177.0 | 19 | 2 | 80.0 | 1482.0 | 1369.0 | |
| 11ac80SISO | 5530 | Type5 | 3 | 8 | 587671.0 | 19 | 2 | 82.0 | 1993.0 | 1197.0 | |
| 11ac80SISO | 5530 | Type5 | 3 | 9 | 135674.0 | 19 | 2 | 82.8 | 1883.0 | 1005.0 | |
| 11ac80SISO | 5530 | Type5 | 3 | 10 | 279928.0 | 19 | 3 | 88.0 | 1061.0 | 1928.0 | 1101.0 |
| 11ac80SISO | 5530 | Type5 | 3 | 11 | 424279.0 | 19 | 3 | 93.2 | 1207.0 | 1907.0 | 1223.0 |
| 11ac80SISO | 5530 | Type5 | 3 | 12 | 570132.0 | 19 | 2 | 70.4 | 1526.0 | 1360.0 | |
| 11ac80SISO | 5530 | Type5 | 3 | 13 | 117439.0 | 19 | 3 | 95.3 | 1171.0 | 1955.0 | 1775.0 |
| 11ac80SISO | 5530 | Type5 | 3 | 14 | 262502.0 | 19 | 2 | 81.9 | 1690.0 | 1545.0 | - |
| 11ac80SISO | 5530 | Type5 | 3 | 15 | 406573.0 | 19 | 3 | 98.5 | 1975.0 | 1169.0 | 1062.0 |
| 11ac80SISO | 5530 | Type5 | 3 | 16 | 553328.0 | 19 | 1 | 65.0 | 1767.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 55 of 85

| 11ac80SISO | 5530 | Type5 | 3 | 17 | 99799.0 | 19 | 3 | 85.4 | 1011.0 | 1637.0 | 1425.0 |
|------------|------|-------|---|----|----------|----|---|------|--------|--------|--------|
| 11ac80SISO | 5530 | Type5 | 3 | 18 | 244095.0 | 19 | 3 | 91.6 | 1878.0 | 1445.0 | 1325.0 |
| 11ac80SISO | 5530 | Type5 | 3 | 19 | 390012.0 | 19 | 2 | 67.3 | 1091.0 | 1218.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 56 of 85

| | | | @FC | C_RLAN_ | _DFS_SPC_ | _Radar_T | 5_SP2_Tr4@ |) | | | |
|--------------------------|--------------|----------------|-------------|---------------|----------------------|----------------|--------------|----------------|------------------|------------------|------------------|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset | Chirp Width | Number Of | Pulse Width | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| | | | | | (µs) | (MHz) | Pulses | (µs) | 1 1 | | |
| 11ac20SISO | 5500 | Type5 | 4 | 0 | 629614.0 | 16 | 2 | 67.9 | 1320.0 | 1133.0 | |
| 11ac20SISO | 5500 | Type5 | 4 | 1 | 96856.0 | 16 | 1 | 62.3 | 1957.0 | | |
| 11ac20SISO | 5500 | Type5 | 4 | 2 | 267719.0 | 16 | 1 | 53.3 | 1592.0 | 4450.0 | |
| 11ac20SISO | 5500 | Type5 | 4 | 3 | 436784.0 | 16 | 3 | 90.0 | 1900.0 | 1153.0 | 1346.0 |
| 11ac20SISO | 5500 | Type5 | 4 | 4 | 608289.0 | 16 | 2 | 77.1 | 1166.0 | 1646.0 | 4450.0 |
| 11ac20SISO | 5500 | Type5 | 4 | 5 | 75610.0 | 16 | 3 | 83.9 | 1278.0 | 1232.0 | 1459.0 |
| 11ac20SISO | 5500 | Type5 | 4 | 6 7 | 245638.0 | 16 | 3 | 89.1 | 1240.0 | 1384.0 | 1939.0 |
| 11ac20SISO | 5500 | Type5 | 4 | | 416355.0 | 16 | 2 | 81.8 | 1833.0 | 1676.0 | |
| 11ac20SISO | 5500 | Type5 | 4 | <u>8</u> 9 | 588736.0 54571.0 | 16 16 | 1 | 50.3 | 1075.0 | 1996.0 | 1756.0 |
| 11ac20SISO | 5500 | Type5 | | 10 | | 16 | 3 | 87.1 | 1116.0 | | 1736.0 |
| 11ac20SISO | 5500 | Type5 | 4 | | 225175.0 | 16 | 2 | 71.3 | 1225.0 | 1815.0 | 1122.0 |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 Type5 | 4 | 11 12 | 394825.0 565361.0 | 16 | 3 | 97.5 90.6 | 1884.0 1561.0 | 1465.0 1040.0 | 1132.0 1354.0 |
| 11ac20SISO | 5500 | Type5 | 4 | 13 | 33643.0 | 16 | 3 | 86.3 | 1596.0 | 1183.0 | 1792.0 |
| 11ac20SISO | 5500 | Type5 | 4 | 14 | 203957.0 | 16 | 3 | 97.6 | 1365.0 | 1073.0 | 1361.0 |
| 11ac20SISO | 5500 | Type5 | 4 | 15 | 373812.0 | 16 | 3 | 84.7 | 1021.0 | 1718.0 | 1854.0 |
| 11ac20SISO | 5500 | Type5 | 4 | 16 | 544060.0 | 16 | 3 | 99.7 | 1150.0 | 1244.0 | 1988.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 0 | 629614.0 | 16 | 2 | 67.9 | 1320.0 | 1133.0 | |
| 11ac40SISO | 5510 | Type5 | 4 | 1 | 96856.0 | 16 | 1 | 62.3 | 1957.0 | | |
| 11ac40SISO | 5510 | Type5 | 4 | 2 | 267719.0 | 16 | 1 | 53.3 | 1592.0 | | |
| 11ac40SISO | 5510 | Type5 | 4 | 3 | 436784.0 | 16 | 3 | 90.0 | 1900.0 | 1153.0 | 1346.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 4 | 608289.0 | 16 | 2 | 77.1 | 1166.0 | 1646.0 | 1040.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 5 | 75610.0 | 16 | 3 | 83.9 | 1278.0 | 1232.0 | 1459.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 6 | 245638.0 | 16 | 3 | 89.1 | 1240.0 | 1384.0 | 1939.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 7 | 416355.0 | 16 | 2 | 81.8 | 1833.0 | 1676.0 | |
| 11ac40SISO | 5510 | Type5 | 4 | 8 | 588736.0 | 16 | 1 | 50.3 | 1075.0 | | |
| 11ac40SISO | 5510 | Type5 | 4 | 9 | 54571.0 | 16 | 3 | 87.1 | 1116.0 | 1996.0 | 1756.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 10 | 225175.0 | 16 | 2 | 71.3 | 1225.0 | 1815.0 | |
| 11ac40SISO | 5510 | Type5 | 4 | 11 | 394825.0 | 16 | 3 | 97.5 | 1884.0 | 1465.0 | 1132.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 12 | 565361.0 | 16 | 3 | 90.6 | 1561.0 | 1040.0 | 1354.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 13 | 33643.0 | 16 | 3 | 86.3 | 1596.0 | 1183.0 | 1792.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 14 | 203957.0 | 16 | 3 | 97.6 | 1365.0 | 1073.0 | 1361.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 15 | 373812.0 | 16 | 3 | 84.7 | 1021.0 | 1718.0 | 1854.0 |
| 11ac40SISO | 5510 | Type5 | 4 | 16 | 544060.0 | 16 | 3 | 99.7 | 1150.0 | 1244.0 | 1988.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 0 | 629614.0 | 16 | 2 | 67.9 | 1320.0 | 1133.0 | |
| 11ac80SISO | 5530 | Type5 | 4 | 1 | 96856.0 | 16 | 1 | 62.3 | 1957.0 | - | |
| 11ac80SISO | 5530 | Type5 | 4 | 2 | 267719.0 | 16 | 1 | 53.3 | 1592.0 | - | |
| 11ac80SISO | 5530 | Type5 | 4 | 3 | 436784.0 | 16 | 3 | 90.0 | 1900.0 | 1153.0 | 1346.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 4 | 608289.0 | 16 | 2 | 77.1 | 1166.0 | 1646.0 | |
| 11ac80SISO | 5530 | Type5 | 4 | 5 | 75610.0 | 16 | 3 | 83.9 | 1278.0 | 1232.0 | 1459.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 6 | 245638.0 | 16 | 3 | 89.1 | 1240.0 | 1384.0 | 1939.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 7 | 416355.0 | 16 | 2 | 81.8 | 1833.0 | 1676.0 | |
| 11ac80SISO | 5530 | Type5 | 4 | 8 | 588736.0 | 16 | 1 | 50.3 | 1075.0 | | |
| 11ac80SISO | 5530 | Type5 | 4 | 9 | 54571.0 | 16 | 3 | 87.1 | 1116.0 | 1996.0 | 1756.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 10 | 225175.0 | 16 | 2 | 71.3 | 1225.0 | 1815.0 | |
| 11ac80SISO | 5530 | Type5 | 4 | 11 | 394825.0 | 16 | 3 | 97.5 | 1884.0 | 1465.0 | 1132.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 12 | 565361.0 | 16 | 3 | 90.6 | 1561.0 | 1040.0 | 1354.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 13 | 33643.0 | 16 | 3 | 86.3 | 1596.0 | 1183.0 | 1792.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 14 | 203957.0 | 16 | 3 | 97.6 | 1365.0 | 1073.0 | 1361.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 15 | 373812.0 | 16 | 3 | 84.7 | 1021.0 | 1718.0 | 1854.0 |
| 11ac80SISO | 5530 | Type5 | 4 | 16 | 544060.0 | 16 | 3 | 99.7 | 1150.0 | 1244.0 | 1988.0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 57 of 85

| | | | @FC | C RLAN | DFS SPC | Radar T | 5 SP2 Tr5@ | <u> </u> | | | |
|------------|---------|---------------|----------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 5 | 0 | 15438.0 | 12 | 3 | 92.9 | 1085.0 | 1564.0 | 1407.0 |
| 11ac20SISO | 5500 | Type5 | 5 | 1 | 222486.0 | 12 | 2 | 67.7 | 1744.0 | 1747.0 | |
| 11ac20SISO | 5500 | Type5 | 5 | 2 | 430731.0 | 12 | 1 | 65.8 | 1092.0 | | |
| 11ac20SISO | 5500 | Type5 | 5 | 3 | 637784.0 | 12 | 1 | 56.3 | 1851.0 | | |
| 11ac20SISO | 5500 | Type5 | 5 | 4 | 845342.0 | 12 | 1 | 53.7 | 1727.0 | | |
| 11ac20SISO | 5500 | Type5 | 5 | 5 | 196720.0 | 12 | 3 | 83.5 | 1679.0 | 1930.0 | 1025.0 |
| 11ac20SISO | 5500 | Type5 | 5 | 6 | 404955.0 | 12 | 1 | 65.8 | 1519.0 | | |
| 11ac20SISO | 5500 | Type5 | 5 | 7 | 610711.0 | 12 | 3 | 85.9 | 1134.0 | 1034.0 | 1808.0 |
| 11ac20SISO | 5500 | Type5 | 5 | 8 | 818057.0 | 12 | 2 | 76.3 | 1606.0 | 1926.0 | |
| 11ac20SISO | 5500 | Type5 | 5 | 9 | 171459.0 | 12 | 2 | 81.5 | 1891.0 | 1714.0 | |
| 11ac20SISO | 5500 | Type5 | 5 | 10 | 377969.0 | 12 | 3 | 89.4 | 1310.0 | 1594.0 | 1827.0 |
| 11ac20SISO | 5500 | Type5 | 5 | 11 | 586875.0 | 12 | 1 | 63.4 | 1568.0 | | |
| 11ac20SISO | 5500 | Type5 | 5 | 12 | 792834.0 | 12 | 2 | 69.6 | 1307.0 | 1925.0 | |
| 11ac20SISO | 5500 | Type5 | 5 | 13 | 146044.0 | 12 | 2 | 74.5 | 1264.0 | 1846.0 | |
| 11ac40SISO | 5510 | Type5 | 5 | 0 | 15438.0 | 12 | 3 | 92.9 | 1085.0 | 1564.0 | 1407.0 |
| 11ac40SISO | 5510 | Type5 | 5 | 1 | 222486.0 | 12 | 2 | 67.7 | 1744.0 | 1747.0 | |
| 11ac40SISO | 5510 | Type5 | 5 | 2 | 430731.0 | 12 | 1 | 65.8 | 1092.0 | | |
| 11ac40SISO | 5510 | Type5 | 5 | 3 | 637784.0 | 12 | 1 | 56.3 | 1851.0 | | |
| 11ac40SISO | 5510 | Type5 | 5 | 4 | 845342.0 | 12 | 1 | 53.7 | 1727.0 | | |
| 11ac40SISO | 5510 | Type5 | 5 | 5 | 196720.0 | 12 | 3 | 83.5 | 1679.0 | 1930.0 | 1025.0 |
| 11ac40SISO | 5510 | Type5 | 5 | 6 | 404955.0 | 12 | 11 | 65.8 | 1519.0 | | |
| 11ac40SISO | 5510 | Type5 | 5 | 7 | 610711.0 | 12 | 3 | 85.9 | 1134.0 | 1034.0 | 1808.0 |
| 11ac40SISO | 5510 | Type5 | 5 | 8 | 818057.0 | 12 | 2 | 76.3 | 1606.0 | 1926.0 | |
| 11ac40SISO | 5510 | Type5 | 5 | 9 | 171459.0 | 12 | 2 | 81.5 | 1891.0 | 1714.0 | |
| 11ac40SISO | 5510 | Type5 | 5 | 10 | 377969.0 | 12 | 3 | 89.4 | 1310.0 | 1594.0 | 1827.0 |
| 11ac40SISO | 5510 | Type5 | 5 | 11 | 586875.0 | 12 | 1 | 63.4 | 1568.0 | | |
| 11ac40SISO | 5510 | Type5 | 5 | 12 | 792834.0 | 12 | 2 | 69.6 | 1307.0 | 1925.0 | |
| 11ac40SISO | 5510 | Type5 | 5 | 13 | 146044.0 | 12 | 2 | 74.5 | 1264.0 | 1846.0 | |
| 11ac80SISO | 5530 | Type5 | 5 | 0 | 15438.0 | 12 | 3 | 92.9 | 1085.0 | 1564.0 | 1407.0 |
| 11ac80SISO | 5530 | Type5 | 5 | 1 | 222486.0 | 12 | 2 | 67.7 | 1744.0 | 1747.0 | |
| 11ac80SISO | 5530 | Type5 | 5 | 2 | 430731.0 | 12 | 1 | 65.8 | 1092.0 | | |
| 11ac80SISO | 5530 | Type5 | 5 | 3 | 637784.0 | 12 | 1 | 56.3 | 1851.0 | | |
| 11ac80SISO | 5530 | Type5 | 5 | 4 | 845342.0 | 12 | 1 | 53.7 | 1727.0 | | |
| 11ac80SISO | 5530 | Type5 | 5 | 5 | 196720.0 | 12 | 3 | 83.5 | 1679.0 | 1930.0 | 1025.0 |
| 11ac80SISO | 5530 | Type5 | 5 | 6 | 404955.0 | 12 | 1 | 65.8 | 1519.0 | | |
| 11ac80SISO | 5530 | Type5 | 5 | 7 | 610711.0 | 12 | 3 | 85.9 | 1134.0 | 1034.0 | 1808.0 |
| 11ac80SISO | 5530 | Type5 | 5 | 8 | 818057.0 | 12 | 2 | 76.3 | 1606.0 | 1926.0 | |
| 11ac80SISO | 5530 | Type5 | 5 | 9 | 171459.0 | 12 | 2 | 81.5 | 1891.0 | 1714.0 | |
| 11ac80SISO | 5530 | Type5 | 5 | 10 | 377969.0 | 12 | 3 | 89.4 | 1310.0 | 1594.0 | 1827.0 |
| 11ac80SISO | 5530 | Type5 | 5 | 11 | 586875.0 | 12 | 1 | 63.4 | 1568.0 | | |
| 11ac80SISO | 5530 | Type5 | 5 | 12 | 792834.0 | 12 | 2 | 69.6 | 1307.0 | 1925.0 | |
| 11ac80SISO | 5530 | Type5 | 5 | 13 | 146044.0 | 12 | 2 | 74.5 | 1264.0 | 1846.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 58 of 85

| TestMode Channel Radar Type Trial ID Burst ID Chirp Offset (μs) Chirp Width (MHz) Number Of Pulses PRI1 (μs) PRI2 (μs) 11ac20SISO 5500 Type5 6 0 329022.0 13 3 96.6 1182.0 1609. 11ac20SISO 5500 Type5 6 1 521718.0 13 3 96.7 1829.0 1799. 11ac20SISO 5500 Type5 6 2 714222.0 13 3 86.5 1923.0 1396. 11ac20SISO 5500 Type5 6 2 714222.0 13 3 86.5 1923.0 1396. 11ac20SISO 5500 Type5 6 3 112450.0 13 2 73.3 1908.0 1318. 11ac20SISO 5500 Type5 6 4 306283.0 13 1 55.8 1688.0 11ac20SISO 5500 Type5 6 5 500239.0 | 1154.0 1865.0 1820.0 |
|--|--|
| 11ac20SISO 5500 Type5 6 1 521718.0 13 3 96.7 1829.0 1799.0 11ac20SISO 5500 Type5 6 2 714222.0 13 3 86.5 1923.0 1396. 11ac20SISO 5500 Type5 6 3 112450.0 13 2 73.3 1908.0 1318. 11ac20SISO 5500 Type5 6 4 306283.0 13 1 55.8 1688.0 11ac20SISO 5500 Type5 6 5 500239.0 13 1 55.4 1145.0 11ac20SISO 5500 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. 11ac20SISO 5500 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65 | 1154.0 1865.0 1820.0 |
| 11ac20SISO 5500 Type5 6 2 714222.0 13 3 86.5 1923.0 1396. 11ac20SISO 5500 Type5 6 3 112450.0 13 2 73.3 1908.0 1318. 11ac20SISO 5500 Type5 6 4 306283.0 13 1 55.8 1688.0 11ac20SISO 5500 Type5 6 5 500239.0 13 1 55.4 1145.0 11ac20SISO 5500 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. 11ac20SISO 5500 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65.7 1476.0 11ac20SISO 5500 Type5 6 9 475842.0 13 2 77.7 </td <td>1865.0 1820.0 </td> | 1865.0 1820.0 |
| 11ac20SISO 5500 Type5 6 3 112450.0 13 2 73.3 1908.0 1318. 11ac20SISO 5500 Type5 6 4 306283.0 13 1 55.8 1688.0 11ac20SISO 5500 Type5 6 5 500239.0 13 1 55.4 1145.0 11ac20SISO 5500 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. 11ac20SISO 5500 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65.7 1476.0 11ac20SISO 5500 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7< | 1820.0 |
| 11ac20SISO 5500 Type5 6 4 306283.0 13 1 55.8 1688.0 11ac20SISO 5500 Type5 6 5 500239.0 13 1 55.4 1145.0 11ac20SISO 5500 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. 11ac20SISO 5500 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65.7 1476.0 11ac20SISO 5500 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79. | 1820.0 |
| 11ac20SISO 5500 Type5 6 5 500239.0 13 1 55.4 1145.0 11ac20SISO 5500 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. 11ac20SISO 5500 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65.7 1476.0 11ac20SISO 5500 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | 1820.0 |
| 11ac20SISO 5500 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. 11ac20SISO 5500 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65.7 1476.0 11ac20SISO 5500 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | |
| 11ac20SISO 5500 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65.7 1476.0 11ac20SISO 5500 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | |
| 11ac20SISO 5500 Type5 6 8 282508.0 13 1 65.7 1476.0 11ac20SISO 5500 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | |
| 11ac20SISO 5500 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | |
| 11ac20SISO 5500 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | |
| 11ac20SISO 5500 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | |
| | |
| | 13/0 0 |
| | 1045.0 |
| 11ac20SISO 5500 Type5 6 13 452335.0 13 1 61.4 1451.0 | |
| 11ac20SISO 5500 Type5 6 14 643395.0 13 3 90.6 1233.0 1562. | 1887.0 |
| 11ac40SISO 5510 Type5 6 0 329022.0 13 3 96.6 1182.0 1609. | 1581.0 |
| 11ac40SISO 5510 Type5 6 1 521718.0 13 3 96.7 1829.0 1799. | |
| 11ac40SISO 5510 Type5 6 2 714222.0 13 3 86.5 1923.0 1396. | _ |
| 11ac40SISO 5510 Type5 6 3 112450.0 13 2 73.3 1908.0 1318. | |
| 11ac40SISO 5510 Type5 6 4 306283.0 13 1 55.8 1688.0 | |
| 11ac40SISO 5510 Type5 6 5 500239.0 13 1 55.4 1145.0 | |
| 11ac40SISO 5510 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. | 1820.0 |
| 11ac40SISO 5510 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. | |
| 11ac40SISO 5510 Type5 6 8 282508.0 13 1 65.7 1476.0 | |
| 11ac40SISO 5510 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. | |
| 11ac40SISO 5510 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. | |
| 11ac40SISO 5510 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | _ |
| 11ac40SISO 5510 Type5 6 12 257755.0 13 3 94.9 1830.0 1070. | |
| 11ac40SISO 5510 Type5 6 13 452335.0 13 1 61.4 1451.0 | |
| 11ac40SISO 5510 Type5 6 14 643395.0 13 3 90.6 1233.0 1562. | 1887.0 |
| 11ac80SISO 5530 Type5 6 0 329022.0 13 3 96.6 1182.0 1609. | |
| 11ac80SISO 5530 Type5 6 1 521718.0 13 3 96.7 1829.0 1799. | |
| 11ac80SISO 5530 Type5 6 2 714222.0 13 3 86.5 1923.0 1396. | |
| 11ac80SISO 5530 Type5 6 3 112450.0 13 2 73.3 1908.0 1318. | |
| 11ac80SISO 5530 Type5 6 4 306283.0 13 1 55.8 1688.0 | |
| 11ac80SISO 5530 Type5 6 5 500239.0 13 1 55.4 1145.0 | |
| 11ac80SISO 5530 Type5 6 6 690932.0 13 3 85.3 1336.0 1504. | |
| 11ac80SISO 5530 Type5 6 7 88645.0 13 2 79.4 1344.0 1893. | |
| 11ac80SISO 5530 Type5 6 8 282508.0 13 1 65.7 1476.0 | |
| 11ac80SISO 5530 Type5 6 9 475842.0 13 2 68.6 1008.0 1028. | |
| 11ac80SISO 5530 Type5 6 10 667887.0 13 2 77.7 1972.0 1835. | |
| 11ac80SISO 5530 Type5 6 11 64845.0 13 2 79.6 1882.0 1331. | |
| 11ac80SISO 5530 Type5 6 12 257755.0 13 3 94.9 1830.0 1070. | |
| 11ac80SISO 5530 Type5 6 13 452335.0 13 1 61.4 1451.0 | 1349.0 |
| 11ac80SISO 5530 Type5 6 14 643395.0 13 3 90.6 1233.0 1562. | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 59 of 85

| | | | | | | | i agc. | 33 0 | | | |
|------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|
| | | | @FC | C_RLAN_ | DFS_SPC_ | | 5_SP2_Tr7@ |) | | | |
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 7 | 0 | 51446.0 | 10 | 1 | 52.6 | 1210.0 | | |
| 11ac20SISO | 5500 | Type5 | 7 | 1 | 292696.0 | 10 | 3 | 84.1 | 1314.0 | 1725.0 | 1529.0 |
| 11ac20SISO | 5500 | Type5 | 7 | 2 | 533989.0 | 10 | 3 | 97.7 | 1139.0 | 1868.0 | 1805.0 |
| 11ac20SISO | 5500 | Type5 | 7 | 3 | 775564.0 | 10 | 3 | 97.3 | 1341.0 | 1446.0 | 1755.0 |
| 11ac20SISO | 5500 | Type5 | 7 | 4 | 21542.0 | 10 | 3 | 98.8 | 1544.0 | 1386.0 | 1302.0 |
| 11ac20SISO | 5500 | Type5 | 7 | 5 | 263385.0 | 10 | 2 | 72.2 | 1771.0 | 1184.0 | |
| 11ac20SISO | 5500 | Type5 | 7 | 6 | 505581.0 | 10 | 2 | 67.6 | 1175.0 | 1027.0 | |
| 11ac20SISO | 5500 | Type5 | 7 | 7 | 747058.0 | 10 | 2 | 75.7 | 1026.0 | 1871.0 | |
| 11ac20SISO | 5500 | Type5 | 7 | 8 | 989976.0 | 10 | 1 | 60.9 | 1798.0 | | |
| 11ac20SISO | 5500 | Type5 | 7 | 9 | 234024.0 | 10 | 1 | 64.2 | 1138.0 | | |
| 11ac20SISO | 5500 | Type5 | 7 | 10 | 475207.0 | 10 | 2 | 78.8 | 1784.0 | 1604.0 | |
| 11ac20SISO | 5500 | Type5 | 7 | 11 | 715825.0 | 10 | 3 | 87.5 | 1511.0 | 1712.0 | 1683.0 |
| 11ac40SISO | 5510 | Type5 | 7 | 0 | 51446.0 | 10 | 1 | 52.6 | 1210.0 | | |
| 11ac40SISO | 5510 | Type5 | 7 | 1 | 292696.0 | 10 | 3 | 84.1 | 1314.0 | 1725.0 | 1529.0 |
| 11ac40SISO | 5510 | Type5 | 7 | 2 | 533989.0 | 10 | 3 | 97.7 | 1139.0 | 1868.0 | 1805.0 |
| 11ac40SISO | 5510 | Type5 | 7 | 3 | 775564.0 | 10 | 3 | 97.3 | 1341.0 | 1446.0 | 1755.0 |
| 11ac40SISO | 5510 | Type5 | 7 | 4 | 21542.0 | 10 | 3 | 98.8 | 1544.0 | 1386.0 | 1302.0 |
| 11ac40SISO | 5510 | Type5 | 7 | 5 | 263385.0 | 10 | 2 | 72.2 | 1771.0 | 1184.0 | |
| 11ac40SISO | 5510 | Type5 | 7 | 6 | 505581.0 | 10 | 2 | 67.6 | 1175.0 | 1027.0 | |
| 11ac40SISO | 5510 | Type5 | 7 | 7 | 747058.0 | 10 | 2 | 75.7 | 1026.0 | 1871.0 | |
| 11ac40SISO | 5510 | Type5 | 7 | 8 | 989976.0 | 10 | 1 | 60.9 | 1798.0 | | |
| 11ac40SISO | 5510 | Type5 | 7 | 9 | 234024.0 | 10 | 1 | 64.2 | 1138.0 | | |
| 11ac40SISO | 5510 | Type5 | 7 | 10 | 475207.0 | 10 | 2 | 78.8 | 1784.0 | 1604.0 | |
| 11ac40SISO | 5510 | Type5 | 7 | 11 | 715825.0 | 10 | 3 | 87.5 | 1511.0 | 1712.0 | 1683.0 |
| 11ac80SISO | 5530 | Type5 | 7 | 0 | 51446.0 | 10 | 1 | 52.6 | 1210.0 | | |
| 11ac80SISO | 5530 | Type5 | 7 | 1 | 292696.0 | 10 | 3 | 84.1 | 1314.0 | 1725.0 | 1529.0 |
| 11ac80SISO | 5530 | Type5 | 7 | 2 | 533989.0 | 10 | 3 | 97.7 | 1139.0 | 1868.0 | 1805.0 |
| 11ac80SISO | 5530 | Type5 | 7 | 3 | 775564.0 | 10 | 3 | 97.3 | 1341.0 | 1446.0 | 1755.0 |
| 11ac80SISO | 5530 | Type5 | 7 | 4 | 21542.0 | 10 | 3 | 98.8 | 1544.0 | 1386.0 | 1302.0 |
| 11ac80SISO | 5530 | Type5 | 7 | 5 | 263385.0 | 10 | 2 | 72.2 | 1771.0 | 1184.0 | |
| 11ac80SISO | 5530 | Type5 | 7 | 6 | 505581.0 | 10 | 2 | 67.6 | 1175.0 | 1027.0 | |
| 11ac80SISO | 5530 | Type5 | 7 | 7 | 747058.0 | 10 | 2 | 75.7 | 1026.0 | 1871.0 | |
| 11ac80SISO | 5530 | Type5 | 7 | 8 | 989976.0 | 10 | 1 | 60.9 | 1798.0 | | |
| 11ac80SISO | 5530 | Type5 | 7 | 9 | 234024.0 | 10 | 1 | 64.2 | 1138.0 | | |
| 11ac80SISO | 5530 | Type5 | 7 | 10 | 475207.0 | 10 | 2 | 78.8 | 1784.0 | 1604.0 | |
| 11ac80SISO | 5530 | Type5 | 7 | 11 | 715825.0 | 10 | 3 | 87.5 | 1511.0 | 1712.0 | 1683.0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 60 of 85

| | | | @FC | C_RLAN_ | DFS_SPC_ | _Radar_T | 5_SP2_Tr8@ | 2 | | | |
|------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 8 | 0 | 823112.0 | 13 | 1 | 54.1 | 1415.0 | | |
| 11ac20SISO | 5500 | Type5 | 8 | 1 | 174965.0 | 13 | 1 | 50.7 | 1221.0 | | |
| 11ac20SISO | 5500 | Type5 | 8 | 2 | 382216.0 | 13 | 1 | 52.3 | 1974.0 | | |
| 11ac20SISO | 5500 | Type5 | 8 | 3 | 587395.0 | 13 | 3 | 99.8 | 1558.0 | 1696.0 | 1949.0 |
| 11ac20SISO | 5500 | Type5 | 8 | 4 | 796897.0 | 13 | 2 | 68.4 | 1014.0 | 1099.0 | |
| 11ac20SISO | 5500 | Type5 | 8 | 5 | 149042.0 | 13 | 2 | 80.8 | 1736.0 | 1505.0 | |
| 11ac20SISO | 5500 | Type5 | 8 | 6 | 356750.0 | 13 | 1 | 62.5 | 1778.0 | | |
| 11ac20SISO | 5500 | Type5 | 8 | 7 | 563824.0 | 13 | 2 | 74.8 | 1149.0 | 1204.0 | |
| 11ac20SISO | 5500 | Type5 | 8 | 8 | 772314.0 | 13 | 1 | 50.8 | 1049.0 | | |
| 11ac20SISO | 5500 | Type5 | 8 | 9 | 123796.0 | 13 | 1 | 54.0 | 1417.0 | | |
| 11ac20SISO | 5500 | Type5 | 8 | 10 | 331215.0 | 13 | 1 | 63.0 | 1730.0 | | |
| 11ac20SISO | 5500 | Type5 | 8 | 11 | 537402.0 | 13 | 3 | 91.8 | 1143.0 | 1270.0 | 1347.0 |
| 11ac20SISO | 5500 | Type5 | 8 | 12 | 744805.0 | 13 | 2 | 79.3 | 1274.0 | 1992.0 | |
| 11ac20SISO | 5500 | Type5 | 8 | 13 | 98172.0 | 13 | 1 | 64.3 | 1937.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 0 | 823112.0 | 13 | 1 | 54.1 | 1415.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 1 | 174965.0 | 13 | 1 | 50.7 | 1221.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 2 | 382216.0 | 13 | 1 | 52.3 | 1974.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 3 | 587395.0 | 13 | 3 | 99.8 | 1558.0 | 1696.0 | 1949.0 |
| 11ac40SISO | 5510 | Type5 | 8 | 4 | 796897.0 | 13 | 2 | 68.4 | 1014.0 | 1099.0 | |
| 11ac40SISO | 5510 | Type5 | 8 | 5 | 149042.0 | 13 | 2 | 80.8 | 1736.0 | 1505.0 | |
| 11ac40SISO | 5510 | Type5 | 8 | 6 | 356750.0 | 13 | 1 | 62.5 | 1778.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 7 | 563824.0 | 13 | 2 | 74.8 | 1149.0 | 1204.0 | |
| 11ac40SISO | 5510 | Type5 | 8 | 8 | 772314.0 | 13 | 1 | 50.8 | 1049.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 9 | 123796.0 | 13 | 1 | 54.0 | 1417.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 10 | 331215.0 | 13 | 1 | 63.0 | 1730.0 | | |
| 11ac40SISO | 5510 | Type5 | 8 | 11 | 537402.0 | 13 | 3 | 91.8 | 1143.0 | 1270.0 | 1347.0 |
| 11ac40SISO | 5510 | Type5 | 8 | 12 | 744805.0 | 13 | 2 | 79.3 | 1274.0 | 1992.0 | |
| 11ac40SISO | 5510 | Type5 | 8 | 13 | 98172.0 | 13 | 1 | 64.3 | 1937.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 0 | 823112.0 | 13 | 1 | 54.1 | 1415.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 1 | 174965.0 | 13 | 1 | 50.7 | 1221.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 2 | 382216.0 | 13 | 1 | 52.3 | 1974.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 3 | 587395.0 | 13 | 3 | 99.8 | 1558.0 | 1696.0 | 1949.0 |
| 11ac80SISO | 5530 | Type5 | 8 | 4 | 796897.0 | 13 | 2 | 68.4 | 1014.0 | 1099.0 | |
| 11ac80SISO | 5530 | Type5 | 8 | 5 | 149042.0 | 13 | 2 | 80.8 | 1736.0 | 1505.0 | |
| 11ac80SISO | 5530 | Type5 | 8 | 6 | 356750.0 | 13 | 1 | 62.5 | 1778.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 7 | 563824.0 | 13 | 2 | 74.8 | 1149.0 | 1204.0 | |
| 11ac80SISO | 5530 | Type5 | 8 | 8 | 772314.0 | 13 | 1 | 50.8 | 1049.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 9 | 123796.0 | 13 | 1 | 54.0 | 1417.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 10 | 331215.0 | 13 | 1 | 63.0 | 1730.0 | | |
| 11ac80SISO | 5530 | Type5 | 8 | 11 | 537402.0 | 13 | 3 | 91.8 | 1143.0 | 1270.0 | 1347.0 |
| 11ac80SISO | 5530 | Type5 | 8 | 12 | 744805.0 | 13 | 2 | 79.3 | 1274.0 | 1992.0 | |
| 11ac80SISO | 5530 | Type5 | 8 | 13 | 98172.0 | 13 | 1 | 64.3 | 1937.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86-512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 61 of 85

| | | | @FC | C_RLAN_ | _DFS_SPC_ | Radar_T | 5_SP2_Tr9@ | ! | | | |
|------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 9 | 0 | 535615.0 | 6 | 1 | 63.4 | 1043.0 | | |
| 11ac20SISO | 5500 | Type5 | 9 | 1 | 898668.0 | 6 | 1 | 52.0 | 1863.0 | | |
| 11ac20SISO | 5500 | Type5 | 9 | 2 | 1259235.0 | 6 | 3 | 97.2 | 1973.0 | 1605.0 | 1583.0 |
| 11ac20SISO | 5500 | Type5 | 9 | 3 | 127106.0 | 6 | 2 | 78.7 | 1466.0 | 1743.0 | |
| 11ac20SISO | 5500 | Type5 | 9 | 4 | 490358.0 | 6 | 2 | 74.2 | 1280.0 | 1219.0 | |
| 11ac20SISO | 5500 | Type5 | 9 | 5 | 852409.0 | 6 | 3 | 88.7 | 1293.0 | 1934.0 | 1273.0 |
| 11ac20SISO | 5500 | Type5 | 9 | 6 | 1217152.0 | 6 | 1 | 54.3 | 1991.0 | I | |
| 11ac20SISO | 5500 | Type5 | 9 | 7 | 82296.0 | 6 | 3 | 95.4 | 1580.0 | 1555.0 | 1791.0 |
| 11ac40SISO | 5510 | Type5 | 9 | 0 | 535615.0 | 6 | 1 | 63.4 | 1043.0 | | |
| 11ac40SISO | 5510 | Type5 | 9 | 1 | 898668.0 | 6 | 1 | 52.0 | 1863.0 | | |
| 11ac40SISO | 5510 | Type5 | 9 | 2 | 1259235.0 | 6 | 3 | 97.2 | 1973.0 | 1605.0 | 1583.0 |
| 11ac40SISO | 5510 | Type5 | 9 | 3 | 127106.0 | 6 | 2 | 78.7 | 1466.0 | 1743.0 | |
| 11ac40SISO | 5510 | Type5 | 9 | 4 | 490358.0 | 6 | 2 | 74.2 | 1280.0 | 1219.0 | |
| 11ac40SISO | 5510 | Type5 | 9 | 5 | 852409.0 | 6 | 3 | 88.7 | 1293.0 | 1934.0 | 1273.0 |
| 11ac40SISO | 5510 | Type5 | 9 | 6 | 1217152.0 | 6 | 1 | 54.3 | 1991.0 | - | |
| 11ac40SISO | 5510 | Type5 | 9 | 7 | 82296.0 | 6 | 3 | 95.4 | 1580.0 | 1555.0 | 1791.0 |
| 11ac80SISO | 5530 | Type5 | 9 | 0 | 535615.0 | 6 | 1 | 63.4 | 1043.0 | | |
| 11ac80SISO | 5530 | Type5 | 9 | 1 | 898668.0 | 6 | 1 | 52.0 | 1863.0 | | |
| 11ac80SISO | 5530 | Type5 | 9 | 2 | 1259235.0 | 6 | 3 | 97.2 | 1973.0 | 1605.0 | 1583.0 |
| 11ac80SISO | 5530 | Type5 | 9 | 3 | 127106.0 | 6 | 2 | 78.7 | 1466.0 | 1743.0 | |
| 11ac80SISO | 5530 | Type5 | 9 | 4 | 490358.0 | 6 | 2 | 74.2 | 1280.0 | 1219.0 | |
| 11ac80SISO | 5530 | Type5 | 9 | 5 | 852409.0 | 6 | 3 | 88.7 | 1293.0 | 1934.0 | 1273.0 |
| 11ac80SISO | 5530 | Type5 | 9 | 6 | 1217152.0 | 6 | 1 | 54.3 | 1991.0 | | |
| 11ac80SISO | 5530 | Type5 | 9 | 7 | 82296.0 | 6 | 3 | 95.4 | 1580.0 | 1555.0 | 1791.0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, Chine (Jiangsu) Pillot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 62 of 85

| | | | @FC | C_RLAN_ | DFS_SPC_ | Radar_T | 5_SP2_Tr10@ | <u></u> | | | |
|------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) |
| 11ac20SISO | 5500 | Type5 | 10 | 0 | 209249.0 | 16 | 2 | 73.7 | 1208.0 | 1497.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 1 | 378386.0 | 16 | 3 | 97.4 | 1942.0 | 1754.0 | 1613.0 |
| 11ac20SISO | 5500 | Type5 | 10 | 2 | 548411.0 | 16 | 3 | 91.7 | 1999.0 | 1702.0 | 1462.0 |
| 11ac20SISO | 5500 | Type5 | 10 | 3 | 17733.0 | 16 | 1 | 66.2 | 1393.0 | | |
| 11ac20SISO | 5500 | Type5 | 10 | 4 | 187952.0 | 16 | 2 | 70.8 | 1968.0 | 1821.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 5 | 359277.0 | 16 | 1 | 52.3 | 1740.0 | | |
| 11ac20SISO | 5500 | Type5 | 10 | 6 | 528886.0 | 16 | 2 | 78.9 | 1308.0 | 1984.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 7 | 700166.0 | 16 | 2 | 70.9 | 1050.0 | 1358.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 8 | 167197.0 | 16 | 2 | 75.6 | 1437.0 | 1430.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 9 | 338262.0 | 16 | 1 | 59.1 | 1697.0 | | |
| 11ac20SISO | 5500 | Type5 | 10 | 10 | 508324.0 | 16 | 2 | 77.0 | 1397.0 | 1304.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 11 | 678689.0 | 16 | 2 | 67.9 | 1803.0 | 1083.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 12 | 146031.0 | 16 | 2 | 81.2 | 1720.0 | 1932.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 13 | 316923.0 | 16 | 2 | 78.7 | 1247.0 | 1121.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 14 | 488056.0 | 16 | 1 | 63.3 | 1634.0 | | |
| 11ac20SISO | 5500 | Type5 | 10 | 15 | 657326.0 | 16 | 2 | 68.9 | 1849.0 | 1423.0 | |
| 11ac20SISO | 5500 | Type5 | 10 | 16 | 125509.0 | 16 | 1 | 59.3 | 1093.0 | | |
| 11ac40SISO | 5510 | Type5 | 10 | 0 | 209249.0 | 16 | 2 | 73.7 | 1208.0 | 1497.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 1 | 378386.0 | 16 | 3 | 97.4 | 1942.0 | 1754.0 | 1613.0 |
| 11ac40SISO | 5510 | Type5 | 10 | 2 | 548411.0 | 16 | 3 | 91.7 | 1999.0 | 1702.0 | 1462.0 |
| 11ac40SISO | 5510 | Type5 | 10 | 3 | 17733.0 | 16 | 1 | 66.2 | 1393.0 | | |
| 11ac40SISO | 5510 | Type5 | 10 | 4 | 187952.0 | 16 | 2 | 70.8 | 1968.0 | 1821.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 5 | 359277.0 | 16 | 1 | 52.3 | 1740.0 | | |
| 11ac40SISO | 5510 | Type5 | 10 | 6 | 528886.0 | 16 | 2 | 78.9 | 1308.0 | 1984.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 7 | 700166.0 | 16 | 2 | 70.9 | 1050.0 | 1358.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 8 | 167197.0 | 16 | 2 | 75.6 | 1437.0 | 1430.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 9 | 338262.0 | 16 | 1 | 59.1 | 1697.0 | | |
| 11ac40SISO | 5510 | Type5 | 10 | 10 | 508324.0 | 16 | 2 | 77.0 | 1397.0 | 1304.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 11 | 678689.0 | 16 | 2 | 67.9 | 1803.0 | 1083.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 12 | 146031.0 | 16 | 2 | 81.2 | 1720.0 | 1932.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 13 | 316923.0 | 16 | 2 | 78.7 | 1247.0 | 1121.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 14 | 488056.0 | 16 | 1 | 63.3 | 1634.0 | | |
| 11ac40SISO | 5510 | Type5 | 10 | 15 | 657326.0 | 16 | 2 | 68.9 | 1849.0 | 1423.0 | |
| 11ac40SISO | 5510 | Type5 | 10 | 16 | 125509.0 | 16 | 1 | 59.3 | 1093.0 | | |
| 11ac80SISO | 5530 | Type5 | 10 | 0 | 209249.0 | 16 | 2 | 73.7 | 1208.0 | 1497.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 1 | 378386.0 | 16 | 3 | 97.4 | 1942.0 | 1754.0 | 1613.0 |
| 11ac80SISO | 5530 | Type5 | 10 | 2 | 548411.0 | 16 | 3 | 91.7 | 1999.0 | 1702.0 | 1462.0 |
| 11ac80SISO | 5530 | Type5 | 10 | 3 | 17733.0 | 16 | 1 | 66.2 | 1393.0 | | |
| 11ac80SISO | 5530 | Type5 | 10 | 4 | 187952.0 | 16 | 2 | 70.8 | 1968.0 | 1821.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 5 | 359277.0 | 16 | 1 | 52.3 | 1740.0 | | |
| 11ac80SISO | 5530 | Type5 | 10 | 6 | 528886.0 | 16 | 2 | 78.9 | 1308.0 | 1984.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 7 | 700166.0 | 16 | 2 | 70.9 | 1050.0 | 1358.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 8 | 167197.0 | 16 | 2 | 75.6 | 1437.0 | 1430.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 9 | 338262.0 | 16 | 1 | 59.1 | 1697.0 | 1204.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 10 | 508324.0 | 16 | 2 | 77.0 | 1397.0 | 1304.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 11 | 678689.0 | 16 | 2 | 67.9 | 1803.0 | 1083.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 12 | 146031.0 | 16 | 2 | 81.2 | 1720.0 | 1932.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 13 | 316923.0 | 16 | 2 | 78.7 | 1247.0 | 1121.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 14 | 488056.0 | 16 | 1 | 63.3 | 1634.0 | 1422.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 15 16 | 657326.0 | 16 | 2 | 68.9 | 1849.0 | 1423.0 | |
| 11ac80SISO | 5530 | Type5 | 10 | 16 | 125509.0 | 16 | 1 | 59.3 | 1093.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 63 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr11@ | | | | | | | | | | | | |
|--------------------------------------|--------------|----------------|----------|----------|----------------------|----------|---------------|--------------|------------------|------------------|------------------|--|
| | | | | | Burst | Chirp | Number | Pulse | | | | |
| TestMode | Channel | Radar | Trial | Burst | Offset | Width | Of | Width | PRI1 | PRI2 | PRI3 | |
| | 0110111101 | Туре | ID | ID | (µs) | (MHz) | Pulses | (µs) | (µs) | (µs) | (µs) | |
| 11ac20SISO | 5500 | Type5 | 11 | 0 | 263736.0 | 19 | 3 | 98.9 | 1381.0 | 1680.0 | 1488.0 | |
| 11ac20SISO | 5500 | Type5 | 11 | 1 | 416459.0 | 19 | 2 | 82.3 | 1716.0 | 1855.0 | | |
| 11ac20SISO | 5500 | Type5 | 11 | 2 | 567902.0 | 19 | 3 | 86.7 | 1211.0 | 1400.0 | 1919.0 | |
| 11ac20SISO | 5500 | Type5 | 11 | 3 | 92979.0 | 19 | 3 | 89.7 | 1861.0 | 1068.0 | 1282.0 | |
| 11ac20SISO | 5500 | Type5 | 11 | 4 | 245155.0 | 19 | 3 | 98.6 | 1507.0 | 1194.0 | 1461.0 | |
| 11ac20SISO | 5500 | Type5 | 11 | 5 | 397609.0 | 19 | 2 | 71.1 | 1921.0 | 1789.0 | | |
| 11ac20SISO | 5500 | Type5 | 11 | 6 | 551431.0 | 19 | 1 | 55.9 | 1947.0 | | | |
| 11ac20SISO | 5500 | Type5 | 11 | 7 | 74413.0 | 19 | 2 | 67.9 | 1350.0 | 1372.0 | | |
| 11ac20SISO | 5500 | Type5 | 11 | 8 | 226559.0 | 19 | 3 | 84.4 | 1203.0 | 1107.0 | 1443.0 | |
| 11ac20SISO | 5500 | Type5 | 11 | 9 | 380056.0 | 19 | 1 | 58.8 | 1715.0 | | | |
| 11ac20SISO | 5500 | Type5 | 11 | 10 | 533408.0 | 19 | 1 | 65.6 | 1017.0 | | | |
| 11ac20SISO | 5500 | Type5 | 11 | 11 | 55547.0 | 19 | 2 | 78.5 | 1911.0 | 1704.0 | | |
| 11ac20SISO | 5500 | Type5 | 11 | 12 | 207876.0 | 19 | 2 | 82.3 | 1845.0 | 1686.0 | 1066.0 | |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 Type5 | 11 11 | 13 14 | 359771.0 511297.0 | 19 19 | 3 | 90.1 90.2 | 1938.0 1989.0 | 1071.0 1089.0 | 1266.0 1950.0 | |
| 11ac20SISO | 5500 | - , . | 11 | 15 | 36803.0 | 19 | 2 | 83.1 | 1989.0 | 1406.0 | | |
| 11ac20SISO | 5500 | Type5 Type5 | 11 | 16 | 189652.0 | 19 | 1 | 58.8 | 1742.0 | 1400.0 | | |
| 11ac20SISO | 5500 | Type5 | 11 | 17 | 341809.0 | 19 | 2 | 77.0 | 1187.0 | 1657.0 | | |
| 11ac20SISO | 5500 | Type5 | 11 | 18 | 495737.0 | 19 | 1 | 55.0 | 1012.0 | | | |
| 11ac40SISO | 5510 | Type5 | 11 | 0 | 263736.0 | 19 | 3 | 98.9 | 1381.0 | 1680.0 | 1488.0 | |
| 11ac40SISO | 5510 | Type5 | 11 | 1 | 416459.0 | 19 | 2 | 82.3 | 1716.0 | 1855.0 | | |
| 11ac40SISO | 5510 | Type5 | 11 | 2 | 567902.0 | 19 | 3 | 86.7 | 1211.0 | 1400.0 | 1919.0 | |
| 11ac40SISO | 5510 | Type5 | 11 | 3 | 92979.0 | 19 | 3 | 89.7 | 1861.0 | 1068.0 | 1282.0 | |
| 11ac40SISO | 5510 | Type5 | 11 | 4 | 245155.0 | 19 | 3 | 98.6 | 1507.0 | 1194.0 | 1461.0 | |
| 11ac40SISO | 5510 | Type5 | 11 | 5 | 397609.0 | 19 | 2 | 71.1 | 1921.0 | 1789.0 | | |
| 11ac40SISO | 5510 | Type5 | 11 | 6 | 551431.0 | 19 | 1 | 55.9 | 1947.0 | | | |
| 11ac40SISO | 5510 | Type5 | 11 | 7 | 74413.0 | 19 | 2 | 67.9 | 1350.0 | 1372.0 | | |
| 11ac40SISO | 5510 | Type5 | 11 | 8 | 226559.0 | 19 | 3 | 84.4 | 1203.0 | 1107.0 | 1443.0 | |
| 11ac40SISO | 5510 | Type5 | 11 | 9 | 380056.0 | 19 | 1 | 58.8 | 1715.0 | | | |
| 11ac40SISO | 5510 | Type5 | 11 | 10 | 533408.0 | 19 | 1 | 65.6 | 1017.0 | | | |
| 11ac40SISO | 5510 | Type5 | 11 | 11 | 55547.0 | 19 | 2 | 78.5 | 1911.0 | 1704.0 | | |
| 11ac40SISO | 5510 | Type5 | 11 | 12 | 207876.0 | 19 | 2 | 82.3 | 1845.0 | 1686.0 | 4000.0 | |
| 11ac40SISO | 5510 | Type5 | 11 | 13 | 359771.0 | 19 | 3 | 90.1 | 1938.0 | 1071.0 | 1266.0 | |
| 11ac40SISO | 5510 5510 | Type5 | 11 | 14 15 | 511297.0 | 19 19 | 3 | 90.2 | 1989.0 | 1089.0 | 1950.0 | |
| 11ac40SISO 11ac40SISO | 5510 5510 | Type5 Type5 | 11 11 | 16 | 36803.0 189652.0 | 19 | <u>2</u> 1 | 83.1 58.8 | 1943.0 1742.0 | 1406.0 | | |
| 11ac40SISO | 5510 | Type5 | 11 | 17 | 341809.0 | 19 | 2 | 77.0 | 1187.0 | 1657.0 | | |
| 11ac40SISO | 5510 | Type5 | 11 | 18 | 495737.0 | 19 | 1 | 55.0 | 1012.0 | 1037.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 0 | 263736.0 | 19 | 3 | 98.9 | 1381.0 | 1680.0 | 1488.0 | |
| 11ac80SISO | 5530 | Type5 | 11 | 1 | 416459.0 | 19 | 2 | 82.3 | 1716.0 | 1855.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 2 | 567902.0 | 19 | 3 | 86.7 | 1211.0 | 1400.0 | 1919.0 | |
| 11ac80SISO | 5530 | Type5 | 11 | 3 | 92979.0 | 19 | 3 | 89.7 | 1861.0 | 1068.0 | 1282.0 | |
| 11ac80SISO | 5530 | Type5 | 11 | 4 | 245155.0 | 19 | 3 | 98.6 | 1507.0 | 1194.0 | 1461.0 | |
| 11ac80SISO | 5530 | Type5 | 11 | 5 | 397609.0 | 19 | 2 | 71.1 | 1921.0 | 1789.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 6 | 551431.0 | 19 | 1 | 55.9 | 1947.0 | - | | |
| 11ac80SISO | 5530 | Type5 | 11 | 7 | 74413.0 | 19 | 2 | 67.9 | 1350.0 | 1372.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 8 | 226559.0 | 19 | 3 | 84.4 | 1203.0 | 1107.0 | 1443.0 | |
| 11ac80SISO | 5530 | Type5 | 11 | 9 | 380056.0 | 19 | 1 | 58.8 | 1715.0 | | | |
| 11ac80SISO | 5530 | Type5 | 11 | 10 | 533408.0 | 19 | 1 | 65.6 | 1017.0 | 4704.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 11 | 55547.0 | 19 | 2 | 78.5 | 1911.0 | 1704.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 12 | 207876.0 | 19 | 2 | 82.3 | 1845.0 | 1686.0 | 4000.0 | |
| 11ac80SISO | 5530 | Type5 | 11 | 13 | 359771.0 | 19 | 3 | 90.1 | 1938.0 | 1071.0 | 1266.0 | |
| 11ac80SISO 11ac80SISO | 5530 5530 | Type5 | 11 11 | 14 15 | 511297.0 | 19 19 | 3 | 90.2 | 1989.0 1943.0 | 1089.0 1406.0 | 1950.0 | |
| 11ac80SISO | 5530 | Type5 Type5 | 11 | 16 | 36803.0 189652.0 | 19 | <u>2</u> 1 | 83.1 58.8 | 1742.0 | 1400.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 17 | 341809.0 | 19 | 2 | 77.0 | 1187.0 | 1657.0 | | |
| 11ac80SISO | 5530 | Type5 | 11 | 18 | 495737.0 | 19 | 1 | 55.0 | 1012.0 | | | |
| TIACOUSISO | 5550 | Types | - 11 | 10 | +33131.U | ıσ | ı | 55.0 | 1012.0 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 64 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr12@ | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | |
| 11ac20SISO | 5500 | Type5 | 12 | 0 | 22911.0 | 13 | 1 | 58.1 | 1929.0 | | | |
| 11ac20SISO | 5500 | Type5 | 12 | 1 | 216473.0 | 13 | 1 | 52.1 | 1910.0 | | | |
| 11ac20SISO | 5500 | Type5 | 12 | 2 | 410004.0 | 13 | 1 | 59.9 | 1971.0 | | | |
| 11ac20SISO | 5500 | Type5 | 12 | 3 | 603671.0 | 13 | 1 | 60.2 | 1812.0 | | | |
| 11ac20SISO | 5500 | Type5 | 12 | 4 | 794160.0 | 13 | 3 | 95.9 | 1399.0 | 1906.0 | 1608.0 | |
| 11ac20SISO | 5500 | Type5 | 12 | 5 | 192251.0 | 13 | 2 | 79.9 | 1626.0 | 1859.0 | | |
| 11ac20SISO | 5500 | Type5 | 12 | 6 | 385590.0 | 13 | 2 | 78.5 | 1238.0 | 1917.0 | | |
| 11ac20SISO | 5500 | Type5 | 12 | 7 | 579862.0 | 13 | 1 | 53.8 | 1763.0 | - | | |
| 11ac20SISO | 5500 | Type5 | 12 | 8 | 773423.0 | 13 | 1 | 64.7 | 1800.0 | | | |
| 11ac20SISO | 5500 | Type5 | 12 | 9 | 168898.0 | 13 | 1 | 61.4 | 1390.0 | | | |
| 11ac20SISO | 5500 | Type5 | 12 | 10 | 361606.0 | 13 | 2 | 83.2 | 1692.0 | 1858.0 | | |
| 11ac20SISO | 5500 | Type5 | 12 | 11 | 553866.0 | 13 | 3 | 84.7 | 1533.0 | 1677.0 | 1638.0 | |
| 11ac20SISO | 5500 | Type5 | 12 | 12 | 747241.0 | 13 | 3 | 88.7 | 1703.0 | 1528.0 | 1058.0 | |
| 11ac20SISO | 5500 | Type5 | 12 | 13 | 144710.0 | 13 | 2 | 78.3 | 1258.0 | 1951.0 | | |
| 11ac20SISO | 5500 | Type5 | 12 | 14 | 337856.0 | 13 | 2 | 69.3 | 1731.0 | 1717.0 | | |
| 11ac40SISO | 5510 | Type5 | 12 | 0 | 22911.0 | 13 | 1 | 58.1 | 1929.0 | | | |
| 11ac40SISO | 5510 | Type5 | 12 | 1 | 216473.0 | 13 | 1 | 52.1 | 1910.0 | | | |
| 11ac40SISO | 5510 | Type5 | 12 | 2 | 410004.0 | 13 | 1 | 59.9 | 1971.0 | | | |
| 11ac40SISO | 5510 | Type5 | 12 | 3 | 603671.0 | 13 | 1 | 60.2 | 1812.0 | | | |
| 11ac40SISO | 5510 | Type5 | 12 | 4 | 794160.0 | 13 | 3 | 95.9 | 1399.0 | 1906.0 | 1608.0 | |
| 11ac40SISO | 5510 | Type5 | 12 | 5 | 192251.0 | 13 | 2 | 79.9 | 1626.0 | 1859.0 | | |
| 11ac40SISO | 5510 | Type5 | 12 | 6 | 385590.0 | 13 | 2 | 78.5 | 1238.0 | 1917.0 | | |
| 11ac40SISO | 5510 | Type5 | 12 | 7 | 579862.0 | 13 | 1 | 53.8 | 1763.0 | | | |
| 11ac40SISO | 5510 | Type5 | 12 | 8 | 773423.0 | 13 | 1 | 64.7 | 1800.0 | | | |
| 11ac40SISO | 5510 | Type5 | 12 | 9 | 168898.0 | 13 | 1 | 61.4 | 1390.0 | | | |
| 11ac40SISO | 5510 | Type5 | 12 | 10 | 361606.0 | 13 | 2 | 83.2 | 1692.0 | 1858.0 | | |
| 11ac40SISO | 5510 | Type5 | 12 | 11 | 553866.0 | 13 | 3 | 84.7 | 1533.0 | 1677.0 | 1638.0 | |
| 11ac40SISO | 5510 | Type5 | 12 | 12 | 747241.0 | 13 | 3 | 88.7 | 1703.0 | 1528.0 | 1058.0 | |
| 11ac40SISO | 5510 | Type5 | 12 | 13 | 144710.0 | 13 | 2 | 78.3 | 1258.0 | 1951.0 | | |
| 11ac40SISO | 5510 | Type5 | 12 | 14 | 337856.0 | 13 | 2 | 69.3 | 1731.0 | 1717.0 | | |
| 11ac80SISO | 5530 | Type5 | 12 | 0 | 22911.0 | 13 | 1 | 58.1 | 1929.0 | | | |
| 11ac80SISO | 5530 | Type5 | 12 | 1 | 216473.0 | 13 | 1 | 52.1 | 1910.0 | | | |
| 11ac80SISO | 5530 | Type5 | 12 | 2 | 410004.0 | 13 | 1 | 59.9 | 1971.0 | | | |
| 11ac80SISO | 5530 | Type5 | 12 | 3 | 603671.0 | 13 | 1 | 60.2 | 1812.0 | | | |
| 11ac80SISO | 5530 | Type5 | 12 | 4 | 794160.0 | 13 | 3 | 95.9 | 1399.0 | 1906.0 | 1608.0 | |
| 11ac80SISO | 5530 | Type5 | 12 | 5 | 192251.0 | 13 | 2 | 79.9 | 1626.0 | 1859.0 | | |
| 11ac80SISO | 5530 | Type5 | 12 | 6 | 385590.0 | 13 | 2 | 78.5 | 1238.0 | 1917.0 | | |
| 11ac80SISO | 5530 | Type5 | 12 | 7 | 579862.0 | 13 | 1 | 53.8 | 1763.0 | | | |
| 11ac80SISO | 5530 | Type5 | 12 | 8 | 773423.0 | 13 | 1 | 64.7 | 1800.0 | | | |
| 11ac80SISO | 5530 | Type5 | 12 | 9 | 168898.0 | 13 | 1 | 61.4 | 1390.0 | | | |
| 11ac80SISO | 5530 | Type5 | 12 | 10 | 361606.0 | 13 | 2 | 83.2 | 1692.0 | 1858.0 | | |
| 11ac80SISO | 5530 | Type5 | 12 | 11 | 553866.0 | 13 | 3 | 84.7 | 1533.0 | 1677.0 | 1638.0 | |
| 11ac80SISO | 5530 | Type5 | 12 | 12 | 747241.0 | 13 | 3 | 88.7 | 1703.0 | 1528.0 | 1058.0 | |
| 11ac80SISO | 5530 | Type5 | 12 | 13 | 144710.0 | 13 | 2 | 78.3 | 1258.0 | 1951.0 | | |
| 11ac80SISO | 5530 | Type5 | 12 | 14 | 337856.0 | 13 | 2 | 69.3 | 1731.0 | 1717.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86-512) 62992980 t (86-512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 65 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr13@ | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | |
| 11ac20SISO | 5500 | Type5 | 13 | 0 | 664275.0 | 10 | 2 | 75.3 | 1994.0 | 1612.0 | | |
| 11ac20SISO | 5500 | Type5 | 13 | 1 | 907886.0 | 10 | 1 | 56.3 | 1456.0 | | | |
| 11ac20SISO | 5500 | Type5 | 13 | 2 | 151316.0 | 10 | 2 | 67.7 | 1617.0 | 1185.0 | | |
| 11ac20SISO | 5500 | Type5 | 13 | 3 | 393746.0 | 10 | 1 | 55.6 | 1337.0 | | | |
| 11ac20SISO | 5500 | Type5 | 13 | 4 | 635093.0 | 10 | 2 | 75.2 | 1421.0 | 1267.0 | | |
| 11ac20SISO | 5500 | Type5 | 13 | 5 | 876993.0 | 10 | 2 | 76.3 | 1359.0 | 1305.0 | | |
| 11ac20SISO | 5500 | Type5 | 13 | 6 | 121278.0 | 10 | 3 | 85.7 | 1547.0 | 1362.0 | 1924.0 | |
| 11ac20SISO | 5500 | Type5 | 13 | 7 | 362696.0 | 10 | 3 | 98.4 | 1873.0 | 1550.0 | 1249.0 | |
| 11ac20SISO | 5500 | Type5 | 13 | 8 | 604342.0 | 10 | 3 | 86.4 | 1779.0 | 1439.0 | 1046.0 | |
| 11ac20SISO | 5500 | Type5 | 13 | 9 | 846453.0 | 10 | 3 | 93.6 | 1059.0 | 1031.0 | 1452.0 | |
| 11ac20SISO | 5500 | Type5 | 13 | 10 | 91871.0 | 10 | 1 | 63.3 | 1328.0 | | | |
| 11ac20SISO | 5500 | Type5 | 13 | 11 | 333050.0 | 10 | 3 | 92.4 | 1412.0 | 1673.0 | 1322.0 | |
| 11ac40SISO | 5510 | Type5 | 13 | 0 | 664275.0 | 10 | 2 | 75.3 | 1994.0 | 1612.0 | | |
| 11ac40SISO | 5510 | Type5 | 13 | 1 | 907886.0 | 10 | 1 | 56.3 | 1456.0 | | | |
| 11ac40SISO | 5510 | Type5 | 13 | 2 | 151316.0 | 10 | 2 | 67.7 | 1617.0 | 1185.0 | | |
| 11ac40SISO | 5510 | Type5 | 13 | 3 | 393746.0 | 10 | 1 | 55.6 | 1337.0 | | | |
| 11ac40SISO | 5510 | Type5 | 13 | 4 | 635093.0 | 10 | 2 | 75.2 | 1421.0 | 1267.0 | | |
| 11ac40SISO | 5510 | Type5 | 13 | 5 | 876993.0 | 10 | 2 | 76.3 | 1359.0 | 1305.0 | | |
| 11ac40SISO | 5510 | Type5 | 13 | 6 | 121278.0 | 10 | 3 | 85.7 | 1547.0 | 1362.0 | 1924.0 | |
| 11ac40SISO | 5510 | Type5 | 13 | 7 | 362696.0 | 10 | 3 | 98.4 | 1873.0 | 1550.0 | 1249.0 | |
| 11ac40SISO | 5510 | Type5 | 13 | 8 | 604342.0 | 10 | 3 | 86.4 | 1779.0 | 1439.0 | 1046.0 | |
| 11ac40SISO | 5510 | Type5 | 13 | 9 | 846453.0 | 10 | 3 | 93.6 | 1059.0 | 1031.0 | 1452.0 | |
| 11ac40SISO | 5510 | Type5 | 13 | 10 | 91871.0 | 10 | 1 | 63.3 | 1328.0 | | | |
| 11ac40SISO | 5510 | Type5 | 13 | 11 | 333050.0 | 10 | 3 | 92.4 | 1412.0 | 1673.0 | 1322.0 | |
| 11ac80SISO | 5530 | Type5 | 13 | 0 | 664275.0 | 10 | 2 | 75.3 | 1994.0 | 1612.0 | | |
| 11ac80SISO | 5530 | Type5 | 13 | 1 | 907886.0 | 10 | 1 | 56.3 | 1456.0 | | | |
| 11ac80SISO | 5530 | Type5 | 13 | 2 | 151316.0 | 10 | 2 | 67.7 | 1617.0 | 1185.0 | | |
| 11ac80SISO | 5530 | Type5 | 13 | 3 | 393746.0 | 10 | 1 | 55.6 | 1337.0 | | | |
| 11ac80SISO | 5530 | Type5 | 13 | 4 | 635093.0 | 10 | 2 | 75.2 | 1421.0 | 1267.0 | | |
| 11ac80SISO | 5530 | Type5 | 13 | 5 | 876993.0 | 10 | 2 | 76.3 | 1359.0 | 1305.0 | | |
| 11ac80SISO | 5530 | Type5 | 13 | 6 | 121278.0 | 10 | 3 | 85.7 | 1547.0 | 1362.0 | 1924.0 | |
| 11ac80SISO | 5530 | Type5 | 13 | 7 | 362696.0 | 10 | 3 | 98.4 | 1873.0 | 1550.0 | 1249.0 | |
| 11ac80SISO | 5530 | Type5 | 13 | 8 | 604342.0 | 10 | 3 | 86.4 | 1779.0 | 1439.0 | 1046.0 | |
| 11ac80SISO | 5530 | Type5 | 13 | 9 | 846453.0 | 10 | 3 | 93.6 | 1059.0 | 1031.0 | 1452.0 | |
| 11ac80SISO | 5530 | Type5 | 13 | 10 | 91871.0 | 10 | 1 | 63.3 | 1328.0 | | | |
| 11ac80SISO | 5530 | Type5 | 13 | 11 | 333050.0 | 10 | 3 | 92.4 | 1412.0 | 1673.0 | 1322.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 66 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr14@ | | | | | | | | | | | | |
|--------------------------------------|--------------|----------------|----------|----------|----------------------|----------|---------------|--------------|------------------|------------------|--------|--|
| | | | | | Burst | Chirp | Number | Pulse | | 5510 | 5510 | |
| TestMode | Channel | Radar | Trial | Burst | Offset | Width | Of | Width | PRI1 | PRI2 | PRI3 | |
| | | Type | ID | ID | (µs) | (MHz) | Pulses | (µs) | (µs) | (µs) | (µs) | |
| 11ac20SISO | 5500 | Type5 | 14 | 0 | 361323.0 | 18 | 3 | 93.3 | 1983.0 | 1912.0 | 1535.0 | |
| 11ac20SISO | 5500 | Type5 | 14 | 1 | 515261.0 | 18 | 2 | 69.1 | 1102.0 | 1794.0 | | |
| 11ac20SISO | 5500 | Type5 | 14 | 2 | 39025.0 | 18 | 3 | 86.9 | 1044.0 | 1152.0 | 1148.0 | |
| 11ac20SISO | 5500 | Type5 | 14 | 3 | 190900.0 | 18 | 3 | 84.9 | 1894.0 | 1948.0 | 1118.0 | |
| 11ac20SISO | 5500 | Type5 | 14 | 4 | 343941.0 | 18 | 2 | 72.3 | 1094.0 | 1916.0 | | |
| 11ac20SISO | 5500 | Type5 | 14 | 5 | 497624.0 | 18 | 1 | 51.7 | 1447.0 | | | |
| 11ac20SISO | 5500 | Type5 | 14 | 6 | 20319.0 | 18 | 1 | 58.3 | 1429.0 | | | |
| 11ac20SISO | 5500 | Type5 | 14 | 7 | 172999.0 | 18 | 1 | 60.8 | 1979.0 | | | |
| 11ac20SISO | 5500 | Type5 | 14 | 8 | 325872.0 | 18 | 1 | 57.1 | 1641.0 | 4004.0 | 4400.0 | |
| 11ac20SISO | 5500 | Type5 | 14 | 9 | 475841.0 | 18 | 3 | 88.9 | 1886.0 | 1964.0 | 1489.0 | |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 | 14 14 | 10 11 | 1489.0 153647.0 | 18 18 | 3 | 72.0 90.9 | 1909.0 1261.0 | 1297.0 1566.0 | 1370.0 | |
| 11ac20SISO | 5500 | Type5 Type5 | 14 | 12 | 307096.0 | 18 | <u>3</u> 1 | 59.8 | 1552.0 | 1300.0 | 1370.0 | |
| 11ac20SISO | 5500 | Type5 | 14 | 13 | 458804.0 | 18 | 2 | 70.0 | 1759.0 | 1291.0 | | |
| 11ac20SISO | 5500 | Type5 | 14 | 14 | 610798.0 | 18 | 2 | 67.2 | 1625.0 | 1881.0 | | |
| 11ac20SISO | 5500 | Type5 | 14 | 15 | 134759.0 | 18 | 3 | 91.2 | 1382.0 | 1832.0 | 1661.0 | |
| 11ac20SISO | 5500 | Type5 | 14 | 16 | 288306.0 | 18 | 1 | 56.5 | 1483.0 | | | |
| 11ac20SISO | 5500 | Type5 | 14 | 17 | 441296.0 | 18 | 1 | 51.2 | 1237.0 | | | |
| 11ac20SISO | 5500 | Type5 | 14 | 18 | 592780.0 | 18 | 2 | 74.1 | 1471.0 | 1245.0 | | |
| 11ac40SISO | 5510 | Type5 | 14 | 0 | 361323.0 | 18 | 3 | 93.3 | 1983.0 | 1912.0 | 1535.0 | |
| 11ac40SISO | 5510 | Type5 | 14 | 1 | 515261.0 | 18 | 2 | 69.1 | 1102.0 | 1794.0 | | |
| 11ac40SISO | 5510 | Type5 | 14 | 2 | 39025.0 | 18 | 3 | 86.9 | 1044.0 | 1152.0 | 1148.0 | |
| 11ac40SISO | 5510 | Type5 | 14 | 3 | 190900.0 | 18 | 3 | 84.9 | 1894.0 | 1948.0 | 1118.0 | |
| 11ac40SISO | 5510 | Type5 | 14 | 4 | 343941.0 | 18 | 2 | 72.3 | 1094.0 | 1916.0 | | |
| 11ac40SISO | 5510 | Type5 | 14 | 5 | 497624.0 | 18 | 1 | 51.7 | 1447.0 | | | |
| 11ac40SISO | 5510 | Type5 | 14 | 6 | 20319.0 | 18 | 1 | 58.3 | 1429.0 | | | |
| 11ac40SISO | 5510 | Type5 | 14 | 7 | 172999.0 | 18 | 1 | 60.8 | 1979.0 | | | |
| 11ac40SISO | 5510 | Type5 | 14 | 8 | 325872.0 | 18 | 1 | 57.1 | 1641.0 | | | |
| 11ac40SISO | 5510 | Type5 | 14 | 9 | 475841.0 | 18 | 3 | 88.9 | 1886.0 | 1964.0 | 1489.0 | |
| 11ac40SISO | 5510 | Type5 | 14 | 10 | 1489.0 | 18 | 2 | 72.0 | 1909.0 | 1297.0 | | |
| 11ac40SISO | 5510 | Type5 | 14 | 11 | 153647.0 | 18 | 3 | 90.9 | 1261.0 | 1566.0 | 1370.0 | |
| 11ac40SISO 11ac40SISO | 5510 5510 | Type5 Type5 | 14 14 | 12 13 | 307096.0 458804.0 | 18 18 | 2 | 59.8 70.0 | 1552.0 1759.0 | 1291.0 | | |
| 11ac40SISO | 5510 | Type5 | 14 | 14 | 610798.0 | 18 | 2 | 67.2 | 1625.0 | 1881.0 | | |
| 11ac40SISO | 5510 | Type5 | 14 | 15 | 134759.0 | 18 | 3 | 91.2 | 1382.0 | 1832.0 | 1661.0 | |
| 11ac40SISO | 5510 | Type5 | 14 | 16 | 288306.0 | 18 | 1 | 56.5 | 1483.0 | | | |
| 11ac40SISO | 5510 | Type5 | 14 | 17 | 441296.0 | 18 | 1 | 51.2 | 1237.0 | | | |
| 11ac40SISO | 5510 | Type5 | 14 | 18 | 592780.0 | 18 | 2 | 74.1 | 1471.0 | 1245.0 | | |
| 11ac80SISO | 5530 | Type5 | 14 | 0 | 361323.0 | 18 | 3 | 93.3 | 1983.0 | 1912.0 | 1535.0 | |
| 11ac80SISO | 5530 | Type5 | 14 | 1 | 515261.0 | 18 | 2 | 69.1 | 1102.0 | 1794.0 | | |
| 11ac80SISO | 5530 | Type5 | 14 | 2 | 39025.0 | 18 | 3 | 86.9 | 1044.0 | 1152.0 | 1148.0 | |
| 11ac80SISO | 5530 | Type5 | 14 | 3 | 190900.0 | 18 | 3 | 84.9 | 1894.0 | 1948.0 | 1118.0 | |
| 11ac80SISO | 5530 | Type5 | 14 | 4 | 343941.0 | 18 | 2 | 72.3 | 1094.0 | 1916.0 | | |
| 11ac80SISO | 5530 | Type5 | 14 | 5 | 497624.0 | 18 | 1 | 51.7 | 1447.0 | | | |
| 11ac80SISO | 5530 | Type5 | 14 | 6 | 20319.0 | 18 | 1 | 58.3 | 1429.0 | | | |
| 11ac80SISO | 5530 | Type5 | 14 | 7 | 172999.0 | 18 | 1 | 60.8 | 1979.0 | | | |
| 11ac80SISO | 5530 | Type5 | 14 | 8 | 325872.0 | 18 | 1 | 57.1 | 1641.0 | | | |
| 11ac80SISO | 5530 | Type5 | 14 | 9 | 475841.0 | 18 | 3 | 88.9 | 1886.0 | 1964.0 | 1489.0 | |
| 11ac80SISO | 5530 | Type5 | 14 | 10 | 1489.0 | 18 | 2 | 72.0 | 1909.0 | 1297.0 | 4070.0 | |
| 11ac80SISO | 5530 | Type5 | 14 | 11 | 153647.0 | 18 | 3 | 90.9 | 1261.0 | 1566.0 | 1370.0 | |
| 11ac80SISO | 5530 | Type5 | 14 | 12 | 307096.0 | 18 | 1 | 59.8 | 1552.0 | 1201.0 | | |
| 11ac80SISO | 5530 5530 | Type5 | 14 | 13 | 458804.0 | 18 | 2 | 70.0 | 1759.0 | 1291.0 | | |
| 11ac80SISO 11ac80SISO | 5530 5530 | Type5 Type5 | 14 14 | 14 15 | 610798.0 134759.0 | 18 18 | 3 | 67.2 91.2 | 1625.0 1382.0 | 1881.0 1832.0 | 1661.0 | |
| 11ac80SISO | 5530 | Type5 | 14 | 16 | 288306.0 | 18 | <u> </u> | 56.5 | 1483.0 | 1032.0 | | |
| 11ac80SISO | 5530 | Type5 | 14 | 17 | 441296.0 | 18 | 1 | 51.2 | 1237.0 | | | |
| 11ac80SISO | 5530 | Type5 | 14 | 18 | 592780.0 | 18 | 2 | 74.1 | 1471.0 | 1245.0 | | |
| TIACOUSISO | 3330 | Types | 14 | 10 | J92100.0 | 10 | | 74.1 | 147 1.0 | 1240.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 67 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr15@ | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | |
| 11ac20SISO | 5500 | Type5 | 15 | 0 | 158286.0 | 12 | 2 | 76.9 | 1110.0 | 1140.0 | | |
| 11ac20SISO | 5500 | Type5 | 15 | 1 | 366024.0 | 12 | 1 | 50.2 | 1316.0 | | | |
| 11ac20SISO | 5500 | Type5 | 15 | 2 | 573452.0 | 12 | 1 | 62.9 | 1520.0 | | | |
| 11ac20SISO | 5500 | Type5 | 15 | 3 | 780619.0 | 12 | 1 | 64.7 | 1902.0 | | | |
| 11ac20SISO | 5500 | Type5 | 15 | 4 | 132455.0 | 12 | 3 | 83.8 | 1410.0 | 1097.0 | 1621.0 | |
| 11ac20SISO | 5500 | Type5 | 15 | 5 | 340207.0 | 12 | 1 | 65.4 | 1944.0 | | | |
| 11ac20SISO | 5500 | Type5 | 15 | 6 | 548208.0 | 12 | 1 | 53.2 | 1024.0 | | | |
| 11ac20SISO | 5500 | Type5 | 15 | 7 | 755333.0 | 12 | 1 | 51.7 | 1603.0 | | | |
| 11ac20SISO | 5500 | Type5 | 15 | 8 | 107117.0 | 12 | 2 | 78.7 | 1804.0 | 1168.0 | | |
| 11ac20SISO | 5500 | Type5 | 15 | 9 | 314500.0 | 12 | 2 | 72.4 | 1030.0 | 1343.0 | | |
| 11ac20SISO | 5500 | Type5 | 15 | 10 | 522447.0 | 12 | 1 | 53.8 | 1327.0 | | | |
| 11ac20SISO | 5500 | Type5 | 15 | 11 | 728517.0 | 12 | 2 | 73.6 | 1524.0 | 1553.0 | | |
| 11ac20SISO | 5500 | Type5 | 15 | 12 | 81611.0 | 12 | 2 | 66.7 | 1722.0 | 1122.0 | | |
| 11ac20SISO | 5500 | Type5 | 15 | 13 | 288948.0 | 12 | 2 | 82.5 | 1404.0 | 1019.0 | | |
| 11ac40SISO | 5510 | Type5 | 15 | 0 | 158286.0 | 12 | 2 | 76.9 | 1110.0 | 1140.0 | | |
| 11ac40SISO | 5510 | Type5 | 15 | 1 | 366024.0 | 12 | 1 | 50.2 | 1316.0 | | | |
| 11ac40SISO | 5510 | Type5 | 15 | 2 | 573452.0 | 12 | 1 | 62.9 | 1520.0 | | | |
| 11ac40SISO | 5510 | Type5 | 15 | 3 | 780619.0 | 12 | 1 | 64.7 | 1902.0 | | | |
| 11ac40SISO | 5510 | Type5 | 15 | 4 | 132455.0 | 12 | 3 | 83.8 | 1410.0 | 1097.0 | 1621.0 | |
| 11ac40SISO | 5510 | Type5 | 15 | 5 | 340207.0 | 12 | 1 | 65.4 | 1944.0 | | | |
| 11ac40SISO | 5510 | Type5 | 15 | 6 | 548208.0 | 12 | 1 | 53.2 | 1024.0 | | | |
| 11ac40SISO | 5510 | Type5 | 15 | 7 | 755333.0 | 12 | 1 | 51.7 | 1603.0 | | | |
| 11ac40SISO | 5510 | Type5 | 15 | 8 | 107117.0 | 12 | 2 | 78.7 | 1804.0 | 1168.0 | | |
| 11ac40SISO | 5510 | Type5 | 15 | 9 | 314500.0 | 12 | 2 | 72.4 | 1030.0 | 1343.0 | | |
| 11ac40SISO | 5510 | Type5 | 15 | 10 | 522447.0 | 12 | 1 | 53.8 | 1327.0 | | | |
| 11ac40SISO | 5510 | Type5 | 15 | 11 | 728517.0 | 12 | 2 | 73.6 | 1524.0 | 1553.0 | | |
| 11ac40SISO | 5510 | Type5 | 15 | 12 | 81611.0 | 12 | 2 | 66.7 | 1722.0 | 1122.0 | | |
| 11ac40SISO | 5510 | Type5 | 15 | 13 | 288948.0 | 12 | 2 | 82.5 | 1404.0 | 1019.0 | | |
| 11ac80SISO | 5530 | Type5 | 15 | 0 | 158286.0 | 12 | 2 | 76.9 | 1110.0 | 1140.0 | | |
| 11ac80SISO | 5530 | Type5 | 15 | 1 | 366024.0 | 12 | 1 | 50.2 | 1316.0 | | | |
| 11ac80SISO | 5530 | Type5 | 15 | 2 | 573452.0 | 12 | 1 | 62.9 | 1520.0 | | | |
| 11ac80SISO | 5530 | Type5 | 15 | 3 | 780619.0 | 12 | 1 | 64.7 | 1902.0 | | | |
| 11ac80SISO | 5530 | Type5 | 15 | 4 | 132455.0 | 12 | 3 | 83.8 | 1410.0 | 1097.0 | 1621.0 | |
| 11ac80SISO | 5530 | Type5 | 15 | 5 | 340207.0 | 12 | 1 | 65.4 | 1944.0 | | | |
| 11ac80SISO | 5530 | Type5 | 15 | 6 | 548208.0 | 12 | 1 | 53.2 | 1024.0 | | | |
| 11ac80SISO | 5530 | Type5 | 15 | 7 | 755333.0 | 12 | 1 | 51.7 | 1603.0 | | | |
| 11ac80SISO | 5530 | Type5 | 15 | 8 | 107117.0 | 12 | 2 | 78.7 | 1804.0 | 1168.0 | | |
| 11ac80SISO | 5530 | Type5 | 15 | 9 | 314500.0 | 12 | 2 | 72.4 | 1030.0 | 1343.0 | | |
| 11ac80SISO | 5530 | Type5 | 15 | 10 | 522447.0 | 12 | 1 | 53.8 | 1327.0 | | | |
| 11ac80SISO | 5530 | Type5 | 15 | 11 | 728517.0 | 12 | 2 | 73.6 | 1524.0 | 1553.0 | | |
| 11ac80SISO | 5530 | Type5 | 15 | 12 | 81611.0 | 12 | 2 | 66.7 | 1722.0 | 1122.0 | | |
| 11ac80SISO | 5530 | Type5 | 15 | 13 | 288948.0 | 12 | 2 | 82.5 | 1404.0 | 1019.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 68 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr16@ | | | | | | | | | | | | |
|--------------------------------------|--------------|----------------|----------|----------|----------------------|----------|--------|--------------|------------------|------------------|--------|--|
| | | Б. | | Б , | Burst | Chirp | Number | Pulse | DDIA | DDIO | BBIO | |
| TestMode | Channel | Radar | Trial | Burst | Offset | Width | Of | Width | PRI1 | PRI2 | PRI3 | |
| | | Type | ID | ID | (µs) | (MHz) | Pulses | (µs) | (µs) | (µs) | (µs) | |
| 11ac20SISO | 5500 | Type5 | 16 | 0 | 345766.0 | 20 | 3 | 87.6 | 1565.0 | 1055.0 | 1840.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 1 | 490019.0 | 20 | 3 | 85.2 | 1735.0 | 1541.0 | 1408.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 2 | 39073.0 | 20 | 3 | 84.8 | 1534.0 | 1889.0 | 1463.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 3 | 183923.0 | 20 | 2 | 77.9 | 1749.0 | 1460.0 | | |
| 11ac20SISO | 5500 | Type5 | 16 | 4 | 328777.0 | 20 | 2 | 76.5 | 1518.0 | 1485.0 | | |
| 11ac20SISO | 5500 | Type5 | 16 | 5 | 474728.0 | 20 | 1 | 60.9 | 1540.0 | 1010.0 | | |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 Type5 | 16 16 | 6 7 | 21394.0 165992.0 | 20 20 | 2 2 | 83.0 80.4 | 1080.0 1824.0 | 1752.0 | | |
| 11ac20SISO | 5500 | Type5 | 16 | 8 | 310973.0 | 20 | 2 | 67.5 | 1764.0 | 1181.0 | | |
| 11ac20SISO | 5500 | Type5 | 16 | 9 | 456884.0 | 20 | 1 | 62.1 | 1495.0 | | | |
| 11ac20SISO | 5500 | Type5 | 16 | 10 | 3515.0 | 20 | 3 | 86.4 | 1773.0 | 1966.0 | 1263.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 11 | 147928.0 | 20 | 3 | 84.3 | 1593.0 | 1188.0 | 1788.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 12 | 293225.0 | 20 | 2 | 76.9 | 1226.0 | 1537.0 | | |
| 11ac20SISO | 5500 | Type5 | 16 | 13 | 436922.0 | 20 | 3 | 95.8 | 1192.0 | 1298.0 | 1844.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 14 | 584015.0 | 20 | 1 | 55.2 | 1644.0 | | | |
| 11ac20SISO | 5500 | Type5 | 16 | 15 | 130832.0 | 20 | 1 | 59.0 | 1402.0 | I | | |
| 11ac20SISO | 5500 | Type5 | 16 | 16 | 274684.0 | 20 | 3 | 94.5 | 1296.0 | 1700.0 | 1283.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 17 | 418579.0 | 20 | 3 | 91.9 | 1970.0 | 1978.0 | 1165.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 18 | 563464.0 | 20 | 3 | 85.2 | 1732.0 | 1551.0 | 1189.0 | |
| 11ac20SISO | 5500 | Type5 | 16 | 19 | 112787.0 | 20 | 2 | 69.5 | 1038.0 | 1224.0 | | |
| 11ac40SISO | 5510 | Type5 | 16 | 0 | 345766.0 | 20 | 3 | 87.6 | 1565.0 | 1055.0 | 1840.0 | |
| 11ac40SISO | 5510 | Type5 | 16 | 1 | 490019.0 | 20 | 3 | 85.2 | 1735.0 | 1541.0 | 1408.0 | |
| 11ac40SISO | 5510 | Type5 | 16 | 2 | 39073.0 | 20 | 3 | 84.8 | 1534.0 | 1889.0 | 1463.0 | |
| 11ac40SISO 11ac40SISO | 5510 5510 | Type5 Type5 | 16 16 | 3 4 | 183923.0 328777.0 | 20 20 | 2 | 77.9 76.5 | 1749.0 1518.0 | 1460.0 1485.0 | | |
| 11ac40SISO | 5510 | Type5 | 16 | 5 | 474728.0 | 20 | 1 | 60.9 | 1540.0 | 1465.0 | | |
| 11ac40SISO | 5510 | Type5 | 16 | 6 | 21394.0 | 20 | 2 | 83.0 | 1080.0 | 1010.0 | | |
| 11ac40SISO | 5510 | Type5 | 16 | 7 | 165992.0 | 20 | 2 | 80.4 | 1824.0 | 1752.0 | | |
| 11ac40SISO | 5510 | Type5 | 16 | 8 | 310973.0 | 20 | 2 | 67.5 | 1764.0 | 1181.0 | | |
| 11ac40SISO | 5510 | Type5 | 16 | 9 | 456884.0 | 20 | 1 | 62.1 | 1495.0 | | | |
| 11ac40SISO | 5510 | Type5 | 16 | 10 | 3515.0 | 20 | 3 | 86.4 | 1773.0 | 1966.0 | 1263.0 | |
| 11ac40SISO | 5510 | Type5 | 16 | 11 | 147928.0 | 20 | 3 | 84.3 | 1593.0 | 1188.0 | 1788.0 | |
| 11ac40SISO | 5510 | Type5 | 16 | 12 | 293225.0 | 20 | 2 | 76.9 | 1226.0 | 1537.0 | | |
| 11ac40SISO | 5510 | Type5 | 16 | 13 | 436922.0 | 20 | 3 | 95.8 | 1192.0 | 1298.0 | 1844.0 | |
| 11ac40SISO | 5510 | Type5 | 16 | 14 | 584015.0 | 20 | 1 | 55.2 | 1644.0 | | | |
| 11ac40SISO | 5510 | Type5 | 16 | 15 | 130832.0 | 20 | 1 | 59.0 | 1402.0 | | | |
| 11ac40SISO | 5510 | Type5 | 16 | 16 | 274684.0 | 20 | 3 | 94.5 | 1296.0 | 1700.0 | 1283.0 | |
| 11ac40SISO | 5510 | Type5 | 16 | 17 | 418579.0 | 20 | 3 | 91.9 | 1970.0 | 1978.0 | 1165.0 | |
| 11ac40SISO 11ac40SISO | 5510 5510 | Type5 | 16 16 | 18 19 | 563464.0 112787.0 | 20 20 | 3 2 | 85.2 69.5 | 1732.0 1038.0 | 1551.0 1224.0 | 1189.0 | |
| 11ac40SISO | 5530 | Type5 Type5 | 16 | 0 | 345766.0 | 20 | 3 | 87.6 | 1565.0 | 1055.0 | 1840.0 | |
| 11ac80SISO | 5530 | Type5 | 16 | 1 | 490019.0 | 20 | 3 | 85.2 | 1735.0 | 1541.0 | 1408.0 | |
| 11ac80SISO | 5530 | Type5 | 16 | 2 | 39073.0 | 20 | 3 | 84.8 | 1534.0 | 1889.0 | 1463.0 | |
| 11ac80SISO | 5530 | Type5 | 16 | 3 | 183923.0 | 20 | 2 | 77.9 | 1749.0 | 1460.0 | | |
| 11ac80SISO | 5530 | Type5 | 16 | 4 | 328777.0 | 20 | 2 | 76.5 | 1518.0 | 1485.0 | | |
| 11ac80SISO | 5530 | Type5 | 16 | 5 | 474728.0 | 20 | 1 | 60.9 | 1540.0 | | | |
| 11ac80SISO | 5530 | Type5 | 16 | 6 | 21394.0 | 20 | 2 | 83.0 | 1080.0 | 1010.0 | | |
| 11ac80SISO | 5530 | Type5 | 16 | 7 | 165992.0 | 20 | 2 | 80.4 | 1824.0 | 1752.0 | | |
| 11ac80SISO | 5530 | Type5 | 16 | 8 | 310973.0 | 20 | 2 | 67.5 | 1764.0 | 1181.0 | | |
| 11ac80SISO | 5530 | Type5 | 16 | 9 | 456884.0 | 20 | 1 | 62.1 | 1495.0 | | | |
| 11ac80SISO | 5530 | Type5 | 16 | 10 | 3515.0 | 20 | 3 | 86.4 | 1773.0 | 1966.0 | 1263.0 | |
| 11ac80SISO | 5530 | Type5 | 16 | 11 | 147928.0 | 20 | 3 | 84.3 | 1593.0 | 1188.0 | 1788.0 | |
| 11ac80SISO | 5530 | Type5 | 16 | 12 | 293225.0 | 20 | 2 | 76.9 | 1226.0 | 1537.0 | | |
| 11ac80SISO | 5530 | Type5 | 16 | 13 | 436922.0 | 20 | 3 | 95.8 | 1192.0 | 1298.0 | 1844.0 | |
| 11ac80SISO | 5530 5530 | Type5 | 16 16 | 14 | 584015.0 | 20 | 1 | 55.2 | 1644.0 | | | |
| 11ac80SISO 11ac80SISO | 5530 5530 | Type5 | 16 16 | 15 16 | 130832.0 274684.0 | 20 20 | 3 | 59.0 94.5 | 1402.0 1296.0 | 1700.0 | 1283.0 | |
| 1180000100 | 5530 | Type5 | 10 | 10 | 214004.0 | ∠∪ | J | 94.5 | 1290.0 | 1700.0 | 1203.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 69 of 85

| 11ac80SISO | 5530 | Type5 | 16 | 17 | 418579.0 | 20 | 3 | 91.9 | 1970.0 | 1978.0 | 1165.0 |
|------------|------|-------|----|----|----------|----|---|------|--------|--------|--------|
| 11ac80SISO | 5530 | Type5 | 16 | 18 | 563464.0 | 20 | 3 | 85.2 | 1732.0 | 1551.0 | 1189.0 |
| 11ac80SISO | 5530 | Type5 | 16 | 19 | 112787.0 | 20 | 2 | 69.5 | 1038.0 | 1224.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Infustrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 70 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr17@ | | | | | | | | | | | | |
|--------------------------------------|---------|-------|-------|-------|----------|-------|--------|-------|--------|--------|--------|--|
| | | | @i cc | | | | | | | | | |
| | | Radar | Trial | Burst | Burst | Chirp | Number | Pulse | PRI1 | PRI2 | PRI3 | |
| TestMode | Channel | Type | ID | ID | Offset | Width | Of | Width | (µs) | (µs) | (µs) | |
| | | Турс | | טו | (µs) | (MHz) | Pulses | (µs) | ,, | | / | |
| 11ac20SISO | 5500 | Type5 | 17 | 0 | 429224.0 | 10 | 3 | 86.4 | 1259.0 | 1918.0 | 1455.0 | |
| 11ac20SISO | 5500 | Type5 | 17 | 1 | 670241.0 | 10 | 3 | 92.2 | 1598.0 | 1719.0 | 1895.0 | |
| 11ac20SISO | 5500 | Type5 | 17 | 2 | 912880.0 | 10 | 2 | 80.4 | 1816.0 | 1899.0 | | |
| 11ac20SISO | 5500 | Type5 | 17 | 3 | 158603.0 | 10 | 1 | 54.3 | 1335.0 | | | |
| 11ac20SISO | 5500 | Type5 | 17 | 4 | 400824.0 | 10 | 1 | 53.1 | 1303.0 | | - | |
| 11ac20SISO | 5500 | Type5 | 17 | 5 | 641915.0 | 10 | 2 | 69.4 | 1503.0 | 1546.0 | - | |
| 11ac20SISO | 5500 | Type5 | 17 | 6 | 883823.0 | 10 | 2 | 69.1 | 1279.0 | 1639.0 | | |
| 11ac20SISO | 5500 | Type5 | 17 | 7 | 128373.0 | 10 | 3 | 100.0 | 1375.0 | 1438.0 | 1595.0 | |
| 11ac20SISO | 5500 | Type5 | 17 | 8 | 370379.0 | 10 | 2 | 79.6 | 1239.0 | 1705.0 | | |
| 11ac20SISO | 5500 | Type5 | 17 | 9 | 611194.0 | 10 | 3 | 88.4 | 1374.0 | 1579.0 | 1623.0 | |
| 11ac20SISO | 5500 | Type5 | 17 | 10 | 855665.0 | 10 | 1 | 53.3 | 1016.0 | | | |
| 11ac20SISO | 5500 | Type5 | 17 | 11 | 98897.0 | 10 | 1 | 65.3 | 1709.0 | | | |
| 11ac40SISO | 5510 | Type5 | 17 | 0 | 429224.0 | 10 | 3 | 86.4 | 1259.0 | 1918.0 | 1455.0 | |
| 11ac40SISO | 5510 | Type5 | 17 | 1 | 670241.0 | 10 | 3 | 92.2 | 1598.0 | 1719.0 | 1895.0 | |
| 11ac40SISO | 5510 | Type5 | 17 | 2 | 912880.0 | 10 | 2 | 80.4 | 1816.0 | 1899.0 | | |
| 11ac40SISO | 5510 | Type5 | 17 | 3 | 158603.0 | 10 | 1 | 54.3 | 1335.0 | | | |
| 11ac40SISO | 5510 | Type5 | 17 | 4 | 400824.0 | 10 | 1 | 53.1 | 1303.0 | | | |
| 11ac40SISO | 5510 | Type5 | 17 | 5 | 641915.0 | 10 | 2 | 69.4 | 1503.0 | 1546.0 | | |
| 11ac40SISO | 5510 | Type5 | 17 | 6 | 883823.0 | 10 | 2 | 69.1 | 1279.0 | 1639.0 | | |
| 11ac40SISO | 5510 | Type5 | 17 | 7 | 128373.0 | 10 | 3 | 100.0 | 1375.0 | 1438.0 | 1595.0 | |
| 11ac40SISO | 5510 | Type5 | 17 | 8 | 370379.0 | 10 | 2 | 79.6 | 1239.0 | 1705.0 | | |
| 11ac40SISO | 5510 | Type5 | 17 | 9 | 611194.0 | 10 | 3 | 88.4 | 1374.0 | 1579.0 | 1623.0 | |
| 11ac40SISO | 5510 | Type5 | 17 | 10 | 855665.0 | 10 | 1 | 53.3 | 1016.0 | | | |
| 11ac40SISO | 5510 | Type5 | 17 | 11 | 98897.0 | 10 | 1 | 65.3 | 1709.0 | | | |
| 11ac80SISO | 5530 | Type5 | 17 | 0 | 429224.0 | 10 | 3 | 86.4 | 1259.0 | 1918.0 | 1455.0 | |
| 11ac80SISO | 5530 | Type5 | 17 | 1 | 670241.0 | 10 | 3 | 92.2 | 1598.0 | 1719.0 | 1895.0 | |
| 11ac80SISO | 5530 | Type5 | 17 | 2 | 912880.0 | 10 | 2 | 80.4 | 1816.0 | 1899.0 | | |
| 11ac80SISO | 5530 | Type5 | 17 | 3 | 158603.0 | 10 | 1 | 54.3 | 1335.0 | | | |
| 11ac80SISO | 5530 | Type5 | 17 | 4 | 400824.0 | 10 | 1 | 53.1 | 1303.0 | | | |
| 11ac80SISO | 5530 | Type5 | 17 | 5 | 641915.0 | 10 | 2 | 69.4 | 1503.0 | 1546.0 | | |
| 11ac80SISO | 5530 | Type5 | 17 | 6 | 883823.0 | 10 | 2 | 69.1 | 1279.0 | 1639.0 | | |
| 11ac80SISO | 5530 | Type5 | 17 | 7 | 128373.0 | 10 | 3 | 100.0 | 1375.0 | 1438.0 | 1595.0 | |
| 11ac80SISO | 5530 | Type5 | 17 | 8 | 370379.0 | 10 | 2 | 79.6 | 1239.0 | 1705.0 | | |
| 11ac80SISO | 5530 | Type5 | 17 | 9 | 611194.0 | 10 | 3 | 88.4 | 1374.0 | 1579.0 | 1623.0 | |
| 11ac80SISO | 5530 | Type5 | 17 | 10 | 855665.0 | 10 | 1 | 53.3 | 1016.0 | | | |
| 11ac80SISO | 5530 | Type5 | 17 | 11 | 98897.0 | 10 | 1 | 65.3 | 1709.0 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 71 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr18@ | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|----------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | |
| 11ac20SISO | 5500 | Type5 | 18 | 0 | 292143.0 | 12 | 1 | 55.3 | 1920.0 | | | |
| 11ac20SISO | 5500 | Type5 | 18 | 1 | 499633.0 | 12 | 1 | 58.3 | 1797.0 | | | |
| 11ac20SISO | 5500 | Type5 | 18 | 2 | 706377.0 | 12 | 2 | 72.3 | 1610.0 | 1039.0 | | |
| 11ac20SISO | 5500 | Type5 | 18 | 3 | 58989.0 | 12 | 3 | 84.8 | 1131.0 | 1761.0 | 1721.0 | |
| 11ac20SISO | 5500 | Type5 | 18 | 4 | 266161.0 | 12 | 2 | 82.5 | 1875.0 | 1431.0 | | |
| 11ac20SISO | 5500 | Type5 | 18 | 5 | 474469.0 | 12 | 1 | 63.3 | 1095.0 | | | |
| 11ac20SISO | 5500 | Type5 | 18 | 6 | 680544.0 | 12 | 2 | 80.0 | 1119.0 | 1913.0 | | |
| 11ac20SISO | 5500 | Type5 | 18 | 7 | 33519.0 | 12 | 3 | 90.3 | 1660.0 | 1853.0 | 1123.0 | |
| 11ac20SISO | 5500 | Type5 | 18 | 8 | 240319.0 | 12 | 3 | 91.1 | 1539.0 | 1783.0 | 1172.0 | |
| 11ac20SISO | 5500 | Type5 | 18 | 9 | 447400.0 | 12 | 3 | 96.6 | 1525.0 | 1036.0 | 1385.0 | |
| 11ac20SISO | 5500 | Type5 | 18 | 10 | 654516.0 | 12 | 2 | 82.7 | 1710.0 | 1990.0 | | |
| 11ac20SISO | 5500 | Type5 | 18 | 11 | 8083.0 | 12 | 1 | 50.7 | 1234.0 | | | |
| 11ac20SISO | 5500 | Type5 | 18 | 12 | 215435.0 | 12 | 2 | 78.4 | 1047.0 | 1109.0 | | |
| 11ac20SISO | 5500 | Type5 | 18 | 13 | 421325.0 | 12 | 3 | 99.5 | 1299.0 | 1965.0 | 1869.0 | |
| 11ac40SISO | 5510 | Type5 | 18 | 0 | 292143.0 | 12 | 1 | 55.3 | 1920.0 | | | |
| 11ac40SISO | 5510 | Type5 | 18 | 1 | 499633.0 | 12 | 1 | 58.3 | 1797.0 | | | |
| 11ac40SISO | 5510 | Type5 | 18 | 2 | 706377.0 | 12 | 2 | 72.3 | 1610.0 | 1039.0 | | |
| 11ac40SISO | 5510 | Type5 | 18 | 3 | 58989.0 | 12 | 3 | 84.8 | 1131.0 | 1761.0 | 1721.0 | |
| 11ac40SISO | 5510 | Type5 | 18 | 4 | 266161.0 | 12 | 2 | 82.5 | 1875.0 | 1431.0 | | |
| 11ac40SISO | 5510 | Type5 | 18 | 5 | 474469.0 | 12 | 1 | 63.3 | 1095.0 | - | | |
| 11ac40SISO | 5510 | Type5 | 18 | 6 | 680544.0 | 12 | 2 | 80.0 | 1119.0 | 1913.0 | | |
| 11ac40SISO | 5510 | Type5 | 18 | 7 | 33519.0 | 12 | 3 | 90.3 | 1660.0 | 1853.0 | 1123.0 | |
| 11ac40SISO | 5510 | Type5 | 18 | 8 | 240319.0 | 12 | 3 | 91.1 | 1539.0 | 1783.0 | 1172.0 | |
| 11ac40SISO | 5510 | Type5 | 18 | 9 | 447400.0 | 12 | 3 | 96.6 | 1525.0 | 1036.0 | 1385.0 | |
| 11ac40SISO | 5510 | Type5 | 18 | 10 | 654516.0 | 12 | 2 | 82.7 | 1710.0 | 1990.0 | | |
| 11ac40SISO | 5510 | Type5 | 18 | 11 | 8083.0 | 12 | 1 | 50.7 | 1234.0 | | | |
| 11ac40SISO | 5510 | Type5 | 18 | 12 | 215435.0 | 12 | 2 | 78.4 | 1047.0 | 1109.0 | | |
| 11ac40SISO | 5510 | Type5 | 18 | 13 | 421325.0 | 12 | 3 | 99.5 | 1299.0 | 1965.0 | 1869.0 | |
| 11ac80SISO | 5530 | Type5 | 18 | 0 | 292143.0 | 12 | 1 | 55.3 | 1920.0 | | | |
| 11ac80SISO | 5530 | Type5 | 18 | 1 | 499633.0 | 12 | 1 | 58.3 | 1797.0 | | | |
| 11ac80SISO | 5530 | Type5 | 18 | 2 | 706377.0 | 12 | 2 | 72.3 | 1610.0 | 1039.0 | | |
| 11ac80SISO | 5530 | Type5 | 18 | 3 | 58989.0 | 12 | 3 | 84.8 | 1131.0 | 1761.0 | 1721.0 | |
| 11ac80SISO | 5530 | Type5 | 18 | 4 | 266161.0 | 12 | 2 | 82.5 | 1875.0 | 1431.0 | | |
| 11ac80SISO | 5530 | Type5 | 18 | 5 | 474469.0 | 12 | 1 | 63.3 | 1095.0 | | | |
| 11ac80SISO | 5530 | Type5 | 18 | 6 | 680544.0 | 12 | 2 | 80.0 | 1119.0 | 1913.0 | | |
| 11ac80SISO | 5530 | Type5 | 18 | 7 | 33519.0 | 12 | 3 | 90.3 | 1660.0 | 1853.0 | 1123.0 | |
| 11ac80SISO | 5530 | Type5 | 18 | 8 | 240319.0 | 12 | 3 | 91.1 | 1539.0 | 1783.0 | 1172.0 | |
| 11ac80SISO | 5530 | Type5 | 18 | 9 | 447400.0 | 12 | 3 | 96.6 | 1525.0 | 1036.0 | 1385.0 | |
| 11ac80SISO | 5530 | Type5 | 18 | 10 | 654516.0 | 12 | 2 | 82.7 | 1710.0 | 1990.0 | | |
| 11ac80SISO | 5530 | Type5 | 18 | 11 | 8083.0 | 12 | 1 | 50.7 | 1234.0 | | | |
| 11ac80SISO | 5530 | Type5 | 18 | 12 | 215435.0 | 12 | 2 | 78.4 | 1047.0 | 1109.0 | | |
| 11ac80SISO | 5530 | Type5 | 18 | 13 | 421325.0 | 12 | 3 | 99.5 | 1299.0 | 1965.0 | 1869.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 72 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr19@ | | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | | |
| 11ac20SISO | 5500 | Type5 | 19 | 0 | 733725.0 | 10 | 3 | 88.6 | 1501.0 | 1067.0 | 1927.0 | | |
| 11ac20SISO | 5500 | Type5 | 19 | 1 | 977882.0 | 10 | 1 | 57.4 | 1723.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 19 | 2 | 221197.0 | 10 | 3 | 96.6 | 1086.0 | 1658.0 | 1324.0 | | |
| 11ac20SISO | 5500 | Type5 | 19 | 3 | 462915.0 | 10 | 2 | 69.7 | 1751.0 | 1945.0 | | | |
| 11ac20SISO | 5500 | Type5 | 19 | 4 | 705071.0 | 10 | 2 | 77.9 | 1642.0 | 1317.0 | | | |
| 11ac20SISO | 5500 | Type5 | 19 | 5 | 947923.0 | 10 | 1 | 62.0 | 1866.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 19 | 6 | 191373.0 | 10 | 3 | 88.4 | 1997.0 | 1077.0 | 1366.0 | | |
| 11ac20SISO | 5500 | Type5 | 19 | 7 | 432561.0 | 10 | 3 | 97.3 | 1790.0 | 1896.0 | 1367.0 | | |
| 11ac20SISO | 5500 | Type5 | 19 | 8 | 674004.0 | 10 | 3 | 96.2 | 1391.0 | 1787.0 | 1672.0 | | |
| 11ac20SISO | 5500 | Type5 | 19 | 9 | 915842.0 | 10 | 3 | 95.4 | 1020.0 | 1892.0 | 1414.0 | | |
| 11ac20SISO | 5500 | Type5 | 19 | 10 | 162176.0 | 10 | 1 | 54.8 | 1084.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 19 | 11 | 403553.0 | 10 | 2 | 80.4 | 1850.0 | 1436.0 | | | |
| 11ac40SISO | 5510 | Type5 | 19 | 0 | 733725.0 | 10 | 3 | 88.6 | 1501.0 | 1067.0 | 1927.0 | | |
| 11ac40SISO | 5510 | Type5 | 19 | 1 | 977882.0 | 10 | 1 | 57.4 | 1723.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 19 | 2 | 221197.0 | 10 | 3 | 96.6 | 1086.0 | 1658.0 | 1324.0 | | |
| 11ac40SISO | 5510 | Type5 | 19 | 3 | 462915.0 | 10 | 2 | 69.7 | 1751.0 | 1945.0 | | | |
| 11ac40SISO | 5510 | Type5 | 19 | 4 | 705071.0 | 10 | 2 | 77.9 | 1642.0 | 1317.0 | | | |
| 11ac40SISO | 5510 | Type5 | 19 | 5 | 947923.0 | 10 | 1 | 62.0 | 1866.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 19 | 6 | 191373.0 | 10 | 3 | 88.4 | 1997.0 | 1077.0 | 1366.0 | | |
| 11ac40SISO | 5510 | Type5 | 19 | 7 | 432561.0 | 10 | 3 | 97.3 | 1790.0 | 1896.0 | 1367.0 | | |
| 11ac40SISO | 5510 | Type5 | 19 | 8 | 674004.0 | 10 | 3 | 96.2 | 1391.0 | 1787.0 | 1672.0 | | |
| 11ac40SISO | 5510 | Type5 | 19 | 9 | 915842.0 | 10 | 3 | 95.4 | 1020.0 | 1892.0 | 1414.0 | | |
| 11ac40SISO | 5510 | Type5 | 19 | 10 | 162176.0 | 10 | 1 | 54.8 | 1084.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 19 | 11 | 403553.0 | 10 | 2 | 80.4 | 1850.0 | 1436.0 | | | |
| 11ac80SISO | 5530 | Type5 | 19 | 0 | 733725.0 | 10 | 3 | 88.6 | 1501.0 | 1067.0 | 1927.0 | | |
| 11ac80SISO | 5530 | Type5 | 19 | 1 | 977882.0 | 10 | 1 | 57.4 | 1723.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 19 | 2 | 221197.0 | 10 | 3 | 96.6 | 1086.0 | 1658.0 | 1324.0 | | |
| 11ac80SISO | 5530 | Type5 | 19 | 3 | 462915.0 | 10 | 2 | 69.7 | 1751.0 | 1945.0 | | | |
| 11ac80SISO | 5530 | Type5 | 19 | 4 | 705071.0 | 10 | 2 | 77.9 | 1642.0 | 1317.0 | | | |
| 11ac80SISO | 5530 | Type5 | 19 | 5 | 947923.0 | 10 | 1 | 62.0 | 1866.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 19 | 6 | 191373.0 | 10 | 3 | 88.4 | 1997.0 | 1077.0 | 1366.0 | | |
| 11ac80SISO | 5530 | Type5 | 19 | 7 | 432561.0 | 10 | 3 | 97.3 | 1790.0 | 1896.0 | 1367.0 | | |
| 11ac80SISO | 5530 | Type5 | 19 | 8 | 674004.0 | 10 | 3 | 96.2 | 1391.0 | 1787.0 | 1672.0 | | |
| 11ac80SISO | 5530 | Type5 | 19 | 9 | 915842.0 | 10 | 3 | 95.4 | 1020.0 | 1892.0 | 1414.0 | | |
| 11ac80SISO | 5530 | Type5 | 19 | 10 | 162176.0 | 10 | 1 | 54.8 | 1084.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 19 | 11 | 403553.0 | 10 | 2 | 80.4 | 1850.0 | 1436.0 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 73 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr20@ Radar Trial Burst Burst Chirp Number Pulse DRI3 DRI3 | | | | | | | | | | | | | |
|--|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | | |
| 11ac20SISO | 5500 | Type5 | 20 | 0 | 483470.0 | 15 | 2 | 74.7 | 1619.0 | 1611.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 1 | 666072.0 | 15 | 1 | 57.1 | 1560.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 2 | 98810.0 | 15 | 3 | 91.9 | 1392.0 | 1475.0 | 1276.0 | | |
| 11ac20SISO | 5500 | Type5 | 20 | 3 | 279914.0 | 15 | 2 | 83.1 | 1809.0 | 1772.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 4 | 462536.0 | 15 | 1 | 50.7 | 1003.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 5 | 642324.0 | 15 | 2 | 79.2 | 1574.0 | 1600.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 6 | 76831.0 | 15 | 1 | 58.7 | 1186.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 7 | 257785.0 | 15 | 2 | 71.0 | 1521.0 | 1567.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 8 | 438554.0 | 15 | 2 | 79.0 | 1777.0 | 1960.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 9 | 620397.0 | 15 | 2 | 68.5 | 1284.0 | 1428.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 10 | 54310.0 | 15 | 2 | 73.5 | 1904.0 | 1352.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 11 | 235506.0 | 15 | 2 | 70.5 | 1864.0 | 1115.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 12 | 417036.0 | 15 | 2 | 76.6 | 1045.0 | 1300.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 13 | 597974.0 | 15 | 2 | 81.2 | 1160.0 | 1675.0 | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 14 | 32086.0 | 15 | 1 | 61.8 | 1277.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 20 | 15 | 212751.0 | 15 | 3 | 94.9 | 1450.0 | 1206.0 | 1860.0 | | |
| 11ac40SISO | 5510 | Type5 | 20 | 0 | 483470.0 | 15 | 2 | 74.7 | 1619.0 | 1611.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 1 | 666072.0 | 15 | 1 | 57.1 | 1560.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 2 | 98810.0 | 15 | 3 | 91.9 | 1392.0 | 1475.0 | 1276.0 | | |
| 11ac40SISO | 5510 | Type5 | 20 | 3 | 279914.0 | 15 | 2 | 83.1 | 1809.0 | 1772.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 4 | 462536.0 | 15 | 1 | 50.7 | 1003.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 5 | 642324.0 | 15 | 2 | 79.2 | 1574.0 | 1600.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 6 | 76831.0 | 15 | 1 | 58.7 | 1186.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 7 | 257785.0 | 15 | 2 | 71.0 | 1521.0 | 1567.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 8 | 438554.0 | 15 | 2 | 79.0 | 1777.0 | 1960.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 9 | 620397.0 | 15 | 2 | 68.5 | 1284.0 | 1428.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 10 | 54310.0 | 15 | 2 | 73.5 | 1904.0 | 1352.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 11 | 235506.0 | 15 | 2 | 70.5 | 1864.0 | 1115.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 12 | 417036.0 | 15 | 2 | 76.6 | 1045.0 | 1300.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 13 | 597974.0 | 15 | 2 | 81.2 | 1160.0 | 1675.0 | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 14 | 32086.0 | 15 | 1 | 61.8 | 1277.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 20 | 15 | 212751.0 | 15 | 3 | 94.9 | 1450.0 | 1206.0 | 1860.0 | | |
| 11ac80SISO | 5530 | Type5 | 20 | 0 | 483470.0 | 15 | 2 | 74.7 | 1619.0 | 1611.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 1 | 666072.0 | 15 | 1 | 57.1 | 1560.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 2 | 98810.0 | 15 | 3 | 91.9 | 1392.0 | 1475.0 | 1276.0 | | |
| 11ac80SISO | 5530 | Type5 | 20 | 3 | 279914.0 | 15 | 2 | 83.1 | 1809.0 | 1772.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 4 | 462536.0 | 15 | 1 | 50.7 | 1003.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 5 | 642324.0 | 15 | 2 | 79.2 | 1574.0 | 1600.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 6 | 76831.0 | 15 | 1 | 58.7 | 1186.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 7 | 257785.0 | 15 | 2 | 71.0 | 1521.0 | 1567.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 8 | 438554.0 | 15 | 2 | 79.0 | 1777.0 | 1960.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 9 | 620397.0 | 15 | 2 | 68.5 | 1284.0 | 1428.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 10 | 54310.0 | 15 | 2 | 73.5 | 1904.0 | 1352.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 11 | 235506.0 | 15 | 2 | 70.5 | 1864.0 | 1115.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 12 | 417036.0 | 15 | 2 | 76.6 | 1045.0 | 1300.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 13 | 597974.0 | 15 | 2 | 81.2 | 1160.0 | 1675.0 | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 14 | 32086.0 | 15 | 1 | 61.8 | 1277.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 20 | 15 | 212751.0 | 15 | 3 | 94.9 | 1450.0 | 1206.0 | 1860.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 74 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr21@ | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | |
| 11ac20SISO | 5500 | Type5 | 21 | 0 | 526149.0 | 9 | 2 | 78.5 | 1653.0 | 1698.0 | | |
| 11ac20SISO | 5500 | Type5 | 21 | 1 | 767135.0 | 9 | 3 | 89.8 | 1174.0 | 1962.0 | 1167.0 | |
| 11ac20SISO | 5500 | Type5 | 21 | 2 | 12955.0 | 9 | 1 | 59.4 | 1982.0 | | | |
| 11ac20SISO | 5500 | Type5 | 21 | 3 | 254612.0 | 9 | 2 | 79.6 | 1633.0 | 1890.0 | | |
| 11ac20SISO | 5500 | Type5 | 21 | 4 | 496588.0 | 9 | 2 | 76.0 | 1112.0 | 1811.0 | | |
| 11ac20SISO | 5500 | Type5 | 21 | 5 | 739728.0 | 9 | 1 | 53.6 | 1144.0 | | | |
| 11ac20SISO | 5500 | Type5 | 21 | 6 | 980872.0 | 9 | 2 | 80.9 | 1220.0 | 1053.0 | | |
| 11ac20SISO | 5500 | Type5 | 21 | 7 | 225249.0 | 9 | 1 | 61.6 | 1724.0 | | | |
| 11ac20SISO | 5500 | Type5 | 21 | 8 | 467279.0 | 9 | 1 | 53.4 | 1901.0 | | | |
| 11ac20SISO | 5500 | Type5 | 21 | 9 | 709720.0 | 9 | 1 | 59.9 | 1379.0 | | | |
| 11ac20SISO | 5500 | Type5 | 21 | 10 | 951847.0 | 9 | 1 | 60.4 | 1453.0 | | | |
| 11ac20SISO | 5500 | Type5 | 21 | 11 | 194839.0 | 9 | 3 | 91.4 | 1768.0 | 1726.0 | 1227.0 | |
| 11ac40SISO | 5510 | Type5 | 21 | 0 | 526149.0 | 9 | 2 | 78.5 | 1653.0 | 1698.0 | | |
| 11ac40SISO | 5510 | Type5 | 21 | 1 | 767135.0 | 9 | 3 | 89.8 | 1174.0 | 1962.0 | 1167.0 | |
| 11ac40SISO | 5510 | Type5 | 21 | 2 | 12955.0 | 9 | 1 | 59.4 | 1982.0 | | | |
| 11ac40SISO | 5510 | Type5 | 21 | 3 | 254612.0 | 9 | 2 | 79.6 | 1633.0 | 1890.0 | | |
| 11ac40SISO | 5510 | Type5 | 21 | 4 | 496588.0 | 9 | 2 | 76.0 | 1112.0 | 1811.0 | | |
| 11ac40SISO | 5510 | Type5 | 21 | 5 | 739728.0 | 9 | 1 | 53.6 | 1144.0 | | | |
| 11ac40SISO | 5510 | Type5 | 21 | 6 | 980872.0 | 9 | 2 | 80.9 | 1220.0 | 1053.0 | | |
| 11ac40SISO | 5510 | Type5 | 21 | 7 | 225249.0 | 9 | 1 | 61.6 | 1724.0 | | | |
| 11ac40SISO | 5510 | Type5 | 21 | 8 | 467279.0 | 9 | 1 | 53.4 | 1901.0 | | | |
| 11ac40SISO | 5510 | Type5 | 21 | 9 | 709720.0 | 9 | 1 | 59.9 | 1379.0 | | | |
| 11ac40SISO | 5510 | Type5 | 21 | 10 | 951847.0 | 9 | 1 | 60.4 | 1453.0 | | | |
| 11ac40SISO | 5510 | Type5 | 21 | 11 | 194839.0 | 9 | 3 | 91.4 | 1768.0 | 1726.0 | 1227.0 | |
| 11ac80SISO | 5530 | Type5 | 21 | 0 | 526149.0 | 9 | 2 | 78.5 | 1653.0 | 1698.0 | | |
| 11ac80SISO | 5530 | Type5 | 21 | 1 | 767135.0 | 9 | 3 | 89.8 | 1174.0 | 1962.0 | 1167.0 | |
| 11ac80SISO | 5530 | Type5 | 21 | 2 | 12955.0 | 9 | 1 | 59.4 | 1982.0 | | | |
| 11ac80SISO | 5530 | Type5 | 21 | 3 | 254612.0 | 9 | 2 | 79.6 | 1633.0 | 1890.0 | | |
| 11ac80SISO | 5530 | Type5 | 21 | 4 | 496588.0 | 9 | 2 | 76.0 | 1112.0 | 1811.0 | | |
| 11ac80SISO | 5530 | Type5 | 21 | 5 | 739728.0 | 9 | 1 | 53.6 | 1144.0 | | | |
| 11ac80SISO | 5530 | Type5 | 21 | 6 | 980872.0 | 9 | 2 | 80.9 | 1220.0 | 1053.0 | | |
| 11ac80SISO | 5530 | Type5 | 21 | 7 | 225249.0 | 9 | 1 | 61.6 | 1724.0 | | | |
| 11ac80SISO | 5530 | Type5 | 21 | 8 | 467279.0 | 9 | 1 | 53.4 | 1901.0 | | | |
| 11ac80SISO | 5530 | Type5 | 21 | 9 | 709720.0 | 9 | 1 | 59.9 | 1379.0 | | | |
| 11ac80SISO | 5530 | Type5 | 21 | 10 | 951847.0 | 9 | 1 | 60.4 | 1453.0 | | | |
| 11ac80SISO | 5530 | Type5 | 21 | 11 | 194839.0 | 9 | 3 | 91.4 | 1768.0 | 1726.0 | 1227.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01 Page: 75 of 85

| | Fage. 75 01 65 | | | | | | | | | | | | | |
|--------------------------|--|----------------|----------|---------------|----------------------|----------|--------|--------------|------------------|------------------|--------|--|--|--|
| | ## Channel Channel Radar Type Type Type Type Type Type Type Type | | | | | | | | | | | | | |
| | 01 1 | Radar | Trial | Burst | | | | | PRI1 | PRI2 | PRI3 | | | |
| lestMode | Channel | | | | | | _ | | | | | | | |
| 44 000100 | 5500 | | 00 | 0 | | | | | 1 1 | | | | | |
| 11ac20SISO | 5500 | Type5 | 22 22 | 0 1 | 261858.0 | 20 20 | 2 | 77.0 58.1 | 1191.0 | 1363.0 | | | | |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 Type5 | 22 | 2 | 407646.0 552319.0 | 20 | 1 | 62.1 | 1248.0 1836.0 | | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 3 | 99107.0 | 20 | 2 | 76.9 | 1334.0 | 1236.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 4 | 243514.0 | 20 | 2 | 80.0 | 1914.0 | 1852.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 5 | 389464.0 | 20 | 1 | 52.0 | 1701.0 | | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 6 | 531093.0 | 20 | 3 | 88.6 | 1693.0 | 1995.0 | 1905.0 | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 7 | 81159.0 | 20 | 2 | 72.9 | 1922.0 | 1387.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 8 | 225245.0 | 20 | 3 | 98.5 | 1839.0 | 1746.0 | 1389.0 | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 9 | 371906.0 | 20 | 1 | 57.9 | 1193.0 | | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 10 | 514197.0 | 20 | 3 | 95.9 | 1659.0 | 1870.0 | 1066.0 | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 11 | 63561.0 | 20 | 1 | 53.5 | 1162.0 | | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 12 | 207510.0 | 20 | 3 | 92.0 | 1745.0 | 1654.0 | 1458.0 | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 13 | 353638.0 | 20 | 1 | 57.3 | 1834.0 | 1586.0 | | | | |
| 11ac20SISO | 5500 5500 | Type5 | 22 | 14 | 497515.0 | 20 | 2 | 70.5 | 1684.0 | | | | | |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 Type5 | 22 22 | 15 16 | 45553.0 189821.0 | 20 20 | 3 | 70.0 84.0 | 1042.0 1765.0 | 1664.0 1630.0 | 1176.0 | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 17 | 335330.0 | 20 | 2 | 76.1 | 1557.0 | 1057.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 18 | 478825.0 | 20 | 3 | 93.2 | 1985.0 | 1037.0 | 1340.0 | | | |
| 11ac20SISO | 5500 | Type5 | 22 | 19 | 27594.0 | 20 | 3 | 96.8 | 1760.0 | 1614.0 | 1817.0 | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 0 | 261858.0 | 20 | 2 | 77.0 | 1191.0 | 1363.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 1 | 407646.0 | 20 | 1 | 58.1 | 1248.0 | | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 2 | 552319.0 | 20 | 1 | 62.1 | 1836.0 | | - | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 3 | 99107.0 | 20 | 2 | 76.9 | 1334.0 | 1236.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 4 | 243514.0 | 20 | 2 | 80.0 | 1914.0 | 1852.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 5 | 389464.0 | 20 | 1 | 52.0 | 1701.0 | | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 6 | 531093.0 | 20 | 3 | 88.6 | 1693.0 | 1995.0 | 1905.0 | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 7 | 81159.0 | 20 | 2 | 72.9 | 1922.0 | 1387.0 | 4200.0 | | | |
| 11ac40SISO 11ac40SISO | 5510 5510 | Type5 Type5 | 22 22 | <u>8</u> 9 | 225245.0 371906.0 | 20 20 | 3 1 | 98.5 57.9 | 1839.0 1193.0 | 1746.0 | 1389.0 | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 10 | 514197.0 | 20 | 3 | 95.9 | 1659.0 | 1870.0 | 1066.0 | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 11 | 63561.0 | 20 | 1 | 53.5 | 1162.0 | | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 12 | 207510.0 | 20 | 3 | 92.0 | 1745.0 | 1654.0 | 1458.0 | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 13 | 353638.0 | 20 | 1 | 57.3 | 1834.0 | | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 14 | 497515.0 | 20 | 2 | 70.5 | 1684.0 | 1586.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 15 | 45553.0 | 20 | 2 | 70.0 | 1042.0 | 1664.0 | - | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 16 | 189821.0 | 20 | 3 | 84.0 | 1765.0 | 1630.0 | 1176.0 | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 17 | 335330.0 | 20 | 2 | 76.1 | 1557.0 | 1057.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 18 | 478825.0 | 20 | 3 | 93.2 | 1985.0 | 1018.0 | 1340.0 | | | |
| 11ac40SISO | 5510 | Type5 | 22 | 19 | 27594.0 | 20 | 3 | 96.8 | 1760.0 | 1614.0 | 1817.0 | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 0 | 261858.0 | 20 | 2 | 77.0 | 1191.0 | 1363.0 | | | | |
| 11ac80SISO 11ac80SISO | 5530 5530 | Type5 Type5 | 22 22 | 2 | 407646.0 552319.0 | 20 20 | 1 | 58.1 62.1 | 1248.0 1836.0 | | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 3 | 99107.0 | 20 | 2 | 76.9 | 1334.0 | 1236.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 4 | 243514.0 | 20 | 2 | 80.0 | 1914.0 | 1852.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 5 | 389464.0 | 20 | 1 | 52.0 | 1701.0 | | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 6 | 531093.0 | 20 | 3 | 88.6 | 1693.0 | 1995.0 | 1905.0 | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 7 | 81159.0 | 20 | 2 | 72.9 | 1922.0 | 1387.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 8 | 225245.0 | 20 | 3 | 98.5 | 1839.0 | 1746.0 | 1389.0 | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 9 | 371906.0 | 20 | 1 | 57.9 | 1193.0 | | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 10 | 514197.0 | 20 | 3 | 95.9 | 1659.0 | 1870.0 | 1066.0 | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 11 | 63561.0 | 20 | 1 | 53.5 | 1162.0 | | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 12 | 207510.0 | 20 | 3 | 92.0 | 1745.0 | 1654.0 | 1458.0 | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 13 | 353638.0 | 20 | 1 | 57.3 | 1834.0 | 45000 | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 14 | 497515.0 | 20 | 2 | 70.5 | 1684.0 | 1586.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 15 | 45553.0 | 20 | 2 | 70.0 | 1042.0 | 1664.0 | 1176.0 | | | |
| 11ac80SISO | 5530 5530 | Type5 | 22 | 16 17 | 189821.0 | 20 | 3 | 84.0 | 1765.0 | 1630.0 | 1176.0 | | | |
| 11ac80SISO | 5530 | Type5 | 22 | 17 | 335330.0 | 20 | 2 | 76.1 | 1557.0 | 1057.0 | | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 76 of 85

| 11ac80SISO | 5530 | Type5 | 22 | 18 | 478825.0 | 20 | 3 | 93.2 | 1985.0 | 1018.0 | 1340.0 |
|------------|------|-------|----|----|----------|----|---|------|--------|--------|--------|
| 11ac80SISO | 5530 | Type5 | 22 | 19 | 27594.0 | 20 | 3 | 96.8 | 1760.0 | 1614.0 | 1817.0 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 77 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr23@ | | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-----------------|----------------|--------------|----------------|--------------|--------------|--------------|--|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset | Chirp Width | Number Of | Pulse Width | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | | |
| | | | | | (µs) | (MHz) | Pulses | (µs) | 1 | 1 1 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 0 | 247117.0 | 12 | 1 | 50.1 | 1841.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 1 | 453362.0 | 12 | 3 | 93.5 | 1590.0 | 1081.0 | 1413.0 | | |
| 11ac20SISO | 5500 | Type5 | 23 | 2 | 660875.0 | 12 | 2 | 68.8 | 1707.0 | 1577.0 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 3 | 14140.0 | 12 | 1 | 56.3 | 1056.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 4 | 220734.0 | 12 | 3 | 86.0 | 1953.0 | 1108.0 | 1987.0 | | |
| 11ac20SISO | 5500 | Type5 | 23 | 5 | 428367.0 | 12 | 2 | 75.2 | 1572.0 | 1536.0 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 6 | 636681.0 | 12 | 1 | 54.4 | 1517.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 7 | 843157.0 | 12 | 2 | 71.1 | 1329.0 | 1243.0 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 8 | 195585.0 | 12 | 2 | 76.2 | 1940.0 | 1770.0 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 9 | 403231.0 | 12 | 2 | 80.2 | 1098.0 | 1209.0 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 10 | 610202.0 | 12 | 2 | 79.7 | 1588.0 | 1214.0 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 11 | 815229.0 | 12 | 3 | 90.9 | 1615.0 | 1862.0 | 1601.0 | | |
| 11ac20SISO | 5500 | Type5 | 23 | 12 | 170267.0 | 12 | 2 | 68.7 | 1377.0 | 1441.0 | | | |
| 11ac20SISO | 5500 | Type5 | 23 | 13 | 377306.0 | 12 | 2 | 67.4 | 1872.0 | 1313.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 0 | 247117.0 | 12 | 1 | 50.1 | 1841.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 1 | 453362.0 | 12 | 3 | 93.5 | 1590.0 | 1081.0 | 1413.0 | | |
| 11ac40SISO | 5510 | Type5 | 23 | 2 | 660875.0 | 12 | 2 | 68.8 | 1707.0 | 1577.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 3 | 14140.0 | 12 | 1 | 56.3 | 1056.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 4 | 220734.0 | 12 | 3 | 86.0 | 1953.0 | 1108.0 | 1987.0 | | |
| 11ac40SISO | 5510 | Type5 | 23 | 5 | 428367.0 | 12 | 2 | 75.2 | 1572.0 | 1536.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 6 | 636681.0 | 12 | 1 | 54.4 | 1517.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 7 | 843157.0 | 12 | 2 | 71.1 | 1329.0 | 1243.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 8 | 195585.0 | 12 | 2 | 76.2 | 1940.0 | 1770.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 9 | 403231.0 | 12 | 2 | 80.2 | 1098.0 | 1209.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 10 | 610202.0 | 12 | 2 | 79.7 | 1588.0 | 1214.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 11 | 815229.0 | 12 | 3 | 90.9 | 1615.0 | 1862.0 | 1601.0 | | |
| 11ac40SISO | 5510 | Type5 | 23 | 12 | 170267.0 | 12 | 2 | 68.7 | 1377.0 | 1441.0 | | | |
| 11ac40SISO | 5510 | Type5 | 23 | 13 | 377306.0 | 12 | 2 | 67.4 | 1872.0 | 1313.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 0 | 247117.0 | 12 | 1 | 50.1 | 1841.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 11 | 453362.0 | 12 | 3 | 93.5 | 1590.0 | 1081.0 | 1413.0 | | |
| 11ac80SISO | 5530 | Type5 | 23 | 2 | 660875.0 | 12 | 2 | 68.8 | 1707.0 | 1577.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 3 | 14140.0 | 12 | 1 | 56.3 | 1056.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 4 | 220734.0 | 12 | 3 | 86.0 | 1953.0 | 1108.0 | 1987.0 | | |
| 11ac80SISO | 5530 | Type5 | 23 | 5 | 428367.0 | 12 | 2 | 75.2 | 1572.0 | 1536.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 6 | 636681.0 | 12 | 1 | 54.4 | 1517.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 7 | 843157.0 | 12 | 2 | 71.1 | 1329.0 | 1243.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 8 | 195585.0 | 12 | 2 | 76.2 | 1940.0 | 1770.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 9 | 403231.0 | 12 | 2 | 80.2 | 1098.0 | 1209.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 10 | 610202.0 | 12 | 2 | 79.7 | 1588.0 | 1214.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 11 | 815229.0 | 12 | 3 | 90.9 | 1615.0 | 1862.0 | 1601.0 | | |
| 11ac80SISO | 5530 | Type5 | 23 | 12 | 170267.0 | 12 | 2 | 68.7 | 1377.0 | 1441.0 | | | |
| 11ac80SISO | 5530 | Type5 | 23 | 13 | 377306.0 | 12 | 2 | 67.4 | 1872.0 | 1313.0 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 78 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr24@ | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | |
| 11ac20SISO | 5500 | Type5 | 24 | 0 | 628071.0 | 11 | 3 | 94.0 | 1643.0 | 1748.0 | 1941.0 | |
| 11ac20SISO | 5500 | Type5 | 24 | 1 | 853391.0 | 11 | 2 | 70.8 | 1177.0 | 1201.0 | | |
| 11ac20SISO | 5500 | Type5 | 24 | 2 | 156223.0 | 11 | 1 | 56.3 | 1006.0 | | | |
| 11ac20SISO | 5500 | Type5 | 24 | 3 | 378734.0 | 11 | 3 | 96.7 | 1230.0 | 1163.0 | 1332.0 | |
| 11ac20SISO | 5500 | Type5 | 24 | 4 | 601331.0 | 11 | 3 | 90.6 | 1217.0 | 1582.0 | 1498.0 | |
| 11ac20SISO | 5500 | Type5 | 24 | 5 | 825462.0 | 11 | 2 | 74.5 | 1569.0 | 1281.0 | | |
| 11ac20SISO | 5500 | Type5 | 24 | 6 | 128265.0 | 11 | 3 | 92.6 | 1065.0 | 1669.0 | 1222.0 | |
| 11ac20SISO | 5500 | Type5 | 24 | 7 | 351161.0 | 11 | 3 | 89.0 | 1493.0 | 1135.0 | 1380.0 | |
| 11ac20SISO | 5500 | Type5 | 24 | 8 | 573425.0 | 11 | 3 | 96.5 | 1607.0 | 1822.0 | 1602.0 | |
| 11ac20SISO | 5500 | Type5 | 24 | 9 | 798431.0 | 11 | 2 | 70.5 | 1141.0 | 1178.0 | | |
| 11ac20SISO | 5500 | Type5 | 24 | 10 | 100737.0 | 11 | 3 | 94.0 | 1009.0 | 1629.0 | 1956.0 | |
| 11ac20SISO | 5500 | Type5 | 24 | 11 | 324661.0 | 11 | 1 | 55.8 | 1290.0 | | | |
| 11ac20SISO | 5500 | Type5 | 24 | 12 | 546278.0 | 11 | 3 | 87.7 | 1435.0 | 1963.0 | 1164.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 0 | 628071.0 | 11 | 3 | 94.0 | 1643.0 | 1748.0 | 1941.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 1 | 853391.0 | 11 | 2 | 70.8 | 1177.0 | 1201.0 | | |
| 11ac40SISO | 5510 | Type5 | 24 | 2 | 156223.0 | 11 | 1 | 56.3 | 1006.0 | | | |
| 11ac40SISO | 5510 | Type5 | 24 | 3 | 378734.0 | 11 | 3 | 96.7 | 1230.0 | 1163.0 | 1332.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 4 | 601331.0 | 11 | 3 | 90.6 | 1217.0 | 1582.0 | 1498.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 5 | 825462.0 | 11 | 2 | 74.5 | 1569.0 | 1281.0 | | |
| 11ac40SISO | 5510 | Type5 | 24 | 6 | 128265.0 | 11 | 3 | 92.6 | 1065.0 | 1669.0 | 1222.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 7 | 351161.0 | 11 | 3 | 89.0 | 1493.0 | 1135.0 | 1380.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 8 | 573425.0 | 11 | 3 | 96.5 | 1607.0 | 1822.0 | 1602.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 9 | 798431.0 | 11 | 2 | 70.5 | 1141.0 | 1178.0 | | |
| 11ac40SISO | 5510 | Type5 | 24 | 10 | 100737.0 | 11 | 3 | 94.0 | 1009.0 | 1629.0 | 1956.0 | |
| 11ac40SISO | 5510 | Type5 | 24 | 11 | 324661.0 | 11 | 1 | 55.8 | 1290.0 | | | |
| 11ac40SISO | 5510 | Type5 | 24 | 12 | 546278.0 | 11 | 3 | 87.7 | 1435.0 | 1963.0 | 1164.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 0 | 628071.0 | 11 | 3 | 94.0 | 1643.0 | 1748.0 | 1941.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 1 | 853391.0 | 11 | 2 | 70.8 | 1177.0 | 1201.0 | | |
| 11ac80SISO | 5530 | Type5 | 24 | 2 | 156223.0 | 11 | 1 | 56.3 | 1006.0 | | | |
| 11ac80SISO | 5530 | Type5 | 24 | 3 | 378734.0 | 11 | 3 | 96.7 | 1230.0 | 1163.0 | 1332.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 4 | 601331.0 | 11 | 3 | 90.6 | 1217.0 | 1582.0 | 1498.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 5 | 825462.0 | 11 | 2 | 74.5 | 1569.0 | 1281.0 | | |
| 11ac80SISO | 5530 | Type5 | 24 | 6 | 128265.0 | 11 | 3 | 92.6 | 1065.0 | 1669.0 | 1222.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 7 | 351161.0 | 11 | 3 | 89.0 | 1493.0 | 1135.0 | 1380.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 8 | 573425.0 | 11 | 3 | 96.5 | 1607.0 | 1822.0 | 1602.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 9 | 798431.0 | 11 | 2 | 70.5 | 1141.0 | 1178.0 | | |
| 11ac80SISO | 5530 | Type5 | 24 | 10 | 100737.0 | 11 | 3 | 94.0 | 1009.0 | 1629.0 | 1956.0 | |
| 11ac80SISO | 5530 | Type5 | 24 | 11 | 324661.0 | 11 | 1 | 55.8 | 1290.0 | | | |
| 11ac80SISO | 5530 | Type5 | 24 | 12 | 546278.0 | 11 | 3 | 87.7 | 1435.0 | 1963.0 | 1164.0 | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 79 of 85

| | @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr25@ | | | | | | | | | | | | | |
|------------|--------------------------------------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|--|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 0 | 1253842.0 | 5 | 2 | 68.6 | 1306.0 | 1161.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 1 | 119486.0 | 5 | 2 | 83.1 | 1420.0 | 1315.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 2 | 482958.0 | 5 | 1 | 60.9 | 1687.0 | | | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 3 | 845641.0 | 5 | 2 | 77.7 | 1776.0 | 1158.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 4 | 1208428.0 | 5 | 2 | 77.4 | 1793.0 | 1510.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 5 | 74748.0 | 5 | 2 | 66.8 | 1576.0 | 1323.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 6 | 438300.0 | 5 | 1 | 63.7 | 1333.0 | | | | | |
| 11ac20SISO | 5500 | Type5 | 25 | 7 | 800152.0 | 5 | 3 | 91.2 | 1409.0 | 1681.0 | 1275.0 | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 0 | 1253842.0 | 5 | 2 | 68.6 | 1306.0 | 1161.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 1 | 119486.0 | 5 | 2 | 83.1 | 1420.0 | 1315.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 2 | 482958.0 | 5 | 1 | 60.9 | 1687.0 | - | | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 3 | 845641.0 | 5 | 2 | 77.7 | 1776.0 | 1158.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 4 | 1208428.0 | 5 | 2 | 77.4 | 1793.0 | 1510.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 5 | 74748.0 | 5 | 2 | 66.8 | 1576.0 | 1323.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 6 | 438300.0 | 5 | 1 | 63.7 | 1333.0 | | | | | |
| 11ac40SISO | 5510 | Type5 | 25 | 7 | 800152.0 | 5 | 3 | 91.2 | 1409.0 | 1681.0 | 1275.0 | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 0 | 1253842.0 | 5 | 2 | 68.6 | 1306.0 | 1161.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 1 | 119486.0 | 5 | 2 | 83.1 | 1420.0 | 1315.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 2 | 482958.0 | 5 | 1 | 60.9 | 1687.0 | | | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 3 | 845641.0 | 5 | 2 | 77.7 | 1776.0 | 1158.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 4 | 1208428.0 | 5 | 2 | 77.4 | 1793.0 | 1510.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 5 | 74748.0 | 5 | 2 | 66.8 | 1576.0 | 1323.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 6 | 438300.0 | 5 | 1 | 63.7 | 1333.0 | | | | | |
| 11ac80SISO | 5530 | Type5 | 25 | 7 | 800152.0 | 5 | 3 | 91.2 | 1409.0 | 1681.0 | 1275.0 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 80 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr26@ | | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|----------|----------------|--------|-------|--------------|--------------|--------------|--|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Offset | Chirp Width | Of | Width | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | | |
| 44 000100 | 5500 | | | | (µs) | (MHz) | Pulses | (µs) | | | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 0 | 545865.0 | 16 | 3 | 83.6 | 1632.0 | 1195.0 | 1000.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 1 | 14067.0 | 16 | 3 | 89.4 | 1173.0 | 1627.0 | 1656.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 2 | 184953.0 | 16 | 1 | 55.8 | 1532.0 | 4554.0 | 4000.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 3 | 353759.0 | 16 | 3 | 90.9 | 1981.0 | 1554.0 | 1998.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 4 | 526388.0 | 16 | 1 | 54.7 | 1825.0 | 4000.0 | 4050.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 5 | 694806.0 | 16 | 3 | 97.7 | 1734.0 | 1202.0 | 1250.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 6 | 163568.0 | 16 | 2 | 67.5 | 1571.0 | 1434.0 | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 7 | 333410.0 | 16 | 3 | 96.7 | 1589.0 | 1469.0 | 1268.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 8 | 504006.0 | 16 | 2 | 68.3 | 1750.0 | 1954.0 | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 9 | 675297.0 | 16 | 2 | 78.3 | 1591.0 | 1082.0 | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 10 | 142890.0 | 16 | 1 | 55.0 | 1427.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 11 | 312479.0 | 16 | 3 | 84.9 | 1129.0 | 1936.0 | 1199.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 12 | 482953.0 | 16 | 2 | 74.6 | 1959.0 | 1856.0 | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 13 | 655022.0 | 16 | 1 | 63.3 | 1885.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 14 | 121457.0 | 16 | 3 | 99.8 | 1035.0 | 1515.0 | 1120.0 | | |
| 11ac20SISO | 5500 | Type5 | 26 | 15 | 292606.0 | 16 | 1 | 63.6 | 1647.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 26 | 16 | 461322.0 | 16 | 3 | 87.3 | 1931.0 | 1051.0 | 1831.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 0 | 545865.0 | 16 | 3 | 83.6 | 1632.0 | 1195.0 | 1000.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 1 | 14067.0 | 16 | 3 | 89.4 | 1173.0 | 1627.0 | 1656.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 2 | 184953.0 | 16 | 1 | 55.8 | 1532.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 3 | 353759.0 | 16 | 3 | 90.9 | 1981.0 | 1554.0 | 1998.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 4 | 526388.0 | 16 | 1 | 54.7 | 1825.0 | - | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 5 | 694806.0 | 16 | 3 | 97.7 | 1734.0 | 1202.0 | 1250.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 6 | 163568.0 | 16 | 2 | 67.5 | 1571.0 | 1434.0 | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 7 | 333410.0 | 16 | 3 | 96.7 | 1589.0 | 1469.0 | 1268.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 8 | 504006.0 | 16 | 2 | 68.3 | 1750.0 | 1954.0 | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 9 | 675297.0 | 16 | 2 | 78.3 | 1591.0 | 1082.0 | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 10 | 142890.0 | 16 | 1 | 55.0 | 1427.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 11 | 312479.0 | 16 | 3 | 84.9 | 1129.0 | 1936.0 | 1199.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 12 | 482953.0 | 16 | 2 | 74.6 | 1959.0 | 1856.0 | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 13 | 655022.0 | 16 | 1 | 63.3 | 1885.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 14 | 121457.0 | 16 | 3 | 99.8 | 1035.0 | 1515.0 | 1120.0 | | |
| 11ac40SISO | 5510 | Type5 | 26 | 15 | 292606.0 | 16 | 1 | 63.6 | 1647.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 26 | 16 | 461322.0 | 16 | 3 | 87.3 | 1931.0 | 1051.0 | 1831.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 0 | 545865.0 | 16 | 3 | 83.6 | 1632.0 | 1195.0 | 1000.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 1 | 14067.0 | 16 | 3 | 89.4 | 1173.0 | 1627.0 | 1656.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 2 | 184953.0 | 16 | 1 | 55.8 | 1532.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 3 | 353759.0 | 16 | 3 | 90.9 | 1981.0 | 1554.0 | 1998.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 4 | 526388.0 | 16 | 1 | 54.7 | 1825.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 5 | 694806.0 | 16 | 3 | 97.7 | 1734.0 | 1202.0 | 1250.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 6 | 163568.0 | 16 | 2 | 67.5 | 1571.0 | 1434.0 | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 7 | 333410.0 | 16 | 3 | 96.7 | 1589.0 | 1469.0 | 1268.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 8 | 504006.0 | 16 | 2 | 68.3 | 1750.0 | 1954.0 | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 9 | 675297.0 | 16 | 2 | 78.3 | 1591.0 | 1082.0 | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 10 | 142890.0 | 16 | 1 | 55.0 | 1427.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 11 | 312479.0 | 16 | 3 | 84.9 | 1129.0 | 1936.0 | 1199.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 12 | 482953.0 | 16 | 2 | 74.6 | 1959.0 | 1856.0 | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 13 | 655022.0 | 16 | 1 | 63.3 | 1885.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 14 | 121457.0 | 16 | 3 | 99.8 | 1035.0 | 1515.0 | 1120.0 | | |
| 11ac80SISO | 5530 | Type5 | 26 | 15 | 292606.0 | 16 | 1 | 63.6 | 1647.0 | 1313.0 | | | |
| 11ac80SISO | 5530 | Type5 | 26 | 16 | 461322.0 | 16 | 3 | 87.3 | 1931.0 | 1051.0 | 1831.0 | | |
| 1146003130 | JJJ0U | rypes | 20 | I IU | 401322.0 | 10 | J | 07.3 | 1931.0 | 1031.0 | 1031.0 | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 81 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr27@ TestMode Channel Radar Trial Burst Offset Width Of Width PRI1 PRI2 PRI3 | | | | | | | | | | | | | |
|---|--------------|----------------|----------|---------------|----------------------|----------------|--------------|--------------|------------------|------------------|------------------|--|--|
| TestMode | Channel | Туре | ID | ID | Offset (µs) | Width (MHz) | Of Pulses | Width (µs) | (µs) | (µs) | (µs) | | |
| 11ac20SISO | 5500 | Type5 | 27 | 0 | 565136.0 | 19 | 3 | 85.6 | 1946.0 | 1078.0 | 1015.0 | | |
| 11ac20SISO | 5500 | Type5 | 27 | 1 | 89970.0 | 19 | 2 | 68.6 | 1029.0 | 1780.0 | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 2 | 243121.0 | 19 | 1 | 54.2 | 1111.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 27 27 | 3 | 396034.0 | 19 19 | 1 | 61.2 | 1104.0 | | 1100.0 | | |
| 11ac20SISO 11ac20SISO | 5500 5500 | Type5 Type5 | 27 | <u>4</u> 5 | 546225.0 70998.0 | 19 | 3 | 97.1 98.3 | 1157.0 1142.0 | 1969.0 1699.0 | 1622.0 | | |
| 11ac20SISO | 5500 | Type5 | 27 | 6 | 224093.0 | 19 | 1 | 62.4 | 1655.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 7 | 376127.0 | 19 | 2 | 80.2 | 1126.0 | 1769.0 | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 8 | 527806.0 | 19 | 3 | 87.5 | 1216.0 | 1448.0 | 1179.0 | | |
| 11ac20SISO | 5500 | Type5 | 27 | 9 | 52247.0 | 19 | 3 | 85.8 | 1847.0 | 1348.0 | 1472.0 | | |
| 11ac20SISO | 5500 | Type5 | 27 | 10 | 204582.0 | 19 | 3 | 88.1 | 1023.0 | 1124.0 | 1631.0 | | |
| 11ac20SISO | 5500 | Type5 | 27 | 11 | 357941.0 | 19 | 1 | 65.3 | 1848.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 12 | 510977.0 | 19 | 1 | 52.5 | 1470.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 13 | 33698.0 | 19 | 1 | 52.3 | 1312.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 14 | 186023.0 | 19 | 2 | 74.1 | 1915.0 | 1200.0 | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 15 | 339327.0 | 19 | 1 | 54.9 | 1479.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 16 | 491053.0 | 19 | 2 | 76.2 | 1376.0 | 1502.0 | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 17 | 14858.0 | 19 | 1 | 60.4 | 1758.0 | | | | |
| 11ac20SISO | 5500 | Type5 | 27 | 18 | 167387.0 | 19 | 2 | 81.5 | 1491.0 | 1103.0 | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 0 | 565136.0 | 19 | 3 | 85.6 | 1946.0 | 1078.0 | 1015.0 | | |
| 11ac40SISO | 5510 | Type5 | 27 | 1 | 89970.0 | 19 | 2 | 68.6 | 1029.0 | 1780.0 | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 2 | 243121.0 | 19 | 1 | 54.2 | 1111.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 3 | 396034.0 | 19 | 1 | 61.2 | 1104.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 4 | 546225.0 | 19 | 3 | 97.1 | 1157.0 | 1969.0 | 1100.0 | | |
| 11ac40SISO | 5510 | Type5 | 27 | 5 | 70998.0 | 19 | 3 | 98.3 | 1142.0 | 1699.0 | 1622.0 | | |
| 11ac40SISO | 5510 | Type5 | 27 | 6 | 224093.0 | 19 | 1 | 62.4 | 1655.0 | 4700.0 | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 7 | 376127.0 | 19 | 2 | 80.2 | 1126.0 | 1769.0 | 4470.0 | | |
| 11ac40SISO 11ac40SISO | 5510 5510 | Type5 Type5 | 27 27 | <u>8</u> 9 | 527806.0 52247.0 | 19 19 | 3 | 87.5 85.8 | 1216.0 1847.0 | 1448.0 1348.0 | 1179.0 1472.0 | | |
| 11ac40SISO | 5510 | Type5 | 27 | 10 | 204582.0 | 19 | 3 | 88.1 | 1023.0 | 1124.0 | 1631.0 | | |
| 11ac40SISO | 5510 | Type5 | 27 | 11 | 357941.0 | 19 | 1 | 65.3 | 1848.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 12 | 510977.0 | 19 | 1 | 52.5 | 1470.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 13 | 33698.0 | 19 | 1 | 52.3 | 1312.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 14 | 186023.0 | 19 | 2 | 74.1 | 1915.0 | 1200.0 | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 15 | 339327.0 | 19 | 1 | 54.9 | 1479.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 16 | 491053.0 | 19 | 2 | 76.2 | 1376.0 | 1502.0 | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 17 | 14858.0 | 19 | 1 | 60.4 | 1758.0 | | | | |
| 11ac40SISO | 5510 | Type5 | 27 | 18 | 167387.0 | 19 | 2 | 81.5 | 1491.0 | 1103.0 | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 0 | 565136.0 | 19 | 3 | 85.6 | 1946.0 | 1078.0 | 1015.0 | | |
| 11ac80SISO | 5530 | Type5 | 27 | 1 | 89970.0 | 19 | 2 | 68.6 | 1029.0 | 1780.0 | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 2 | 243121.0 | 19 | 1 | 54.2 | 1111.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 3 | 396034.0 | 19 | 1 | 61.2 | 1104.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 4 | 546225.0 | 19 | 3 | 97.1 | 1157.0 | 1969.0 | 1100.0 | | |
| 11ac80SISO | 5530 | Type5 | 27 | 5 | 70998.0 | 19 | 3 | 98.3 | 1142.0 | 1699.0 | 1622.0 | | |
| 11ac80SISO | 5530 | Type5 | 27 | 6 | 224093.0 | 19 | 1 | 62.4 | 1655.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 7 | 376127.0 | 19 | 2 | 80.2 | 1126.0 | 1769.0 | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 8 | 527806.0 | 19 | 3 | 87.5 | 1216.0 | 1448.0 | 1179.0 | | |
| 11ac80SISO | 5530 | Type5 | 27 | 9 | 52247.0 | 19 | 3 | 85.8 | 1847.0 | 1348.0 | 1472.0 | | |
| 11ac80SISO | 5530 | Type5 | 27 | 10 | 204582.0 | 19 | 3 | 88.1 | 1023.0 | 1124.0 | 1631.0 | | |
| 11ac80SISO | 5530 | Type5 | 27 | 11 | 357941.0 | 19 | 1 | 65.3 | 1848.0 | | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 12 | 510977.0 | 19 | 1 | 52.5 | 1470.0 | | | | |
| 11ac80SISO | 5530 5530 | Type5 | 27 27 | 13 14 | 33698.0 | 19 19 | 2 | 52.3 | 1312.0 1915.0 | 1200.0 | | | |
| 11ac80SISO 11ac80SISO | 5530 5530 | Type5 | 27 | 15 | 186023.0 339327.0 | 19 | 1 | 74.1 54.9 | 1915.0 | 1200.0 | | | |
| 11ac80SISO | 5530 | Type5 Type5 | 27 | 16 | 491053.0 | 19 | 2 | 76.2 | 1376.0 | 1502.0 | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 17 | 14858.0 | 19 | 1 | 60.4 | 1758.0 | 1302.0 | | | |
| 11ac80SISO | 5530 | Type5 | 27 | 18 | 167387.0 | 19 | 2 | 81.5 | 1491.0 | 1103.0 | | | |
| TIACOUSISO | 5550 | TypeJ | <u> </u> | 10 | 107307.0 | 13 | ۷ | 01.0 | 1731.0 | 1103.0 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 82 of 85

| @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr28@ | | | | | | | | | | | | |
|--------------------------------------|---------|---------------|-------------|-------------|-------------------------|-------------------------|------------------------|------------------------|--------------|--------------|--------------|--|
| TestMode | Channel | Radar Type | Trial ID | Burst ID | Burst Offset (µs) | Chirp Width (MHz) | Number Of Pulses | Pulse Width (µs) | PRI1 (µs) | PRI2 (µs) | PRI3 (µs) | |
| 11ac20SISO | 5500 | Type5 | 28 | 0 | 507709.0 | 10 | 1 | 50.5 | 1857.0 | | | |
| 11ac20SISO | 5500 | Type5 | 28 | 1 | 750249.0 | 10 | 1 | 55.7 | 1246.0 | | | |
| 11ac20SISO | 5500 | Type5 | 28 | 2 | 989003.0 | 10 | 3 | 85.8 | 1774.0 | 1002.0 | 1967.0 | |
| 11ac20SISO | 5500 | Type5 | 28 | 3 | 235634.0 | 10 | 2 | 76.9 | 1125.0 | 1474.0 | | |
| 11ac20SISO | 5500 | Type5 | 28 | 4 | 477675.0 | 10 | 2 | 75.1 | 1254.0 | 1052.0 | | |
| 11ac20SISO | 5500 | Type5 | 28 | 5 | 718312.0 | 10 | 3 | 92.3 | 1180.0 | 1486.0 | 1492.0 | |
| 11ac20SISO | 5500 | Type5 | 28 | 6 | 960895.0 | 10 | 2 | 78.1 | 1301.0 | 1757.0 | | |
| 11ac20SISO | 5500 | Type5 | 28 | 7 | 205370.0 | 10 | 3 | 92.2 | 1898.0 | 1252.0 | 1713.0 | |
| 11ac20SISO | 5500 | Type5 | 28 | 8 | 446940.0 | 10 | 3 | 89.0 | 1260.0 | 1706.0 | 1411.0 | |
| 11ac20SISO | 5500 | Type5 | 28 | 9 | 689225.0 | 10 | 2 | 70.9 | 1578.0 | 1620.0 | | |
| 11ac20SISO | 5500 | Type5 | 28 | 10 | 932305.0 | 10 | 1 | 63.1 | 1782.0 | | | |
| 11ac20SISO | 5500 | Type5 | 28 | 11 | 176231.0 | 10 | 1 | 55.3 | 1522.0 | | | |
| 11ac40SISO | 5510 | Type5 | 28 | 0 | 507709.0 | 10 | 1 | 50.5 | 1857.0 | | | |
| 11ac40SISO | 5510 | Type5 | 28 | 1 | 750249.0 | 10 | 1 | 55.7 | 1246.0 | | | |
| 11ac40SISO | 5510 | Type5 | 28 | 2 | 989003.0 | 10 | 3 | 85.8 | 1774.0 | 1002.0 | 1967.0 | |
| 11ac40SISO | 5510 | Type5 | 28 | 3 | 235634.0 | 10 | 2 | 76.9 | 1125.0 | 1474.0 | | |
| 11ac40SISO | 5510 | Type5 | 28 | 4 | 477675.0 | 10 | 2 | 75.1 | 1254.0 | 1052.0 | | |
| 11ac40SISO | 5510 | Type5 | 28 | 5 | 718312.0 | 10 | 3 | 92.3 | 1180.0 | 1486.0 | 1492.0 | |
| 11ac40SISO | 5510 | Type5 | 28 | 6 | 960895.0 | 10 | 2 | 78.1 | 1301.0 | 1757.0 | | |
| 11ac40SISO | 5510 | Type5 | 28 | 7 | 205370.0 | 10 | 3 | 92.2 | 1898.0 | 1252.0 | 1713.0 | |
| 11ac40SISO | 5510 | Type5 | 28 | 8 | 446940.0 | 10 | 3 | 89.0 | 1260.0 | 1706.0 | 1411.0 | |
| 11ac40SISO | 5510 | Type5 | 28 | 9 | 689225.0 | 10 | 2 | 70.9 | 1578.0 | 1620.0 | | |
| 11ac40SISO | 5510 | Type5 | 28 | 10 | 932305.0 | 10 | 1 | 63.1 | 1782.0 | | | |
| 11ac40SISO | 5510 | Type5 | 28 | 11 | 176231.0 | 10 | 1 | 55.3 | 1522.0 | | | |
| 11ac80SISO | 5530 | Type5 | 28 | 0 | 507709.0 | 10 | 1 | 50.5 | 1857.0 | | | |
| 11ac80SISO | 5530 | Type5 | 28 | 1 | 750249.0 | 10 | 1 | 55.7 | 1246.0 | | | |
| 11ac80SISO | 5530 | Type5 | 28 | 2 | 989003.0 | 10 | 3 | 85.8 | 1774.0 | 1002.0 | 1967.0 | |
| 11ac80SISO | 5530 | Type5 | 28 | 3 | 235634.0 | 10 | 2 | 76.9 | 1125.0 | 1474.0 | | |
| 11ac80SISO | 5530 | Type5 | 28 | 4 | 477675.0 | 10 | 2 | 75.1 | 1254.0 | 1052.0 | | |
| 11ac80SISO | 5530 | Type5 | 28 | 5 | 718312.0 | 10 | 3 | 92.3 | 1180.0 | 1486.0 | 1492.0 | |
| 11ac80SISO | 5530 | Type5 | 28 | 6 | 960895.0 | 10 | 2 | 78.1 | 1301.0 | 1757.0 | | |
| 11ac80SISO | 5530 | Type5 | 28 | 7 | 205370.0 | 10 | 3 | 92.2 | 1898.0 | 1252.0 | 1713.0 | |
| 11ac80SISO | 5530 | Type5 | 28 | 8 | 446940.0 | 10 | 3 | 89.0 | 1260.0 | 1706.0 | 1411.0 | |
| 11ac80SISO | 5530 | Type5 | 28 | 9 | 689225.0 | 10 | 2 | 70.9 | 1578.0 | 1620.0 | | |
| 11ac80SISO | 5530 | Type5 | 28 | 10 | 932305.0 | 10 | 1 | 63.1 | 1782.0 | | | |
| 11ac80SISO | 5530 | Type5 | 28 | 11 | 176231.0 | 10 | 1 | 55.3 | 1522.0 | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路 号约6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 83 of 85

| TestMode Channel Radar Trial Burst Di | @FCC_RLAN_DFS_SPC_Radar_T5_SP2_Tr29@ | | | | | | | | | | | | |
|--|--------------------------------------|---------|-------|---------|-------|----------|----|---|------|--------|--------|--------|--|
| Test | | | | <u></u> | | | | | | 1 | | | |
| Inac2018 196 | TaskMaska | Chamal | Radar | Trial | Burst | | | | | PRI1 | PRI2 | PRI3 | |
| Trace Trac | restiviode | Channel | Type | ID | ID | - | | _ | | (µs) | (µs) | (µs) | |
| | 11==200100 | 5500 | | 20 | 0 | | | | | | | | |
| | | | | | | | | | | | | | |
| | | | | | | | | | | | | | |
| HacQSISISO | | | - | | | | | | | | | | |
| | | | | | | | | | | | | | |
| 14acQSISO 5500 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 14acQSISO 5500 Type5 29 8 238032.0 17 3 91.1 110.5 0 1599.0 1442.0 141 | | | | | | | | | | | | | |
| | | | | 29 | 6 | | | 2 | | | 1137.0 | | |
| | | | | | 7 | 77366.0 | 17 | | 86.5 | | 1128.0 | 1828.0 | |
| 11ac2OSISO | 11ac20SISO | 5500 | Type5 | 29 | 8 | 238032.0 | | 3 | 91.1 | 1105.0 | 1599.0 | 1442.0 | |
| | | | Type5 | | | | | 3 | | | 1373.0 | 1087.0 | |
| | | | - | | | | | | | | | | |
| 11ac2OSISO | | | | | | | | | | | 1405.0 | | |
| TraczOSISO | | | - | | | | | | | | | | |
| Tilac2OSISO | | | | | | | | | | | | | |
| Telagosiso | | | | | | | | | | | 1464.0 | | |
| | | | - , . | | | | | | | | 1255.0 | | |
| | | | | | | 350754.0 | | | | | | | |
| | | | | | | | | | | | | 1801.0 | |
| | | | - | | | | | | | | | | |
| Tilac40SISO 5510 Type5 29 3 97088.0 17 3 91.8 1563.0 1151.0 1802.0 11ac40SISO 5510 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 1760.0 | | | | | | | | | | | | | |
| 11ac40SISO 5510 Type5 29 | | | | | | | | | | | | | |
| 11ac40SISO 5510 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac40SISO 5510 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 113c40SISO 5510 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 11ac40SISO 5510 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac40SISO 5510 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac40SISO 5510 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac40SISO 5510 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac40SISO 5510 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac40SISO 5510 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac40SISO 5510 Type5 29 15 37916.0 17 2 81.4 1096.0 1464.0 11ac40SISO 5510 Type5 29 16 198794.0 17 2 81.0 1326.0 1668.0 11ac40SISO 5530 Type5 29 0 277485.0 17 2 81.0 1326.0 1668.0 11ac80SISO 5530 Type5 29 1 43788.0 17 3 83.4 1454.0 1205.0 1801.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 97.3 1319.0 1826.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 97.3 1319.0 1826.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 3 9380SISO 17 3 91.1 1105.0 1590.0 1442.0 11ac80SISO 5530 Type5 29 3 9380SISO 17 3 91.1 1105.0 1590.0 1442.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 | 11ac40SISO | | | | | | | | | | | | |
| 11ac40SISO 5510 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 11ac40SISO 5510 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 11ac40SISO 5510 Type5 29 9 398805.0 17 3 93.5 1867.0 1373.0 1087.0 11ac40SISO 5510 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac40SISO 5510 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac40SISO 5510 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac40SISO 5510 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac40SISO 5510 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac40SISO 5510 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac40SISO 5510 Type5 29 16 198794.0 17 2 81.4 1096.0 1464.0 11ac40SISO 5510 Type5 29 16 198794.0 17 2 81.0 1326.0 1668.0 11ac40SISO 5510 Type5 29 17 359754.0 17 2 81.0 1326.0 1668.0 11ac40SISO 5530 Type5 29 1 437880.0 17 3 83.4 1454.0 1205.0 1801.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 97.3 1319.0 1826.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 97.3 1319.0 1826.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 5 419893.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 5 43893.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 5 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 | 11ac40SISO | 5510 | Type5 | 29 | 5 | 419893.0 | 17 | 1 | 59.5 | | | | |
| 11ac40SISO | | | Type5 | | | | | | 80.0 | | | | |
| 11ac40SISO | | | - | | | | | | | | | | |
| 11ac40SISO | | | | | | | | | | | | | |
| 11ac40SISO | | | | | | | | | | | | | |
| 11ac40SISO | | | - | | | 562025.0 | | | | | | | |
| 11ac40SISO | | | | | | | | | | | 1405.0 | | |
| 11ac40SISO 5510 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac40SISO 5510 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac40SISO 5510 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 11ac40SISO 5510 Type5 29 17 359754.0 17 2 81.0 1326.0 1668.0 11ac80SISO 5530 Type5 29 0 277485.0 17 3 83.4 1454.0 1205.0 1801.0 11ac80SISO 5530 Type5 29 1 437880.0 17 3 97.3 1319.0 1826.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 91.8 1563.0 1151.0 1802.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 8 238032.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 79.4 1933.0 1667.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 80.0 1733.0 1255.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 80.0 1733.0 1255.0 | | | | | | | | | | | 1667.0 | | |
| 11ac40SISO 5510 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac40SISO 5510 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 11ac40SISO 5510 Type5 29 17 359754.0 17 2 81.0 1326.0 1668.0 11ac80SISO 5530 Type5 29 0 277485.0 17 3 83.4 1454.0 1205.0 1801.0 11ac80SISO 5530 Type5 29 1 437880.0 17 3 90.4 1079.0 1986.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 91.8 1563.0 1151.0 1802.0 11ac | | | | | | | | | | | | | |
| 11ac40SISO 5510 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 11ac40SISO 5510 Type5 29 17 359754.0 17 2 81.0 1326.0 1668.0 11ac80SISO 5530 Type5 29 0 277485.0 17 3 83.4 1454.0 1205.0 1801.0 11ac80SISO 5530 Type5 29 1 437880.0 17 3 97.3 1319.0 1826.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 90.4 1079.0 1986.0 1635.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 91.8 1563.0 1151.0 1802.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 | | | | | | 37916.0 | | | | | 1404.0 | | |
| 11ac40SISO 5510 Type5 29 17 359754.0 17 2 81.0 1326.0 1668.0 11ac80SISO 5530 Type5 29 0 277485.0 17 3 83.4 1454.0 1205.0 1801.0 11ac80SISO 5530 Type5 29 1 437880.0 17 3 97.3 1319.0 1826.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 < | | | | | | | | | | | 1255.0 | | |
| 11ac80SISO 5530 Type5 29 0 277485.0 17 3 83.4 1454.0 1205.0 1801.0 11ac80SISO 5530 Type5 29 1 437880.0 17 3 97.3 1319.0 1826.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 91.8 1563.0 1151.0 1802.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 5 419893.0 17 1 59.5 1952.0 | | | | | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 1 437880.0 17 3 97.3 1319.0 1826.0 1635.0 11ac80SISO 5530 Type5 29 2 598445.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 91.8 1563.0 1151.0 1802.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 5 419893.0 17 1 59.5 1952.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 11ac | | | | | | | | | | | | 1801.0 | |
| 11ac80SISO 5530 Type5 29 2 598445.0 17 3 90.4 1079.0 1986.0 1674.0 11ac80SISO 5530 Type5 29 3 97088.0 17 3 91.8 1563.0 1151.0 1802.0 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 5 419893.0 17 1 59.5 1952.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 11ac80SISO 5530 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 | | | | 29 | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 4 257251.0 17 3 98.2 1876.0 1977.0 1766.0 11ac80SISO 5530 Type5 29 5 419893.0 17 1 59.5 1952.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 11ac80SISO 5530 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 11ac80SISO 5530 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 | | 5530 | | 29 | | 598445.0 | 17 | 3 | | | 1986.0 | | |
| 11ac80SISO 5530 Type5 29 5 419893.0 17 1 59.5 1952.0 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 11ac80SISO 5530 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 11ac80SISO 5530 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO< | | | | | | | | | | | | 1802.0 | |
| 11ac80SISO 5530 Type5 29 6 580724.0 17 2 80.0 1253.0 1137.0 11ac80SISO 5530 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 11ac80SISO 5530 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 11ac80SISO 5530 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO | | | | | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 7 77366.0 17 3 86.5 1054.0 1128.0 1828.0 11ac80SISO 5530 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 11ac80SISO 5530 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO 5530 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 | | | | | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 8 238032.0 17 3 91.1 1105.0 1599.0 1442.0 11ac80SISO 5530 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO 5530 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac80SISO | | | | | | | | 2 | | | | | |
| 11ac80SISO 5530 Type5 29 9 398605.0 17 3 93.5 1867.0 1373.0 1087.0 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO 5530 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac80SISO 5530 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac80SISO | | | | | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 10 562025.0 17 1 60.7 1033.0 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO 5530 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac80SISO 5530 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac80SISO 5530 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 | | | - , . | | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 11 57684.0 17 2 67.2 1288.0 1405.0 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO 5530 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac80SISO 5530 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac80SISO 5530 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 | | | | | | | | | | | 13/3.0 | | |
| 11ac80SISO 5530 Type5 29 12 219083.0 17 1 61.8 1585.0 11ac80SISO 5530 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac80SISO 5530 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac80SISO 5530 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 | | | | | | | | | | | 1405.0 | | |
| 11ac80SISO 5530 Type5 29 13 379234.0 17 2 79.4 1933.0 1667.0 11ac80SISO 5530 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac80SISO 5530 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac80SISO 5530 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 | | | , , | | | | | | | | 1400.0 | | |
| 11ac80SISO 5530 Type5 29 14 540896.0 17 2 81.4 1096.0 1464.0 11ac80SISO 5530 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac80SISO 5530 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 | | | | | | | | | | | 1667.0 | | |
| 11ac80SISO 5530 Type5 29 15 37916.0 17 1 65.7 1496.0 11ac80SISO 5530 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 | | | - | | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 16 198794.0 17 2 76.0 1733.0 1255.0 | | | - | | | | | | | | | | |
| 11ac80SISO 5530 Type5 29 17 359754.0 17 2 81.0 1326.0 1668.0 | | | | | | | | | | | 1255.0 | | |
| | | | | | | | | 2 | | | | | |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. B Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 84 of 86

| | | | Trial | Pulse width | PRI | Pulses | Detection |
|------------|----------------|------------|----------|-------------|-------|---------|-----------------|
| TestMode | Frequency[MHz] | Radar Type | ID | (µs) | (µs) | per Hop | (1: Yes; 0: No) |
| | | Type6 | 0 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 1 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 2 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 3 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 4 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 5 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 6 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 7 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 8 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 9 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 10 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 11 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 12 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 13 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 14 | 1 | 333.3 | 9 | 1 |
| 11ac20SISO | 5500 | Type6 | 15 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 16 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 17 | 1 | 333.3 | 9 | 1 |
| | | | 18 | 1 | 333.3 | 9 | 1 |
| | | Type6 | | 1 | | 9 | |
| | | Type6 | 19 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 20 21 | 1 | 333.3 | | 1 |
| | | Type6 | 22 | 1 | 333.3 | 9 | 1 1 |
| | | Type6 | | • | 333.3 | | |
| | | Type6 | 23 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 24 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 25 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 26 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 27 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 28 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 29 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 0 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 1 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 2 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 3 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 4 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 5 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 6 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 7 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 8 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 9 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 10 | 1 | 333.3 | 9 | 1 |
| 11ac40SISO | 5510 | Type6 | 11 | 1 | 333.3 | 9 | 1 |
| 1.45.05.50 | 3310 | Type6 | 12 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 13 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 14 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 15 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 16 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 17 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 18 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 19 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 20 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 21 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 22 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 23 | 1 | 333.3 | 9 | 1 |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indeminification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CND occheck@ss.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suchou Area, China (Jiangsu) Pitot Free Trade Zone 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 t (86–512) 62992980



Report No.: SEWA2209000044RG06

Rev.: 01

Page: 85 of 85

| | | | | | i agc. | 00 01 00 | |
|------------|------|-------|----|---|--------|----------|---|
| | | Type6 | 24 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 25 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 26 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 27 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 28 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 29 | 1 | 333.3 | 9 | 1 |
| 11ac80SISO | 5530 | Type6 | 0 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 1 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 2 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 3 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 4 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 5 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 6 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 7 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 8 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 9 | 1 | 333.3 | 9 | 0 |
| | | Type6 | 10 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 11 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 12 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 13 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 14 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 15 | 1 | 333.3 | 9 | 0 |
| | | Type6 | 16 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 17 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 18 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 19 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 20 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 21 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 22 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 23 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 24 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 25 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 26 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 27 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 28 | 1 | 333.3 | 9 | 1 |
| | | Type6 | 29 | 1 | 333.3 | 9 | 1 |

---End of Report---



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company, Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN. Doccheck@ass.com

South of No. 6 Plant, No. 1, Runsheng Road, Suchou Industrial Park, Suzhou Area, Chira (Jiangsu) Pilot Friee Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86–512) 62992980 ww t (86–512) 62992980 sgs