






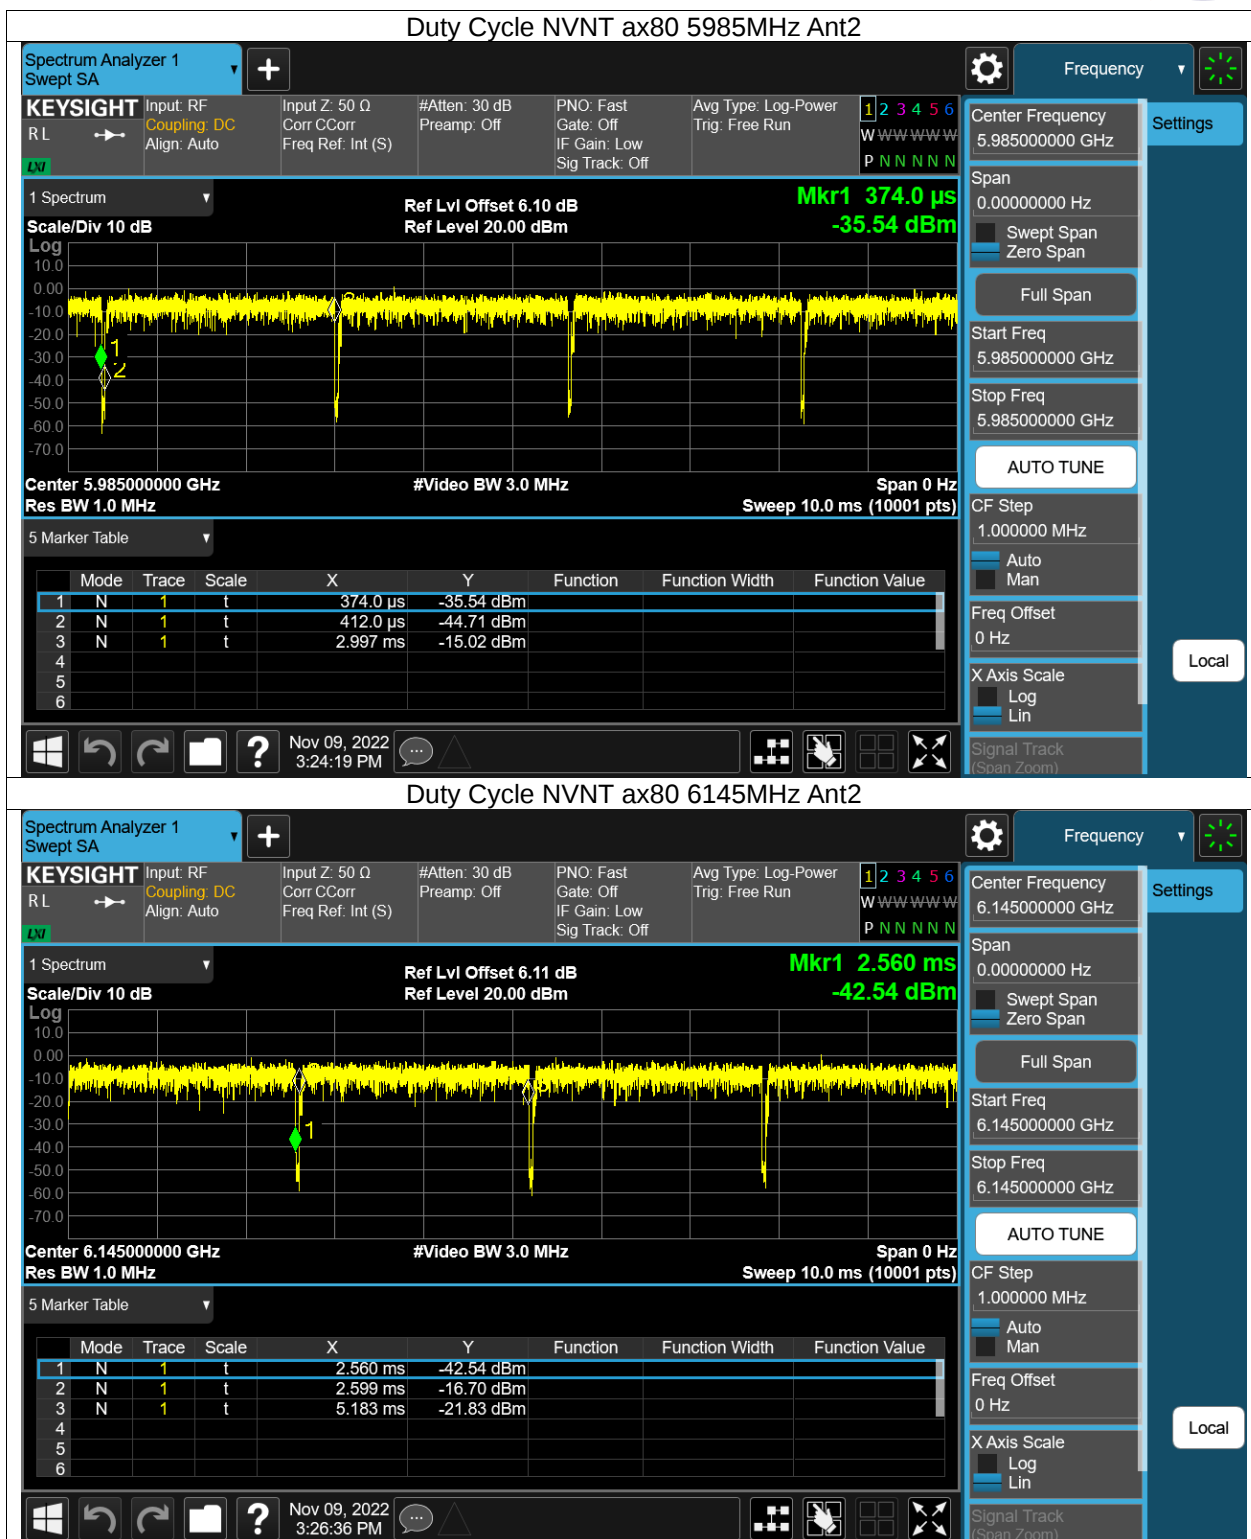


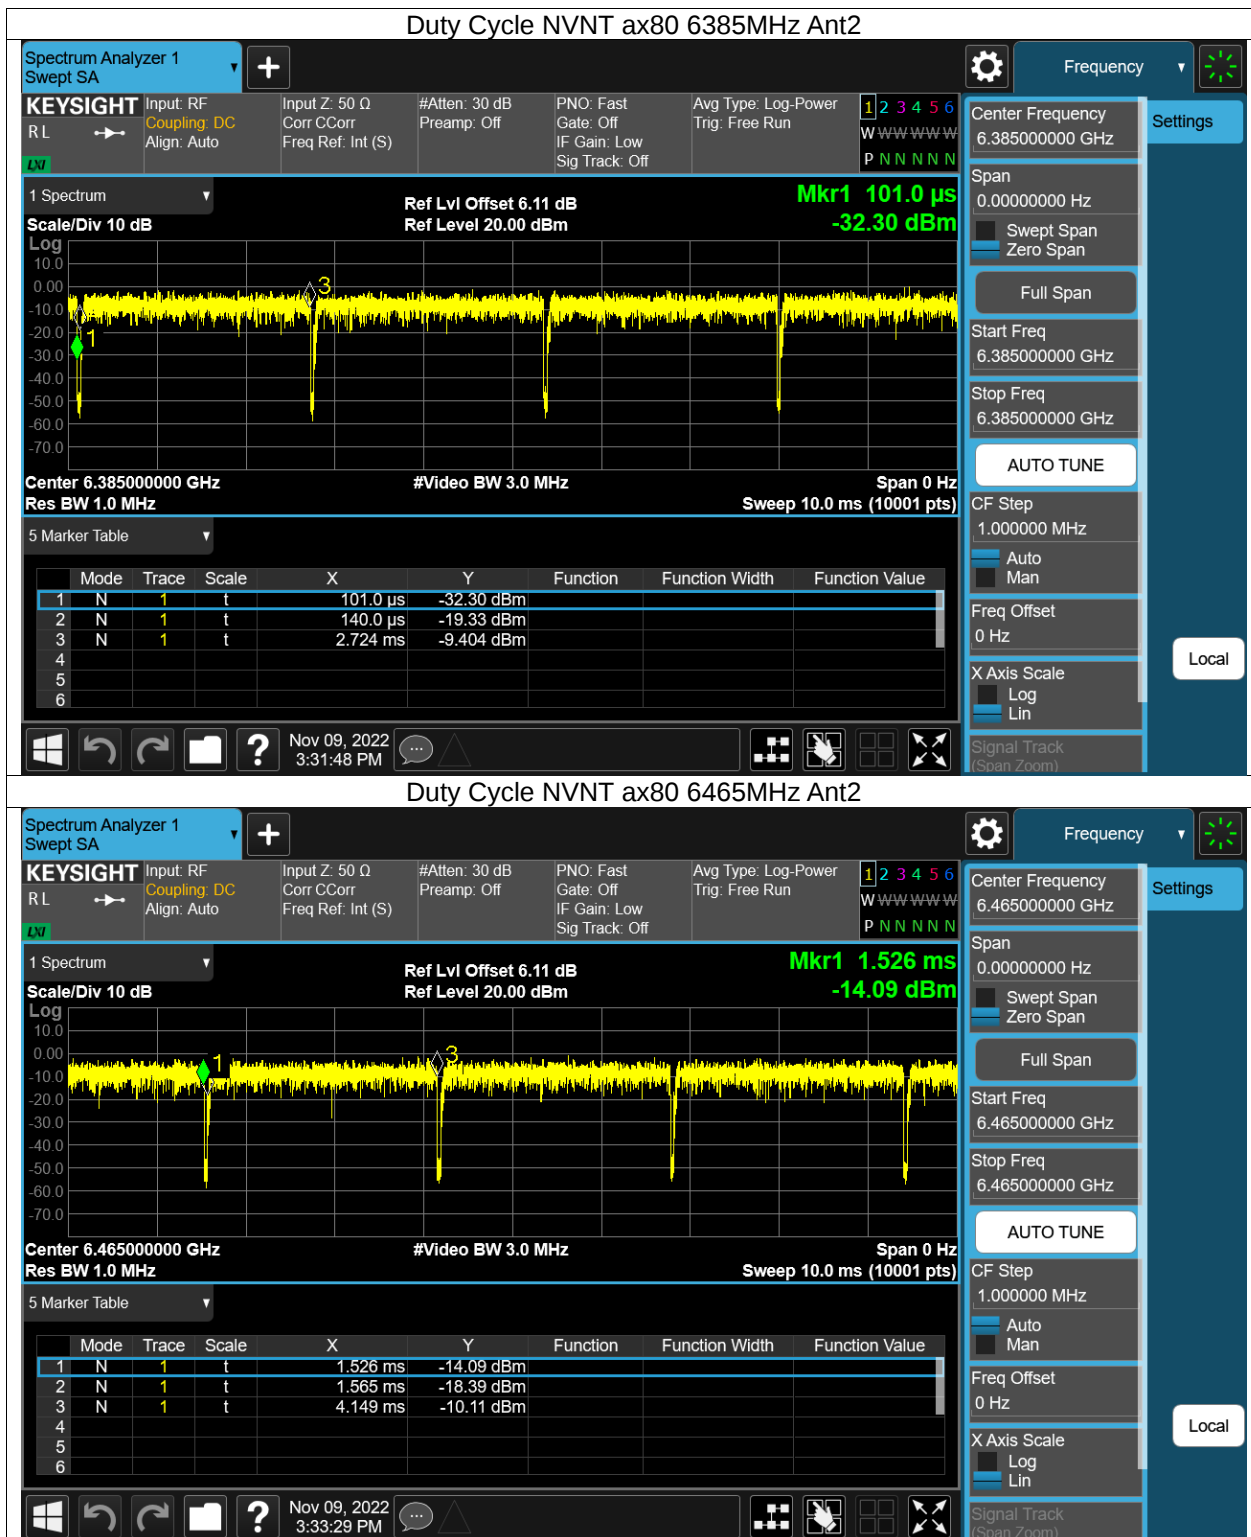


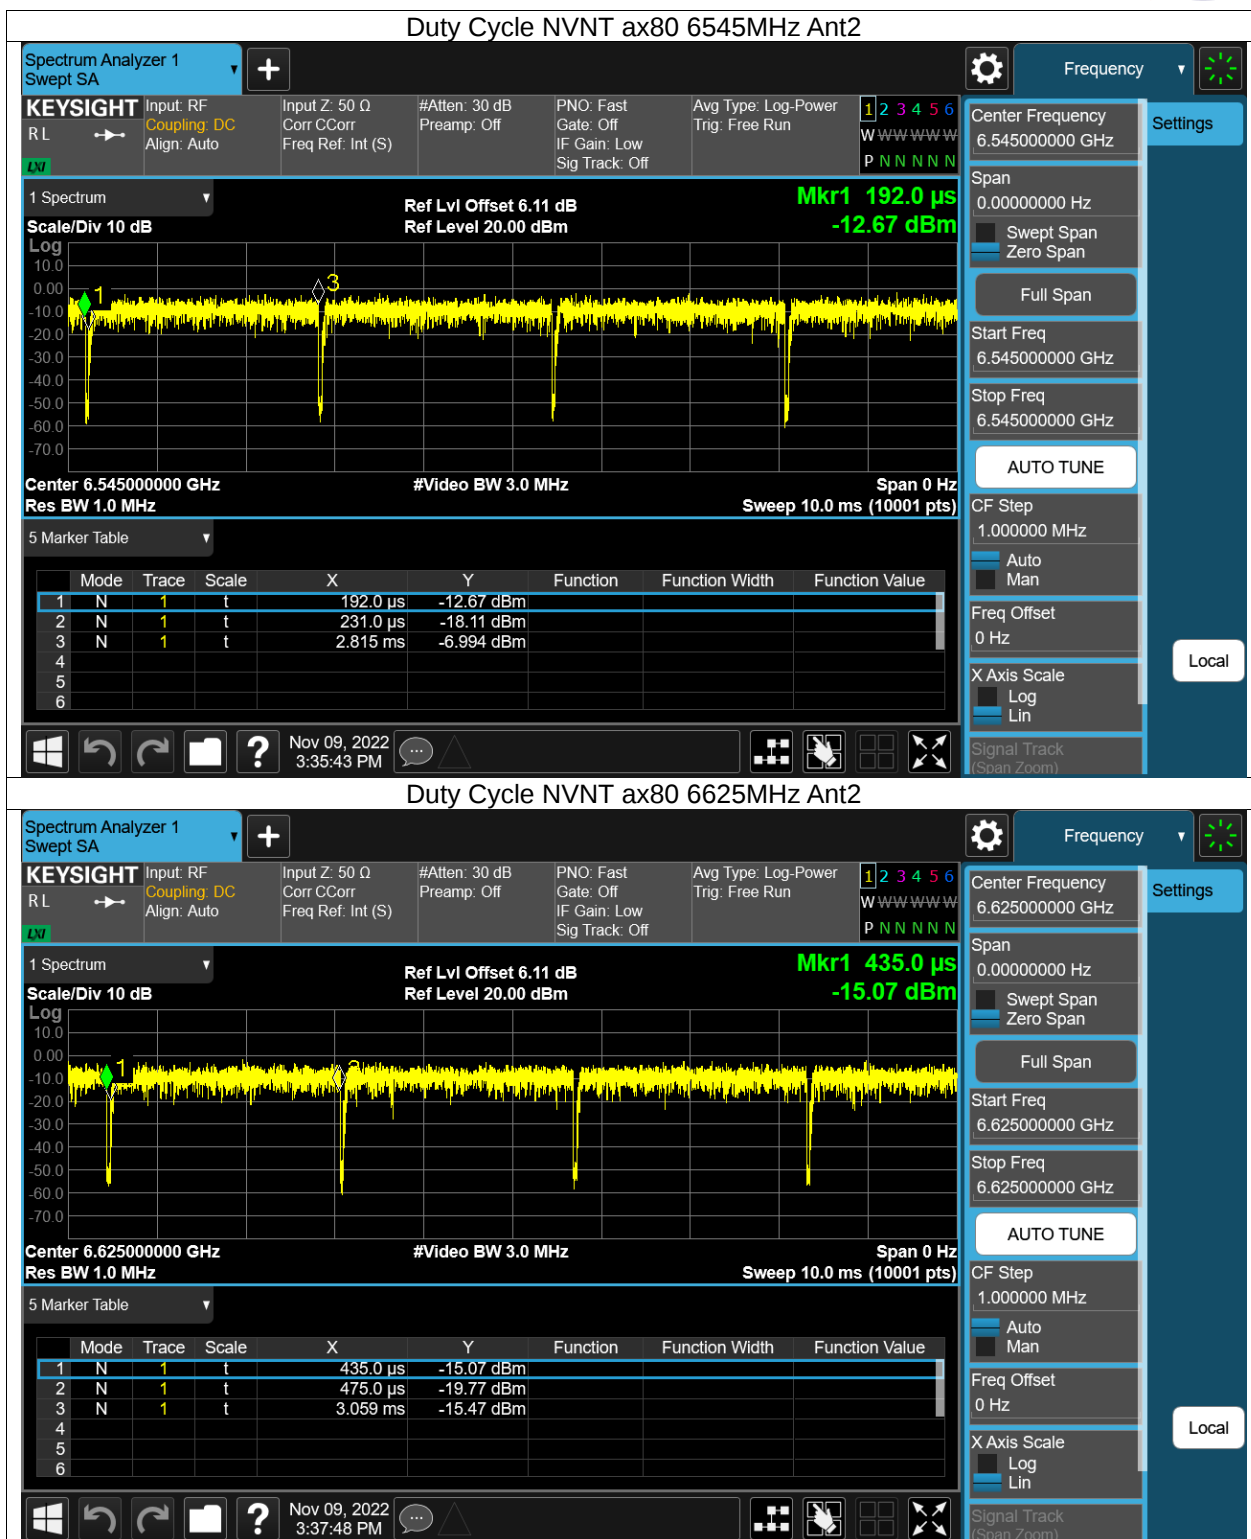


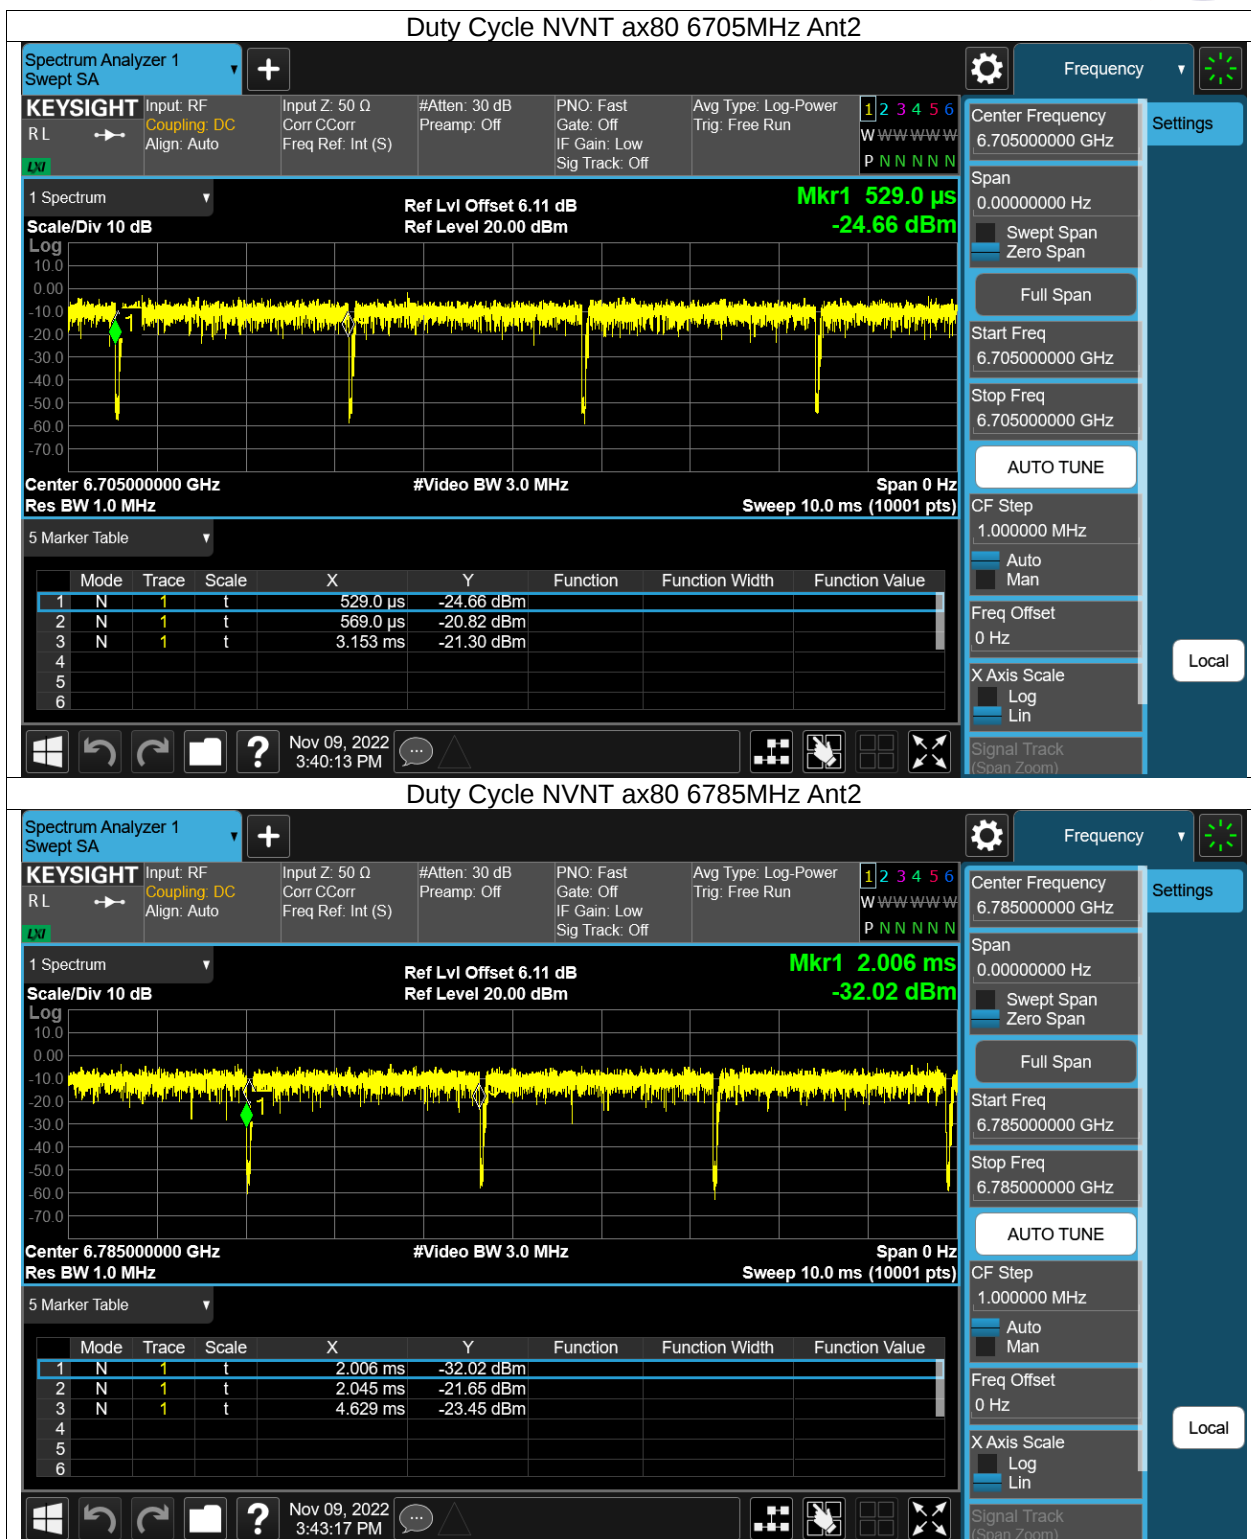


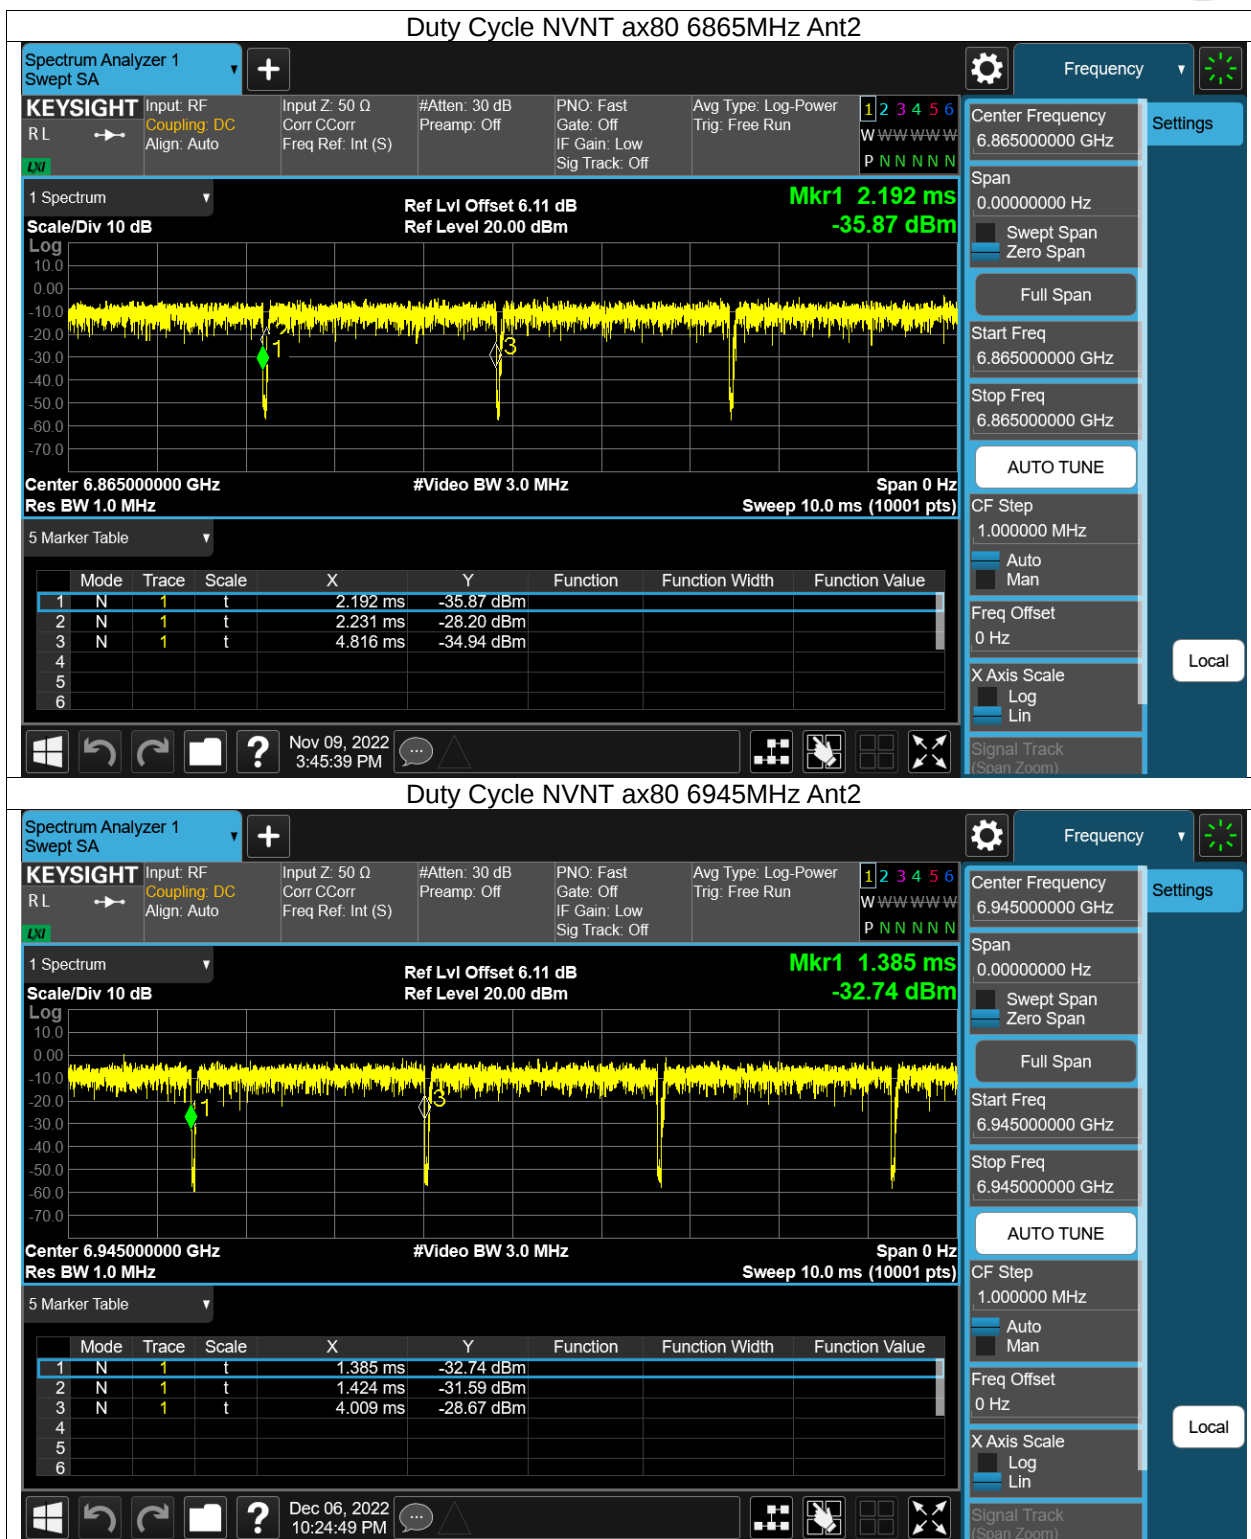


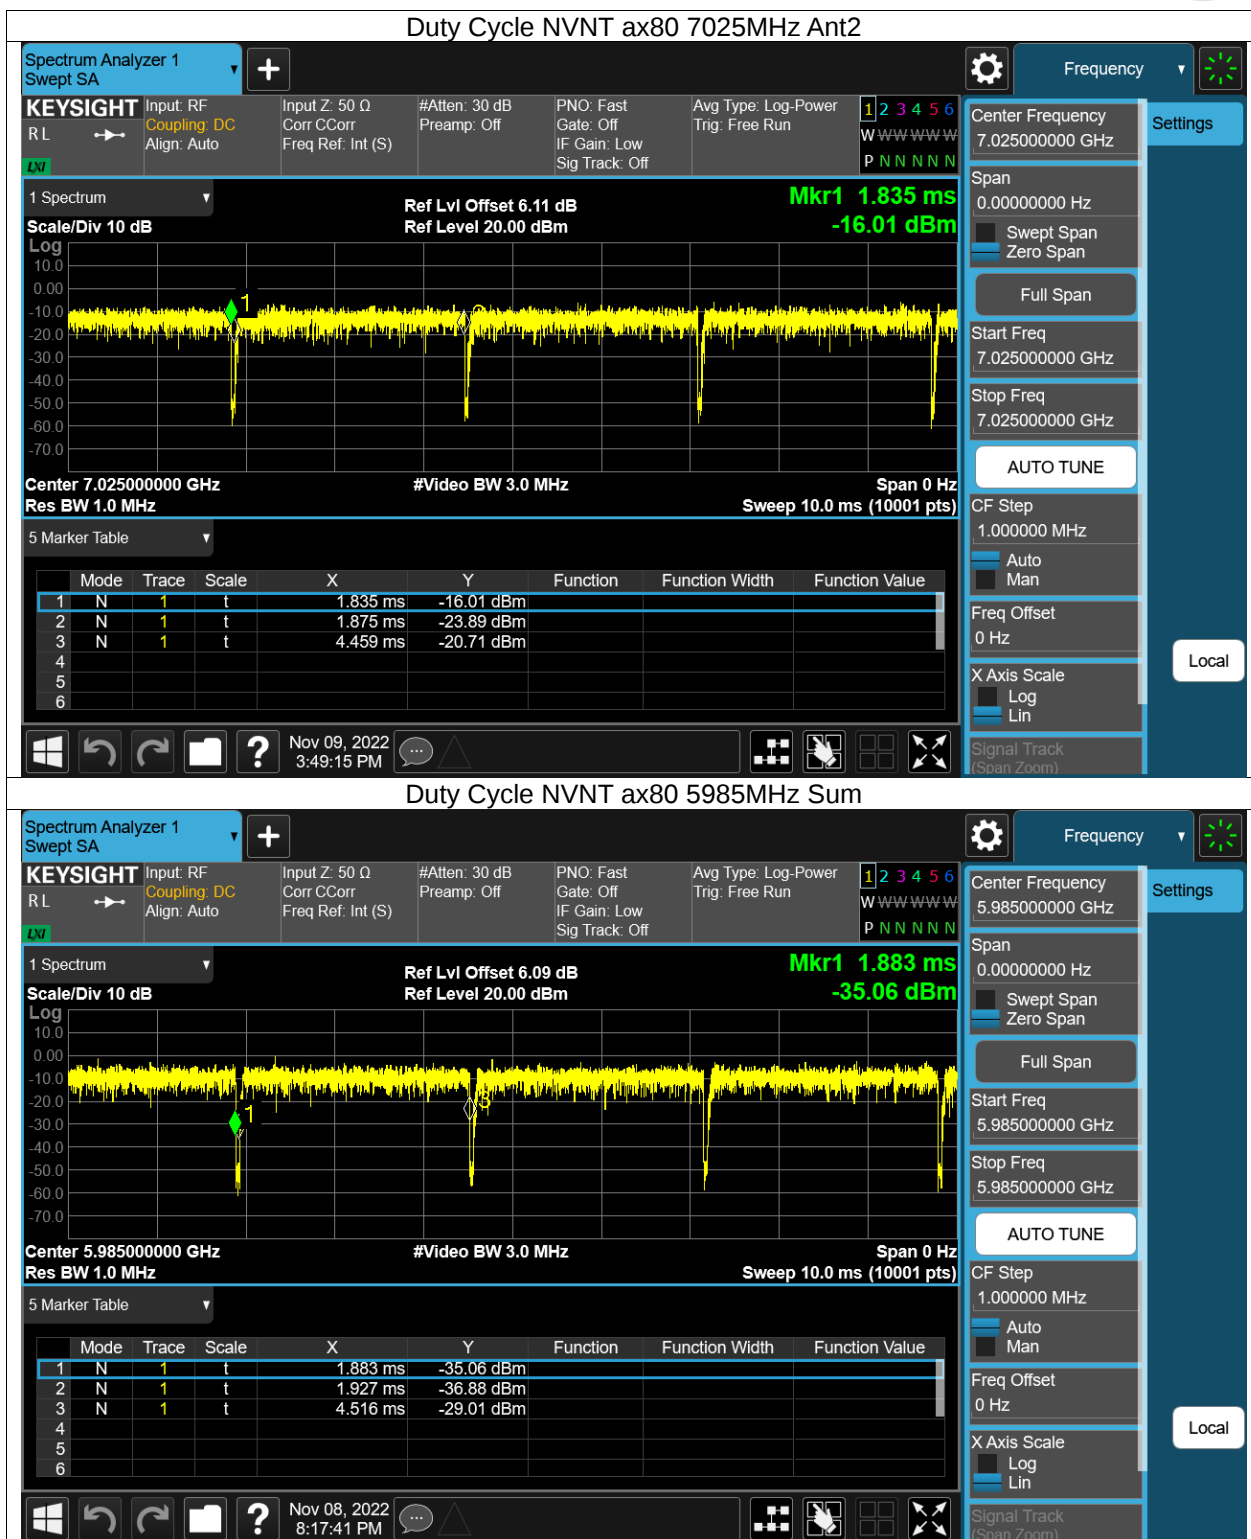


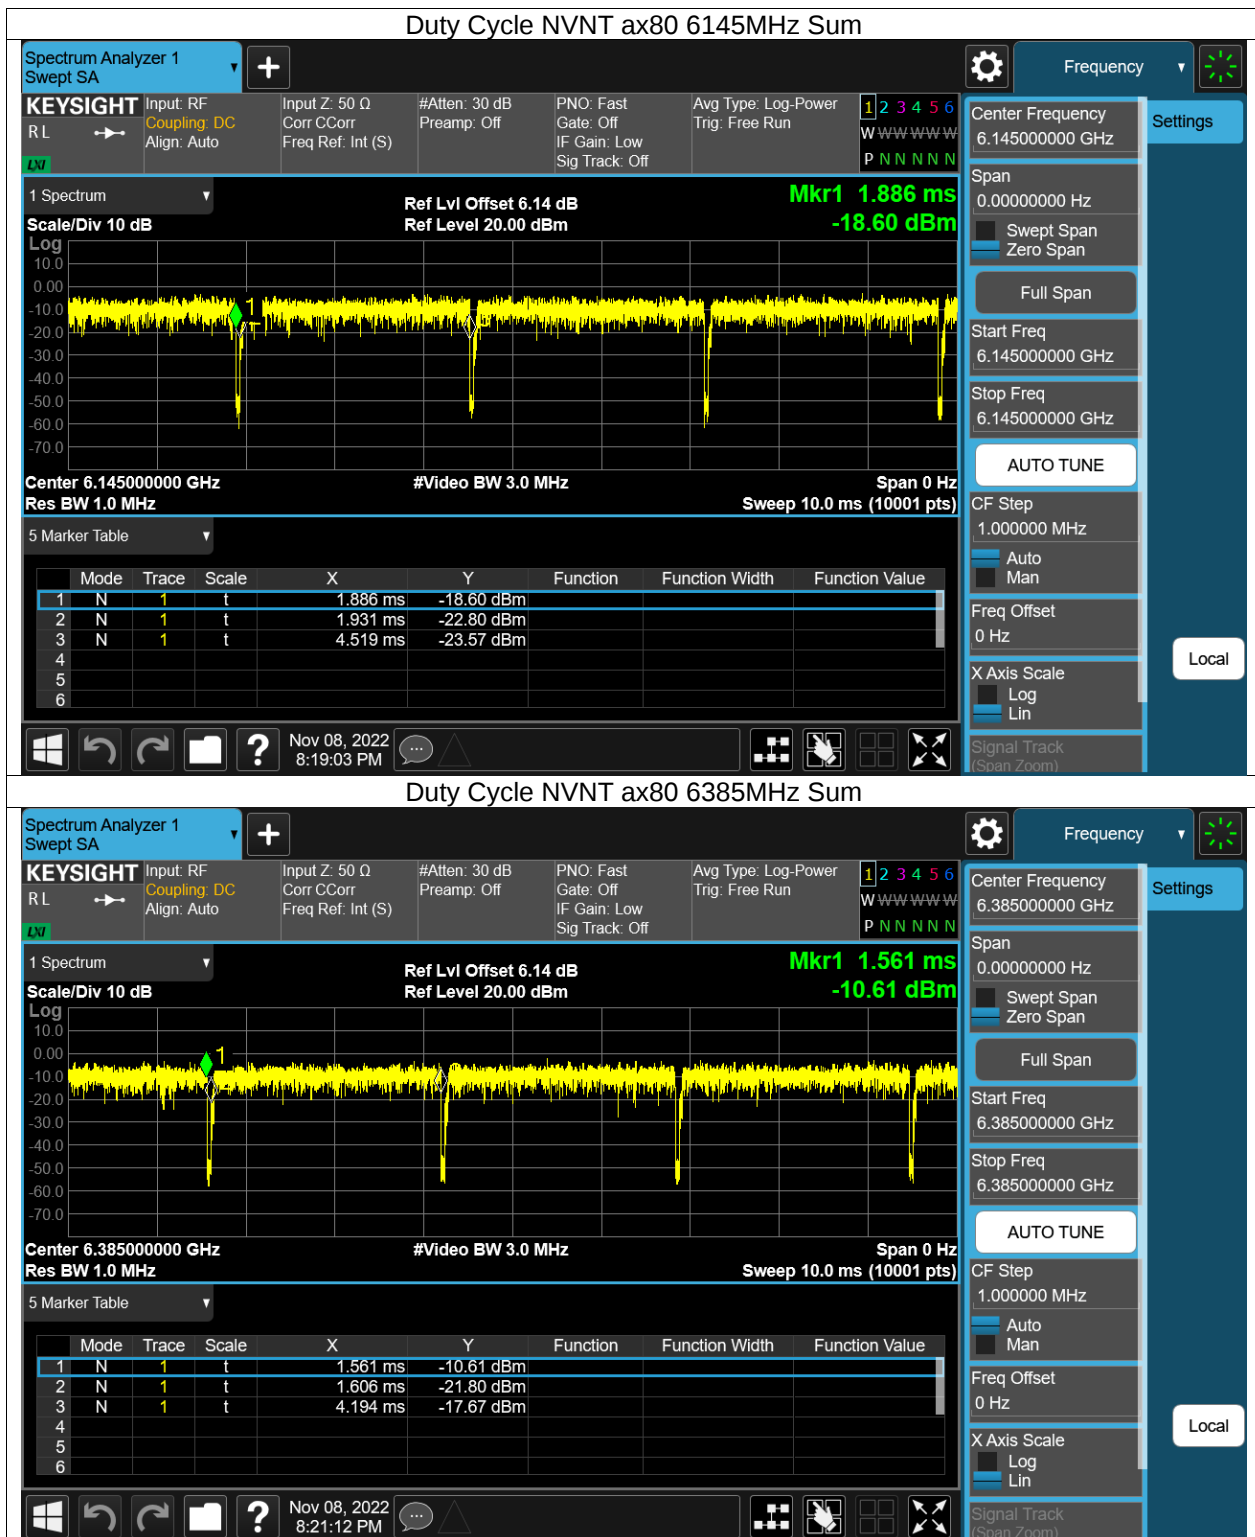

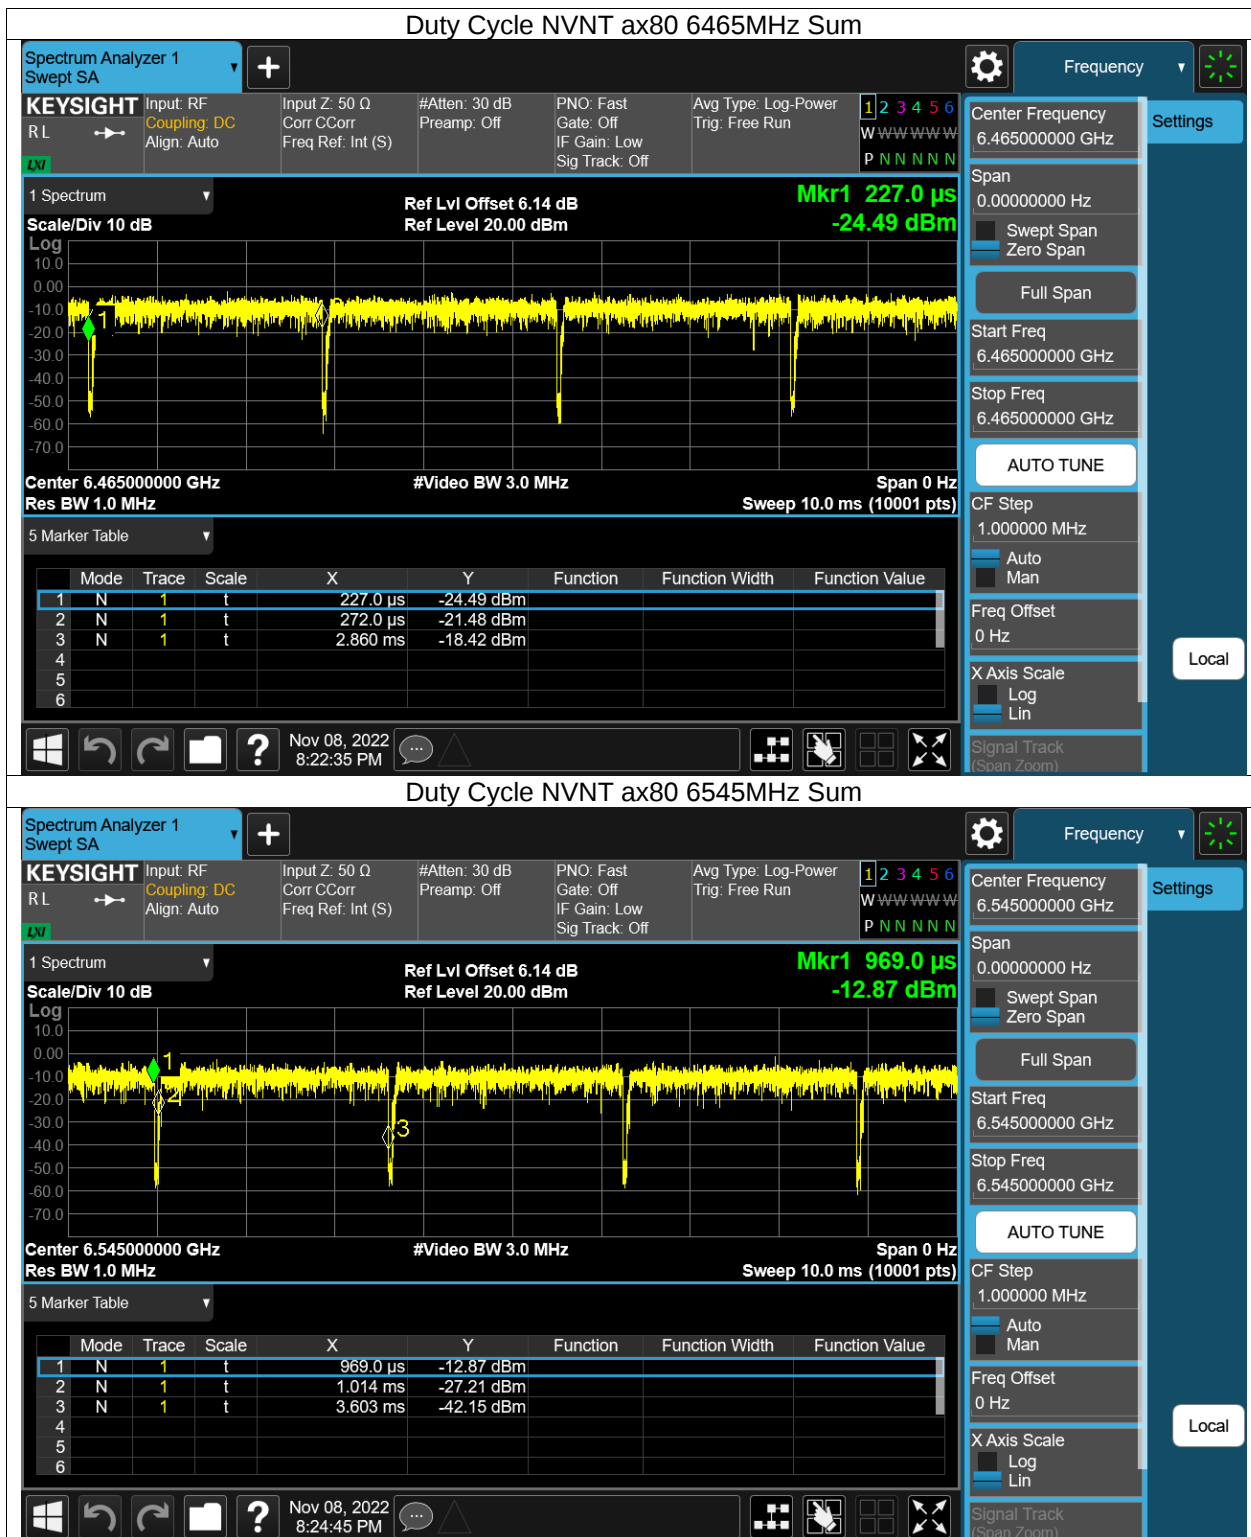

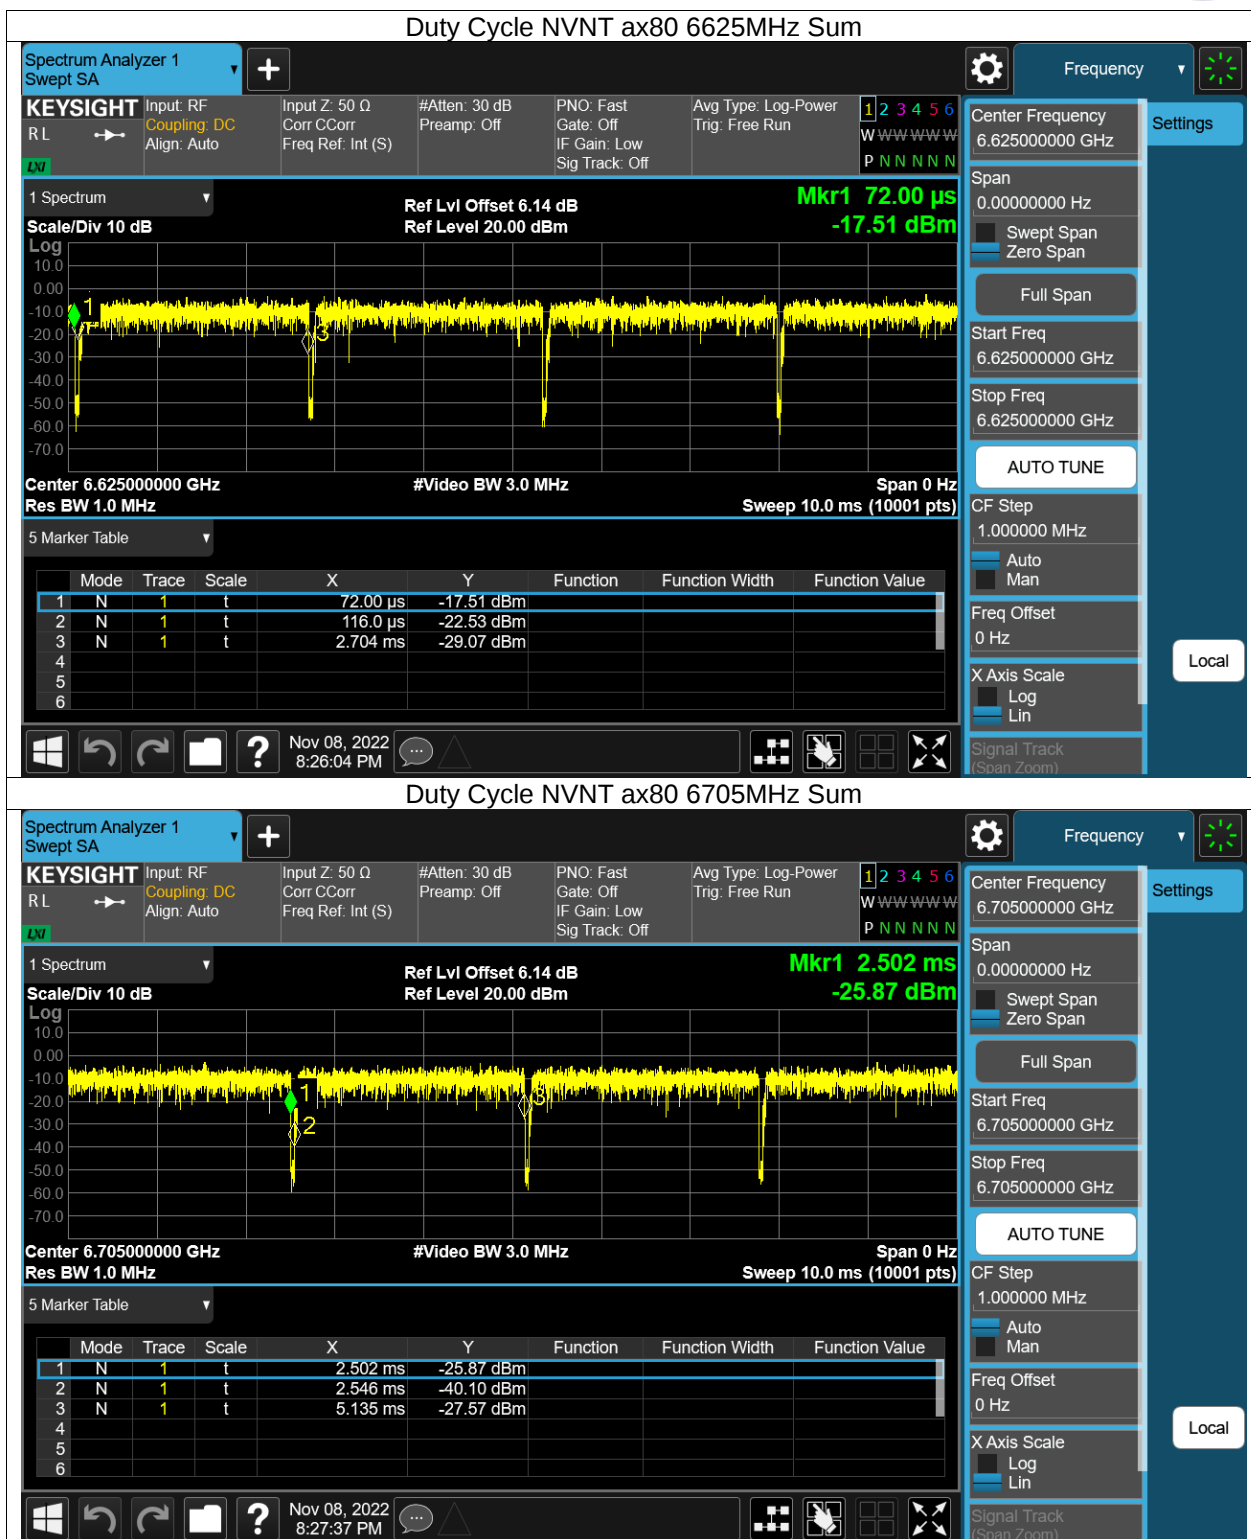

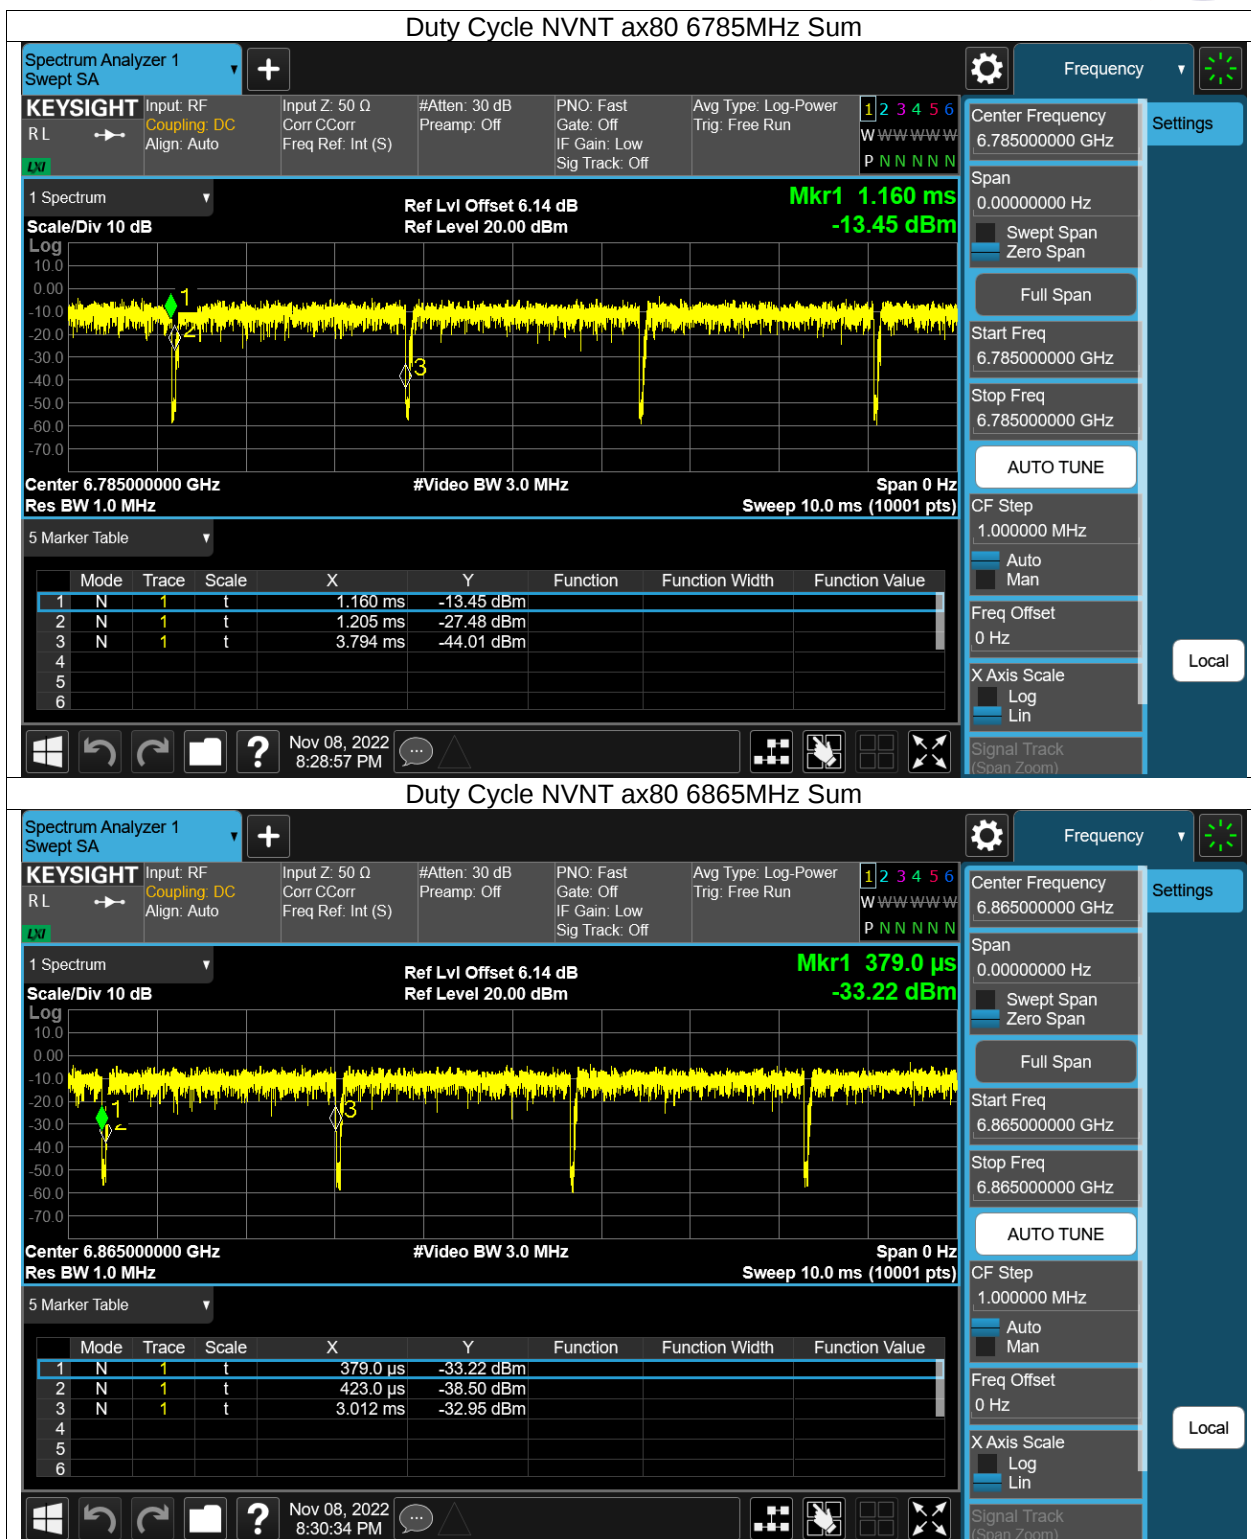

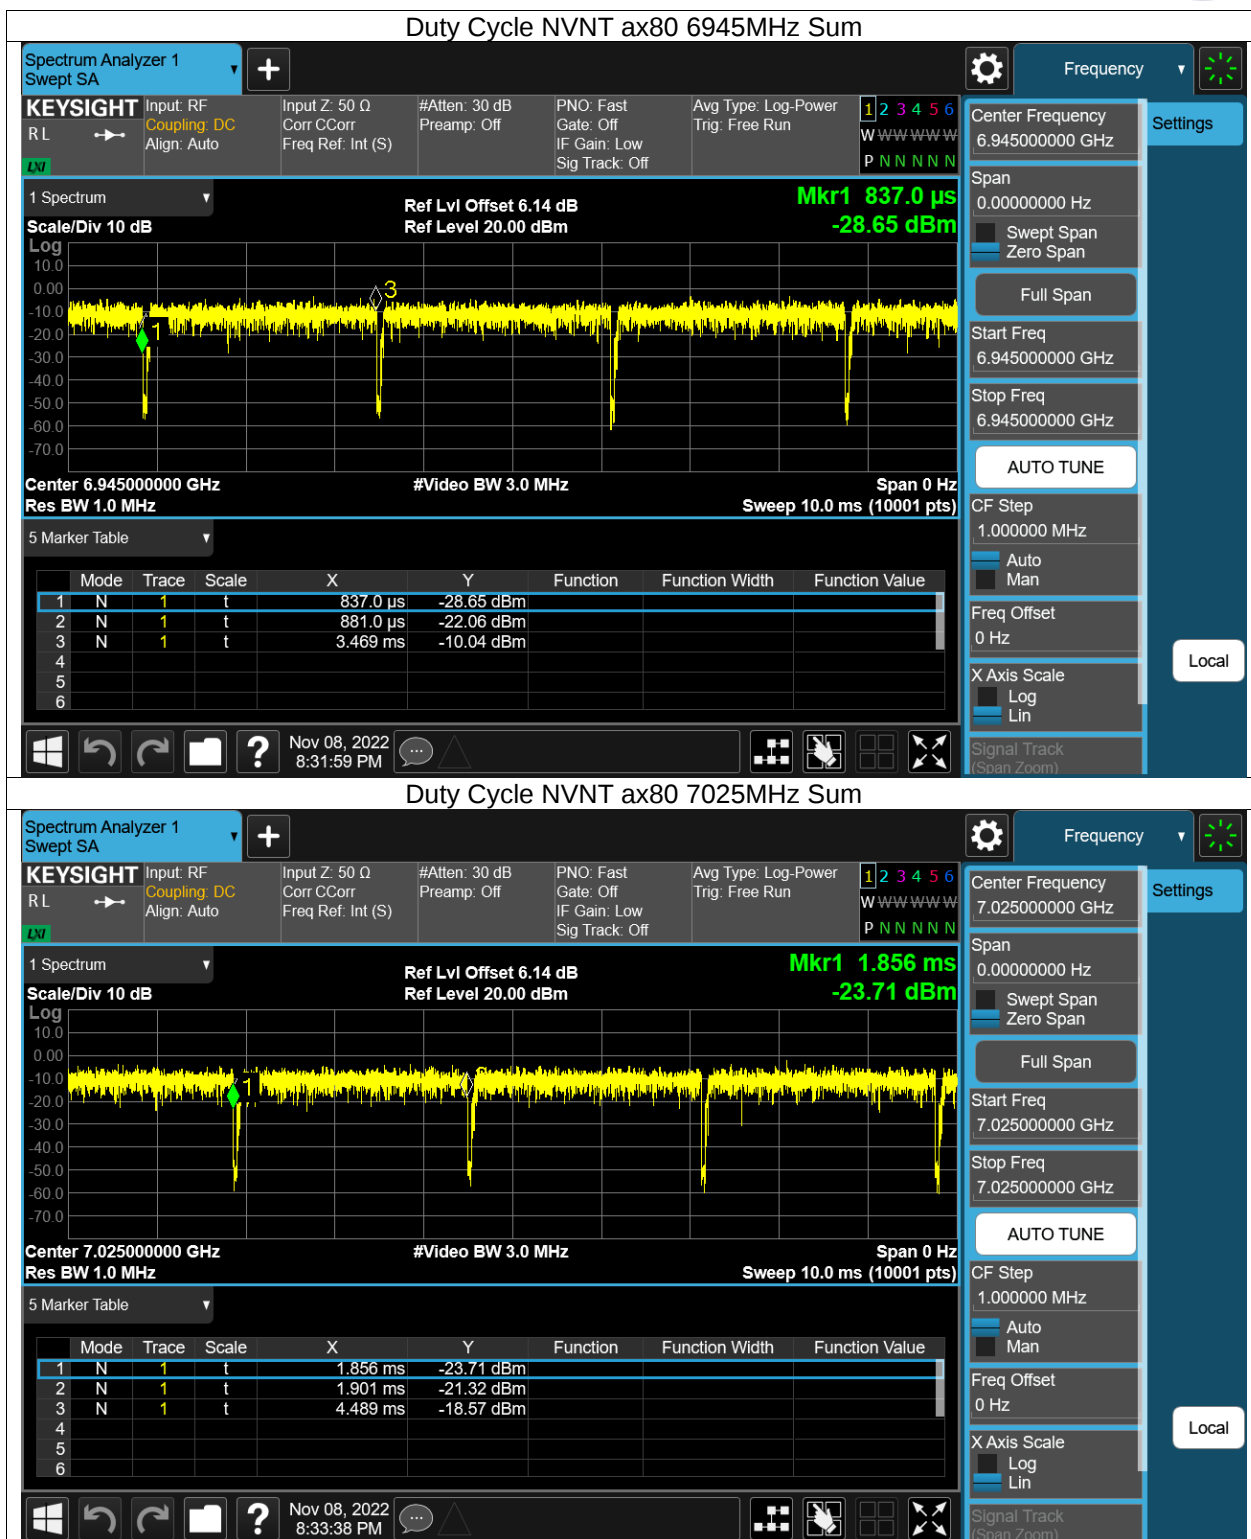



MAXIMUM CONDUCTED OUTPUT POWER

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Gain (dBi)	eirp Power	Limit (dBm)	Verdict
NVNT	ax160	6025	Ant1	13.49	0	13.49	2.22	15.71	24	Pass
NVNT	ax160	6185	Ant1	13.53	0	13.53	2.22	15.75	24	Pass
NVNT	ax160	6345	Ant1	13.78	0	13.78	2.22	16.00	24	Pass
NVNT	ax160	6505	Ant1	13.64	0	13.64	2.22	15.86	24	Pass
NVNT	ax160	6665	Ant1	12.67	0	12.67	2.22	14.89	24	Pass
NVNT	ax160	6825	Ant1	12.3	0	12.3	2.22	14.52	24	Pass
NVNT	ax160	6985	Ant1	12.46	0	12.46	2.22	14.68	24	Pass
NVNT	ax160	6025	Ant2	12.49	0	12.49	2.22	14.71	24	Pass
NVNT	ax160	6185	Ant2	12.01	0	12.01	2.22	14.23	24	Pass
NVNT	ax160	6345	Ant2	12.17	0	12.17	2.22	14.39	24	Pass
NVNT	ax160	6505	Ant2	11.7	0	11.7	2.22	13.92	24	Pass
NVNT	ax160	6665	Ant2	10.64	0	10.64	2.22	12.86	24	Pass
NVNT	ax160	6825	Ant2	9.95	0	9.95	2.22	12.17	24	Pass
NVNT	ax160	6985	Ant2	8.24	0	8.24	2.22	10.46	24	Pass
NVNT	ax160	6025	Ant1	10.21	0	10.21	2.22	12.43	24	Pass
NVNT	ax160	6025	Ant2	8.79	0	8.79	2.22	11.01	24	Pass
NVNT	ax160	6025	Sum					14.79	24	Pass
NVNT	ax160	6185	Ant1	10.21	0	10.21	2.22	12.43	24	Pass
NVNT	ax160	6185	Ant2	9.12	0	9.12	2.22	11.34	24	Pass
NVNT	ax160	6185	Sum					14.93	24	Pass
NVNT	ax160	6345	Ant1	10.47	0	10.47	2.22	12.69	24	Pass
NVNT	ax160	6345	Ant2	8.96	0	8.96	2.22	11.18	24	Pass
NVNT	ax160	6345	Sum					15.01	24	Pass
NVNT	ax160	6505	Ant1	10.46	0	10.46	2.22	12.68	24	Pass
NVNT	ax160	6505	Ant2	9.35	0	9.35	2.22	11.57	24	Pass
NVNT	ax160	6505	Sum					15.17	24	Pass
NVNT	ax160	6665	Ant1	9.32	0	9.32	2.22	11.54	24	Pass
NVNT	ax160	6665	Ant2	8.12	0	8.12	2.22	10.34	24	Pass
NVNT	ax160	6665	Sum					13.99	24	Pass
NVNT	ax160	6825	Ant1	8.89	0	8.89	2.22	11.11	24	Pass
NVNT	ax160	6825	Ant2	8.28	0	8.28	2.22	10.50	24	Pass
NVNT	ax160	6825	Sum					13.83	24	Pass
NVNT	ax160	6985	Ant1	9.2	0	9.2	2.22	11.42	24	Pass
NVNT	ax160	6985	Ant2	8.11	0	8.11	2.22	10.33	24	Pass
NVNT	ax160	6985	Sum					13.92	24	Pass
NVNT	ax20	5955	Ant1	4.31	0	4.31	2.22	6.53	24	Pass
NVNT	ax20	6175	Ant1	4.31	0	4.31	2.22	6.53	24	Pass
NVNT	ax20	6415	Ant1	4.73	0	4.73	2.22	6.95	24	Pass
NVNT	ax20	6435	Ant1	4.76	0	4.76	2.22	6.98	24	Pass
NVNT	ax20	6475	Ant1	4.82	0	4.82	2.22	7.04	24	Pass
NVNT	ax20	6515	Ant1	4.73	0	4.73	2.22	6.95	24	Pass
NVNT	ax20	6535	Ant1	3.82	0	3.82	2.22	6.04	24	Pass
NVNT	ax20	6695	Ant1	3.61	0	3.61	2.22	5.83	24	Pass
NVNT	ax20	6855	Ant1	2.88	0	2.88	2.22	5.10	24	Pass
NVNT	ax20	6895	Ant1	3.21	0	3.21	2.22	5.43	24	Pass
NVNT	ax20	7115	Ant1	-2.64	0	-2.64	2.22	-0.42	24	Pass
NVNT	ax20	5955	Ant2	1.43	0	1.43	2.22	3.65	24	Pass
NVNT	ax20	6175	Ant2	0.59	0	0.59	2.22	2.81	24	Pass
NVNT	ax20	6415	Ant2	1.77	0	1.77	2.22	3.99	24	Pass
NVNT	ax20	6435	Ant2	2.14	0	2.14	2.22	4.36	24	Pass
NVNT	ax20	6475	Ant2	2.58	0	2.58	2.22	4.80	24	Pass
NVNT	ax20	6515	Ant2	2.53	0	2.53	2.22	4.75	24	Pass
NVNT	ax20	6535	Ant2	1.33	0	1.33	2.22	3.55	24	Pass
NVNT	ax20	6695	Ant2	1.54	0	1.54	2.22	3.76	24	Pass
NVNT	ax20	6855	Ant2	1.7	0	1.7	2.22	3.92	24	Pass
NVNT	ax20	6895	Ant2	1.63	0	1.63	2.22	3.85	24	Pass
NVNT	ax20	7115	Ant2	-3.22	0	-3.22	2.22	-1.00	24	Pass
NVNT	ax20	5955	Ant1	1.7	0	1.7	2.22	3.92	24	Pass
NVNT	ax20	5955	Ant2	0.08	0	0.08	2.22	2.30	24	Pass
NVNT	ax20	5955	Sum					6.20	24	Pass
NVNT	ax20	6175	Ant1	1.64	0	1.64	2.22	3.86	24	Pass
NVNT	ax20	6175	Ant2	0.04	0	0.04	2.22	2.26	24	Pass
NVNT	ax20	6175	Sum					6.14	24	Pass



NVNT	ax20	6415	Ant1	1.85	0	1.85	2.22	4.07	24	Pass
NVNT	ax20	6415	Ant2	0.29	0	0.29	2.22	2.51	24	Pass
NVNT	ax20	6415	Sum					6.37	24	Pass
NVNT	ax20	6435	Ant1	1.79	0	1.79	2.22	4.01	24	Pass
NVNT	ax20	6435	Ant2	0.56	0	0.56	2.22	2.78	24	Pass
NVNT	ax20	6435	Sum					6.45	24	Pass
NVNT	ax20	6475	Ant1	1.93	0	1.93	2.22	4.15	24	Pass
NVNT	ax20	6475	Ant2	0.59	0	0.59	2.22	2.81	24	Pass
NVNT	ax20	6475	Sum					6.54	24	Pass
NVNT	ax20	6515	Ant1	1.78	0	1.78	2.22	4.00	24	Pass
NVNT	ax20	6515	Ant2	0.4	0	0.4	2.22	2.62	24	Pass
NVNT	ax20	6515	Sum					6.37	24	Pass
NVNT	ax20	6535	Ant1	-1.5	0	-1.5	2.22	0.72	24	Pass
NVNT	ax20	6535	Ant2	-1.59	0	-1.59	2.22	0.63	24	Pass
NVNT	ax20	6535	Sum					3.69	24	Pass
NVNT	ax20	6695	Ant1	-1.36	0	-1.36	2.22	0.86	24	Pass
NVNT	ax20	6695	Ant2	-3.35	0	-3.35	2.22	-1.13	24	Pass
NVNT	ax20	6695	Sum					2.99	24	Pass
NVNT	ax20	6855	Ant1	-0.4	0	-0.4	2.22	1.82	24	Pass
NVNT	ax20	6855	Ant2	-2.52	0	-2.52	2.22	-0.30	24	Pass
NVNT	ax20	6855	Sum					3.90	24	Pass
NVNT	ax20	6895	Ant1	-0.83	0	-0.83	2.22	1.39	24	Pass
NVNT	ax20	6895	Ant2	-3.14	0	-3.14	2.22	-0.92	24	Pass
NVNT	ax20	6895	Sum				2.22	3.40	24	Pass
NVNT	ax20	7115	Ant1	-5.94	0	-5.94	2.22	-3.72	24	Pass
NVNT	ax20	7115	Ant2	-6.41	0	-6.41	2.22	-4.19	24	Pass
NVNT	ax20	7115	Sum					-0.94	24	Pass
NVNT	ax40	5965	Ant1	8.08	0	8.08	2.22	10.30	24	Pass
NVNT	ax40	6165	Ant1	7.86	0	7.86	2.22	10.08	24	Pass
NVNT	ax40	6405	Ant1	8.18	0	8.18	2.22	10.40	24	Pass
NVNT	ax40	6445	Ant1	8.16	0	8.16	2.22	10.38	24	Pass
NVNT	ax40	6485	Ant1	8.29	0	8.29	2.22	10.51	24	Pass
NVNT	ax40	6525	Ant1	8.17	0	8.17	2.22	10.39	24	Pass
NVNT	ax40	6565	Ant1	7.18	0	7.18	2.22	9.40	24	Pass
NVNT	ax40	6685	Ant1	6.8	0	6.8	2.22	9.02	24	Pass
NVNT	ax40	6845	Ant1	6.22	0	6.22	2.22	8.44	24	Pass
NVNT	ax40	6885	Ant1	6.28	0	6.28	2.22	8.50	24	Pass
NVNT	ax40	6925	Ant1	6.08	0	6.08	2.22	8.30	24	Pass
NVNT	ax40	6965	Ant1	6.54	0	6.54	2.22	8.76	24	Pass
NVNT	ax40	7085	Ant1	6.72	0	6.72	2.22	8.94	24	Pass
NVNT	ax40	5965	Ant2	4.84	0	4.84	2.22	7.06	24	Pass
NVNT	ax40	6165	Ant2	3.53	0	3.53	2.22	5.75	24	Pass
NVNT	ax40	6405	Ant2	4.38	0	4.38	2.22	6.60	24	Pass
NVNT	ax40	6445	Ant2	3	0	3	2.22	5.22	24	Pass
NVNT	ax40	6485	Ant2	3.6	0	3.6	2.22	5.82	24	Pass
NVNT	ax40	6525	Ant2	3.47	0	3.47	2.22	5.69	24	Pass
NVNT	ax40	6565	Ant2	2.54	0	2.54	2.22	4.76	24	Pass
NVNT	ax40	6685	Ant2	2.2	0	2.2	2.22	4.42	24	Pass
NVNT	ax40	6845	Ant2	3.5	0	3.5	2.22	5.72	24	Pass
NVNT	ax40	6885	Ant2	3.58	0	3.58	2.22	5.80	24	Pass
NVNT	ax40	6925	Ant2	2.95	0	2.95	2.22	5.17	24	Pass
NVNT	ax40	6965	Ant2	2.57	0	2.57	2.22	4.79	24	Pass
NVNT	ax40	7085	Ant2	0.99	0	0.99	2.22	3.21	24	Pass
NVNT	ax40	5965	Ant1	4.87	0	4.87	2.22	7.09	24	Pass
NVNT	ax40	5965	Ant2	3.62	0	3.62	2.22	5.84	24	Pass
NVNT	ax40	5965	Sum					9.52	24	Pass
NVNT	ax40	6165	Ant1	4.52	0	4.52	2.22	6.74	24	Pass
NVNT	ax40	6165	Ant2	3.29	0	3.29	2.22	5.51	24	Pass
NVNT	ax40	6165	Sum					9.18	24	Pass
NVNT	ax40	6405	Ant1	4.79	0	4.79	2.22	7.01	24	Pass
NVNT	ax40	6405	Ant2	3.38	0	3.38	2.22	5.60	24	Pass
NVNT	ax40	6405	Sum					9.37	24	Pass
NVNT	ax40	6445	Ant1	4.8	0	4.8	2.22	7.02	24	Pass
NVNT	ax40	6445	Ant2	3.9	0	3.9	2.22	6.12	24	Pass
NVNT	ax40	6445	Sum					9.60	24	Pass
NVNT	ax40	6485	Ant1	4.92	0	4.92	2.22	7.14	24	Pass
NVNT	ax40	6485	Ant2	3.86	0	3.86	2.22	6.08	24	Pass
NVNT	ax40	6485	Sum					9.65	24	Pass



NVNT	ax40	6525	Ant1	4.84	0	4.84	2.22	7.06	24	Pass
NVNT	ax40	6525	Ant2	3.53	0	3.53	2.22	5.75	24	Pass
NVNT	ax40	6525	Sum					9.46	24	Pass
NVNT	ax40	6565	Ant1	4.11	0	4.11	2.22	6.33	24	Pass
NVNT	ax40	6565	Ant2	2.62	0	2.62	2.22	4.84	24	Pass
NVNT	ax40	6565	Sum					8.66	24	Pass
NVNT	ax40	6685	Ant1	3.65	0	3.65	2.22	5.87	24	Pass
NVNT	ax40	6685	Ant2	2.36	0	2.36	2.22	4.58	24	Pass
NVNT	ax40	6685	Sum					8.28	24	Pass
NVNT	ax40	6845	Ant1	2.91	0	2.91	2.22	5.13	24	Pass
NVNT	ax40	6845	Ant2	1.97	0	1.97	2.22	4.19	24	Pass
NVNT	ax40	6845	Sum					7.70	24	Pass
NVNT	ax40	6885	Ant1	2.97	0	2.97	2.22	5.19	24	Pass
NVNT	ax40	6885	Ant2	1.88	0	1.88	2.22	4.10	24	Pass
NVNT	ax40	6885	Sum					7.69	24	Pass
NVNT	ax40	6925	Ant1	3.07	0	3.07	2.22	5.29	24	Pass
NVNT	ax40	6925	Ant2	1.55	0	1.55	2.22	3.77	24	Pass
NVNT	ax40	6925	Sum					7.61	24	Pass
NVNT	ax40	6965	Ant1	3.62	0	3.62	2.22	5.84	24	Pass
NVNT	ax40	6965	Ant2	1.88	0	1.88	2.22	4.10	24	Pass
NVNT	ax40	6965	Sum					8.07	24	Pass
NVNT	ax40	7085	Ant1	3.79	0	3.79	2.22	6.01	24	Pass
NVNT	ax40	7085	Ant2	2.58	0	2.58	2.22	4.80	24	Pass
NVNT	ax40	7085	Sum					8.46	24	Pass
NVNT	ax80	5985	Ant1	10.54	0	10.54	2.22	12.76	24	Pass
NVNT	ax80	6145	Ant1	10.41	0	10.41	2.22	12.63	24	Pass
NVNT	ax80	6385	Ant1	10.65	0	10.65	2.22	12.87	24	Pass
NVNT	ax80	6465	Ant1	10.67	0	10.67	2.22	12.89	24	Pass
NVNT	ax80	6545	Ant1	10.51	0	10.51	2.22	12.73	24	Pass
NVNT	ax80	6625	Ant1	9.3	0	9.3	2.22	11.52	24	Pass
NVNT	ax80	6705	Ant1	9.06	0	9.06	2.22	11.28	24	Pass
NVNT	ax80	6785	Ant1	8.7	0	8.7	2.22	10.92	24	Pass
NVNT	ax80	6865	Ant1	8.61	0	8.61	2.22	10.83	24	Pass
NVNT	ax80	6945	Ant1	8.77	0	8.77	2.22	10.99	24	Pass
NVNT	ax80	7025	Ant1	8.98	0	8.98	2.22	11.20	24	Pass
NVNT	ax80	5985	Ant2	9.25	0	9.25	2.22	11.47	24	Pass
NVNT	ax80	6145	Ant2	8.5	0	8.5	2.22	10.72	24	Pass
NVNT	ax80	6385	Ant2	8.73	0	8.73	2.22	10.95	24	Pass
NVNT	ax80	6465	Ant2	8.67	0	8.67	2.22	10.89	24	Pass
NVNT	ax80	6545	Ant2	8.47	0	8.47	2.22	10.69	24	Pass
NVNT	ax80	6625	Ant2	7.5	0	7.5	2.22	9.72	24	Pass
NVNT	ax80	6705	Ant2	6.64	0	6.64	2.22	8.86	24	Pass
NVNT	ax80	6785	Ant2	5.96	0	5.96	2.22	8.18	24	Pass
NVNT	ax80	6865	Ant2	6.17	0	6.17	2.22	8.39	24	Pass
NVNT	ax80	6945	Ant2	8.29	0	8.29	2.22	10.51	24	Pass
NVNT	ax80	7025	Ant2	4.09	0	4.09	2.22	6.31	24	Pass
NVNT	ax80	5985	Ant1	7.24	0	7.24	2.22	9.46	24	Pass
NVNT	ax80	5985	Ant2	5.76	0	5.76	2.22	7.98	24	Pass
NVNT	ax80	5985	Sum					11.79	24	Pass
NVNT	ax80	6145	Ant1	6.97	0	6.97	2.22	9.19	24	Pass
NVNT	ax80	6145	Ant2	5.73	0	5.73	2.22	7.95	24	Pass
NVNT	ax80	6145	Sum					11.62	24	Pass
NVNT	ax80	6385	Ant1	7.2	0	7.2	2.22	9.42	24	Pass
NVNT	ax80	6385	Ant2	5.74	0	5.74	2.22	7.96	24	Pass
NVNT	ax80	6385	Sum					11.76	24	Pass
NVNT	ax80	6465	Ant1	7.38	0	7.38	2.22	9.60	24	Pass
NVNT	ax80	6465	Ant2	6.39	0	6.39	2.22	8.61	24	Pass
NVNT	ax80	6465	Sum					12.14	24	Pass
NVNT	ax80	6545	Ant1	7.26	0	7.26	2.22	9.48	24	Pass
NVNT	ax80	6545	Ant2	5.86	0	5.86	2.22	8.08	24	Pass
NVNT	ax80	6545	Sum					11.85	24	Pass
NVNT	ax80	6625	Ant1	6.45	0	6.45	2.22	8.67	24	Pass
NVNT	ax80	6625	Ant2	4.66	0	4.66	2.22	6.88	24	Pass
NVNT	ax80	6625	Sum					10.88	24	Pass
NVNT	ax80	6705	Ant1	6.16	0	6.16	2.22	8.38	24	Pass
NVNT	ax80	6705	Ant2	4.78	0	4.78	2.22	7.00	24	Pass
NVNT	ax80	6705	Sum					10.75	24	Pass
NVNT	ax80	6785	Ant1	5.72	0	5.72	2.22	7.94	24	Pass



NVNT	ax80	6785	Ant2	4.71	0	4.71	2.22	6.93	24	Pass
NVNT	ax80	6785	Sum					10.47	24	Pass
NVNT	ax80	6865	Ant1	5.57	0	5.57	2.22	7.79	24	Pass
NVNT	ax80	6865	Ant2	4.57	0	4.57	2.22	6.79	24	Pass
NVNT	ax80	6865	Sum					10.33	24	Pass
NVNT	ax80	6945	Ant1	5.71	0	5.71	2.22	7.93	24	Pass
NVNT	ax80	6945	Ant2	4.36	0	4.36	2.22	6.58	24	Pass
NVNT	ax80	6945	Sum					10.32	24	Pass
NVNT	ax80	7025	Ant1	6.17	0	6.17	2.22	8.39	24	Pass
NVNT	ax80	7025	Ant2	4.76	0	4.76	2.22	6.98	24	Pass
NVNT	ax80	7025	Sum					10.75	24	Pass



