






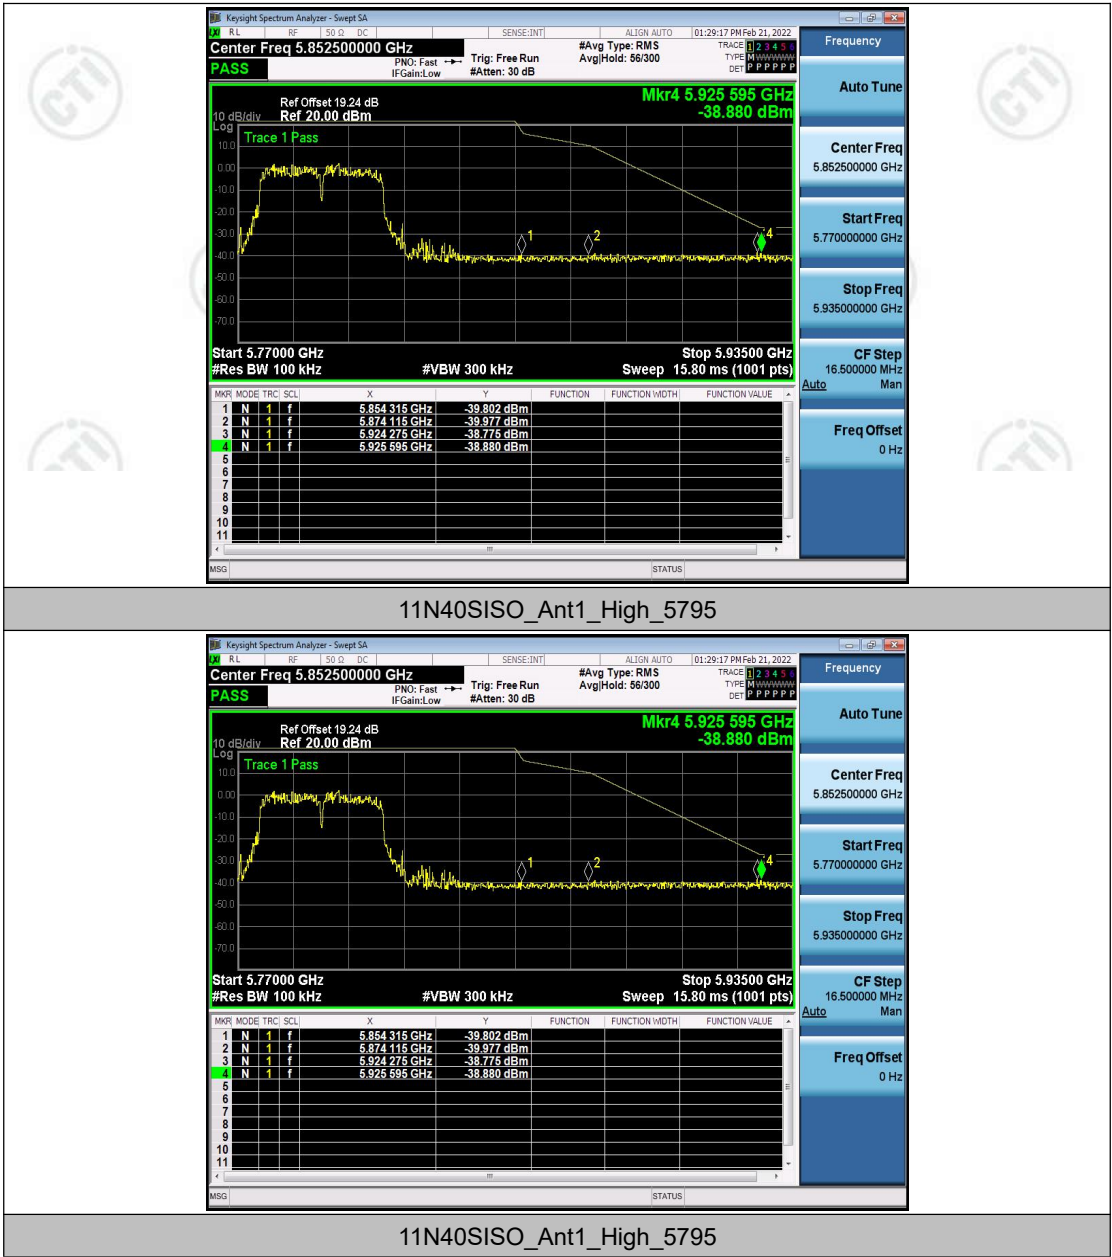


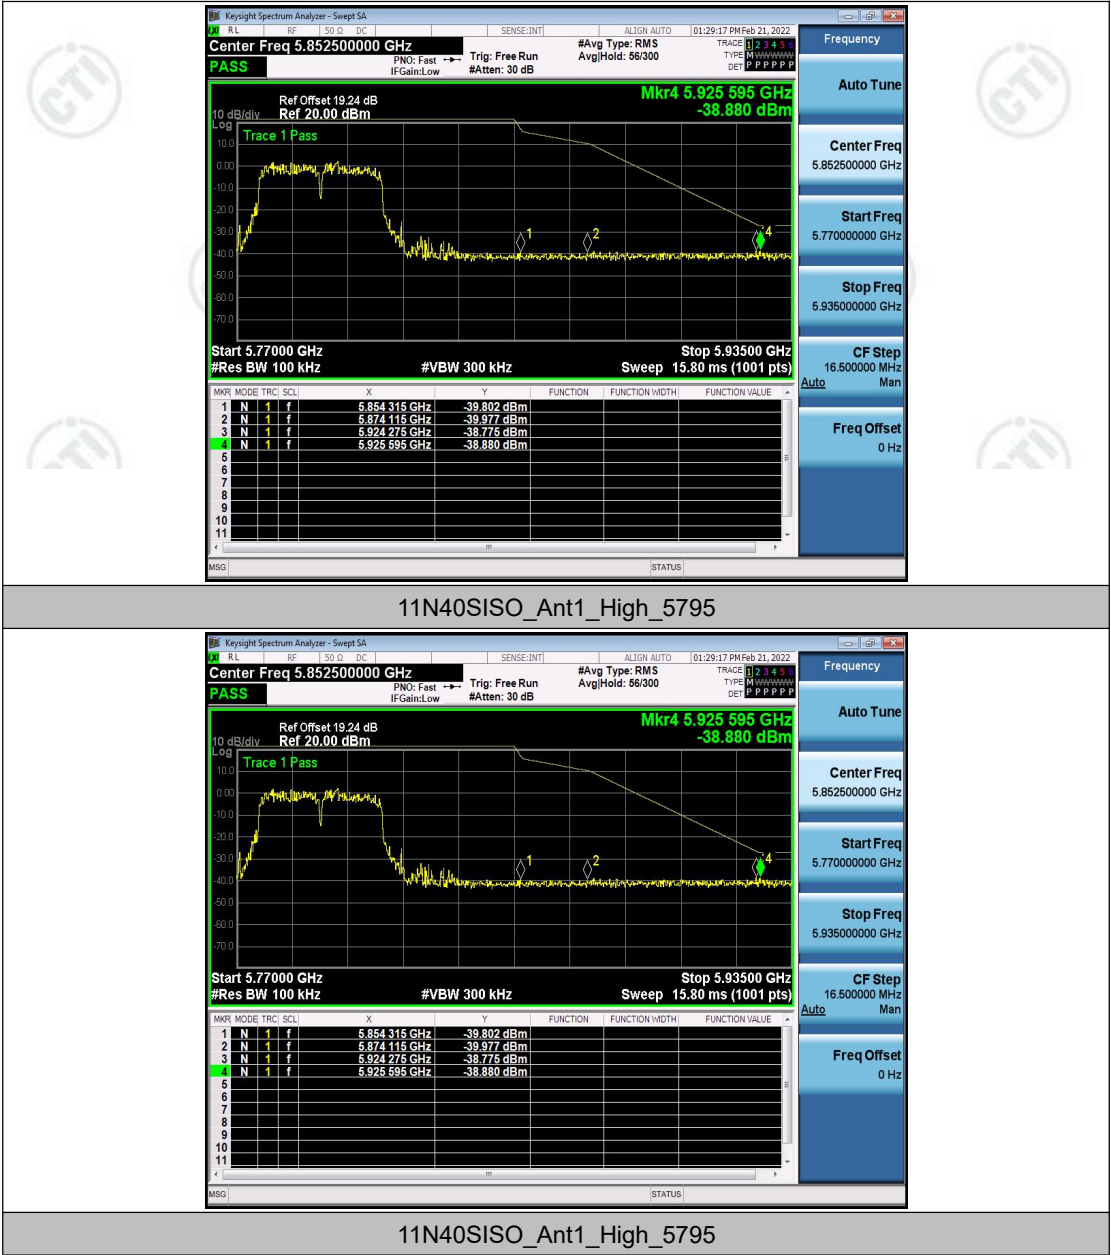


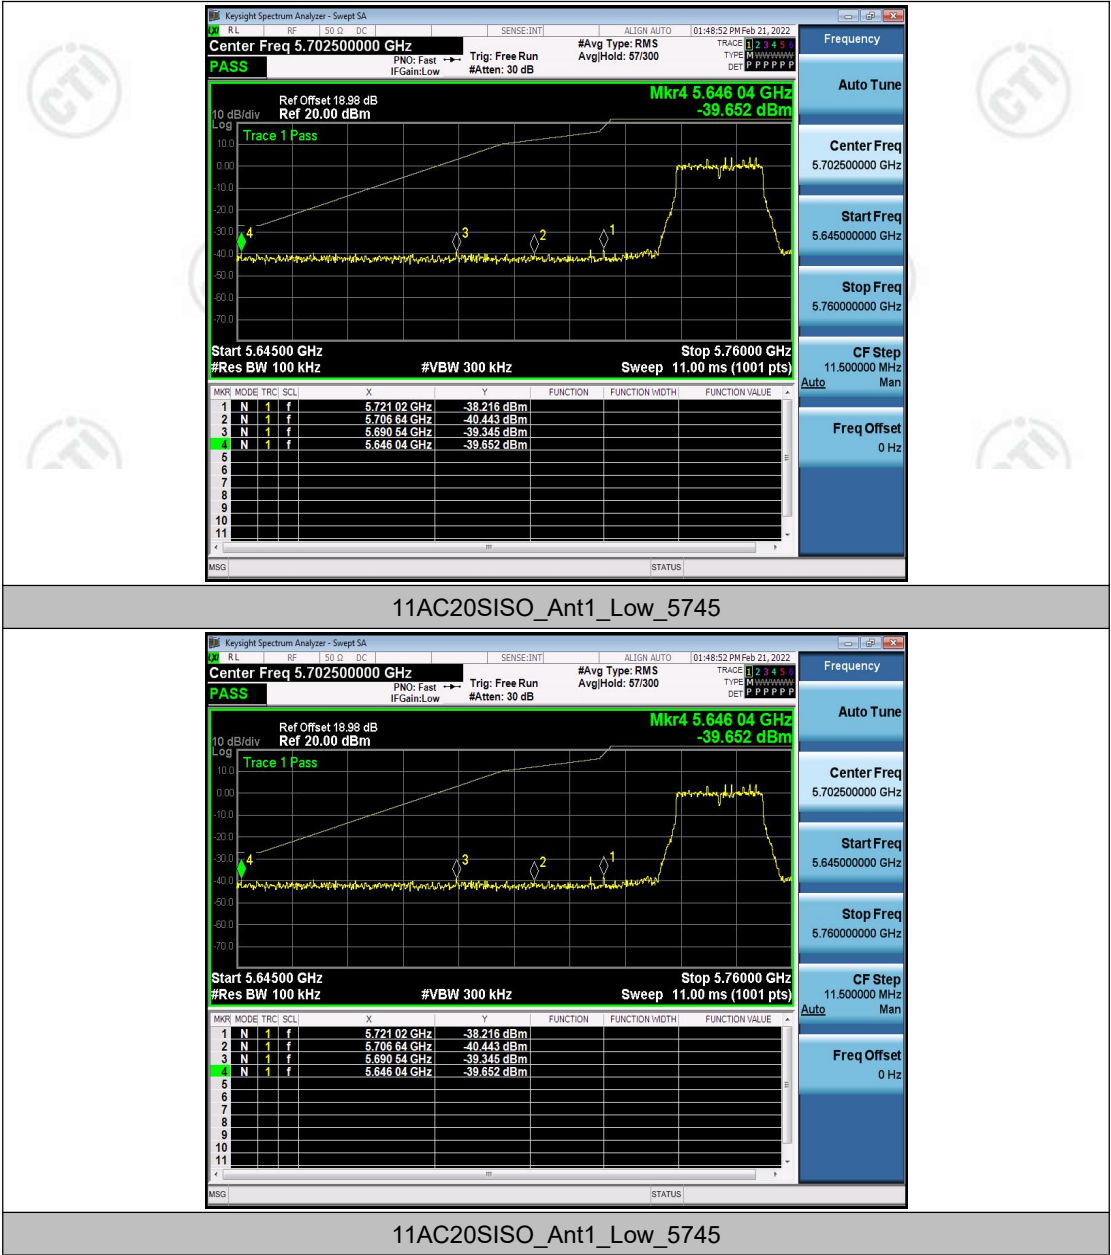


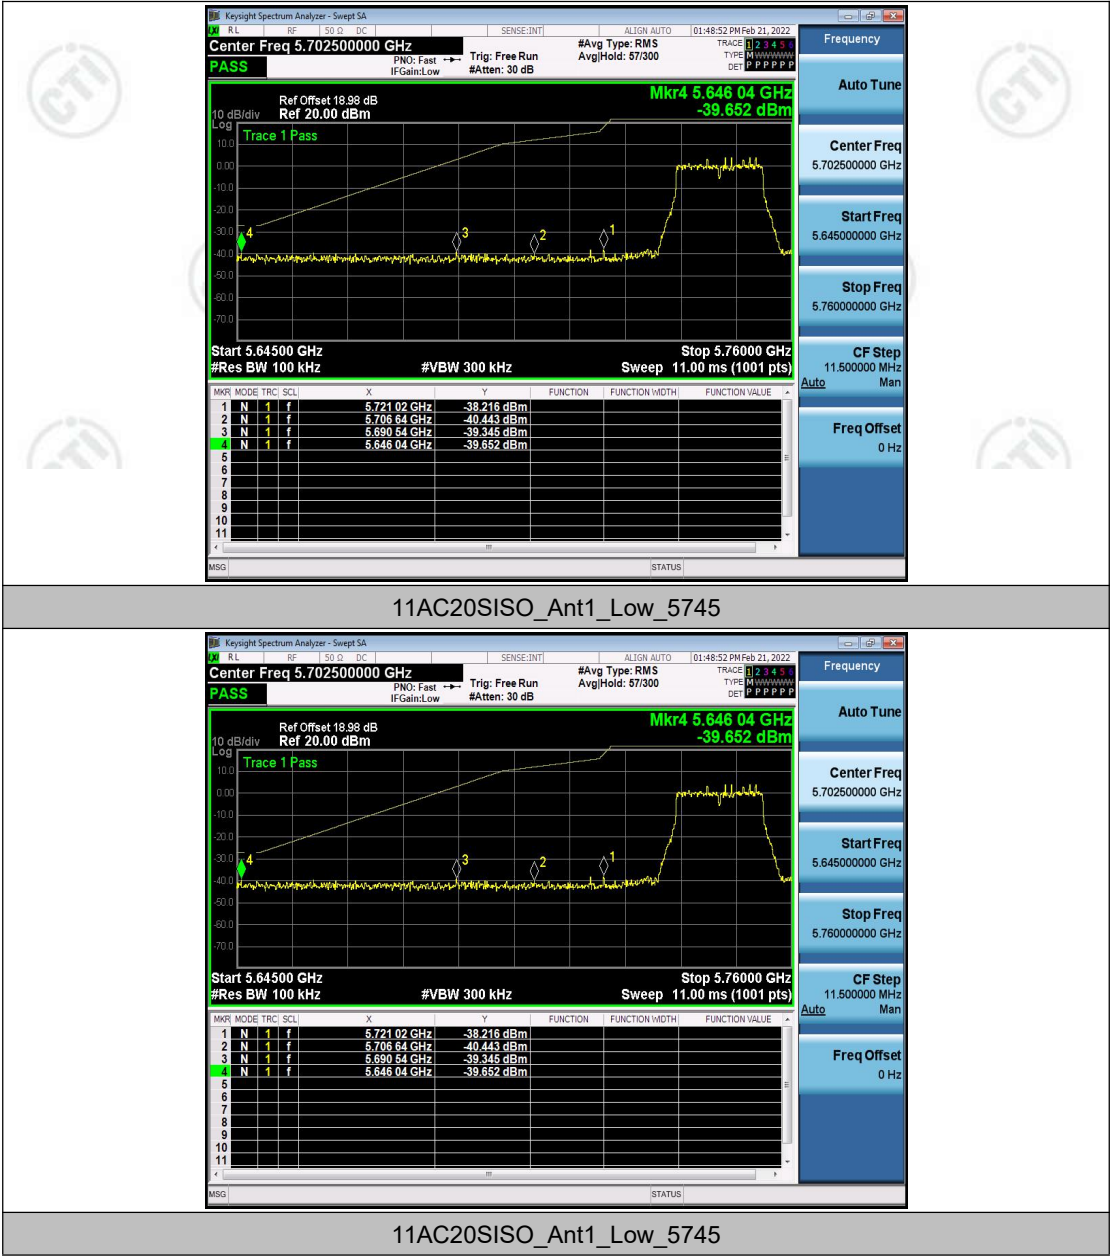


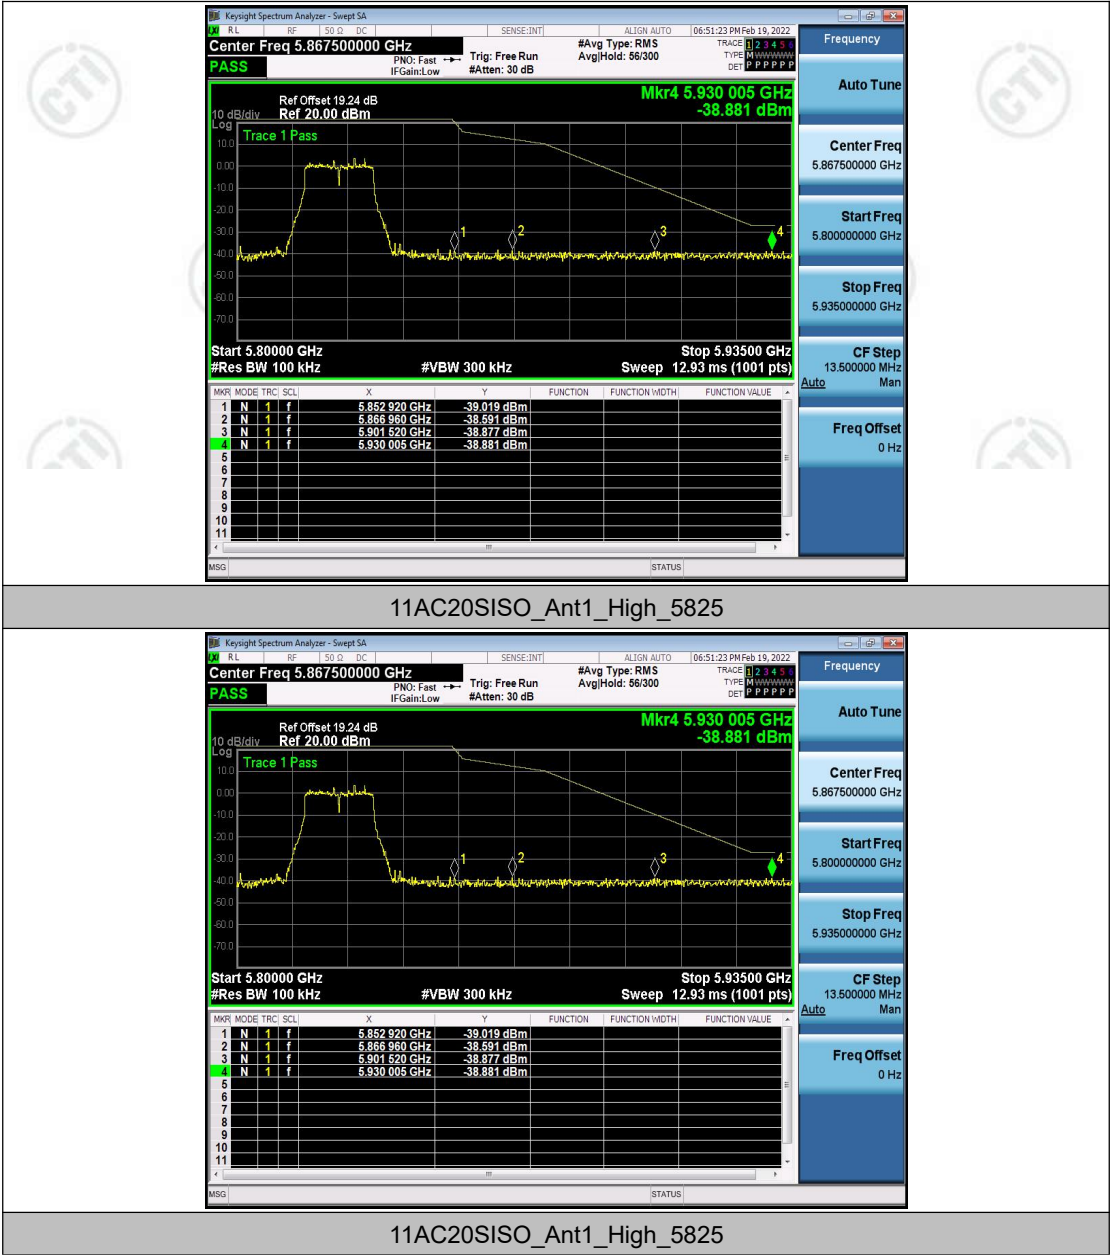


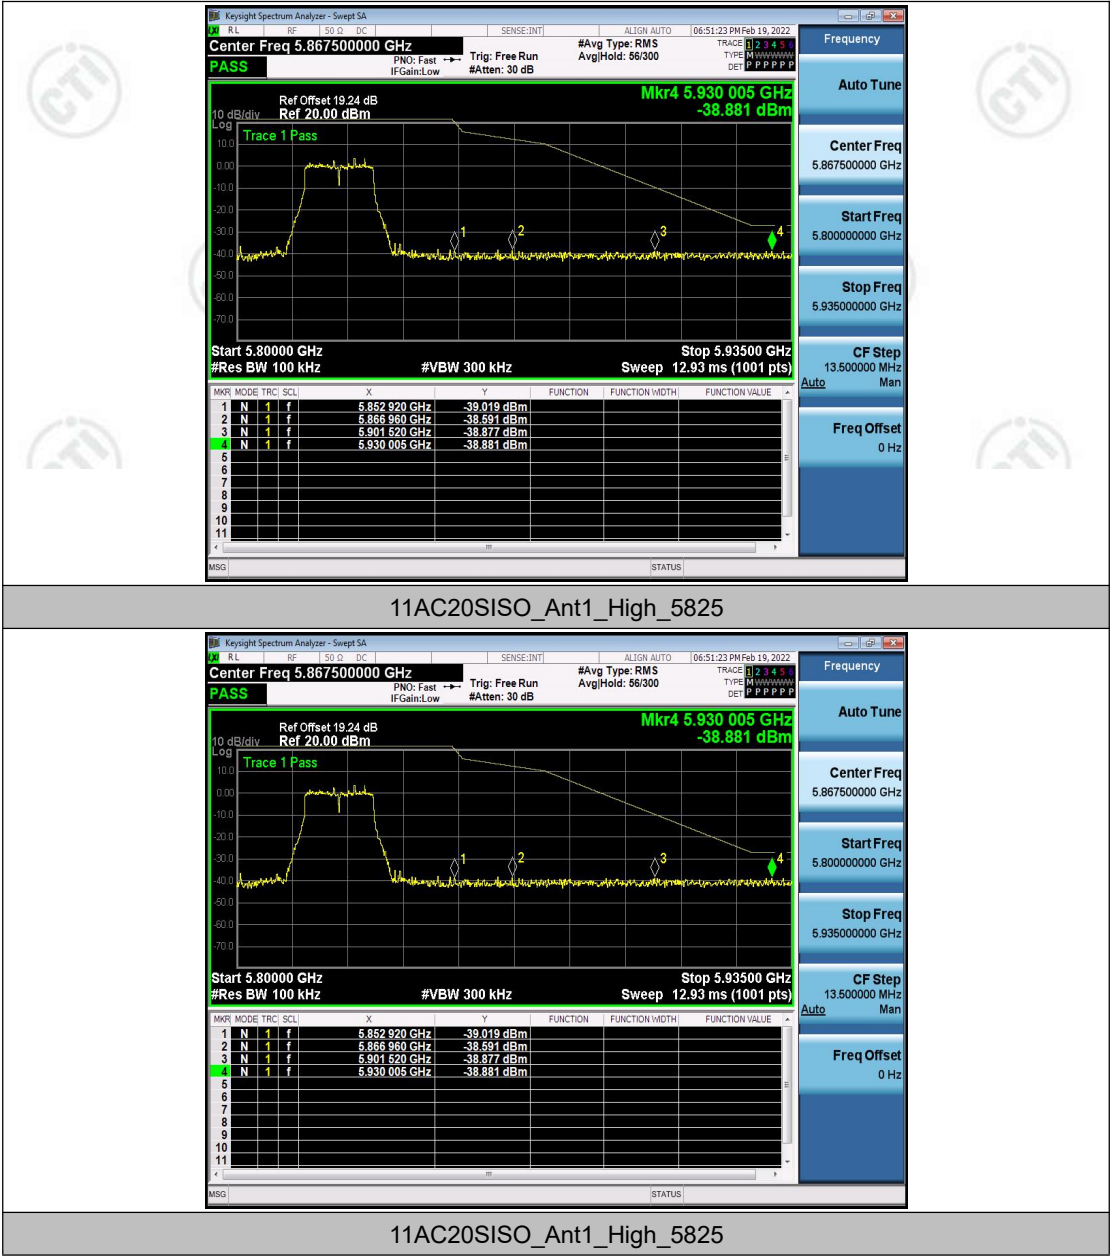


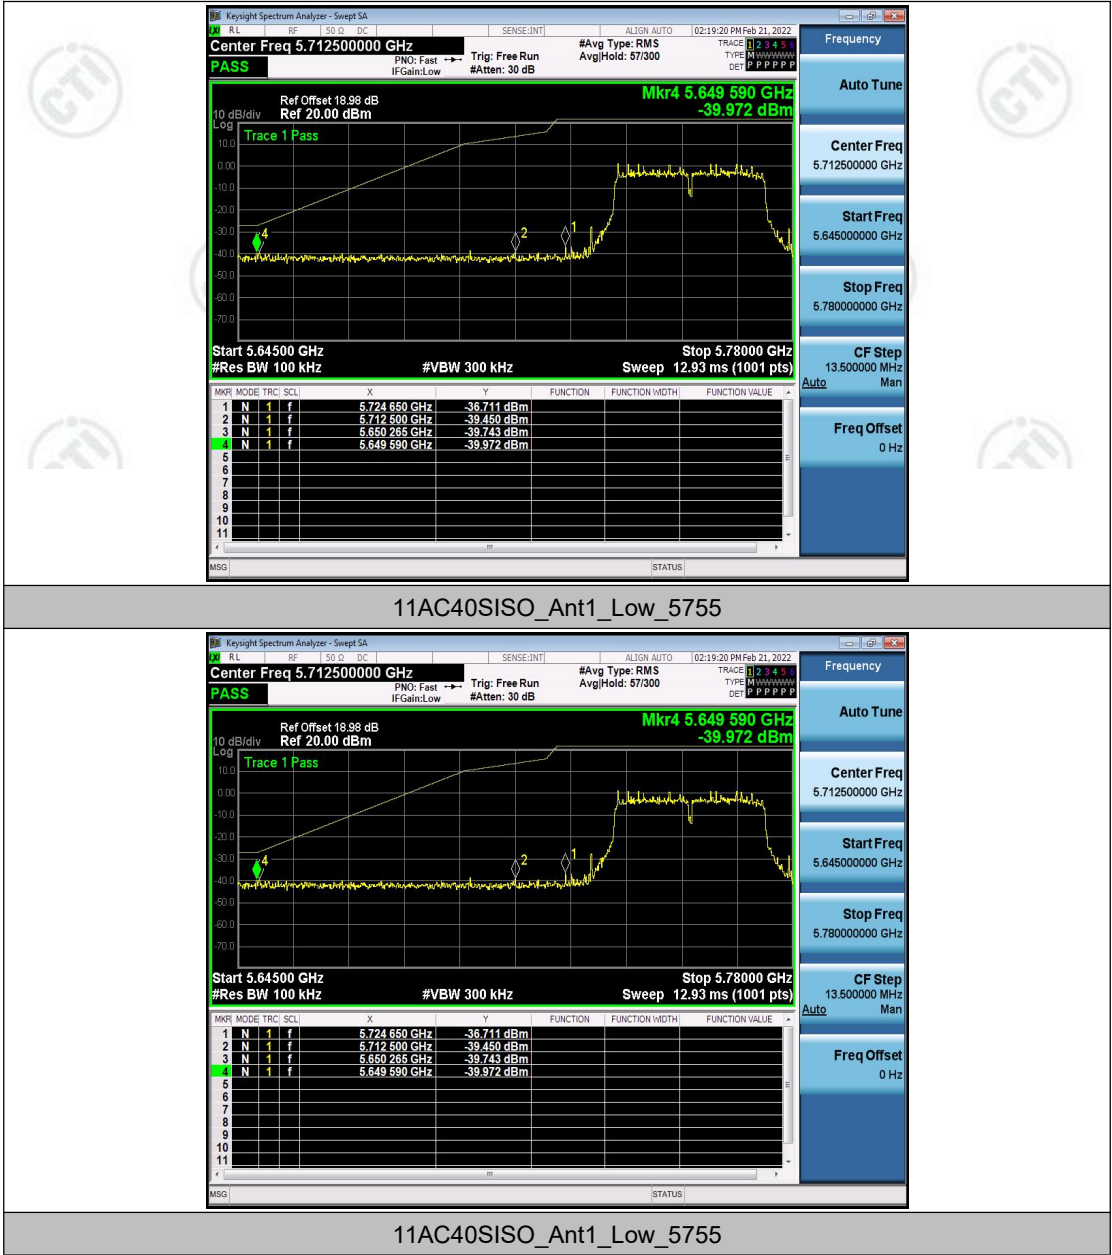


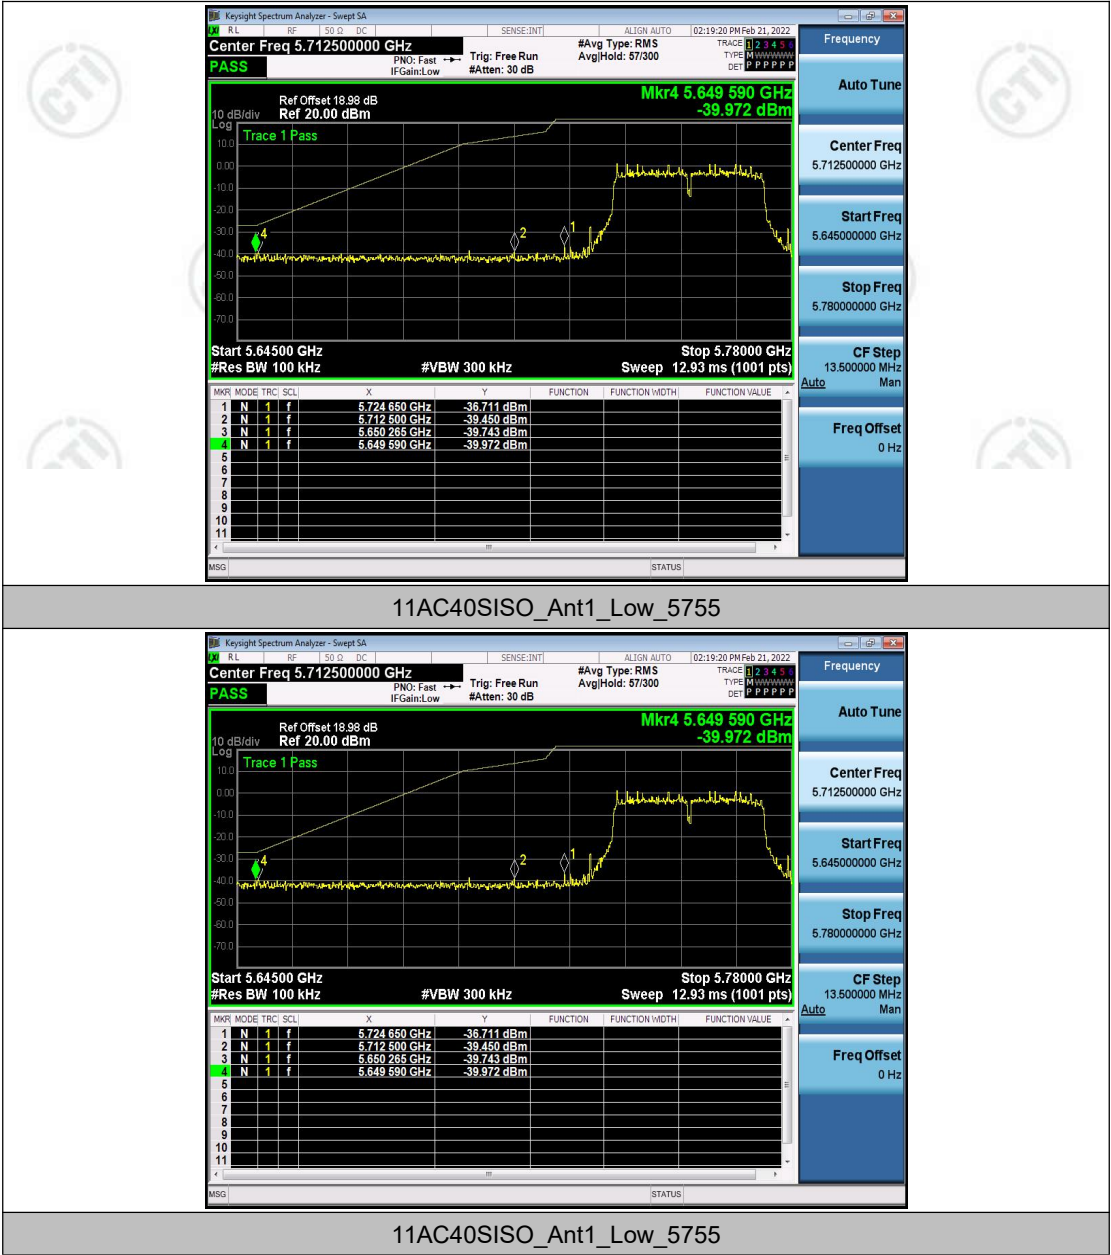


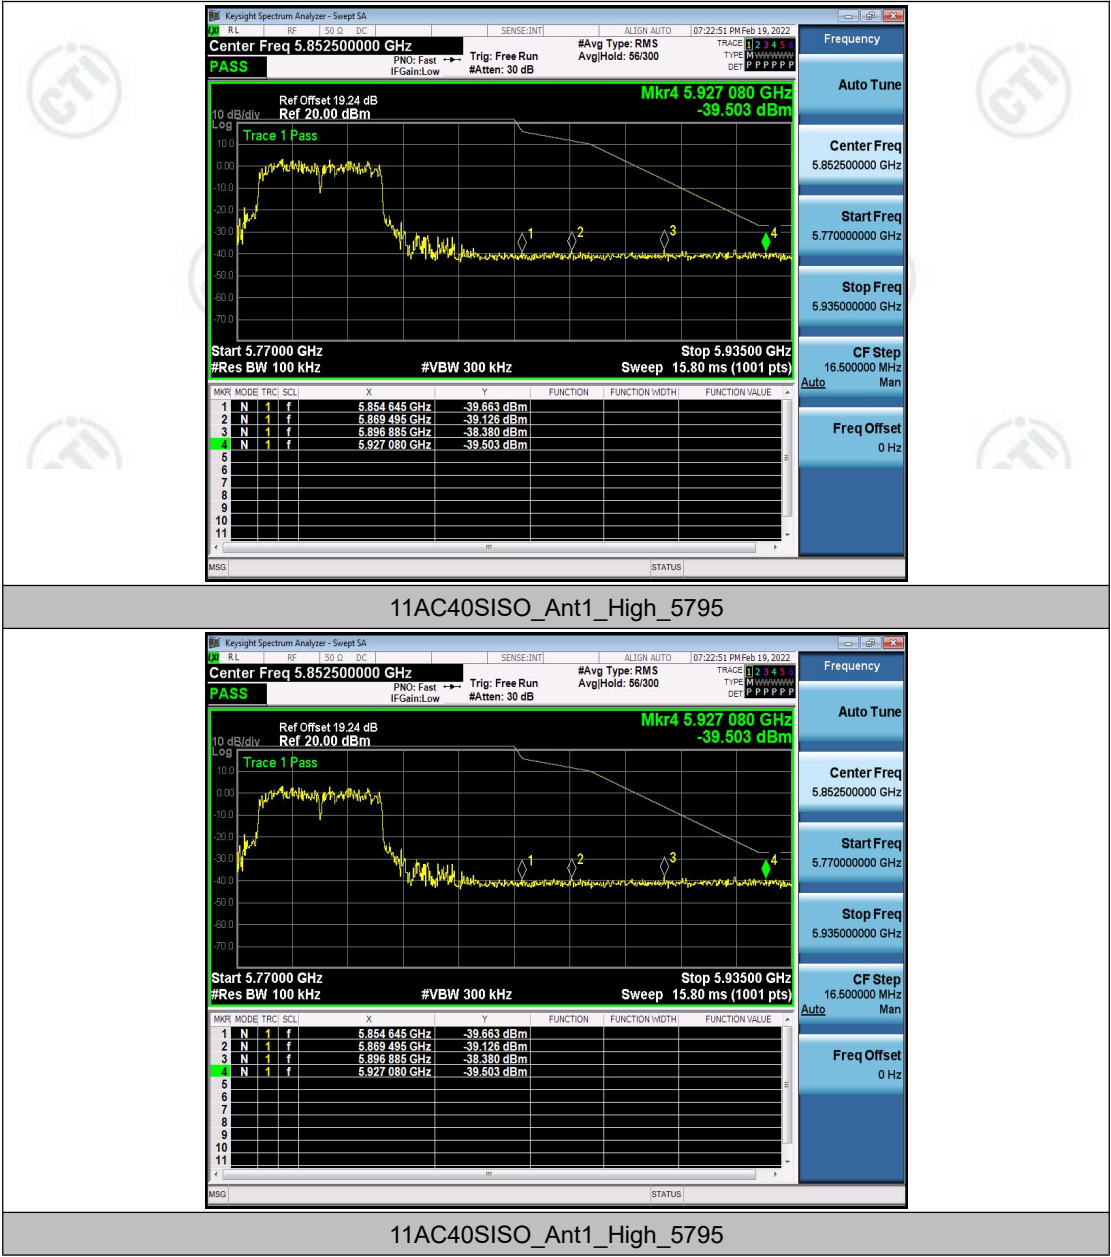


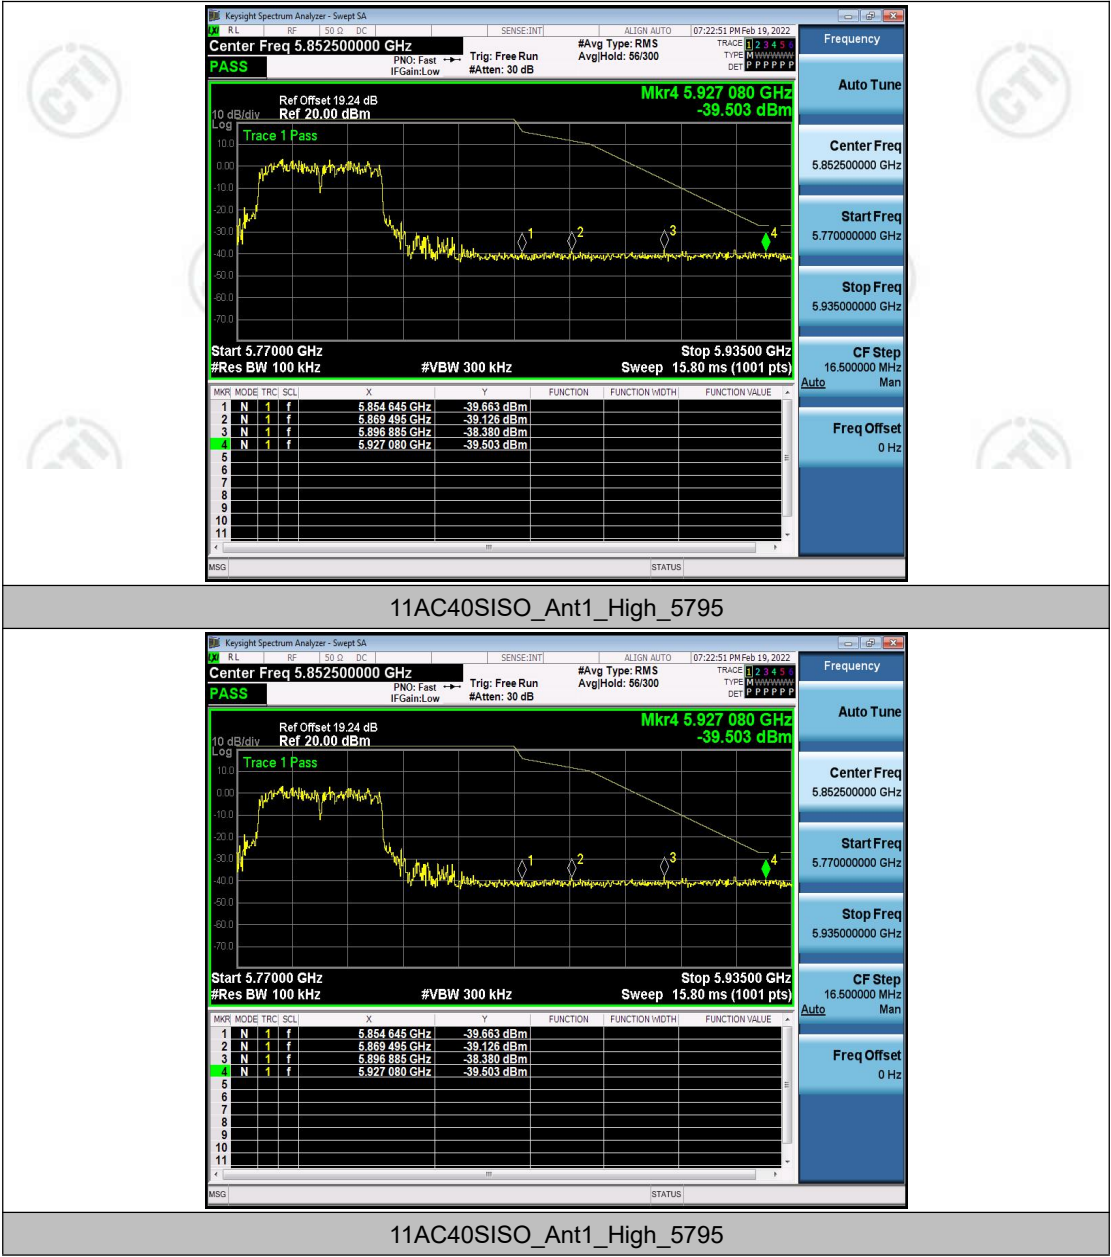

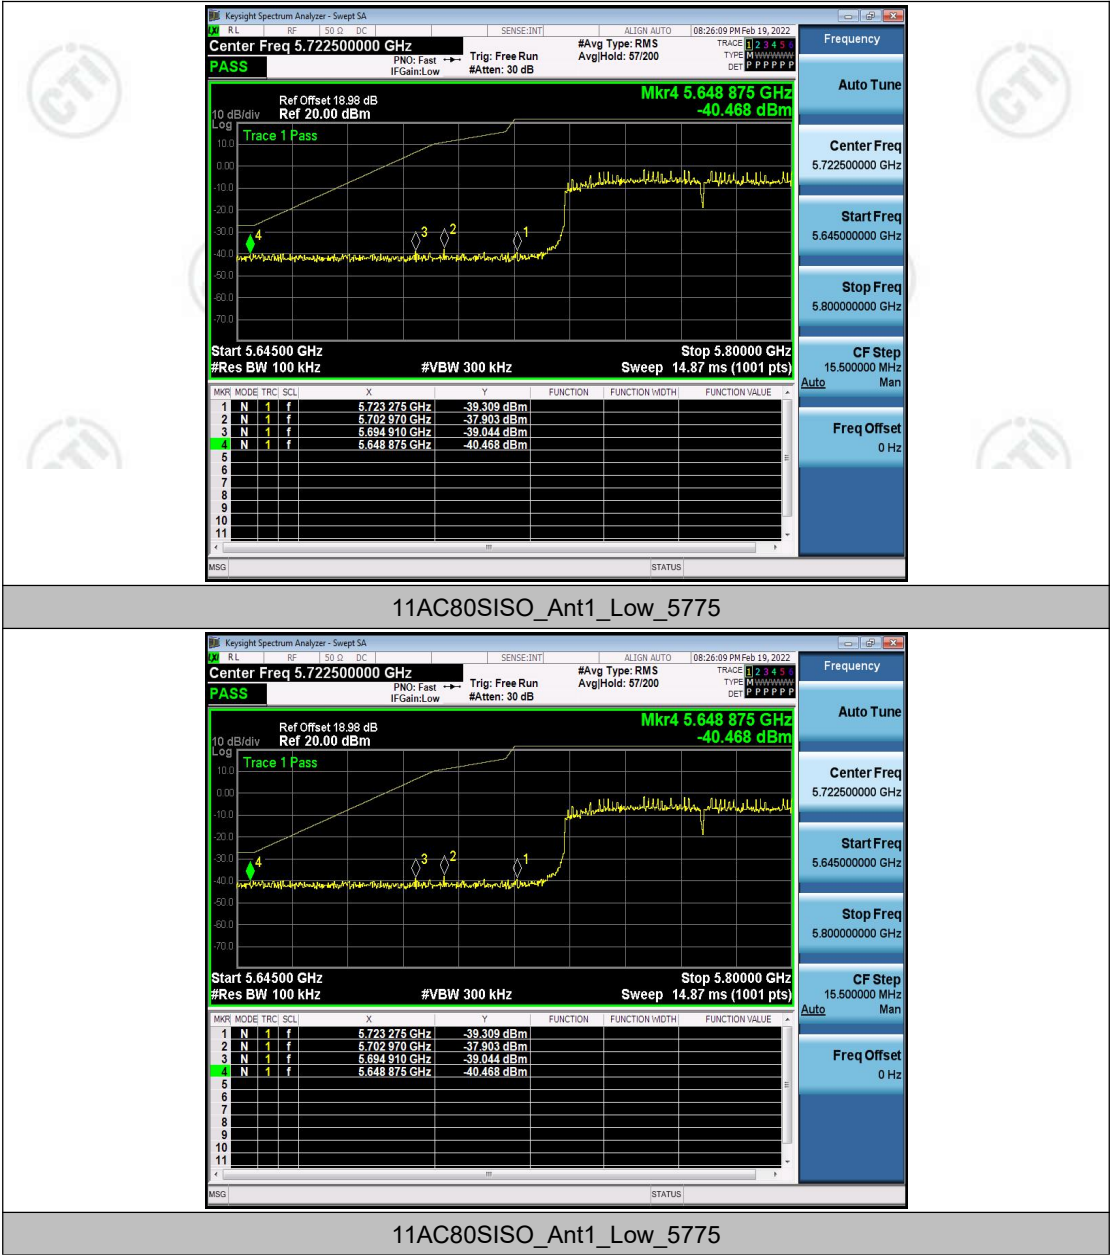

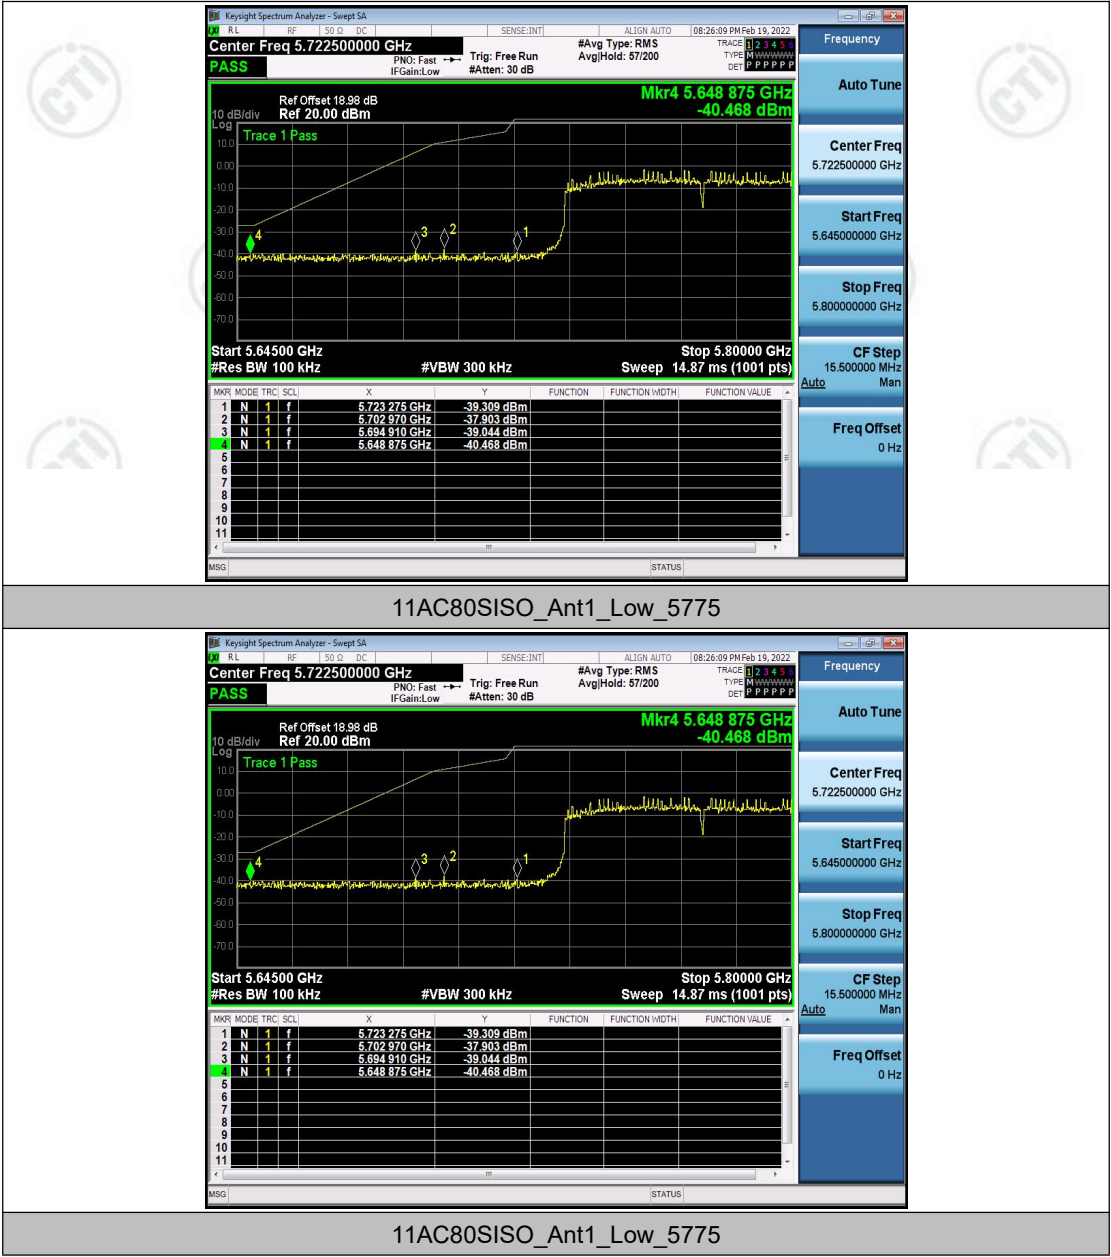

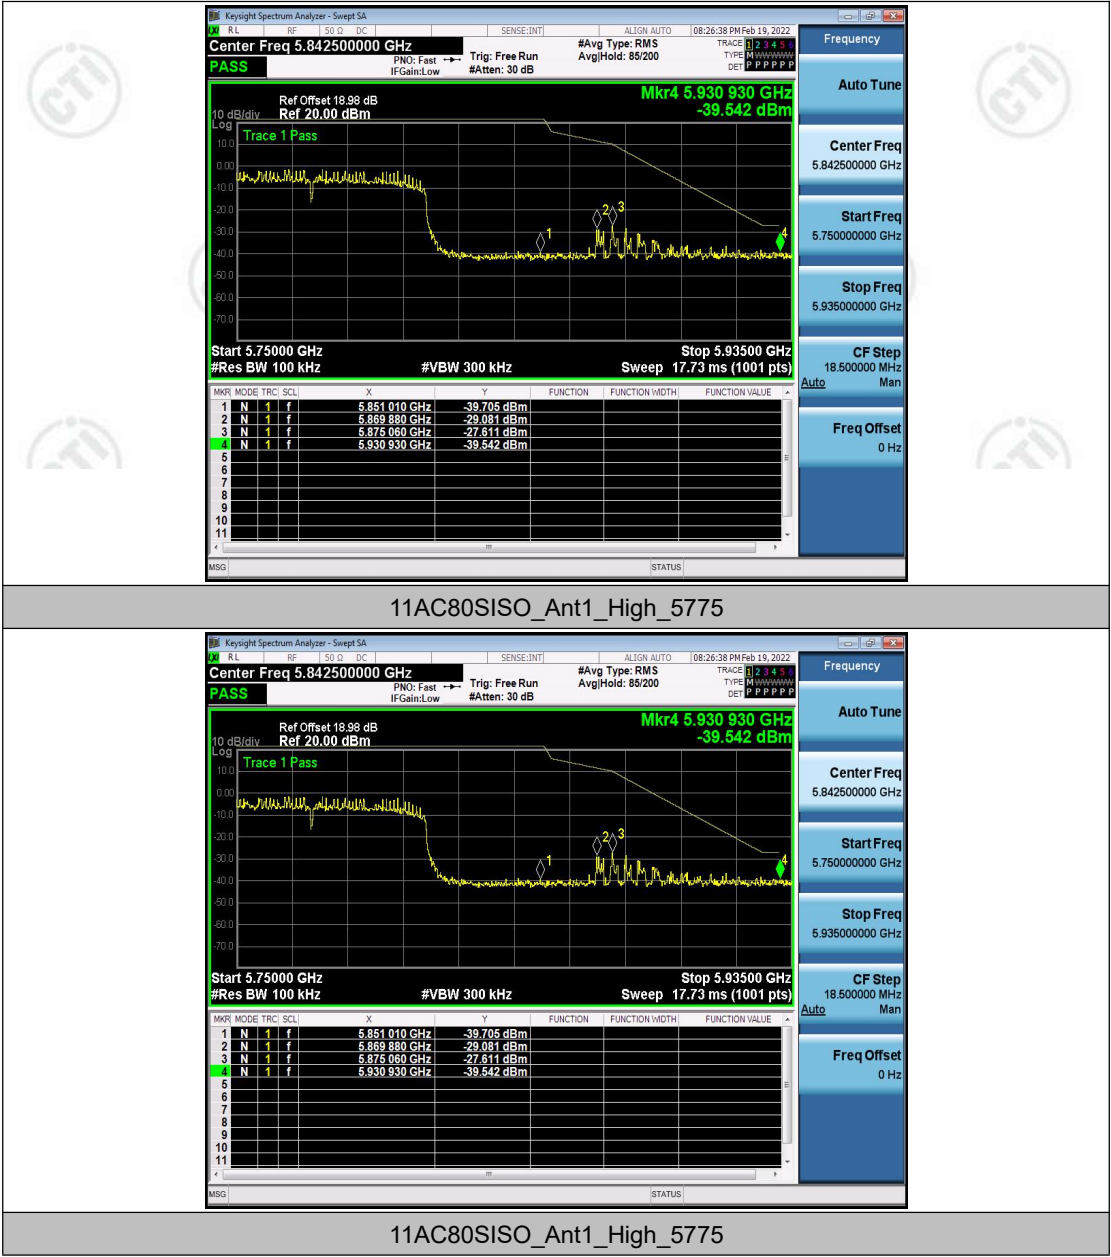

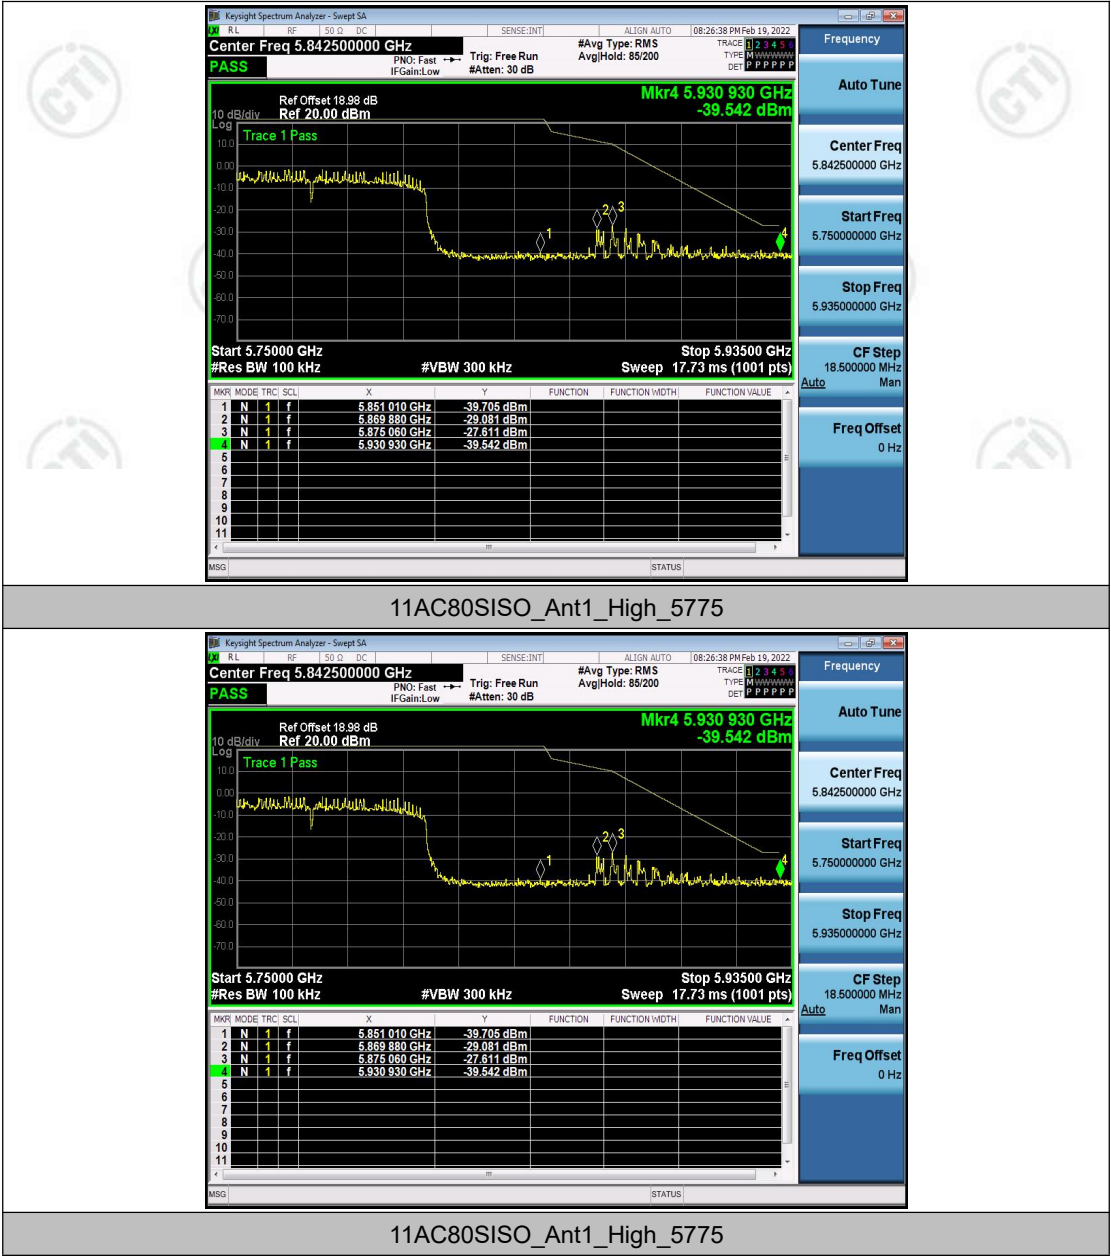

Appendix F: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Channel	FreqRange [MHz]	Max. Fre [MHz]	Max. Level [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	30~5140	30~5140	-31.039	<=-27	PASS
			5360~4000	5360~4000	-33.85	<=-27	PASS
		5200	30~5140	30~5140	-32.442	<=-27	PASS
			5360~4000	5360~4000	-33.568	<=-27	PASS
		5240	30~5140	30~5140	-32.56	<=-27	PASS
			5360~4000	5360~4000	-33.819	<=-27	PASS
		5745	30~5650	30~5650	-31.829	<=-27	PASS
			5925~4000	5925~4000	-32.845	<=-27	PASS
		5785	30~5650	30~5650	-29.357	<=-27	PASS
			5925~4000	5925~4000	-32.073	<=-27	PASS
		5825	30~5650	30~5650	-32.04	<=-27	PASS
			5925~4000	5925~4000	-32.54	<=-27	PASS
11N20SI SO	Ant1	5180	30~5140	30~5140	-39.019	<=-27	PASS
			5360~4000	5360~4000	-35.299	<=-27	PASS
		5200	30~5140	30~5140	-40.85	<=-27	PASS
			5360~4000	5360~4000	-35.193	<=-27	PASS
		5240	30~5140	30~5140	-40.419	<=-27	PASS
			5360~4000	5360~4000	-34.089	<=-27	PASS
		5745	30~5650	30~5650	-38.338	<=-27	PASS
			5925~4000	5925~4000	-33.097	<=-27	PASS
		5785	30~5650	30~5650	-39.496	<=-27	PASS
			5925~4000	5925~4000	-32.825	<=-27	PASS
		5825	30~5650	30~5650	-31.441	<=-27	PASS
			5925~4000	5925~4000	-33.253	<=-27	PASS

11N40SI SO	Ant1	5190	30~5140	30~5140	-35.096	<=-27	PASS
			5360~400 00	5360~400 00	-34.061	<=-27	PASS
		5230	30~5140	30~5140	-36.456	<=-27	PASS
			5360~400 00	5360~400 00	-33.626	<=-27	PASS
		5755	30~5650	30~5650	-40.304	<=-27	PASS
			5925~400 00	5925~400 00	-33.042	<=-27	PASS
		5795	30~5650	30~5650	-38.938	<=-27	PASS
			5925~400 00	5925~400 00	-32.606	<=-27	PASS
11AC20S ISO	Ant1	5180	30~5140	30~5140	-39.942	<=-27	PASS
			5360~400 00	5360~400 00	-33.302	<=-27	PASS
		5200	30~5140	30~5140	-41.125	<=-27	PASS
			5360~400 00	5360~400 00	-33.814	<=-27	PASS
		5240	30~5140	30~5140	-41.404	<=-27	PASS
			5360~400 00	5360~400 00	-34.345	<=-27	PASS
		5745	30~5650	30~5650	-40.23	<=-27	PASS
			5925~400 00	5925~400 00	-32.826	<=-27	PASS
		5785	30~5650	30~5650	-34.377	<=-27	PASS
			5925~400 00	5925~400 00	-33.175	<=-27	PASS
		5825	30~5650	30~5650	-33.302	<=-27	PASS
			5925~400 00	5925~400 00	-32.424	<=-27	PASS
11AC40S ISO	Ant1	5190	30~5140	30~5140	-41.263	<=-27	PASS
			5360~400 00	5360~400 00	-34	<=-27	PASS
		5230	30~5140	30~5140	-40.732	<=-27	PASS
			5360~400 00	5360~400 00	-33.928	<=-27	PASS
		5755	30~5650	30~5650	-40.536	<=-27	PASS
			5925~400 00	5925~400 00	-32.993	<=-27	PASS
		5795	30~5650	30~5650	-34.259	<=-27	PASS
			5925~400	5925~400	-32.332	<=-27	PASS

			00	00			
11AC80S ISO	Ant1	5210	30~5140	30~5140	-38.077	<=-27	PASS
			5360~400 00	5360~400 00	-33.694	<=-27	PASS
		5775	30~5650	30~5650	-37.098	<=-27	PASS
			5925~400 00	5925~400 00	-31.629	<=-27	PASS

Test Graphs

