




OBW NVNT n20 5280MHz Ant2




OBW NVNT n20 5280MHz Ant3

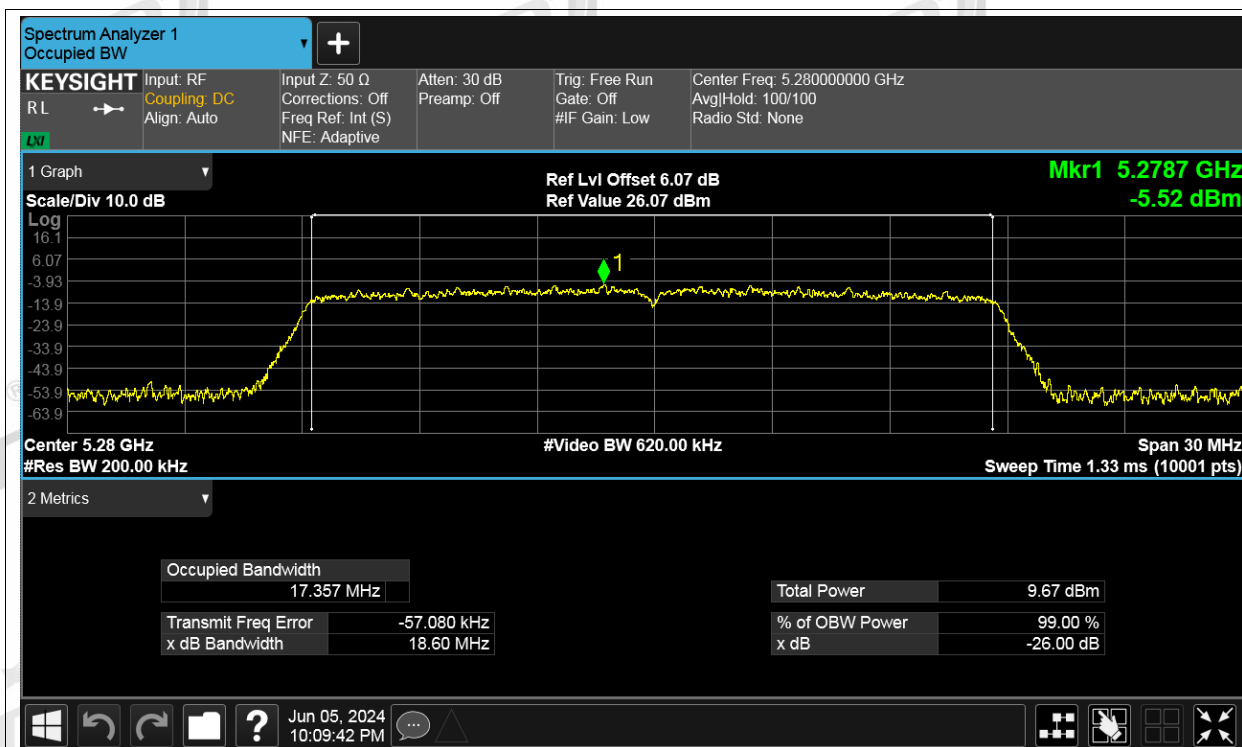

OBW NVNT n20 5320MHz Ant1




OBW NVNT n20 5320MHz Ant2

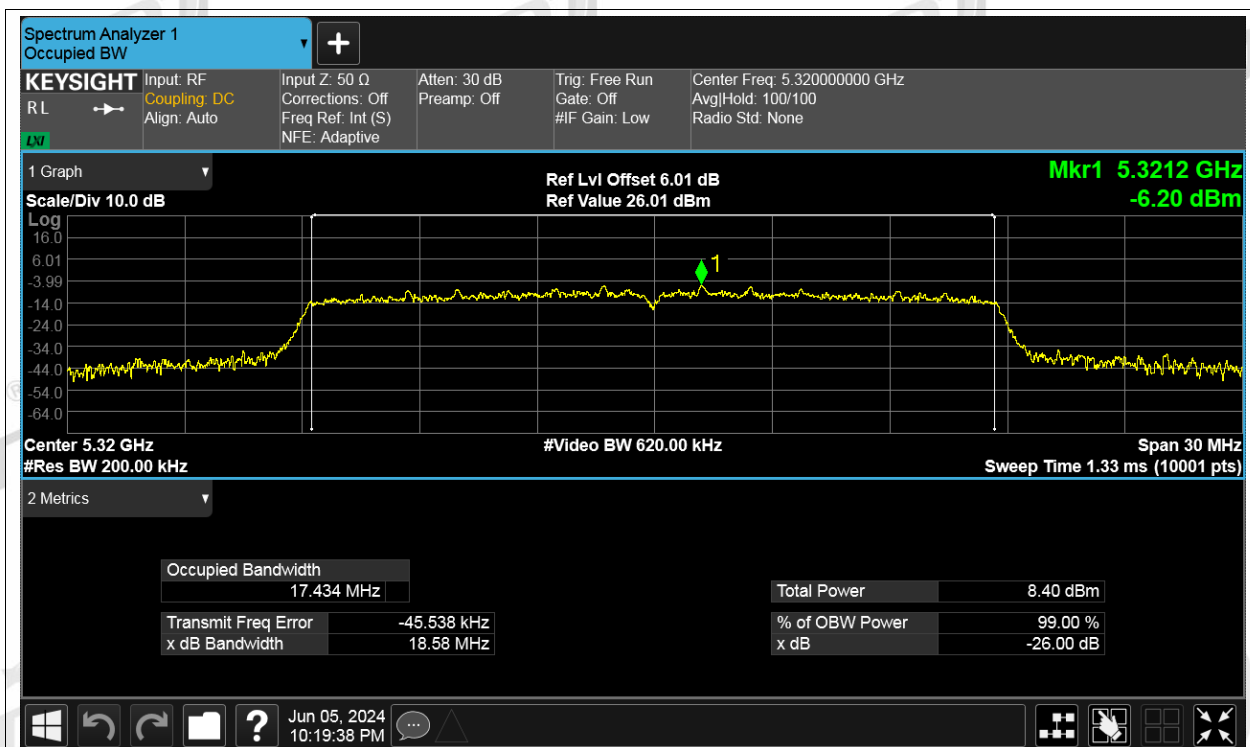

OBW NVNT n20 5320MHz Ant3




OBW NVNT n20 5500MHz Ant1

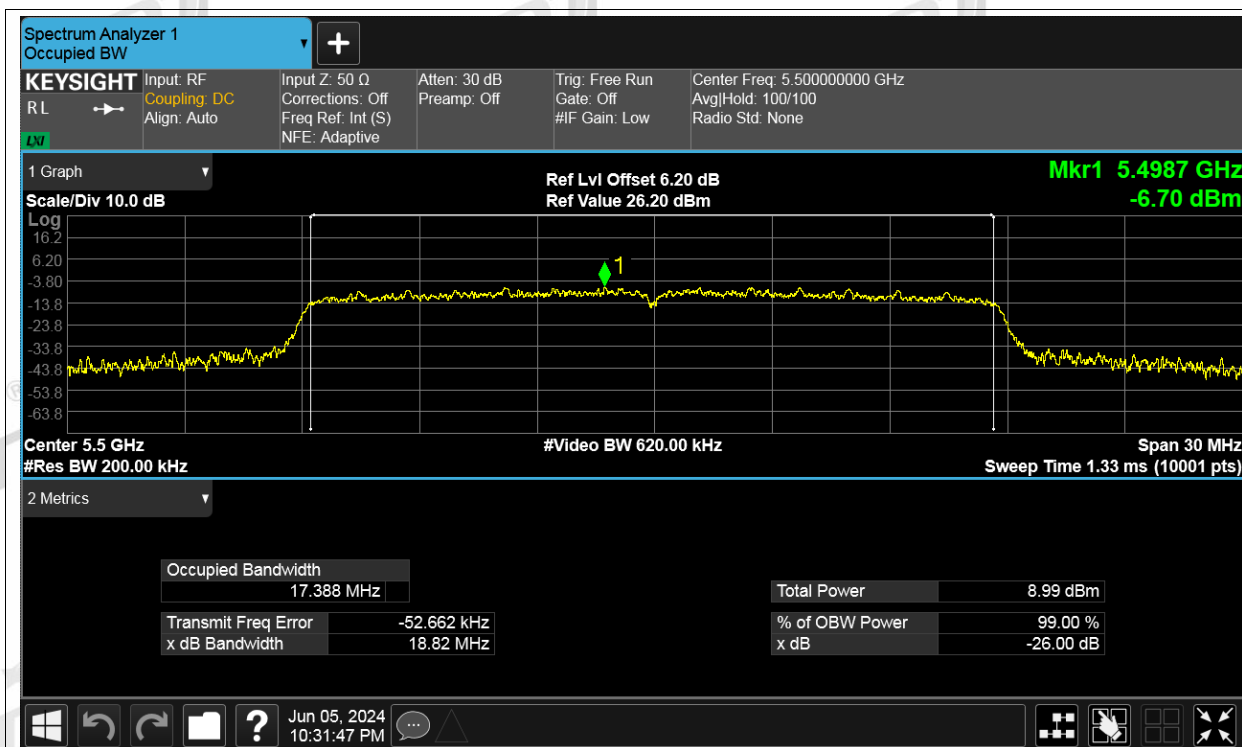

OBW NVNT n20 5500MHz Ant2




OBW NVNT n20 5500MHz Ant3

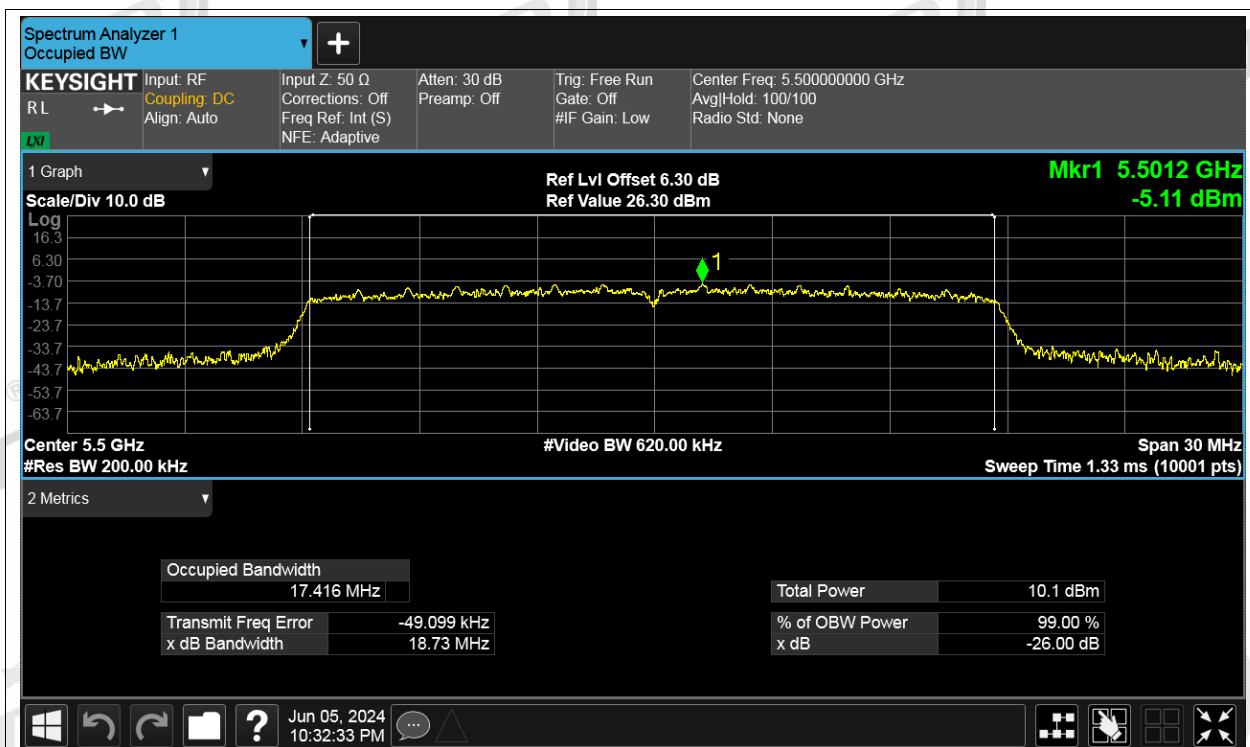

OBW NVNT n20 5580MHz Ant1




OBW NVNT n20 5580MHz Ant2

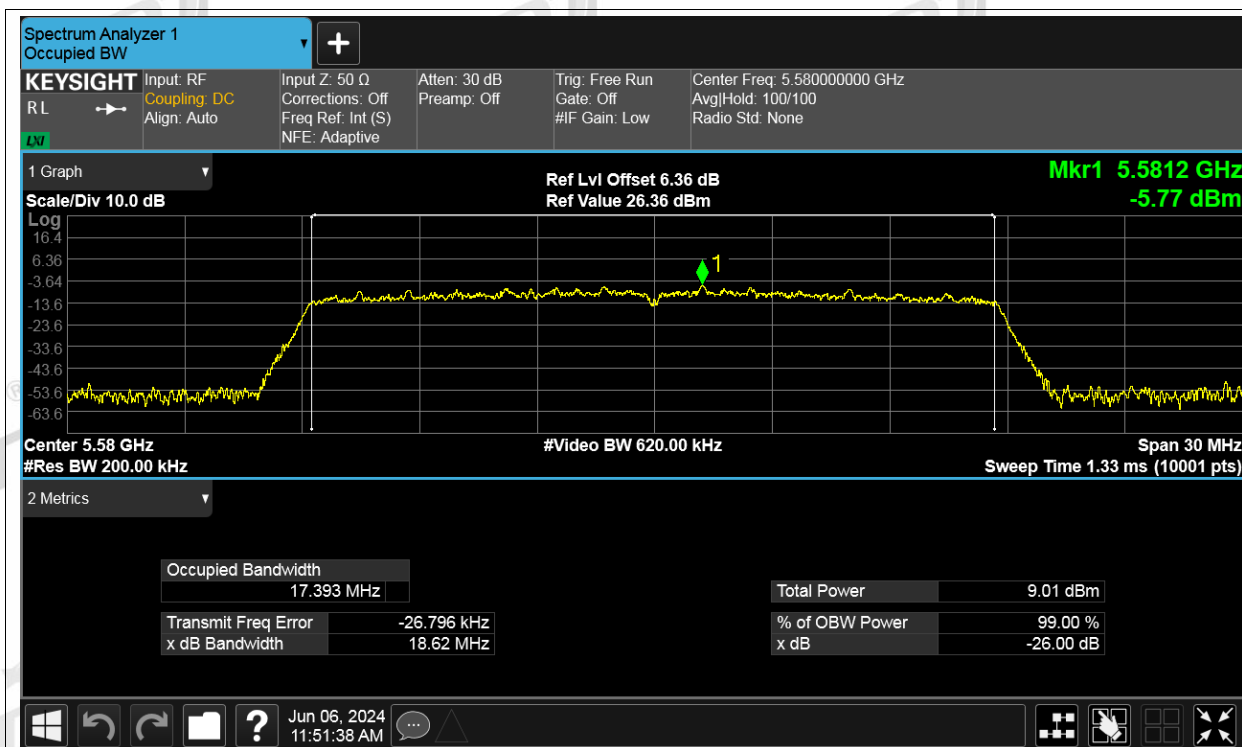

OBW NVNT n20 5580MHz Ant3




OBW NVNT n20 5700MHz Ant1

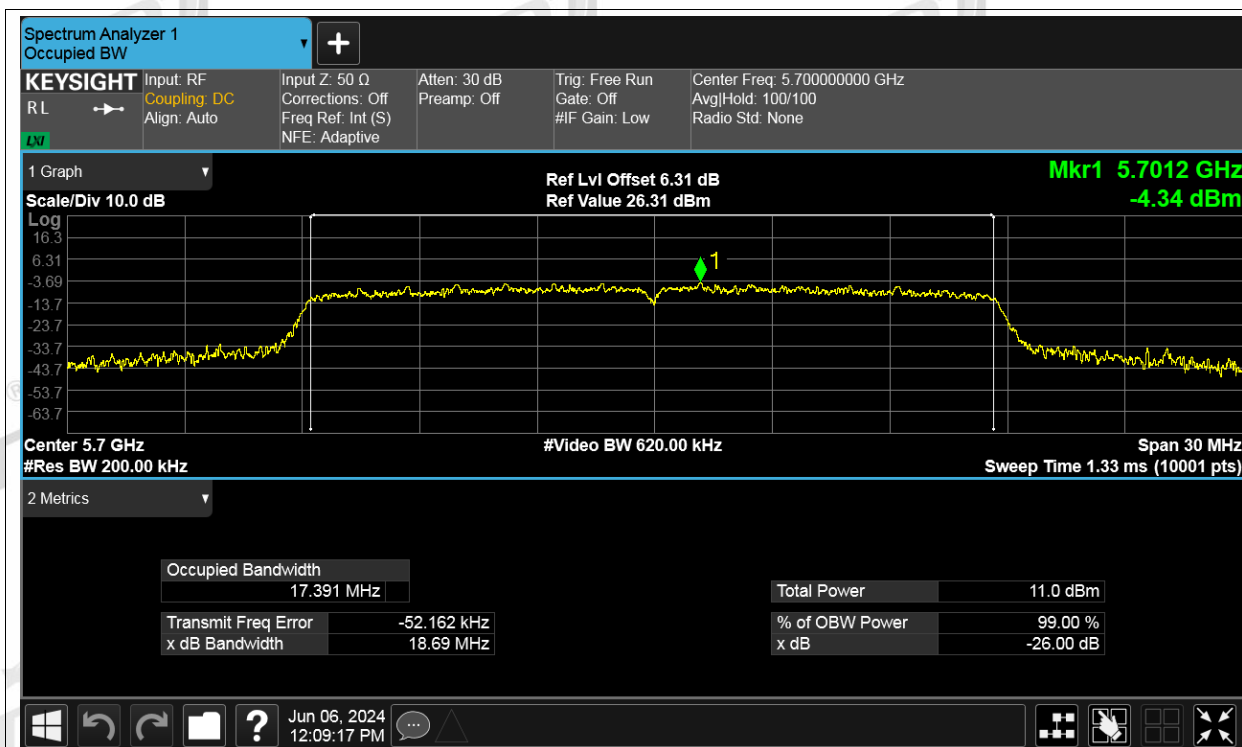


OBW NVNT n20 5700MHz Ant2




OBW NVNT n20 5700MHz Ant3

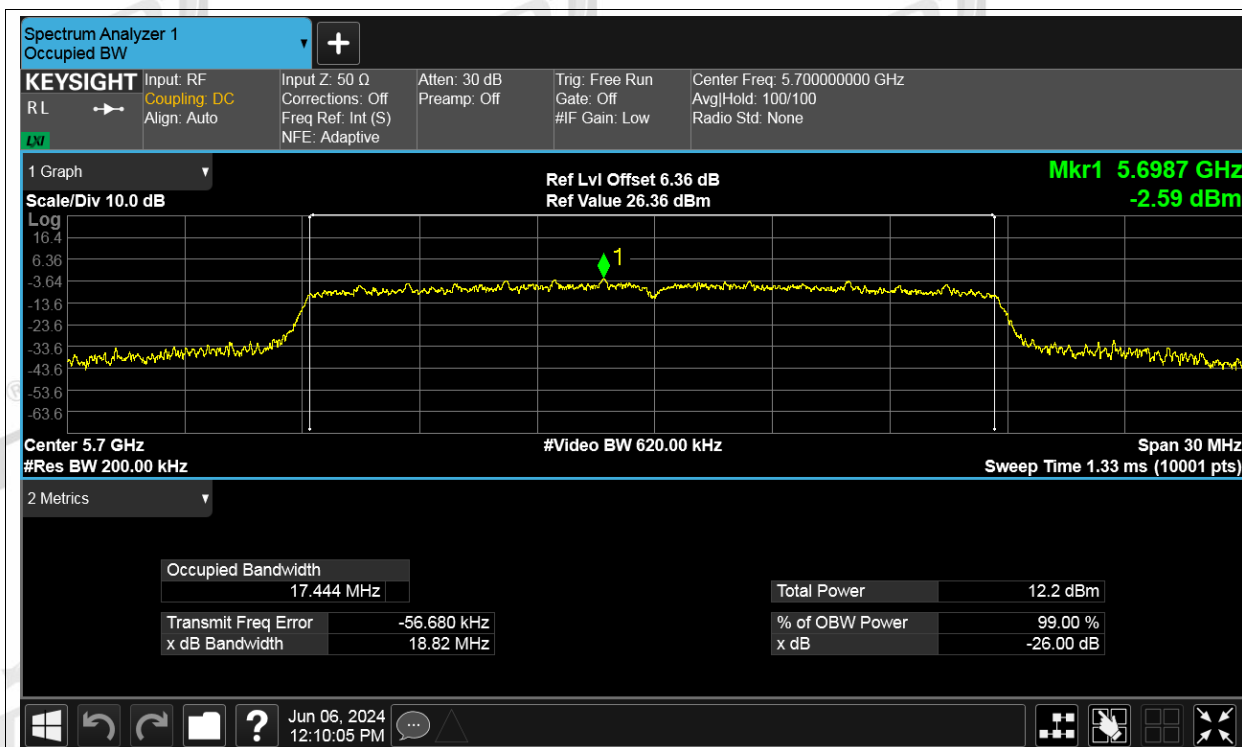


OBW NVNT n20 5745MHz Ant1

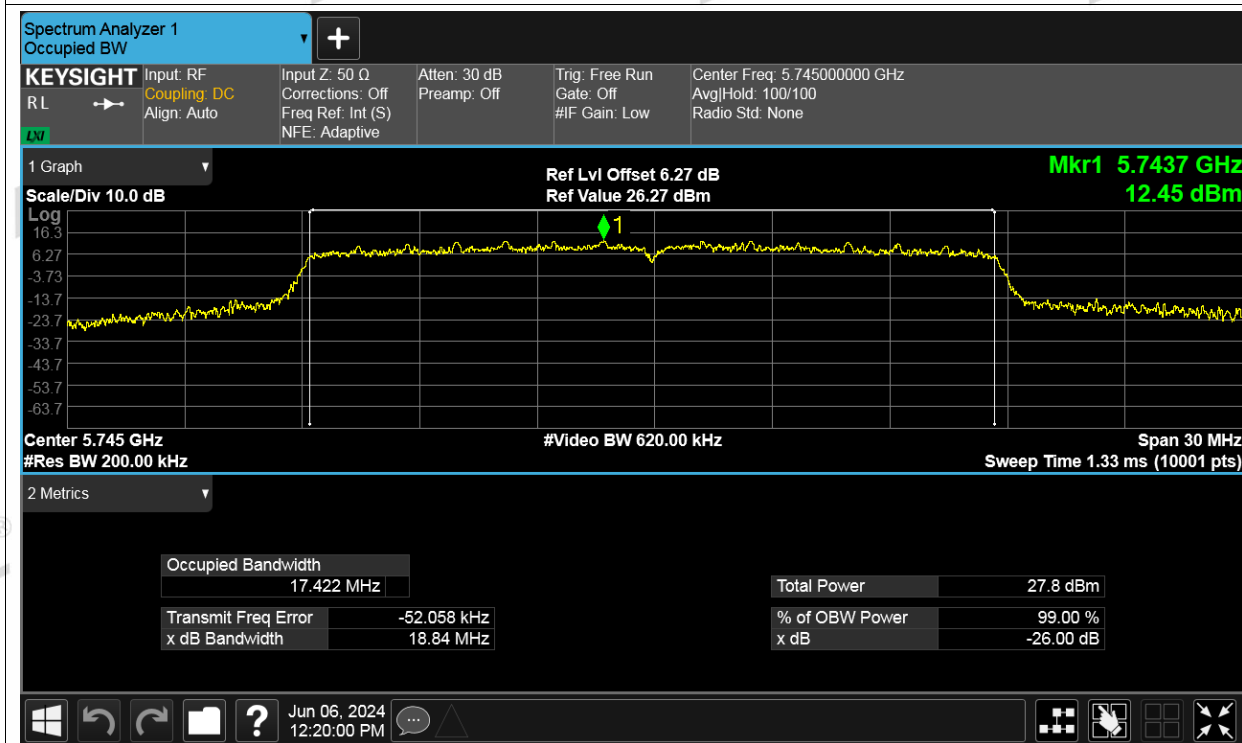


OBW NVNT n20 5745MHz Ant2

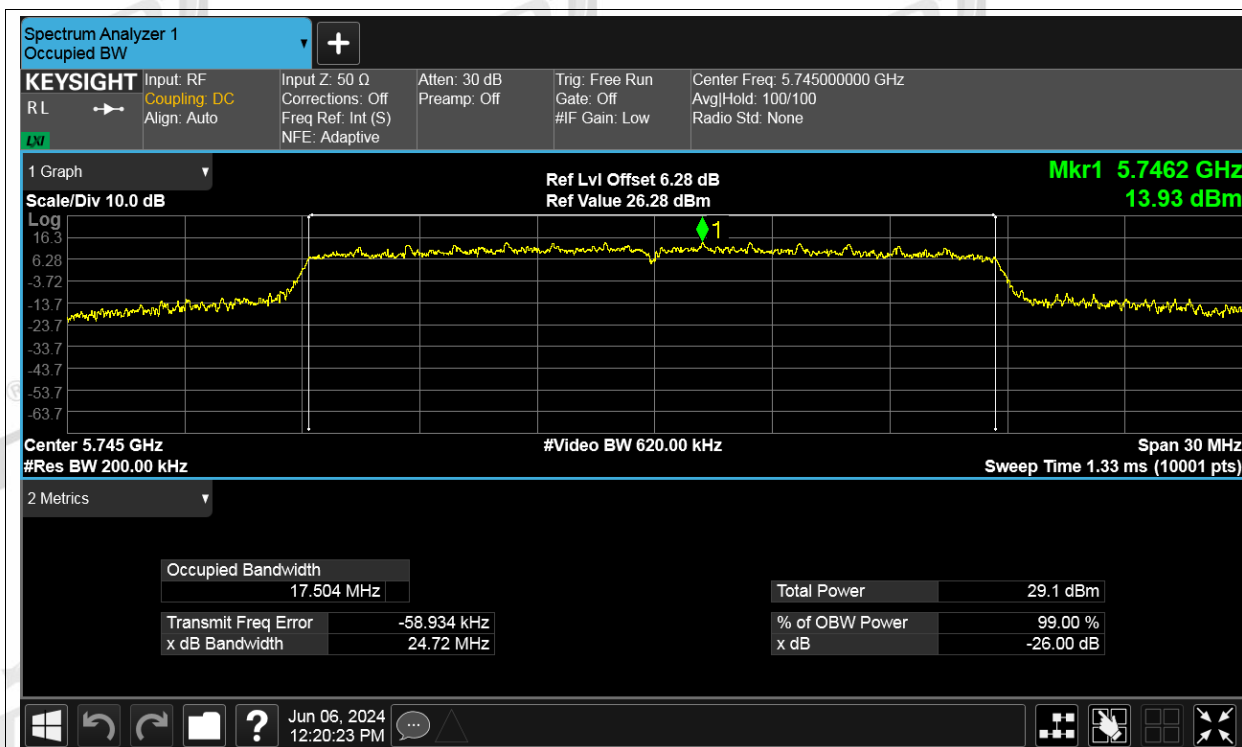


OBW NVNT n20 5745MHz Ant3

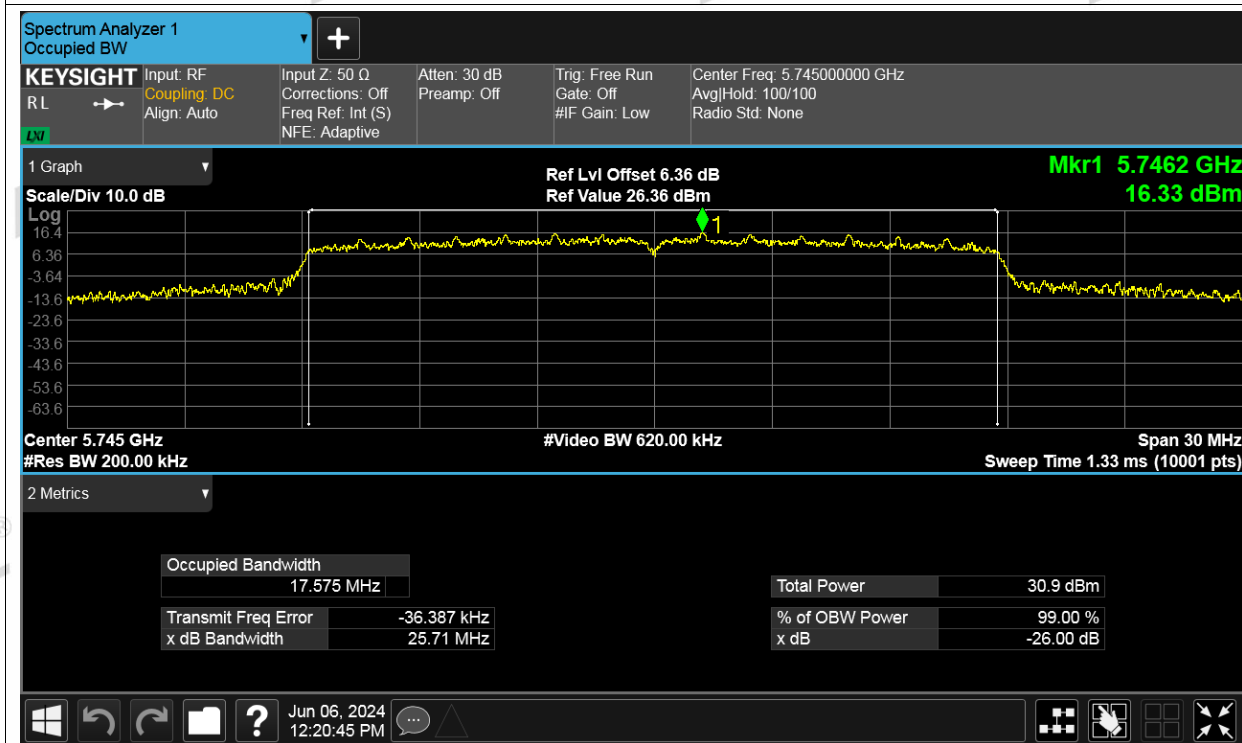


OBW NVNT n20 5785MHz Ant1

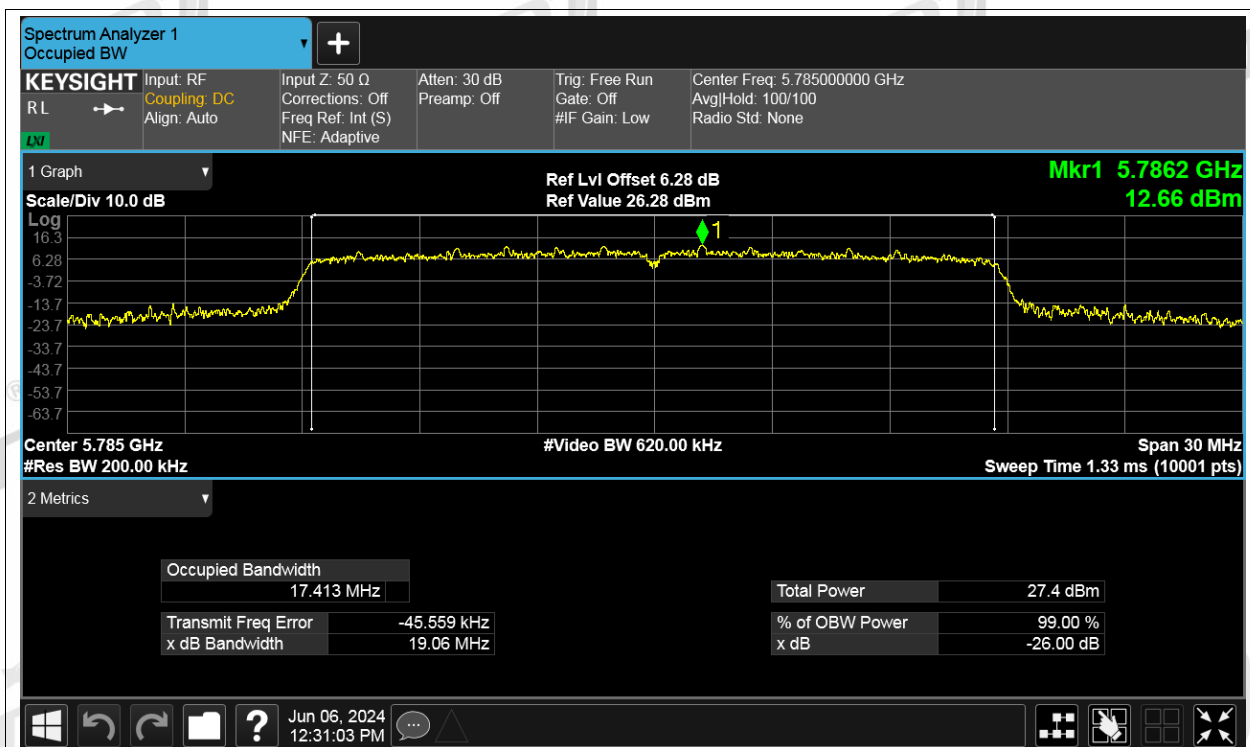


OBW NVNT n20 5785MHz Ant2

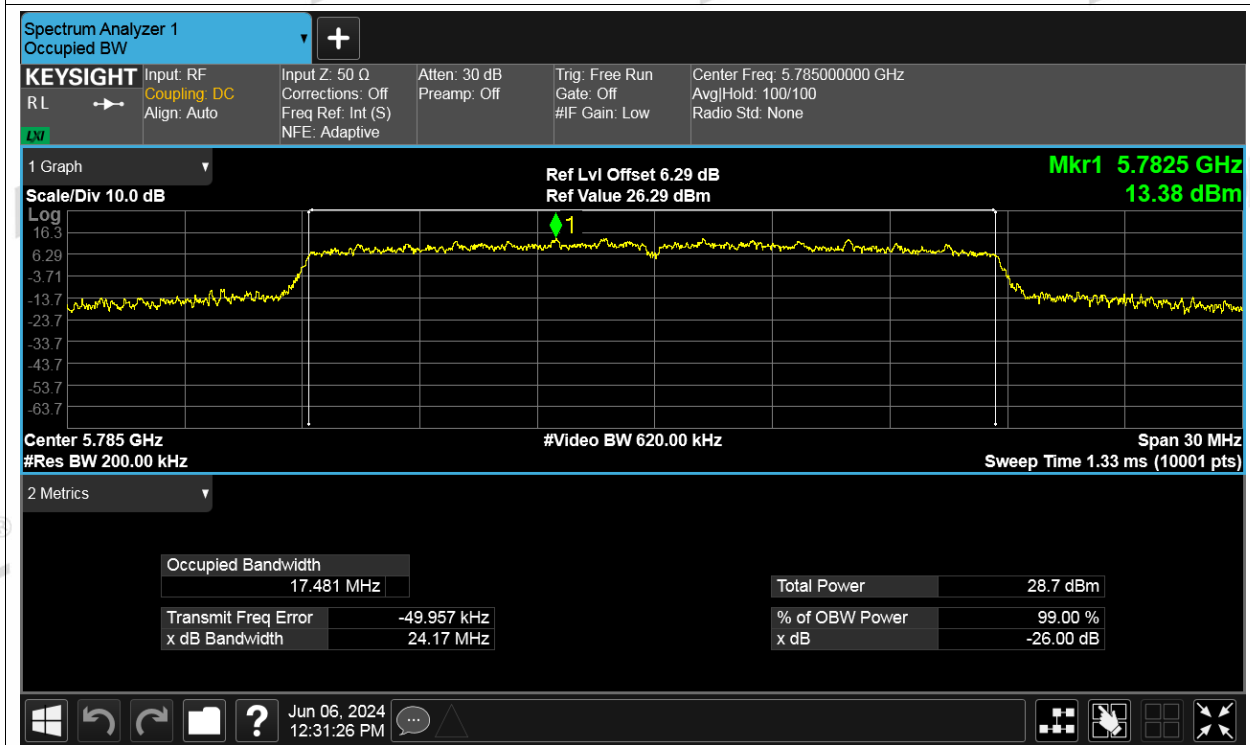


OBW NVNT n20 5785MHz Ant3

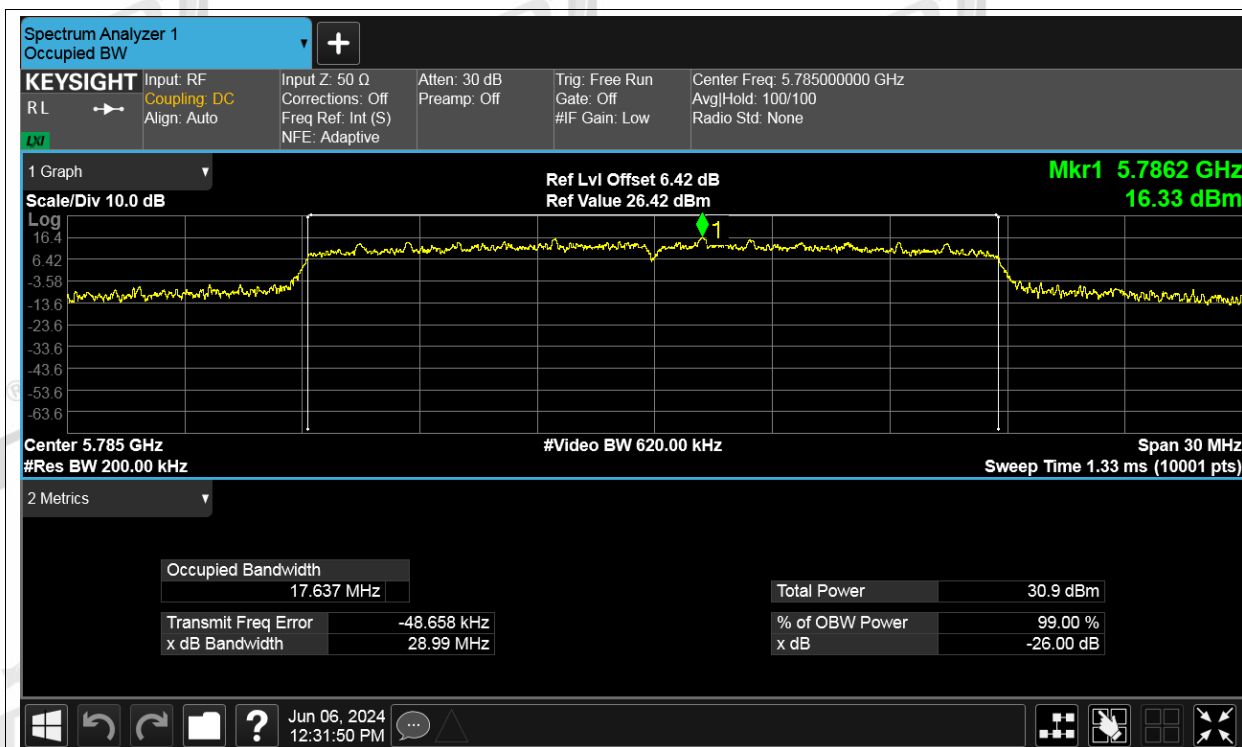


OBW NVNT n20 5825MHz Ant1

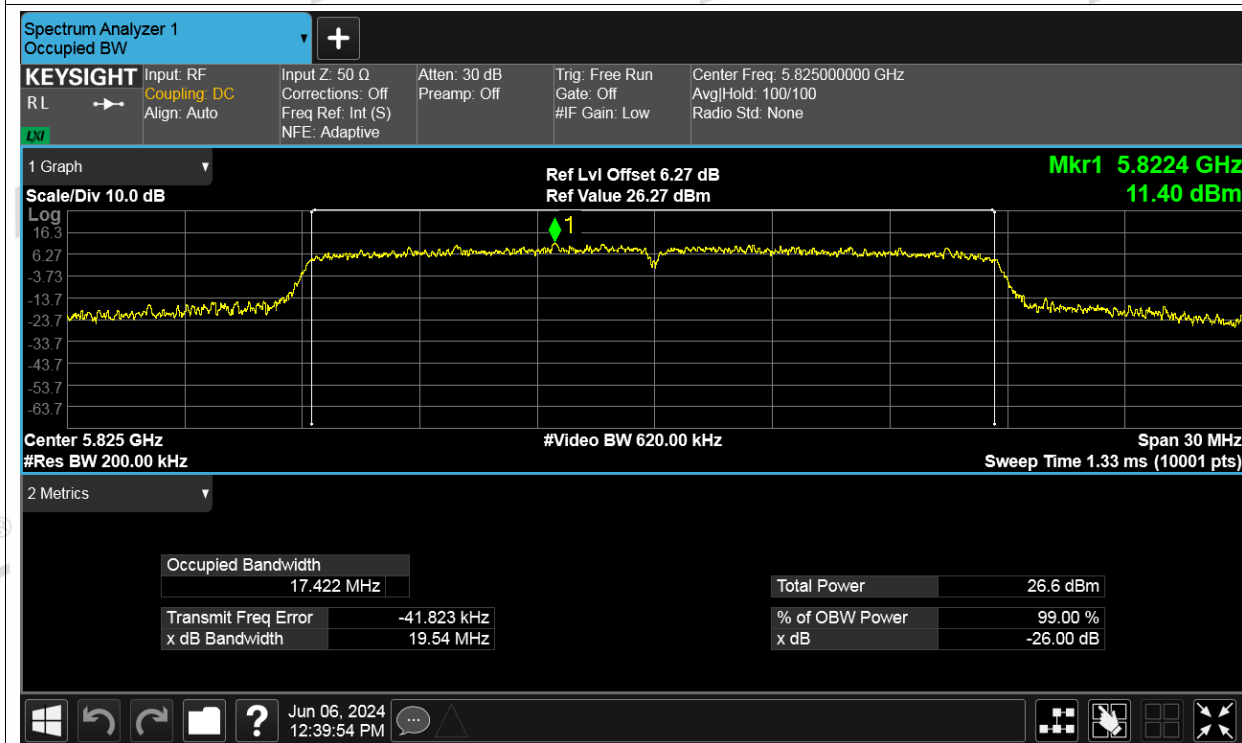

OBW NVNT n20 5825MHz Ant2

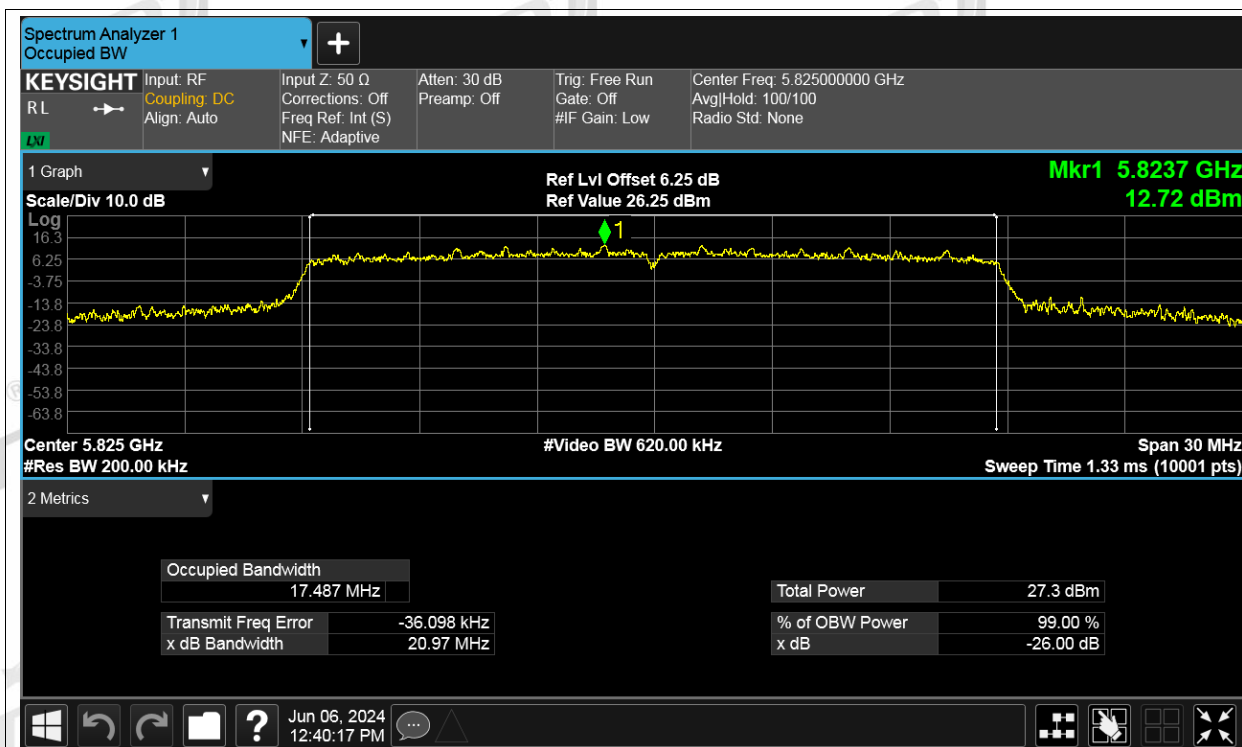


OBW NVNT n20 5825MHz Ant3

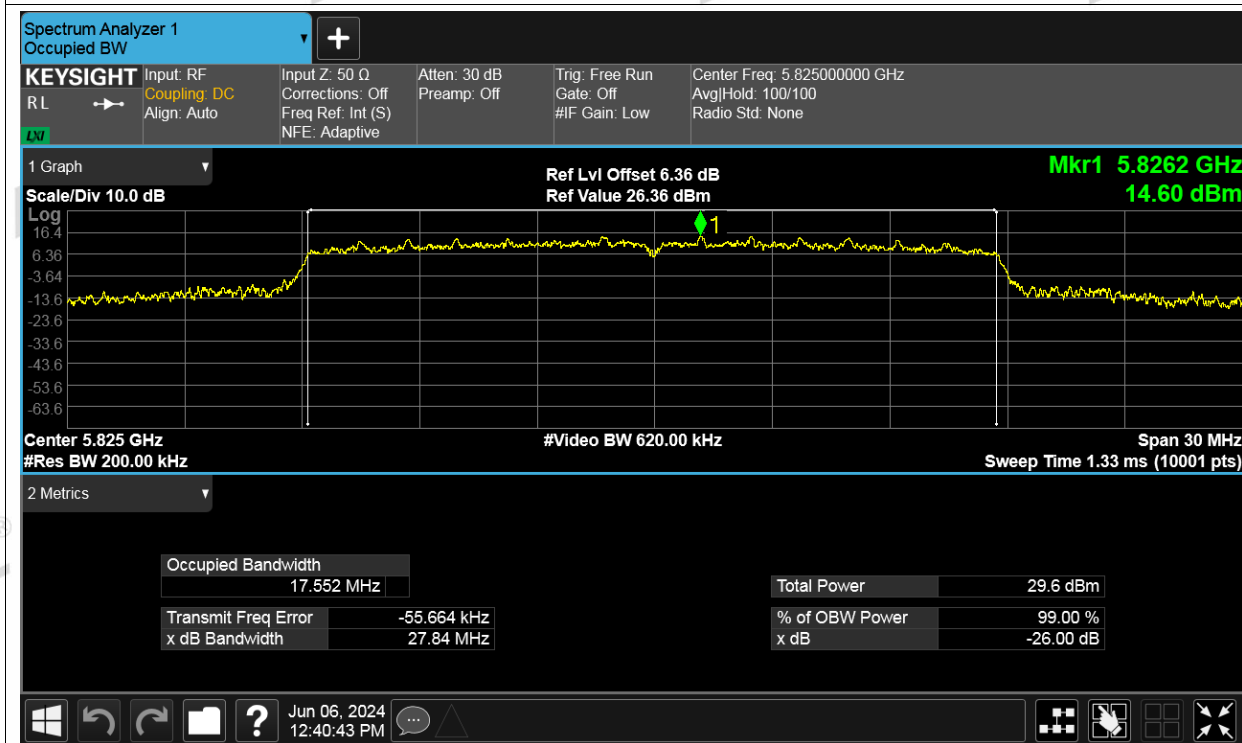


OBW NVNT n40 5190MHz Ant1



OBW NVNT n40 5190MHz Ant2

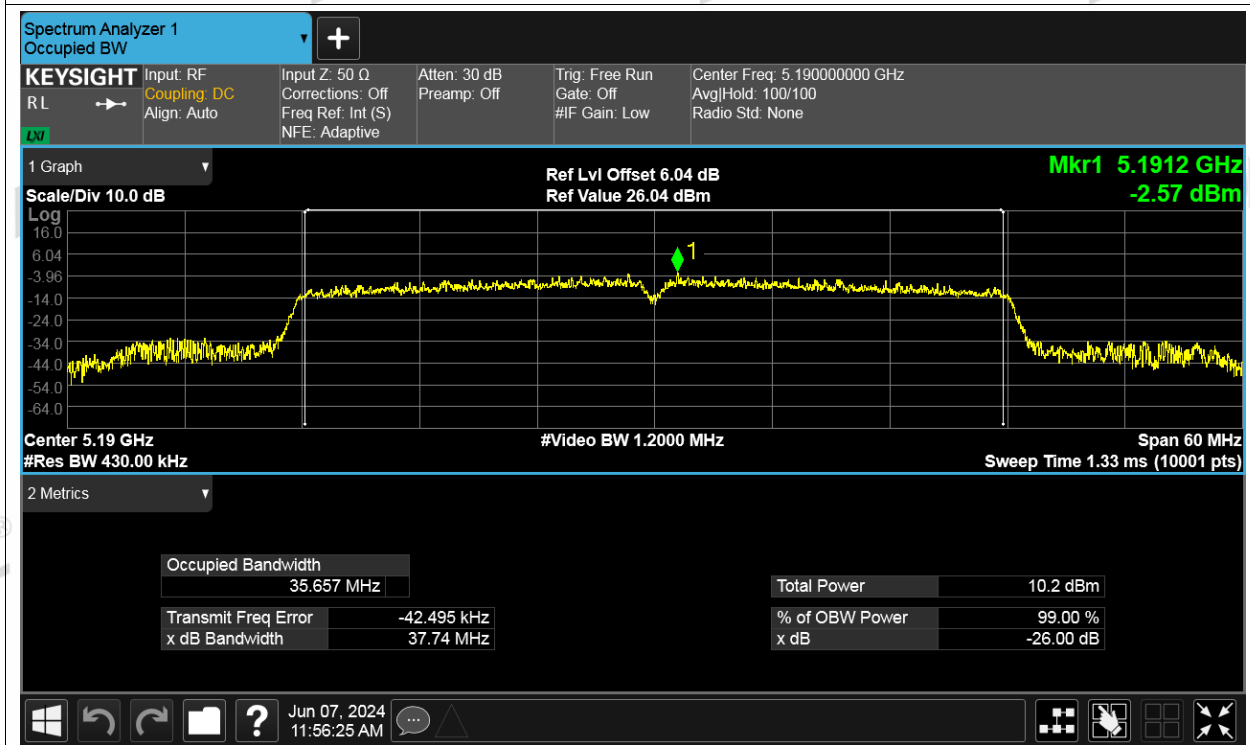


OBW NVNT n40 5190MHz Ant3

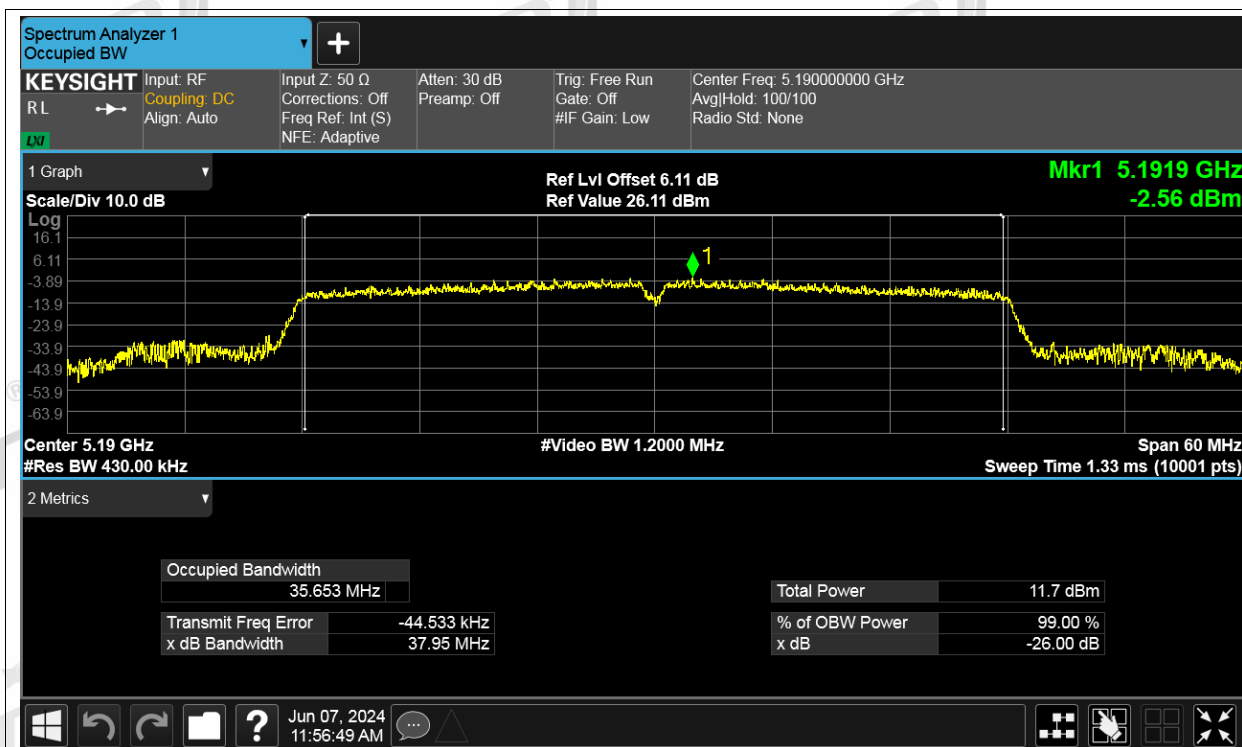


OBW NVNT n40 5230MHz Ant1



OBW NVNT n40 5230MHz Ant2

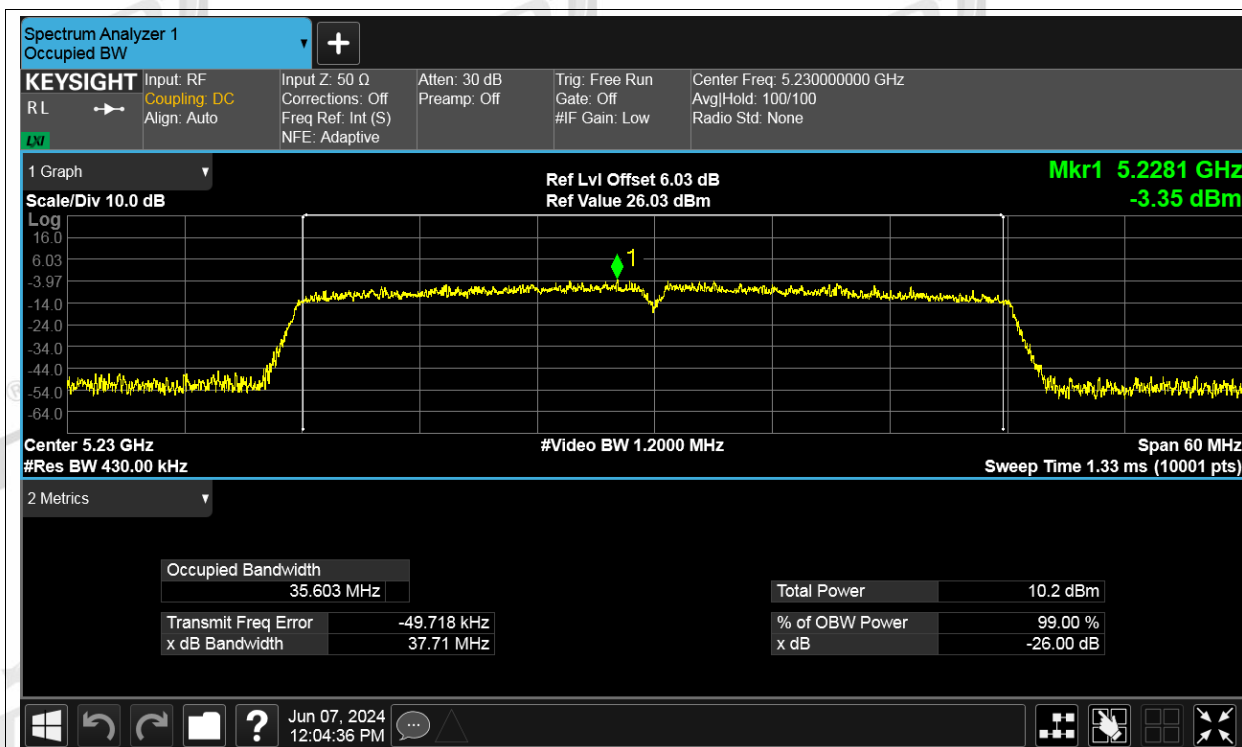

OBW NVNT n40 5230MHz Ant3

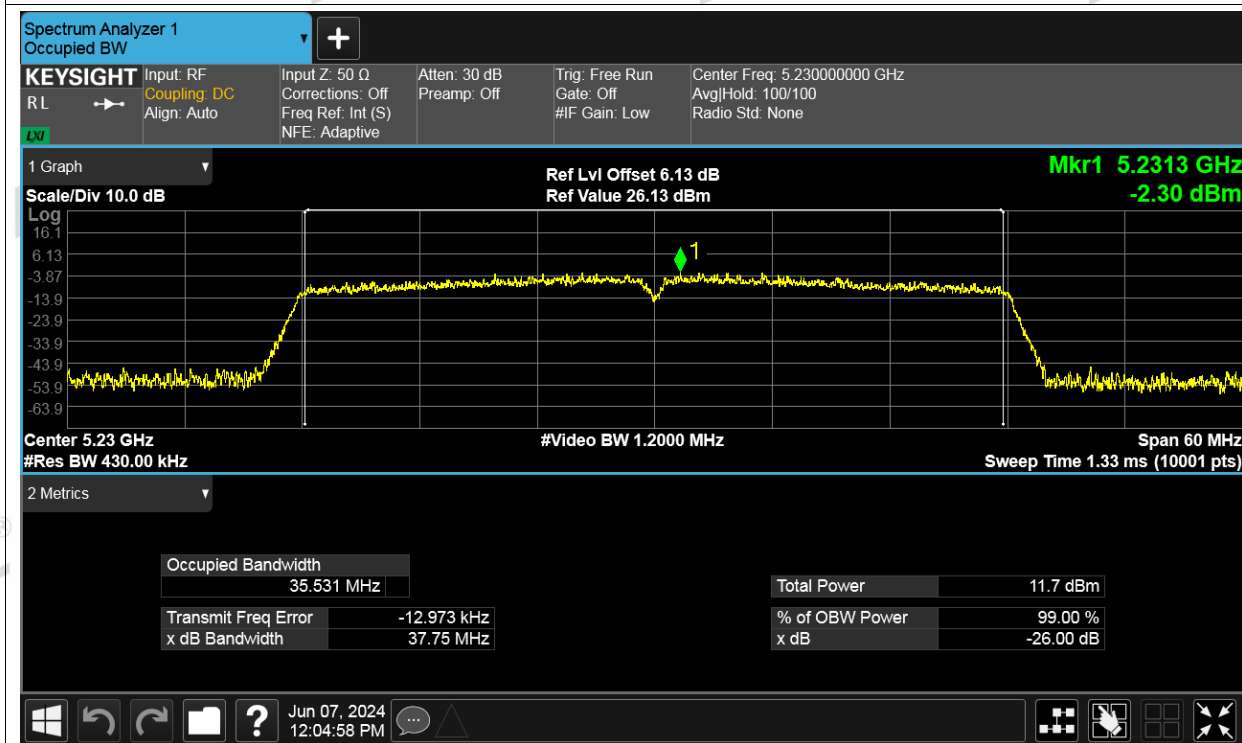


OBW NVNT n40 5270MHz Ant1



OBW NVNT n40 5270MHz Ant2




OBW NVNT n40 5270MHz Ant3

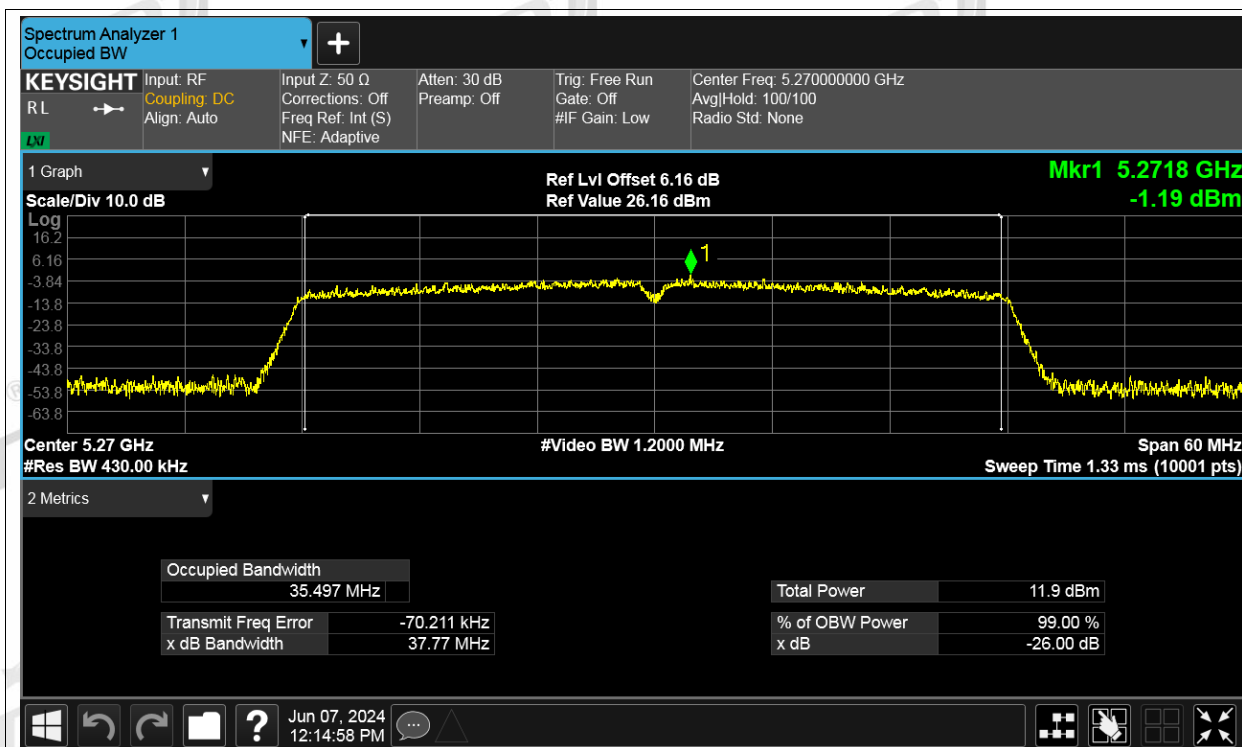


OBW NVNT n40 5310MHz Ant1



OBW NVNT n40 5310MHz Ant2

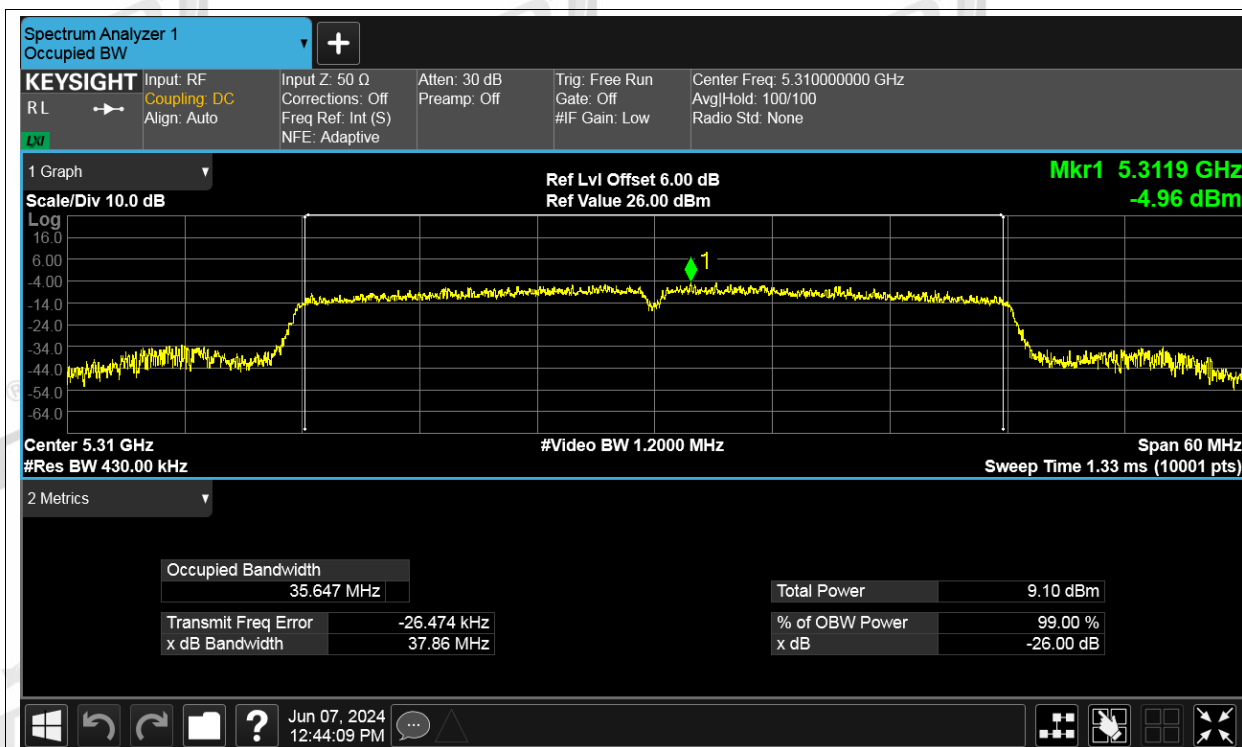


OBW NVNT n40 5310MHz Ant3

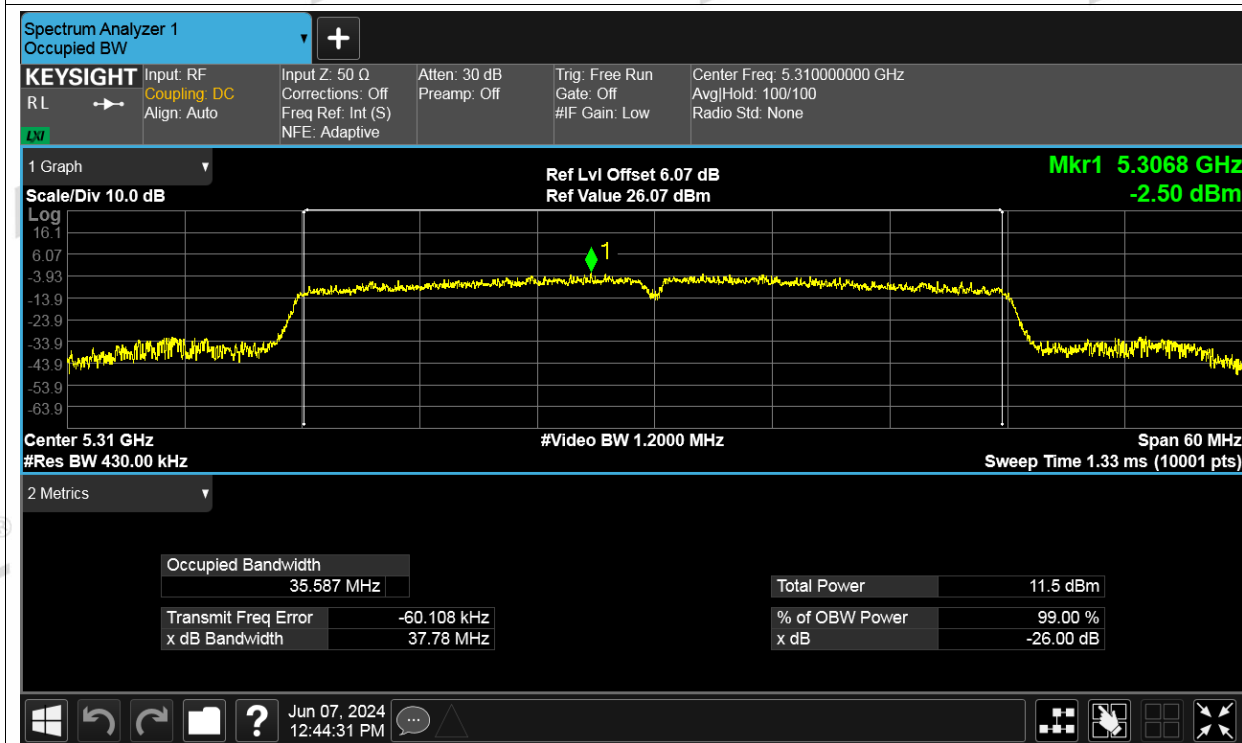


OBW NVNT n40 5510MHz Ant1



OBW NVNT n40 5510MHz Ant2

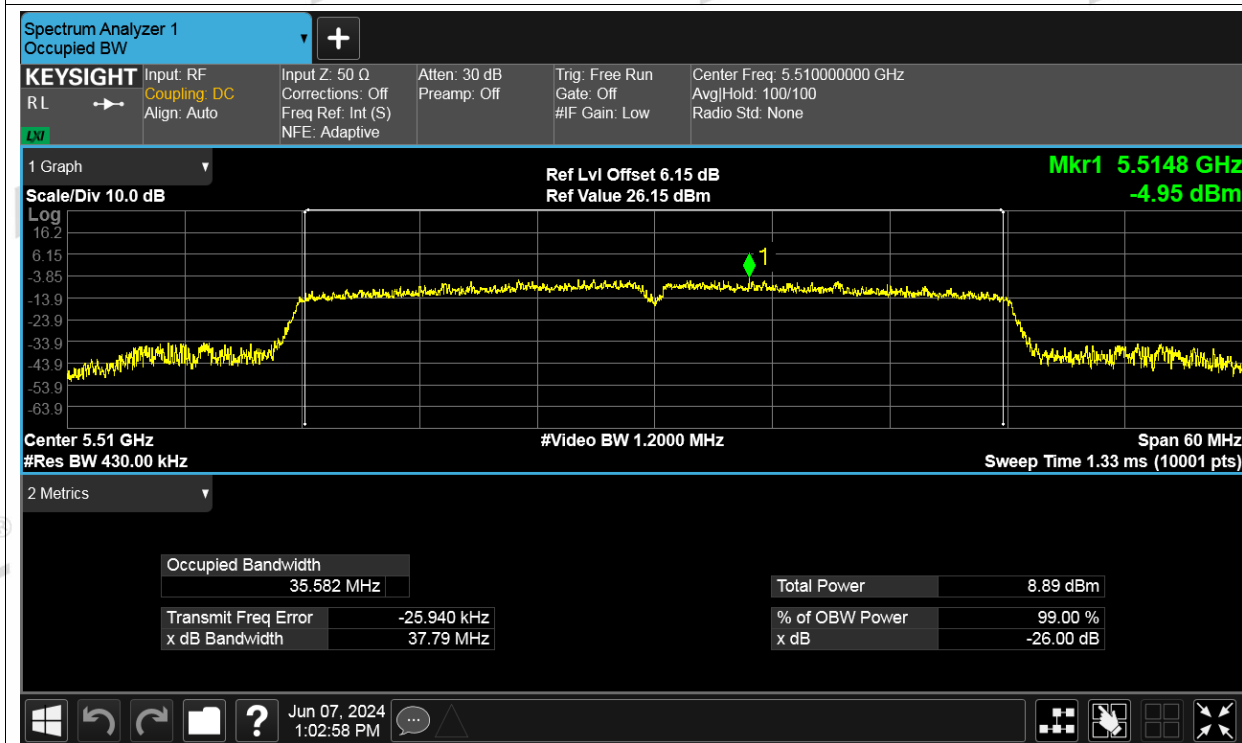


OBW NVNT n40 5510MHz Ant3

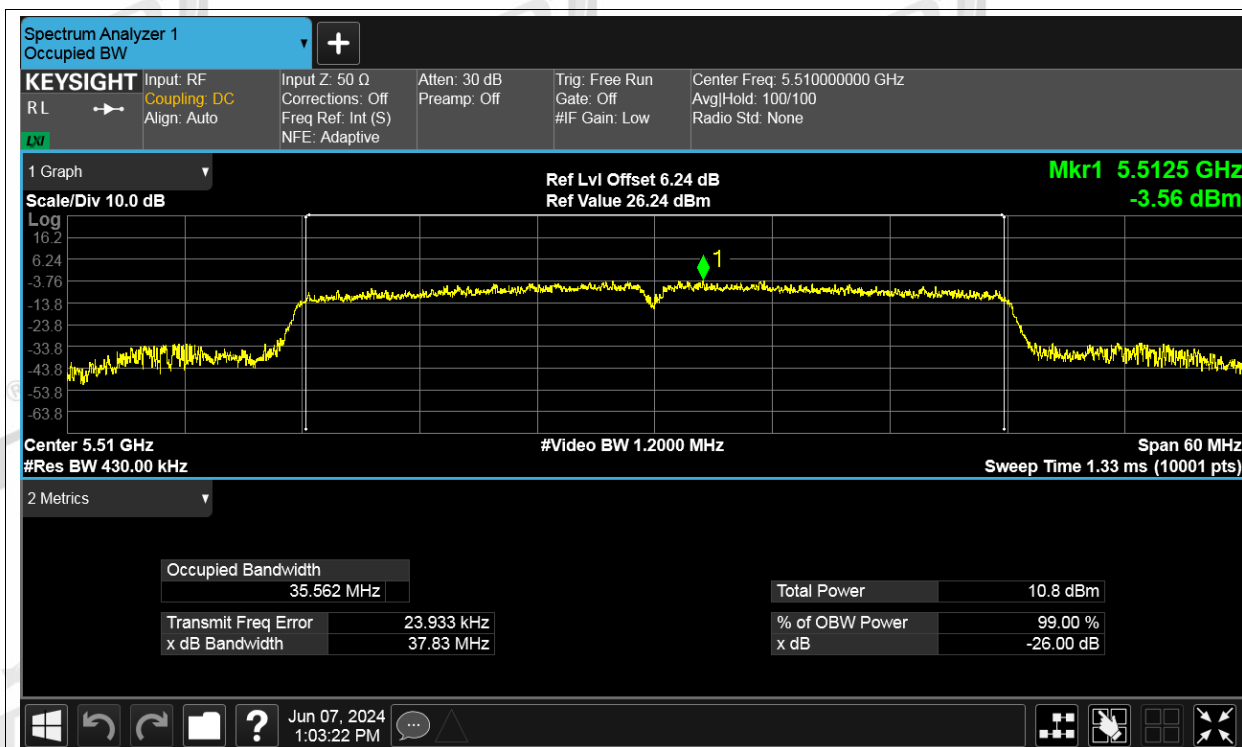


OBW NVNT n40 5550MHz Ant1



OBW NVNT n40 5550MHz Ant2

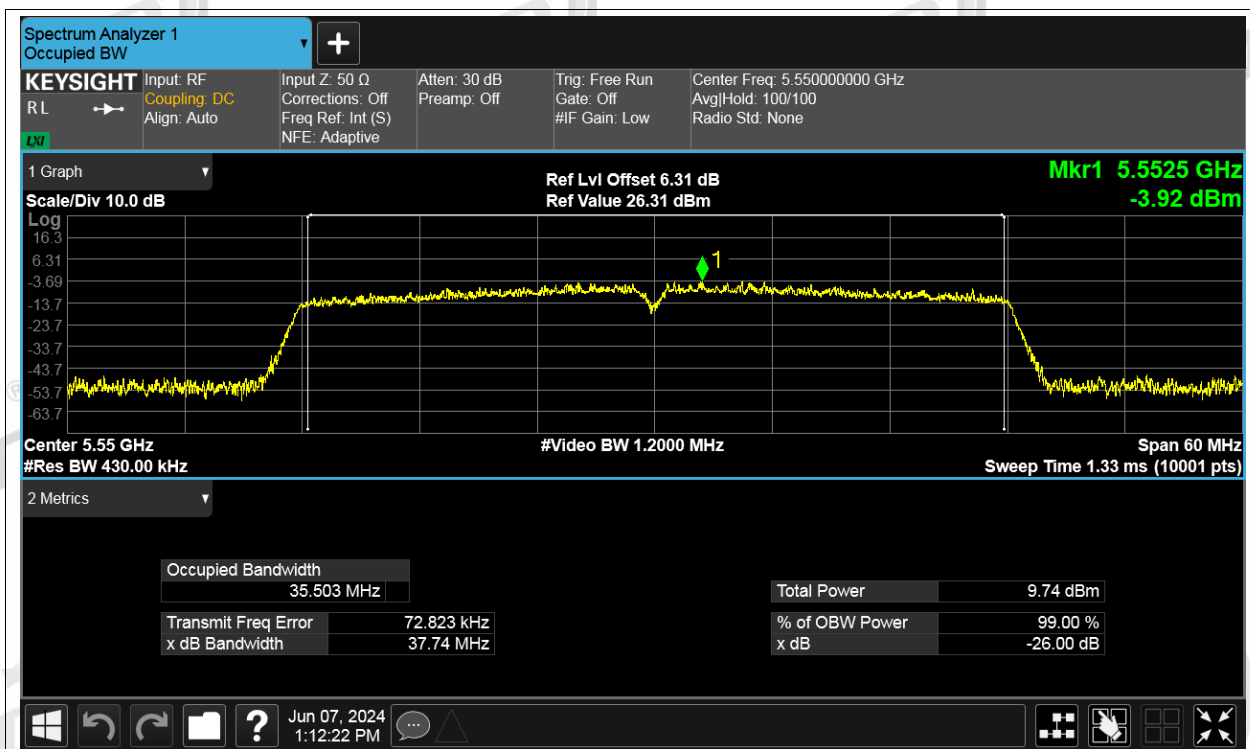

OBW NVNT n40 5550MHz Ant3

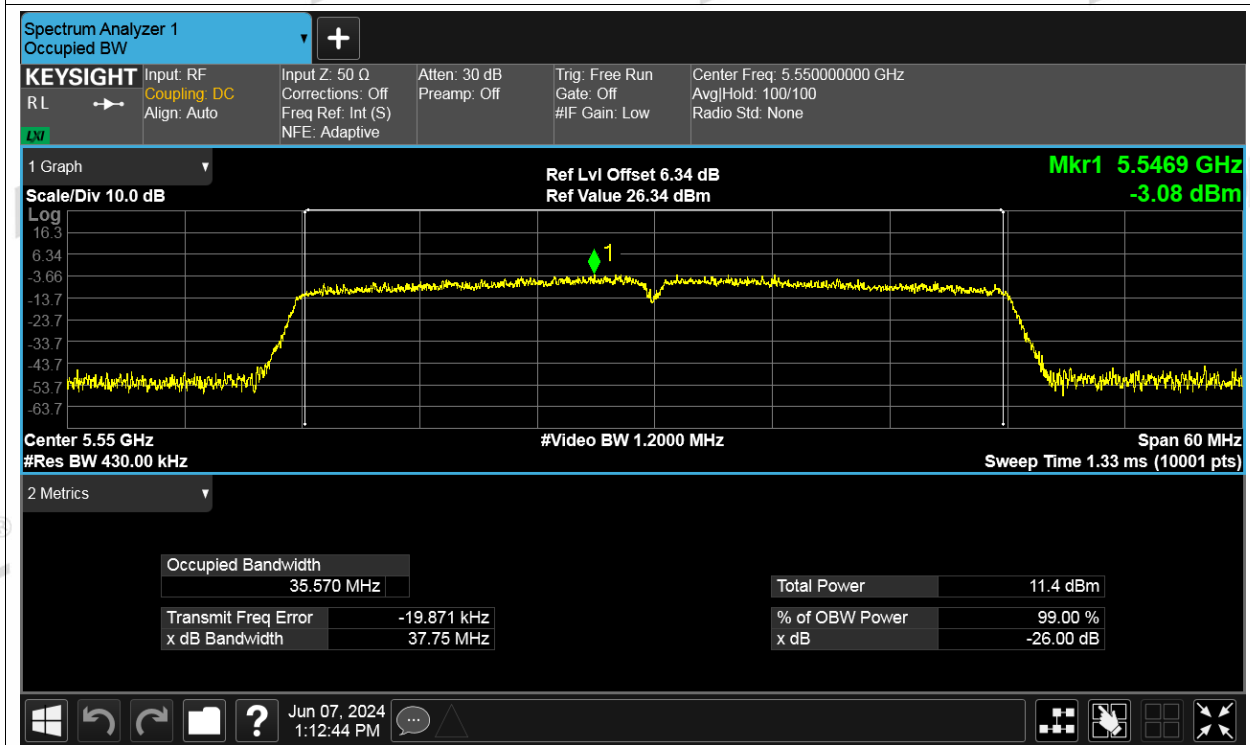


OBW NVNT n40 5670MHz Ant1




OBW NVNT n40 5670MHz Ant2




OBW NVNT n40 5670MHz Ant3

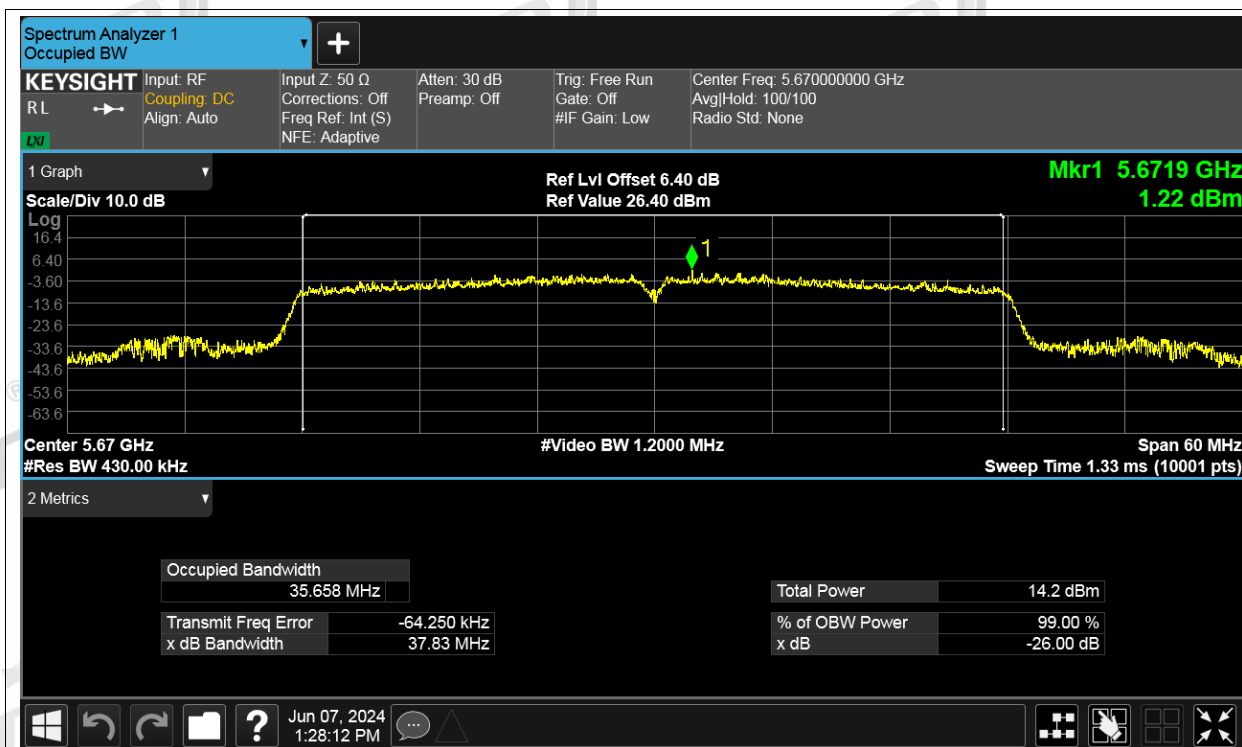


OBW NVNT n40 5755MHz Ant1

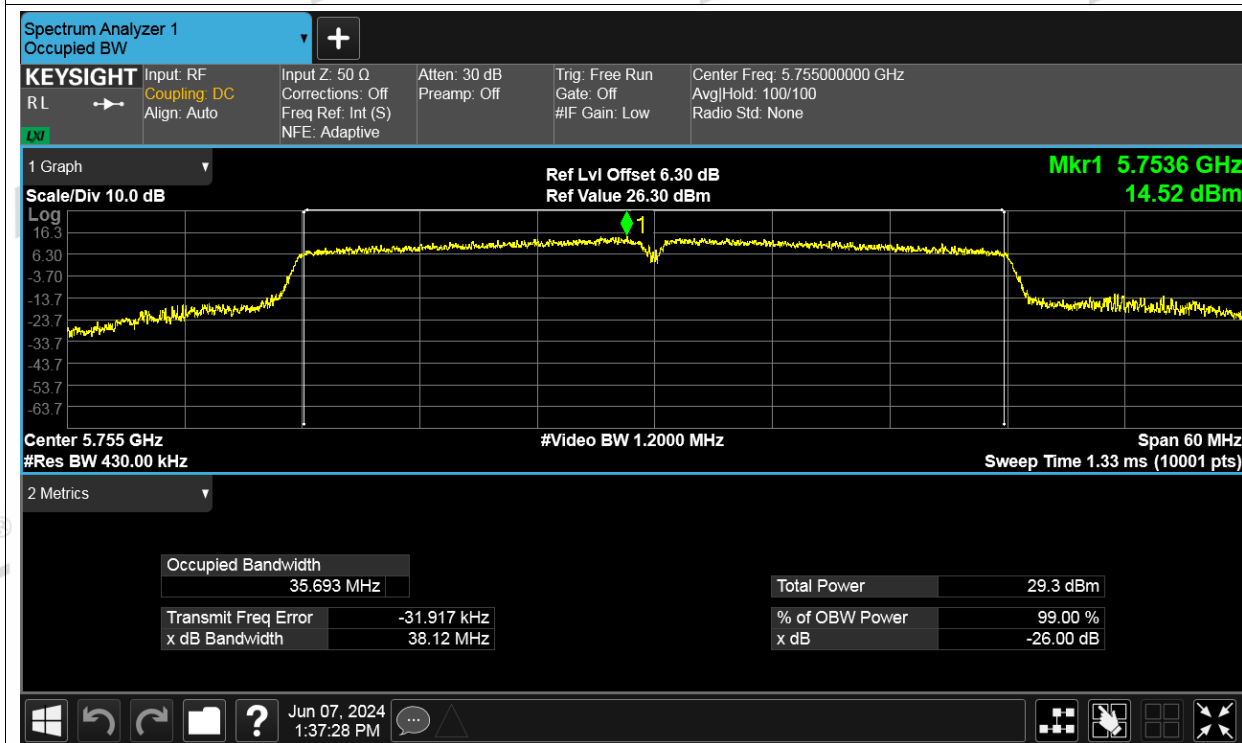


OBW NVNT n40 5755MHz Ant2

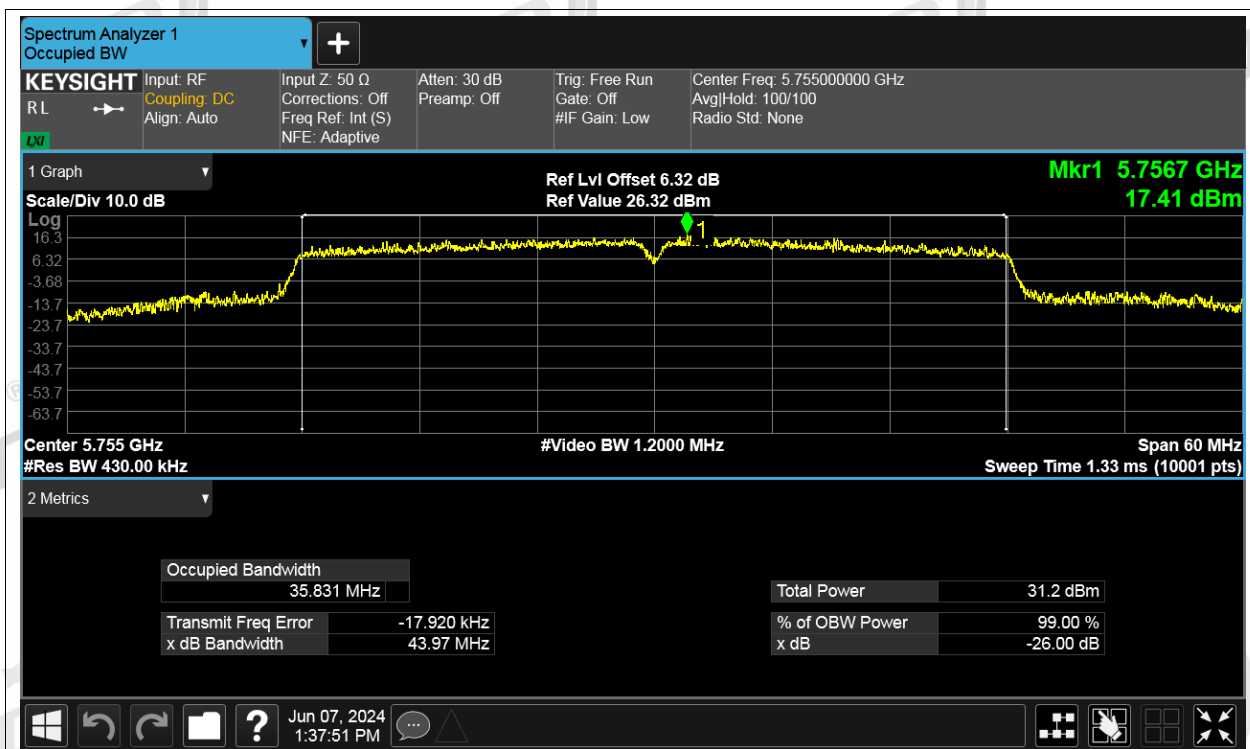


OBW NVNT n40 5755MHz Ant3

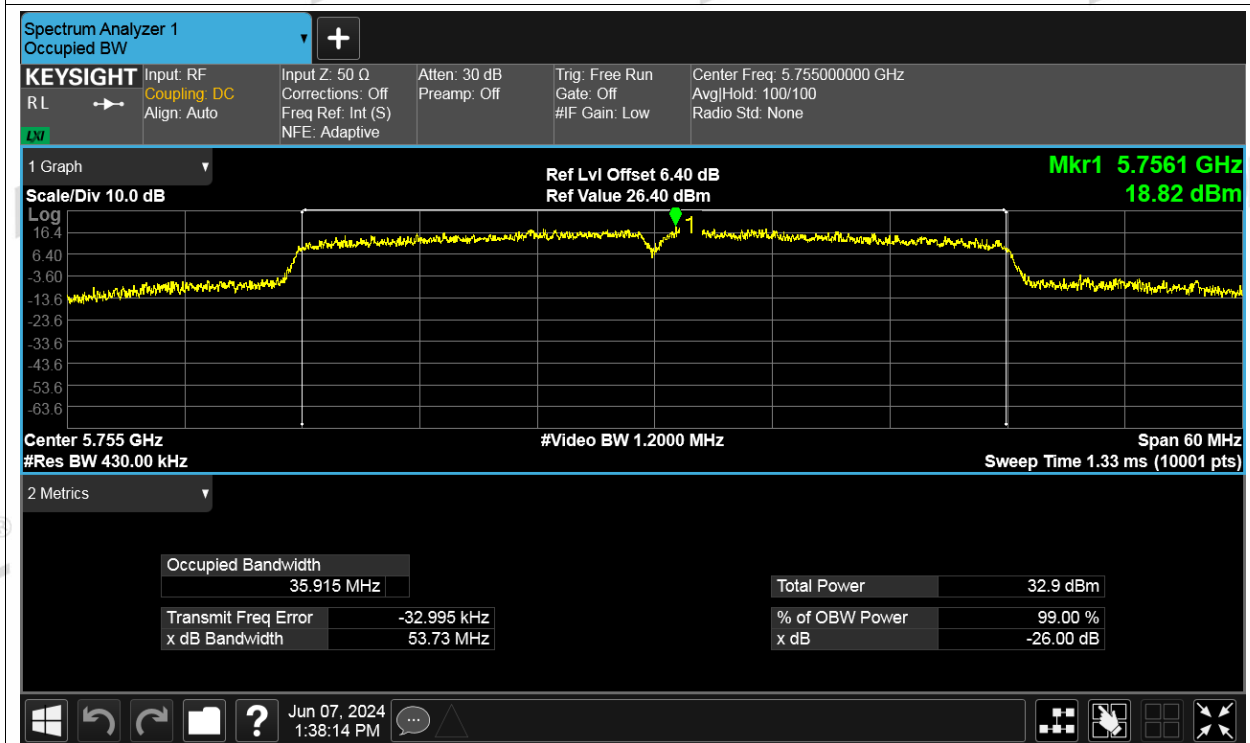


OBW NVNT n40 5795MHz Ant1

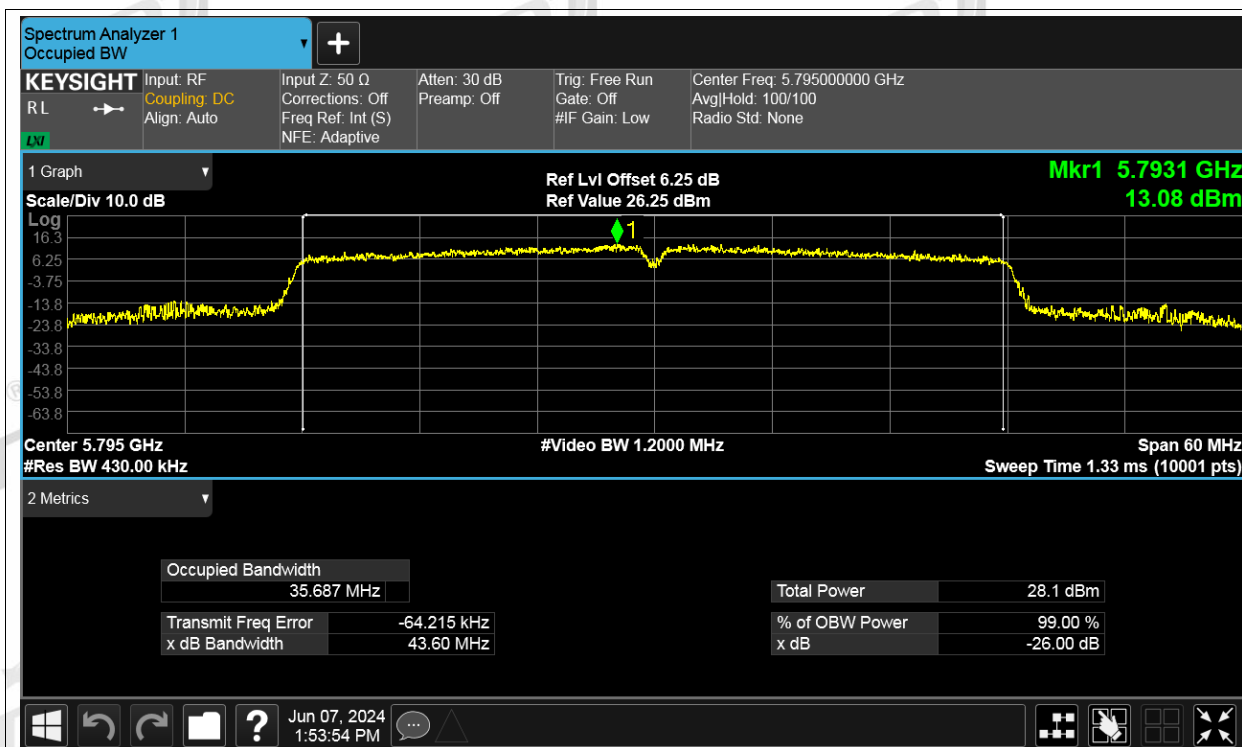

OBW NVNT n40 5795MHz Ant2

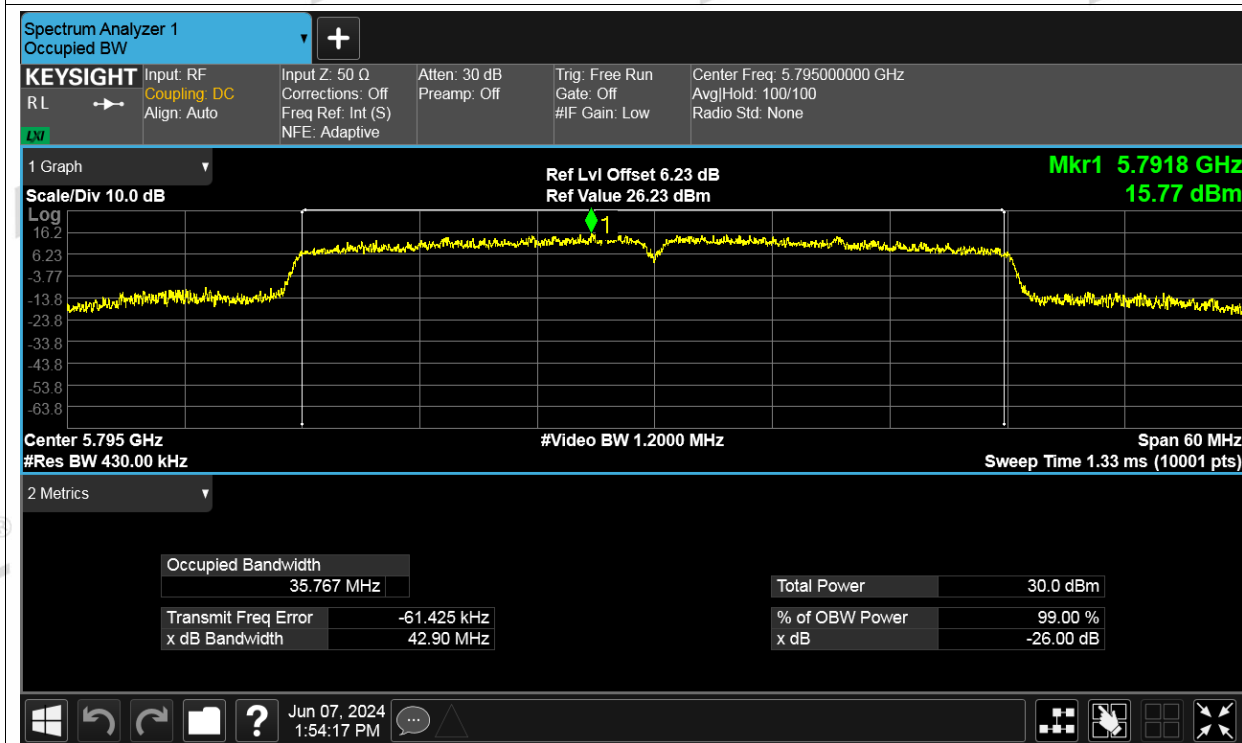

OBW NVNT n40 5795MHz Ant3

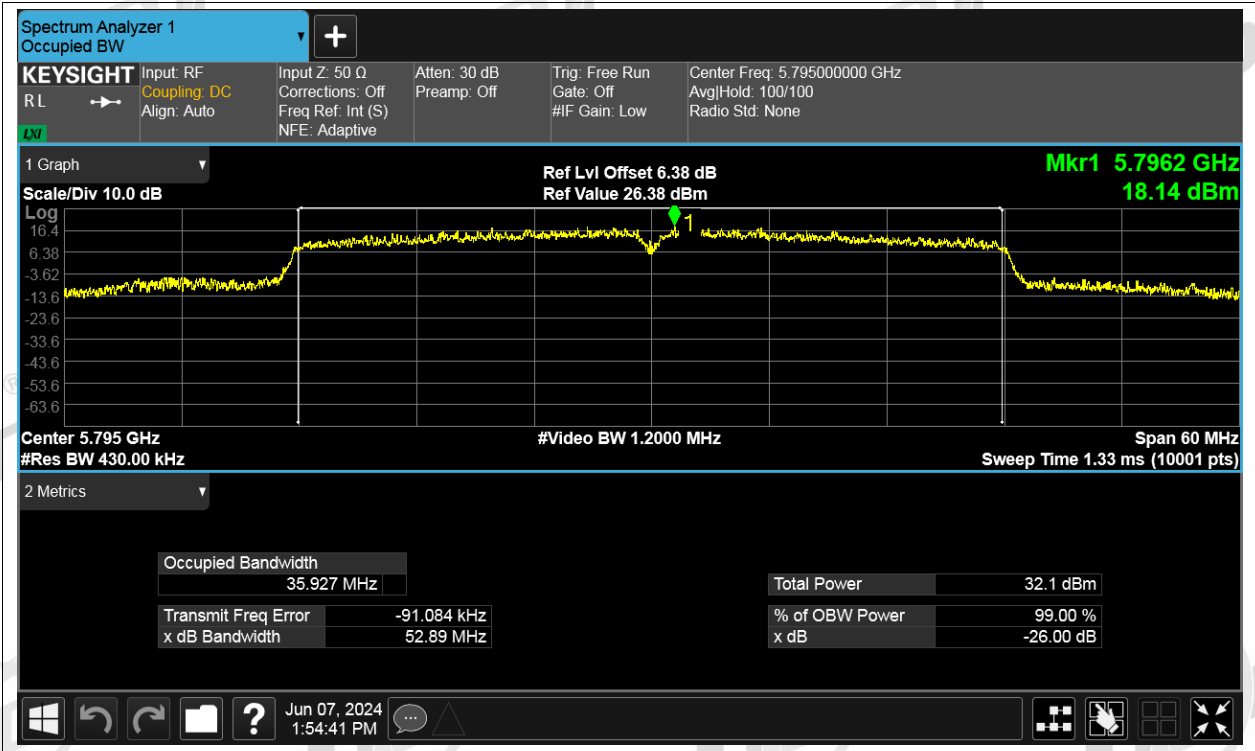

Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	12.89	0.12	13.01	17	Pass
NVNT	a	5200	Ant1	12.84	0.13	12.97	17	Pass
NVNT	a	5240	Ant1	12.33	0.14	12.47	17	Pass
NVNT	a	5260	Ant1	10.01	0.13	10.14	11	Pass
NVNT	a	5280	Ant1	10.22	0.13	10.35	11	Pass
NVNT	a	5320	Ant1	10.36	0.14	10.5	11	Pass
NVNT	a	5500	Ant1	10.48	0.14	10.62	11	Pass
NVNT	a	5580	Ant1	10.8	0.11	10.91	11	Pass
NVNT	a	5700	Ant1	10.58	0.13	10.71	11	Pass
NVNT	a	5745	Ant1	10.33	0.13	10.46	30	Pass
NVNT	a	5785	Ant1	9.54	0.13	9.67	30	Pass
NVNT	a	5825	Ant1	8.57	0.14	8.71	30	Pass
NVNT	a	5180	Ant2	11.84	0.14	11.98	17	Pass
NVNT	a	5200	Ant2	11.97	0.14	12.11	17	Pass
NVNT	a	5240	Ant2	11.39	0.13	11.52	17	Pass
NVNT	a	5260	Ant2	10.57	0.13	10.7	11	Pass
NVNT	a	5280	Ant2	10.1	0.13	10.23	11	Pass
NVNT	a	5320	Ant2	10.13	0.14	10.27	11	Pass
NVNT	a	5500	Ant2	10.44	0.14	10.58	11	Pass
NVNT	a	5580	Ant2	10.58	0.14	10.72	11	Pass
NVNT	a	5700	Ant2	10.5	0.12	10.62	11	Pass
NVNT	a	5745	Ant2	11.23	0.13	11.36	30	Pass
NVNT	a	5785	Ant2	10.6	0.13	10.73	30	Pass
NVNT	a	5825	Ant2	9.31	0.14	9.45	30	Pass
NVNT	a	5180	Ant3	14.3	0.14	14.44	17	Pass
NVNT	a	5200	Ant3	13.93	0.14	14.07	17	Pass
NVNT	a	5240	Ant3	14.08	0.12	14.2	17	Pass
NVNT	a	5260	Ant3	10.62	0.14	10.76	11	Pass
NVNT	a	5280	Ant3	10.36	0.13	10.49	11	Pass
NVNT	a	5320	Ant3	10.25	0.14	10.39	11	Pass
NVNT	a	5500	Ant3	9.82	0.14	9.96	11	Pass
NVNT	a	5580	Ant3	10.67	0.14	10.81	11	Pass
NVNT	a	5700	Ant3	10.1	0.14	10.24	11	Pass
NVNT	a	5745	Ant3	12.51	0.14	12.65	30	Pass
NVNT	a	5785	Ant3	12.71	0.14	12.85	30	Pass
NVNT	a	5825	Ant3	11.61	0.14	11.75	30	Pass
NVNT	ac160	5250	Ant1	-7.04	1.66	-5.38	7.45	Pass

NVNT	ac160	5250	Ant2	-9.94	1.66	-8.28	7.45	Pass
NVNT	ac160	5250	Ant3	-5.34	1.66	-3.68	7.45	Pass
NVNT	ac160	5250	Sum	-2.28	1.66	-0.62	7.45	Pass
NVNT	ac160	5570	Ant1	-1.79	1.52	-0.27	6.94	Pass
NVNT	ac160	5570	Ant2	-0.79	1.52	0.73	6.94	Pass
NVNT	ac160	5570	Ant3	0.01	1.52	1.53	6.94	Pass
NVNT	ac160	5570	Sum	3.98	1.52	5.5	6.94	Pass
NVNT	ac20	5180	Ant1	8.16	0.38	8.54	14.58	Pass
NVNT	ac20	5180	Ant2	7.22	0.38	7.6	14.58	Pass
NVNT	ac20	5180	Ant3	9.54	0.38	9.92	14.58	Pass
NVNT	ac20	5180	Sum	13.18	0.38	13.56	14.58	Pass
NVNT	ac20	5200	Ant1	8.06	0.37	8.43	14.58	Pass
NVNT	ac20	5200	Ant2	7	0.37	7.37	14.58	Pass
NVNT	ac20	5200	Ant3	9.68	0.37	10.05	14.58	Pass
NVNT	ac20	5200	Sum	13.16	0.37	13.53	14.58	Pass
NVNT	ac20	5240	Ant1	7.56	0.38	7.94	14.58	Pass
NVNT	ac20	5240	Ant2	6.65	0.38	7.03	14.58	Pass
NVNT	ac20	5240	Ant3	9.65	0.38	10.03	14.58	Pass
NVNT	ac20	5240	Sum	12.91	0.38	13.29	14.58	Pass
NVNT	ac20	5260	Ant1	0.15	0.39	0.54	7.45	Pass
NVNT	ac20	5260	Ant2	0.9	0.39	1.29	7.45	Pass
NVNT	ac20	5260	Ant3	2.85	0.39	3.24	7.45	Pass
NVNT	ac20	5260	Sum	6.23	0.39	6.62	7.45	Pass
NVNT	ac20	5280	Ant1	0.21	0.37	0.58	7.45	Pass
NVNT	ac20	5280	Ant2	0.86	0.37	1.23	7.45	Pass
NVNT	ac20	5280	Ant3	2.22	0.37	2.59	7.45	Pass
NVNT	ac20	5280	Sum	5.95	0.37	6.32	7.45	Pass
NVNT	ac20	5320	Ant1	-0.6	0.36	-0.24	7.45	Pass
NVNT	ac20	5320	Ant2	-0.09	0.36	0.27	7.45	Pass
NVNT	ac20	5320	Ant3	2.05	0.36	2.41	7.45	Pass
NVNT	ac20	5320	Sum	5.38	0.36	5.74	7.45	Pass
NVNT	ac20	5500	Ant1	0.2	0.37	0.57	6.94	Pass
NVNT	ac20	5500	Ant2	0.54	0.37	0.91	6.94	Pass
NVNT	ac20	5500	Ant3	1.56	0.37	1.93	6.94	Pass
NVNT	ac20	5500	Sum	5.58	0.37	5.95	6.94	Pass
NVNT	ac20	5580	Ant1	0.61	0.37	0.98	6.94	Pass
NVNT	ac20	5580	Ant2	1.02	0.37	1.39	6.94	Pass
NVNT	ac20	5580	Ant3	1.87	0.37	2.24	6.94	Pass
NVNT	ac20	5580	Sum	5.97	0.37	6.34	6.94	Pass
NVNT	ac20	5700	Ant1	0.21	0.35	0.56	6.94	Pass
NVNT	ac20	5700	Ant2	0.63	0.35	0.98	6.94	Pass
NVNT	ac20	5700	Ant3	2.58	0.35	2.93	6.94	Pass

NVNT	ac20	5700	Sum	6.04	0.35	6.39	6.94	Pass
NVNT	ac20	5745	Ant1	9.3	0.36	9.66	25.82	Pass
NVNT	ac20	5745	Ant2	11.01	0.36	11.37	25.82	Pass
NVNT	ac20	5745	Ant3	12.23	0.36	12.59	25.82	Pass
NVNT	ac20	5745	Sum	15.78	0.36	16.14	25.82	Pass
NVNT	ac20	5785	Ant1	8.83	0.36	9.19	25.82	Pass
NVNT	ac20	5785	Ant2	10.21	0.36	10.57	25.82	Pass
NVNT	ac20	5785	Ant3	12.16	0.36	12.52	25.82	Pass
NVNT	ac20	5785	Sum	15.39	0.36	15.75	25.82	Pass
NVNT	ac20	5825	Ant1	7.94	0.37	8.31	25.82	Pass
NVNT	ac20	5825	Ant2	9.24	0.37	9.61	25.82	Pass
NVNT	ac20	5825	Ant3	10.99	0.37	11.36	25.82	Pass
NVNT	ac20	5825	Sum	14.34	0.37	14.71	25.82	Pass
NVNT	ac40	5190	Ant1	8.18	0.64	8.82	14.58	Pass
NVNT	ac40	5190	Ant2	7.1	0.64	7.74	14.58	Pass
NVNT	ac40	5190	Ant3	9.39	0.64	10.03	14.58	Pass
NVNT	ac40	5190	Sum	13.1	0.64	13.74	14.58	Pass
NVNT	ac40	5230	Ant1	7.63	0.64	8.27	14.58	Pass
NVNT	ac40	5230	Ant2	6.09	0.64	6.73	14.58	Pass
NVNT	ac40	5230	Ant3	9.38	0.64	10.02	14.58	Pass
NVNT	ac40	5230	Sum	12.68	0.64	13.32	14.58	Pass
NVNT	ac40	5270	Ant1	0.05	0.65	0.7	7.45	Pass
NVNT	ac40	5270	Ant2	1.09	0.65	1.74	7.45	Pass
NVNT	ac40	5270	Ant3	2.97	0.65	3.62	7.45	Pass
NVNT	ac40	5270	Sum	6.31	0.65	6.96	7.45	Pass
NVNT	ac40	5310	Ant1	-0.74	0.64	-0.1	7.45	Pass
NVNT	ac40	5310	Ant2	-0.12	0.64	0.52	7.45	Pass
NVNT	ac40	5310	Ant3	2.02	0.64	2.66	7.45	Pass
NVNT	ac40	5310	Sum	5.33	0.64	5.97	7.45	Pass
NVNT	ac40	5510	Ant1	-0.72	0.65	-0.07	6.94	Pass
NVNT	ac40	5510	Ant2	-0.08	0.65	0.57	6.94	Pass
NVNT	ac40	5510	Ant3	1.73	0.65	2.38	6.94	Pass
NVNT	ac40	5510	Sum	5.21	0.65	5.86	6.94	Pass
NVNT	ac40	5550	Ant1	0.6	0.64	1.24	6.94	Pass
NVNT	ac40	5550	Ant2	0.91	0.64	1.55	6.94	Pass
NVNT	ac40	5550	Ant3	2.3	0.64	2.94	6.94	Pass
NVNT	ac40	5550	Sum	6.11	0.64	6.75	6.94	Pass
NVNT	ac40	5670	Ant1	0.45	0.64	1.09	6.94	Pass
NVNT	ac40	5670	Ant2	0.72	0.64	1.36	6.94	Pass
NVNT	ac40	5670	Ant3	2.77	0.64	3.41	6.94	Pass
NVNT	ac40	5670	Sum	6.21	0.64	6.85	6.94	Pass
NVNT	ac40	5755	Ant1	7.16	0.65	7.81	25.82	Pass

NVNT	ac40	5755	Ant2	9.17	0.65	9.82	25.82	Pass
NVNT	ac40	5755	Ant3	10.92	0.65	11.57	25.82	Pass
NVNT	ac40	5755	Sum	14.12	0.65	14.77	25.82	Pass
NVNT	ac40	5795	Ant1	7.23	0.65	7.88	25.82	Pass
NVNT	ac40	5795	Ant2	8.5	0.65	9.15	25.82	Pass
NVNT	ac40	5795	Ant3	10.7	0.65	11.35	25.82	Pass
NVNT	ac40	5795	Sum	13.82	0.65	14.47	25.82	Pass
NVNT	ac80	5210	Ant1	7.1	1.03	8.13	14.58	Pass
NVNT	ac80	5210	Ant2	5.85	1.03	6.88	14.58	Pass
NVNT	ac80	5210	Ant3	8.84	1.03	9.87	14.58	Pass
NVNT	ac80	5210	Sum	12.21	1.03	13.24	14.58	Pass
NVNT	ac80	5290	Ant1	-0.7	1.03	0.33	7.45	Pass
NVNT	ac80	5290	Ant2	0.59	1.03	1.62	7.45	Pass
NVNT	ac80	5290	Ant3	2.75	1.03	3.78	7.45	Pass
NVNT	ac80	5290	Sum	5.89	1.03	6.92	7.45	Pass
NVNT	ac80	5530	Ant1	-0.2	1.04	0.84	6.94	Pass
NVNT	ac80	5530	Ant2	0.6	1.04	1.64	6.94	Pass
NVNT	ac80	5530	Ant3	2.27	1.04	3.31	6.94	Pass
NVNT	ac80	5530	Sum	5.79	1.04	6.83	6.94	Pass
NVNT	ac80	5610	Ant1	-0.16	1.04	0.88	6.94	Pass
NVNT	ac80	5610	Ant2	0.05	1.04	1.09	6.94	Pass
NVNT	ac80	5610	Ant3	1.86	1.04	2.9	6.94	Pass
NVNT	ac80	5610	Sum	5.45	1.04	6.49	6.94	Pass
NVNT	ac80	5775	Ant1	3.91	1.04	4.95	25.82	Pass
NVNT	ac80	5775	Ant2	5.61	1.04	6.65	25.82	Pass
NVNT	ac80	5775	Ant3	7.72	1.04	8.76	25.82	Pass
NVNT	ac80	5775	Sum	10.8	1.04	11.84	25.82	Pass
NVNT	ax160	5250	Ant1	-6.52	0.43	-6.09	7.45	Pass
NVNT	ax160	5250	Ant2	-6.22	0.43	-5.79	7.45	Pass
NVNT	ax160	5250	Ant3	-5.26	0.43	-4.83	7.45	Pass
NVNT	ax160	5250	Sum	-1.19	0.43	-0.76	7.45	Pass
NVNT	ax160	5570	Ant1	-1.88	0.42	-1.46	6.94	Pass
NVNT	ax160	5570	Ant2	-0.89	0.42	-0.47	6.94	Pass
NVNT	ax160	5570	Ant3	0.22	0.42	0.64	6.94	Pass
NVNT	ax160	5570	Sum	4.01	0.42	4.43	6.94	Pass
NVNT	ax20	5180	Ant1	8.17	0.4	8.57	14.58	Pass
NVNT	ax20	5180	Ant2	7.74	0.4	8.14	14.58	Pass
NVNT	ax20	5180	Ant3	9.67	0.4	10.07	14.58	Pass
NVNT	ax20	5180	Sum	13.38	0.4	13.78	14.58	Pass
NVNT	ax20	5200	Ant1	8.54	0.38	8.92	14.58	Pass
NVNT	ax20	5200	Ant2	6.94	0.38	7.32	14.58	Pass
NVNT	ax20	5200	Ant3	9.4	0.38	9.78	14.58	Pass

NVNT	ax20	5200	Sum	13.18	0.38	13.56	14.58	Pass
NVNT	ax20	5240	Ant1	8.28	0.4	8.68	14.58	Pass
NVNT	ax20	5240	Ant2	6.45	0.4	6.85	14.58	Pass
NVNT	ax20	5240	Ant3	9.69	0.4	10.09	14.58	Pass
NVNT	ax20	5240	Sum	13.11	0.4	13.51	14.58	Pass
NVNT	ax20	5260	Ant1	0.28	0.39	0.67	7.45	Pass
NVNT	ax20	5260	Ant2	1.06	0.39	1.45	7.45	Pass
NVNT	ax20	5260	Ant3	3.05	0.39	3.44	7.45	Pass
NVNT	ax20	5260	Sum	6.4	0.39	6.79	7.45	Pass
NVNT	ax20	5280	Ant1	0.07	0.38	0.45	7.45	Pass
NVNT	ax20	5280	Ant2	0.68	0.38	1.06	7.45	Pass
NVNT	ax20	5280	Ant3	2.26	0.38	2.64	7.45	Pass
NVNT	ax20	5280	Sum	5.88	0.38	6.26	7.45	Pass
NVNT	ax20	5320	Ant1	-0.62	0.38	-0.24	7.45	Pass
NVNT	ax20	5320	Ant2	0.02	0.38	0.4	7.45	Pass
NVNT	ax20	5320	Ant3	2.51	0.38	2.89	7.45	Pass
NVNT	ax20	5320	Sum	5.63	0.38	6.01	7.45	Pass
NVNT	ax20	5500	Ant1	-0.07	0.4	0.33	6.94	Pass
NVNT	ax20	5500	Ant2	0.68	0.4	1.08	6.94	Pass
NVNT	ax20	5500	Ant3	1.87	0.4	2.27	6.94	Pass
NVNT	ax20	5500	Sum	5.67	0.4	6.07	6.94	Pass
NVNT	ax20	5580	Ant1	0.23	0.38	0.61	6.94	Pass
NVNT	ax20	5580	Ant2	0.97	0.38	1.35	6.94	Pass
NVNT	ax20	5580	Ant3	2.22	0.38	2.6	6.94	Pass
NVNT	ax20	5580	Sum	5.99	0.38	6.37	6.94	Pass
NVNT	ax20	5700	Ant1	0.31	0.4	0.71	6.94	Pass
NVNT	ax20	5700	Ant2	0.66	0.4	1.06	6.94	Pass
NVNT	ax20	5700	Ant3	2.54	0.4	2.94	6.94	Pass
NVNT	ax20	5700	Sum	6.06	0.4	6.46	6.94	Pass
NVNT	ax20	5745	Ant1	9.04	0.38	9.42	25.82	Pass
NVNT	ax20	5745	Ant2	10.68	0.38	11.06	25.82	Pass
NVNT	ax20	5745	Ant3	11.69	0.38	12.07	25.82	Pass
NVNT	ax20	5745	Sum	15.37	0.38	15.75	25.82	Pass
NVNT	ax20	5785	Ant1	8.82	0.38	9.2	25.82	Pass
NVNT	ax20	5785	Ant2	10.09	0.38	10.47	25.82	Pass
NVNT	ax20	5785	Ant3	11.98	0.38	12.36	25.82	Pass
NVNT	ax20	5785	Sum	15.26	0.38	15.64	25.82	Pass
NVNT	ax20	5825	Ant1	8.11	0.4	8.51	25.82	Pass
NVNT	ax20	5825	Ant2	8.93	0.4	9.33	25.82	Pass
NVNT	ax20	5825	Ant3	11.41	0.4	11.81	25.82	Pass
NVNT	ax20	5825	Sum	14.49	0.4	14.89	25.82	Pass
NVNT	ax40	5190	Ant1	8.48	0.4	8.88	14.58	Pass

NVNT	ax40	5190	Ant2	7.35	0.4	7.75	14.58	Pass
NVNT	ax40	5190	Ant3	10.01	0.4	10.41	14.58	Pass
NVNT	ax40	5190	Sum	13.52	0.4	13.92	14.58	Pass
NVNT	ax40	5230	Ant1	7.9	0.39	8.29	14.58	Pass
NVNT	ax40	5230	Ant2	6.7	0.39	7.09	14.58	Pass
NVNT	ax40	5230	Ant3	9.63	0.39	10.02	14.58	Pass
NVNT	ax40	5230	Sum	13.02	0.39	13.41	14.58	Pass
NVNT	ax40	5270	Ant1	0.08	0.41	0.49	7.45	Pass
NVNT	ax40	5270	Ant2	1.64	0.41	2.05	7.45	Pass
NVNT	ax40	5270	Ant3	2.67	0.41	3.08	7.45	Pass
NVNT	ax40	5270	Sum	6.36	0.41	6.77	7.45	Pass
NVNT	ax40	5310	Ant1	-0.82	0.41	-0.41	7.45	Pass
NVNT	ax40	5310	Ant2	0.59	0.41	1	7.45	Pass
NVNT	ax40	5310	Ant3	2.72	0.41	3.13	7.45	Pass
NVNT	ax40	5310	Sum	5.85	0.41	6.26	7.45	Pass
NVNT	ax40	5510	Ant1	-0.47	1.03	0.56	6.94	Pass
NVNT	ax40	5510	Ant2	0.17	1.03	1.2	6.94	Pass
NVNT	ax40	5510	Ant3	1.9	1.03	2.93	6.94	Pass
NVNT	ax40	5510	Sum	5.42	1.03	6.45	6.94	Pass
NVNT	ax40	5550	Ant1	0.84	0.39	1.23	6.94	Pass
NVNT	ax40	5550	Ant2	1.54	0.39	1.93	6.94	Pass
NVNT	ax40	5550	Ant3	2.59	0.39	2.98	6.94	Pass
NVNT	ax40	5550	Sum	6.49	0.39	6.88	6.94	Pass
NVNT	ax40	5670	Ant1	0.69	0.39	1.08	6.94	Pass
NVNT	ax40	5670	Ant2	0.92	0.39	1.31	6.94	Pass
NVNT	ax40	5670	Ant3	2.6	0.39	2.99	6.94	Pass
NVNT	ax40	5670	Sum	6.26	0.39	6.65	6.94	Pass
NVNT	ax40	5755	Ant1	7.78	0.39	8.17	25.82	Pass
NVNT	ax40	5755	Ant2	9.61	0.39	10	25.82	Pass
NVNT	ax40	5755	Ant3	10.91	0.39	11.3	25.82	Pass
NVNT	ax40	5755	Sum	14.39	0.39	14.78	25.82	Pass
NVNT	ax40	5795	Ant1	7.15	0.41	7.56	25.82	Pass
NVNT	ax40	5795	Ant2	8.79	0.41	9.2	25.82	Pass
NVNT	ax40	5795	Ant3	11.07	0.41	11.48	25.82	Pass
NVNT	ax40	5795	Sum	14.07	0.41	14.48	25.82	Pass
NVNT	ax80	5210	Ant1	7.87	0.41	8.28	14.58	Pass
NVNT	ax80	5210	Ant2	7.04	0.41	7.45	14.58	Pass
NVNT	ax80	5210	Ant3	9.61	0.41	10.02	14.58	Pass
NVNT	ax80	5210	Sum	13.08	0.41	13.49	14.58	Pass
NVNT	ax80	5290	Ant1	0.44	0.49	0.93	7.45	Pass
NVNT	ax80	5290	Ant2	1.69	0.49	2.18	7.45	Pass
NVNT	ax80	5290	Ant3	2.45	0.49	2.94	7.45	Pass

NVNT	ax80	5290	Sum	6.38	0.49	6.87	7.45	Pass
NVNT	ax80	5530	Ant1	0.51	0.49	1	6.94	Pass
NVNT	ax80	5530	Ant2	0.91	0.49	1.4	6.94	Pass
NVNT	ax80	5530	Ant3	3.01	0.49	3.5	6.94	Pass
NVNT	ax80	5530	Sum	6.39	0.49	6.88	6.94	Pass
NVNT	ax80	5610	Ant1	0.35	0.48	0.83	6.94	Pass
NVNT	ax80	5610	Ant2	1.06	0.48	1.54	6.94	Pass
NVNT	ax80	5610	Ant3	2.22	0.48	2.7	6.94	Pass
NVNT	ax80	5610	Sum	6.05	0.48	6.53	6.94	Pass
NVNT	ax80	5775	Ant1	4.6	0.48	5.08	25.82	Pass
NVNT	ax80	5775	Ant2	5.88	0.48	6.36	25.82	Pass
NVNT	ax80	5775	Ant3	7.92	0.48	8.4	25.82	Pass
NVNT	ax80	5775	Sum	11.12	0.48	11.6	25.82	Pass
NVNT	be160	5250	Ant1	-6.71	0.41	-6.3	7.45	Pass
NVNT	be160	5250	Ant2	-5.86	0.41	-5.45	7.45	Pass
NVNT	be160	5250	Ant3	-4.82	0.41	-4.41	7.45	Pass
NVNT	be160	5250	Sum	-0.96	0.41	-0.55	7.45	Pass
NVNT	be160	5570	Ant1	-1.96	0.41	-1.55	6.94	Pass
NVNT	be160	5570	Ant2	-0.67	0.41	-0.26	6.94	Pass
NVNT	be160	5570	Ant3	0.63	0.41	1.04	6.94	Pass
NVNT	be160	5570	Sum	4.23	0.41	4.64	6.94	Pass
NVNT	be20	5180	Ant1	8.12	0.37	8.49	14.58	Pass
NVNT	be20	5180	Ant2	7.11	0.37	7.48	14.58	Pass
NVNT	be20	5180	Ant3	9.66	0.37	10.03	14.58	Pass
NVNT	be20	5180	Sum	13.2	0.37	13.57	14.58	Pass
NVNT	be20	5200	Ant1	8.19	0.39	8.58	14.58	Pass
NVNT	be20	5200	Ant2	7.08	0.39	7.47	14.58	Pass
NVNT	be20	5200	Ant3	9.81	0.39	10.2	14.58	Pass
NVNT	be20	5200	Sum	13.28	0.39	13.67	14.58	Pass
NVNT	be20	5240	Ant1	8.04	0.39	8.43	14.58	Pass
NVNT	be20	5240	Ant2	6.26	0.39	6.65	14.58	Pass
NVNT	be20	5240	Ant3	9.89	0.39	10.28	14.58	Pass
NVNT	be20	5240	Sum	13.08	0.39	13.47	14.58	Pass
NVNT	be20	5260	Ant1	0.02	0.39	0.41	7.45	Pass
NVNT	be20	5260	Ant2	1.16	0.39	1.55	7.45	Pass
NVNT	be20	5260	Ant3	2.57	0.39	2.96	7.45	Pass
NVNT	be20	5260	Sum	6.15	0.39	6.54	7.45	Pass
NVNT	be20	5280	Ant1	0.18	0.39	0.57	7.45	Pass
NVNT	be20	5280	Ant2	1.25	0.39	1.64	7.45	Pass
NVNT	be20	5280	Ant3	2.34	0.39	2.73	7.45	Pass
NVNT	be20	5280	Sum	6.12	0.39	6.51	7.45	Pass
NVNT	be20	5320	Ant1	-0.59	0.39	-0.2	7.45	Pass

NVNT	be20	5320	Ant2	0.13	0.39	0.52	7.45	Pass
NVNT	be20	5320	Ant3	1.99	0.39	2.38	7.45	Pass
NVNT	be20	5320	Sum	5.42	0.39	5.81	7.45	Pass
NVNT	be20	5500	Ant1	-0.13	0.39	0.26	6.94	Pass
NVNT	be20	5500	Ant2	0.35	0.39	0.74	6.94	Pass
NVNT	be20	5500	Ant3	1.67	0.39	2.06	6.94	Pass
NVNT	be20	5500	Sum	5.47	0.39	5.86	6.94	Pass
NVNT	be20	5580	Ant1	0.62	0.37	0.99	6.94	Pass
NVNT	be20	5580	Ant2	0.75	0.37	1.12	6.94	Pass
NVNT	be20	5580	Ant3	1.79	0.37	2.16	6.94	Pass
NVNT	be20	5580	Sum	5.86	0.37	6.23	6.94	Pass
NVNT	be20	5700	Ant1	0.14	0.38	0.52	6.94	Pass
NVNT	be20	5700	Ant2	0.32	0.38	0.7	6.94	Pass
NVNT	be20	5700	Ant3	2.67	0.38	3.05	6.94	Pass
NVNT	be20	5700	Sum	5.98	0.38	6.36	6.94	Pass
NVNT	be20	5745	Ant1	9.04	0.37	9.41	25.82	Pass
NVNT	be20	5745	Ant2	10.63	0.37	11	25.82	Pass
NVNT	be20	5745	Ant3	12.17	0.37	12.54	25.82	Pass
NVNT	be20	5745	Sum	15.57	0.37	15.94	25.82	Pass
NVNT	be20	5785	Ant1	8.66	0.38	9.04	25.82	Pass
NVNT	be20	5785	Ant2	10.33	0.38	10.71	25.82	Pass
NVNT	be20	5785	Ant3	12.27	0.38	12.65	25.82	Pass
NVNT	be20	5785	Sum	15.44	0.38	15.82	25.82	Pass
NVNT	be20	5825	Ant1	7.8	0.37	8.17	25.82	Pass
NVNT	be20	5825	Ant2	8.86	0.37	9.23	25.82	Pass
NVNT	be20	5825	Ant3	11.04	0.37	11.41	25.82	Pass
NVNT	be20	5825	Sum	14.22	0.37	14.59	25.82	Pass
NVNT	be40	5190	Ant1	8.32	0.39	8.71	14.58	Pass
NVNT	be40	5190	Ant2	7.59	0.39	7.98	14.58	Pass
NVNT	be40	5190	Ant3	10.09	0.39	10.48	14.58	Pass
NVNT	be40	5190	Sum	13.57	0.39	13.96	14.58	Pass
NVNT	be40	5230	Ant1	8.25	0.4	8.65	14.58	Pass
NVNT	be40	5230	Ant2	6.86	0.4	7.26	14.58	Pass
NVNT	be40	5230	Ant3	9.65	0.4	10.05	14.58	Pass
NVNT	be40	5230	Sum	13.17	0.4	13.57	14.58	Pass
NVNT	be40	5270	Ant1	0.05	0.39	0.44	7.45	Pass
NVNT	be40	5270	Ant2	1.75	0.39	2.14	7.45	Pass
NVNT	be40	5270	Ant3	3.14	0.39	3.53	7.45	Pass
NVNT	be40	5270	Sum	6.6	0.39	6.99	7.45	Pass
NVNT	be40	5310	Ant1	-0.43	0.39	-0.04	7.45	Pass
NVNT	be40	5310	Ant2	0.27	0.39	0.66	7.45	Pass
NVNT	be40	5310	Ant3	2.11	0.39	2.5	7.45	Pass

NVNT	be40	5310	Sum	5.56	0.39	5.95	7.45	Pass
NVNT	be40	5510	Ant1	-0.65	0.39	-0.26	6.94	Pass
NVNT	be40	5510	Ant2	-0.08	0.39	0.31	6.94	Pass
NVNT	be40	5510	Ant3	1.57	0.39	1.96	6.94	Pass
NVNT	be40	5510	Sum	5.16	0.39	5.55	6.94	Pass
NVNT	be40	5550	Ant1	0.42	0.41	0.83	6.94	Pass
NVNT	be40	5550	Ant2	1.66	0.41	2.07	6.94	Pass
NVNT	be40	5550	Ant3	2.84	0.41	3.25	6.94	Pass
NVNT	be40	5550	Sum	6.52	0.41	6.93	6.94	Pass
NVNT	be40	5670	Ant1	0.93	0.39	1.32	6.94	Pass
NVNT	be40	5670	Ant2	0.81	0.39	1.2	6.94	Pass
NVNT	be40	5670	Ant3	2.74	0.39	3.13	6.94	Pass
NVNT	be40	5670	Sum	6.36	0.39	6.75	6.94	Pass
NVNT	be40	5755	Ant1	7.41	0.39	7.8	25.82	Pass
NVNT	be40	5755	Ant2	9.19	0.39	9.58	25.82	Pass
NVNT	be40	5755	Ant3	11.28	0.39	11.67	25.82	Pass
NVNT	be40	5755	Sum	14.35	0.39	14.74	25.82	Pass
NVNT	be40	5795	Ant1	7.25	0.39	7.64	25.82	Pass
NVNT	be40	5795	Ant2	8.66	0.39	9.05	25.82	Pass
NVNT	be40	5795	Ant3	11.02	0.39	11.41	25.82	Pass
NVNT	be40	5795	Sum	14.03	0.39	14.42	25.82	Pass
NVNT	be80	5210	Ant1	7.6	0.42	8.02	14.58	Pass
NVNT	be80	5210	Ant2	6.76	0.42	7.18	14.58	Pass
NVNT	be80	5210	Ant3	9.94	0.42	10.36	14.58	Pass
NVNT	be80	5210	Sum	13.09	0.42	13.51	14.58	Pass
NVNT	be80	5290	Ant1	0.2	0.41	0.61	7.45	Pass
NVNT	be80	5290	Ant2	1.52	0.41	1.93	7.45	Pass
NVNT	be80	5290	Ant3	3.07	0.41	3.48	7.45	Pass
NVNT	be80	5290	Sum	6.53	0.41	6.94	7.45	Pass
NVNT	be80	5530	Ant1	0.29	0.42	0.71	6.94	Pass
NVNT	be80	5530	Ant2	1.26	0.42	1.68	6.94	Pass
NVNT	be80	5530	Ant3	3.16	0.42	3.58	6.94	Pass
NVNT	be80	5530	Sum	6.51	0.42	6.93	6.94	Pass
NVNT	be80	5610	Ant1	0.68	0.43	1.11	6.94	Pass
NVNT	be80	5610	Ant2	1.05	0.43	1.48	6.94	Pass
NVNT	be80	5610	Ant3	2.62	0.43	3.05	6.94	Pass
NVNT	be80	5610	Sum	6.31	0.43	6.74	6.94	Pass
NVNT	be80	5775	Ant1	4.75	0.43	5.18	25.82	Pass
NVNT	be80	5775	Ant2	5.98	0.43	6.41	25.82	Pass
NVNT	be80	5775	Ant3	7.99	0.43	8.42	25.82	Pass
NVNT	be80	5775	Sum	11.22	0.43	11.65	25.82	Pass
NVNT	n20	5180	Ant1	8.52	0.37	8.89	14.58	Pass

NVNT	n20	5180	Ant2	6.95	0.37	7.32	14.58	Pass
NVNT	n20	5180	Ant3	9.5	0.37	9.87	14.58	Pass
NVNT	n20	5180	Sum	13.22	0.37	13.59	14.58	Pass
NVNT	n20	5200	Ant1	8.29	0.37	8.66	14.58	Pass
NVNT	n20	5200	Ant2	7.38	0.37	7.75	14.58	Pass
NVNT	n20	5200	Ant3	9.5	0.37	9.87	14.58	Pass
NVNT	n20	5200	Sum	13.25	0.37	13.62	14.58	Pass
NVNT	n20	5240	Ant1	7.95	0.38	8.33	14.58	Pass
NVNT	n20	5240	Ant2	6.38	0.38	6.76	14.58	Pass
NVNT	n20	5240	Ant3	9.61	0.38	9.99	14.58	Pass
NVNT	n20	5240	Sum	12.95	0.38	13.33	14.58	Pass
NVNT	n20	5260	Ant1	0.26	0.38	0.64	7.45	Pass
NVNT	n20	5260	Ant2	1.23	0.38	1.61	7.45	Pass
NVNT	n20	5260	Ant3	2.62	0.38	3	7.45	Pass
NVNT	n20	5260	Sum	6.25	0.38	6.63	7.45	Pass
NVNT	n20	5280	Ant1	-0.11	0.38	0.27	7.45	Pass
NVNT	n20	5280	Ant2	0.87	0.38	1.25	7.45	Pass
NVNT	n20	5280	Ant3	2.77	0.38	3.15	7.45	Pass
NVNT	n20	5280	Sum	6.12	0.38	6.5	7.45	Pass
NVNT	n20	5320	Ant1	-0.28	0.38	0.1	7.45	Pass
NVNT	n20	5320	Ant2	0.13	0.38	0.51	7.45	Pass
NVNT	n20	5320	Ant3	2.27	0.38	2.65	7.45	Pass
NVNT	n20	5320	Sum	5.63	0.38	6.01	7.45	Pass
NVNT	n20	5500	Ant1	-0.09	0.38	0.29	6.94	Pass
NVNT	n20	5500	Ant2	0.81	0.38	1.19	6.94	Pass
NVNT	n20	5500	Ant3	1.94	0.38	2.32	6.94	Pass
NVNT	n20	5500	Sum	5.74	0.38	6.12	6.94	Pass
NVNT	n20	5580	Ant1	0.79	0.37	1.16	6.94	Pass
NVNT	n20	5580	Ant2	0.86	0.37	1.23	6.94	Pass
NVNT	n20	5580	Ant3	2.2	0.37	2.57	6.94	Pass
NVNT	n20	5580	Sum	6.1	0.37	6.47	6.94	Pass
NVNT	n20	5700	Ant1	0.12	0.38	0.5	6.94	Pass
NVNT	n20	5700	Ant2	0.84	0.38	1.22	6.94	Pass
NVNT	n20	5700	Ant3	2.55	0.38	2.93	6.94	Pass
NVNT	n20	5700	Sum	6.06	0.38	6.44	6.94	Pass
NVNT	n20	5745	Ant1	9.1	0.37	9.47	25.82	Pass
NVNT	n20	5745	Ant2	10.49	0.37	10.86	25.82	Pass
NVNT	n20	5745	Ant3	12.12	0.37	12.49	25.82	Pass
NVNT	n20	5745	Sum	15.52	0.37	15.89	25.82	Pass
NVNT	n20	5785	Ant1	8.49	0.37	8.86	25.82	Pass
NVNT	n20	5785	Ant2	9.67	0.37	10.04	25.82	Pass
NVNT	n20	5785	Ant3	12.15	0.37	12.52	25.82	Pass

NVNT	n20	5785	Sum	15.15	0.37	15.52	25.82	Pass
NVNT	n20	5825	Ant1	7.72	0.38	8.1	25.82	Pass
NVNT	n20	5825	Ant2	8.84	0.38	9.22	25.82	Pass
NVNT	n20	5825	Ant3	10.91	0.38	11.29	25.82	Pass
NVNT	n20	5825	Sum	14.13	0.38	14.51	25.82	Pass
NVNT	n40	5190	Ant1	8.31	0.63	8.94	14.58	Pass
NVNT	n40	5190	Ant2	7.26	0.63	7.89	14.58	Pass
NVNT	n40	5190	Ant3	9.73	0.63	10.36	14.58	Pass
NVNT	n40	5190	Sum	13.32	0.63	13.95	14.58	Pass
NVNT	n40	5230	Ant1	7.58	0.64	8.22	14.58	Pass
NVNT	n40	5230	Ant2	6.42	0.64	7.06	14.58	Pass
NVNT	n40	5230	Ant3	9.44	0.64	10.08	14.58	Pass
NVNT	n40	5230	Sum	12.77	0.64	13.41	14.58	Pass
NVNT	n40	5270	Ant1	0.14	0.65	0.79	7.45	Pass
NVNT	n40	5270	Ant2	1.14	0.65	1.79	7.45	Pass
NVNT	n40	5270	Ant3	2.93	0.65	3.58	7.45	Pass
NVNT	n40	5270	Sum	6.33	0.65	6.98	7.45	Pass
NVNT	n40	5310	Ant1	-0.78	0.65	-0.13	7.45	Pass
NVNT	n40	5310	Ant2	-0.1	0.65	0.55	7.45	Pass
NVNT	n40	5310	Ant3	1.94	0.65	2.59	7.45	Pass
NVNT	n40	5310	Sum	5.28	0.65	5.93	7.45	Pass
NVNT	n40	5510	Ant1	-0.67	0.65	-0.02	6.94	Pass
NVNT	n40	5510	Ant2	0.22	0.65	0.87	6.94	Pass
NVNT	n40	5510	Ant3	1.43	0.65	2.08	6.94	Pass
NVNT	n40	5510	Sum	5.18	0.65	5.83	6.94	Pass
NVNT	n40	5550	Ant1	0.65	0.65	1.3	6.94	Pass
NVNT	n40	5550	Ant2	1.25	0.65	1.9	6.94	Pass
NVNT	n40	5550	Ant3	2.36	0.65	3.01	6.94	Pass
NVNT	n40	5550	Sum	6.25	0.65	6.9	6.94	Pass
NVNT	n40	5670	Ant1	0.12	0.67	0.79	6.94	Pass
NVNT	n40	5670	Ant2	0.93	0.67	1.6	6.94	Pass
NVNT	n40	5670	Ant3	2.11	0.67	2.78	6.94	Pass
NVNT	n40	5670	Sum	5.9	0.67	6.57	6.94	Pass
NVNT	n40	5755	Ant1	7.46	0.65	8.11	25.82	Pass
NVNT	n40	5755	Ant2	8.97	0.65	9.62	25.82	Pass
NVNT	n40	5755	Ant3	10.68	0.65	11.33	25.82	Pass
NVNT	n40	5755	Sum	14.01	0.65	14.66	25.82	Pass
NVNT	n40	5795	Ant1	6.86	0.64	7.5	25.82	Pass
NVNT	n40	5795	Ant2	8.44	0.64	9.08	25.82	Pass
NVNT	n40	5795	Ant3	10.32	0.64	10.96	25.82	Pass
NVNT	n40	5795	Sum	13.54	0.64	14.18	25.82	Pass

Condition	Mode	RU Type	Index	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	ax20	26RU	4	5180	Ant1	7.36	0.31	7.67	14.58	Pass
NVNT	ax20	26RU	4	5180	Ant2	7.27	0.31	7.58	14.58	Pass
NVNT	ax20	26RU	4	5180	Ant3	8.68	0.31	8.99	14.58	Pass
NVNT	ax20	26RU	4	5180	Sum	12.59	0.31	12.9	14.58	Pass
NVNT	ax20	26RU	4	5200	Ant1	7.1	0.31	7.41	14.58	Pass
NVNT	ax20	26RU	4	5200	Ant2	7.29	0.31	7.6	14.58	Pass
NVNT	ax20	26RU	4	5200	Ant3	9.11	0.31	9.42	14.58	Pass
NVNT	ax20	26RU	4	5200	Sum	12.7	0.31	13.01	14.58	Pass
NVNT	ax20	26RU	4	5240	Ant1	7.31	0.31	7.62	14.58	Pass
NVNT	ax20	26RU	4	5240	Ant2	6.54	0.31	6.85	14.58	Pass
NVNT	ax20	26RU	4	5240	Ant3	8.17	0.31	8.48	14.58	Pass
NVNT	ax20	26RU	4	5240	Sum	12.16	0.31	12.47	14.58	Pass
NVNT	ax20	26RU	4	5260	Ant1	0.05	0.34	0.39	7.45	Pass
NVNT	ax20	26RU	4	5260	Ant2	-1.31	0.34	-0.97	7.45	Pass
NVNT	ax20	26RU	4	5260	Ant3	1.03	0.34	1.37	7.45	Pass
NVNT	ax20	26RU	4	5260	Sum	4.8	0.34	5.14	7.45	Pass
NVNT	ax20	26RU	4	5280	Ant1	0.64	0.32	0.96	7.45	Pass
NVNT	ax20	26RU	4	5280	Ant2	0.15	0.32	0.47	7.45	Pass
NVNT	ax20	26RU	4	5280	Ant3	2.11	0.32	2.43	7.45	Pass
NVNT	ax20	26RU	4	5280	Sum	5.82	0.32	6.14	7.45	Pass
NVNT	ax20	26RU	4	5320	Ant1	-0.84	0.34	-0.5	7.45	Pass
NVNT	ax20	26RU	4	5320	Ant2	-0.28	0.34	0.06	7.45	Pass
NVNT	ax20	26RU	4	5320	Ant3	1.2	0.34	1.54	7.45	Pass
NVNT	ax20	26RU	4	5320	Sum	4.89	0.34	5.23	7.45	Pass
NVNT	ax20	26RU	4	5500	Ant1	0.12	0.31	0.43	6.94	Pass
NVNT	ax20	26RU	4	5500	Ant2	-0.33	0.31	-0.02	6.94	Pass
NVNT	ax20	26RU	4	5500	Ant3	1.15	0.31	1.46	6.94	Pass
NVNT	ax20	26RU	4	5500	Sum	5.13	0.31	5.44	6.94	Pass
NVNT	ax20	26RU	4	5580	Ant1	1.09	0.31	1.4	6.94	Pass
NVNT	ax20	26RU	4	5580	Ant2	-0.02	0.31	0.29	6.94	Pass
NVNT	ax20	26RU	4	5580	Ant3	1.3	0.31	1.61	6.94	Pass
NVNT	ax20	26RU	4	5580	Sum	5.6	0.31	5.91	6.94	Pass
NVNT	ax20	26RU	4	5700	Ant1	1.12	0.31	1.43	6.94	Pass
NVNT	ax20	26RU	4	5700	Ant2	-0.06	0.31	0.25	6.94	Pass
NVNT	ax20	26RU	4	5700	Ant3	2.39	0.31	2.7	6.94	Pass
NVNT	ax20	26RU	4	5700	Sum	6.04	0.31	6.35	6.94	Pass
NVNT	ax20	26RU	4	5745	Ant1	8.32	0.32	8.64	25.82	Pass
NVNT	ax20	26RU	4	5745	Ant2	9.14	0.32	9.46	25.82	Pass

NVNT	ax20	26RU	4	5745	Ant3	10.86	0.32	11.18	25.82	Pass
NVNT	ax20	26RU	4	5745	Sum	14.34	0.32	14.66	25.82	Pass
NVNT	ax20	26RU	4	5785	Ant1	7.41	0.31	7.72	25.82	Pass
NVNT	ax20	26RU	4	5785	Ant2	9.01	0.31	9.32	25.82	Pass
NVNT	ax20	26RU	4	5785	Ant3	10.75	0.31	11.06	25.82	Pass
NVNT	ax20	26RU	4	5785	Sum	14.04	0.31	14.35	25.82	Pass
NVNT	ax20	26RU	4	5825	Ant1	7.41	0.32	7.73	25.82	Pass
NVNT	ax20	26RU	4	5825	Ant2	7.44	0.32	7.76	25.82	Pass
NVNT	ax20	26RU	4	5825	Ant3	9.82	0.32	10.14	25.82	Pass
NVNT	ax20	26RU	4	5825	Sum	13.15	0.32	13.47	25.82	Pass
NVNT	be20	52+26RU	38+1	5180	Ant1	7.49	0.26	7.75	14.58	Pass
NVNT	be20	52+26RU	38+1	5180	Ant2	7.79	0.26	8.05	14.58	Pass
NVNT	be20	52+26RU	38+1	5180	Ant3	8.97	0.26	9.23	14.58	Pass
NVNT	be20	52+26RU	38+1	5180	Sum	12.9	0.26	13.16	14.58	Pass
NVNT	be20	52+26RU	38+1	5200	Ant1	7.4	0.26	7.66	14.58	Pass
NVNT	be20	52+26RU	38+1	5200	Ant2	7.88	0.26	8.14	14.58	Pass
NVNT	be20	52+26RU	38+1	5200	Ant3	9.38	0.26	9.64	14.58	Pass
NVNT	be20	52+26RU	38+1	5200	Sum	13.08	0.26	13.34	14.58	Pass
NVNT	be20	52+26RU	38+1	5240	Ant1	6.97	0.26	7.23	14.58	Pass
NVNT	be20	52+26RU	38+1	5240	Ant2	7.09	0.26	7.35	14.58	Pass
NVNT	be20	52+26RU	38+1	5240	Ant3	9.14	0.26	9.4	14.58	Pass
NVNT	be20	52+26RU	38+1	5240	Sum	12.62	0.26	12.88	14.58	Pass
NVNT	be20	52+26RU	38+1	5260	Ant1	-0.78	0.29	-0.49	7.45	Pass
NVNT	be20	52+26RU	38+1	5260	Ant2	0.15	0.29	0.44	7.45	Pass
NVNT	be20	52+26RU	38+1	5260	Ant3	2.4	0.29	2.69	7.45	Pass
NVNT	be20	52+26RU	38+1	5260	Sum	5.57	0.29	5.86	7.45	Pass
NVNT	be20	52+26RU	38+1	5280	Ant1	-0.53	0.27	-0.26	7.45	Pass
NVNT	be20	52+26RU	38+1	5280	Ant2	0.99	0.27	1.26	7.45	Pass
NVNT	be20	52+26RU	38+1	5280	Ant3	2.91	0.27	3.18	7.45	Pass
NVNT	be20	52+26RU	38+1	5280	Sum	6.12	0.27	6.39	7.45	Pass
NVNT	be20	52+26RU	38+1	5320	Ant1	-0.99	0.26	-0.73	7.45	Pass
NVNT	be20	52+26RU	38+1	5320	Ant2	0.39	0.26	0.65	7.45	Pass
NVNT	be20	52+26RU	38+1	5320	Ant3	2.33	0.26	2.59	7.45	Pass
NVNT	be20	52+26RU	38+1	5320	Sum	5.56	0.26	5.82	7.45	Pass
NVNT	be20	52+26RU	38+1	5500	Ant1	-0.61	0.25	-0.36	6.94	Pass
NVNT	be20	52+26RU	38+1	5500	Ant2	0.51	0.25	0.76	6.94	Pass
NVNT	be20	52+26RU	38+1	5500	Ant3	2.15	0.25	2.4	6.94	Pass
NVNT	be20	52+26RU	38+1	5500	Sum	5.6	0.25	5.85	6.94	Pass
NVNT	be20	52+26RU	38+1	5580	Ant1	-1.64	0.26	-1.38	6.94	Pass
NVNT	be20	52+26RU	38+1	5580	Ant2	-2.91	0.26	-2.65	6.94	Pass
NVNT	be20	52+26RU	38+1	5580	Ant3	-1.33	0.26	-1.07	6.94	Pass
NVNT	be20	52+26RU	38+1	5580	Sum	2.86	0.26	3.12	6.94	Pass

NVNT	be20	52+26RU	38+1	5700	Ant1	-0.59	0.29	-0.3	6.94	Pass
NVNT	be20	52+26RU	38+1	5700	Ant2	-1.43	0.29	-1.14	6.94	Pass
NVNT	be20	52+26RU	38+1	5700	Ant3	-0.14	0.29	0.15	6.94	Pass
NVNT	be20	52+26RU	38+1	5700	Sum	4.08	0.29	4.37	6.94	Pass
NVNT	be20	52+26RU	38+1	5745	Ant1	8.8	0.26	9.06	25.82	Pass
NVNT	be20	52+26RU	38+1	5745	Ant2	10.02	0.26	10.28	25.82	Pass
NVNT	be20	52+26RU	38+1	5745	Ant3	11.39	0.26	11.65	25.82	Pass
NVNT	be20	52+26RU	38+1	5745	Sum	14.97	0.26	15.23	25.82	Pass
NVNT	be20	52+26RU	38+1	5785	Ant1	7.83	0.28	8.11	25.82	Pass
NVNT	be20	52+26RU	38+1	5785	Ant2	9.76	0.28	10.04	25.82	Pass
NVNT	be20	52+26RU	38+1	5785	Ant3	11.77	0.28	12.05	25.82	Pass
NVNT	be20	52+26RU	38+1	5785	Sum	14.85	0.28	15.13	25.82	Pass
NVNT	be20	52+26RU	38+1	5825	Ant1	6.88	0.28	7.16	25.82	Pass
NVNT	be20	52+26RU	38+1	5825	Ant2	8.06	0.28	8.34	25.82	Pass
NVNT	be20	52+26RU	38+1	5825	Ant3	9.84	0.28	10.12	25.82	Pass
NVNT	be20	52+26RU	38+1	5825	Sum	13.2	0.28	13.48	25.82	Pass
NVNT	be20	52+26RU	38+4	5180	Ant1	8.67	0.27	8.94	14.58	Pass
NVNT	be20	52+26RU	38+4	5180	Ant2	8.83	0.27	9.1	14.58	Pass
NVNT	be20	52+26RU	38+4	5180	Ant3	9.32	0.27	9.59	14.58	Pass
NVNT	be20	52+26RU	38+4	5180	Sum	13.72	0.27	13.99	14.58	Pass
NVNT	be20	52+26RU	38+4	5200	Ant1	8.51	0.26	8.77	14.58	Pass
NVNT	be20	52+26RU	38+4	5200	Ant2	8.35	0.26	8.61	14.58	Pass
NVNT	be20	52+26RU	38+4	5200	Ant3	9.33	0.26	9.59	14.58	Pass
NVNT	be20	52+26RU	38+4	5200	Sum	13.52	0.26	13.78	14.58	Pass
NVNT	be20	52+26RU	38+4	5240	Ant1	8.33	0.29	8.62	14.58	Pass
NVNT	be20	52+26RU	38+4	5240	Ant2	7.86	0.29	8.15	14.58	Pass
NVNT	be20	52+26RU	38+4	5240	Ant3	9.55	0.29	9.84	14.58	Pass
NVNT	be20	52+26RU	38+4	5240	Sum	13.41	0.29	13.7	14.58	Pass
NVNT	be20	52+26RU	38+4	5260	Ant1	-0.05	0.26	0.21	7.45	Pass
NVNT	be20	52+26RU	38+4	5260	Ant2	0.76	0.26	1.02	7.45	Pass
NVNT	be20	52+26RU	38+4	5260	Ant3	2.81	0.26	3.07	7.45	Pass
NVNT	be20	52+26RU	38+4	5260	Sum	6.12	0.26	6.38	7.45	Pass
NVNT	be20	52+26RU	38+4	5280	Ant1	-2.03	0.26	-1.77	7.45	Pass
NVNT	be20	52+26RU	38+4	5280	Ant2	-2.42	0.26	-2.16	7.45	Pass
NVNT	be20	52+26RU	38+4	5280	Ant3	-1.1	0.26	-0.84	7.45	Pass
NVNT	be20	52+26RU	38+4	5280	Sum	2.96	0.26	3.22	7.45	Pass
NVNT	be20	52+26RU	38+4	5320	Ant1	-2.23	0.26	-1.97	7.45	Pass
NVNT	be20	52+26RU	38+4	5320	Ant2	-2.16	0.26	-1.9	7.45	Pass
NVNT	be20	52+26RU	38+4	5320	Ant3	-1.46	0.26	-1.2	7.45	Pass
NVNT	be20	52+26RU	38+4	5320	Sum	2.84	0.26	3.1	7.45	Pass
NVNT	be20	52+26RU	38+4	5500	Ant1	-3.29	0.3	-2.99	6.94	Pass
NVNT	be20	52+26RU	38+4	5500	Ant2	-3.07	0.3	-2.77	6.94	Pass

NVNT	be20	52+26RU	38+4	5500	Ant3	-2.26	0.3	-1.96	6.94	Pass
NVNT	be20	52+26RU	38+4	5500	Sum	1.92	0.3	2.22	6.94	Pass
NVNT	be20	52+26RU	38+4	5580	Ant1	-1.34	0.29	-1.05	6.94	Pass
NVNT	be20	52+26RU	38+4	5580	Ant2	-2.66	0.29	-2.37	6.94	Pass
NVNT	be20	52+26RU	38+4	5580	Ant3	-2.14	0.29	-1.85	6.94	Pass
NVNT	be20	52+26RU	38+4	5580	Sum	2.76	0.29	3.05	6.94	Pass
NVNT	be20	52+26RU	38+4	5700	Ant1	-0.54	0.28	-0.26	6.94	Pass
NVNT	be20	52+26RU	38+4	5700	Ant2	-1.27	0.28	-0.99	6.94	Pass
NVNT	be20	52+26RU	38+4	5700	Ant3	0.14	0.28	0.42	6.94	Pass
NVNT	be20	52+26RU	38+4	5700	Sum	4.25	0.28	4.53	6.94	Pass
NVNT	be20	52+26RU	38+4	5745	Ant1	8.74	0.29	9.03	25.82	Pass
NVNT	be20	52+26RU	38+4	5745	Ant2	10.4	0.29	10.69	25.82	Pass
NVNT	be20	52+26RU	38+4	5745	Ant3	11.79	0.29	12.08	25.82	Pass
NVNT	be20	52+26RU	38+4	5745	Sum	15.26	0.29	15.55	25.82	Pass
NVNT	be20	52+26RU	38+4	5785	Ant1	8.44	0.26	8.7	25.82	Pass
NVNT	be20	52+26RU	38+4	5785	Ant2	10.18	0.26	10.44	25.82	Pass
NVNT	be20	52+26RU	38+4	5785	Ant3	11.35	0.26	11.61	25.82	Pass
NVNT	be20	52+26RU	38+4	5785	Sum	14.92	0.26	15.18	25.82	Pass
NVNT	be20	52+26RU	38+4	5825	Ant1	7.55	0.29	7.84	25.82	Pass
NVNT	be20	52+26RU	38+4	5825	Ant2	8.26	0.29	8.55	25.82	Pass
NVNT	be20	52+26RU	38+4	5825	Ant3	10.19	0.29	10.48	25.82	Pass
NVNT	be20	52+26RU	38+4	5825	Sum	13.59	0.29	13.88	25.82	Pass
NVNT	be20	52+26RU	39+7	5180	Ant1	7.38	0.26	7.64	14.58	Pass
NVNT	be20	52+26RU	39+7	5180	Ant2	7.89	0.26	8.15	14.58	Pass
NVNT	be20	52+26RU	39+7	5180	Ant3	8.93	0.26	9.19	14.58	Pass
NVNT	be20	52+26RU	39+7	5180	Sum	12.89	0.26	13.15	14.58	Pass
NVNT	be20	52+26RU	39+7	5200	Ant1	7.47	0.26	7.73	14.58	Pass
NVNT	be20	52+26RU	39+7	5200	Ant2	7.88	0.26	8.14	14.58	Pass
NVNT	be20	52+26RU	39+7	5200	Ant3	8.74	0.26	9	14.58	Pass
NVNT	be20	52+26RU	39+7	5200	Sum	12.83	0.26	13.09	14.58	Pass
NVNT	be20	52+26RU	39+7	5240	Ant1	7.18	0.26	7.44	14.58	Pass
NVNT	be20	52+26RU	39+7	5240	Ant2	8.07	0.26	8.33	14.58	Pass
NVNT	be20	52+26RU	39+7	5240	Ant3	9.03	0.26	9.29	14.58	Pass
NVNT	be20	52+26RU	39+7	5240	Sum	12.93	0.26	13.19	14.58	Pass
NVNT	be20	52+26RU	39+7	5260	Ant1	-0.45	0.29	-0.16	7.45	Pass
NVNT	be20	52+26RU	39+7	5260	Ant2	0.62	0.29	0.91	7.45	Pass
NVNT	be20	52+26RU	39+7	5260	Ant3	2.93	0.29	3.22	7.45	Pass
NVNT	be20	52+26RU	39+7	5260	Sum	6.04	0.29	6.33	7.45	Pass
NVNT	be20	52+26RU	39+7	5280	Ant1	-0.33	0.28	-0.05	7.45	Pass
NVNT	be20	52+26RU	39+7	5280	Ant2	0.62	0.28	0.9	7.45	Pass
NVNT	be20	52+26RU	39+7	5280	Ant3	2.77	0.28	3.05	7.45	Pass
NVNT	be20	52+26RU	39+7	5280	Sum	5.99	0.28	6.27	7.45	Pass

NVNT	be20	52+26RU	39+7	5320	Ant1	-1.17	0.26	-0.91	7.45	Pass
NVNT	be20	52+26RU	39+7	5320	Ant2	-0.12	0.26	0.14	7.45	Pass
NVNT	be20	52+26RU	39+7	5320	Ant3	2.35	0.26	2.61	7.45	Pass
NVNT	be20	52+26RU	39+7	5320	Sum	5.38	0.26	5.64	7.45	Pass
NVNT	be20	52+26RU	39+7	5500	Ant1	-0.28	0.26	-0.02	6.94	Pass
NVNT	be20	52+26RU	39+7	5500	Ant2	0.23	0.26	0.49	6.94	Pass
NVNT	be20	52+26RU	39+7	5500	Ant3	2.05	0.26	2.31	6.94	Pass
NVNT	be20	52+26RU	39+7	5500	Sum	5.56	0.26	5.82	6.94	Pass
NVNT	be20	52+26RU	39+7	5580	Ant1	-1.56	0.5	-1.06	6.94	Pass
NVNT	be20	52+26RU	39+7	5580	Ant2	-2.59	0.5	-2.09	6.94	Pass
NVNT	be20	52+26RU	39+7	5580	Ant3	-1.15	0.5	-0.65	6.94	Pass
NVNT	be20	52+26RU	39+7	5580	Sum	3.05	0.5	3.55	6.94	Pass
NVNT	be20	52+26RU	39+7	5700	Ant1	-0.2	0.27	0.07	6.94	Pass
NVNT	be20	52+26RU	39+7	5700	Ant2	-2	0.27	-1.73	6.94	Pass
NVNT	be20	52+26RU	39+7	5700	Ant3	0.54	0.27	0.81	6.94	Pass
NVNT	be20	52+26RU	39+7	5700	Sum	4.34	0.27	4.61	6.94	Pass
NVNT	be20	52+26RU	39+7	5745	Ant1	8.57	0.27	8.84	25.82	Pass
NVNT	be20	52+26RU	39+7	5745	Ant2	10.45	0.27	10.72	25.82	Pass
NVNT	be20	52+26RU	39+7	5745	Ant3	11.42	0.27	11.69	25.82	Pass
NVNT	be20	52+26RU	39+7	5745	Sum	15.07	0.27	15.34	25.82	Pass
NVNT	be20	52+26RU	39+7	5785	Ant1	8.11	0.25	8.36	25.82	Pass
NVNT	be20	52+26RU	39+7	5785	Ant2	9.52	0.25	9.77	25.82	Pass
NVNT	be20	52+26RU	39+7	5785	Ant3	11.38	0.25	11.63	25.82	Pass
NVNT	be20	52+26RU	39+7	5785	Sum	14.65	0.25	14.9	25.82	Pass
NVNT	be20	52+26RU	39+7	5825	Ant1	7.25	0.26	7.51	25.82	Pass
NVNT	be20	52+26RU	39+7	5825	Ant2	8.14	0.26	8.4	25.82	Pass
NVNT	be20	52+26RU	39+7	5825	Ant3	10.17	0.26	10.43	25.82	Pass
NVNT	be20	52+26RU	39+7	5825	Sum	13.47	0.26	13.73	25.82	Pass
NVNT	be20	106+26RU	53+4	5180	Ant1	7.45	0.26	7.71	14.58	Pass
NVNT	be20	106+26RU	53+4	5180	Ant2	7.74	0.26	8	14.58	Pass
NVNT	be20	106+26RU	53+4	5180	Ant3	9.08	0.26	9.34	14.58	Pass
NVNT	be20	106+26RU	53+4	5180	Sum	12.92	0.26	13.18	14.58	Pass
NVNT	be20	106+26RU	53+4	5200	Ant1	7.42	0.28	7.7	14.58	Pass
NVNT	be20	106+26RU	53+4	5200	Ant2	8.25	0.28	8.53	14.58	Pass
NVNT	be20	106+26RU	53+4	5200	Ant3	8.8	0.28	9.08	14.58	Pass
NVNT	be20	106+26RU	53+4	5200	Sum	12.96	0.28	13.24	14.58	Pass
NVNT	be20	106+26RU	53+4	5240	Ant1	7.3	0.28	7.58	14.58	Pass
NVNT	be20	106+26RU	53+4	5240	Ant2	7.73	0.28	8.01	14.58	Pass
NVNT	be20	106+26RU	53+4	5240	Ant3	8.74	0.28	9.02	14.58	Pass
NVNT	be20	106+26RU	53+4	5240	Sum	12.74	0.28	13.02	14.58	Pass
NVNT	be20	106+26RU	53+4	5260	Ant1	-0.55	0.27	-0.28	7.45	Pass
NVNT	be20	106+26RU	53+4	5260	Ant2	0.4	0.27	0.67	7.45	Pass

NVNT	be20	106+26RU	53+4	5260	Ant3	2.58	0.27	2.85	7.45	Pass
NVNT	be20	106+26RU	53+4	5260	Sum	5.79	0.27	6.06	7.45	Pass
NVNT	be20	106+26RU	53+4	5280	Ant1	-0.35	0.29	-0.06	7.45	Pass
NVNT	be20	106+26RU	53+4	5280	Ant2	0.25	0.29	0.54	7.45	Pass
NVNT	be20	106+26RU	53+4	5280	Ant3	2.22	0.29	2.51	7.45	Pass
NVNT	be20	106+26RU	53+4	5280	Sum	5.62	0.29	5.91	7.45	Pass
NVNT	be20	106+26RU	53+4	5320	Ant1	-1.46	0.29	-1.17	7.45	Pass
NVNT	be20	106+26RU	53+4	5320	Ant2	-0.48	0.29	-0.19	7.45	Pass
NVNT	be20	106+26RU	53+4	5320	Ant3	1.91	0.29	2.2	7.45	Pass
NVNT	be20	106+26RU	53+4	5320	Sum	5	0.29	5.29	7.45	Pass
NVNT	be20	106+26RU	53+4	5500	Ant1	-0.38	0.29	-0.09	6.94	Pass
NVNT	be20	106+26RU	53+4	5500	Ant2	0	0.29	0.29	6.94	Pass
NVNT	be20	106+26RU	53+4	5500	Ant3	1.62	0.29	1.91	6.94	Pass
NVNT	be20	106+26RU	53+4	5500	Sum	5.27	0.29	5.56	6.94	Pass
NVNT	be20	106+26RU	53+4	5580	Ant1	1.19	0.28	1.47	6.94	Pass
NVNT	be20	106+26RU	53+4	5580	Ant2	1.5	0.28	1.78	6.94	Pass
NVNT	be20	106+26RU	53+4	5580	Ant3	2.62	0.28	2.9	6.94	Pass
NVNT	be20	106+26RU	53+4	5580	Sum	6.59	0.28	6.87	6.94	Pass
NVNT	be20	106+26RU	53+4	5700	Ant1	-0.05	0.28	0.23	6.94	Pass
NVNT	be20	106+26RU	53+4	5700	Ant2	0.61	0.28	0.89	6.94	Pass
NVNT	be20	106+26RU	53+4	5700	Ant3	2.02	0.28	2.3	6.94	Pass
NVNT	be20	106+26RU	53+4	5700	Sum	5.72	0.28	6	6.94	Pass
NVNT	be20	106+26RU	53+4	5745	Ant1	8.39	0.27	8.66	25.82	Pass
NVNT	be20	106+26RU	53+4	5745	Ant2	10.15	0.27	10.42	25.82	Pass
NVNT	be20	106+26RU	53+4	5745	Ant3	11.44	0.27	11.71	25.82	Pass
NVNT	be20	106+26RU	53+4	5745	Sum	14.94	0.27	15.21	25.82	Pass
NVNT	be20	106+26RU	53+4	5785	Ant1	7.46	0.25	7.71	25.82	Pass
NVNT	be20	106+26RU	53+4	5785	Ant2	9.64	0.25	9.89	25.82	Pass
NVNT	be20	106+26RU	53+4	5785	Ant3	11.22	0.25	11.47	25.82	Pass
NVNT	be20	106+26RU	53+4	5785	Sum	14.47	0.25	14.72	25.82	Pass
NVNT	be20	106+26RU	53+4	5825	Ant1	7.21	0.29	7.5	25.82	Pass
NVNT	be20	106+26RU	53+4	5825	Ant2	8.04	0.29	8.33	25.82	Pass
NVNT	be20	106+26RU	53+4	5825	Ant3	9.9	0.29	10.19	25.82	Pass
NVNT	be20	106+26RU	53+4	5825	Sum	13.3	0.29	13.59	25.82	Pass
NVNT	be20	106+26RU	54+4	5180	Ant1	7.27	0.28	7.55	14.58	Pass
NVNT	be20	106+26RU	54+4	5180	Ant2	7.58	0.28	7.86	14.58	Pass
NVNT	be20	106+26RU	54+4	5180	Ant3	8.9	0.28	9.18	14.58	Pass
NVNT	be20	106+26RU	54+4	5180	Sum	12.75	0.28	13.03	14.58	Pass
NVNT	be20	106+26RU	54+4	5200	Ant1	6.84	0.28	7.12	14.58	Pass
NVNT	be20	106+26RU	54+4	5200	Ant2	7.63	0.28	7.91	14.58	Pass
NVNT	be20	106+26RU	54+4	5200	Ant3	8.75	0.28	9.03	14.58	Pass
NVNT	be20	106+26RU	54+4	5200	Sum	12.58	0.28	12.86	14.58	Pass

NVNT	be20	106+26RU	54+4	5240	Ant1	7.15	0.27	7.42	14.58	Pass
NVNT	be20	106+26RU	54+4	5240	Ant2	7.66	0.27	7.93	14.58	Pass
NVNT	be20	106+26RU	54+4	5240	Ant3	8.8	0.27	9.07	14.58	Pass
NVNT	be20	106+26RU	54+4	5240	Sum	12.7	0.27	12.97	14.58	Pass
NVNT	be20	106+26RU	54+4	5260	Ant1	-1.07	0.28	-0.79	7.45	Pass
NVNT	be20	106+26RU	54+4	5260	Ant2	0.15	0.28	0.43	7.45	Pass
NVNT	be20	106+26RU	54+4	5260	Ant3	2.19	0.28	2.47	7.45	Pass
NVNT	be20	106+26RU	54+4	5260	Sum	5.41	0.28	5.69	7.45	Pass
NVNT	be20	106+26RU	54+4	5280	Ant1	-0.71	0.26	-0.45	7.45	Pass
NVNT	be20	106+26RU	54+4	5280	Ant2	0.32	0.26	0.58	7.45	Pass
NVNT	be20	106+26RU	54+4	5280	Ant3	1.89	0.26	2.15	7.45	Pass
NVNT	be20	106+26RU	54+4	5280	Sum	5.4	0.26	5.66	7.45	Pass
NVNT	be20	106+26RU	54+4	5320	Ant1	-1.28	0.3	-0.98	7.45	Pass
NVNT	be20	106+26RU	54+4	5320	Ant2	-0.12	0.3	0.18	7.45	Pass
NVNT	be20	106+26RU	54+4	5320	Ant3	2.03	0.3	2.33	7.45	Pass
NVNT	be20	106+26RU	54+4	5320	Sum	5.2	0.3	5.5	7.45	Pass
NVNT	be20	106+26RU	54+4	5500	Ant1	-0.84	0.26	-0.58	6.94	Pass
NVNT	be20	106+26RU	54+4	5500	Ant2	0.21	0.26	0.47	6.94	Pass
NVNT	be20	106+26RU	54+4	5500	Ant3	1.48	0.26	1.74	6.94	Pass
NVNT	be20	106+26RU	54+4	5500	Sum	5.16	0.26	5.42	6.94	Pass
NVNT	be20	106+26RU	54+4	5580	Ant1	0.37	0.28	0.65	6.94	Pass
NVNT	be20	106+26RU	54+4	5580	Ant2	0.5	0.28	0.78	6.94	Pass
NVNT	be20	106+26RU	54+4	5580	Ant3	2.08	0.28	2.36	6.94	Pass
NVNT	be20	106+26RU	54+4	5580	Sum	5.83	0.28	6.11	6.94	Pass
NVNT	be20	106+26RU	54+4	5700	Ant1	0.27	0.28	0.55	6.94	Pass
NVNT	be20	106+26RU	54+4	5700	Ant2	0.75	0.28	1.03	6.94	Pass
NVNT	be20	106+26RU	54+4	5700	Ant3	2.54	0.28	2.82	6.94	Pass
NVNT	be20	106+26RU	54+4	5700	Sum	6.07	0.28	6.35	6.94	Pass
NVNT	be20	106+26RU	54+4	5745	Ant1	8.36	0.28	8.64	25.82	Pass
NVNT	be20	106+26RU	54+4	5745	Ant2	10.08	0.28	10.36	25.82	Pass
NVNT	be20	106+26RU	54+4	5745	Ant3	11.03	0.28	11.31	25.82	Pass
NVNT	be20	106+26RU	54+4	5745	Sum	14.73	0.28	15.01	25.82	Pass
NVNT	be20	106+26RU	54+4	5785	Ant1	7.9	0.29	8.19	25.82	Pass
NVNT	be20	106+26RU	54+4	5785	Ant2	9.6	0.29	9.89	25.82	Pass
NVNT	be20	106+26RU	54+4	5785	Ant3	11.17	0.29	11.46	25.82	Pass
NVNT	be20	106+26RU	54+4	5785	Sum	14.53	0.29	14.82	25.82	Pass
NVNT	be20	106+26RU	54+4	5825	Ant1	6.53	0.27	6.8	25.82	Pass
NVNT	be20	106+26RU	54+4	5825	Ant2	7.96	0.27	8.23	25.82	Pass
NVNT	be20	106+26RU	54+4	5825	Ant3	9.86	0.27	10.13	25.82	Pass
NVNT	be20	106+26RU	54+4	5825	Sum	13.1	0.27	13.37	25.82	Pass
NVNT	be40	106+26RU	55+13	5190	Ant1	7.55	0.28	7.83	14.58	Pass
NVNT	be40	106+26RU	55+13	5190	Ant2	7.68	0.28	7.96	14.58	Pass

NVNT	be40	106+26RU	55+13	5190	Ant3	8.92	0.28	9.2	14.58	Pass
NVNT	be40	106+26RU	55+13	5190	Sum	12.87	0.28	13.15	14.58	Pass
NVNT	be40	106+26RU	55+13	5230	Ant1	6.96	0.28	7.24	14.58	Pass
NVNT	be40	106+26RU	55+13	5230	Ant2	7.42	0.28	7.7	14.58	Pass
NVNT	be40	106+26RU	55+13	5230	Ant3	8.71	0.28	8.99	14.58	Pass
NVNT	be40	106+26RU	55+13	5230	Sum	12.53	0.28	12.81	14.58	Pass
NVNT	be40	106+26RU	55+13	5270	Ant1	-0.1	0.3	0.2	7.45	Pass
NVNT	be40	106+26RU	55+13	5270	Ant2	1.27	0.3	1.57	7.45	Pass
NVNT	be40	106+26RU	55+13	5270	Ant3	3.42	0.3	3.72	7.45	Pass
NVNT	be40	106+26RU	55+13	5270	Sum	6.55	0.3	6.85	7.45	Pass
NVNT	be40	106+26RU	55+13	5310	Ant1	-1.17	0.27	-0.9	7.45	Pass
NVNT	be40	106+26RU	55+13	5310	Ant2	-0.2	0.27	0.07	7.45	Pass
NVNT	be40	106+26RU	55+13	5310	Ant3	1.92	0.27	2.19	7.45	Pass
NVNT	be40	106+26RU	55+13	5310	Sum	5.15	0.27	5.42	7.45	Pass
NVNT	be40	106+26RU	55+13	5510	Ant1	-1.48	0.26	-1.22	6.94	Pass
NVNT	be40	106+26RU	55+13	5510	Ant2	-0.63	0.26	-0.37	6.94	Pass
NVNT	be40	106+26RU	55+13	5510	Ant3	1.46	0.26	1.72	6.94	Pass
NVNT	be40	106+26RU	55+13	5510	Sum	4.74	0.26	5	6.94	Pass
NVNT	be40	106+26RU	55+13	5550	Ant1	0.41	0.28	0.69	6.94	Pass
NVNT	be40	106+26RU	55+13	5550	Ant2	0.15	0.28	0.43	6.94	Pass
NVNT	be40	106+26RU	55+13	5550	Ant3	2.07	0.28	2.35	6.94	Pass
NVNT	be40	106+26RU	55+13	5550	Sum	5.73	0.28	6.01	6.94	Pass
NVNT	be40	106+26RU	55+13	5670	Ant1	0.09	0.26	0.35	6.94	Pass
NVNT	be40	106+26RU	55+13	5670	Ant2	0.53	0.26	0.79	6.94	Pass
NVNT	be40	106+26RU	55+13	5670	Ant3	1.98	0.26	2.24	6.94	Pass
NVNT	be40	106+26RU	55+13	5670	Sum	5.72	0.26	5.98	6.94	Pass
NVNT	be40	106+26RU	55+13	5755	Ant1	7.85	0.25	8.1	25.82	Pass
NVNT	be40	106+26RU	55+13	5755	Ant2	8.63	0.25	8.88	25.82	Pass
NVNT	be40	106+26RU	55+13	5755	Ant3	10.19	0.25	10.44	25.82	Pass
NVNT	be40	106+26RU	55+13	5755	Sum	13.77	0.25	14.02	25.82	Pass
NVNT	be40	106+26RU	55+13	5795	Ant1	6.55	0.28	6.83	25.82	Pass
NVNT	be40	106+26RU	55+13	5795	Ant2	8.08	0.28	8.36	25.82	Pass
NVNT	be40	106+26RU	55+13	5795	Ant3	9.59	0.28	9.87	25.82	Pass
NVNT	be40	106+26RU	55+13	5795	Sum	13.02	0.28	13.3	25.82	Pass
NVNT	be40	106+26RU	56+13	5190	Ant1	6.77	0.29	7.06	14.58	Pass
NVNT	be40	106+26RU	56+13	5190	Ant2	7.03	0.29	7.32	14.58	Pass
NVNT	be40	106+26RU	56+13	5190	Ant3	8.52	0.29	8.81	14.58	Pass
NVNT	be40	106+26RU	56+13	5190	Sum	12.28	0.29	12.57	14.58	Pass
NVNT	be40	106+26RU	56+13	5230	Ant1	6.23	0.3	6.53	14.58	Pass
NVNT	be40	106+26RU	56+13	5230	Ant2	6.62	0.3	6.92	14.58	Pass
NVNT	be40	106+26RU	56+13	5230	Ant3	7.98	0.3	8.28	14.58	Pass
NVNT	be40	106+26RU	56+13	5230	Sum	11.78	0.3	12.08	14.58	Pass

NVNT	be40	106+26RU	56+13	5270	Ant1	-1.24	0.29	-0.95	7.45	Pass
NVNT	be40	106+26RU	56+13	5270	Ant2	0.45	0.29	0.74	7.45	Pass
NVNT	be40	106+26RU	56+13	5270	Ant3	1.98	0.29	2.27	7.45	Pass
NVNT	be40	106+26RU	56+13	5270	Sum	5.36	0.29	5.65	7.45	Pass
NVNT	be40	106+26RU	56+13	5310	Ant1	-1.5	0.29	-1.21	7.45	Pass
NVNT	be40	106+26RU	56+13	5310	Ant2	-0.45	0.29	-0.16	7.45	Pass
NVNT	be40	106+26RU	56+13	5310	Ant3	1.42	0.29	1.71	7.45	Pass
NVNT	be40	106+26RU	56+13	5310	Sum	4.77	0.29	5.06	7.45	Pass
NVNT	be40	106+26RU	56+13	5510	Ant1	-1.62	0.28	-1.34	6.94	Pass
NVNT	be40	106+26RU	56+13	5510	Ant2	-1.19	0.28	-0.91	6.94	Pass
NVNT	be40	106+26RU	56+13	5510	Ant3	1.43	0.28	1.71	6.94	Pass
NVNT	be40	106+26RU	56+13	5510	Sum	4.53	0.28	4.81	6.94	Pass
NVNT	be40	106+26RU	56+13	5550	Ant1	0.16	0.28	0.44	6.94	Pass
NVNT	be40	106+26RU	56+13	5550	Ant2	0.07	0.28	0.35	6.94	Pass
NVNT	be40	106+26RU	56+13	5550	Ant3	1.49	0.28	1.77	6.94	Pass
NVNT	be40	106+26RU	56+13	5550	Sum	5.39	0.28	5.67	6.94	Pass
NVNT	be40	106+26RU	56+13	5670	Ant1	0.19	0.29	0.48	6.94	Pass
NVNT	be40	106+26RU	56+13	5670	Ant2	0.79	0.29	1.08	6.94	Pass
NVNT	be40	106+26RU	56+13	5670	Ant3	2	0.29	2.29	6.94	Pass
NVNT	be40	106+26RU	56+13	5670	Sum	5.83	0.29	6.12	6.94	Pass
NVNT	be40	106+26RU	56+13	5755	Ant1	7.18	0.28	7.46	25.82	Pass
NVNT	be40	106+26RU	56+13	5755	Ant2	8.49	0.28	8.77	25.82	Pass
NVNT	be40	106+26RU	56+13	5755	Ant3	10.18	0.28	10.46	25.82	Pass
NVNT	be40	106+26RU	56+13	5755	Sum	13.56	0.28	13.84	25.82	Pass
NVNT	be40	106+26RU	56+13	5795	Ant1	6.63	0.3	6.93	25.82	Pass
NVNT	be40	106+26RU	56+13	5795	Ant2	7.92	0.3	8.22	25.82	Pass
NVNT	be40	106+26RU	56+13	5795	Ant3	9.73	0.3	10.03	25.82	Pass
NVNT	be40	106+26RU	56+13	5795	Sum	13.05	0.3	13.35	25.82	Pass


Condition	Mode	MRU Type	MRU Index	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	be80	484+242-tone	MRU4	5210	Ant1	6.74	0.43	7.17	14.58	Pass
NVNT	be80	484+242-tone	MRU4	5210	Ant2	7.15	0.43	7.58	14.58	Pass
NVNT	be80	484+242-tone	MRU4	5210	Ant3	8.09	0.43	8.52	14.58	Pass
NVNT	be80	484+242-tone	MRU4	5210	Sum	12.14	0.43	12.57	14.58	Pass
NVNT	be80	484+242-tone	MRU4	5290	Ant1	-0.44	0.4	-0.04	7.45	Pass
NVNT	be80	484+242-tone	MRU4	5290	Ant2	0.66	0.4	1.06	7.45	Pass
NVNT	be80	484+242-tone	MRU4	5290	Ant3	2.23	0.4	2.63	7.45	Pass
NVNT	be80	484+242-tone	MRU4	5290	Sum	5.73	0.4	6.13	7.45	Pass
NVNT	be80	484+242-tone	MRU4	5530	Ant1	0.01	0.42	0.43	6.94	Pass
NVNT	be80	484+242-tone	MRU4	5530	Ant2	0.04	0.42	0.46	6.94	Pass


NVNT	be80	484+242-tone	MRU4	5530	Ant3	2.1	0.42	2.52	6.94	Pass
NVNT	be80	484+242-tone	MRU4	5530	Sum	5.6	0.42	6.02	6.94	Pass
NVNT	be80	484+242-tone	MRU4	5610	Ant1	0.39	0.43	0.82	6.94	Pass
NVNT	be80	484+242-tone	MRU4	5610	Ant2	0.69	0.43	1.12	6.94	Pass
NVNT	be80	484+242-tone	MRU4	5610	Ant3	2.45	0.43	2.88	6.94	Pass
NVNT	be80	484+242-tone	MRU4	5610	Sum	6.05	0.43	6.48	6.94	Pass
NVNT	be80	484+242-tone	MRU4	5775	Ant1	2.75	0.42	3.17	25.82	Pass
NVNT	be80	484+242-tone	MRU4	5775	Ant2	4.3	0.42	4.72	25.82	Pass
NVNT	be80	484+242-tone	MRU4	5775	Ant3	5.92	0.42	6.34	25.82	Pass
NVNT	be80	484+242-tone	MRU4	5775	Sum	9.29	0.42	9.71	25.82	Pass
NVNT	be80	484+242-tone	MRU3	5210	Ant1	7.44	0.43	7.87	14.58	Pass
NVNT	be80	484+242-tone	MRU3	5210	Ant2	7.48	0.43	7.91	14.58	Pass
NVNT	be80	484+242-tone	MRU3	5210	Ant3	8.74	0.43	9.17	14.58	Pass
NVNT	be80	484+242-tone	MRU3	5210	Sum	12.7	0.43	13.13	14.58	Pass
NVNT	be80	484+242-tone	MRU3	5290	Ant1	-0.32	0.43	0.11	7.45	Pass
NVNT	be80	484+242-tone	MRU3	5290	Ant2	1.45	0.43	1.88	7.45	Pass
NVNT	be80	484+242-tone	MRU3	5290	Ant3	2.69	0.43	3.12	7.45	Pass
NVNT	be80	484+242-tone	MRU3	5290	Sum	6.22	0.43	6.65	7.45	Pass
NVNT	be80	484+242-tone	MRU3	5530	Ant1	0.51	0.43	0.94	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5530	Ant2	0.38	0.43	0.81	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5530	Ant3	2.84	0.43	3.27	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5530	Sum	6.17	0.43	6.6	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5610	Ant1	0.5	0.42	0.92	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5610	Ant2	0.81	0.42	1.23	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5610	Ant3	2.21	0.42	2.63	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5610	Sum	6.01	0.42	6.43	6.94	Pass
NVNT	be80	484+242-tone	MRU3	5775	Ant1	3.28	0.42	3.7	25.82	Pass
NVNT	be80	484+242-tone	MRU3	5775	Ant2	5.16	0.42	5.58	25.82	Pass
NVNT	be80	484+242-tone	MRU3	5775	Ant3	6.94	0.42	7.36	25.82	Pass
NVNT	be80	484+242-tone	MRU3	5775	Sum	10.15	0.42	10.57	25.82	Pass
NVNT	be80	484+242-tone	MRU2	5210	Ant1	7.17	0.4	7.57	14.58	Pass
NVNT	be80	484+242-tone	MRU2	5210	Ant2	7.24	0.4	7.64	14.58	Pass
NVNT	be80	484+242-tone	MRU2	5210	Ant3	8.47	0.4	8.87	14.58	Pass
NVNT	be80	484+242-tone	MRU2	5210	Sum	12.44	0.4	12.84	14.58	Pass
NVNT	be80	484+242-tone	MRU2	5290	Ant1	0.08	0.43	0.51	7.45	Pass
NVNT	be80	484+242-tone	MRU2	5290	Ant2	0.84	0.43	1.27	7.45	Pass
NVNT	be80	484+242-tone	MRU2	5290	Ant3	2.39	0.43	2.82	7.45	Pass
NVNT	be80	484+242-tone	MRU2	5290	Sum	5.98	0.43	6.41	7.45	Pass
NVNT	be80	484+242-tone	MRU2	5530	Ant1	0.51	0.43	0.94	6.94	Pass
NVNT	be80	484+242-tone	MRU2	5530	Ant2	0.45	0.43	0.88	6.94	Pass
NVNT	be80	484+242-tone	MRU2	5530	Ant3	2.43	0.43	2.86	6.94	Pass
NVNT	be80	484+242-tone	MRU2	5530	Sum	6	0.43	6.43	6.94	Pass

NVNT	be80	484+242-tone	MRU2	5610	Ant1	0.76	0.41	1.17	6.94	Pass
NVNT	be80	484+242-tone	MRU2	5610	Ant2	1.1	0.41	1.51	6.94	Pass
NVNT	be80	484+242-tone	MRU2	5610	Ant3	2.55	0.41	2.96	6.94	Pass
NVNT	be80	484+242-tone	MRU2	5610	Sum	6.31	0.41	6.72	6.94	Pass
NVNT	be80	484+242-tone	MRU2	5775	Ant1	3	0.42	3.42	25.82	Pass
NVNT	be80	484+242-tone	MRU2	5775	Ant2	5.43	0.42	5.85	25.82	Pass
NVNT	be80	484+242-tone	MRU2	5775	Ant3	6.65	0.42	7.07	25.82	Pass
NVNT	be80	484+242-tone	MRU2	5775	Sum	10.05	0.42	10.47	25.82	Pass
NVNT	be80	484+242-tone	MRU1	5210	Ant1	6.78	0.43	7.21	14.58	Pass
NVNT	be80	484+242-tone	MRU1	5210	Ant2	7.34	0.43	7.77	14.58	Pass
NVNT	be80	484+242-tone	MRU1	5210	Ant3	8.46	0.43	8.89	14.58	Pass
NVNT	be80	484+242-tone	MRU1	5210	Sum	12.35	0.43	12.78	14.58	Pass
NVNT	be80	484+242-tone	MRU1	5290	Ant1	-0.65	0.41	-0.24	7.45	Pass
NVNT	be80	484+242-tone	MRU1	5290	Ant2	0.22	0.41	0.63	7.45	Pass
NVNT	be80	484+242-tone	MRU1	5290	Ant3	1.68	0.41	2.09	7.45	Pass
NVNT	be80	484+242-tone	MRU1	5290	Sum	5.3	0.41	5.71	7.45	Pass
NVNT	be80	484+242-tone	MRU1	5530	Ant1	-0.29	0.42	0.13	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5530	Ant2	-0.31	0.42	0.11	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5530	Ant3	2.17	0.42	2.59	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5530	Sum	5.46	0.42	5.88	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5610	Ant1	-0.08	0.42	0.34	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5610	Ant2	0.48	0.42	0.9	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5610	Ant3	1.43	0.42	1.85	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5610	Sum	5.43	0.42	5.85	6.94	Pass
NVNT	be80	484+242-tone	MRU1	5775	Ant1	2.58	0.43	3.01	25.82	Pass
NVNT	be80	484+242-tone	MRU1	5775	Ant2	4.87	0.43	5.3	25.82	Pass
NVNT	be80	484+242-tone	MRU1	5775	Ant3	6.42	0.43	6.85	25.82	Pass
NVNT	be80	484+242-tone	MRU1	5775	Sum	9.67	0.43	10.1	25.82	Pass
NVNT	be160	996+484+242-tone	MRU1	5250	Ant1	-6.83	0.44	-6.39	7.45	Pass
NVNT	be160	996+484+242-tone	MRU1	5250	Ant2	-7.38	0.44	-6.94	7.45	Pass
NVNT	be160	996+484+242-tone	MRU1	5250	Ant3	-6.01	0.44	-5.57	7.45	Pass
NVNT	be160	996+484+242-tone	MRU1	5250	Sum	-1.93	0.44	-1.49	7.45	Pass
NVNT	be160	996+484+242-tone	MRU1	5570	Ant1	-1.78	0.43	-1.35	6.94	Pass
NVNT	be160	996+484+242-tone	MRU1	5570	Ant2	-1.46	0.43	-1.03	6.94	Pass
NVNT	be160	996+484+242-tone	MRU1	5570	Ant3	-0.73	0.43	-0.3	6.94	Pass
NVNT	be160	996+484+242-tone	MRU1	5570	Sum	3.47	0.43	3.9	6.94	Pass
NVNT	be160	996+484+242-tone	MRU2	5250	Ant1	-7.32	0.45	-6.87	7.45	Pass
NVNT	be160	996+484+242-tone	MRU2	5250	Ant2	-7.25	0.45	-6.8	7.45	Pass
NVNT	be160	996+484+242-tone	MRU2	5250	Ant3	-6.02	0.45	-5.57	7.45	Pass
NVNT	be160	996+484+242-tone	MRU2	5250	Sum	-2.05	0.45	-1.6	7.45	Pass
NVNT	be160	996+484+242-tone	MRU2	5570	Ant1	-1.84	0.45	-1.39	6.94	Pass
NVNT	be160	996+484+242-tone	MRU2	5570	Ant2	-1.36	0.45	-0.91	6.94	Pass


NVNT	be160	996+484+242-tone	MRU2	5570	Ant3	-0.91	0.45	-0.46	6.94	Pass
NVNT	be160	996+484+242-tone	MRU2	5570	Sum	3.42	0.45	3.87	6.94	Pass
NVNT	be160	996+484+242-tone	MRU3	5250	Ant1	-6.95	0.44	-6.51	7.45	Pass
NVNT	be160	996+484+242-tone	MRU3	5250	Ant2	-7.6	0.44	-7.16	7.45	Pass
NVNT	be160	996+484+242-tone	MRU3	5250	Ant3	-6.33	0.44	-5.89	7.45	Pass
NVNT	be160	996+484+242-tone	MRU3	5250	Sum	-2.16	0.44	-1.72	7.45	Pass
NVNT	be160	996+484+242-tone	MRU3	5570	Ant1	-1.67	0.45	-1.22	6.94	Pass
NVNT	be160	996+484+242-tone	MRU3	5570	Ant2	-1.61	0.45	-1.16	6.94	Pass
NVNT	be160	996+484+242-tone	MRU3	5570	Ant3	-0.64	0.45	-0.19	6.94	Pass
NVNT	be160	996+484+242-tone	MRU3	5570	Sum	3.49	0.45	3.94	6.94	Pass
NVNT	be160	996+484+242-tone	MRU4	5250	Ant1	-7.6	0.45	-7.15	7.45	Pass
NVNT	be160	996+484+242-tone	MRU4	5250	Ant2	-7.6	0.45	-7.15	7.45	Pass
NVNT	be160	996+484+242-tone	MRU4	5250	Ant3	-6.65	0.45	-6.2	7.45	Pass
NVNT	be160	996+484+242-tone	MRU4	5250	Sum	-2.49	0.45	-2.04	7.45	Pass
NVNT	be160	996+484+242-tone	MRU4	5570	Ant1	-2.04	0.43	-1.61	6.94	Pass
NVNT	be160	996+484+242-tone	MRU4	5570	Ant2	-1.17	0.43	-0.74	6.94	Pass
NVNT	be160	996+484+242-tone	MRU4	5570	Ant3	-0.64	0.43	-0.21	6.94	Pass
NVNT	be160	996+484+242-tone	MRU4	5570	Sum	3.53	0.43	3.96	6.94	Pass
NVNT	be160	996+484+242-tone	MRU5	5250	Ant1	-6.93	0.43	-6.5	7.45	Pass
NVNT	be160	996+484+242-tone	MRU5	5250	Ant2	-7.17	0.43	-6.74	7.45	Pass
NVNT	be160	996+484+242-tone	MRU5	5250	Ant3	-6.02	0.43	-5.59	7.45	Pass
NVNT	be160	996+484+242-tone	MRU5	5250	Sum	-1.91	0.43	-1.48	7.45	Pass
NVNT	be160	996+484+242-tone	MRU5	5570	Ant1	-1.64	0.45	-1.19	6.94	Pass
NVNT	be160	996+484+242-tone	MRU5	5570	Ant2	-1.47	0.45	-1.02	6.94	Pass
NVNT	be160	996+484+242-tone	MRU5	5570	Ant3	-0.3	0.45	0.15	6.94	Pass
NVNT	be160	996+484+242-tone	MRU5	5570	Sum	3.68	0.45	4.13	6.94	Pass
NVNT	be160	996+484+242-tone	MRU6	5250	Ant1	-6.54	0.45	-6.09	7.45	Pass
NVNT	be160	996+484+242-tone	MRU6	5250	Ant2	-6.58	0.45	-6.13	7.45	Pass
NVNT	be160	996+484+242-tone	MRU6	5250	Ant3	-5.53	0.45	-5.08	7.45	Pass
NVNT	be160	996+484+242-tone	MRU6	5250	Sum	-1.42	0.45	-0.97	7.45	Pass
NVNT	be160	996+484+242-tone	MRU6	5570	Ant1	-2.04	0.42	-1.62	6.94	Pass
NVNT	be160	996+484+242-tone	MRU6	5570	Ant2	-1.98	0.42	-1.56	6.94	Pass
NVNT	be160	996+484+242-tone	MRU6	5570	Ant3	-1.18	0.42	-0.76	6.94	Pass
NVNT	be160	996+484+242-tone	MRU6	5570	Sum	3.06	0.42	3.48	6.94	Pass
NVNT	be160	996+484+242-tone	MRU7	5250	Ant1	-6.66	0.44	-6.22	7.45	Pass
NVNT	be160	996+484+242-tone	MRU7	5250	Ant2	-6.37	0.44	-5.93	7.45	Pass
NVNT	be160	996+484+242-tone	MRU7	5250	Ant3	-5.52	0.44	-5.08	7.45	Pass
NVNT	be160	996+484+242-tone	MRU7	5250	Sum	-1.38	0.44	-0.94	7.45	Pass
NVNT	be160	996+484+242-tone	MRU7	5570	Ant1	-1.62	0.42	-1.2	6.94	Pass
NVNT	be160	996+484+242-tone	MRU7	5570	Ant2	-1.82	0.42	-1.4	6.94	Pass
NVNT	be160	996+484+242-tone	MRU7	5570	Ant3	-0.72	0.42	-0.3	6.94	Pass
NVNT	be160	996+484+242-tone	MRU7	5570	Sum	3.41	0.42	3.83	6.94	Pass

NVNT	be160	996+484+242-tone	MRU8	5250	Ant1	-6.62	0.42	-6.2	7.45	Pass
NVNT	be160	996+484+242-tone	MRU8	5250	Ant2	-6.93	0.42	-6.51	7.45	Pass
NVNT	be160	996+484+242-tone	MRU8	5250	Ant3	-5.75	0.42	-5.33	7.45	Pass
NVNT	be160	996+484+242-tone	MRU8	5250	Sum	-1.63	0.42	-1.21	7.45	Pass
NVNT	be160	996+484+242-tone	MRU8	5570	Ant1	-1.66	0.42	-1.24	6.94	Pass
NVNT	be160	996+484+242-tone	MRU8	5570	Ant2	-1.62	0.42	-1.2	6.94	Pass
NVNT	be160	996+484+242-tone	MRU8	5570	Ant3	-1.11	0.42	-0.69	6.94	Pass
NVNT	be160	996+484+242-tone	MRU8	5570	Sum	3.32	0.42	3.74	6.94	Pass
NVNT	be160	996+484-tone	MRU1	5250	Ant1	-6.39	0.43	-5.96	7.45	Pass
NVNT	be160	996+484-tone	MRU1	5250	Ant2	-6.31	0.43	-5.88	7.45	Pass
NVNT	be160	996+484-tone	MRU1	5250	Ant3	-5.52	0.43	-5.09	7.45	Pass
NVNT	be160	996+484-tone	MRU1	5250	Sum	-1.28	0.43	-0.85	7.45	Pass
NVNT	be160	996+484-tone	MRU1	5570	Ant1	-1.29	0.42	-0.87	6.94	Pass
NVNT	be160	996+484-tone	MRU1	5570	Ant2	-0.4	0.42	0.02	6.94	Pass
NVNT	be160	996+484-tone	MRU1	5570	Ant3	-0.14	0.42	0.28	6.94	Pass
NVNT	be160	996+484-tone	MRU1	5570	Sum	4.19	0.42	4.61	6.94	Pass
NVNT	be160	996+484-tone	MRU2	5250	Ant1	-6.23	0.43	-5.8	7.45	Pass
NVNT	be160	996+484-tone	MRU2	5250	Ant2	-6.58	0.43	-6.15	7.45	Pass
NVNT	be160	996+484-tone	MRU2	5250	Ant3	-5.92	0.43	-5.49	7.45	Pass
NVNT	be160	996+484-tone	MRU2	5250	Sum	-1.46	0.43	-1.03	7.45	Pass
NVNT	be160	996+484-tone	MRU2	5570	Ant1	-1.01	0.44	-0.57	6.94	Pass
NVNT	be160	996+484-tone	MRU2	5570	Ant2	-0.94	0.44	-0.5	6.94	Pass
NVNT	be160	996+484-tone	MRU2	5570	Ant3	0.03	0.44	0.47	6.94	Pass
NVNT	be160	996+484-tone	MRU2	5570	Sum	4.16	0.44	4.6	6.94	Pass
NVNT	be160	996+484-tone	MRU3	5250	Ant1	-6.01	0.46	-5.55	7.45	Pass
NVNT	be160	996+484-tone	MRU3	5250	Ant2	-6.34	0.46	-5.88	7.45	Pass
NVNT	be160	996+484-tone	MRU3	5250	Ant3	-5.26	0.46	-4.8	7.45	Pass
NVNT	be160	996+484-tone	MRU3	5250	Sum	-1.07	0.46	-0.61	7.45	Pass
NVNT	be160	996+484-tone	MRU3	5570	Ant1	-1.4	0.46	-0.94	6.94	Pass
NVNT	be160	996+484-tone	MRU3	5570	Ant2	-1.24	0.46	-0.78	6.94	Pass
NVNT	be160	996+484-tone	MRU3	5570	Ant3	-0.35	0.46	0.11	6.94	Pass
NVNT	be160	996+484-tone	MRU3	5570	Sum	3.8	0.46	4.26	6.94	Pass
NVNT	be160	996+484-tone	MRU4	5250	Ant1	-6.25	0.46	-5.79	7.45	Pass
NVNT	be160	996+484-tone	MRU4	5250	Ant2	-6.87	0.46	-6.41	7.45	Pass
NVNT	be160	996+484-tone	MRU4	5250	Ant3	-5.88	0.46	-5.42	7.45	Pass
NVNT	be160	996+484-tone	MRU4	5250	Sum	-1.54	0.46	-1.08	7.45	Pass
NVNT	be160	996+484-tone	MRU4	5570	Ant1	-1.06	0.42	-0.64	6.94	Pass
NVNT	be160	996+484-tone	MRU4	5570	Ant2	-0.88	0.42	-0.46	6.94	Pass
NVNT	be160	996+484-tone	MRU4	5570	Ant3	-0.25	0.42	0.17	6.94	Pass
NVNT	be160	996+484-tone	MRU4	5570	Sum	4.06	0.42	4.48	6.94	Pass

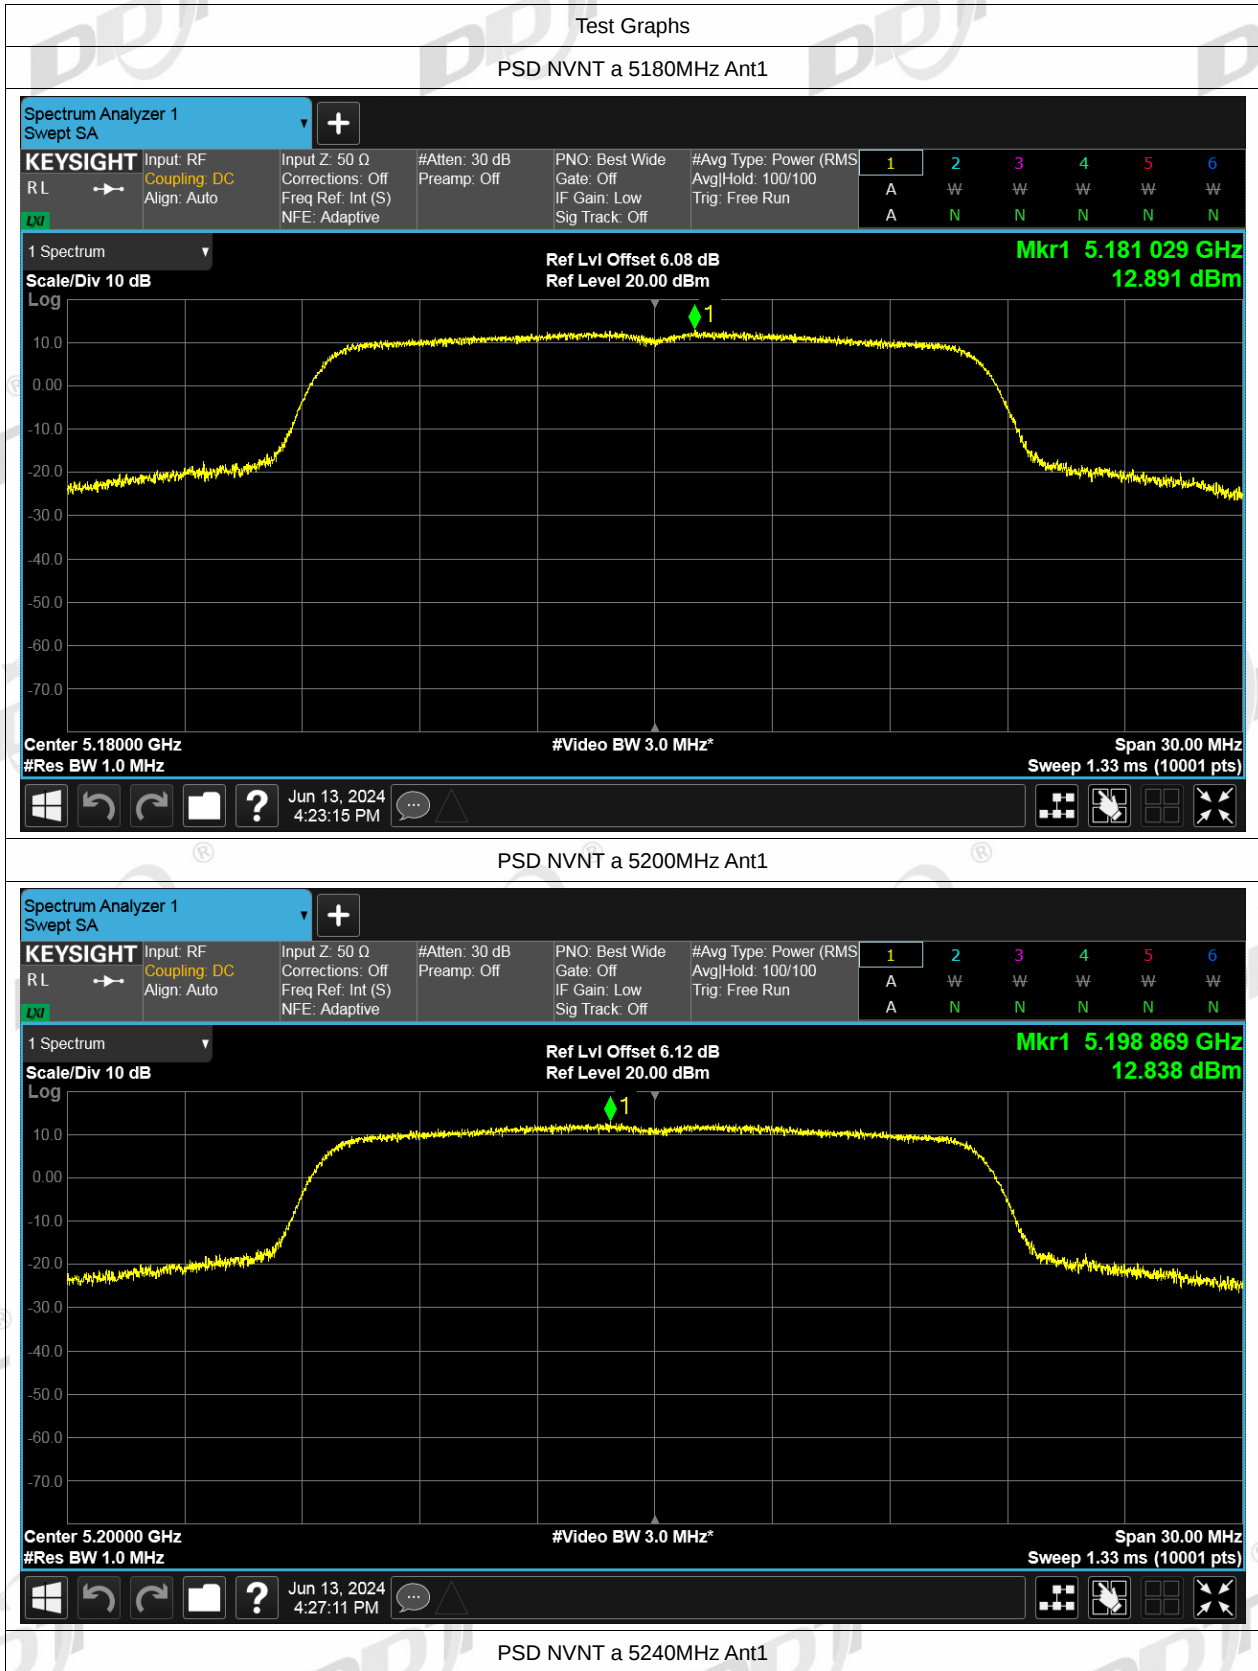

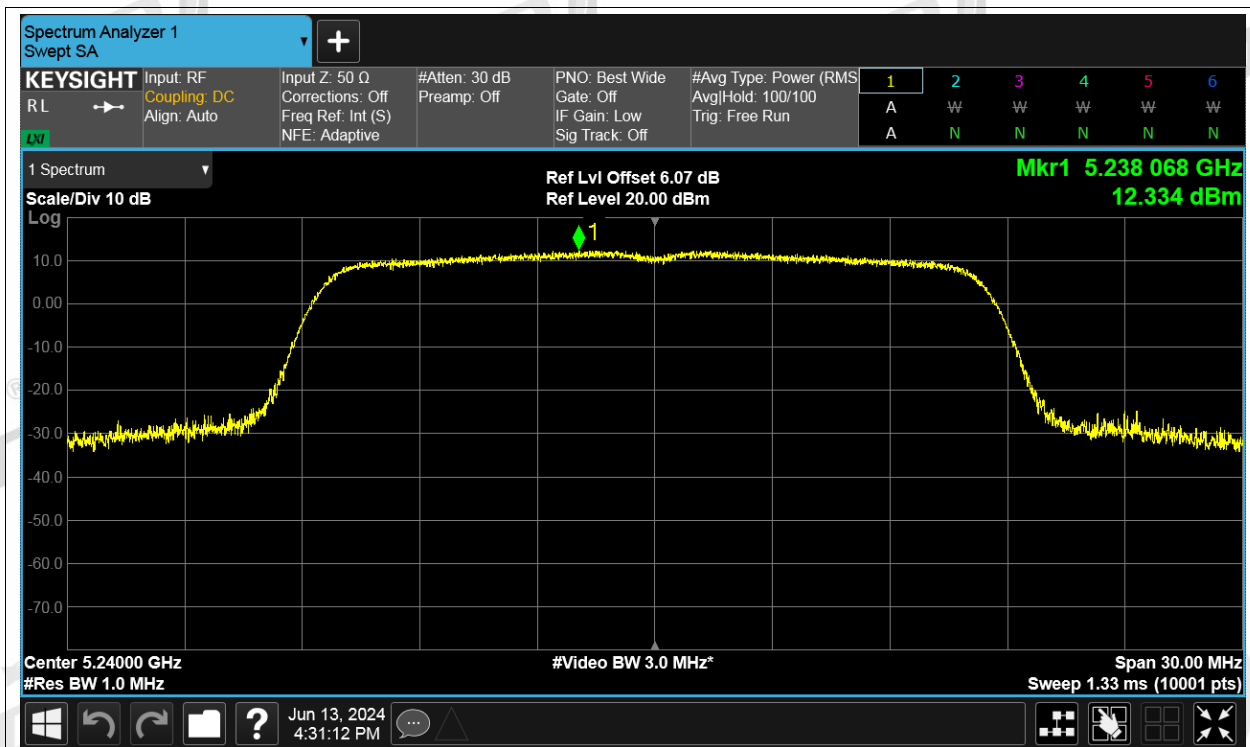

PSD NVNT a 5260MHz Ant1

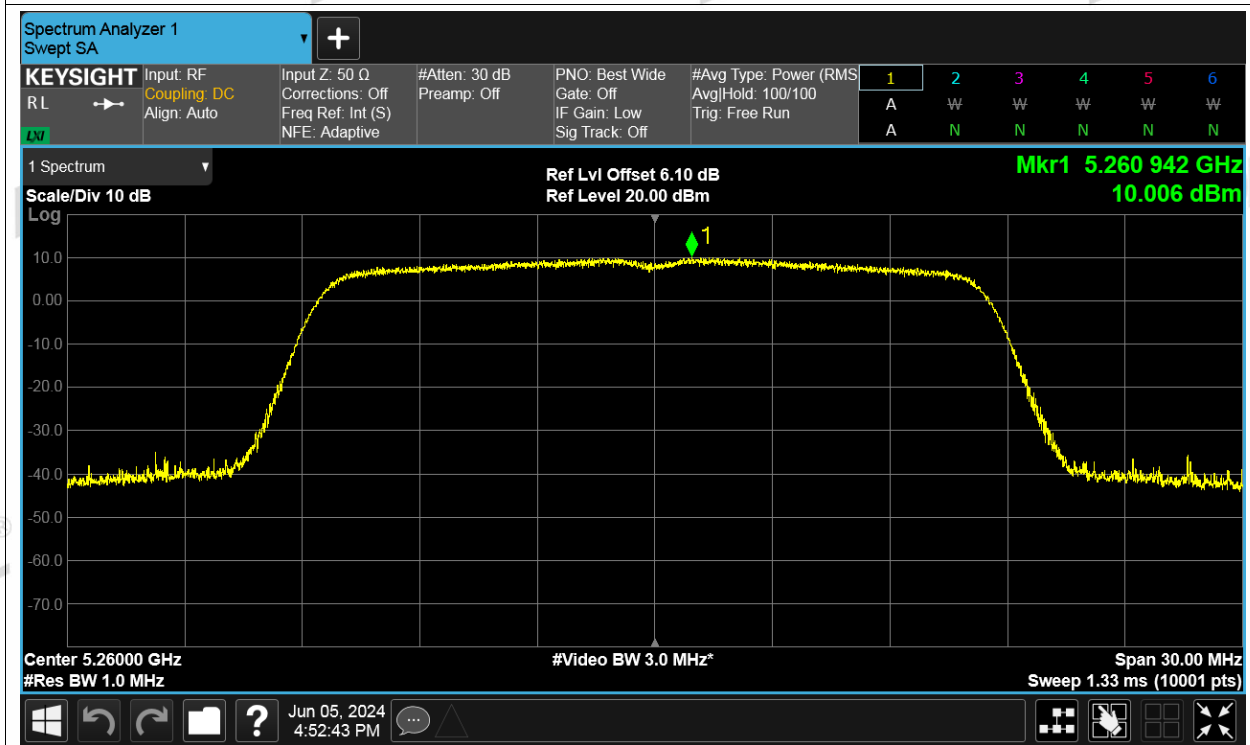

PSD NVNT a 5280MHz Ant1