





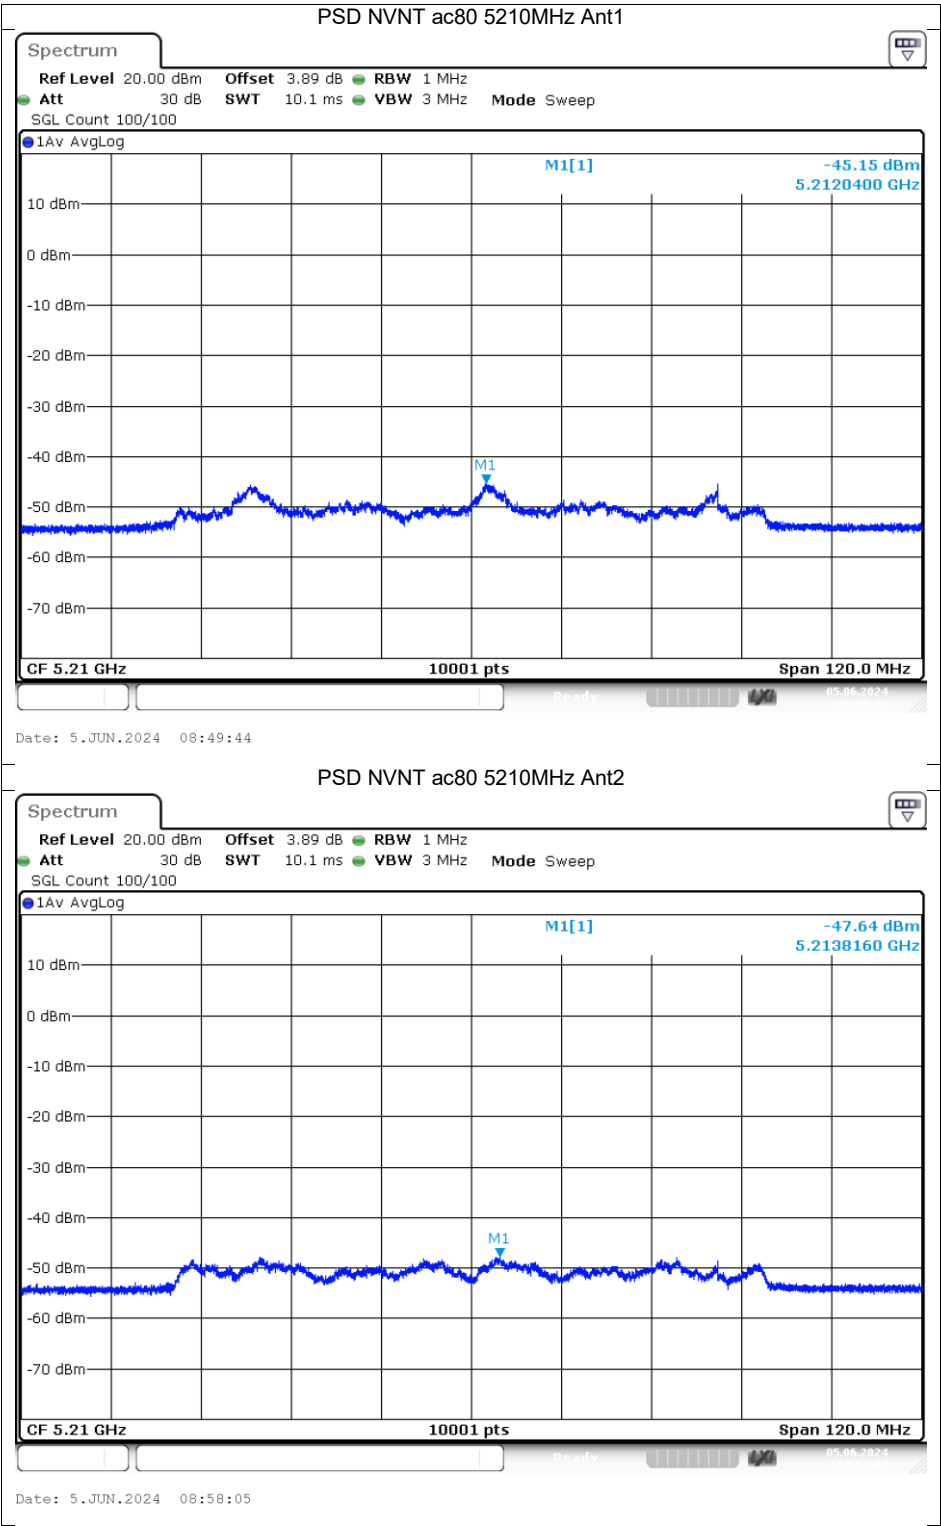

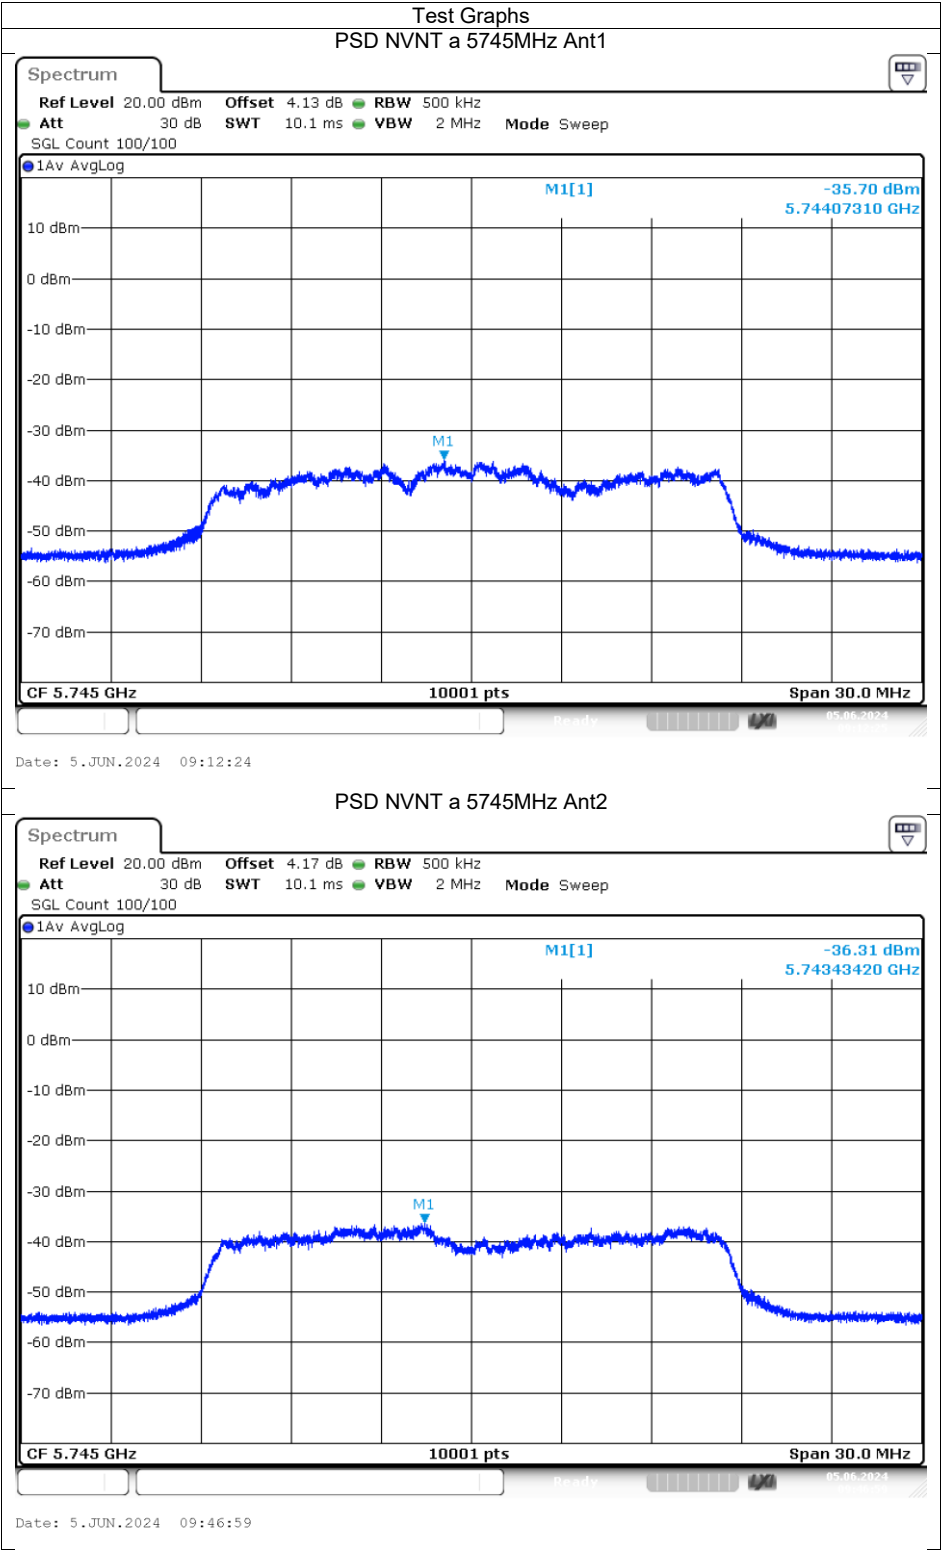


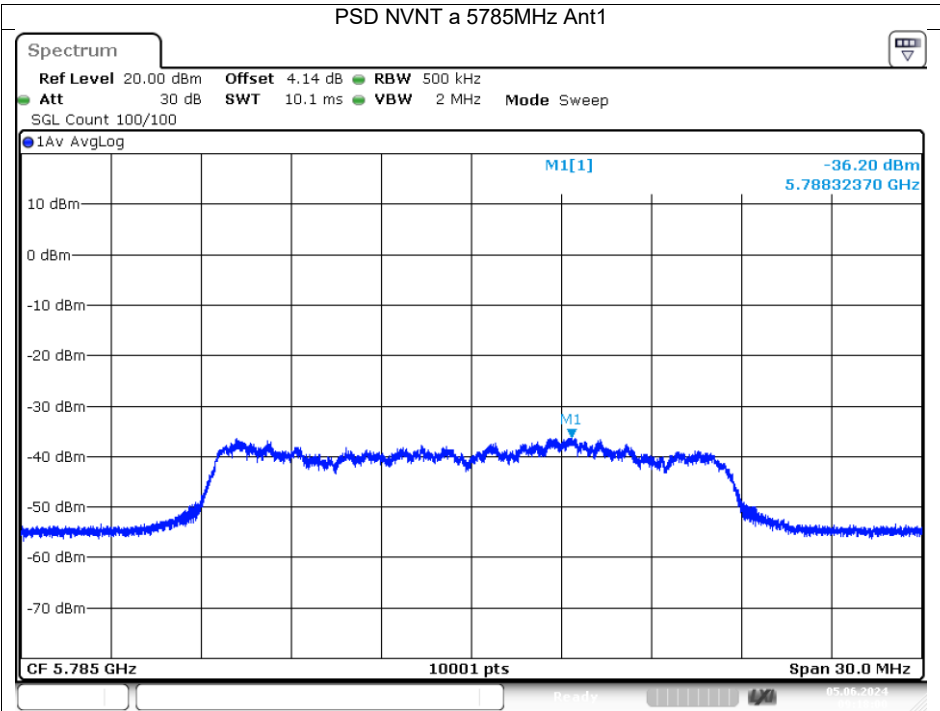


Date: 5.JUN.2024 09:18:00

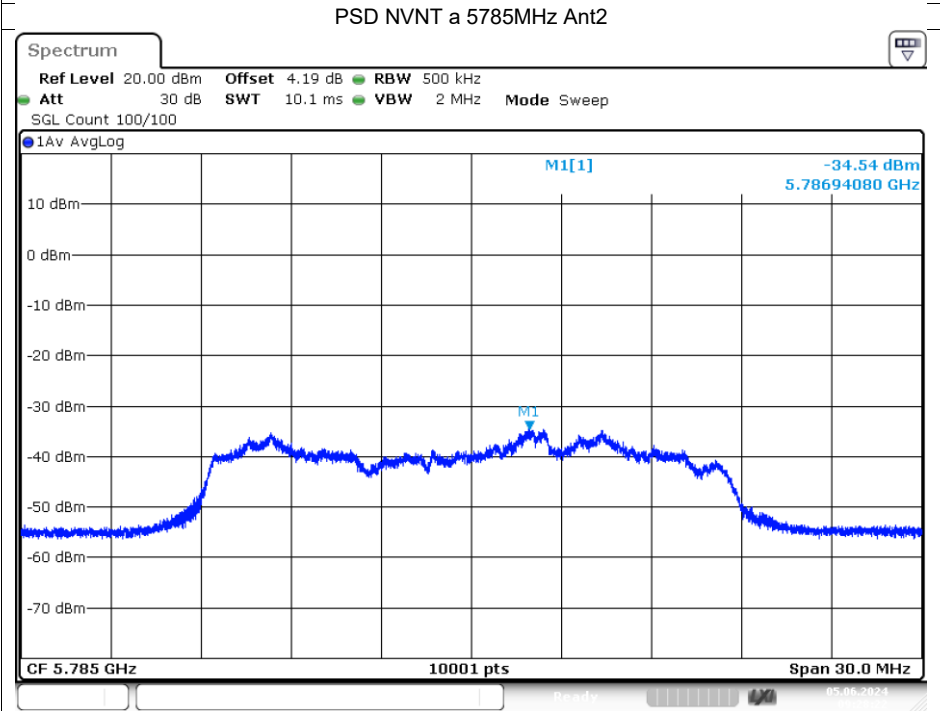


Date: 5.JUN.2024 09:28:22

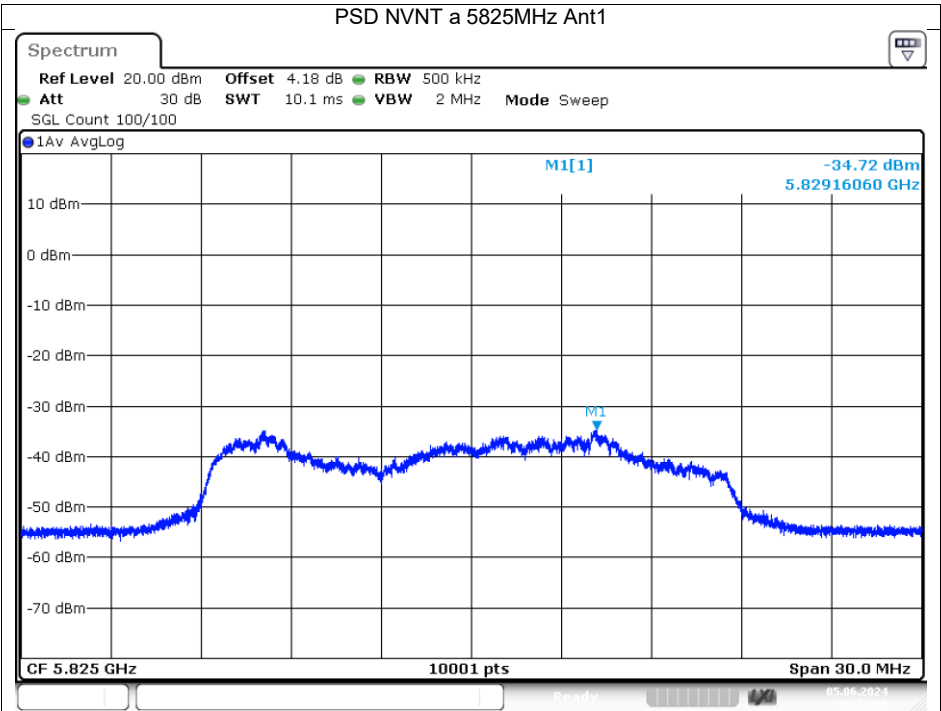


Date: 5.JUN.2024 09:21:09

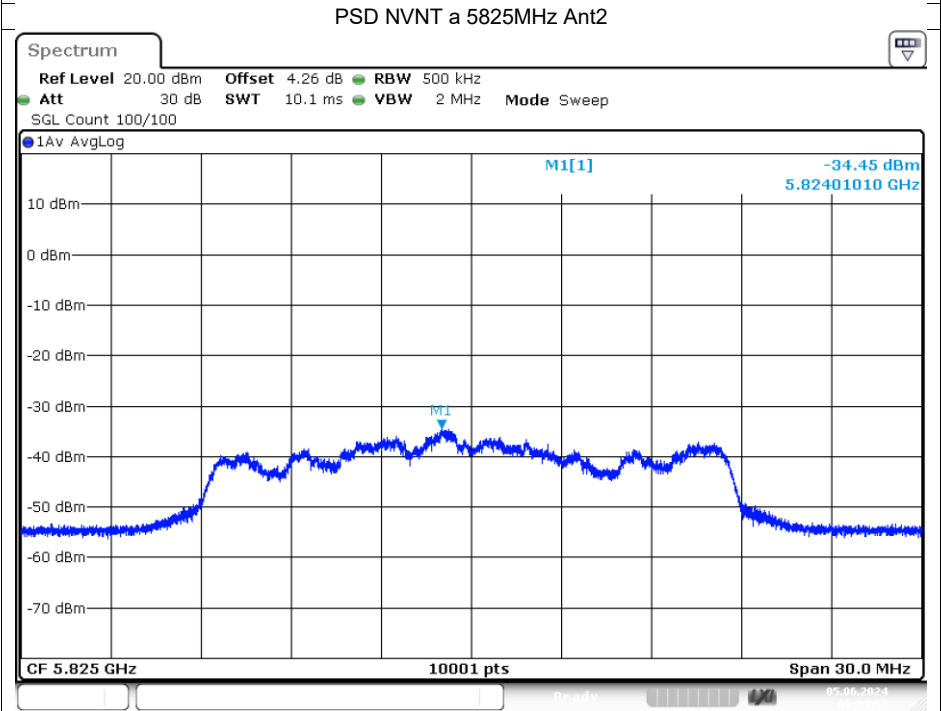



Date: 5.JUN.2024 09:24:52

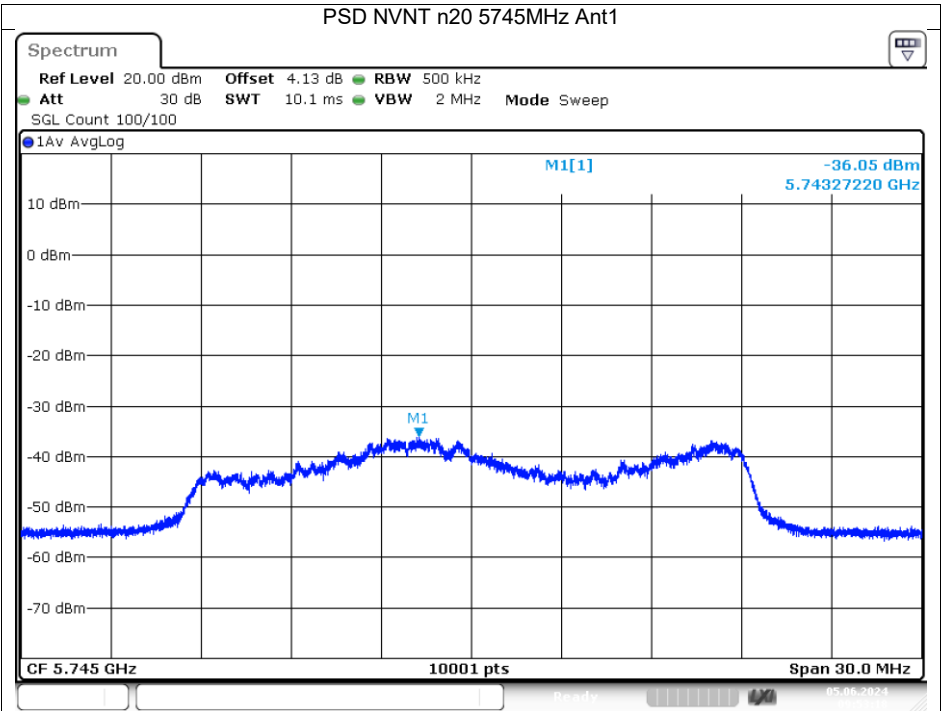


Date: 5.JUN.2024 09:53:18

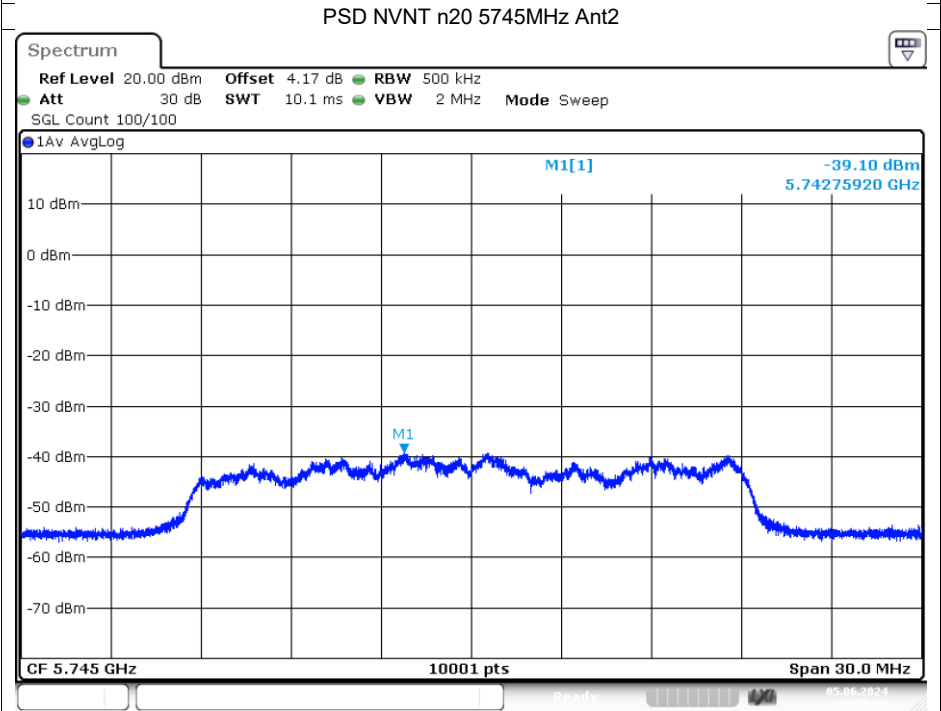


Date: 5.JUN.2024 09:55:22

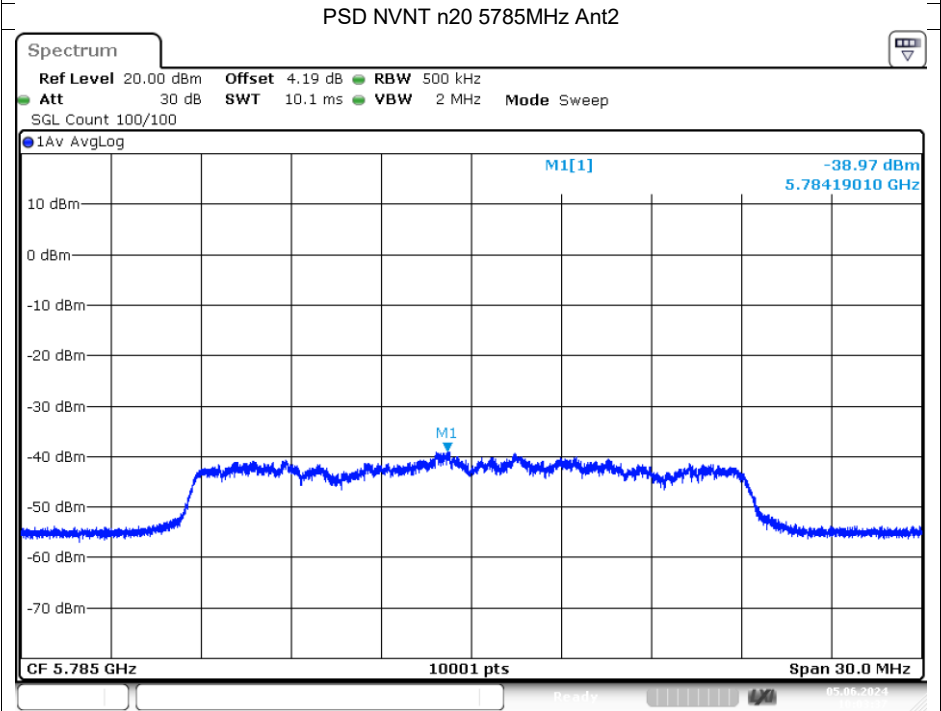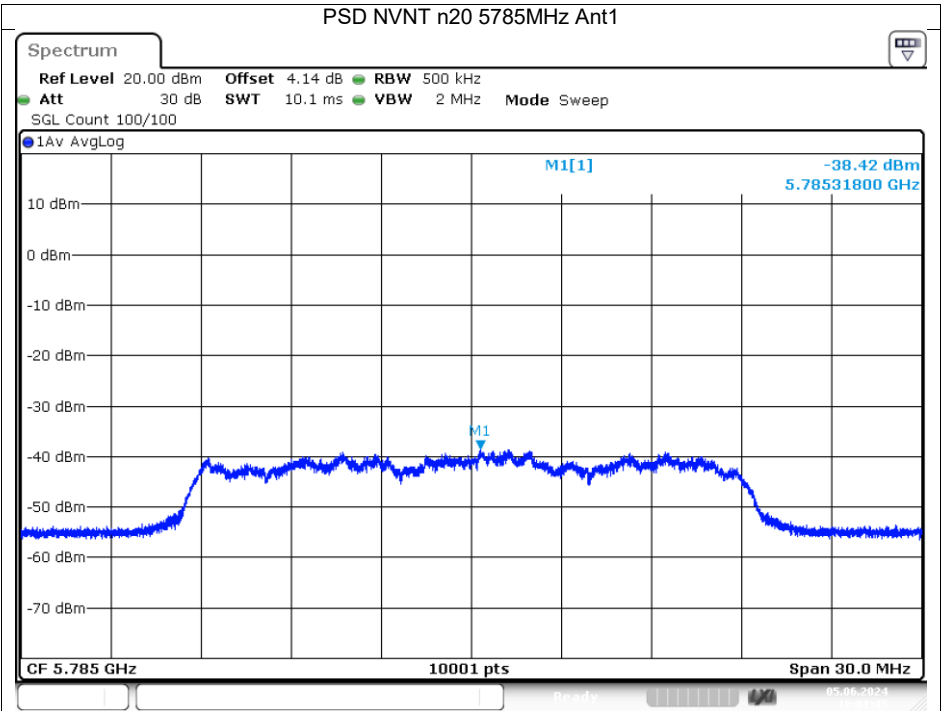


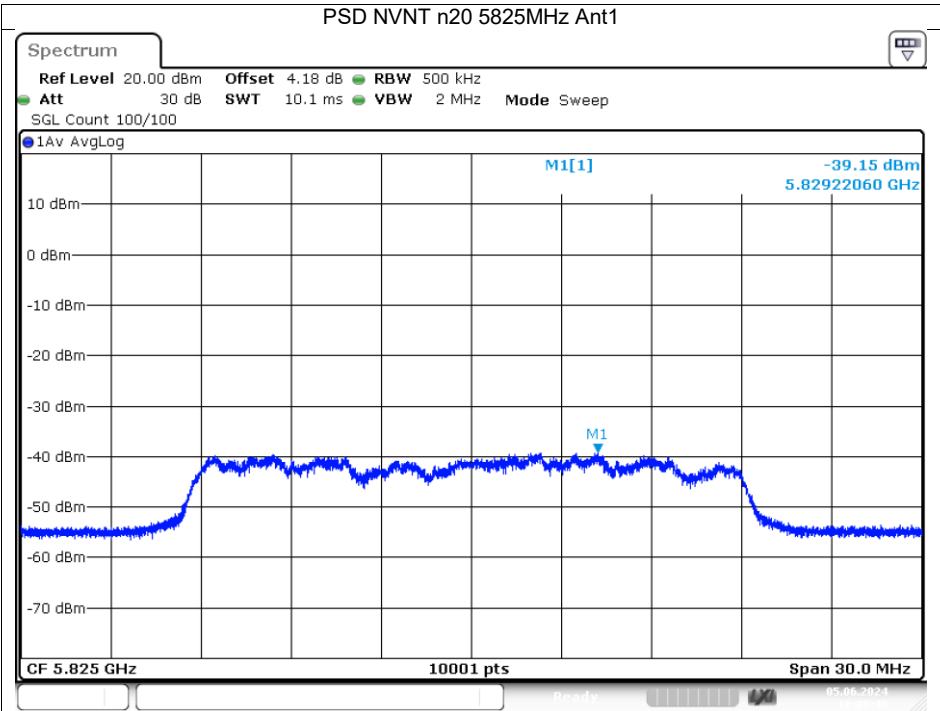


Date: 5.JUN.2024 10:09:49

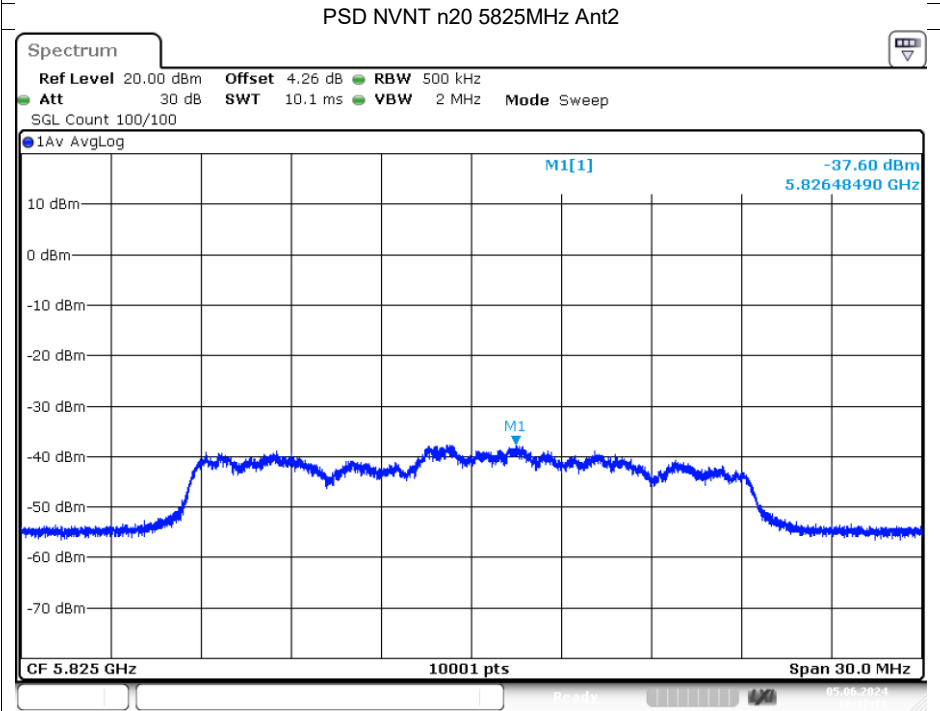


Date: 5.JUN.2024 10:12:12

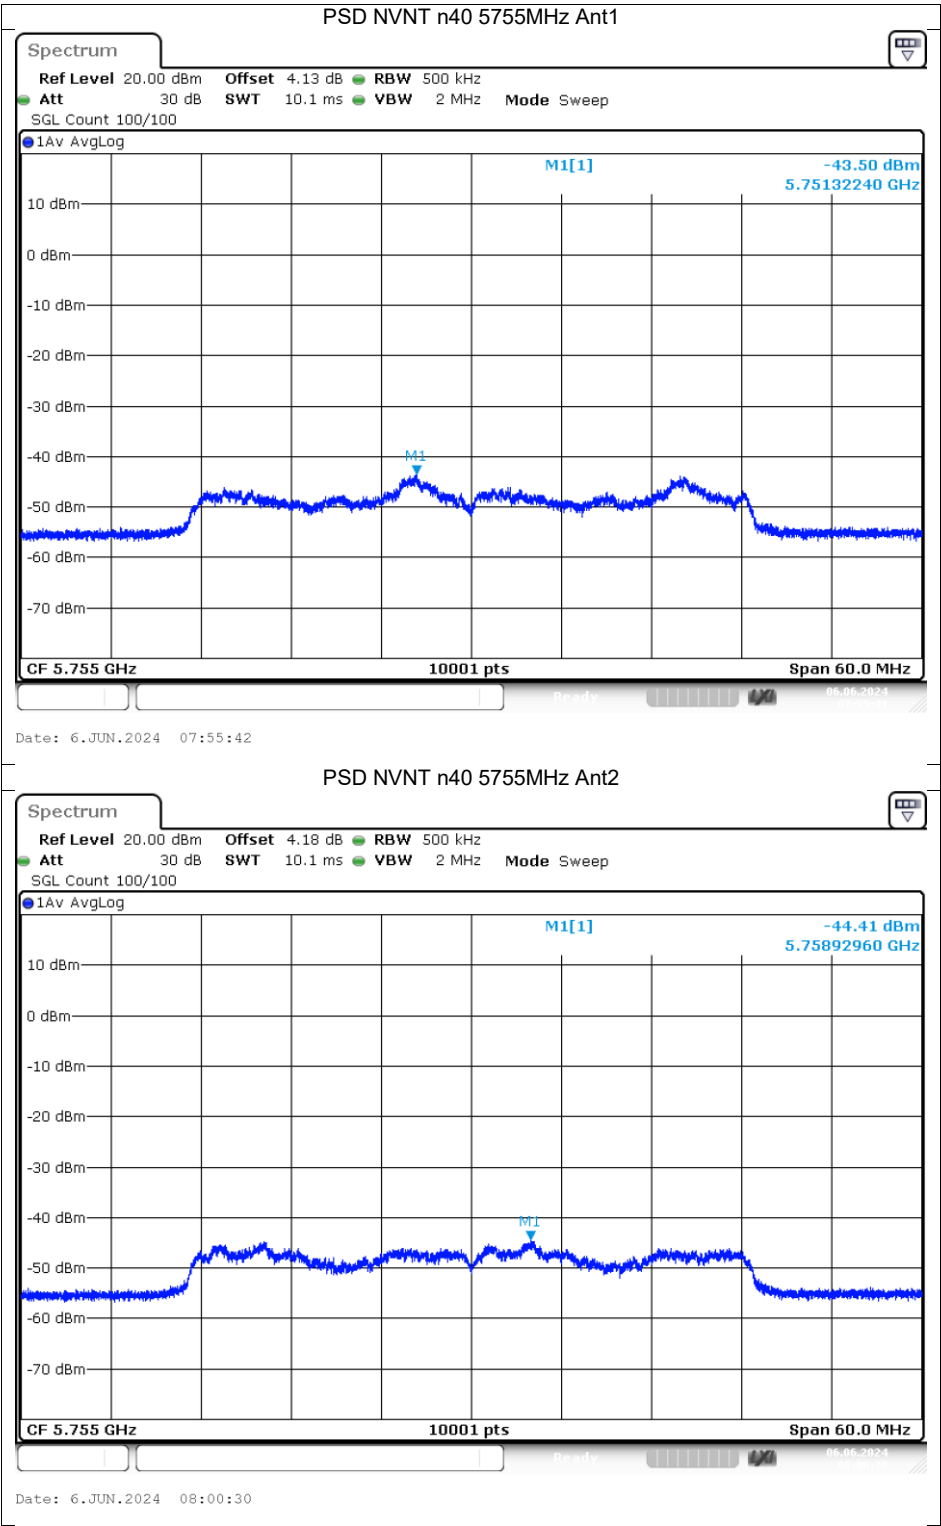


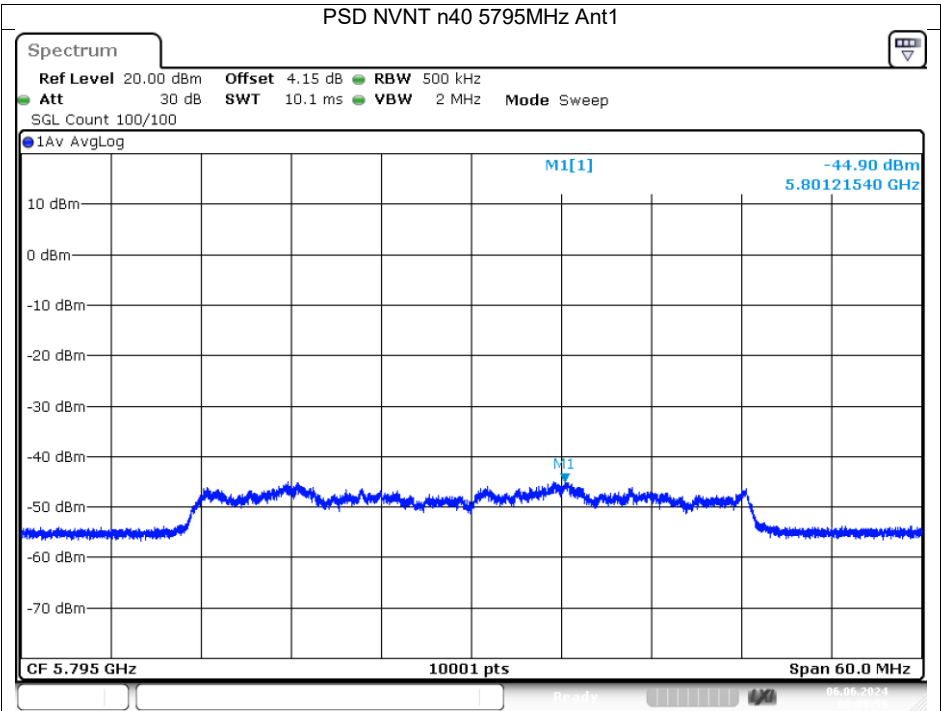



Date: 6.JUN.2024 08:09:59

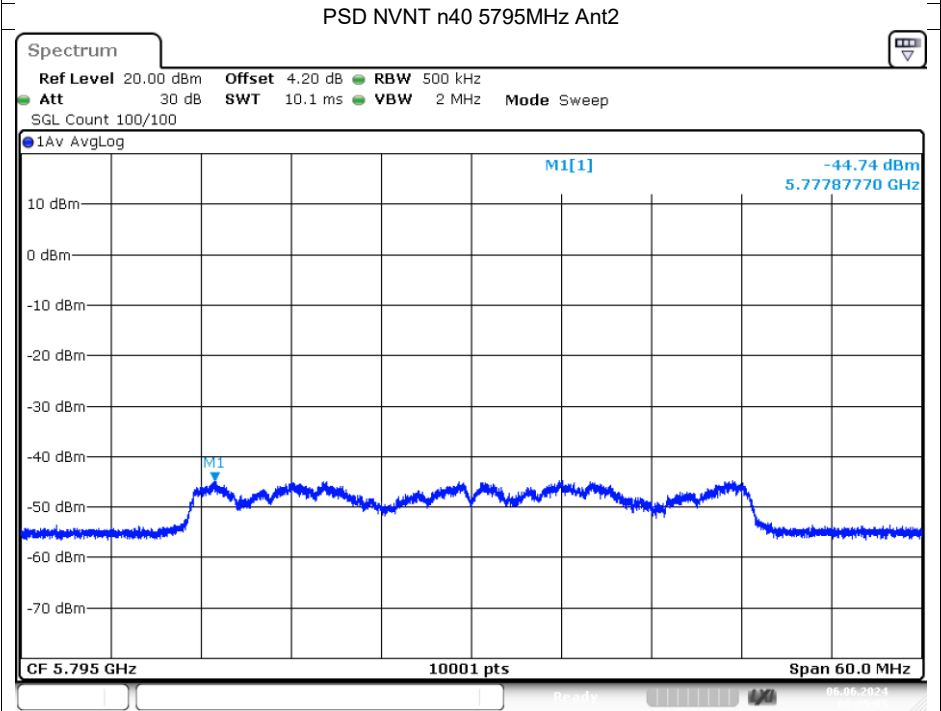



Date: 6.JUN.2024 08:25:06

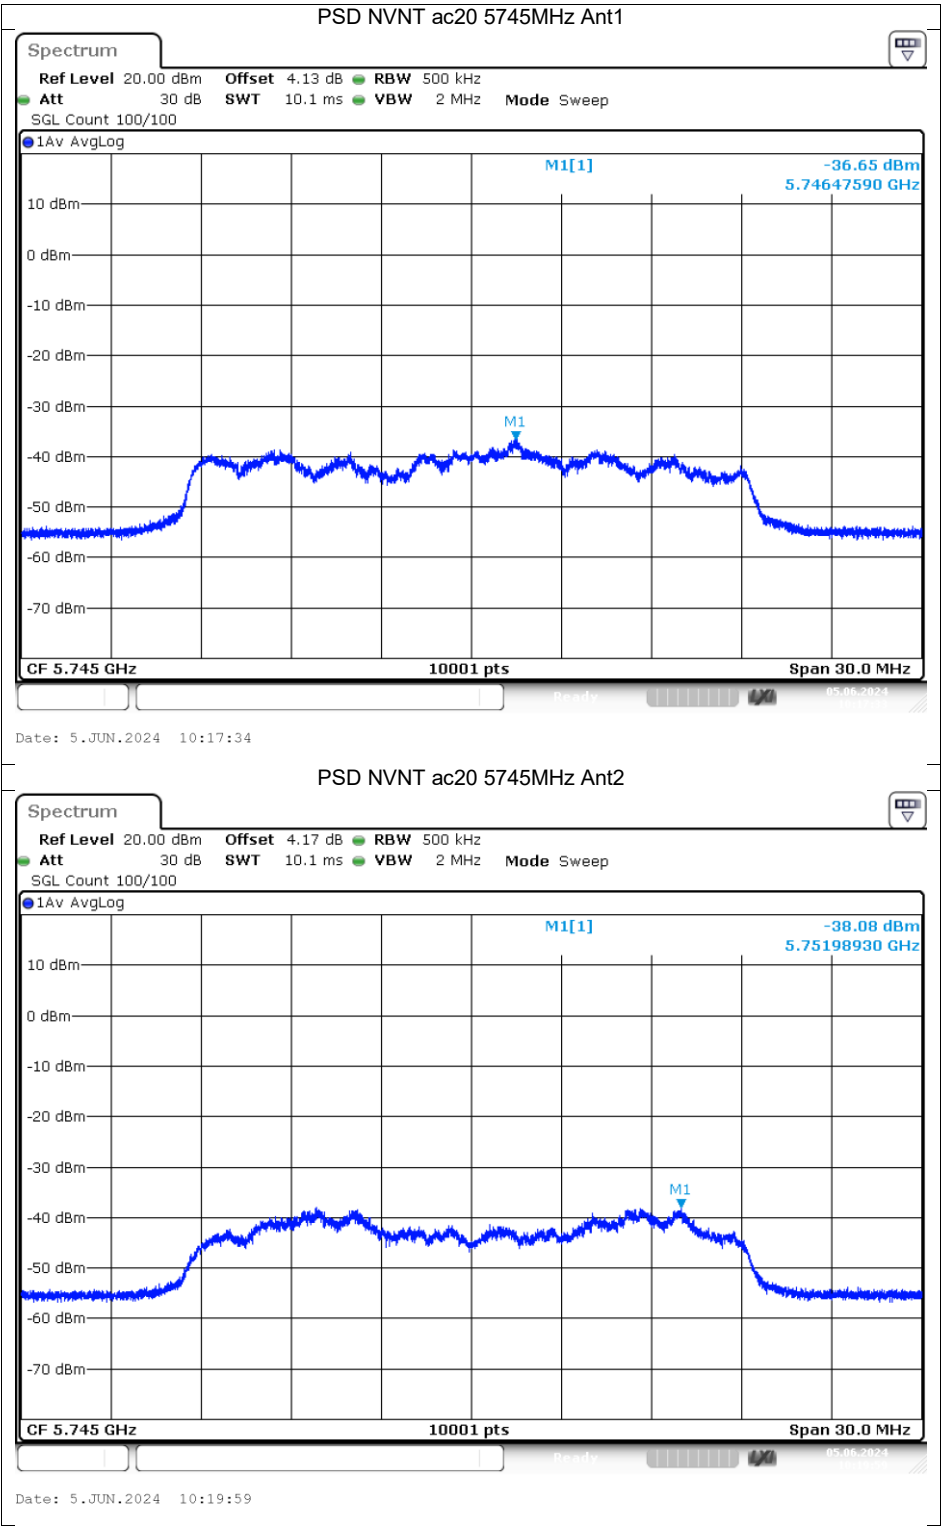


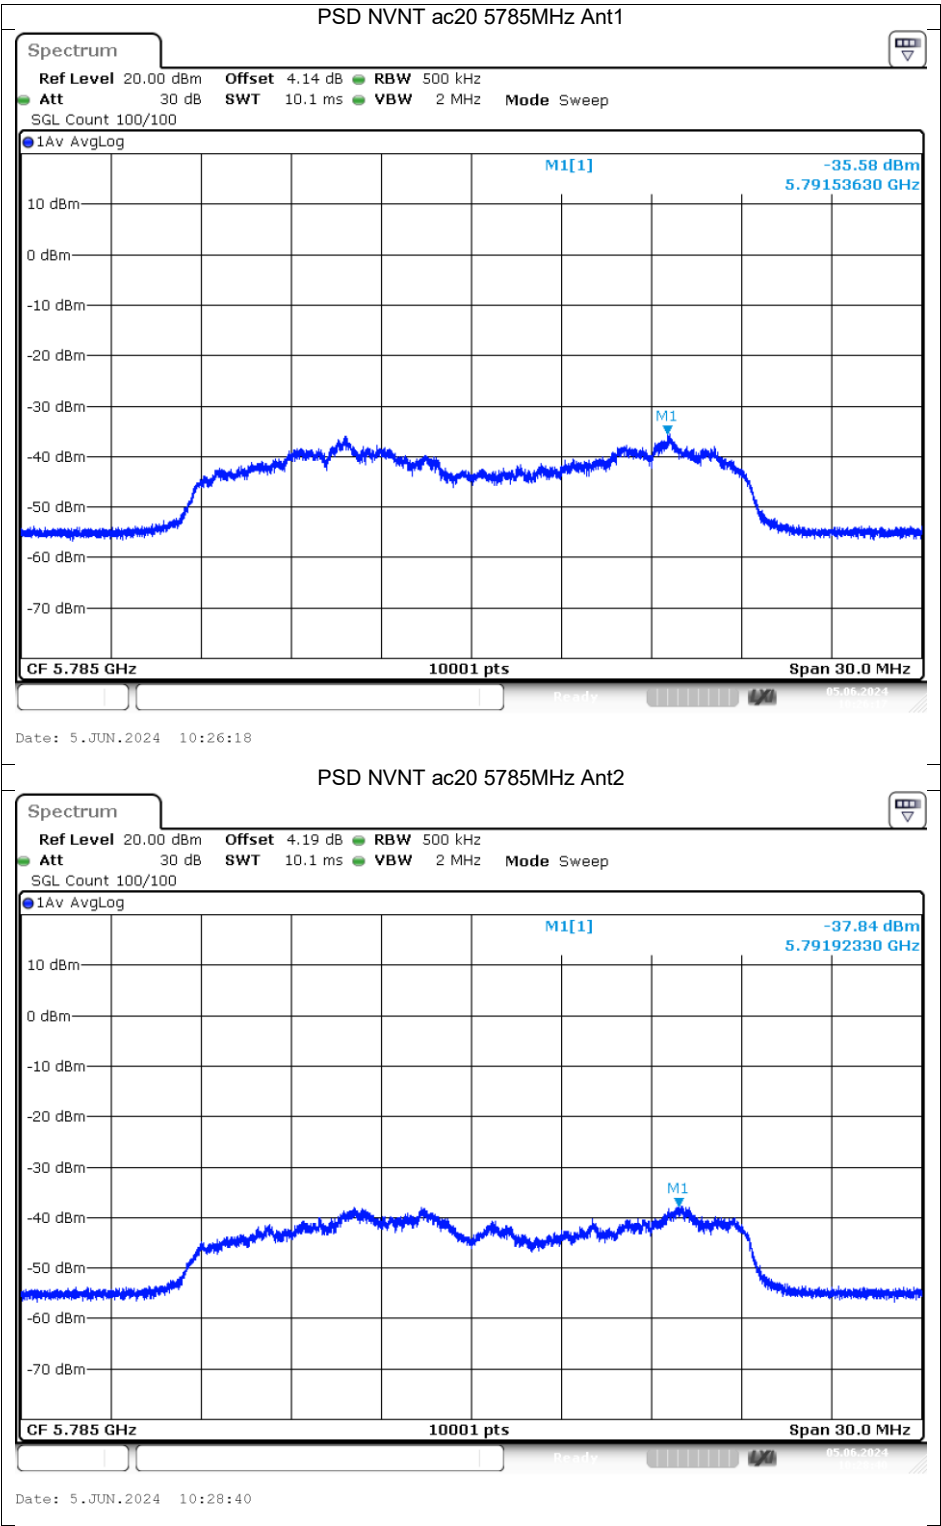

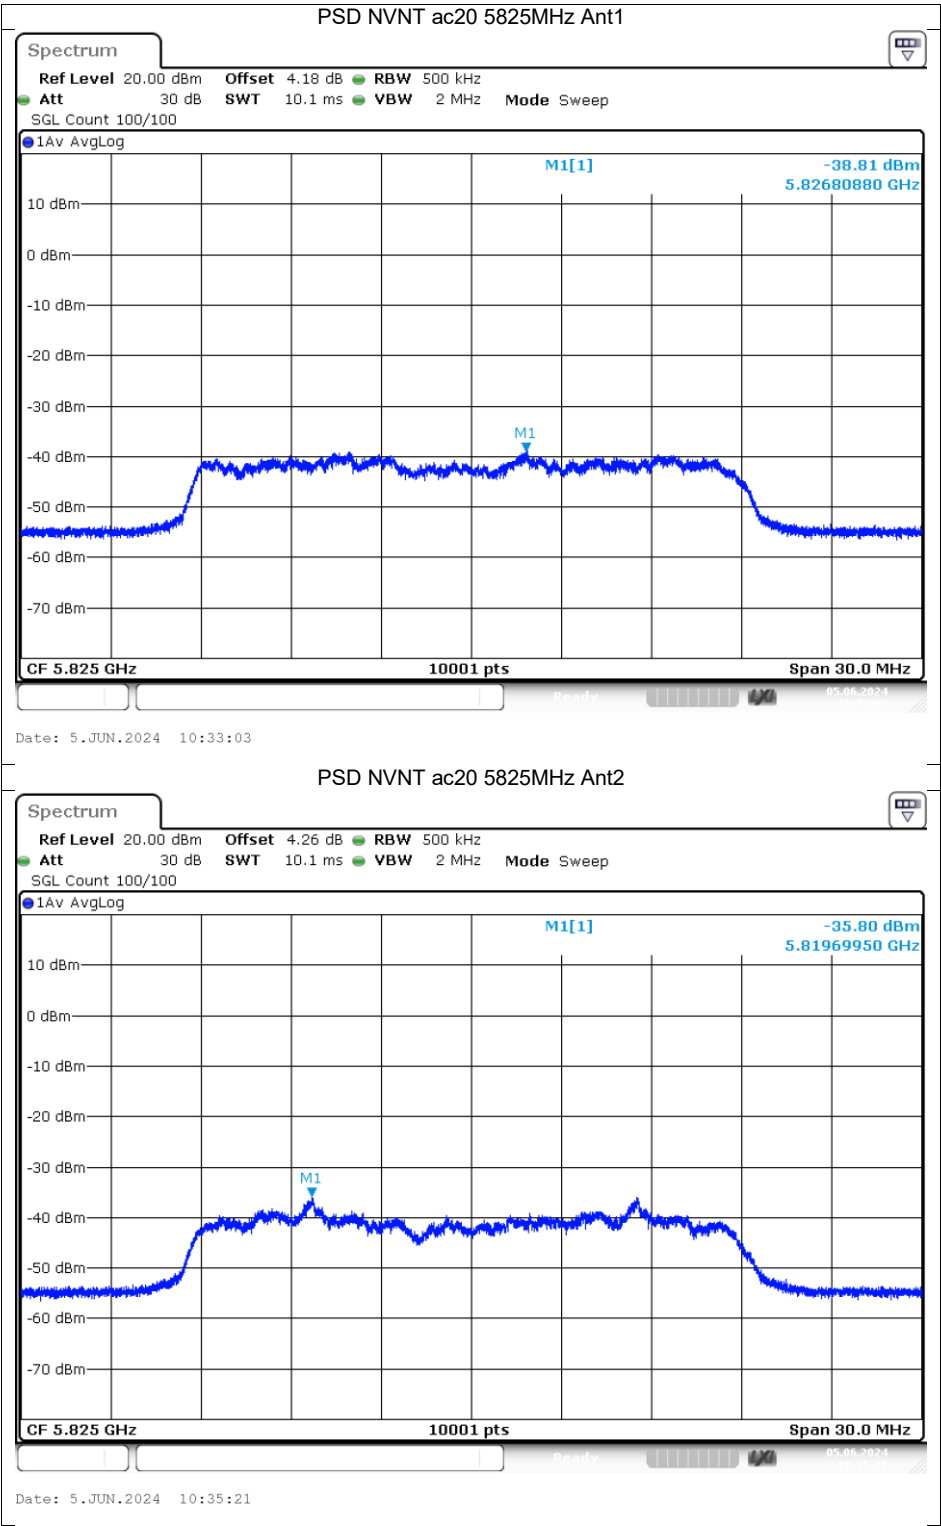

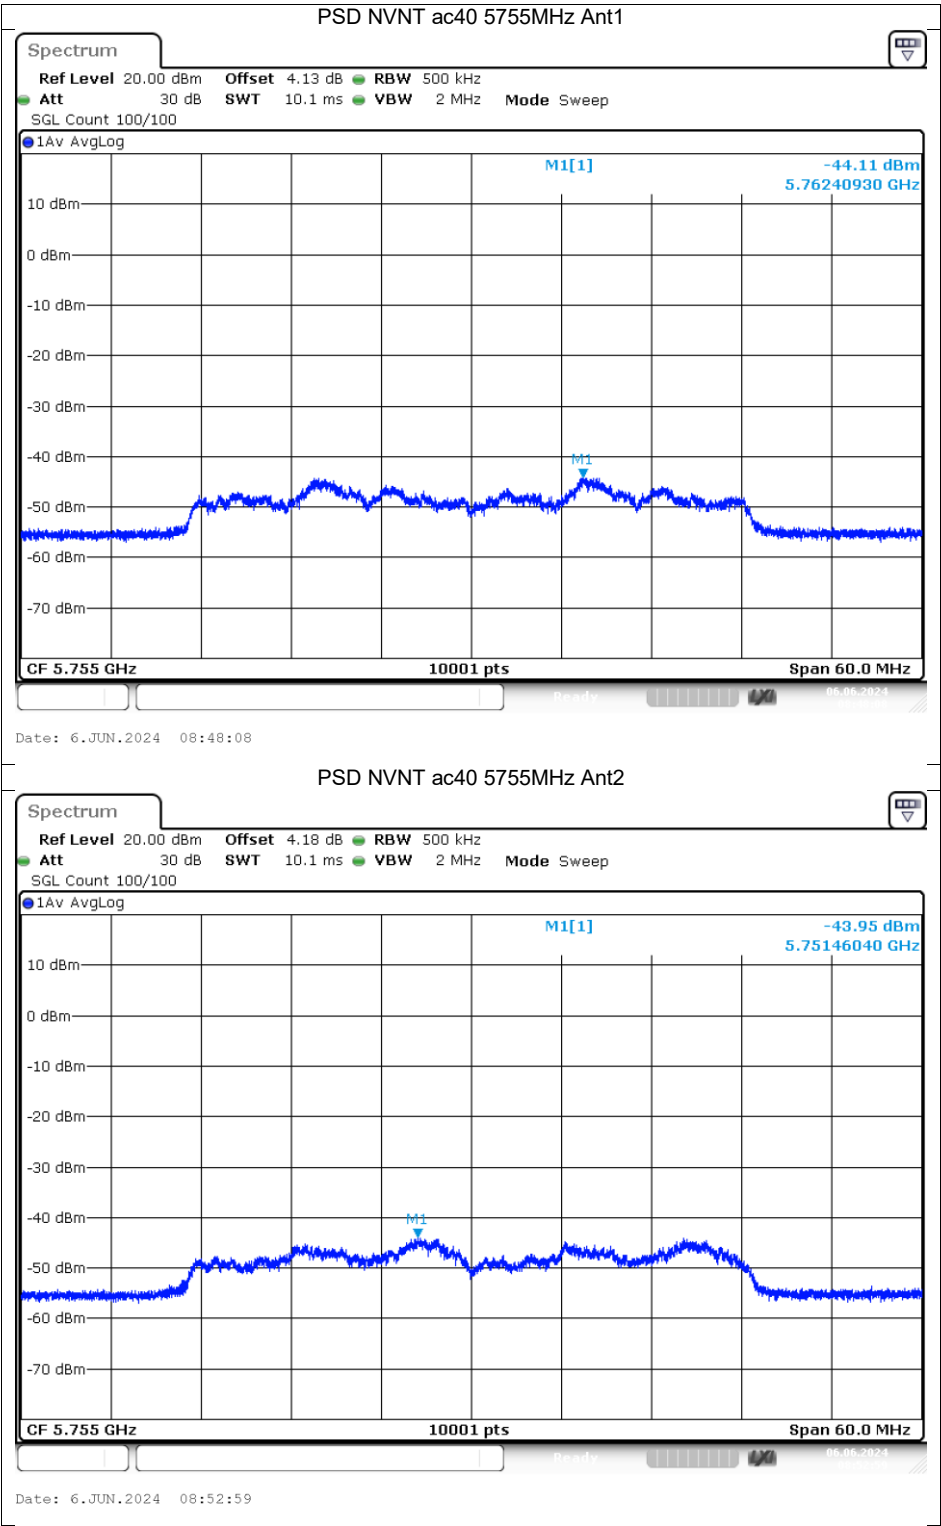

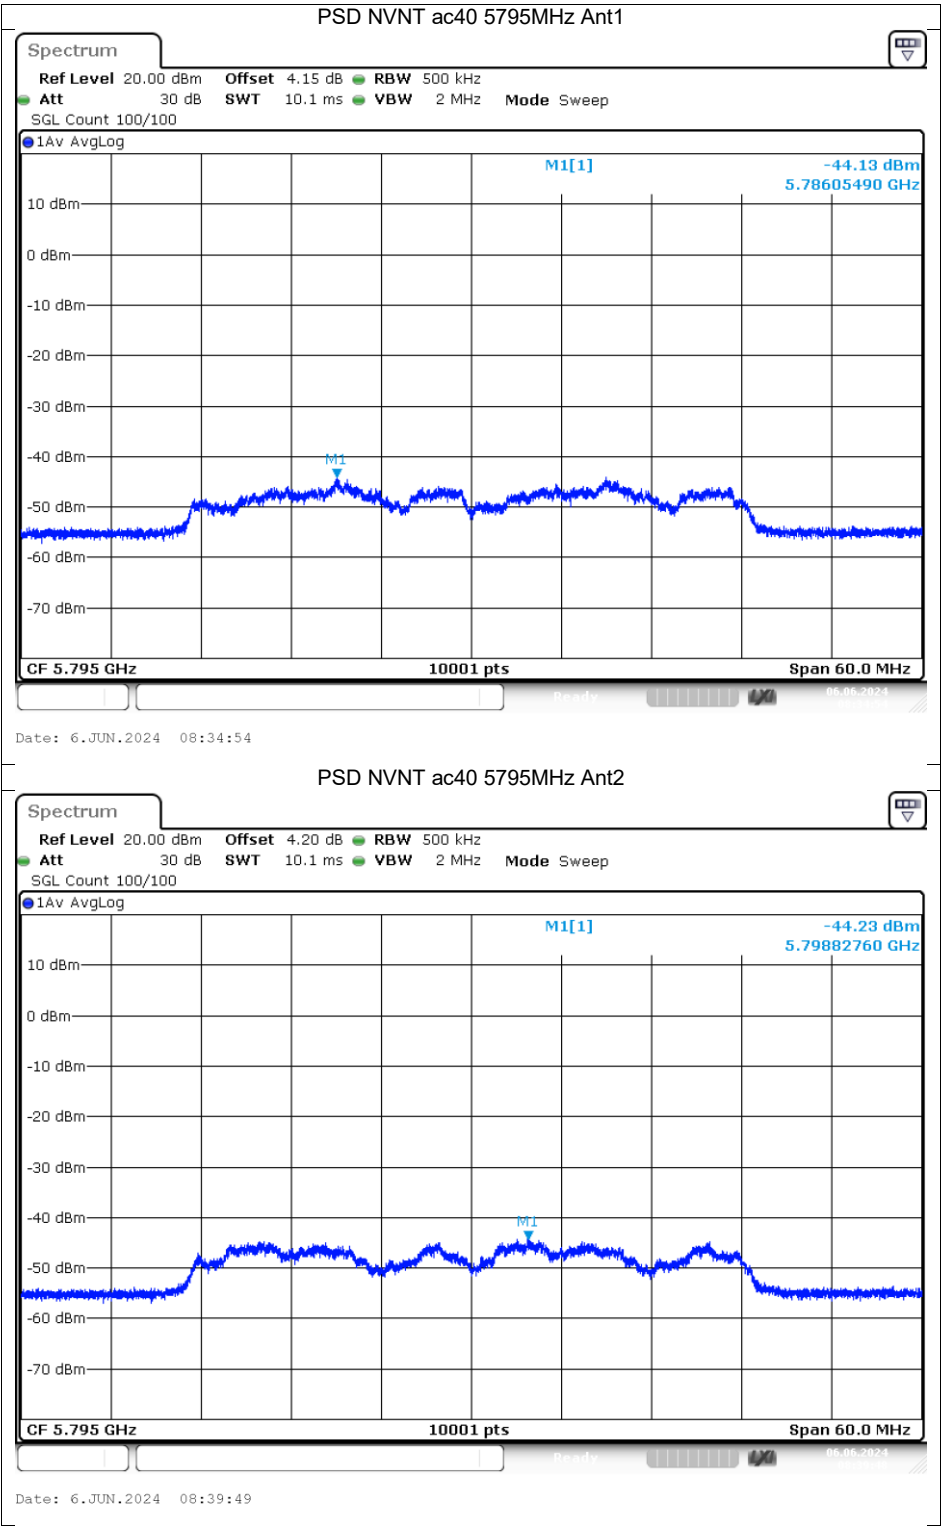

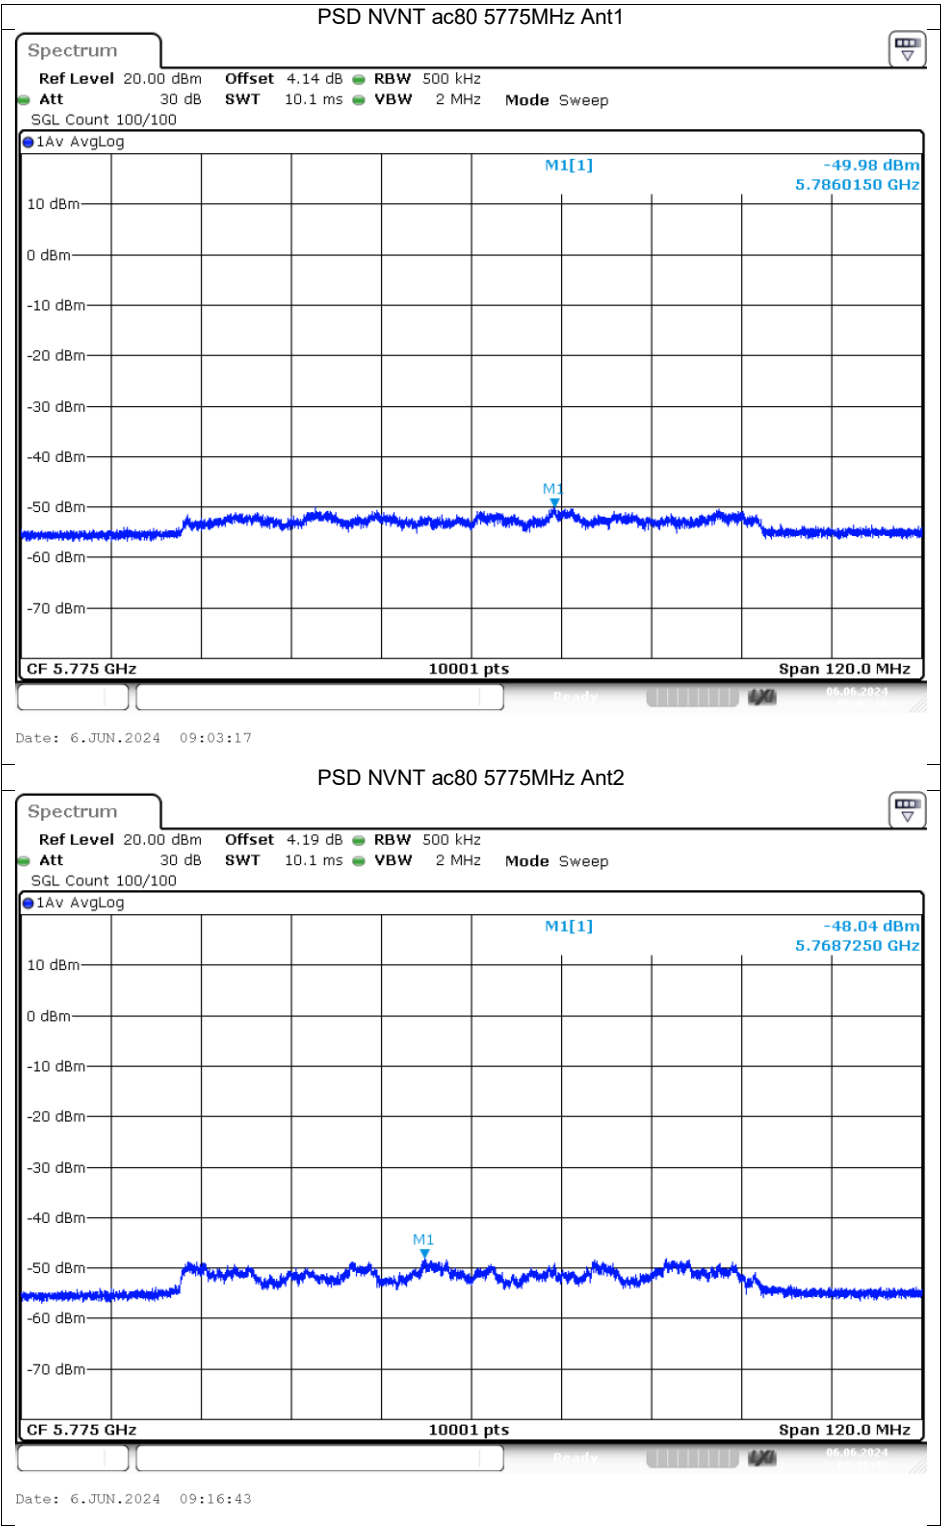

Frequency Stability

Condition	Mode	Time (mins)	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 138V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	a	0	5180	Ant1	5180	0	0	25	Pass
40C 120V	a	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 102V	a	0	5200	Ant1	5200	0	0	25	Pass
20C 120V	a	0	5200	Ant1	5200	0	0	25	Pass
20C 138V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 120V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 120V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
10C 120V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 120V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	a	0	5200	Ant1	5200	0	0	25	Pass
20C 102V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	a	0	5240	Ant1	5240	0	0	25	Pass
20C 138V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 120V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 120V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 120V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 138V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
-10C 120V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
0C 120V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
10C 120V	a	0	5180	Ant2	5179.96	-40000	-7.72	25	Pass
30C 120V	a	0	5180	Ant2	5180	0	0	25	Pass
40C 120V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 102V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 120V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 138V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-10C 120V	a	0	5200	Ant2	5199.96	-40000	-7.69	25	Pass
0C 120V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
10C 120V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
30C 120V	a	0	5200	Ant2	5200	0	0	25	Pass
40C 120V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 102V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 120V	a	0	5240	Ant2	5239.96	-40000	-7.63	25	Pass
20C 138V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
-10C 120V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
0C 120V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
10C 120V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
30C 120V	a	0	5240	Ant2	5240	0	0	25	Pass
40C 120V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 102V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	n20	0	5180	Ant1	5180	0	0	25	Pass
20C 138V	n20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-10C 120V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	n20	0	5180	Ant1	5180	0	0	25	Pass
30C 120V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 120V	n20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 102V	n20	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 120V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass

20C 138V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 120V	n20	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
10C 120V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 120V	n20	0	5200	Ant1	5200	0	0	25	Pass
40C 120V	n20	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 102V	n20	0	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 120V	n20	0	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 138V	n20	0	5240	Ant1	5239.8	-200000	-38.17	25	Pass
-10C 120V	n20	0	5240	Ant1	5239.96	-40000	-7.63	25	Pass
0C 120V	n20	0	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	n20	0	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	n20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 120V	n20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 120V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 138V	n20	0	5180	Ant2	5179.96	-40000	-7.72	25	Pass
-10C 120V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
0C 120V	n20	0	5180	Ant2	5179.96	-40000	-7.72	25	Pass
10C 120V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 120V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
40C 120V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 102V	n20	0	5200	Ant2	5199.96	-40000	-7.69	25	Pass
20C 120V	n20	0	5200	Ant2	5200	0	0	25	Pass
20C 138V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-10C 120V	n20	0	5200	Ant2	5199.96	-40000	-7.69	25	Pass
0C 120V	n20	0	5200	Ant2	5199.94	-60000	-11.54	25	Pass
10C 120V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
30C 120V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
40C 120V	n20	0	5200	Ant2	5200	0	0	25	Pass
20C 102V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 120V	n20	0	5240	Ant2	5239.96	-40000	-7.63	25	Pass
20C 138V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
-10C 120V	n20	0	5240	Ant2	5239.96	-40000	-7.63	25	Pass
0C 120V	n20	0	5240	Ant2	5239.96	-40000	-7.63	25	Pass
10C 120V	n20	0	5240	Ant2	5239.96	-40000	-7.63	25	Pass
30C 120V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 120V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 102V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	n40	0	5190	Ant1	5190	0	0	25	Pass
20C 138V	n40	0	5190	Ant1	5190	0	0	25	Pass
-10C 120V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	n40	0	5190	Ant1	5190	0	0	25	Pass
10C 120V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	0	5230	Ant1	5230	0	0	25	Pass
20C 120V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 120V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 120V	n40	0	5230	Ant1	5230	0	0	25	Pass
20C 102V	n40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 120V	n40	0	5190	Ant2	5190	0	0	25	Pass
20C 138V	n40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
-10C 120V	n40	0	5190	Ant2	5190	0	0	25	Pass
0C 120V	n40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
10C 120V	n40	0	5190	Ant2	5190	0	0	25	Pass
30C 120V	n40	0	5190	Ant2	5190	0	0	25	Pass
40C 120V	n40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	0	5230	Ant2	5229.92	-80000	-15.3	25	Pass
20C 120V	n40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 138V	n40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass

-10C 120V	n40	0	5230	Ant2	5230	0	0	25	Pass
0C 120V	n40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
10C 120V	n40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	0	5230	Ant2	5230	0	0	25	Pass
40C 120V	n40	0	5230	Ant2	5230	0	0	25	Pass
20C 102V	ac20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 120V	ac20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 138V	ac20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	ac20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	ac20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 120V	ac20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	ac20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	ac20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	ac20	0	5200	Ant1	5200	0	0	25	Pass
20C 120V	ac20	0	5200	Ant1	5200	0	0	25	Pass
20C 138V	ac20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 120V	ac20	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	ac20	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
10C 120V	ac20	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
30C 120V	ac20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	ac20	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 102V	ac20	0	5240	Ant1	5240	0	0	25	Pass
20C 120V	ac20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 138V	ac20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	ac20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	ac20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	ac20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 120V	ac20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 120V	ac20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	ac20	0	5180	Ant2	5180	0	0	25	Pass
20C 120V	ac20	0	5180	Ant2	5180	0	0	25	Pass
20C 138V	ac20	0	5180	Ant2	5179.96	-40000	-7.72	25	Pass
-10C 120V	ac20	0	5180	Ant2	5180	0	0	25	Pass
0C 120V	ac20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
10C 120V	ac20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 120V	ac20	0	5180	Ant2	5180	0	0	25	Pass
40C 120V	ac20	0	5180	Ant2	5179.96	-40000	-7.72	25	Pass
20C 102V	ac20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 120V	ac20	0	5200	Ant2	5199.94	-60000	-11.54	25	Pass
20C 138V	ac20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-10C 120V	ac20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
0C 120V	ac20	0	5200	Ant2	5199.96	-40000	-7.69	25	Pass
10C 120V	ac20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
30C 120V	ac20	0	5200	Ant2	5199.96	-40000	-7.69	25	Pass
40C 120V	ac20	0	5200	Ant2	5199.96	-40000	-7.69	25	Pass
20C 102V	ac20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 120V	ac20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 138V	ac20	0	5240	Ant2	5239.96	-40000	-7.63	25	Pass
-10C 120V	ac20	0	5240	Ant2	5240	0	0	25	Pass
0C 120V	ac20	0	5240	Ant2	5239.96	-40000	-7.63	25	Pass
10C 120V	ac20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
30C 120V	ac20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 120V	ac20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 102V	ac40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	ac40	0	5190	Ant1	5190	0	0	25	Pass
-10C 120V	ac40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	ac40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	ac40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	ac40	0	5190	Ant1	5190	0	0	25	Pass
20C 102V	ac40	0	5230	Ant1	5230	0	0	25	Pass
20C 120V	ac40	0	5230	Ant1	5230	0	0	25	Pass
20C 138V	ac40	0	5230	Ant1	5230	0	0	25	Pass
-10C 120V	ac40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass

0C 120V	ac40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	ac40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	ac40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 120V	ac40	0	5230	Ant1	5230	0	0	25	Pass
20C 102V	ac40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 138V	ac40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
-10C 120V	ac40	0	5190	Ant2	5189.92	-80000	-15.41	25	Pass
0C 120V	ac40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	0	5190	Ant2	5189.96	-40000	-7.71	25	Pass
30C 120V	ac40	0	5190	Ant2	5189.92	-80000	-15.41	25	Pass
40C 120V	ac40	0	5190	Ant2	5190	0	0	25	Pass
20C 102V	ac40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 120V	ac40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 138V	ac40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
-10C 120V	ac40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
0C 120V	ac40	0	5230	Ant2	5230	0	0	25	Pass
10C 120V	ac40	0	5230	Ant2	5230	0	0	25	Pass
30C 120V	ac40	0	5230	Ant2	5229.96	-40000	-7.65	25	Pass
40C 120V	ac40	0	5230	Ant2	5230	0	0	25	Pass
20C 102V	ac80	0	5210	Ant1	5210	0	0	25	Pass
20C 120V	ac80	0	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	0	5210	Ant1	5210	0	0	25	Pass
-10C 120V	ac80	0	5210	Ant1	5210	0	0	25	Pass
0C 120V	ac80	0	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	0	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	0	5210	Ant1	5210	0	0	25	Pass
40C 120V	ac80	0	5210	Ant1	5210	0	0	25	Pass
20C 102V	ac80	0	5210	Ant2	5210	0	0	25	Pass
20C 120V	ac80	0	5210	Ant2	5210	0	0	25	Pass
20C 138V	ac80	0	5210	Ant2	5210	0	0	25	Pass
-10C 120V	ac80	0	5210	Ant2	5210	0	0	25	Pass
0C 120V	ac80	0	5210	Ant2	5210	0	0	25	Pass
10C 120V	ac80	0	5210	Ant2	5210	0	0	25	Pass
30C 120V	ac80	0	5210	Ant2	5210	0	0	25	Pass
40C 120V	ac80	0	5210	Ant2	5210	0	0	25	Pass

Condition	Mode	Time (mins)	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	a	0	5745	Ant1	5745	0	0	25	Pass
20C 138V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	a	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
40C 120V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 102V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	a	0	5825	Ant1	5825	0	0	25	Pass
20C 120V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 120V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 138V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass


-10C 120V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 120V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 120V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
40C 120V	a	0	5745	Ant2	5745	0	0	25	Pass
20C 102V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 120V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 138V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-10C 120V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
0C 120V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
10C 120V	a	0	5785	Ant2	5784.96	-40000	-6.91	25	Pass
30C 120V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
40C 120V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 102V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 120V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 138V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
0C 120V	a	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
10C 120V	a	0	5825	Ant2	5825	0	0	25	Pass
30C 120V	a	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
40C 120V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 102V	n20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	n20	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 138V	n20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	n20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	n20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	n20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	n20	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 102V	n20	0	5785	Ant1	5785	0	0	25	Pass
20C 120V	n20	0	5785	Ant1	5785	0	0	25	Pass
20C 138V	n20	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	n20	0	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	n20	0	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	n20	0	5785	Ant1	5784.94	-60000	-10.37	25	Pass
30C 120V	n20	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	n20	0	5785	Ant1	5785	0	0	25	Pass
20C 102V	n20	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	n20	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	n20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	n20	0	5825	Ant1	5825	0	0	25	Pass
10C 120V	n20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	n20	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	n20	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	n20	0	5745	Ant2	5745	0	0	25	Pass
20C 120V	n20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 138V	n20	0	5745	Ant2	5745	0	0	25	Pass
-10C 120V	n20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
0C 120V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 120V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
40C 120V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 102V	n20	0	5785	Ant2	5784.96	-40000	-6.91	25	Pass
20C 120V	n20	0	5785	Ant2	5784.96	-40000	-6.91	25	Pass
20C 138V	n20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-10C 120V	n20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
0C 120V	n20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
10C 120V	n20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
30C 120V	n20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
40C 120V	n20	0	5785	Ant2	5784.96	-40000	-6.91	25	Pass
20C 102V	n20	0	5825	Ant2	5825	0	0	25	Pass
20C 120V	n20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 138V	n20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
-10C 120V	n20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass


0C 120V	n20	0	5825	Ant2	5824.94	-60000	-10.3	25	Pass
10C 120V	n20	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
30C 120V	n20	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
40C 120V	n20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 102V	n40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	n40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	n40	0	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	0	5755	Ant1	5755	0	0	25	Pass
30C 120V	n40	0	5755	Ant1	5755	0	0	25	Pass
40C 120V	n40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	n40	0	5795	Ant1	5795	0	0	25	Pass
20C 120V	n40	0	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	0	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	0	5795	Ant1	5794.96	-40000	-6.9	25	Pass
0C 120V	n40	0	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	n40	0	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	n40	0	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	n40	0	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	n40	0	5755	Ant2	5755	0	0	25	Pass
20C 120V	n40	0	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 138V	n40	0	5755	Ant2	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	0	5755	Ant2	5755	0	0	25	Pass
0C 120V	n40	0	5755	Ant2	5754.96	-40000	-6.95	25	Pass
10C 120V	n40	0	5755	Ant2	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	0	5755	Ant2	5754.96	-40000	-6.95	25	Pass
40C 120V	n40	0	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 102V	n40	0	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	0	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 138V	n40	0	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	0	5795	Ant2	5795	0	0	25	Pass
0C 120V	n40	0	5795	Ant2	5795	0	0	25	Pass
10C 120V	n40	0	5795	Ant2	5795	0	0	25	Pass
30C 120V	n40	0	5795	Ant2	5794.96	-40000	-6.9	25	Pass
40C 120V	n40	0	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 102V	ac20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	ac20	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 138V	ac20	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-10C 120V	ac20	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 120V	ac20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	ac20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	ac20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	ac20	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 102V	ac20	0	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 120V	ac20	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	ac20	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	ac20	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	ac20	0	5785	Ant1	5785	0	0	25	Pass
10C 120V	ac20	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	ac20	0	5785	Ant1	5784.96	-40000	-6.91	25	Pass
40C 120V	ac20	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	ac20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	ac20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	ac20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	ac20	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	ac20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	0	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	ac20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	ac20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 120V	ac20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 138V	ac20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-10C 120V	ac20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	ac20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
10C 120V	ac20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass



30C 120V	ac20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
40C 120V	ac20	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 102V	ac20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 120V	ac20	0	5785	Ant2	5785	0	0	25	Pass
20C 138V	ac20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-10C 120V	ac20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
0C 120V	ac20	0	5785	Ant2	5784.96	-40000	-6.91	25	Pass
10C 120V	ac20	0	5785	Ant2	5784.96	-40000	-6.91	25	Pass
30C 120V	ac20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
40C 120V	ac20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 102V	ac20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 120V	ac20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 138V	ac20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
-10C 120V	ac20	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
0C 120V	ac20	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
10C 120V	ac20	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
40C 120V	ac20	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 102V	ac40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	ac40	0	5755	Ant1	5755	0	0	25	Pass
0C 120V	ac40	0	5755	Ant1	5755	0	0	25	Pass
10C 120V	ac40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	ac40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
40C 120V	ac40	0	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	ac40	0	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	0	5795	Ant1	5795	0	0	25	Pass
20C 138V	ac40	0	5795	Ant1	5795	0	0	25	Pass
-10C 120V	ac40	0	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	0	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	0	5795	Ant1	5795	0	0	25	Pass
30C 120V	ac40	0	5795	Ant1	5795	0	0	25	Pass
40C 120V	ac40	0	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ac40	0	5755	Ant2	5755	0	0	25	Pass
20C 120V	ac40	0	5755	Ant2	5755	0	0	25	Pass
20C 138V	ac40	0	5755	Ant2	5755	0	0	25	Pass
-10C 120V	ac40	0	5755	Ant2	5755	0	0	25	Pass
0C 120V	ac40	0	5755	Ant2	5755	0	0	25	Pass
10C 120V	ac40	0	5755	Ant2	5755	0	0	25	Pass
30C 120V	ac40	0	5755	Ant2	5755	0	0	25	Pass
40C 120V	ac40	0	5755	Ant2	5755	0	0	25	Pass
20C 102V	ac40	0	5795	Ant2	5795	0	0	25	Pass
20C 120V	ac40	0	5795	Ant2	5795	0	0	25	Pass
20C 138V	ac40	0	5795	Ant2	5795	0	0	25	Pass
-10C 120V	ac40	0	5795	Ant2	5795	0	0	25	Pass
0C 120V	ac40	0	5795	Ant2	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	0	5795	Ant2	5795	0	0	25	Pass
30C 120V	ac40	0	5795	Ant2	5795	0	0	25	Pass
40C 120V	ac40	0	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 102V	ac80	0	5775	Ant1	5775	0	0	25	Pass
20C 120V	ac80	0	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	0	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	0	5775	Ant1	5775	0	0	25	Pass
0C 120V	ac80	0	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	0	5775	Ant1	5775	0	0	25	Pass
30C 120V	ac80	0	5775	Ant1	5775	0	0	25	Pass
40C 120V	ac80	0	5775	Ant1	5775	0	0	25	Pass
20C 102V	ac80	0	5775	Ant2	5775	0	0	25	Pass
20C 120V	ac80	0	5775	Ant2	5775	0	0	25	Pass
20C 138V	ac80	0	5775	Ant2	5775	0	0	25	Pass
-10C 120V	ac80	0	5775	Ant2	5775	0	0	25	Pass
0C 120V	ac80	0	5775	Ant2	5775	0	0	25	Pass
10C 120V	ac80	0	5775	Ant2	5775	0	0	25	Pass
30C 120V	ac80	0	5775	Ant2	5775	0	0	25	Pass
40C 120V	ac80	0	5775	Ant2	5775	0	0	25	Pass


-6dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	a	5745	Ant1	16.3	0.5	Pass
NVNT	a	5745	Ant2	16.29	0.5	Pass
NVNT	a	5785	Ant1	16.28	0.5	Pass
NVNT	a	5785	Ant2	15.9	0.5	Pass
NVNT	a	5825	Ant1	16.28	0.5	Pass
NVNT	a	5825	Ant2	16.05	0.5	Pass
NVNT	n20	5745	Ant1	17.53	0.5	Pass
NVNT	n20	5745	Ant2	16.86	0.5	Pass
NVNT	n20	5785	Ant1	17.15	0.5	Pass
NVNT	n20	5785	Ant2	16.53	0.5	Pass
NVNT	n20	5825	Ant1	17.18	0.5	Pass
NVNT	n20	5825	Ant2	17.17	0.5	Pass
NVNT	n40	5755	Ant1	35.36	0.5	Pass
NVNT	n40	5755	Ant2	35.33	0.5	Pass
NVNT	n40	5795	Ant1	34.25	0.5	Pass
NVNT	n40	5795	Ant2	35.64	0.5	Pass
NVNT	ac20	5745	Ant1	17.53	0.5	Pass
NVNT	ac20	5745	Ant2	17.55	0.5	Pass
NVNT	ac20	5785	Ant1	17.02	0.5	Pass
NVNT	ac20	5785	Ant2	17.28	0.5	Pass
NVNT	ac20	5825	Ant1	16.79	0.5	Pass
NVNT	ac20	5825	Ant2	17.17	0.5	Pass
NVNT	ac40	5755	Ant1	35.04	0.5	Pass
NVNT	ac40	5755	Ant2	35.03	0.5	Pass
NVNT	ac40	5795	Ant1	35.6	0.5	Pass
NVNT	ac40	5795	Ant2	35.33	0.5	Pass
NVNT	ac80	5775	Ant1	75.72	0.5	Pass
NVNT	ac80	5775	Ant2	75.43	0.5	Pass

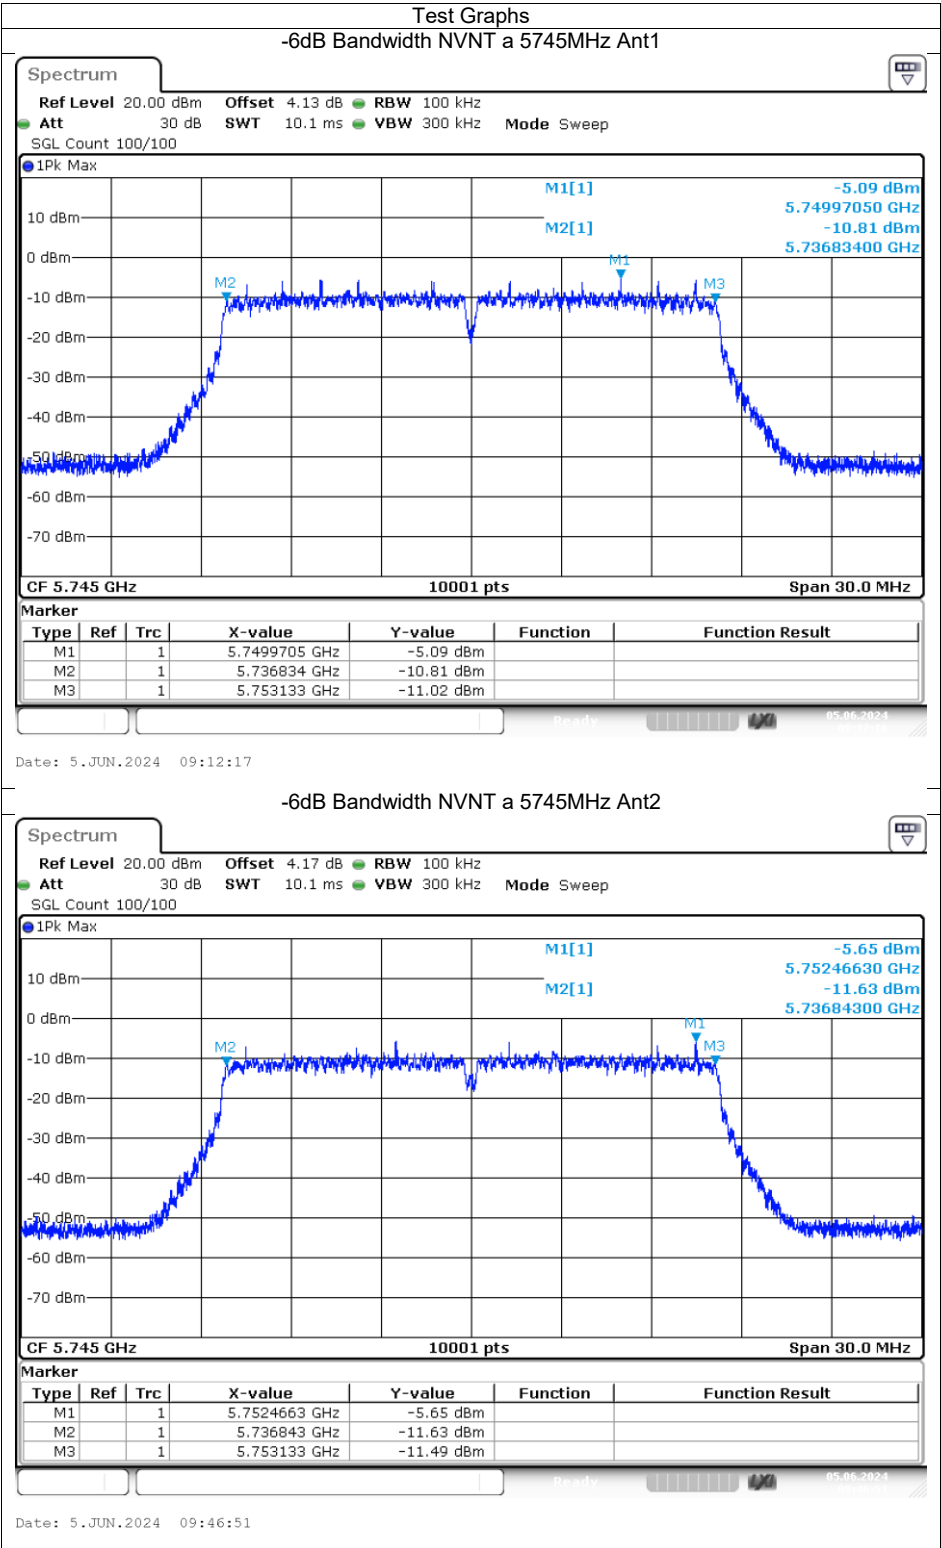


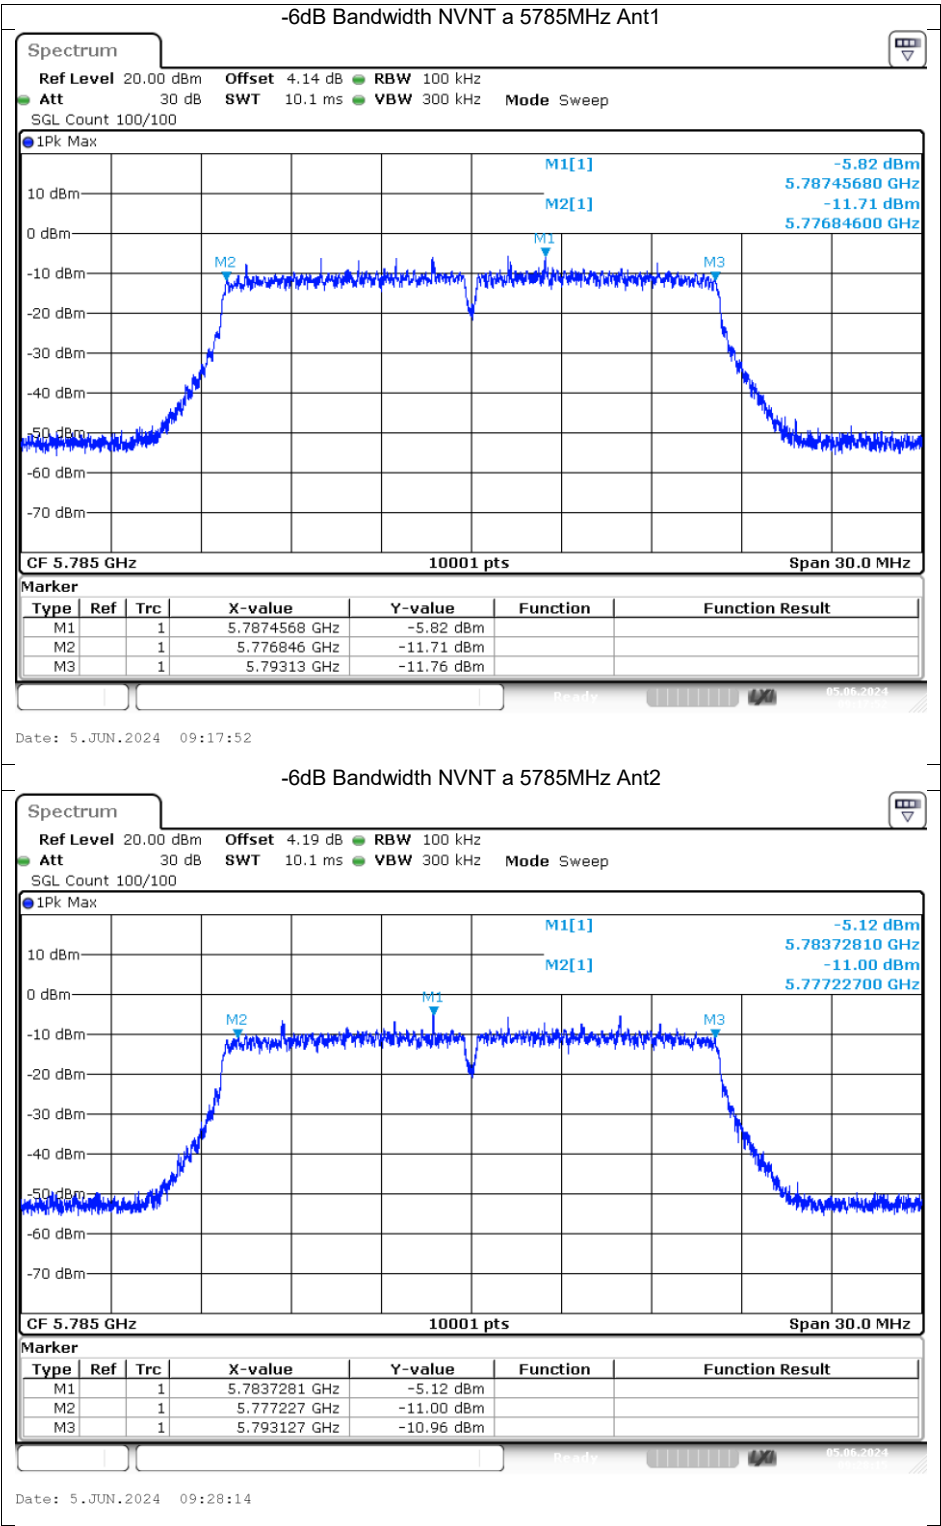


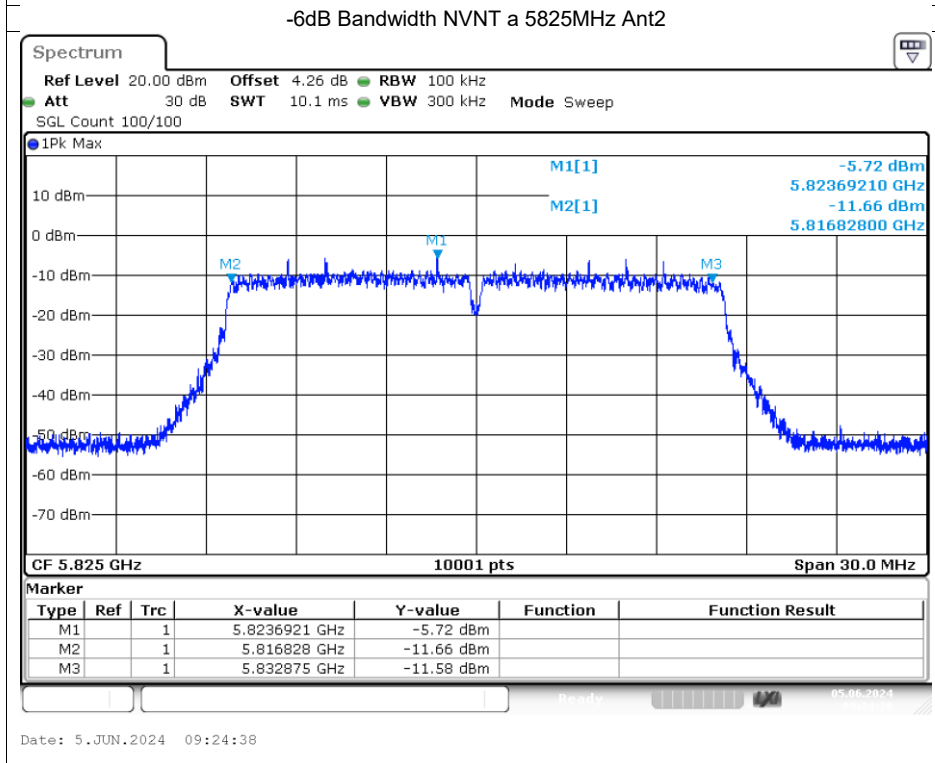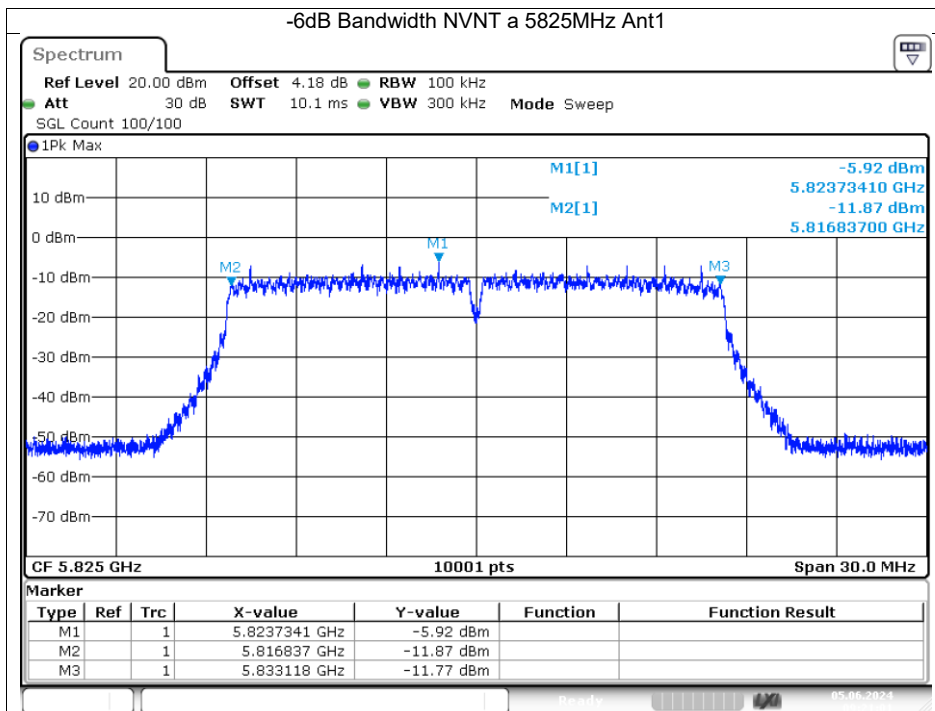


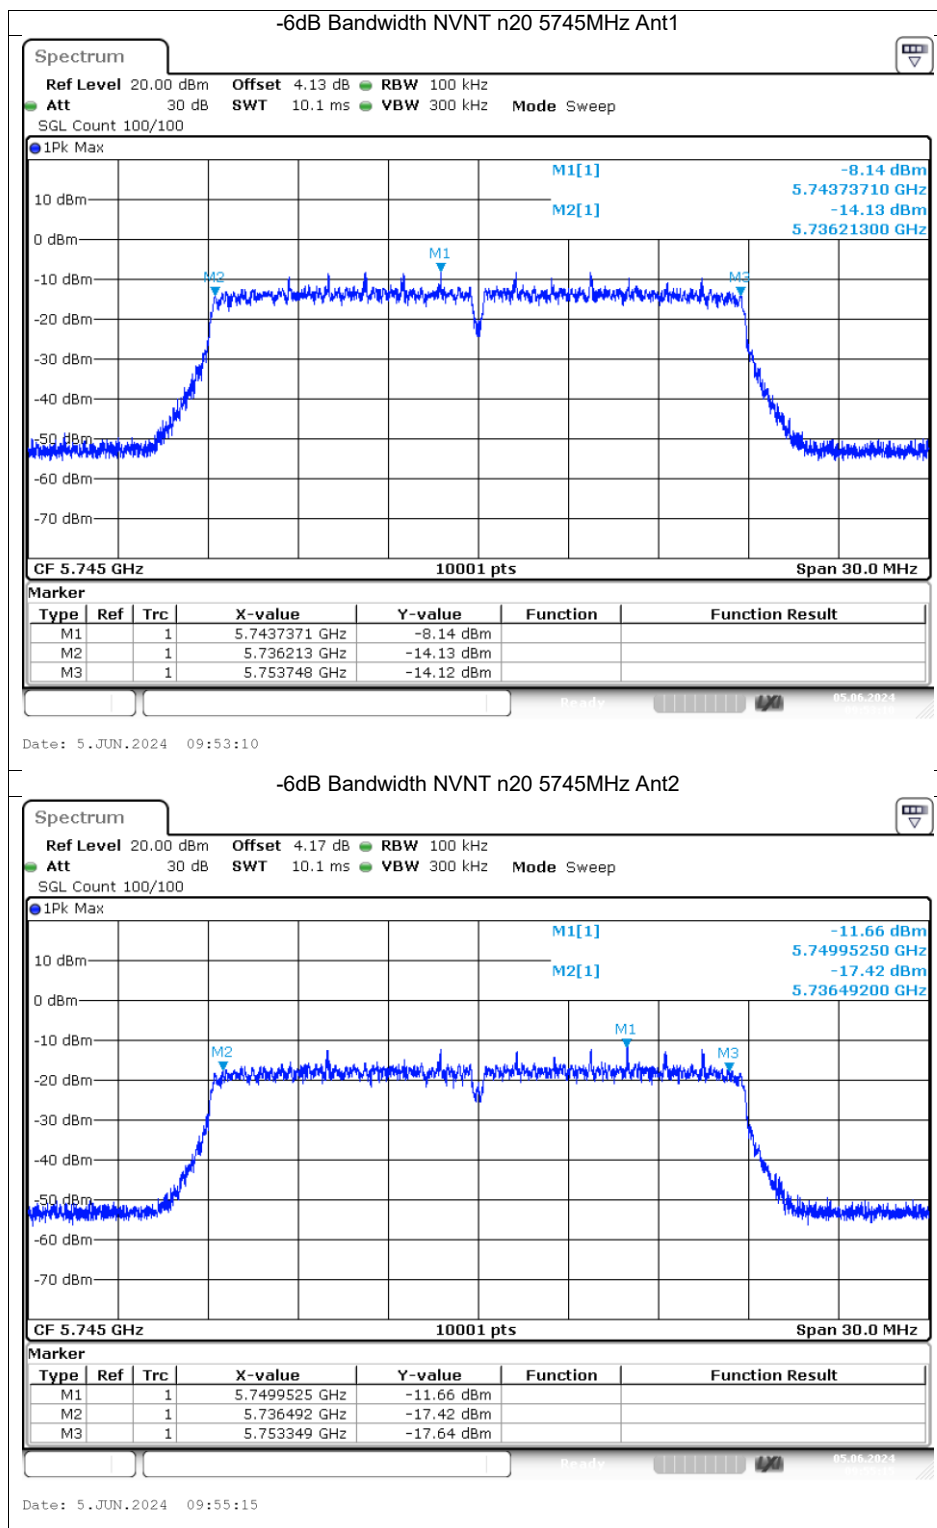


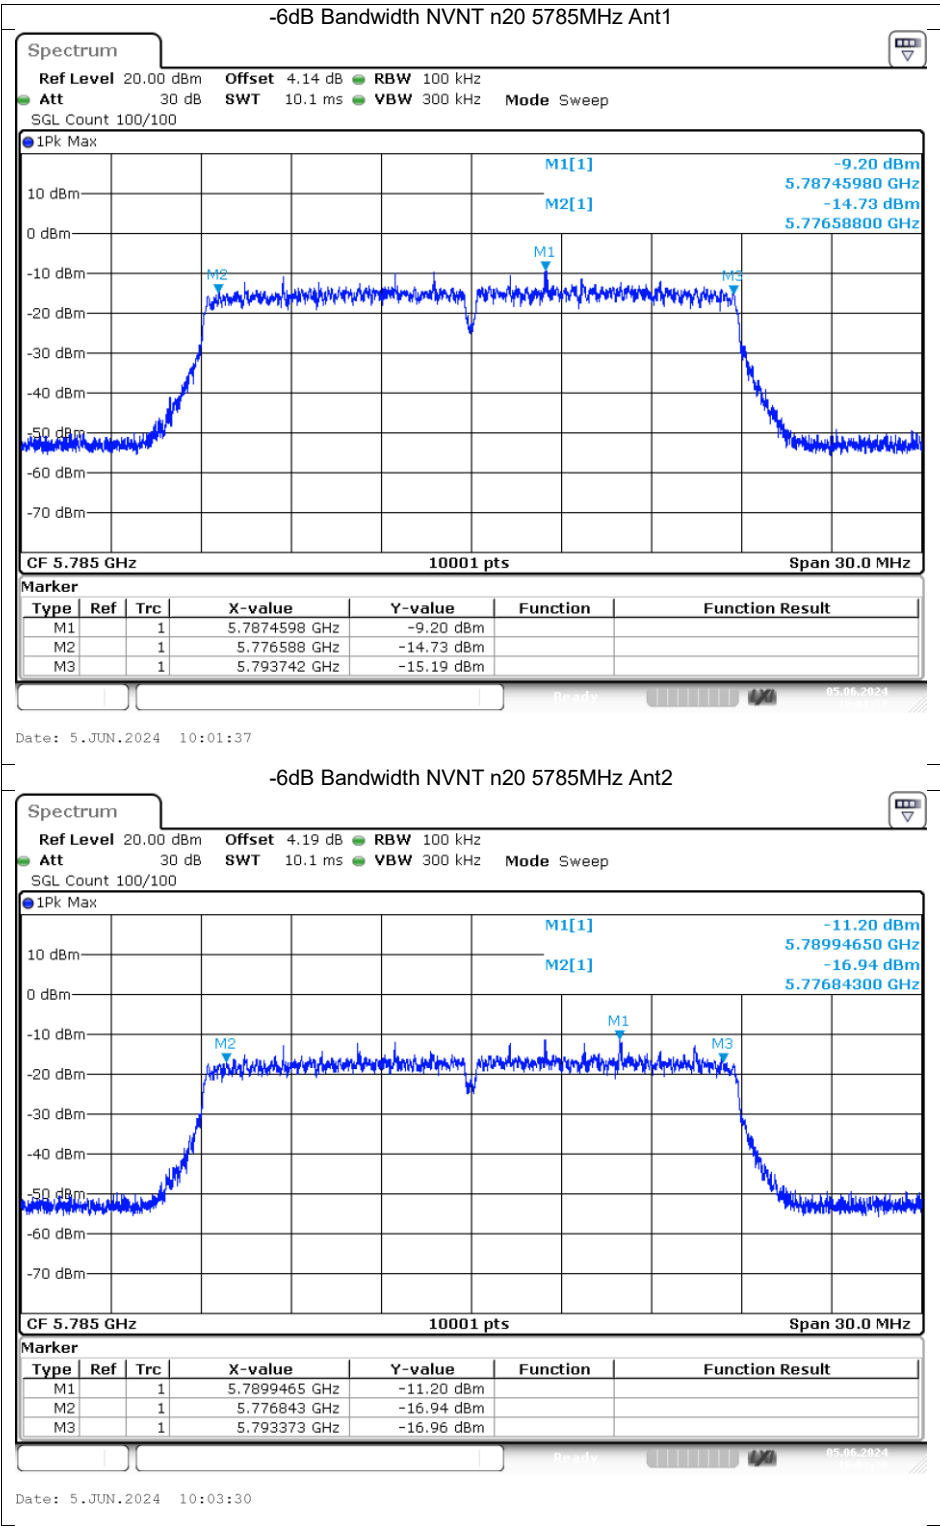


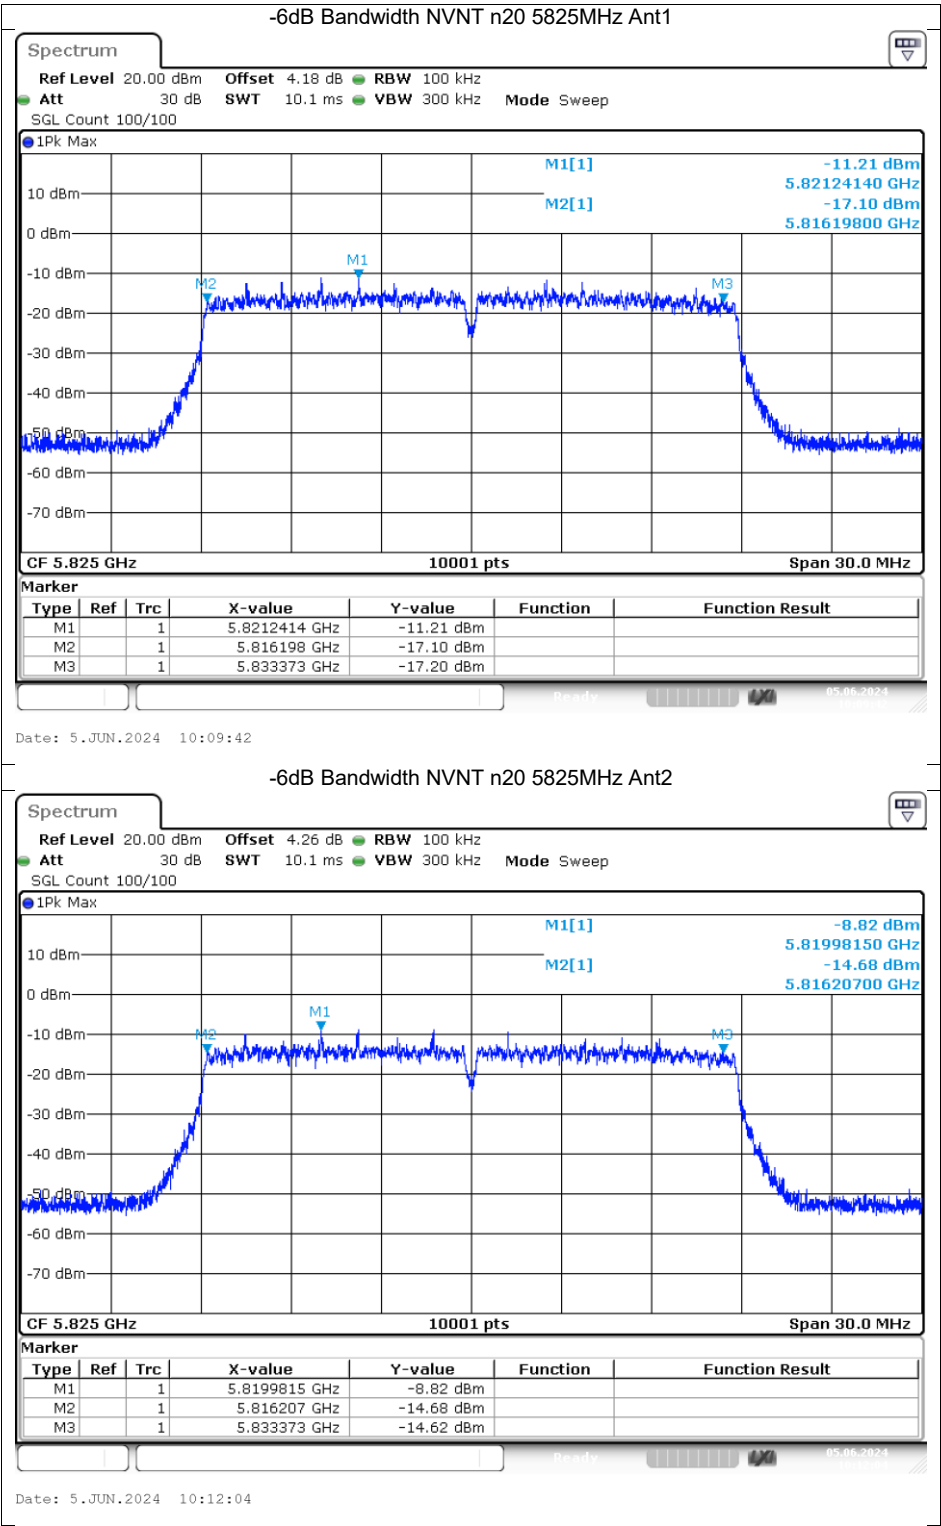


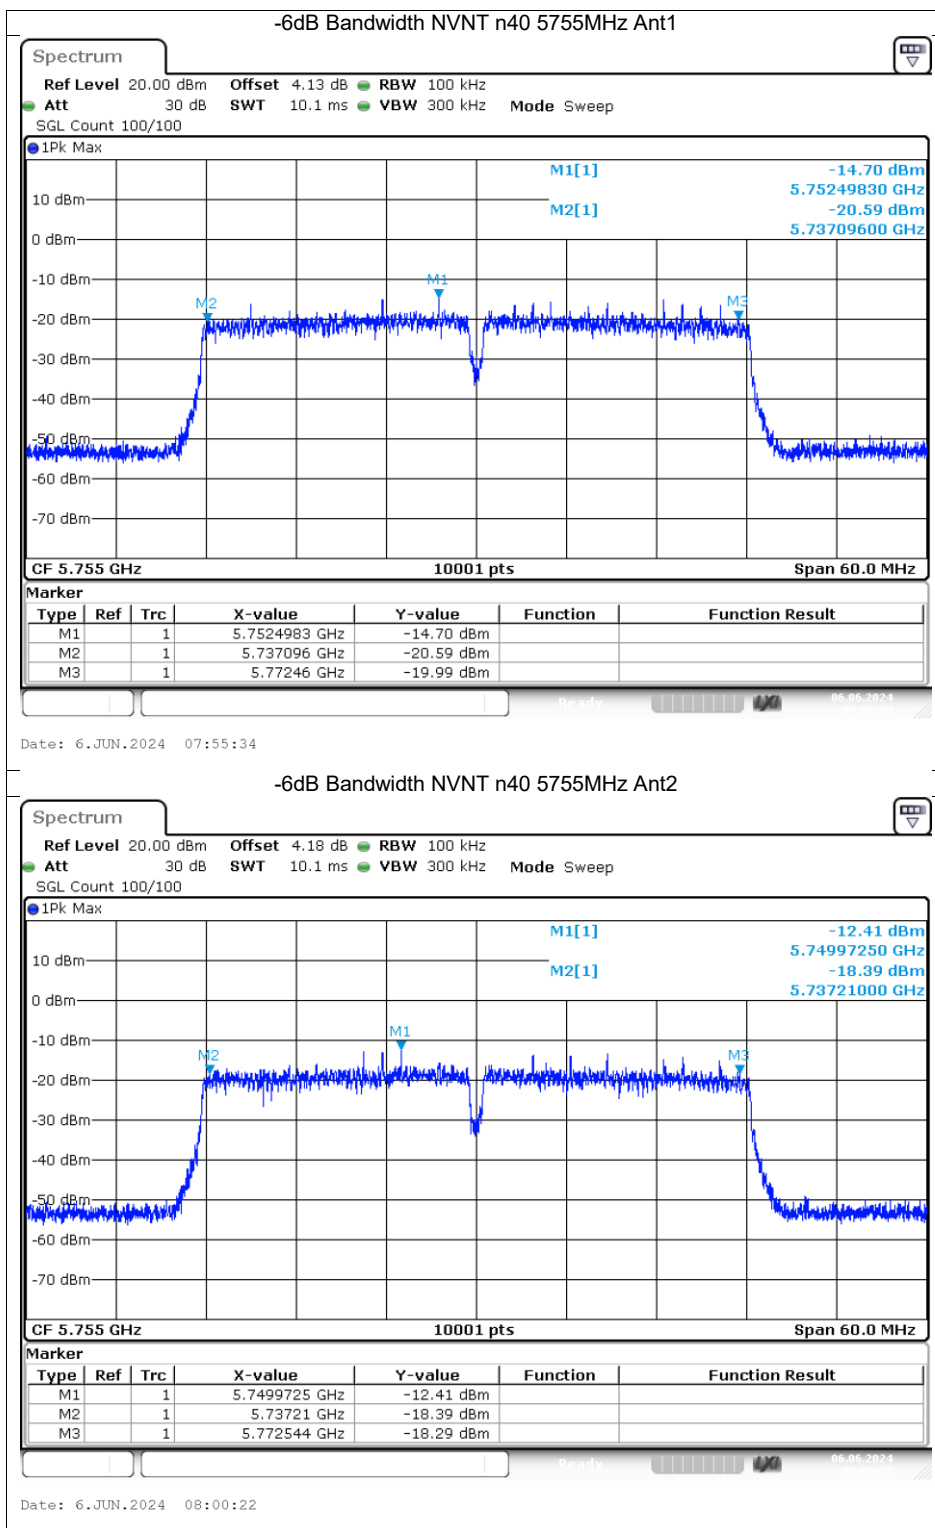


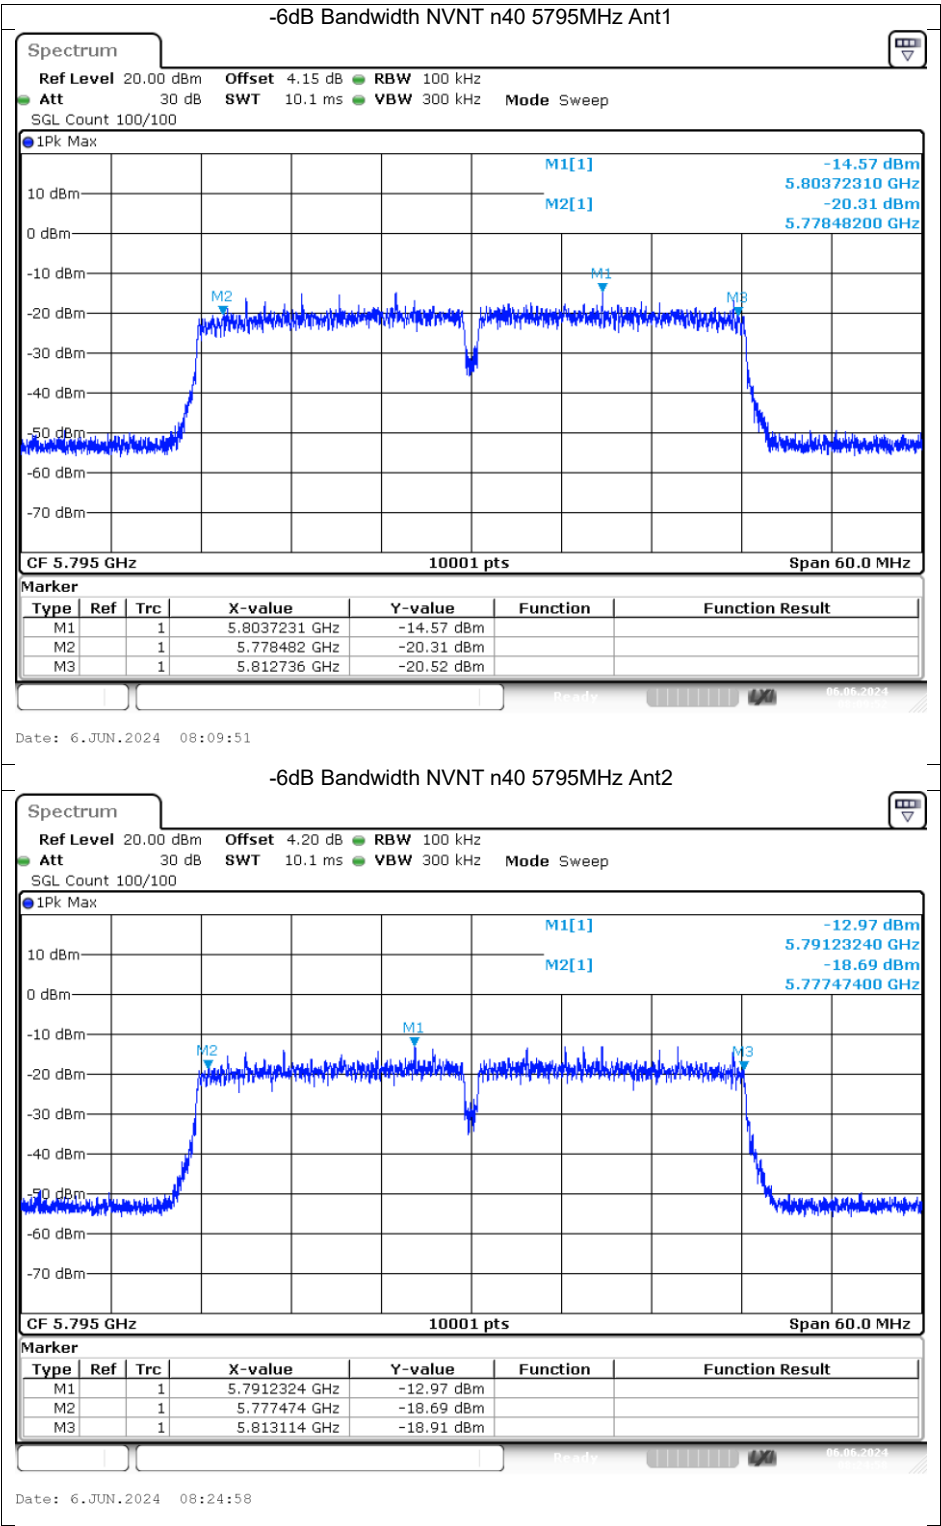


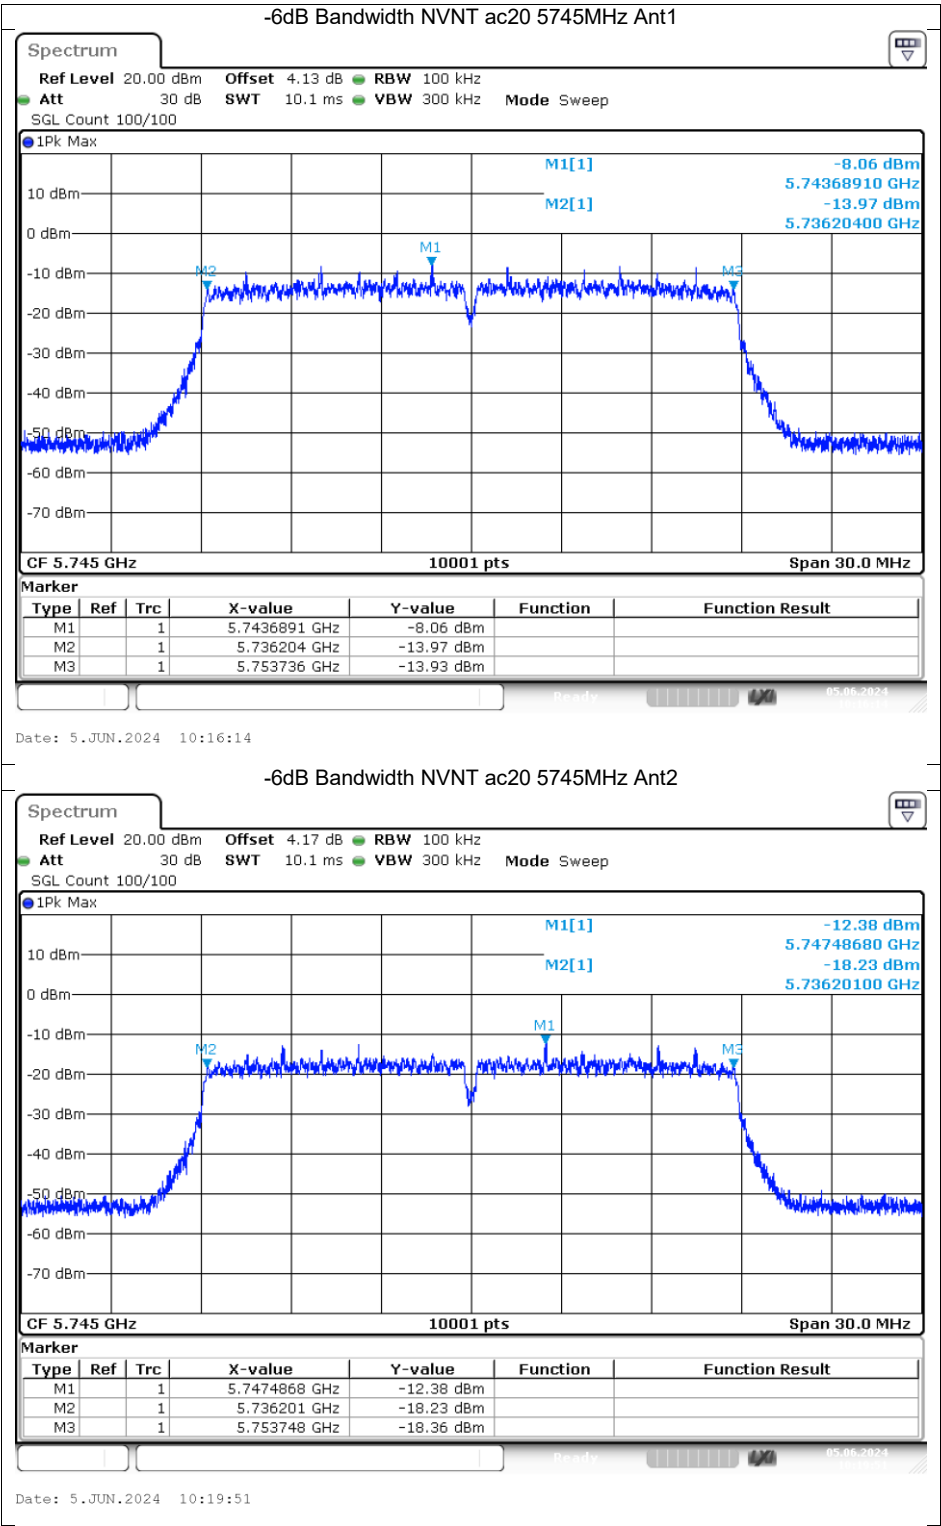


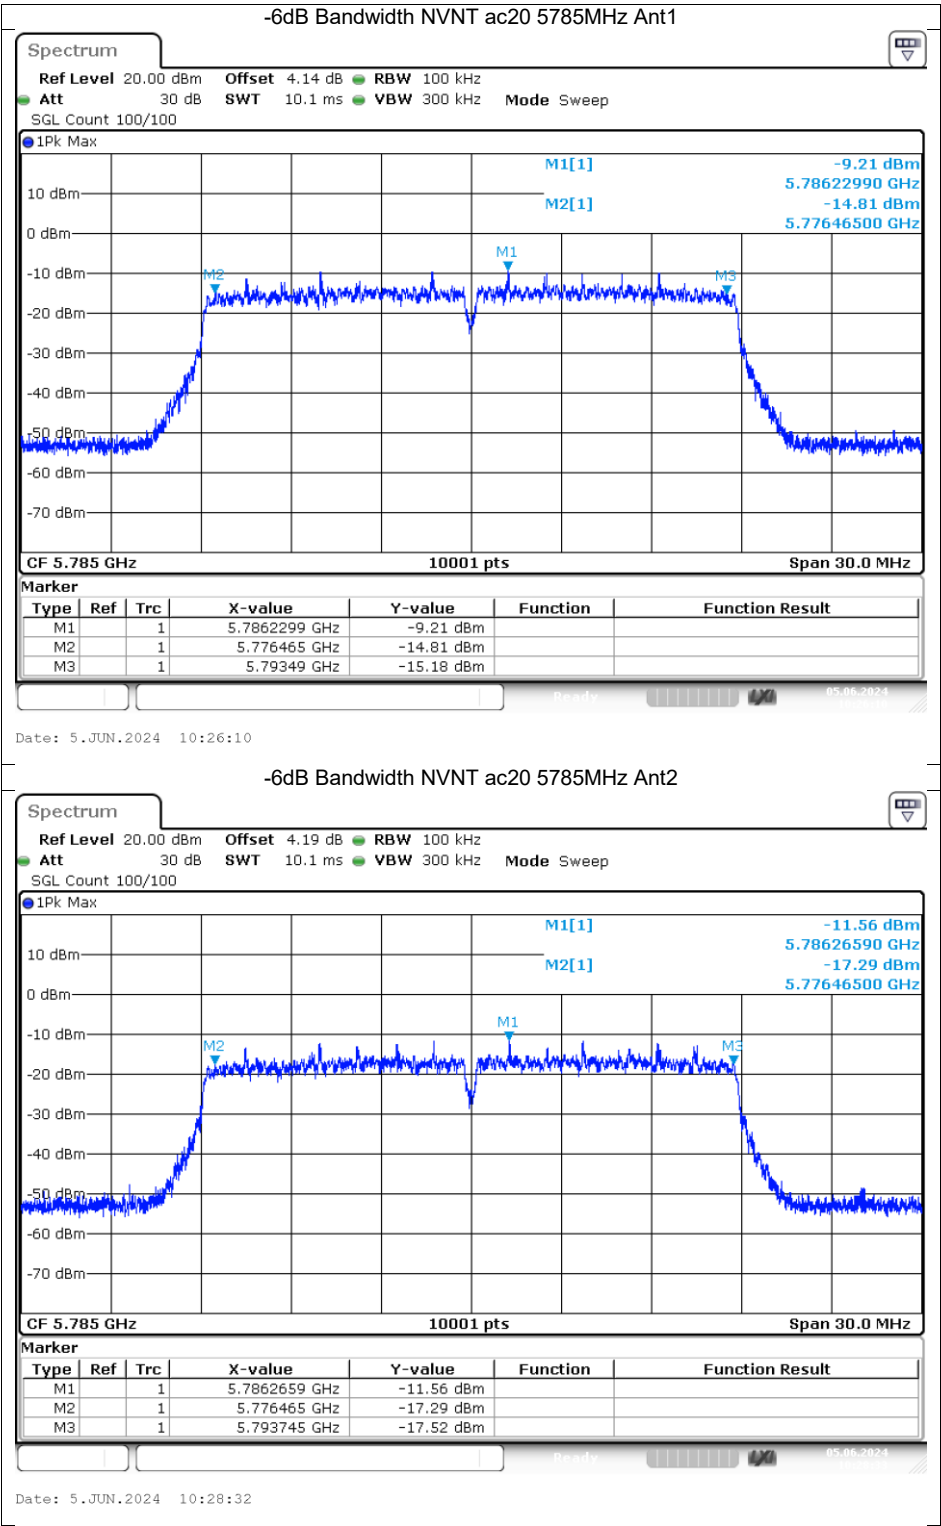

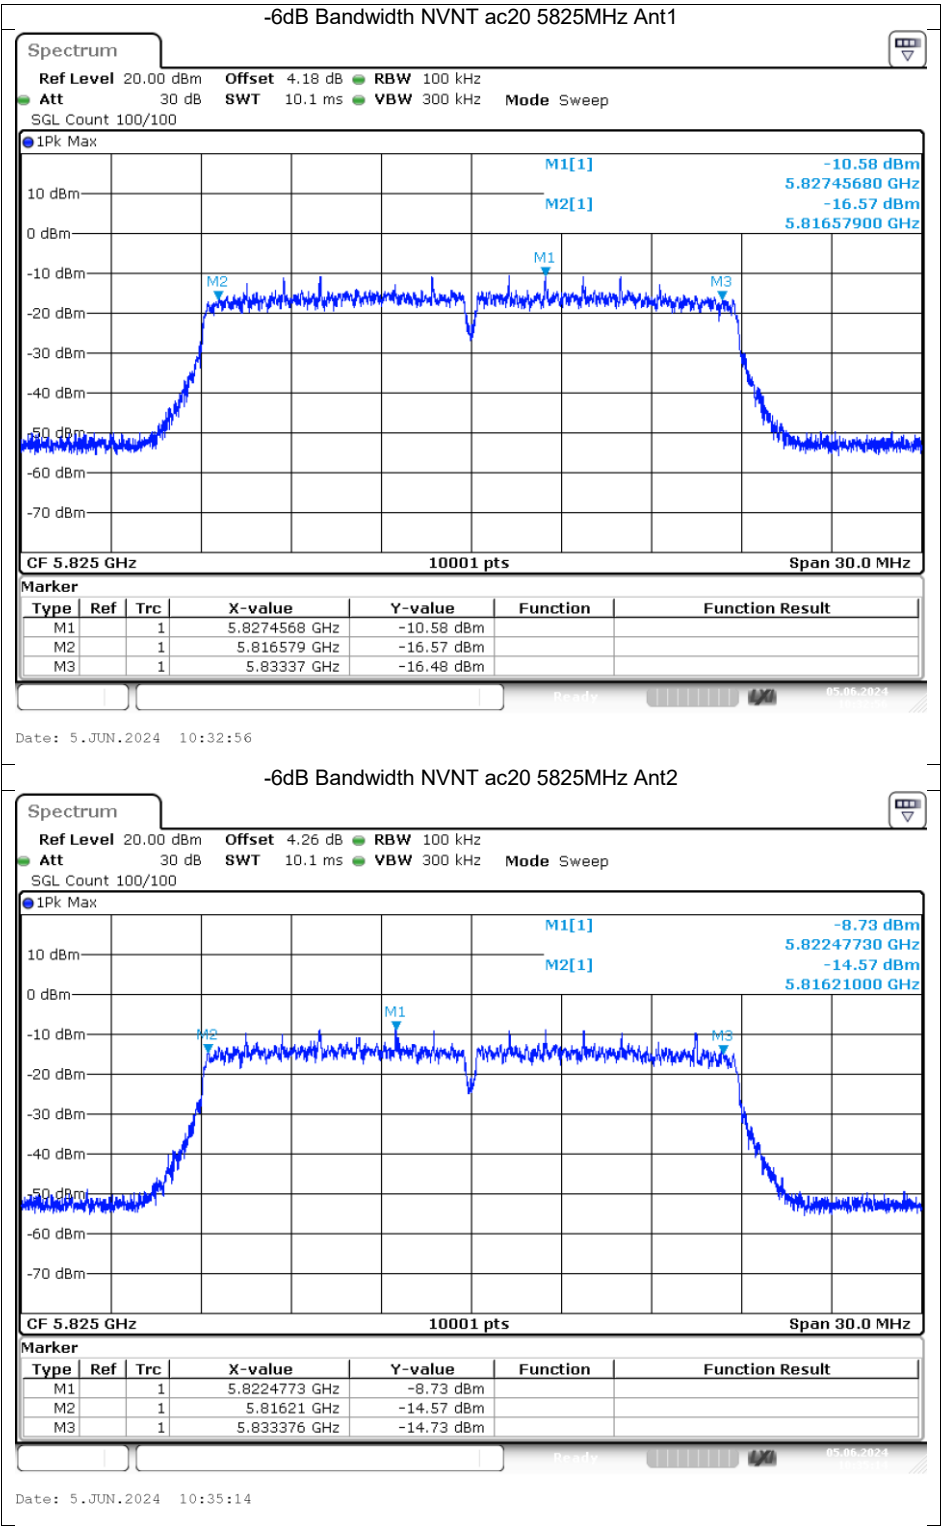

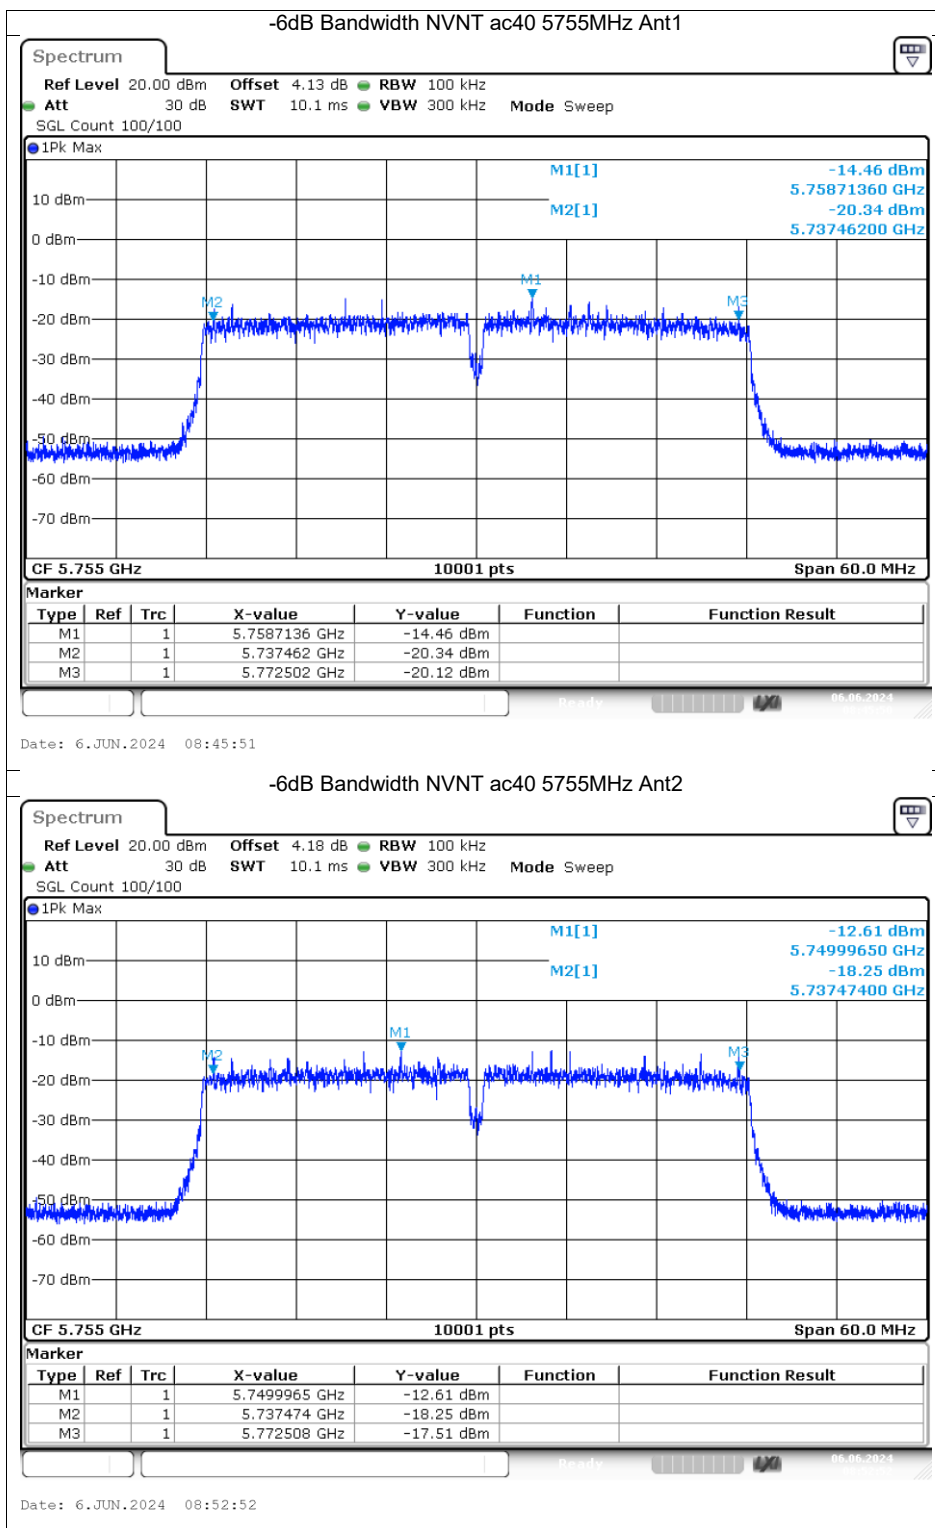

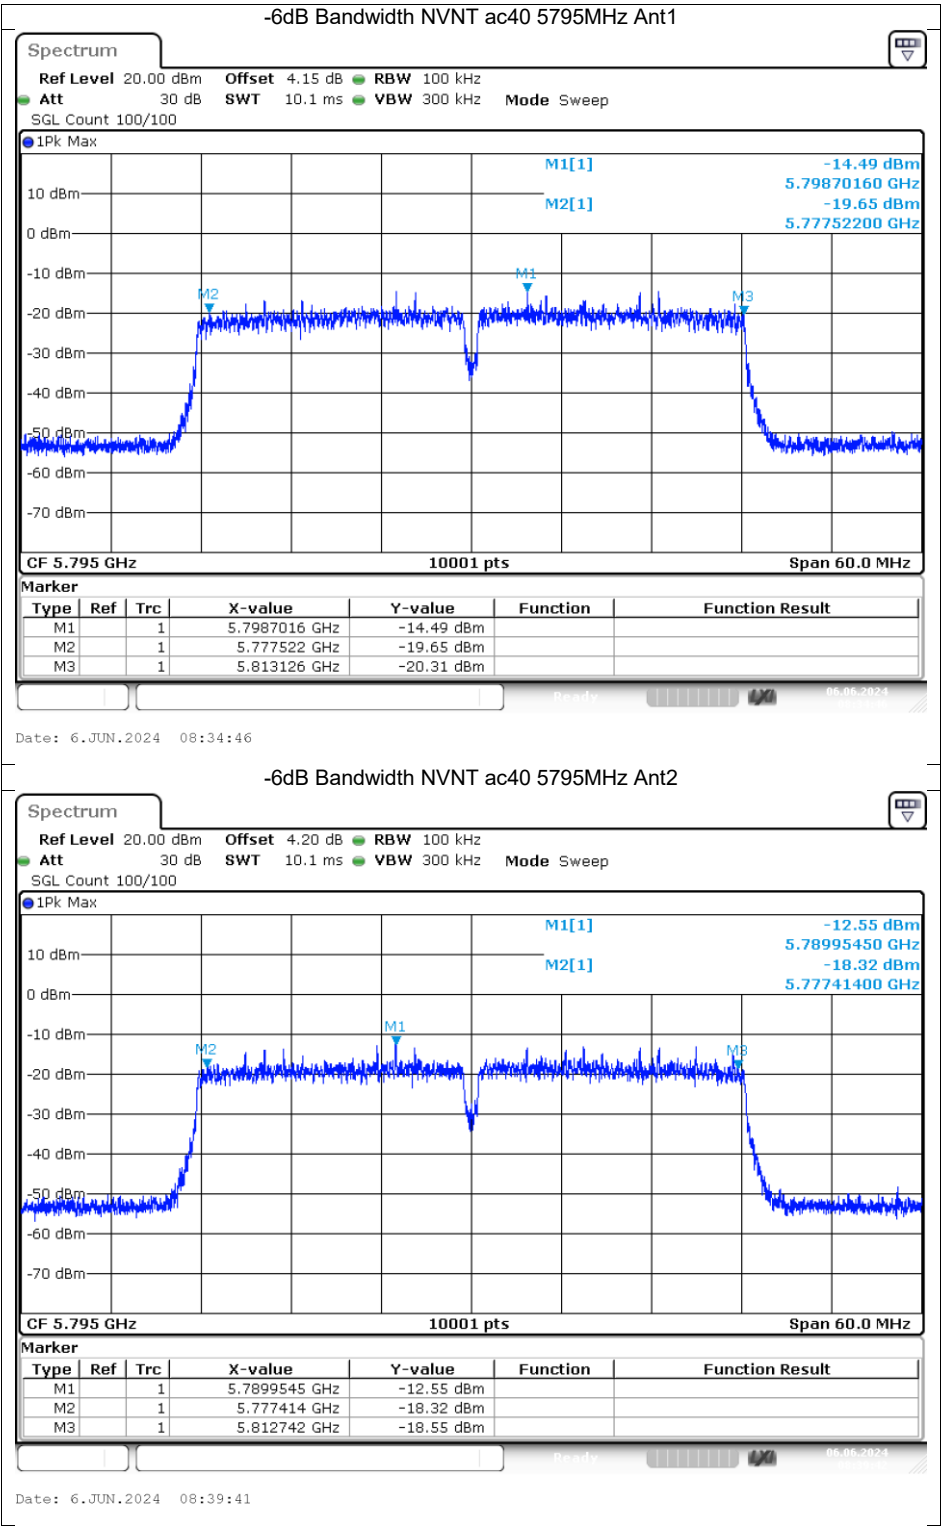

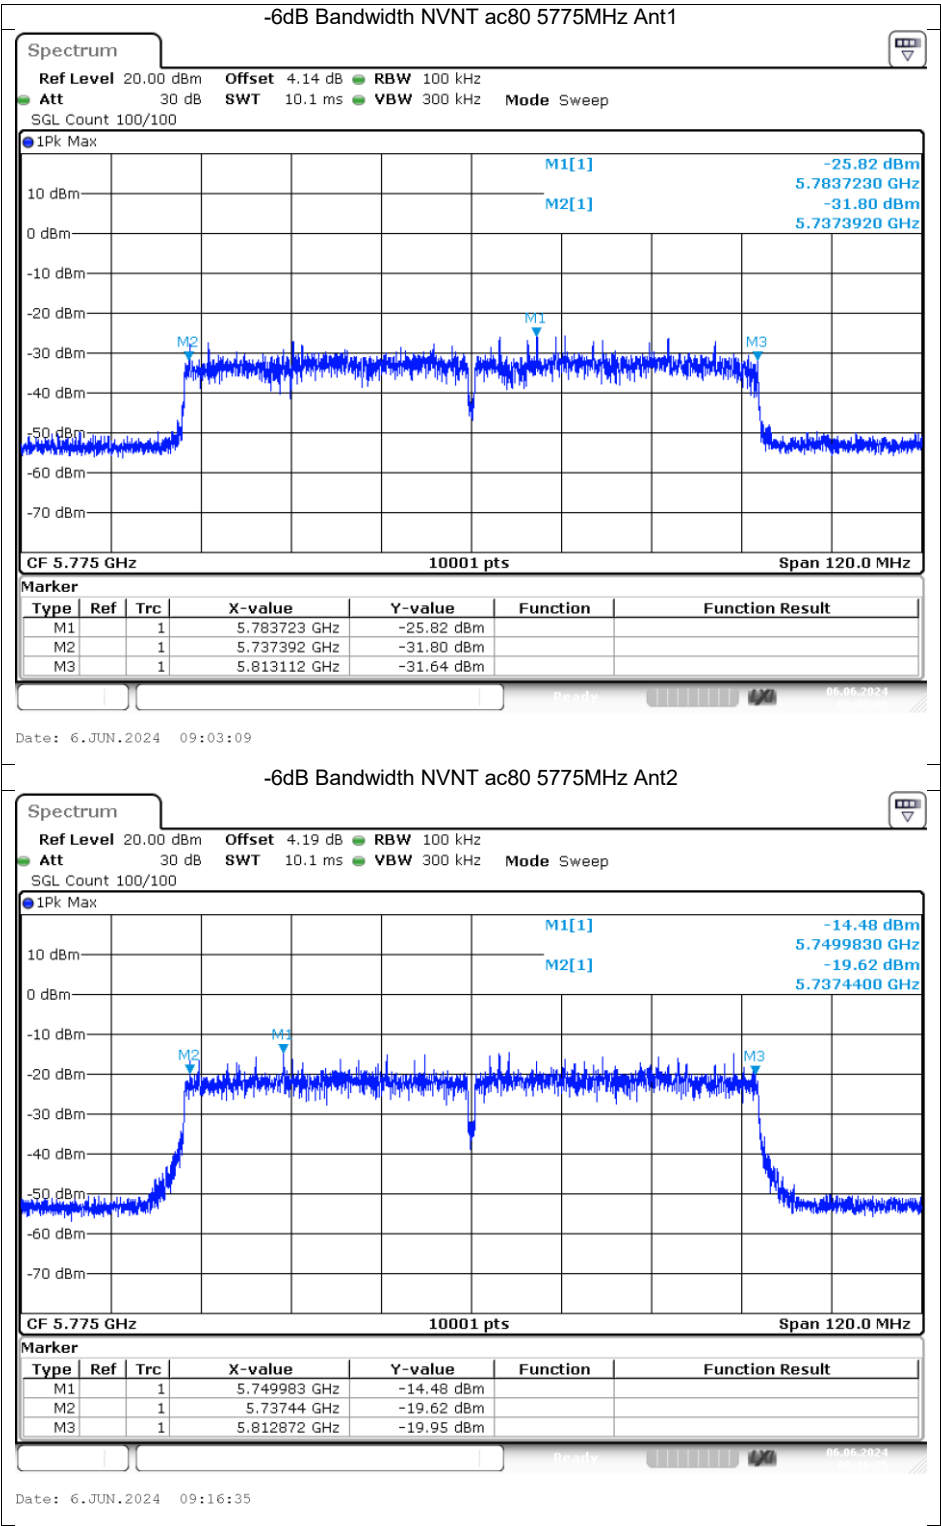

END OF REPORT