


41(2535-2655)	20MHz	16QAM	40140	1RB#0	20000~27000	-41.92	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#0	0.009~0.15	-70.87	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#0	0.15~30	-58.81	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#0	30~1000	-66.82	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#0	20000~27000	-41.98	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#0	0.009~0.15	-69.61	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#0	0.15~30	-60.82	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#0	30~1000	-66.47	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#0	20000~27000	-41.75	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	0.009~0.15	-69.09	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	0.15~30	-69.77	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	30~1000	-64.75	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	20000~27000	-42.03	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#0	0.009~0.15	-69.42	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#0	0.15~30	-70.55	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#0	30~1000	-65.11	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#0	20000~27000	-42.16	PASS



Test Graphs

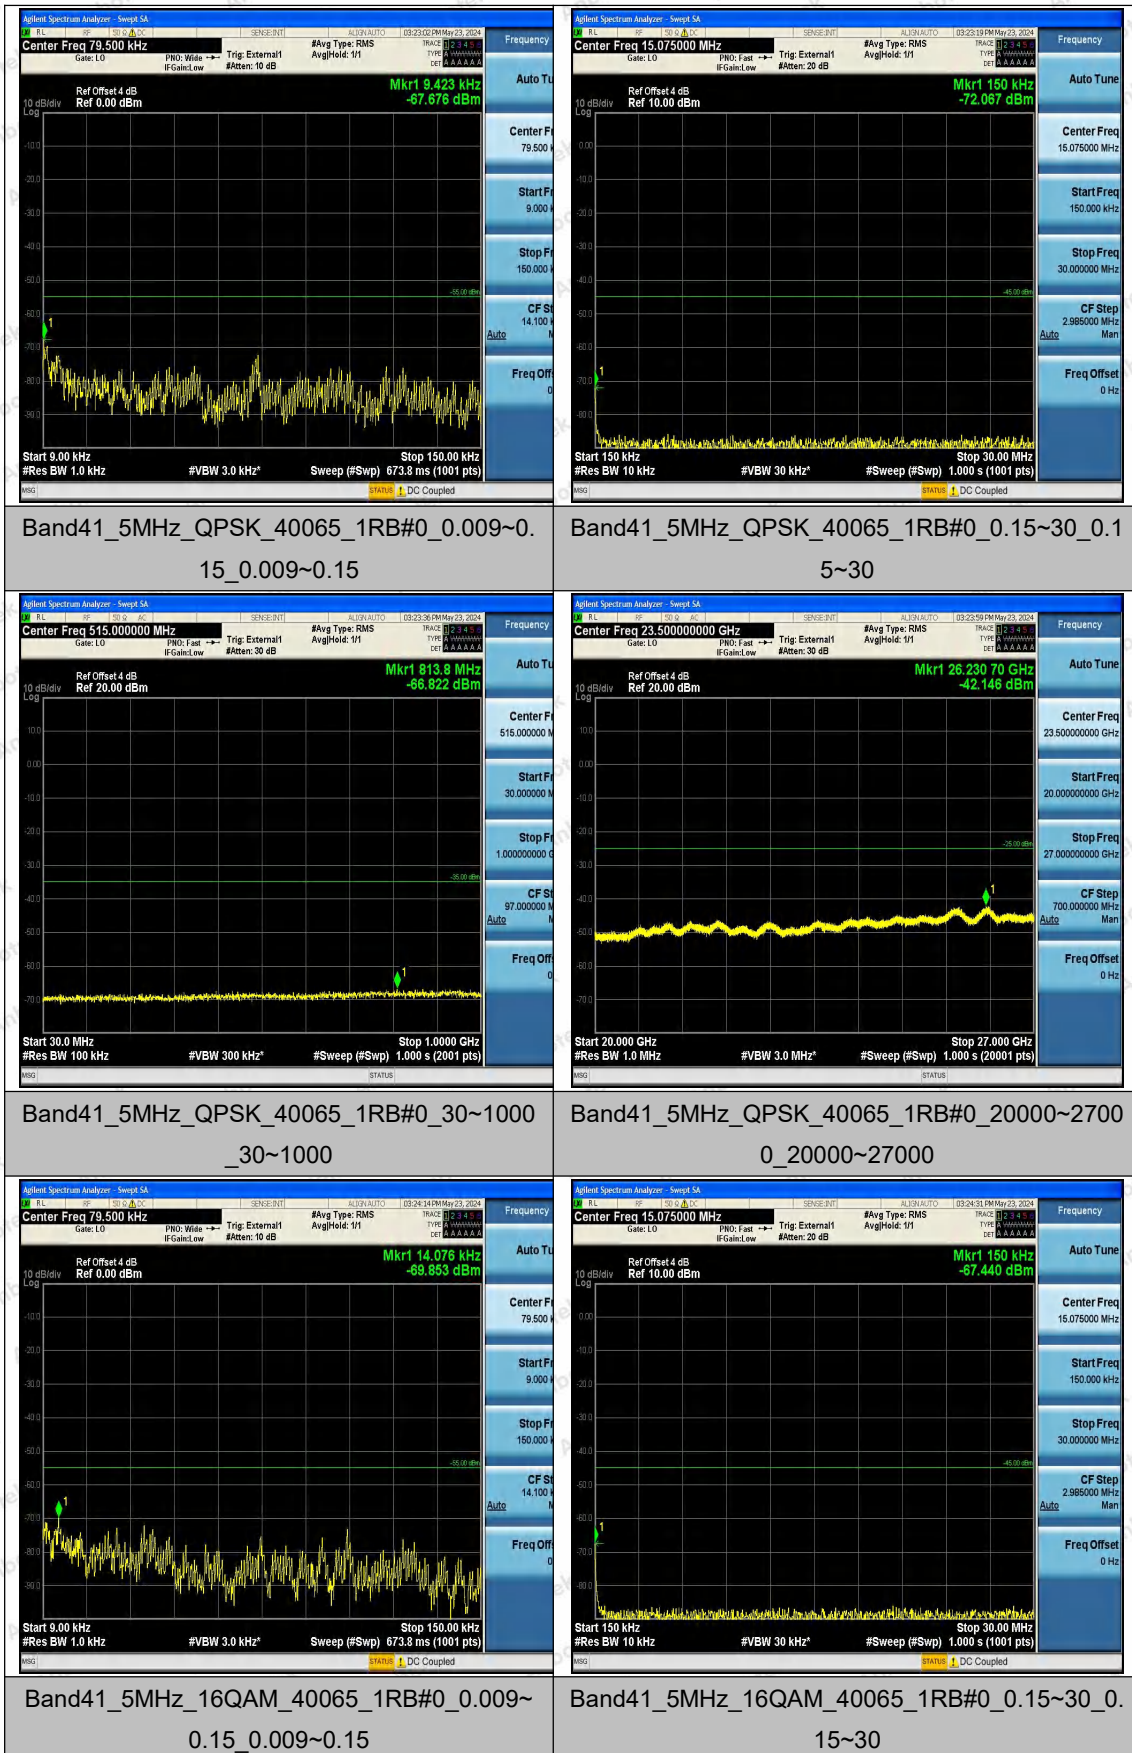


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



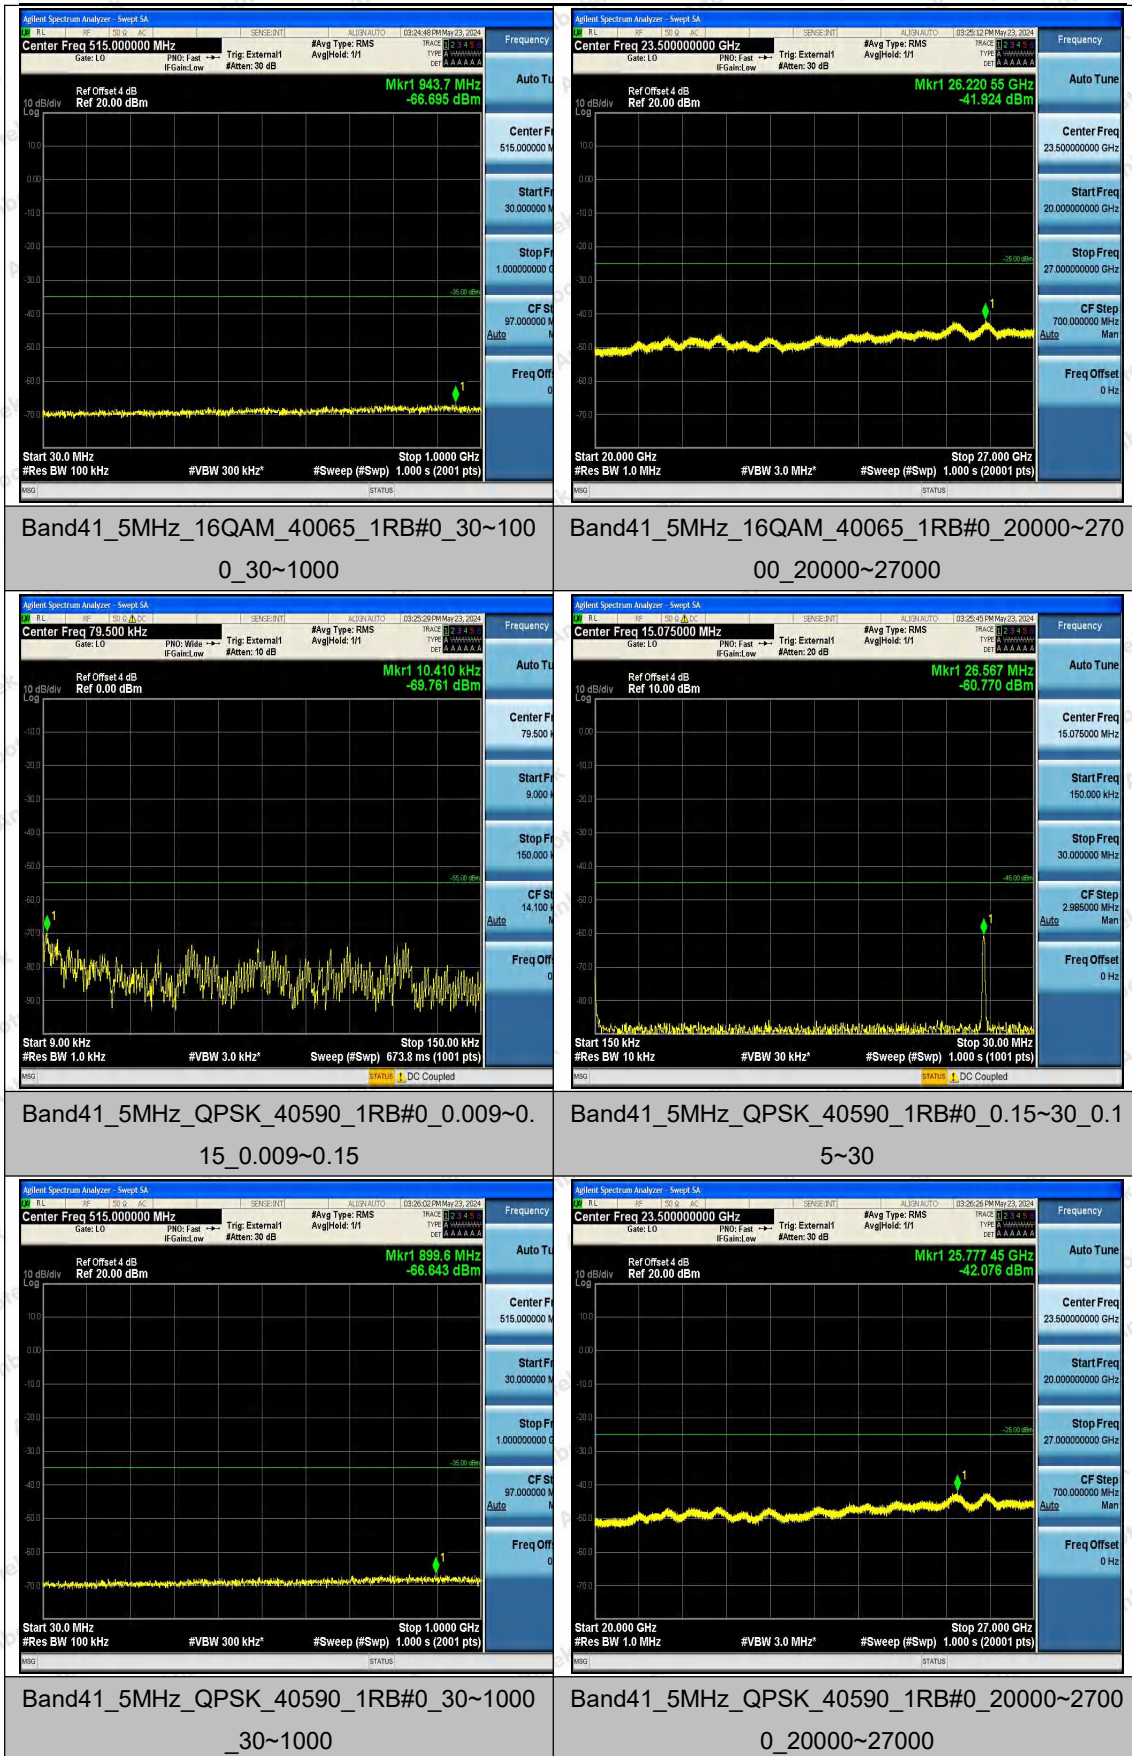


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



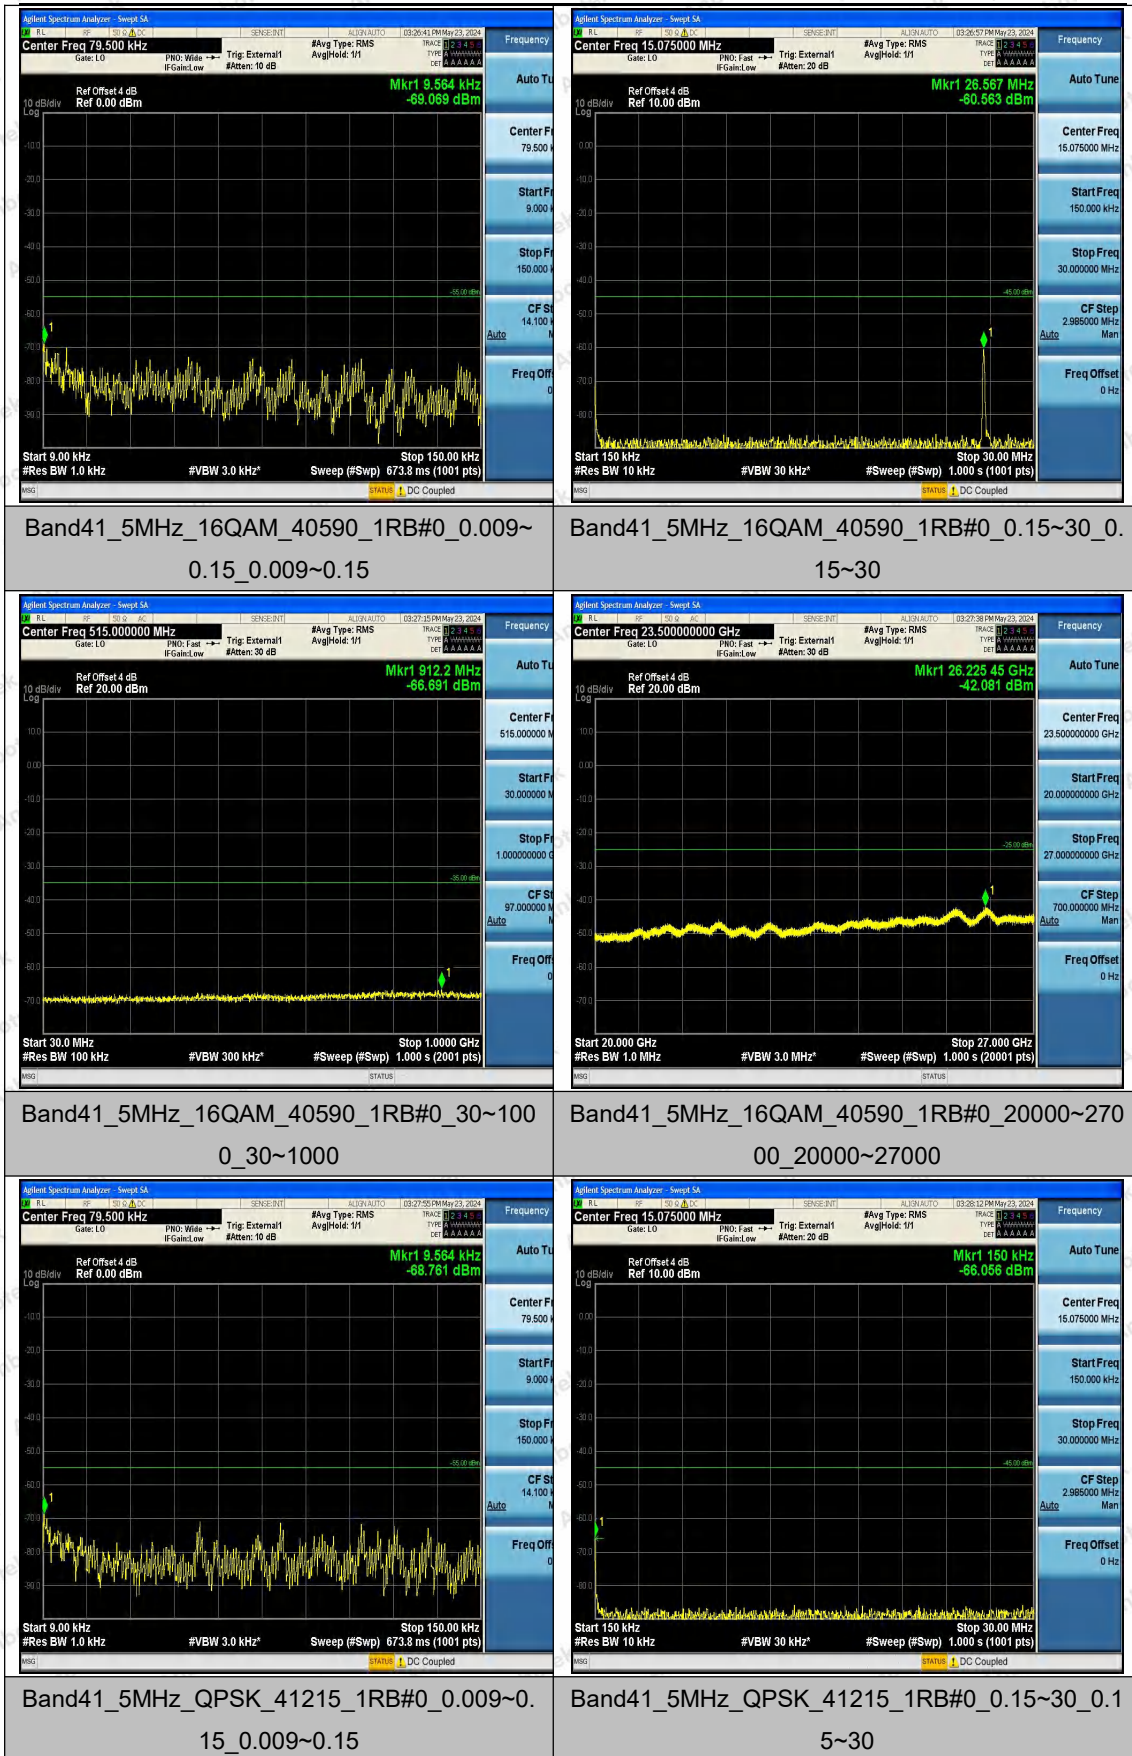

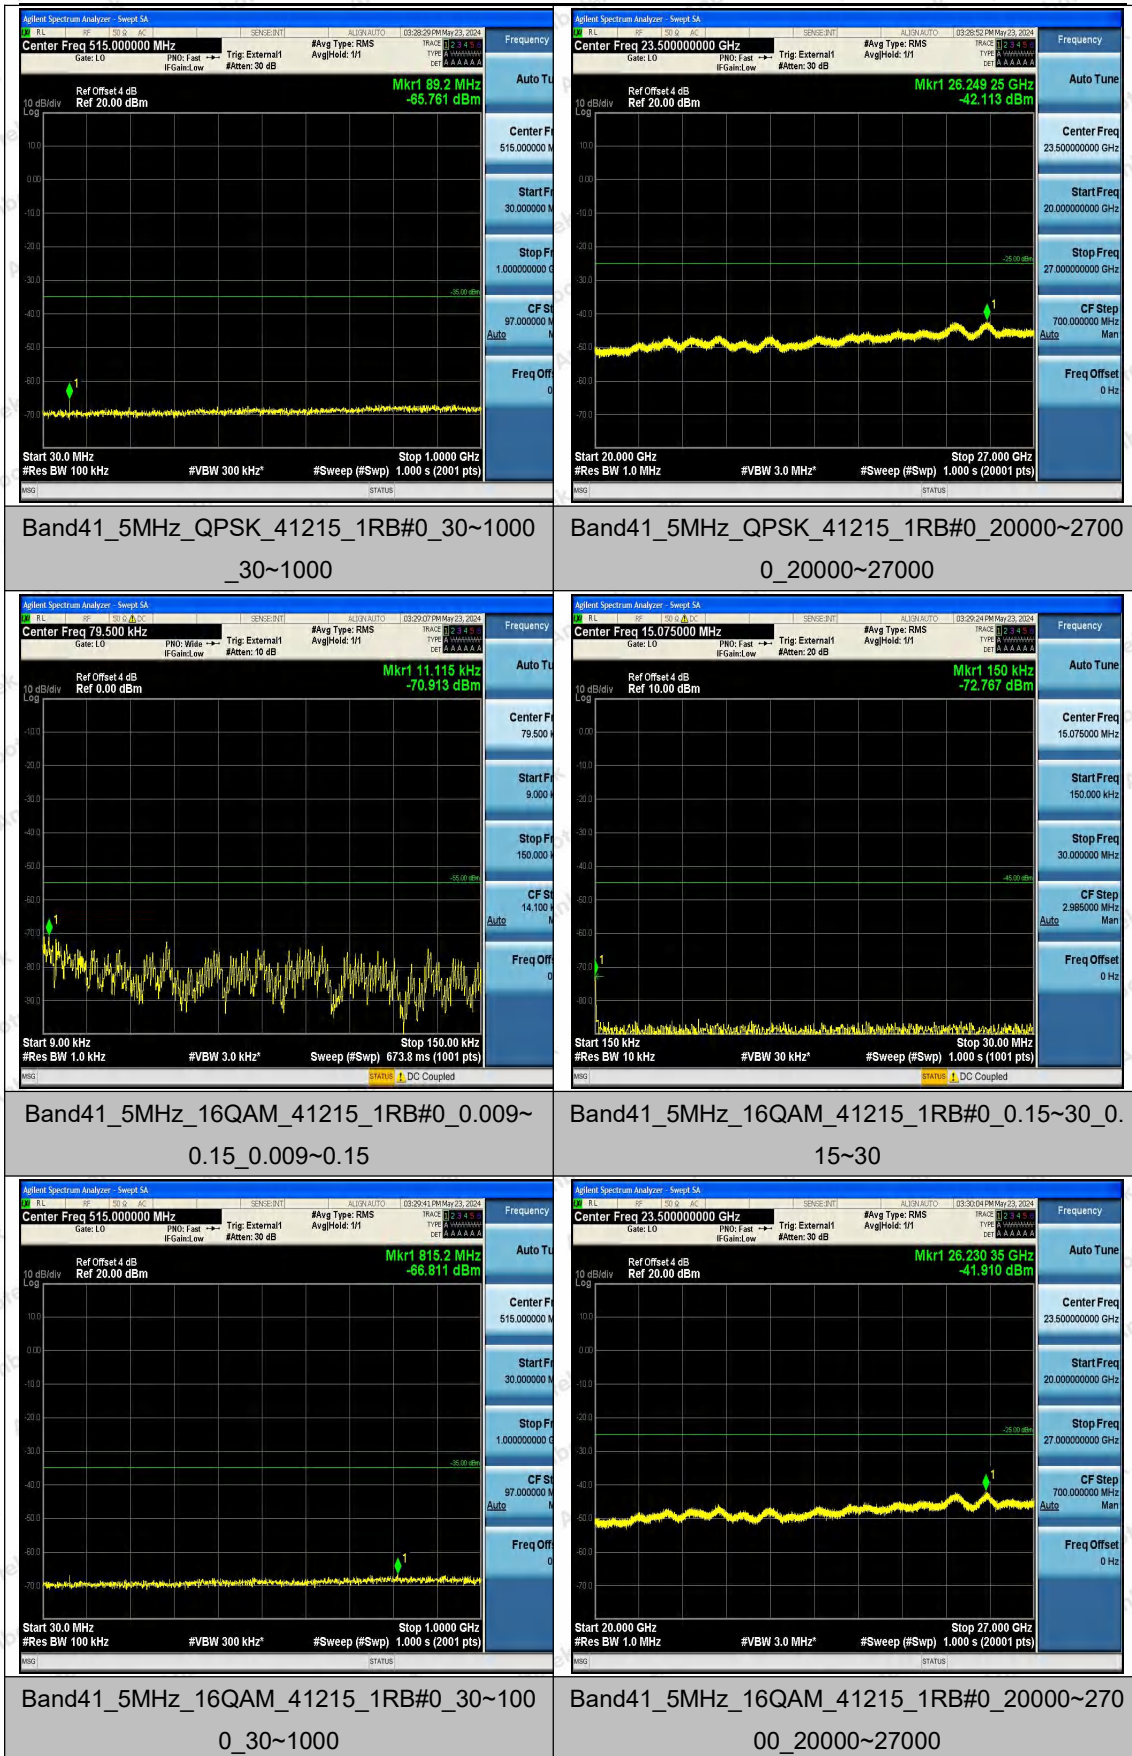


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



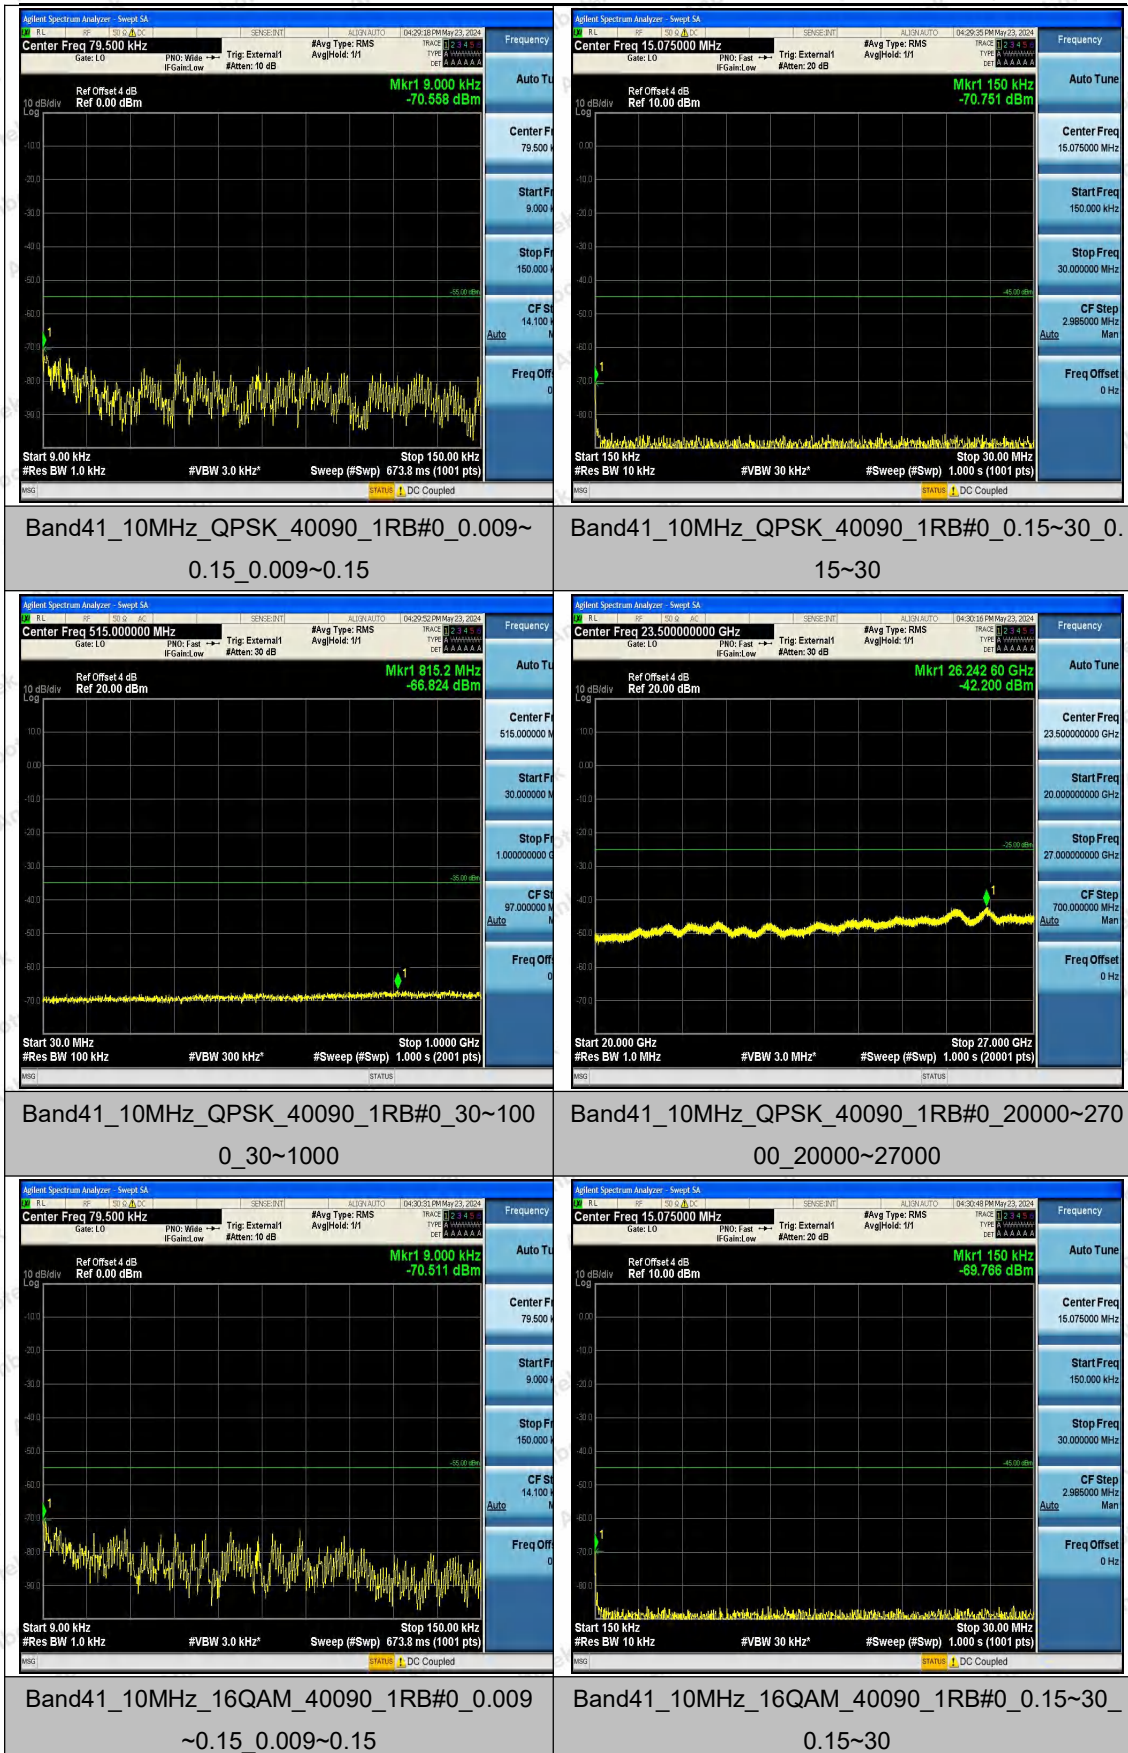

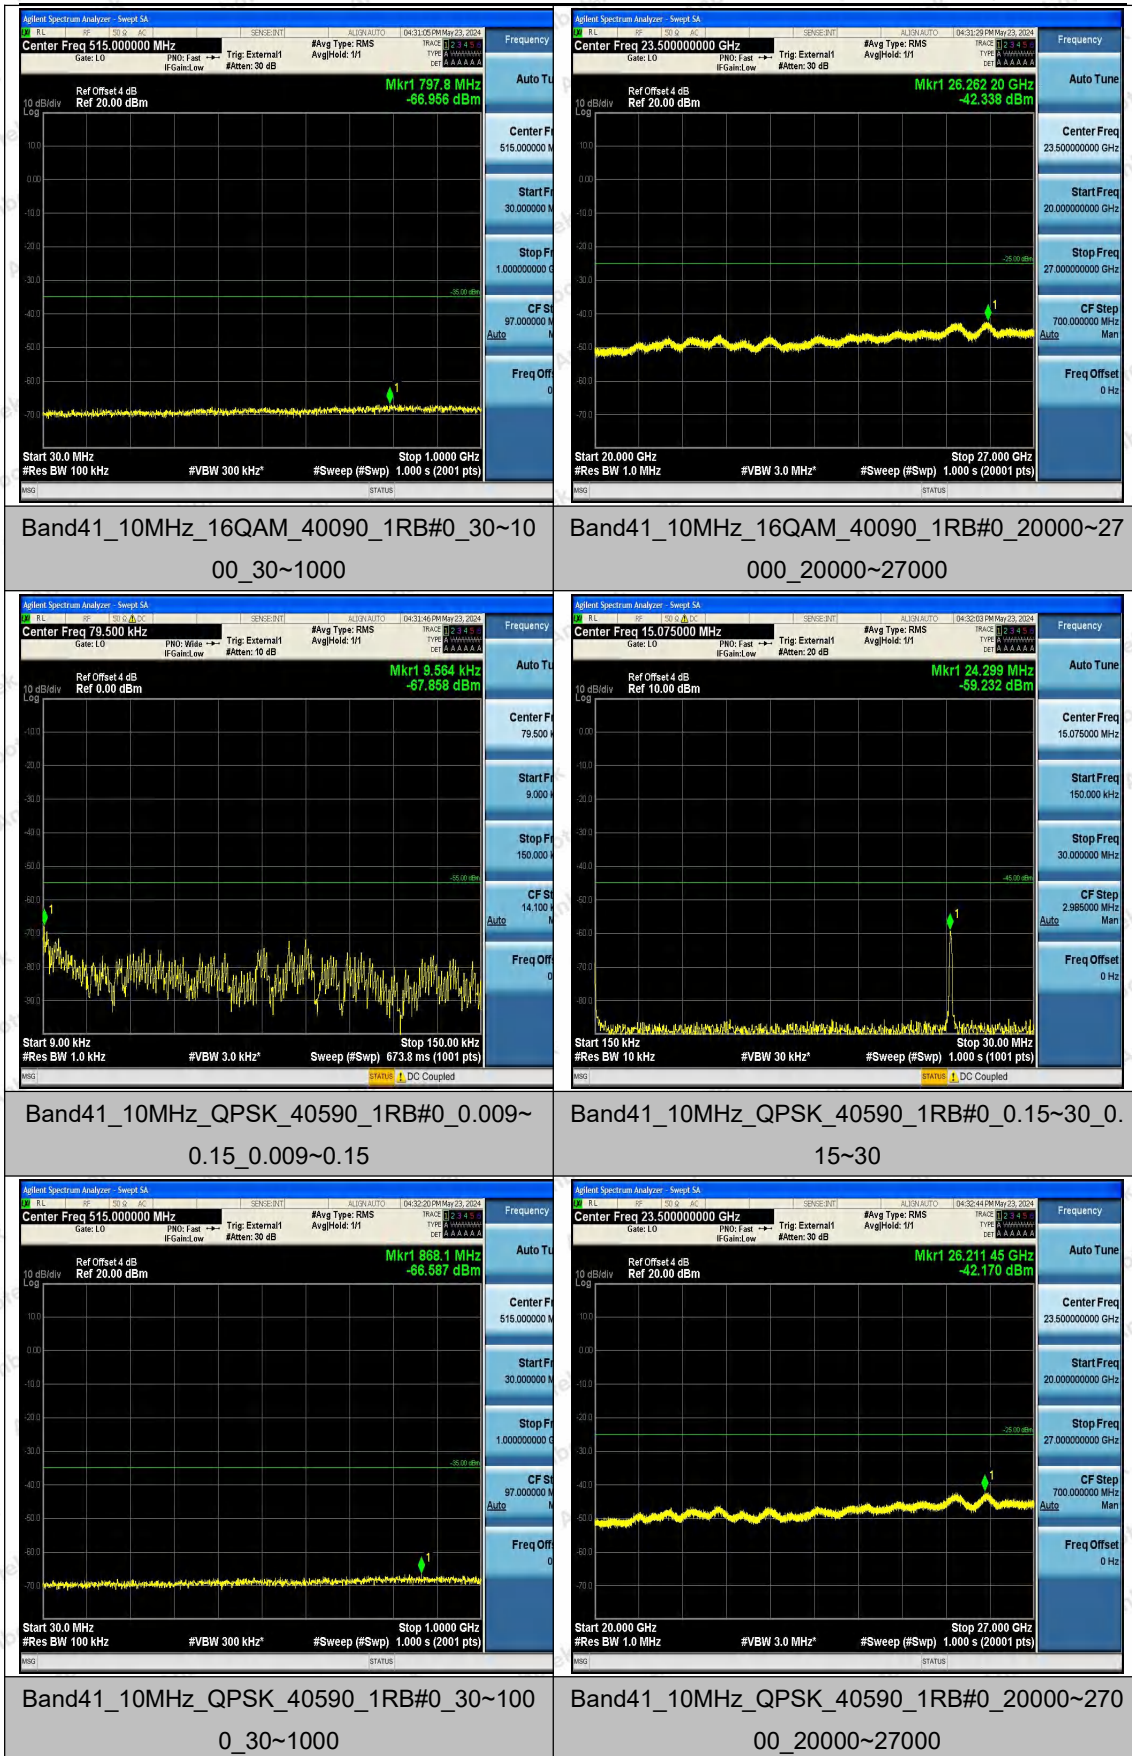


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



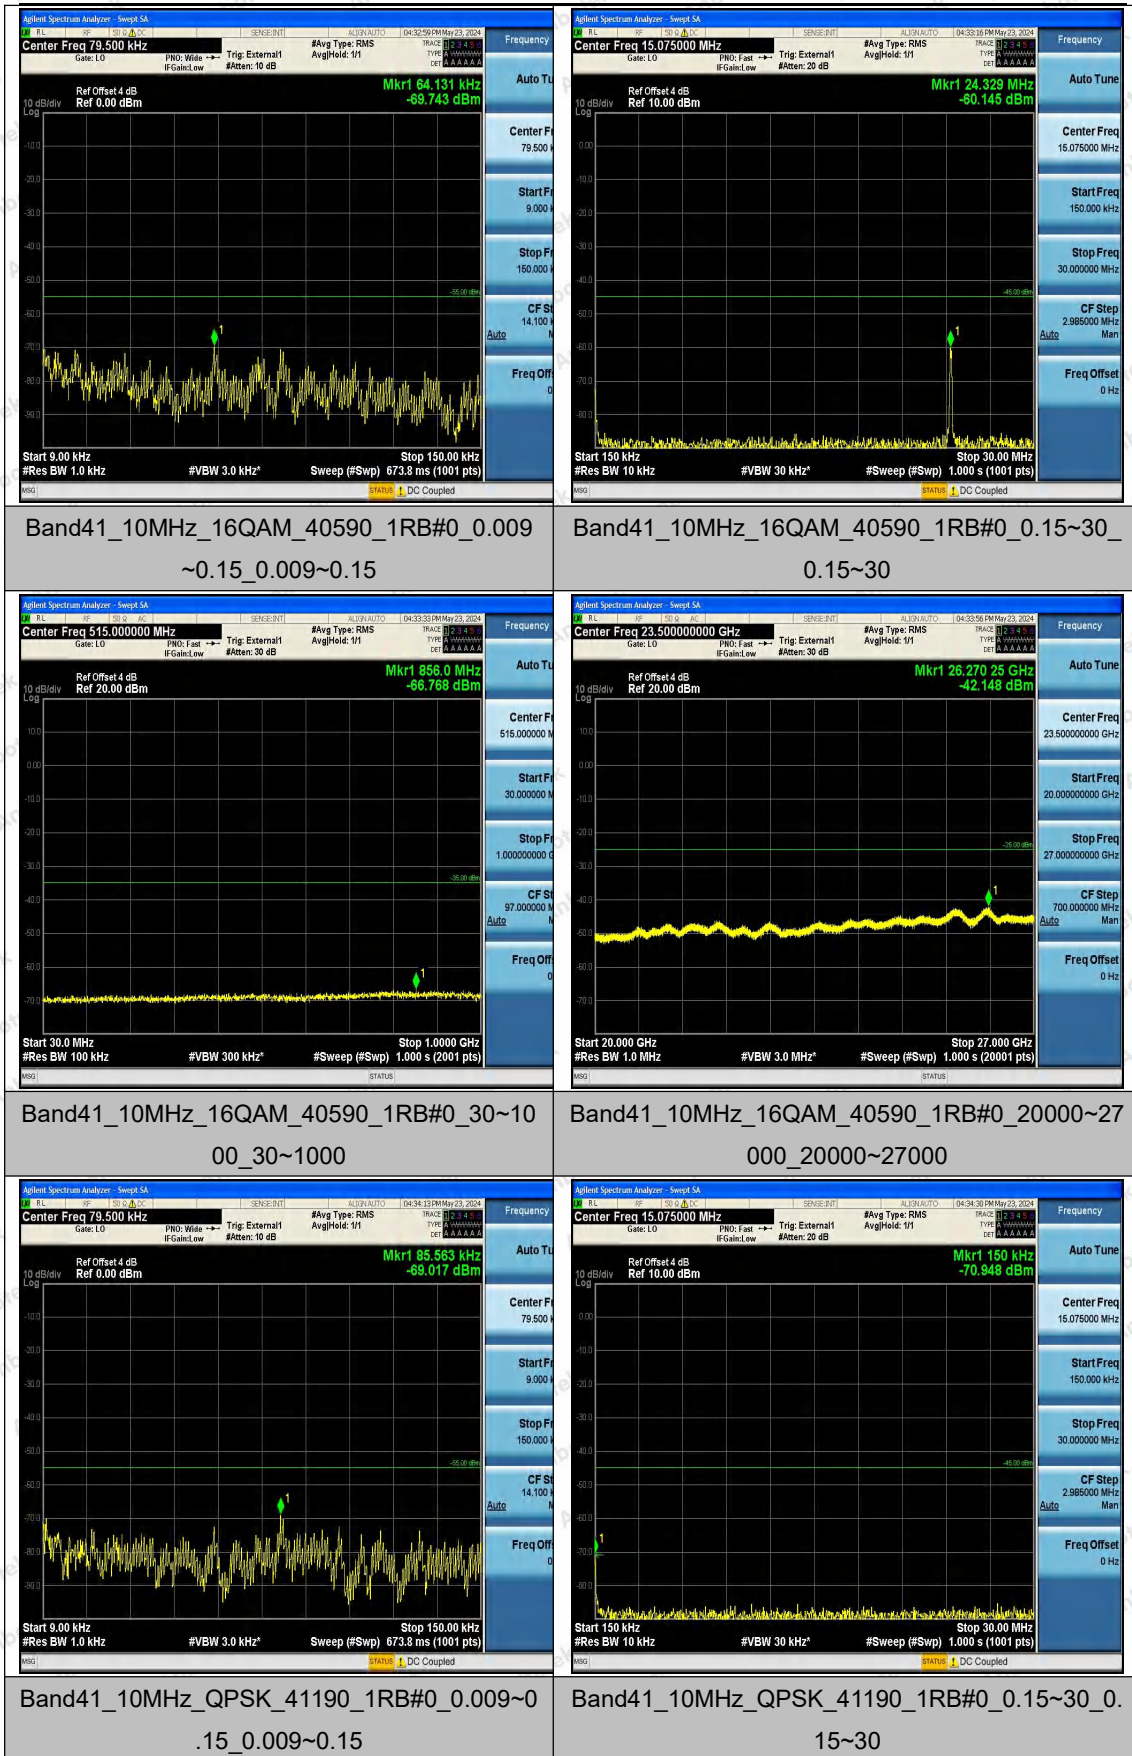


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



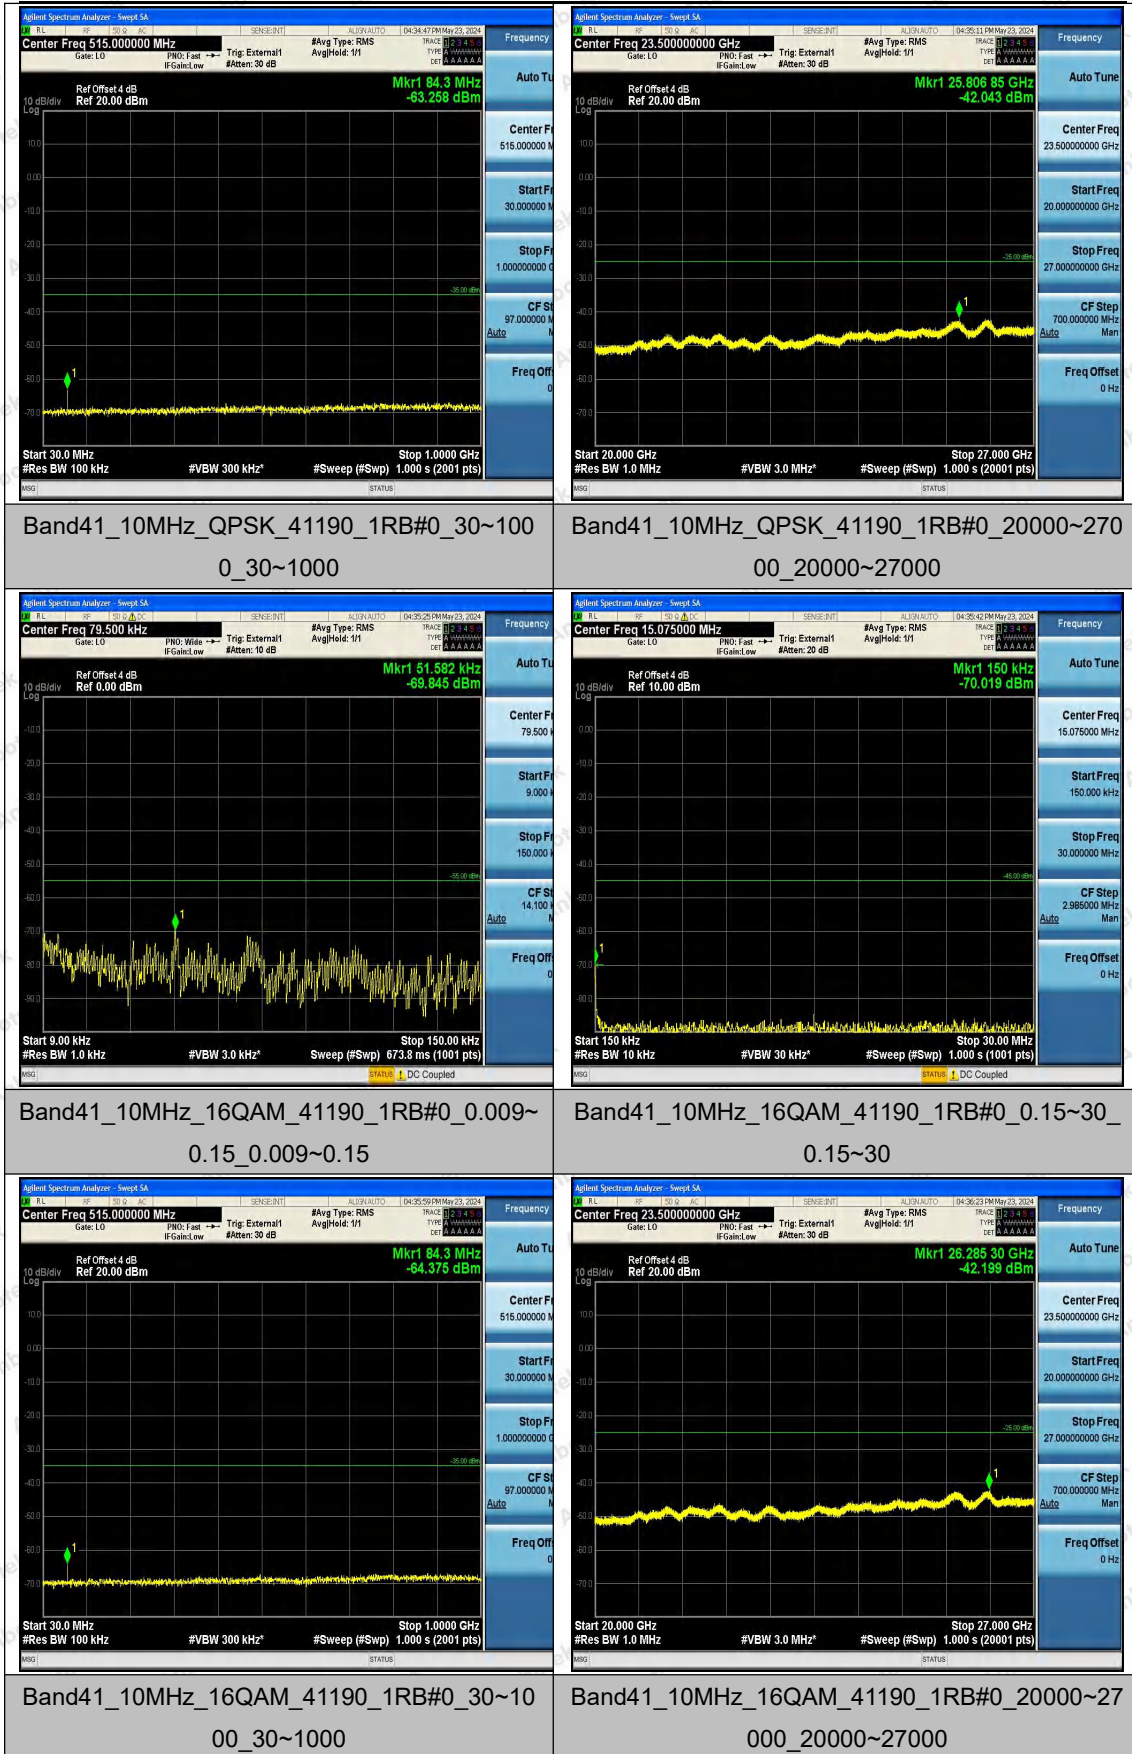

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline

400-003-0500

www.anbotek.com.cn



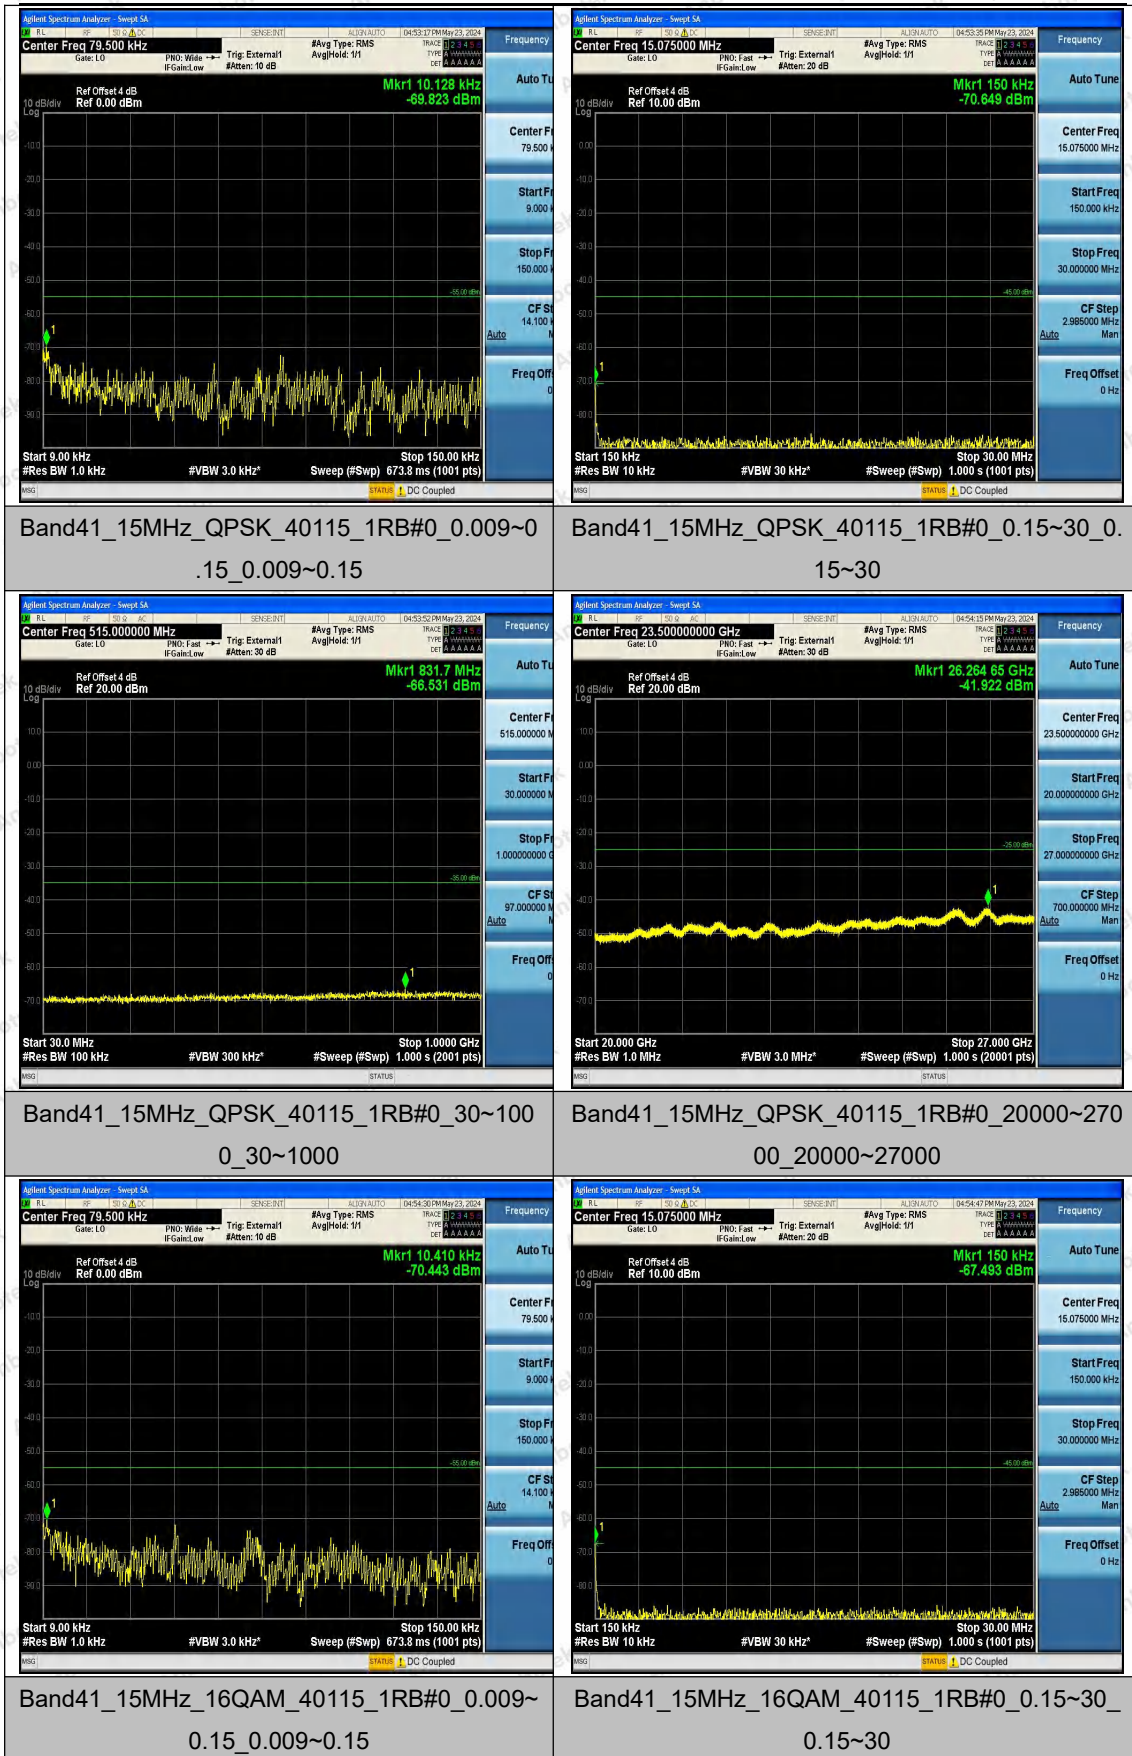

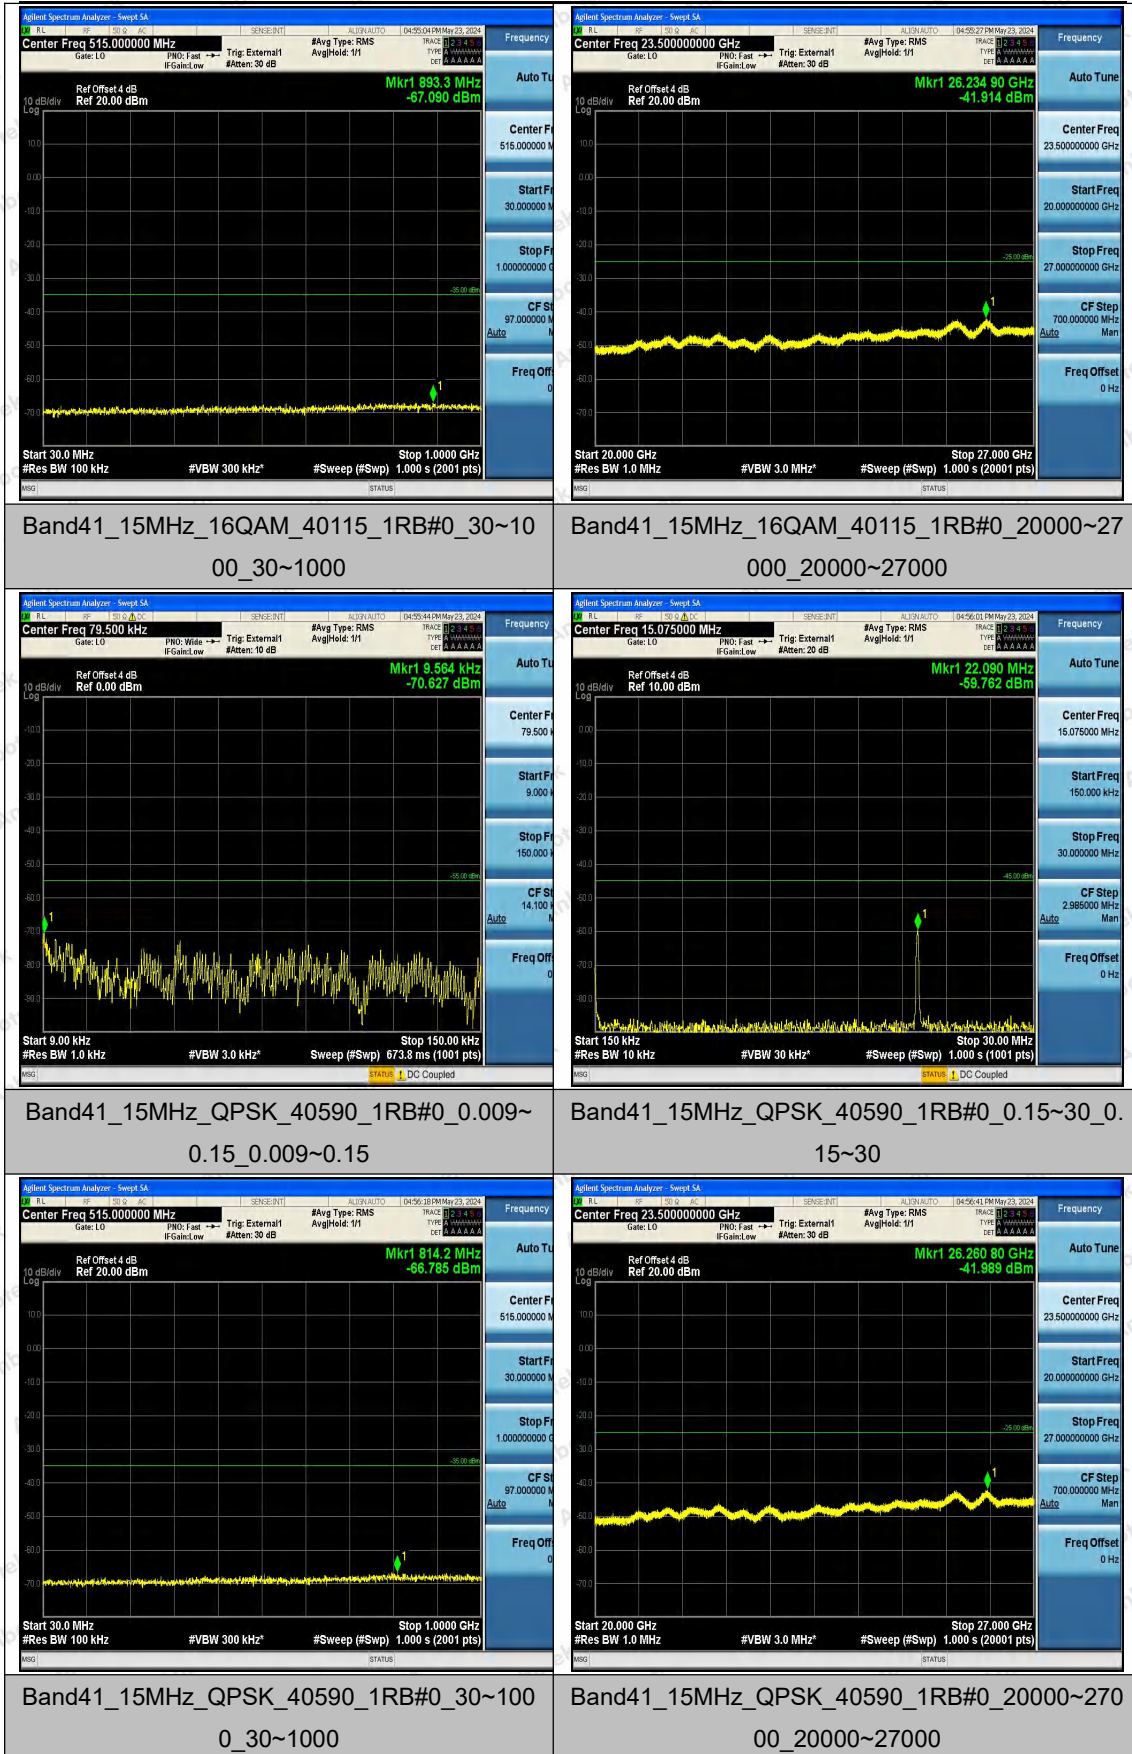


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



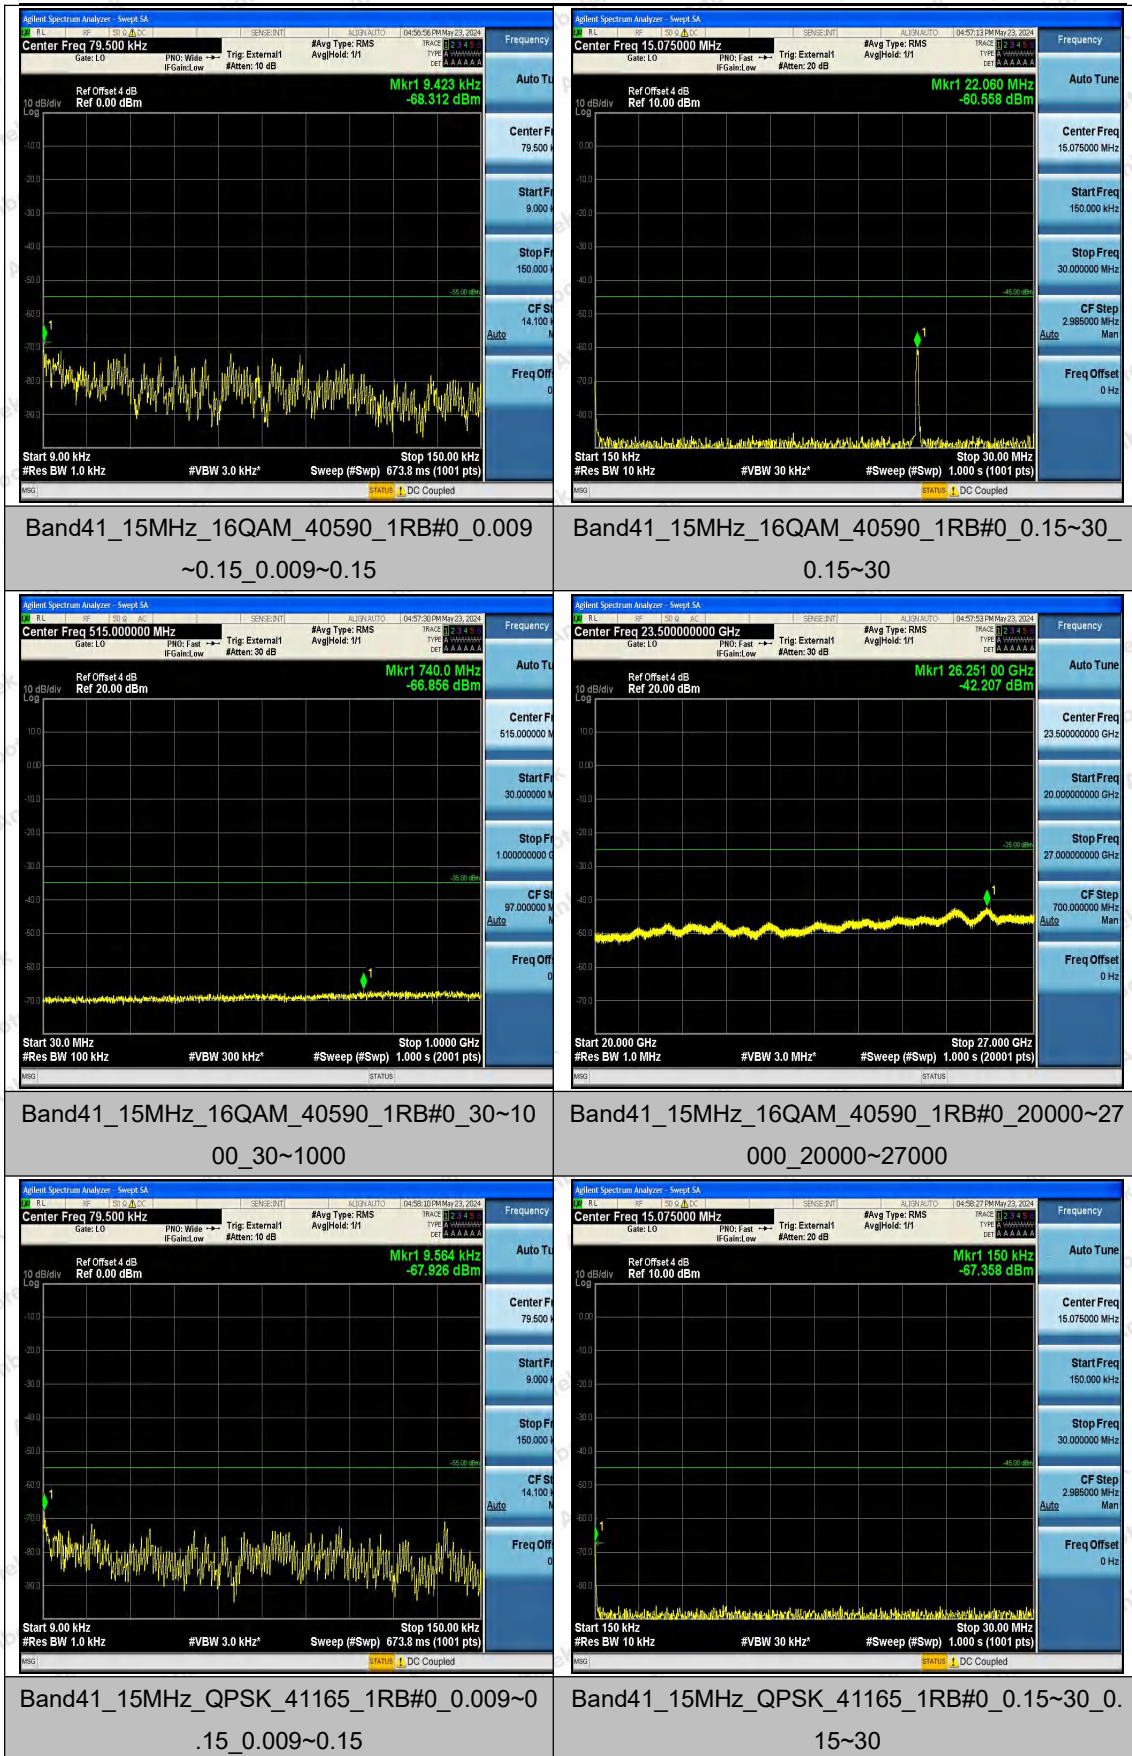


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



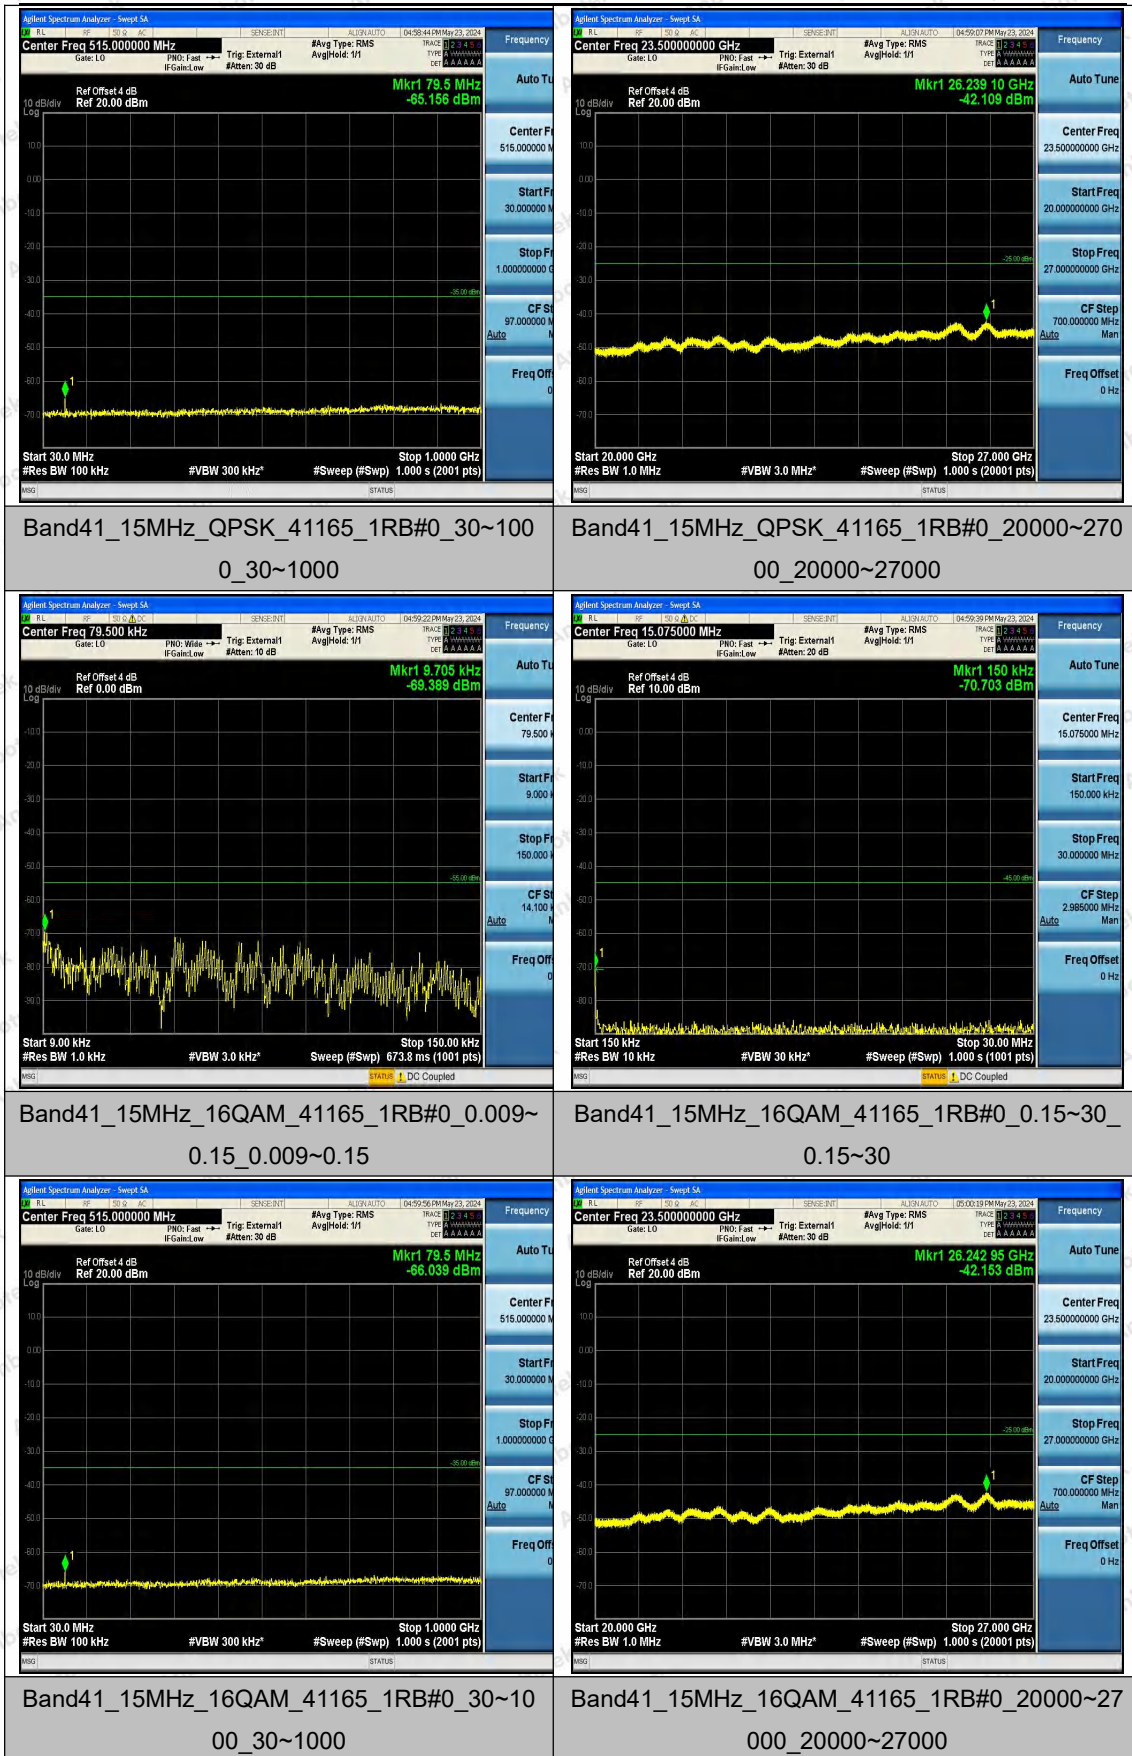


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



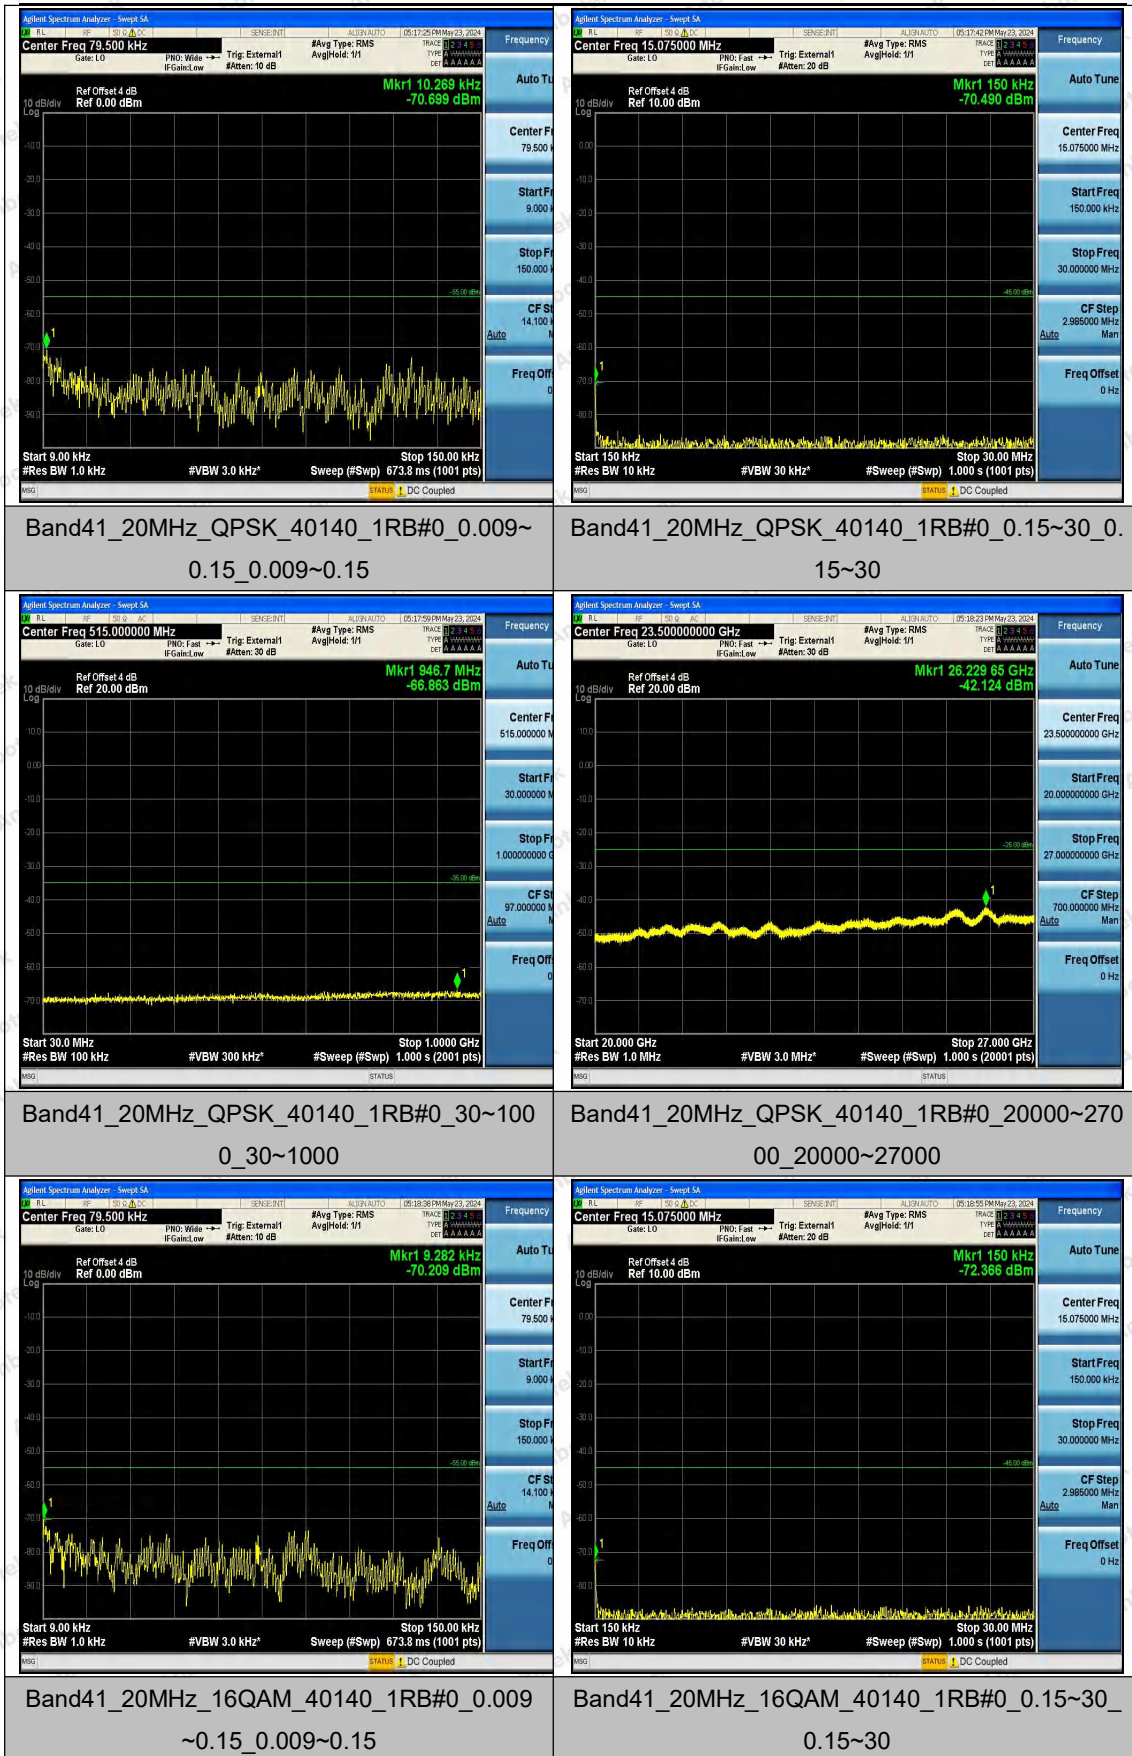


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



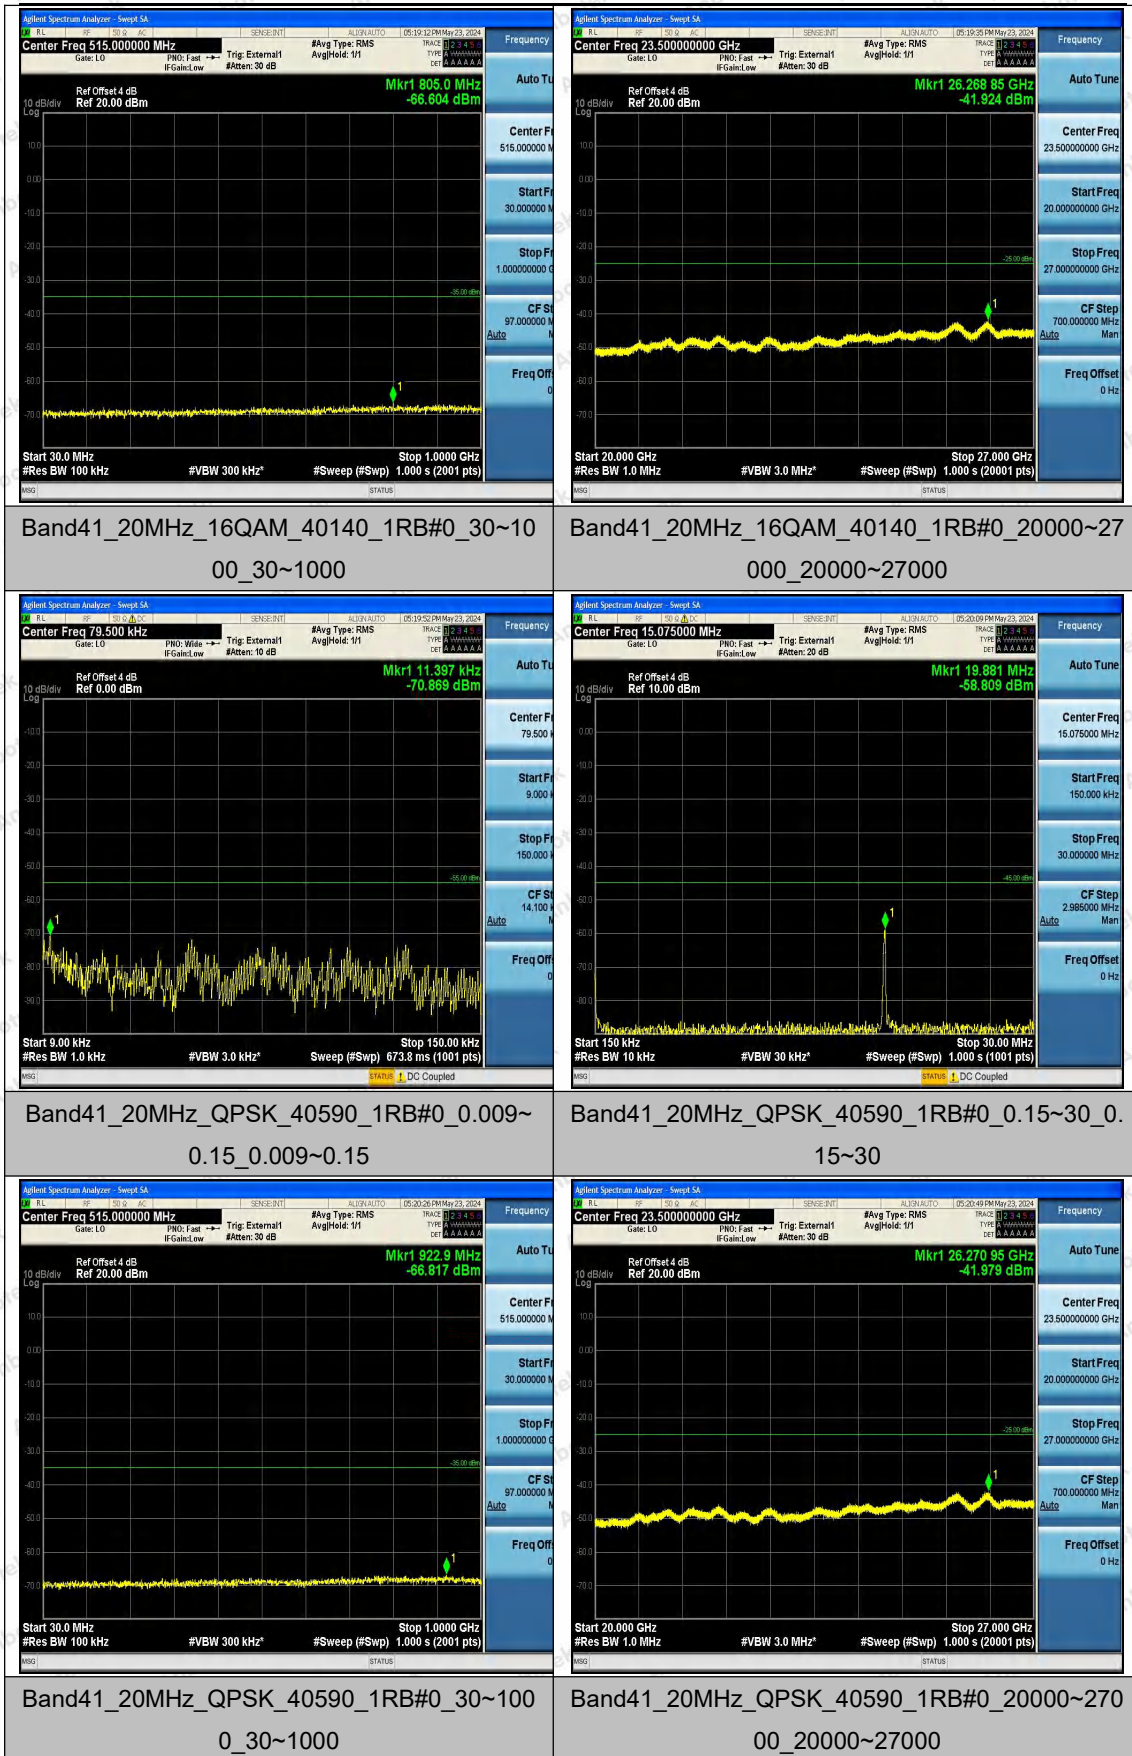

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn





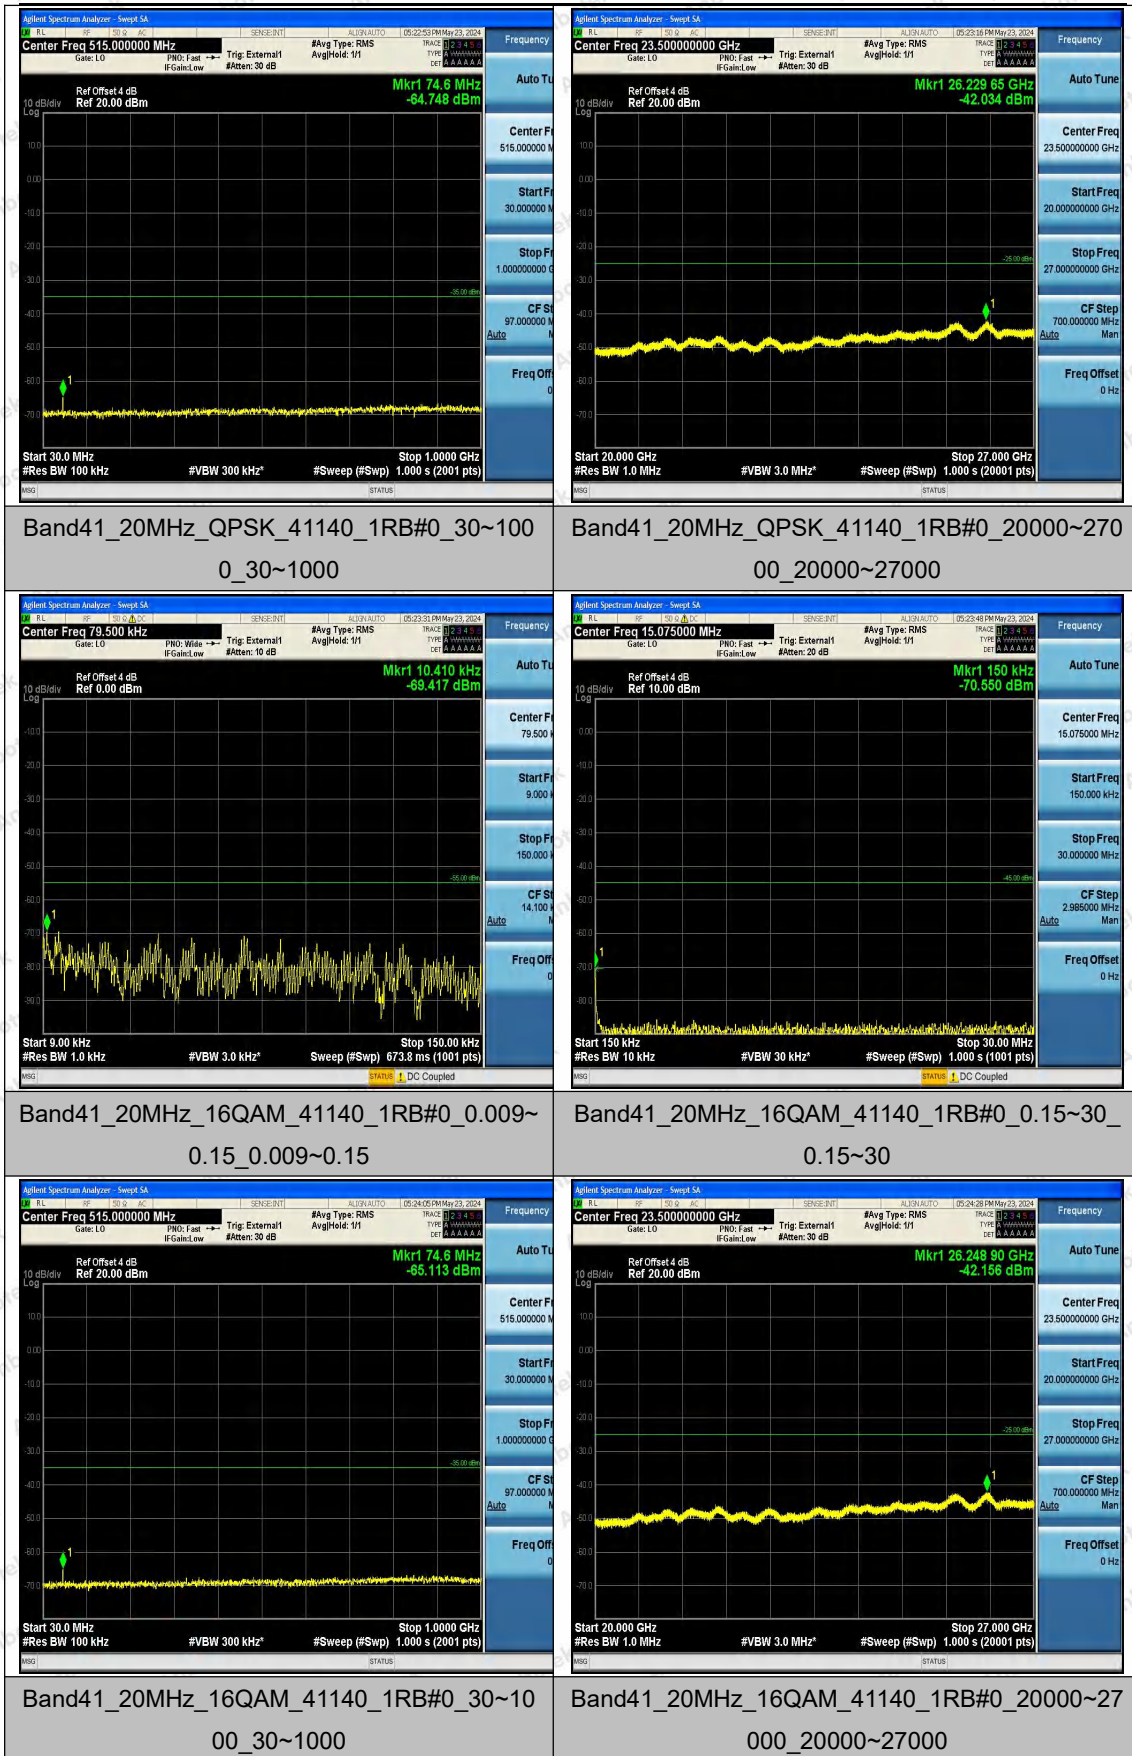

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
41(2535-2655)	5MHz	QPSK	40065	25RB#0	VN	NT	-43.95	-0.017320	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	VL	NT	-21.24	-0.008370	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	VH	NT	-17.05	-0.006719	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	VN	NT	-6.08	-0.002396	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	VL	NT	-9.16	-0.003610	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	VH	NT	-9.77	-0.003850	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	VN	NT	17.77	0.006861	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	VL	NT	-10.29	-0.003973	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	VH	NT	-12.26	-0.004734	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	VN	NT	-7.00	-0.002703	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	VL	NT	12.19	0.004707	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	VH	NT	-13.48	-0.005205	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	VN	NT	25.26	0.009523	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	VL	NT	-20.31	-0.007657	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	VH	NT	-16.88	-0.006364	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	VN	NT	-9.37	-0.003533	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	VL	NT	-17.11	-0.006451	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	VH	NT	-11.83	-0.004460	±2.5	PASS



41(2535-2655)	10MHz	QPSK	40090	50RB#0	VN	NT	-22.03	-0.008673	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	VL	NT	-13.62	-0.005362	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	VH	NT	-17.45	-0.006870	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	VN	NT	-13.60	-0.005354	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	VL	NT	-13.02	-0.005126	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	VH	NT	-11.30	-0.004449	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	VN	NT	15.13	0.005842	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	VL	NT	-17.11	-0.006606	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	VH	NT	-15.88	-0.006131	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	VN	NT	4.72	0.001822	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	VL	NT	-14.76	-0.005699	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	VH	NT	-14.32	-0.005529	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	VN	NT	25.31	0.009551	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	VL	NT	-17.72	-0.006687	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	VH	NT	3.23	0.001219	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	VN	NT	22.83	0.008615	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	VL	NT	-10.17	-0.003838	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	VH	NT	-14.39	-0.005430	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	VN	NT	-26.78	-0.010533	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	VL	NT	-18.57	-0.007304	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	VH	NT	9.47	0.003725	±2.5	PASS



41(2535-2655)	15MHz	16QAM	40115	75RB#0	VN	NT	-11.14	-0.004382	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	VL	NT	-12.23	-0.004810	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	VH	NT	9.66	0.003799	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	VN	NT	13.53	0.005224	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	VL	NT	-14.66	-0.005660	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	VH	NT	15.35	0.005927	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	VN	NT	-10.36	-0.004000	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	VL	NT	-15.46	-0.005969	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	VH	NT	-13.15	-0.005077	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	VN	NT	-23.79	-0.008986	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	VL	NT	6.51	0.002459	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	VH	NT	-10.81	-0.004083	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	VN	NT	-12.60	-0.004759	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	VL	NT	-14.03	-0.005299	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	VH	NT	-10.21	-0.003856	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	VN	NT	-20.76	-0.008157	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	VL	NT	-11.93	-0.004688	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	VH	NT	-11.57	-0.004546	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	VN	NT	8.55	0.003360	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	VL	NT	-13.90	-0.005462	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	VH	NT	-10.53	-0.004138	±2.5	PASS



41(2535-2655)	20MHz	QPSK	40590	100RB#0	VN	NT	-12.19	-0.004707	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	VL	NT	-16.84	-0.006502	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	VH	NT	-16.84	-0.006502	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	VN	NT	12.29	0.004745	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	VL	NT	-10.80	-0.004170	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	VH	NT	-14.18	-0.005475	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	VN	NT	21.64	0.008181	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	VL	NT	-12.99	-0.004911	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	VH	NT	-14.92	-0.005641	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	VN	NT	-14.55	-0.005501	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	VL	NT	-16.69	-0.006310	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	VH	NT	-14.52	-0.005490	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-30	-24.33	-0.009588	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-20	-24.68	-0.009726	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-10	59.94	0.023622	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	0	-4.02	-0.001584	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	10	-9.88	-0.003894	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	20	-14.25	-0.005616	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	30	-19.00	-0.007488	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	40	32.73	0.012899	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	50	6.11	0.002408	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-30	-6.37	-0.002510	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-20	-14.99	-0.005907	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-10	-7.85	-0.003094	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	0	-9.13	-0.003598	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	10	-13.43	-0.005293	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	20	-12.85	-0.005064	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	30	43.52	0.017151	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	40	9.06	0.003570	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	50	-9.28	-0.003657	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-30	-6.25	-0.002413	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-20	-4.71	-0.001819	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-10	-14.32	-0.005529	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	0	-9.28	-0.003583	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	10	-11.84	-0.004571	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	20	9.67	0.003734	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	30	-8.61	-0.003324	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	40	-11.12	-0.004293	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	50	-8.84	-0.003413	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-30	-11.54	-0.004456	±2.5	PASS



41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-20	-11.80	-0.004556	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-10	3.65	0.001409	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	0	-13.52	-0.005220	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	10	5.09	0.001965	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	20	-16.26	-0.006278	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	30	-12.25	-0.004730	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	40	61.87	0.023888	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	50	-12.99	-0.005015	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-30	-15.29	-0.005764	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-20	-19.04	-0.007178	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-10	-12.89	-0.004860	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	0	12.19	0.004596	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	10	4.01	0.001512	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	20	18.90	0.007125	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	30	4.48	0.001689	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	40	-11.89	-0.004483	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	50	-17.84	-0.006726	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-30	-13.96	-0.005263	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-20	-13.55	-0.005108	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-10	-12.67	-0.004777	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	0	-14.32	-0.005399	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	10	37.78	0.014243	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	20	-13.22	-0.004984	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	30	-16.34	-0.006160	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	40	-8.75	-0.003299	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	50	7.37	0.002779	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-30	-11.12	-0.004378	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-20	-14.22	-0.005598	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-10	-9.94	-0.003913	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	0	-11.47	-0.004516	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	10	-3.89	-0.001531	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	20	7.97	0.003138	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	30	-11.60	-0.004567	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	40	8.50	0.003346	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	50	-5.45	-0.002146	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	-30	6.95	0.002736	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	-20	-13.19	-0.005193	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	-10	-16.52	-0.006504	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	0	-16.05	-0.006319	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	10	6.04	0.002378	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	20	-15.21	-0.005988	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	30	-17.78	-0.007000	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	40	-16.18	-0.006370	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	50	33.67	0.013256	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-30	5.51	0.002127	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-20	-14.56	-0.005622	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-10	-10.17	-0.003927	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	0	-15.05	-0.005811	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	10	-6.69	-0.002583	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	20	3.45	0.001332	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	30	-15.05	-0.005811	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	40	-11.43	-0.004413	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	50	-11.09	-0.004282	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	-30	-14.79	-0.005710	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	-20	-11.20	-0.004324	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	-10	12.52	0.004834	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	0	-11.87	-0.004583	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	10	9.94	0.003838	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	20	-15.62	-0.006031	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	30	-11.34	-0.004378	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	40	-11.23	-0.004336	±2.5	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	50	-16.09	-0.006212	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-30	-16.92	-0.006385	±2.5	PASS



41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-20	-15.13	-0.005709	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-10	10.04	0.003789	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	0	-11.66	-0.004400	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	10	7.38	0.002785	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	20	7.93	0.002992	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	30	5.45	0.002057	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	40	-13.66	-0.005155	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	50	-13.43	-0.005068	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	-30	-11.03	-0.004162	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	-20	-4.82	-0.001819	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	-10	-13.25	-0.005000	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	0	-12.19	-0.004600	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	10	-14.78	-0.005577	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	20	-15.01	-0.005664	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	30	7.68	0.002898	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	40	-11.50	-0.004340	±2.5	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	50	-11.59	-0.004374	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-30	19.56	0.007693	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-20	-10.99	-0.004323	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-10	-12.63	-0.004968	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	0	-17.19	-0.006761	±2.5	PASS



41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	10	-12.77	-0.005023	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	20	-9.48	-0.003729	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	30	-10.29	-0.004047	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	40	-14.25	-0.005605	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	50	9.98	0.003925	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	-30	-10.99	-0.004323	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	-20	-12.92	-0.005082	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	-10	-9.07	-0.003567	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	0	11.87	0.004669	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	10	-13.58	-0.005341	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	20	-18.63	-0.007327	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	30	11.64	0.004578	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	40	8.60	0.003382	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	50	-17.14	-0.006741	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-30	-12.35	-0.004768	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-20	-7.62	-0.002942	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-10	10.47	0.004042	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	0	-12.65	-0.004884	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	10	-18.78	-0.007251	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	20	-17.01	-0.006568	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	30	-12.60	-0.004865	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	40	8.81	0.003402	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	50	-13.29	-0.005131	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	-30	-14.00	-0.005405	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	-20	-8.13	-0.003139	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	-10	-14.13	-0.005456	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	0	-11.66	-0.004502	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	10	-10.79	-0.004166	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	20	-12.62	-0.004873	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	30	-14.55	-0.005618	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	40	-11.60	-0.004479	±2.5	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	50	-13.30	-0.005135	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-30	-17.74	-0.006701	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-20	-10.59	-0.004000	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-10	14.98	0.005658	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	0	-14.72	-0.005560	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	10	-13.43	-0.005073	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	20	-14.96	-0.005651	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	30	-19.41	-0.007331	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	40	-15.45	-0.005836	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	50	-11.03	-0.004166	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	-30	10.20	0.003853	±2.5	PASS



41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	-20	-18.53	-0.006999	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	-10	-11.73	-0.004431	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	0	-16.01	-0.006047	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	10	-15.22	-0.005749	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	20	-12.63	-0.004771	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	30	-10.97	-0.004144	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	40	-17.88	-0.006754	±2.5	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	50	-16.89	-0.006380	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-30	-13.00	-0.005108	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-20	-8.43	-0.003312	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-10	26.21	0.010299	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	0	-12.67	-0.004978	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	10	-11.19	-0.004397	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	20	-11.17	-0.004389	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	30	-10.91	-0.004287	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	40	-15.49	-0.006086	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	50	-11.43	-0.004491	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	-30	-15.49	-0.006086	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	-20	-12.19	-0.004790	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	-10	-12.52	-0.004919	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	0	-11.53	-0.004530	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	10	-8.64	-0.003395	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	20	-10.59	-0.004161	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	30	-13.92	-0.005470	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	40	-10.00	-0.003929	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	50	-10.83	-0.004255	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-30	-19.04	-0.007351	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-20	-13.56	-0.005236	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-10	11.57	0.004467	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	0	-12.69	-0.004900	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	10	-9.36	-0.003614	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	20	-6.81	-0.002629	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	30	-17.34	-0.006695	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	40	-10.43	-0.004027	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	50	9.28	0.003583	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	-30	-13.43	-0.005185	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	-20	-13.29	-0.005131	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	-10	-11.90	-0.004595	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	0	-10.07	-0.003888	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	10	-13.56	-0.005236	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	20	10.61	0.004097	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	30	-15.92	-0.006147	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	40	11.03	0.004259	±2.5	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	50	-14.46	-0.005583	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-30	-16.39	-0.006197	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-20	-10.86	-0.004106	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-10	13.03	0.004926	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	0	-12.56	-0.004749	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	10	-15.06	-0.005694	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	20	-12.75	-0.004820	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	30	11.84	0.004476	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	40	-19.86	-0.007509	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	50	23.66	0.008945	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	-30	-11.37	-0.004299	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	-20	-9.37	-0.003543	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	-10	2.16	0.000817	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	0	-10.96	-0.004144	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	10	-10.01	-0.003784	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	20	19.24	0.007274	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	30	-16.02	-0.006057	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	40	12.77	0.004828	±2.5	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	50	13.03	0.004926	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

