

	CTK Co., Ltd. (Ho-dong), 113, Yejik-ro, Cheoin-gu, Yongin-si, Gyeonggi-do, Korea Tel: +82-31-339-9970 Fax: +82-31-624-9501	Report No.: CTK-2017-01618-2 Page (89) / (282) Pages	
---	---	---	--

6. Spurious Emission at Antenna Terminal

§ 27.53 Emission limitations for Broadband PCS equipment

The rules in this section govern the spectral characteristics of emissions in the Broadband Personal Communications Service.

(a) Out of band emissions. The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least $43 + 10 \log(P)$ dB.

(b) Measurement procedure. Compliance with these rules is based on the use of measurement instrumentation employing a resolution bandwidth of 1 MHz or greater. However, in the 1 MHz bands immediately outside and adjacent to the frequency block a resolution bandwidth of at least one percent of the emission bandwidth of the fundamental emission of the transmitter may be employed. A narrower resolution bandwidth is permitted in all cases to improve measurement accuracy provided the measured power is integrated over the full required measurement bandwidth (i.e. 1 MHz or 1 percent of emission bandwidth, as specified). The emission bandwidth is defined as the width of the signal between two points, one below the carrier center frequency and one above the carrier center frequency, outside of which all emissions are attenuated at least 26 dB below the transmitter power.

§ 27.53 Emission limits

(h) AWS emission limits—(1) General protection levels. Except as otherwise specified below, for operations in the 1695-1710 MHz, 1710-1755 MHz, 1755-1780 MHz, 1915-1920 MHz, 1995-2000 MHz, 2000-2020 MHz, 2110-2155 MHz, 2155-2180 MHz, and 2180-2200 bands, the power of any emission outside a licensee's frequency block shall be attenuated below the transmitter power (P) in watts by at least $43 + 10 \log_{10}(P)$ dB.

(3) Measurement procedure. (i) Compliance with this provision is based on the use of measurement instrumentation employing a resolution bandwidth of 1 megahertz or greater. However, in the 1 megahertz bands immediately outside and adjacent to the licensee's frequency block, a resolution bandwidth of at least one percent of the emission bandwidth of the fundamental emission of the transmitter may be employed. The emission bandwidth is defined as the width of the signal between two points, one below the carrier center frequency and one above the carrier center frequency, outside of which all emissions are attenuated at least 26 dB below the transmitter power.

(ii) When measuring the emission limits, the nominal carrier frequency shall be adjusted as close to the licensee's frequency block edges, both upper and lower, as the design permits.

(iii) The measurements of emission power can be expressed in peak or average values, provided they are expressed in the same parameters as the transmitter power.



Test Procedures :

The RF Output of the transceiver was connected to a spectrum analyzer through appropriate attenuation.

The resolution bandwidth of the spectrum analyzer was set at 100 kHz(below 1 GHz), 1 MHz(Above 1 GHz). Sufficient scans were taken to show any out of band emissions up to 10th harmonic.

Notes :

1. In 9 kHz - 10 kHz and 150 kHz - 30 MHz bands, RBW was reduced to 1% and 10% of the reference bandwidth for measuring unwanted emission level(typically, 100 kHz if the authorized frequency band is below 1 GHz) and power was integrated.(1% = +20 dB, 10% = +10 dB)
2. Because the test results are similar trend value for each port, attached plots were only the worst test result.

Test port(Worst case)						
Band type	Bandwidth	Positions	Frequency	Power	Output port	Test Port
Band 2	10 MHz	Bottom	1935.0 MHz	60 W	2TX(5, 6)	Port 5
				40 W	4TX(5, 6, 7, 8)	Port 7
		Middle	1960.0 MHz	60 W	2TX(5, 6)	Port 5
				40 W	4TX(5, 6, 7, 8)	Port 7
		Top	1985.0 MHz	60 W	2TX(5, 6)	Port 5
				40 W	4TX(5, 6, 7, 8)	Port 7
	20 MHz	Bottom	1940.0 MHz	60 W	2TX(5, 6)	Port 5
				40 W	4TX(5, 6, 7, 8)	Port 7
		Middle	1960.0 MHz	60 W	2TX(5, 6)	Port 5
				40 W	4TX(5, 6, 7, 8)	Port 7
		Top	1980.0 MHz	60 W	2TX(5, 6)	Port 5
				40 W	4TX(5, 6, 7, 8)	Port 7

Test port(Worst case)									
Type	Bandwidth positions		1 st FA	2 nd FA	Power Sum	Output port	Test Port		
Band 2	Contiguous	Bottom	Bandwidth	5 MHz	10 MHz				
			Frequency	1932.5 MHz	1940.0 MHz				
			Output Power	20 W	40 W	60 W	2TX(5, 6)	Port 5	
					13 W	26 W	39 W	4TX(5, 6, 7, 8)	Port 7
		Top	Bandwidth	5 MHz	10 MHz				
			Frequency	1977.5 MHz	1985.0 MHz				
			Output Power	20 W	40 W	60 W	2TX(5, 6)	Port 5	
					13 W	26 W	39 W	4TX(5, 6, 7, 8)	Port 7
		Bottom	Bandwidth	10 MHz	10 MHz				
			Frequency	1935.0 MHz	1945.0 MHz				
			Output Power	30 W	30 W	60 W	2TX(5, 6)	Port 5	
					20 W	20 W	40 W	4TX(5, 6, 7, 8)	Port 7
	Top	Bandwidth	10 MHz	10 MHz					
		Frequency	1975.0 MHz	1985.0 MHz					
		Output Power	30 W	30 W	60 W	2TX(5, 6)	Port 5		
				20 W	20 W	40 W	4TX(5, 6, 7, 8)	Port 7	
	Non-Contiguous	Bottom + Top	Bandwidth	10 MHz	10 MHz				
			Frequency	1935.0 MHz	1985.0 MHz				
Output Power			30 W	30 W	60 W	2TX(5, 6)	Port 5		
				20 W	20 W	40 W	4TX(5, 6, 7, 8)	Port 7	
Bottom + Top		Bandwidth	10 MHz	5 MHz					
		Frequency	1935.0 MHz	1987.5 MHz					
	Output Power	40 W	20 W	60 W	2TX(5, 6)	Port 5			
			26 W	13 W	39 W	4TX(5, 6, 7, 8)	Port 7		




CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (91) / (282)
Pages

Spurious Emissions at antenna terminal

Band 2, BW 10MHz, Single 1 carrier, 2TX, Bottom
[QPSK]


9 kHz - 150 kHz

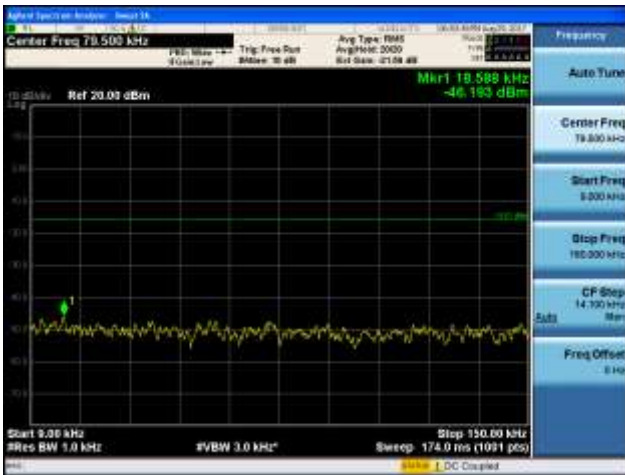

150 kHz - 30 MHz



30 MHz - 1000 MHz

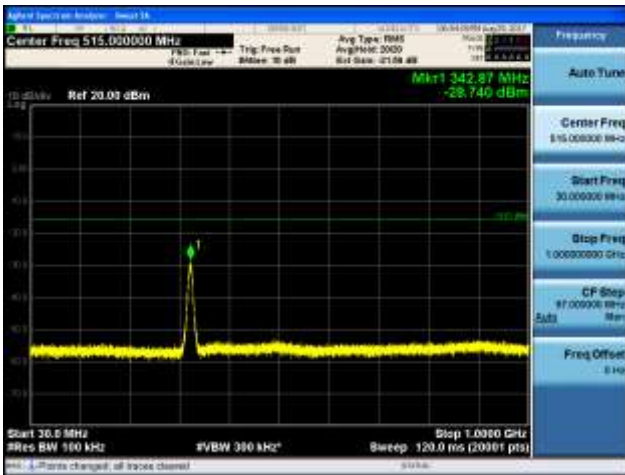

1000 MHz - 1919 MHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (92) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

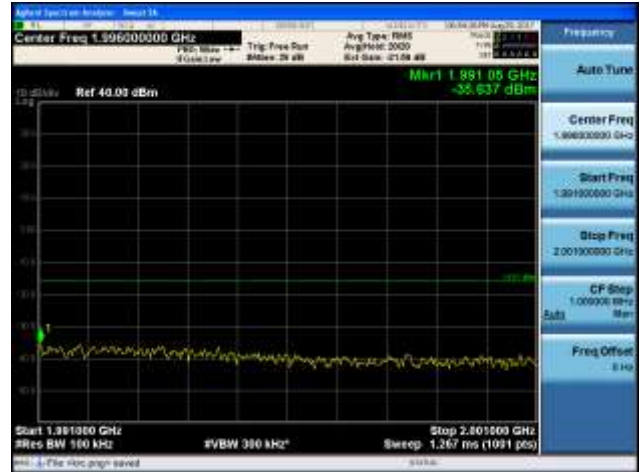

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (93) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz

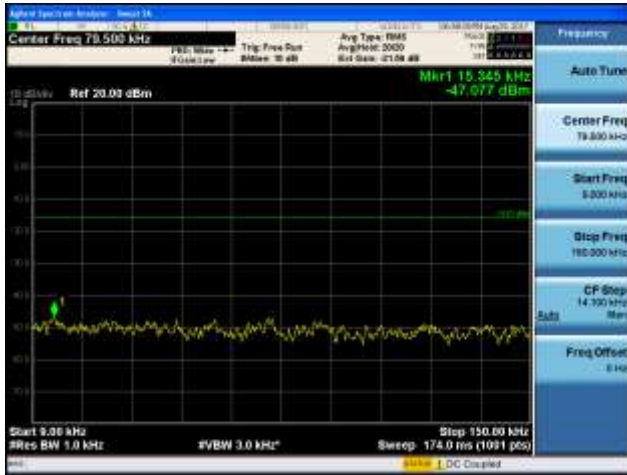


150 kHz - 30 MHz



30 MHz - 1000 MHz

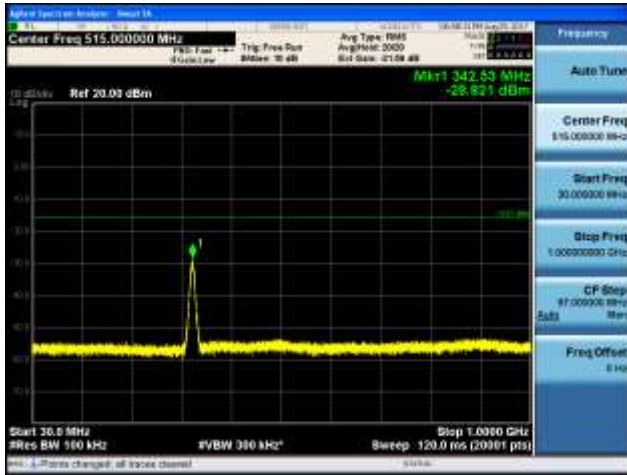

1000 MHz - 1919 MHz

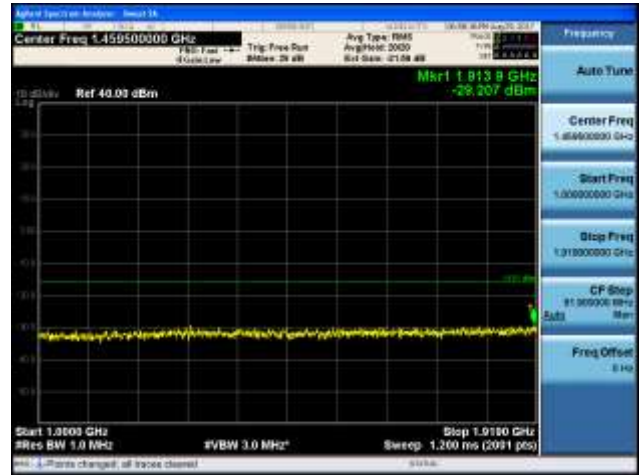




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (94) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

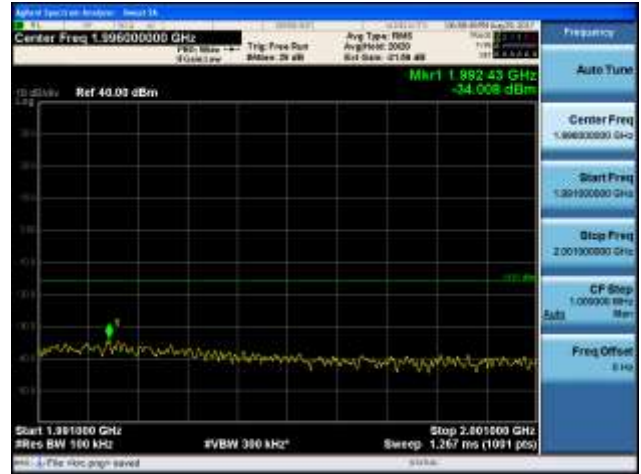

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (95) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz

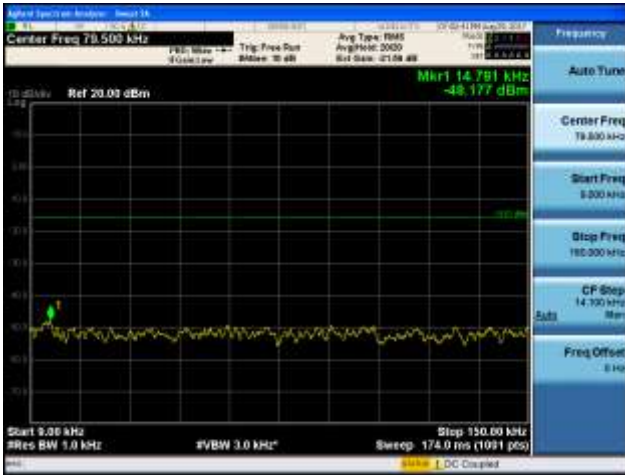

150 kHz - 30 MHz

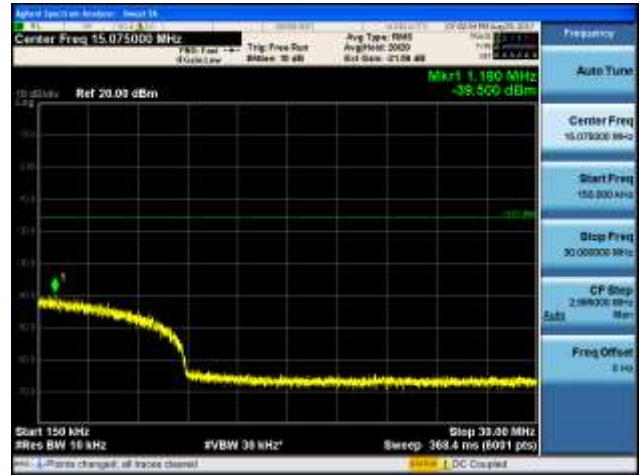

30 MHz - 1000 MHz

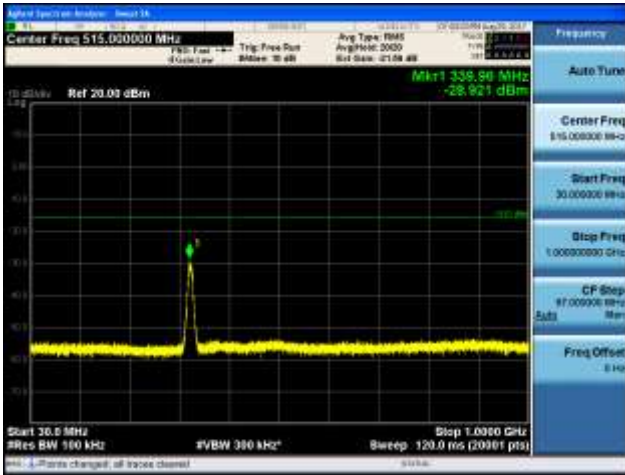

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (96) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (97) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

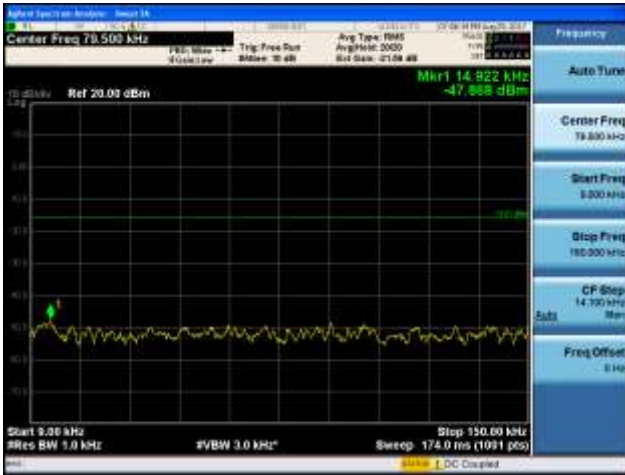


150 kHz - 30 MHz

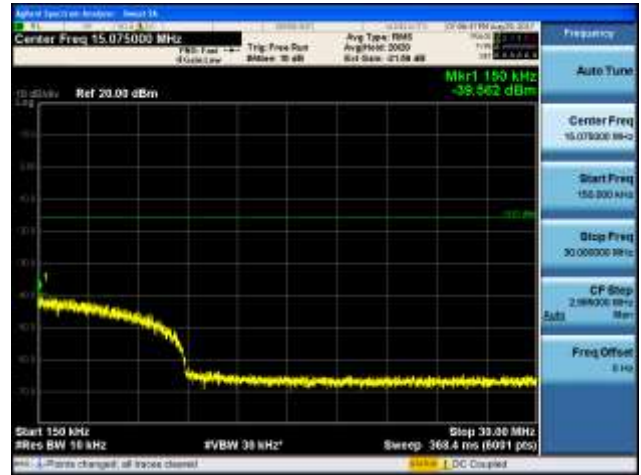

30 MHz - 1000 MHz

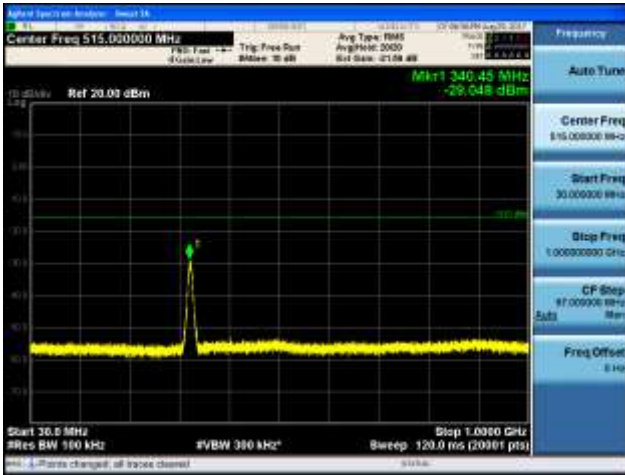

1000 MHz - 1919 MHz

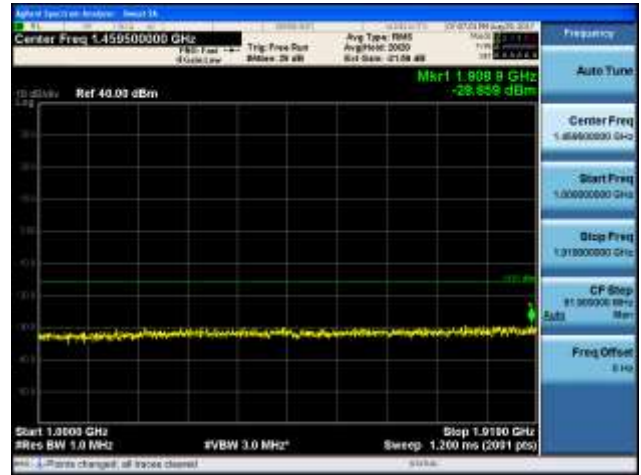



CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (98) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (99) / (282)
 Pages

Band 2, BW 10MHz, Single 1 carrier, 2TX, Middle
 [QPSK]


9 kHz - 150 kHz




150 kHz - 30 MHz

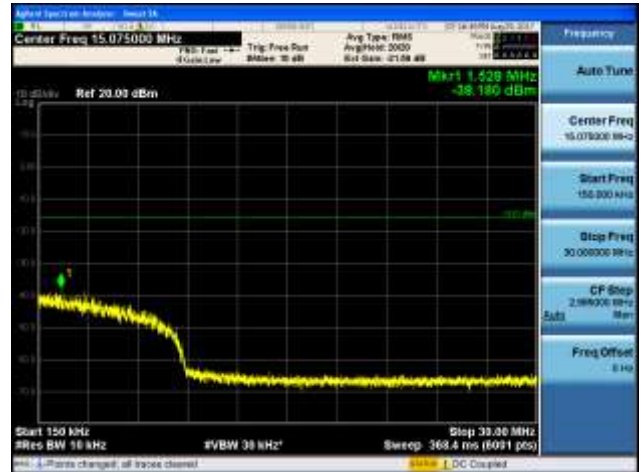

30 MHz - 1000 MHz

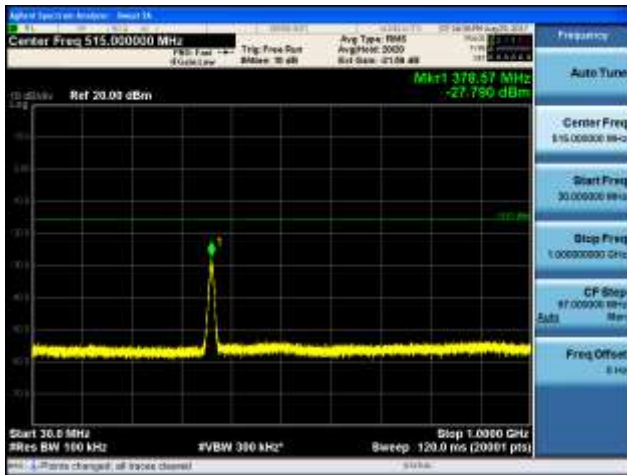

1000 MHz - 1919 MHz

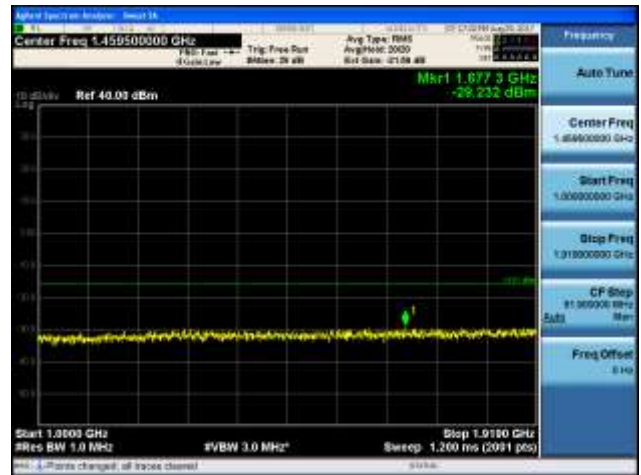





CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (100) / (282)
Pages

1919 MHz - 1929 MHz

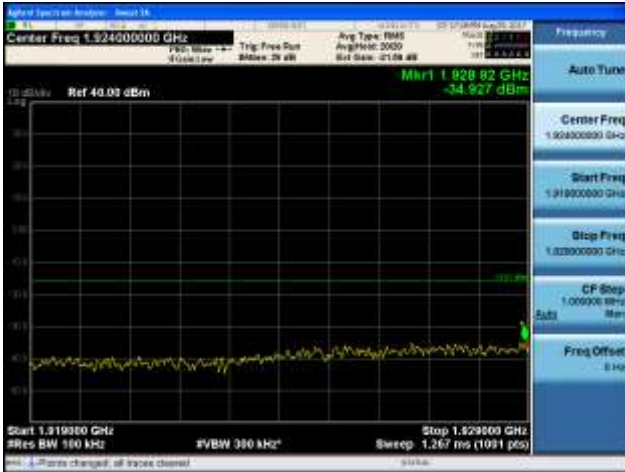

1991 MHz - 2001 MHz

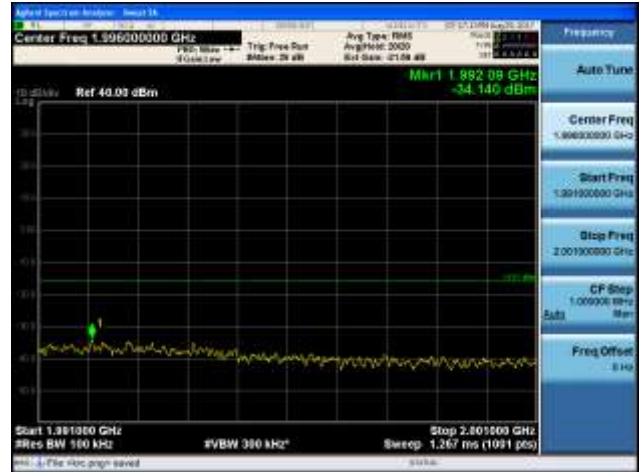

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (101) / (282)
Pages

[16QAM]


9 kHz - 150 kHz




150 kHz - 30 MHz



30 MHz - 1000 MHz

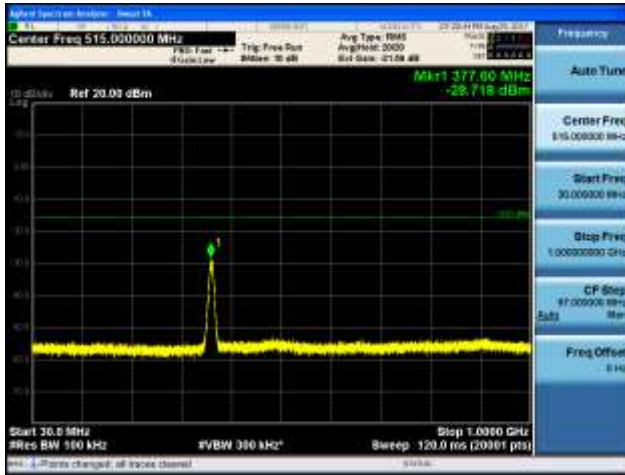

1000 MHz - 1919 MHz

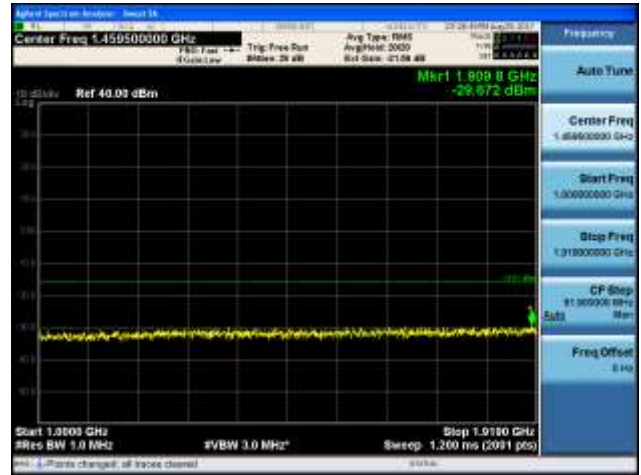




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (102) / (282)
 Pages

1919 MHz - 1929 MHz

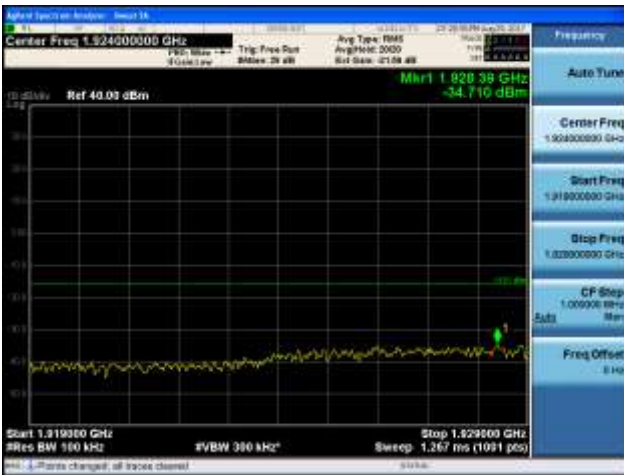

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (103) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz

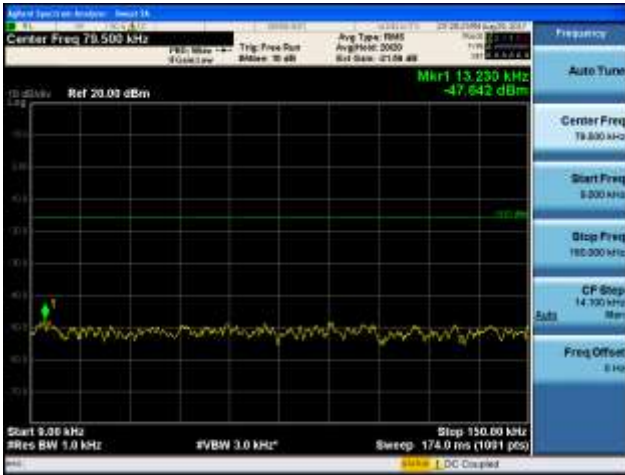


150 kHz - 30 MHz

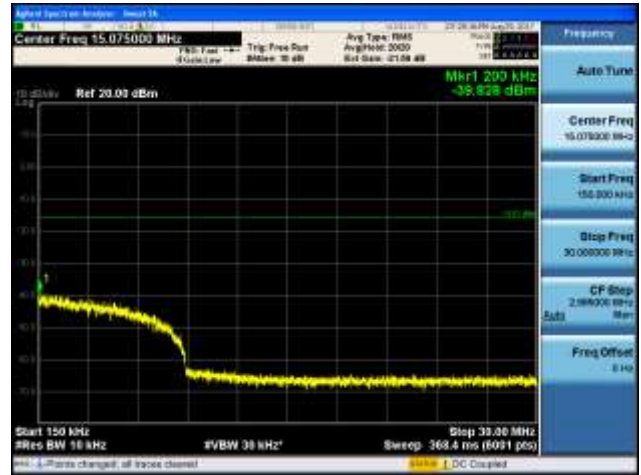

30 MHz - 1000 MHz

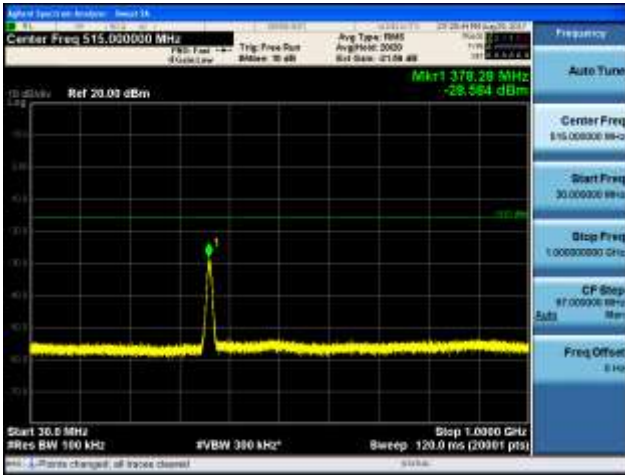

1000 MHz - 1919 MHz

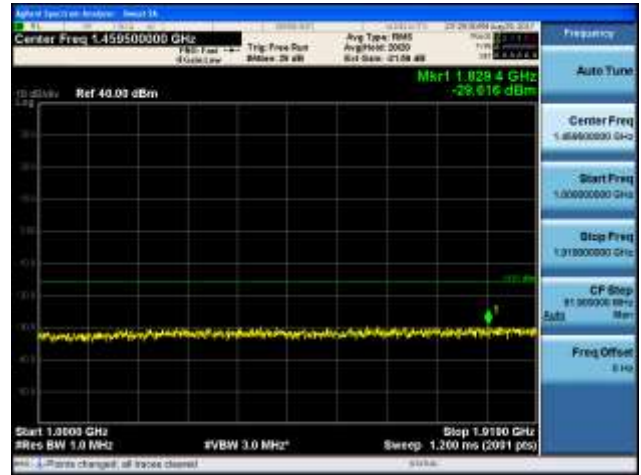



CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (104) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (105) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz




150 kHz - 30 MHz

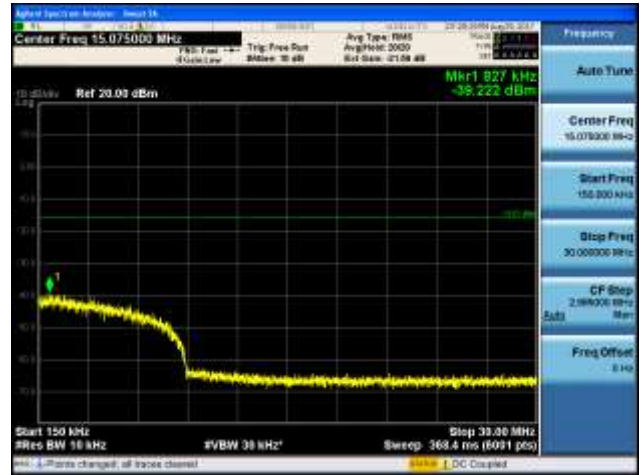

30 MHz - 1000 MHz

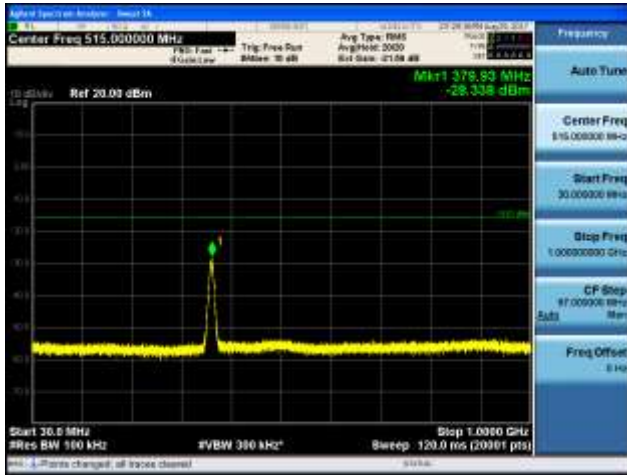

1000 MHz - 1919 MHz

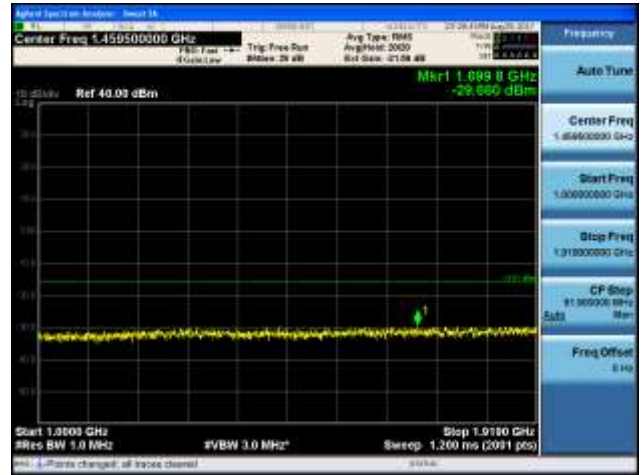





CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (106) / (282)
Pages

1919 MHz - 1929 MHz

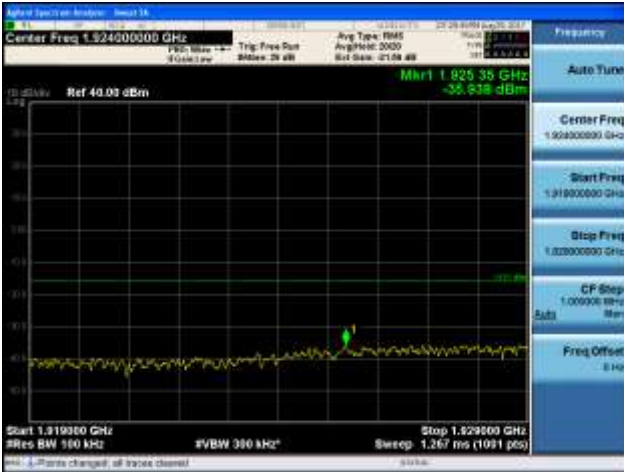

1991 MHz - 2001 MHz

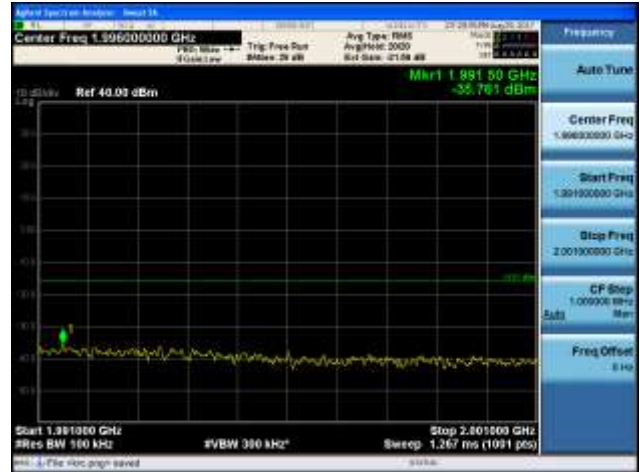

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (107) / (282)
 Pages

Band 2, BW 10MHz, Single 1 carrier, 2TX, Top
 [QPSK]


9 kHz - 150 kHz




150 kHz - 30 MHz



30 MHz - 1000 MHz

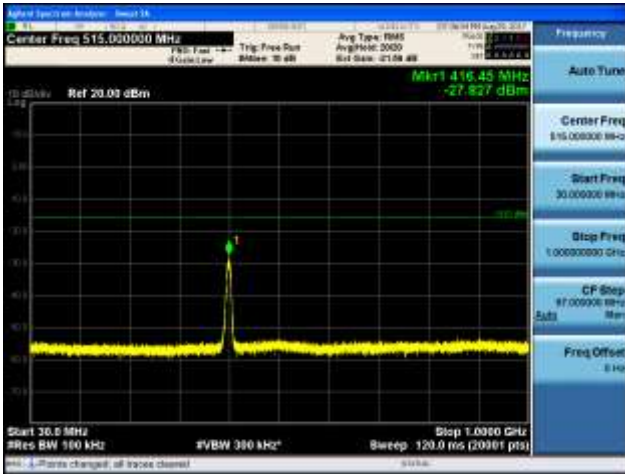

1000 MHz - 1919 MHz

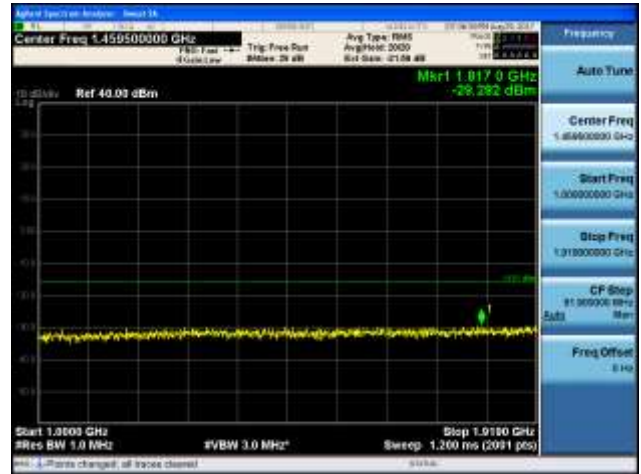




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (108) / (282)
 Pages

1919 MHz - 1929 MHz

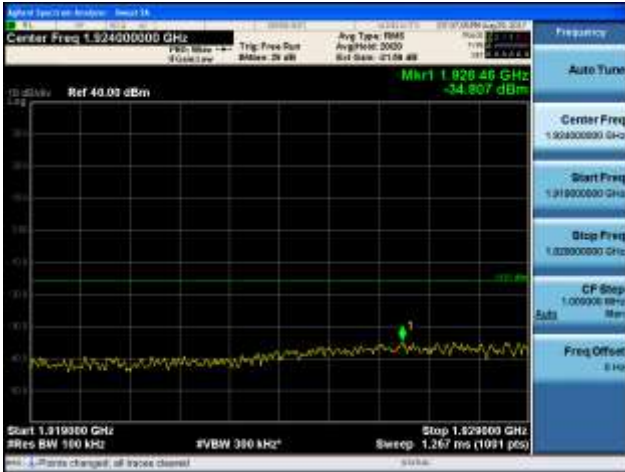

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (109) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz




150 kHz - 30 MHz

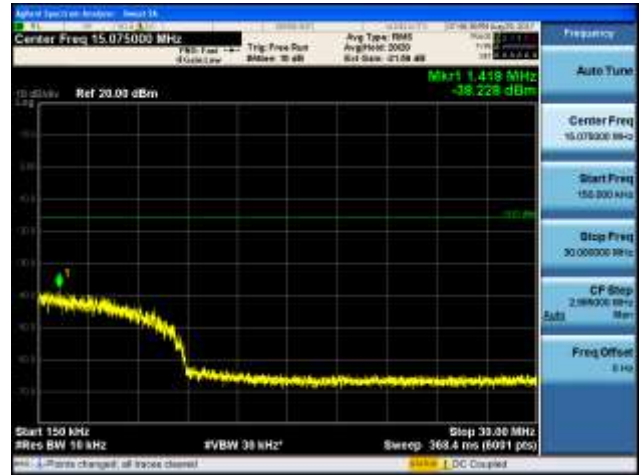

30 MHz - 1000 MHz

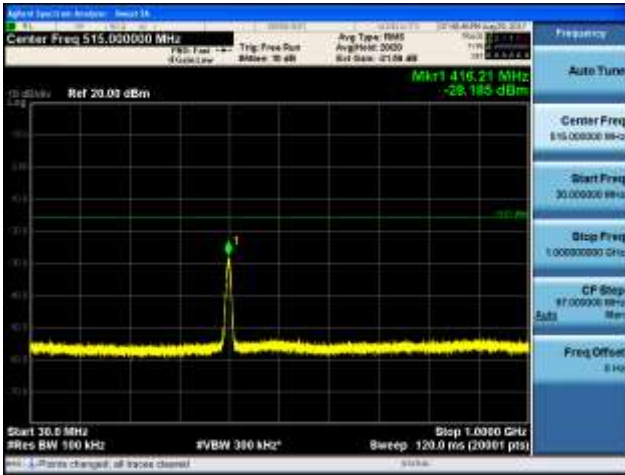

1000 MHz - 1919 MHz

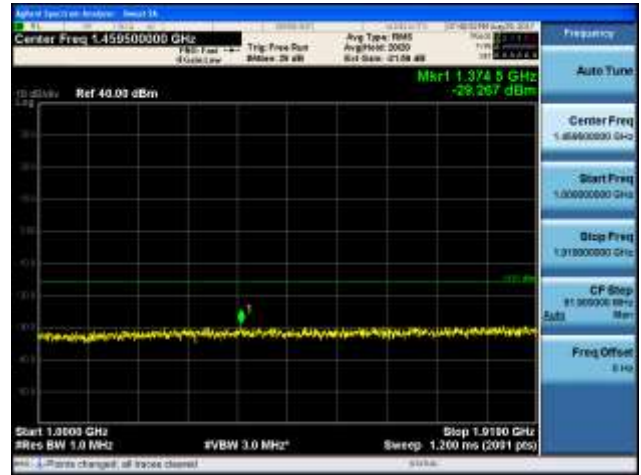




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (110) / (282)
 Pages

1919 MHz - 1929 MHz

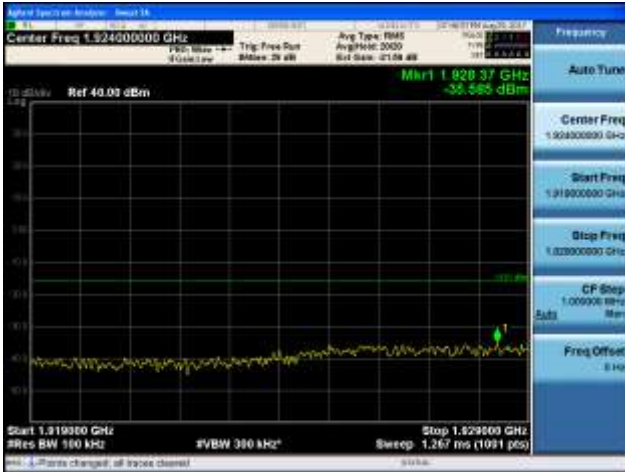

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (111) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz

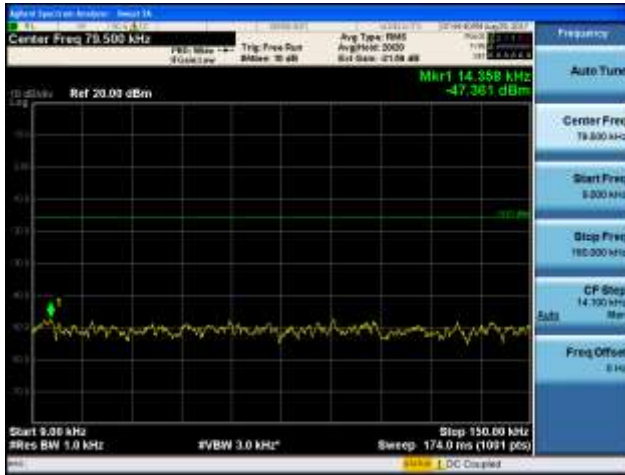


150 kHz - 30 MHz

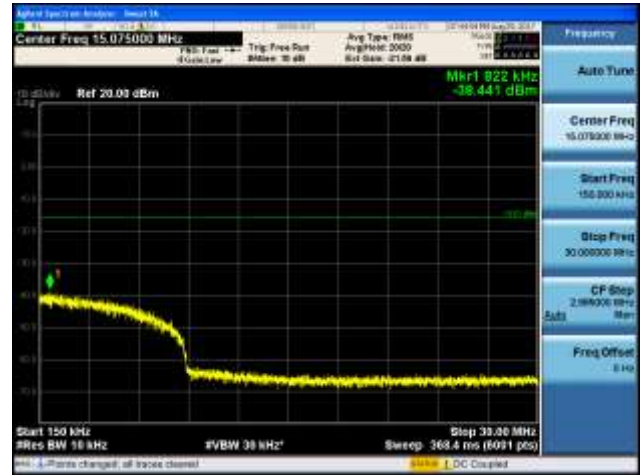

30 MHz - 1000 MHz

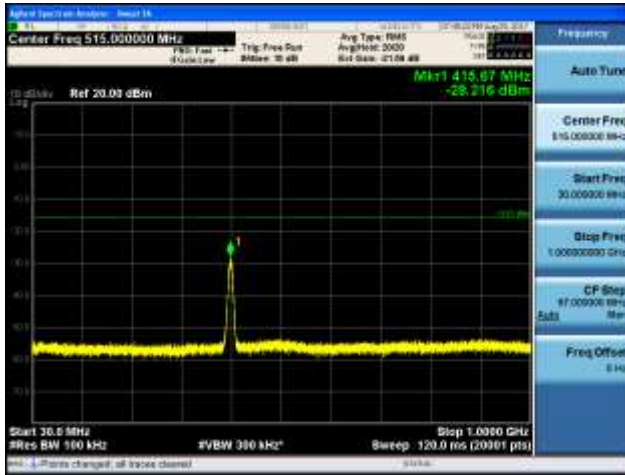

1000 MHz - 1919 MHz

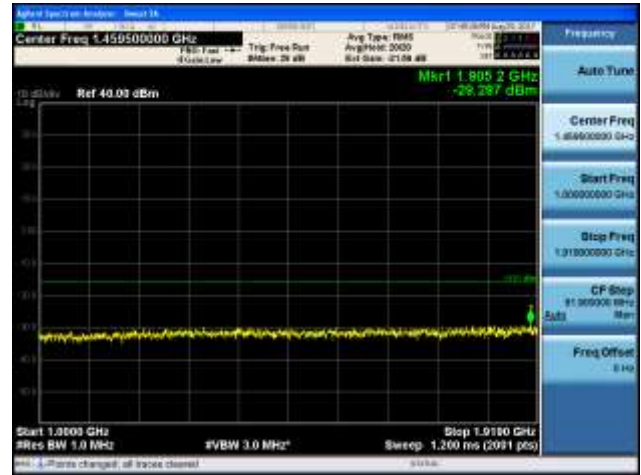




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (112) / (282)
 Pages

1919 MHz - 1929 MHz

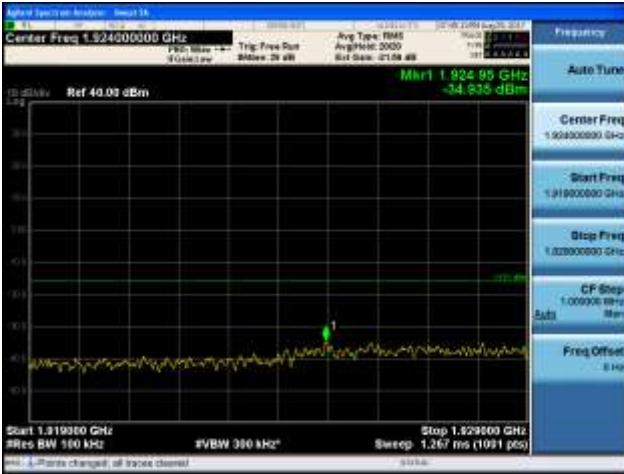

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (113) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

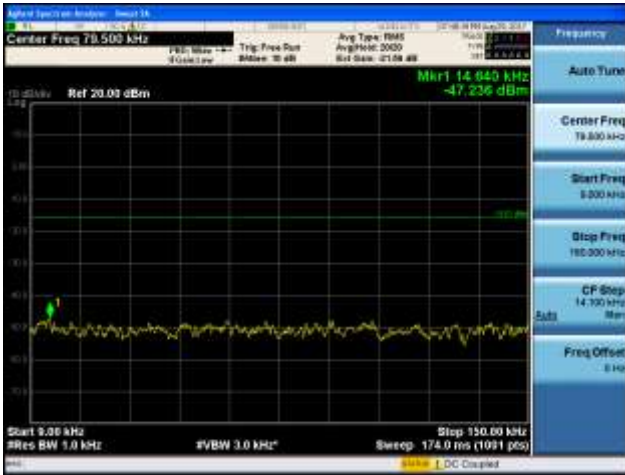


150 kHz - 30 MHz



30 MHz - 1000 MHz

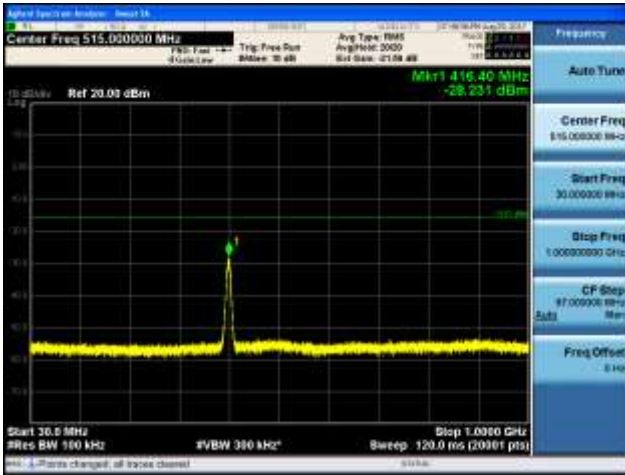

1000 MHz - 1919 MHz

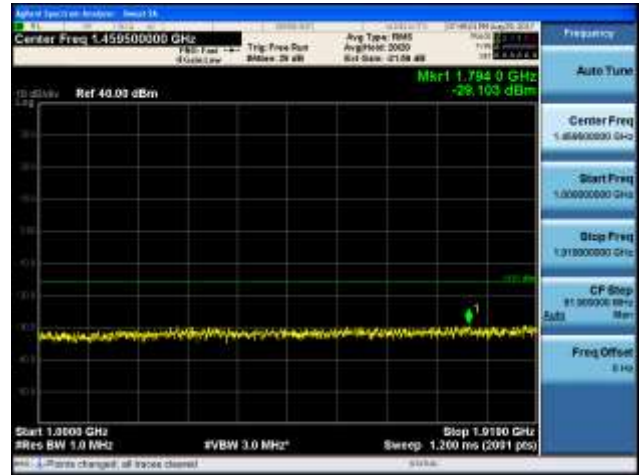




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (114) / (282)
 Pages

1919 MHz - 1929 MHz

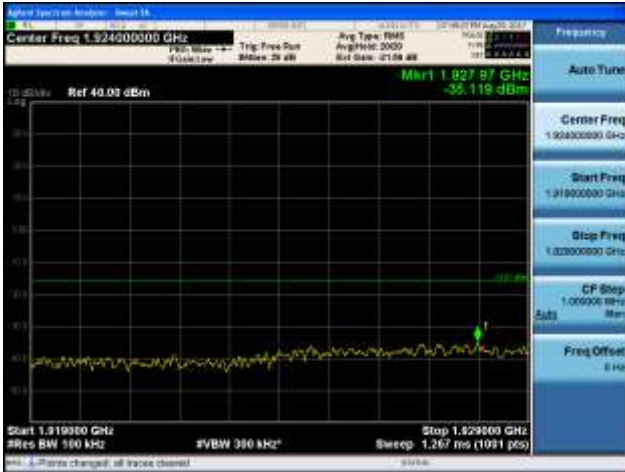

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz




12.75 GHz - 26.5 GHz




Band 2, BW 10MHz, Single 1 carrier, 4TX, Bottom
[QPSK]


9 kHz - 150 kHz

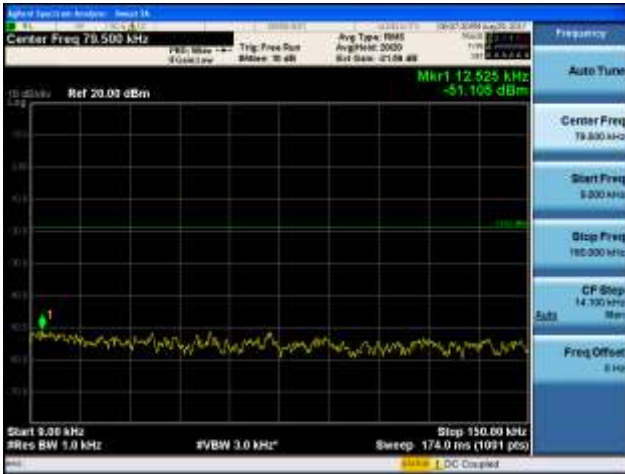


150 kHz - 30 MHz

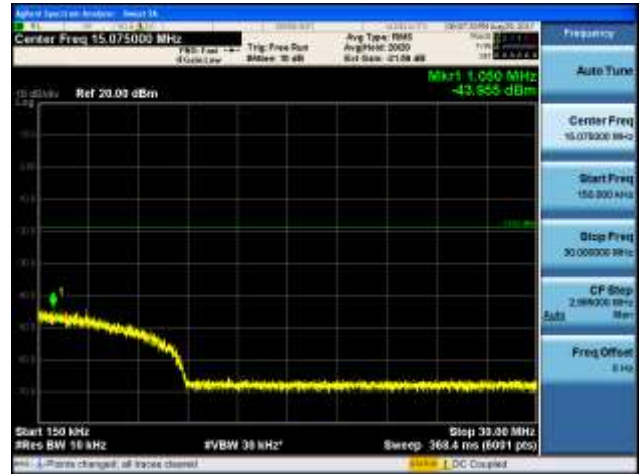

30 MHz - 1000 MHz

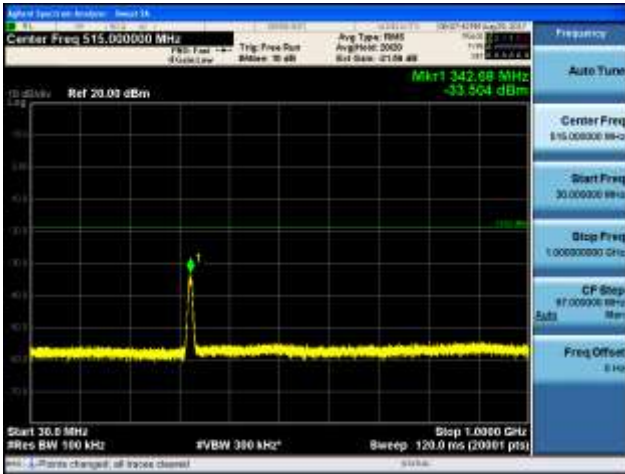

1000 MHz - 1919 MHz

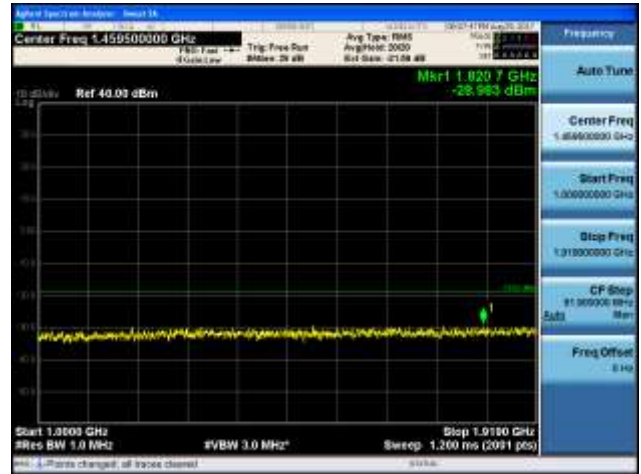




CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (116) / (282)
Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

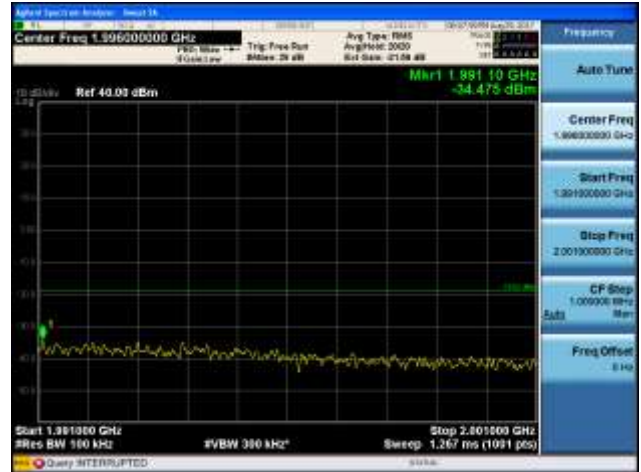

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (117) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz




150 kHz - 30 MHz



30 MHz - 1000 MHz

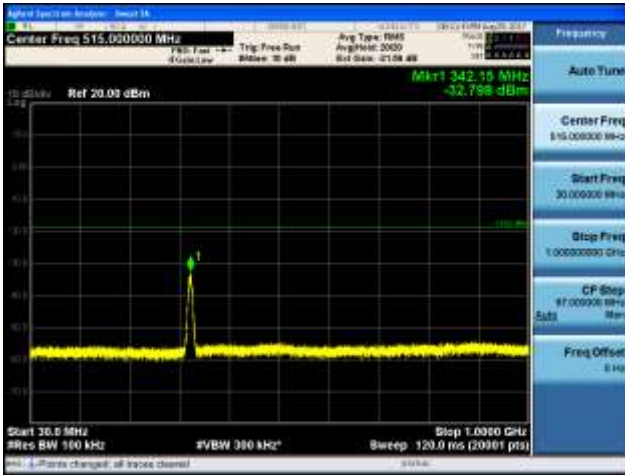

1000 MHz - 1919 MHz

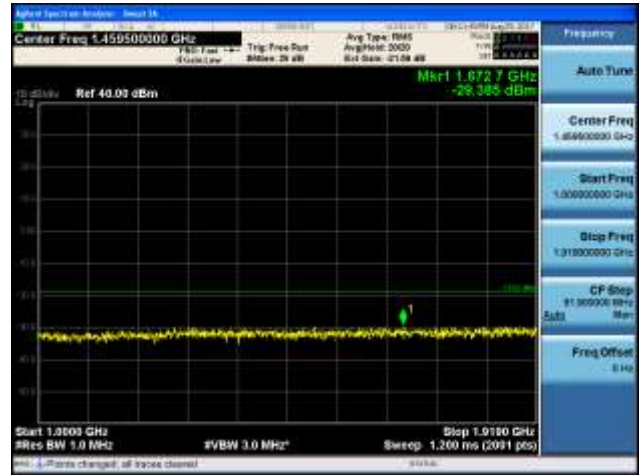




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (118) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

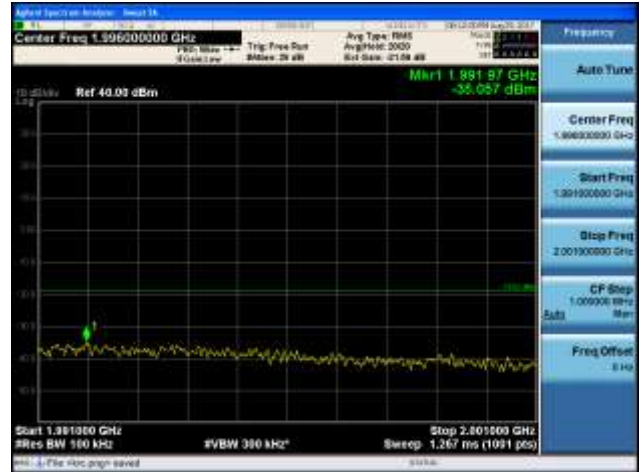

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (119) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz

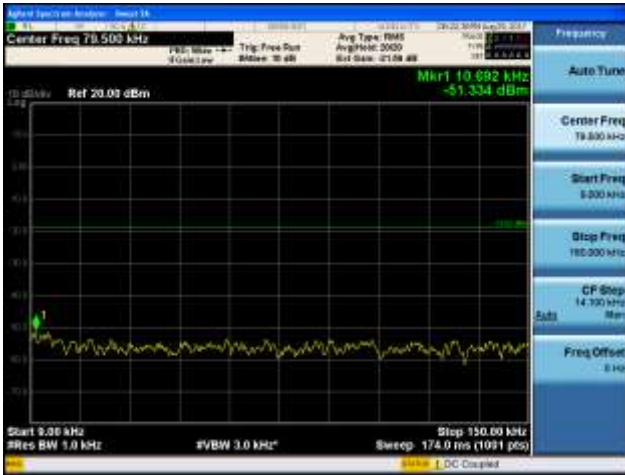

150 kHz - 30 MHz

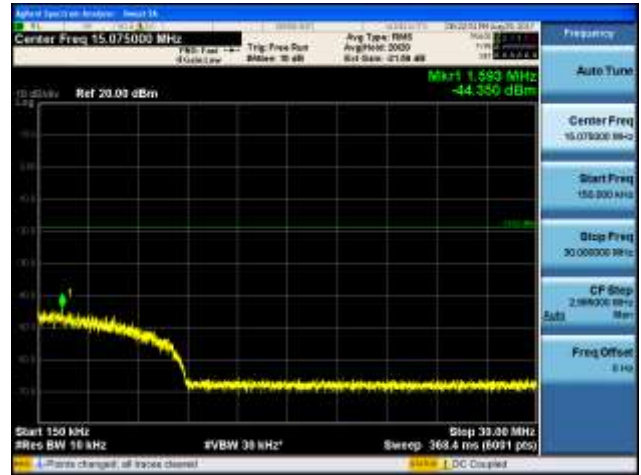

30 MHz - 1000 MHz

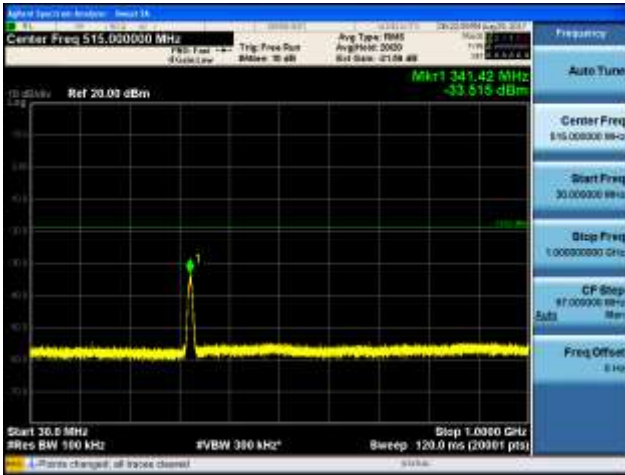

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (120) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (121) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

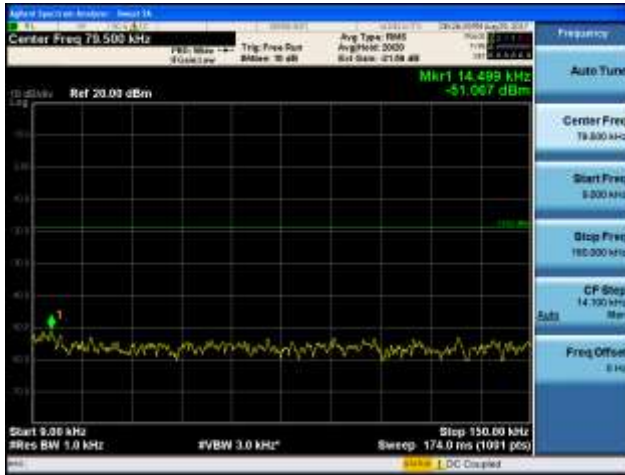

150 kHz - 30 MHz



30 MHz - 1000 MHz

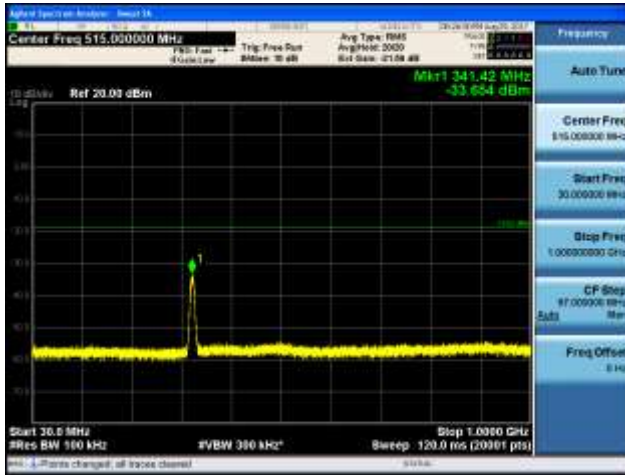

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (122) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (123) / (282)
 Pages

Band 2, BW 10MHz, Single carrier, 4TX, Middle
 [QPSK]


9 kHz - 150 kHz

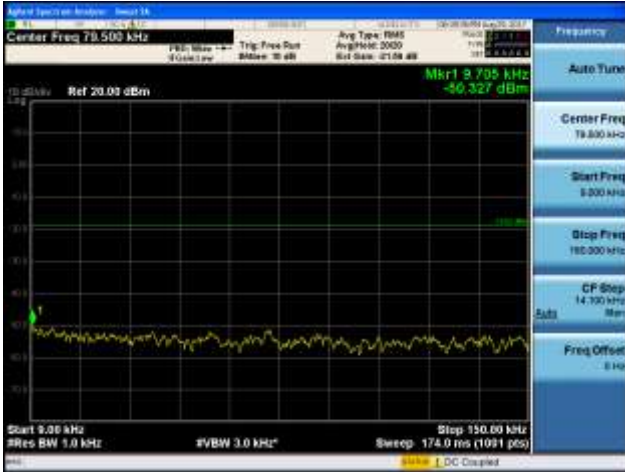

150 kHz - 30 MHz



30 MHz - 1000 MHz

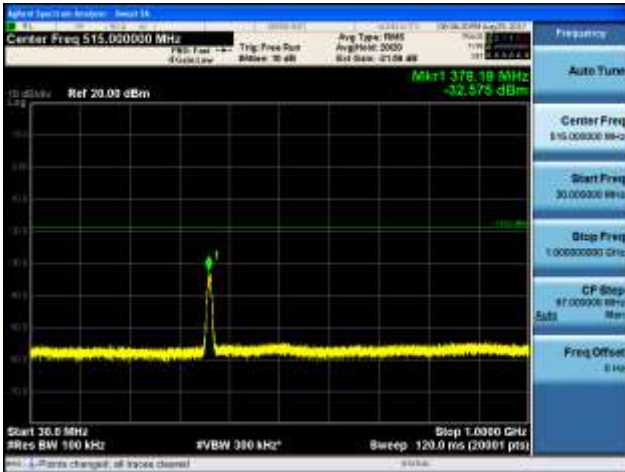

1000 MHz - 1919 MHz







CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (124) / (282)
 Pages

1919 MHz - 1929 MHz

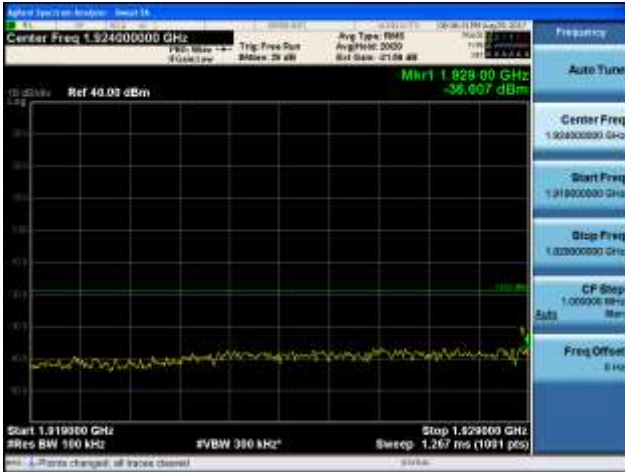


1991 MHz - 2001 MHz

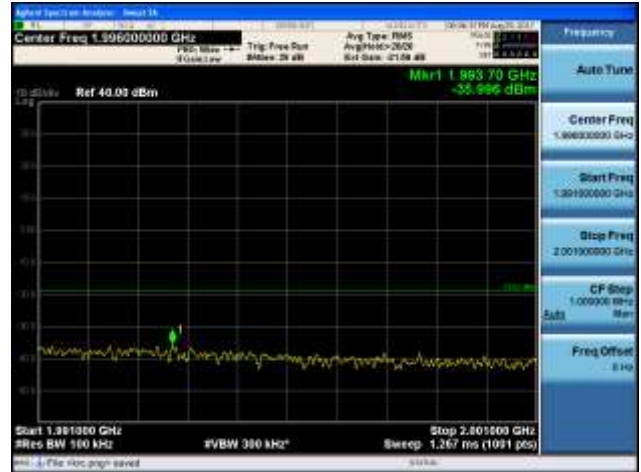

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz

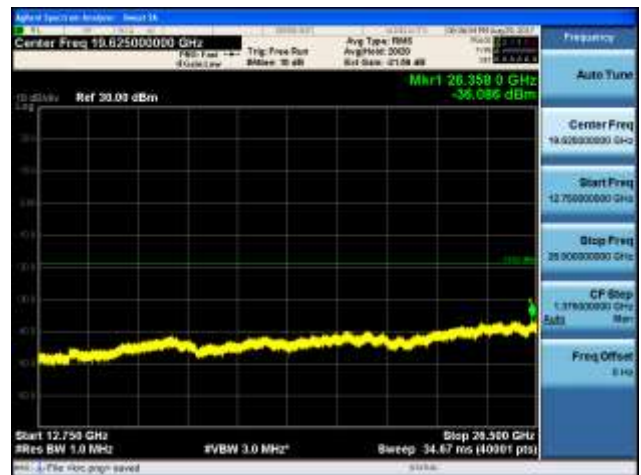




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (125) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz

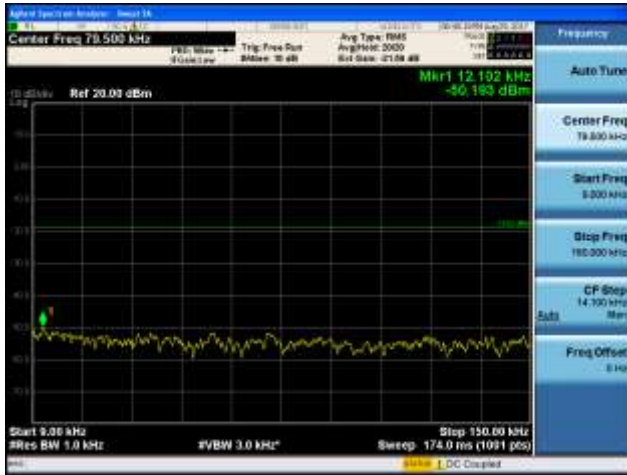

150 kHz - 30 MHz



30 MHz - 1000 MHz

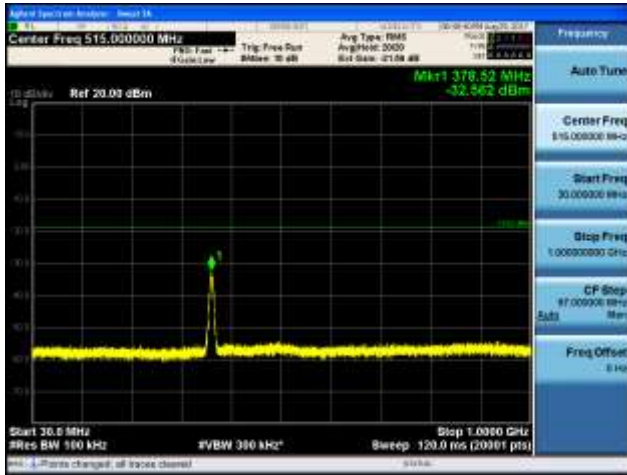

1000 MHz - 1919 MHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (126) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

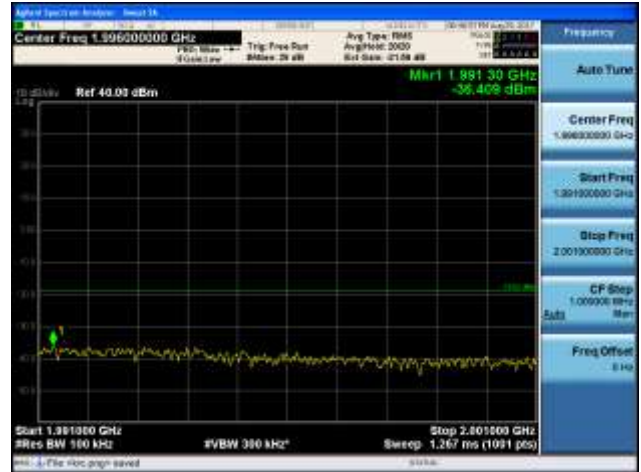

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (127) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz



150 kHz - 30 MHz

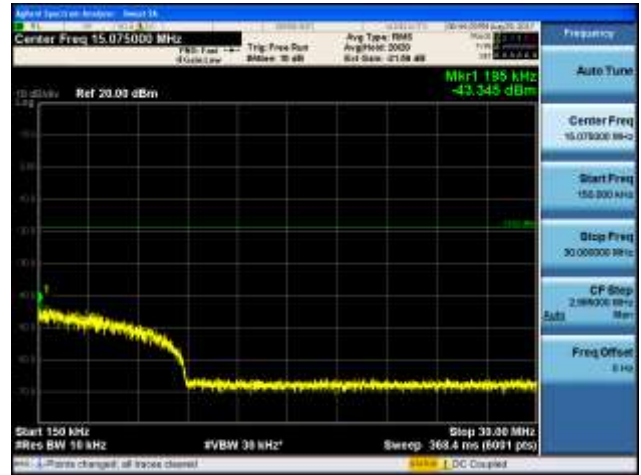

30 MHz - 1000 MHz

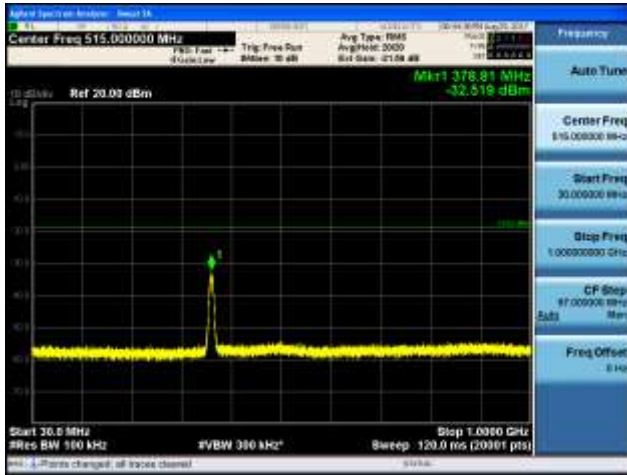

1000 MHz - 1919 MHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (128) / (282)
 Pages

1919 MHz - 1929 MHz

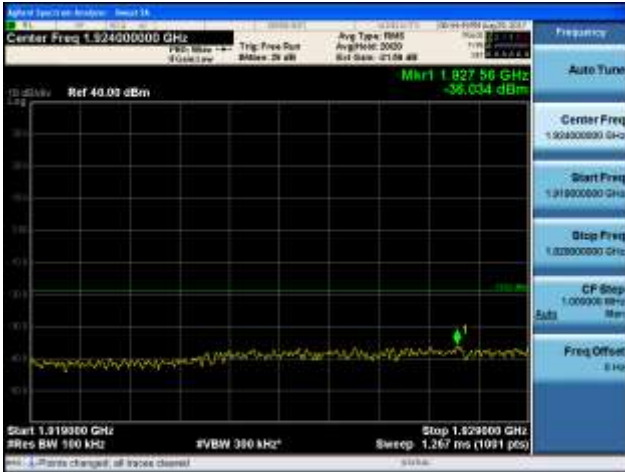

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (129) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

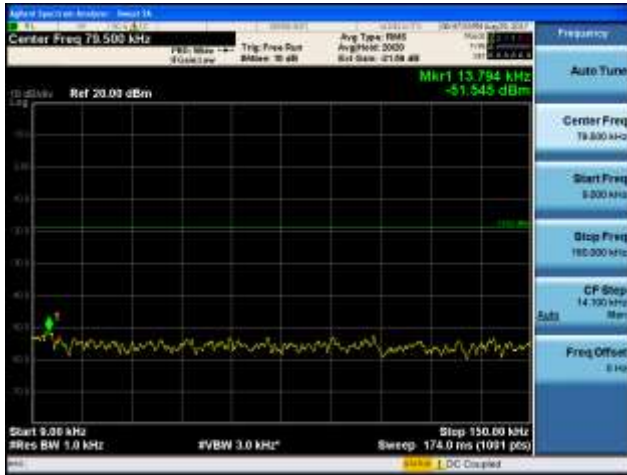


150 kHz - 30 MHz



30 MHz - 1000 MHz

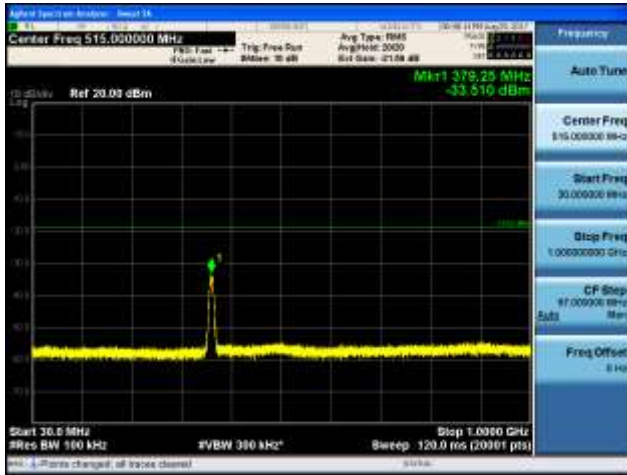

1000 MHz - 1919 MHz

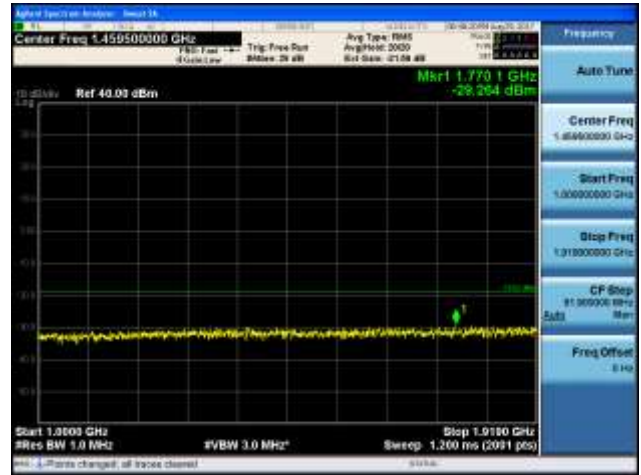



CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (130) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz




12.75 GHz - 26.5 GHz




Band 2, BW 10MHz, Single 1 carrier, 4TX, Top
[QPSK]


9 kHz - 150 kHz

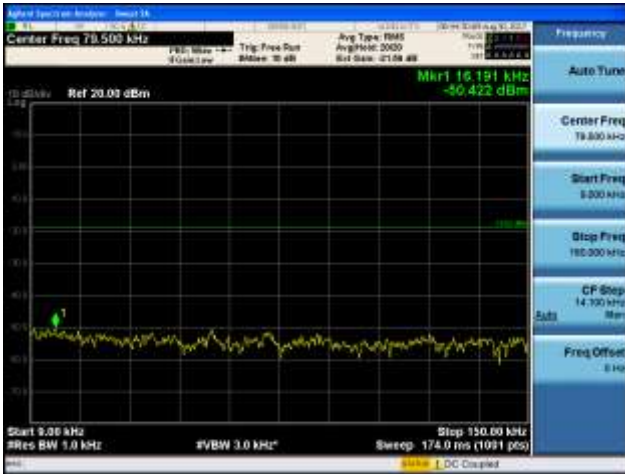


150 kHz - 30 MHz

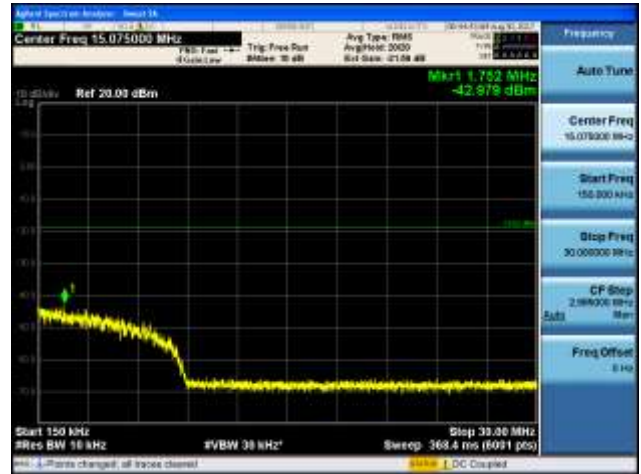

30 MHz - 1000 MHz

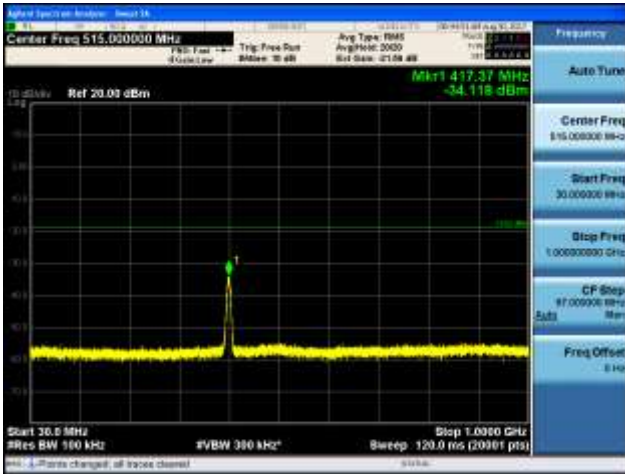

1000 MHz - 1919 MHz

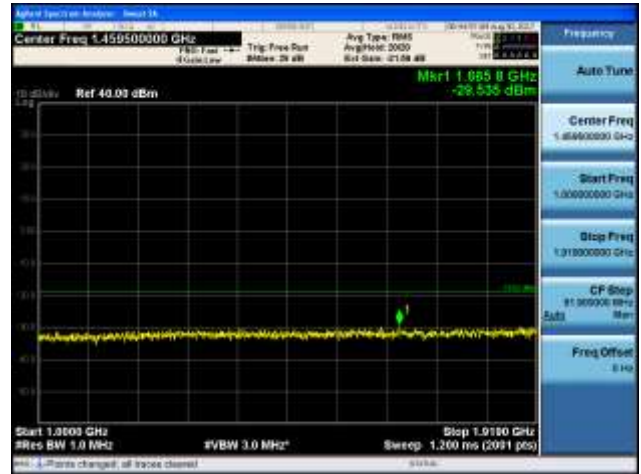




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (132) / (282)
 Pages

1919 MHz - 1929 MHz

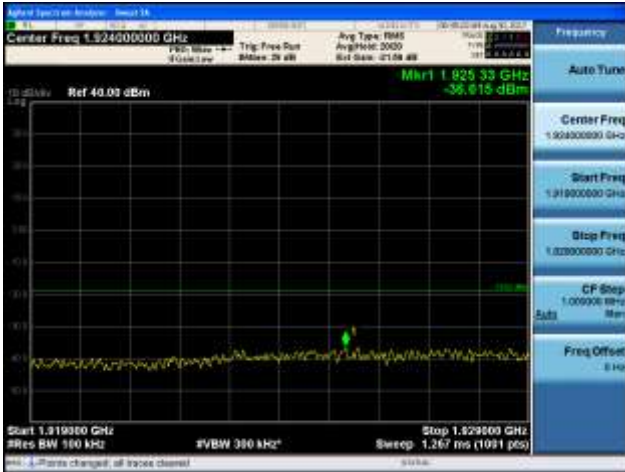


1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz

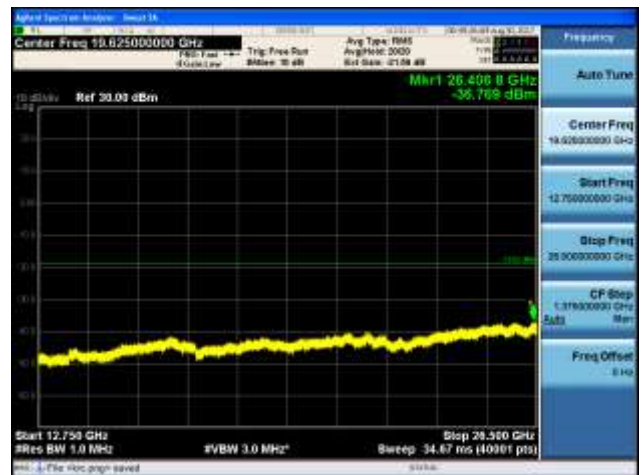




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (133) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz

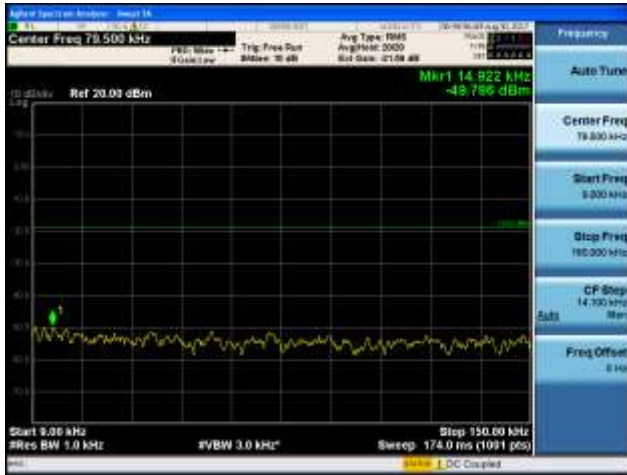

150 kHz - 30 MHz



30 MHz - 1000 MHz

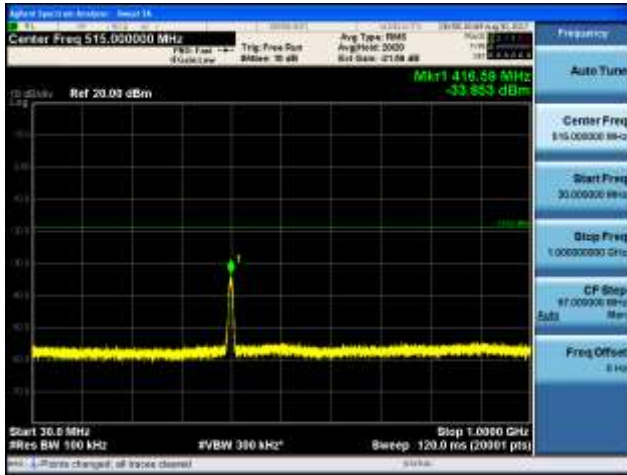

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (134) / (282)
 Pages

1919 MHz - 1929 MHz

Z



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (135) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz

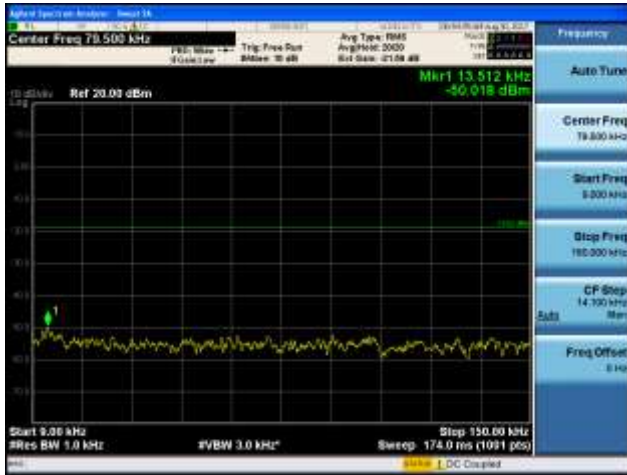

150 kHz - 30 MHz

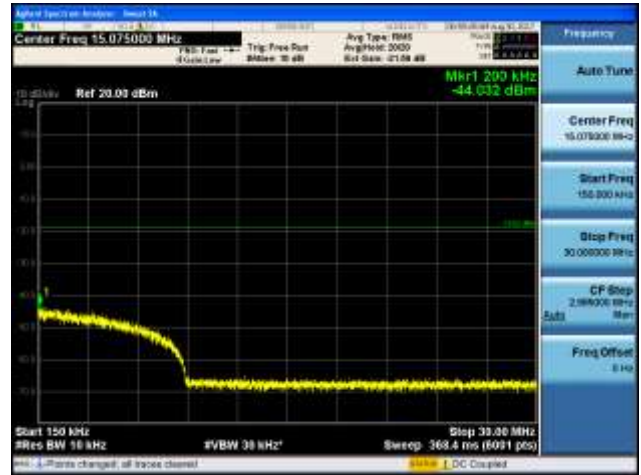

30 MHz - 1000 MHz

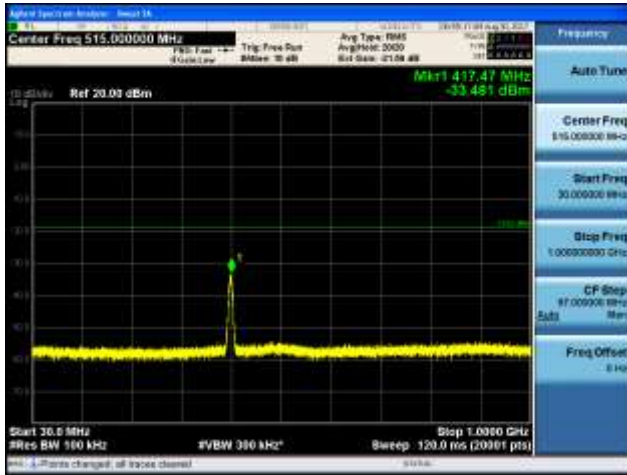

1000 MHz - 1919 MHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (136) / (282)
 Pages

1919 MHz - 1929 MHz

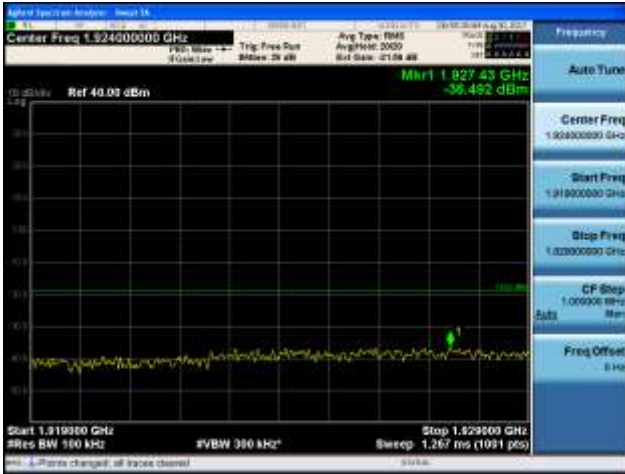

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (137) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

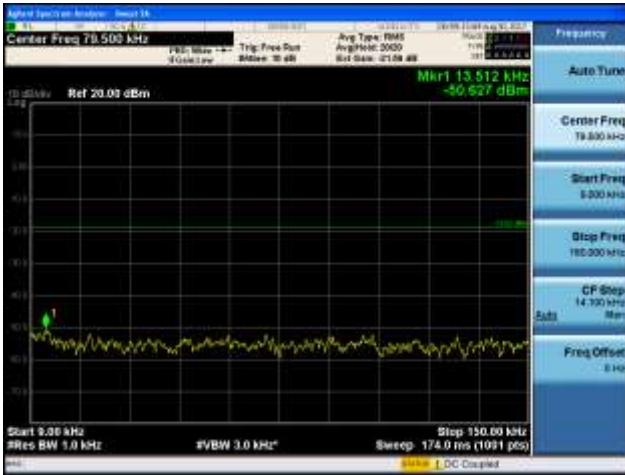

150 kHz - 30 MHz

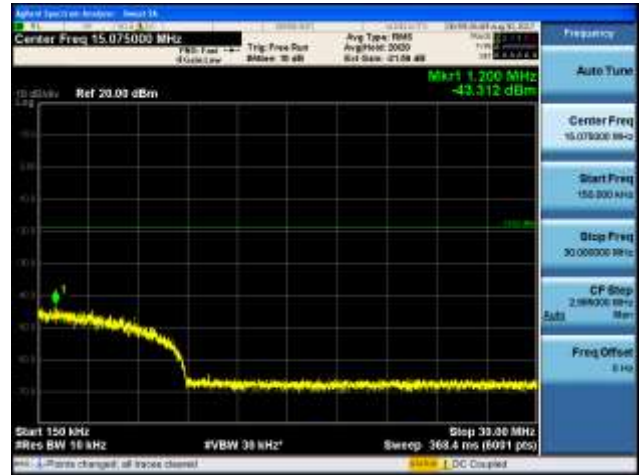

30 MHz - 1000 MHz

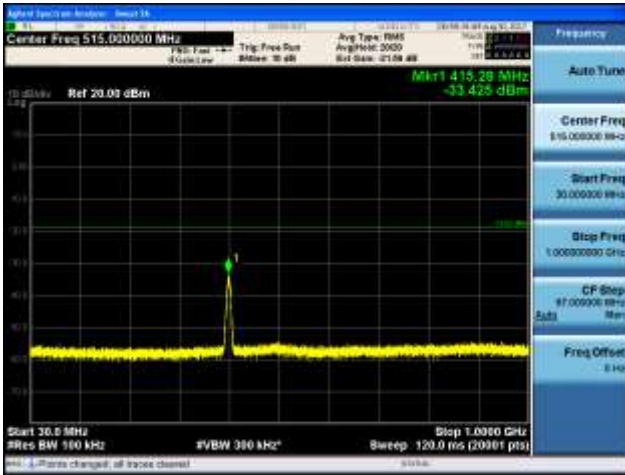

1000 MHz - 1919 MHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (138) / (282)
 Pages

1919 MHz - 1929 MHz

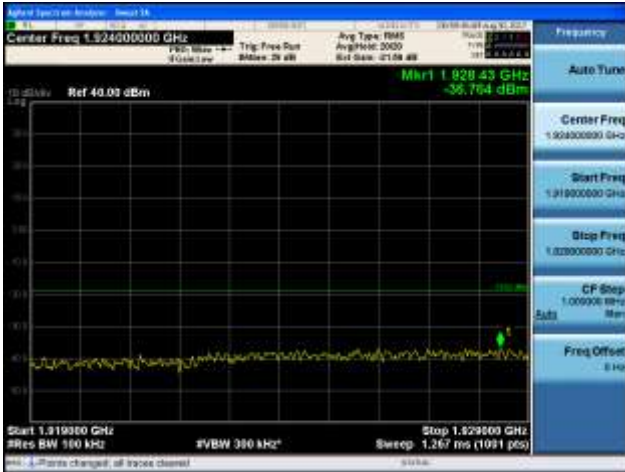

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (139) / (282)
 Pages

Band 2, BW 20MHz, Single 1 carrier, 2TX, Bottom
 [QPSK]


9 kHz - 150 kHz



150 kHz - 30 MHz



30 MHz - 1000 MHz

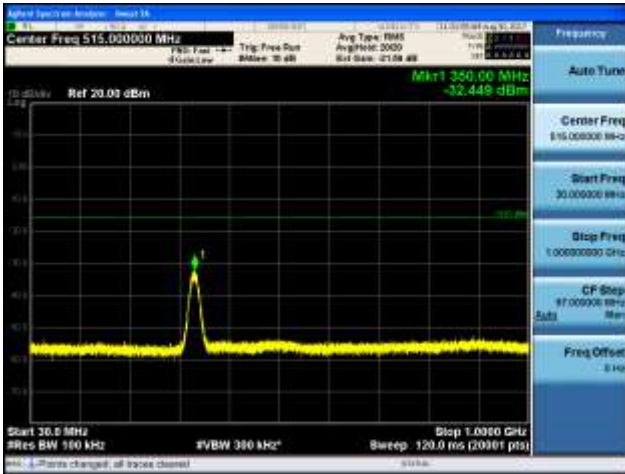

1000 MHz - 1919 MHz





CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (140) / (282)
Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


Report No.:
CTK-2017-01618-2
Page (141) / (282)
Pages

[16QAM]


9 kHz - 150 kHz

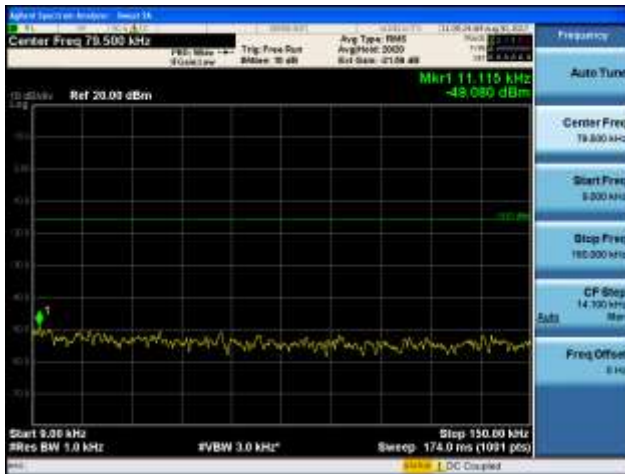


150 kHz - 30 MHz

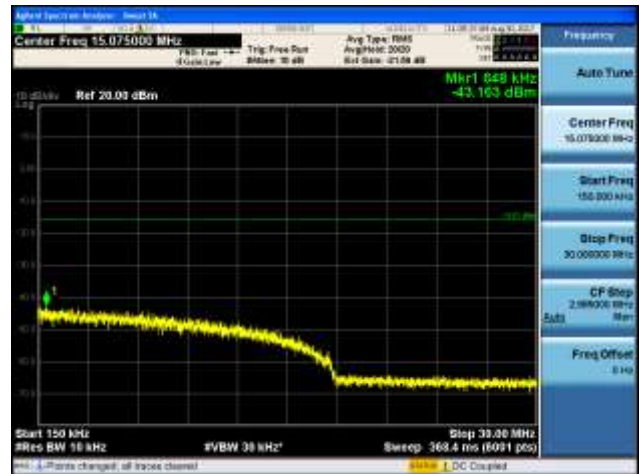

30 MHz - 1000 MHz

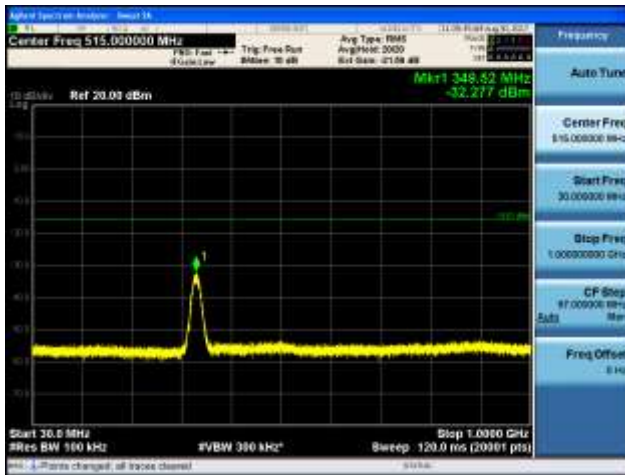

1000 MHz - 1919 MHz

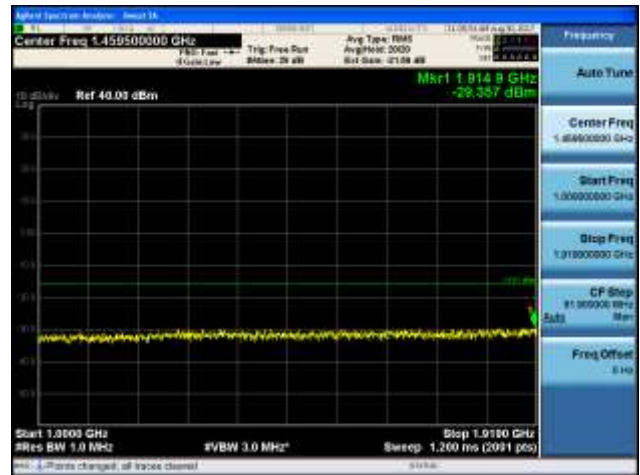



CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (142) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (143) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz

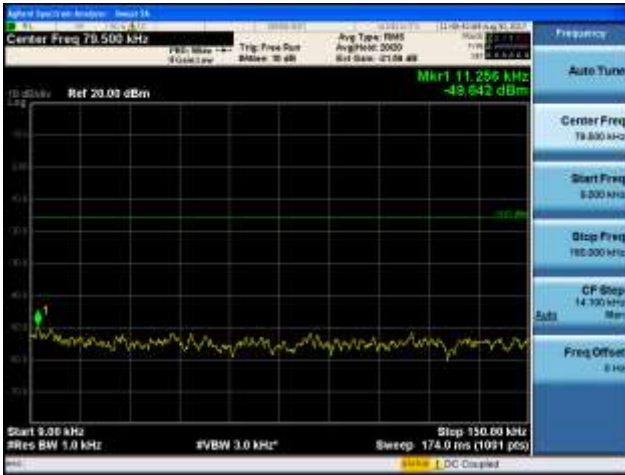

150 kHz - 30 MHz



30 MHz - 1000 MHz

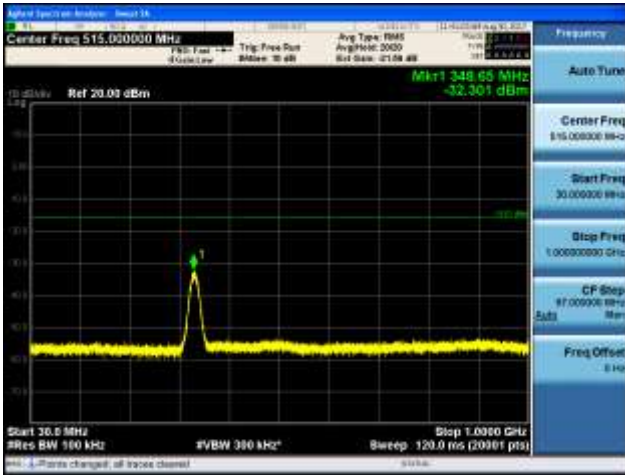

1000 MHz - 1919 MHz






CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (144) / (282)
Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

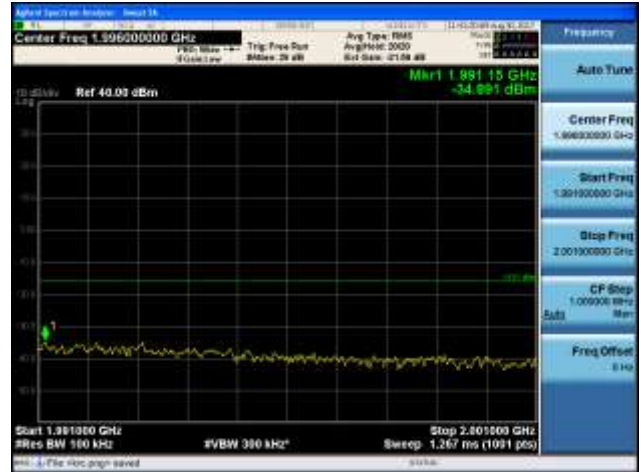

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (145) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

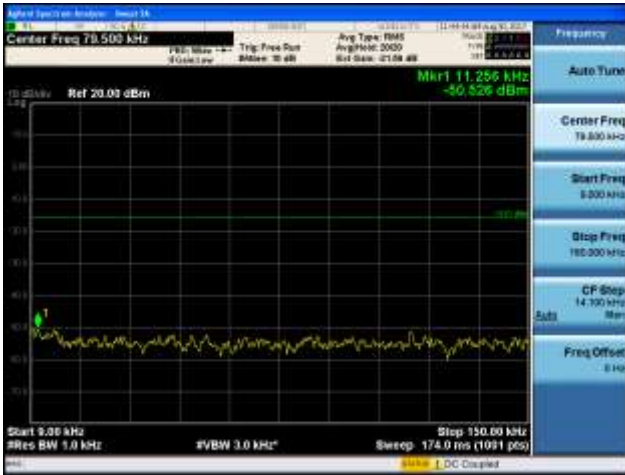

150 kHz - 30 MHz



30 MHz - 1000 MHz

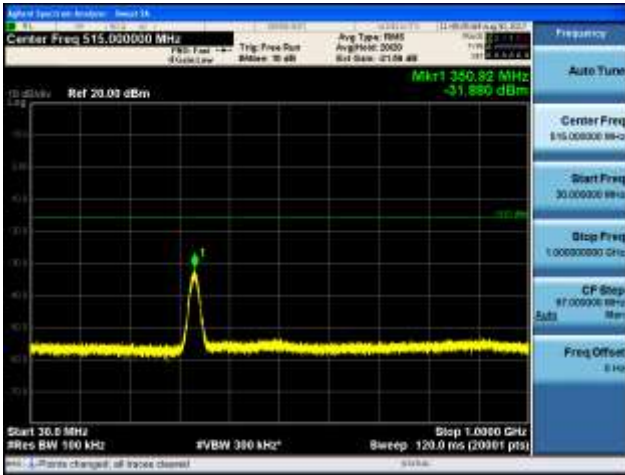

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (146) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz




Band 2, BW 20MHz, Single 1 carrier, 2TX, Middle
 [QPSK]


9 kHz - 150 kHz



150 kHz - 30 MHz

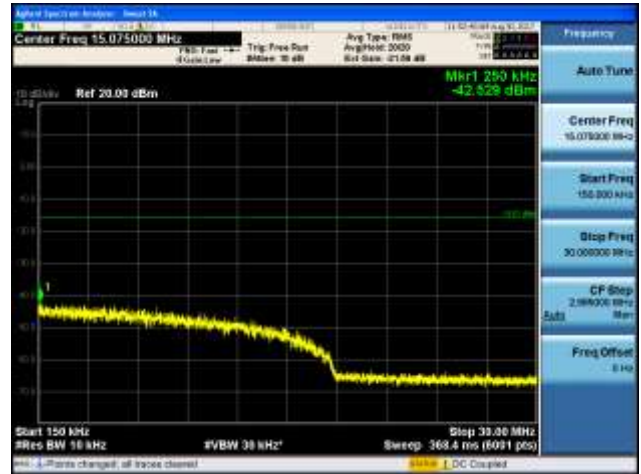

30 MHz - 1000 MHz

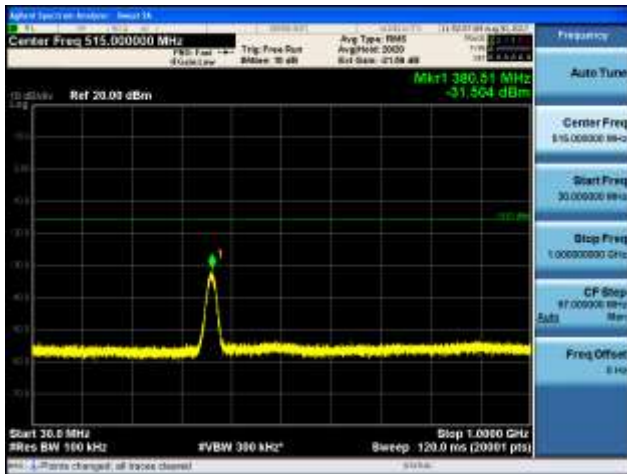

1000 MHz - 1919 MHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (148) / (282)
 Pages

1919 MHz - 1929 MHz




1991 MHz - 2001 MHz

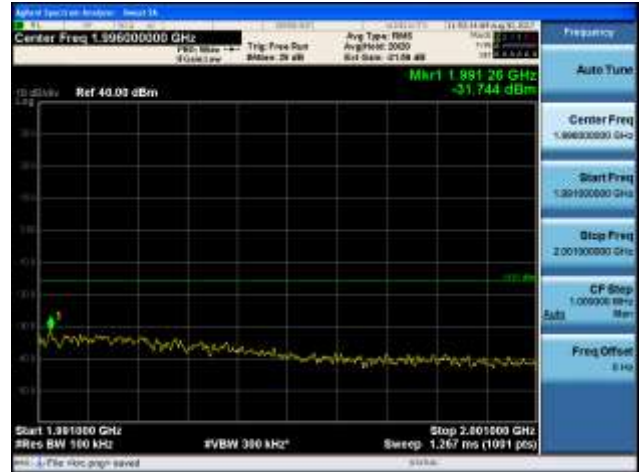

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz

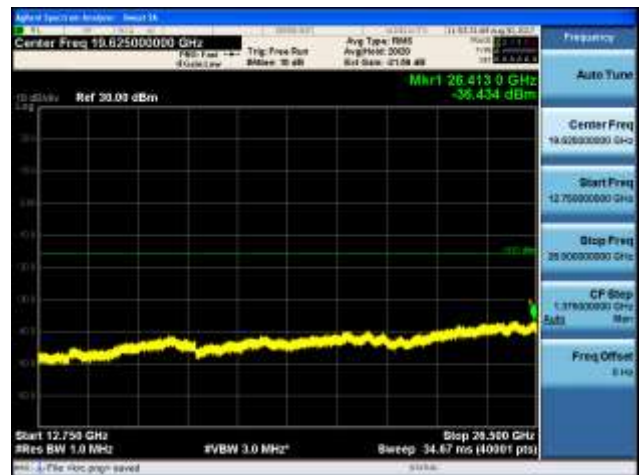



CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (149) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz



150 kHz - 30 MHz



30 MHz - 1000 MHz

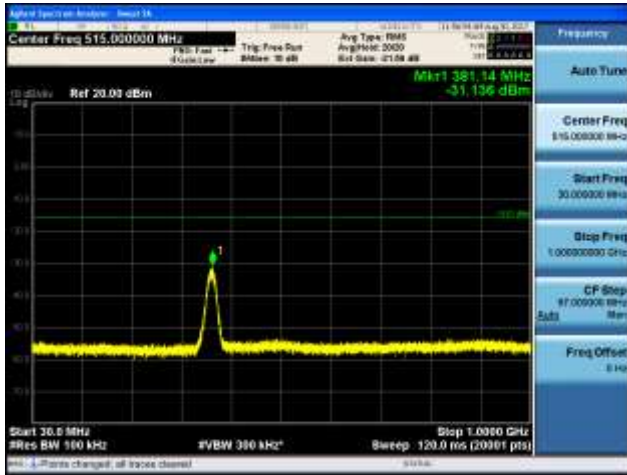

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (150) / (282)
 Pages

1919 MHz - 1929 MHz




1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz

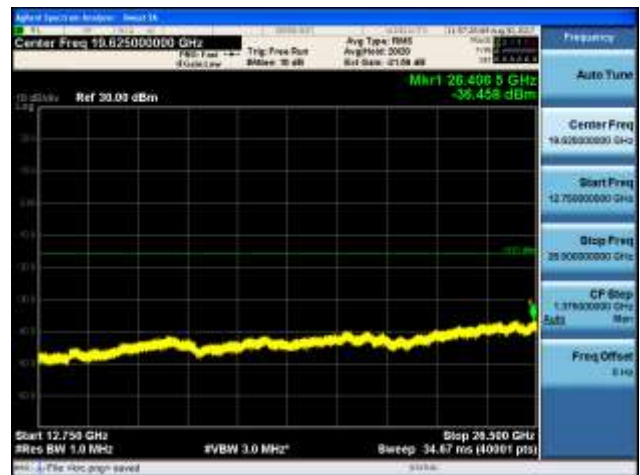



CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


Report No.:
CTK-2017-01618-2
Page (151) / (282)
Pages

[64QAM]


9 kHz - 150 kHz




150 kHz - 30 MHz

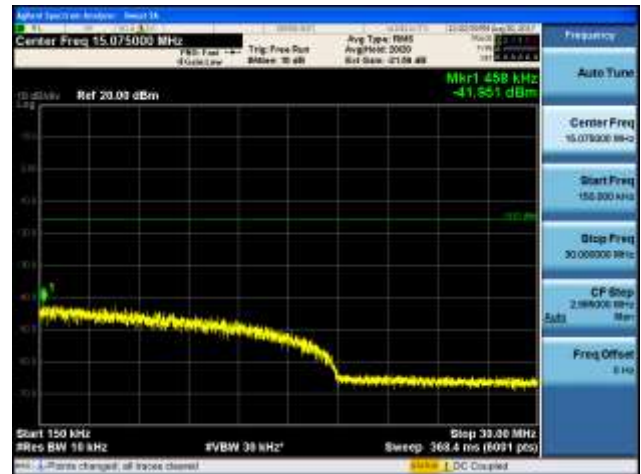

30 MHz - 1000 MHz

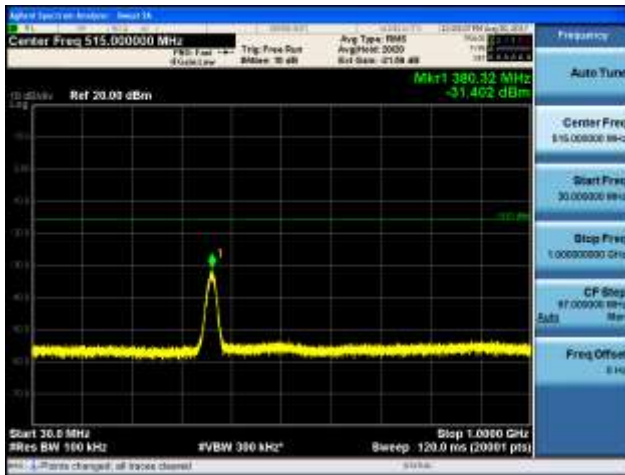

1000 MHz - 1919 MHz

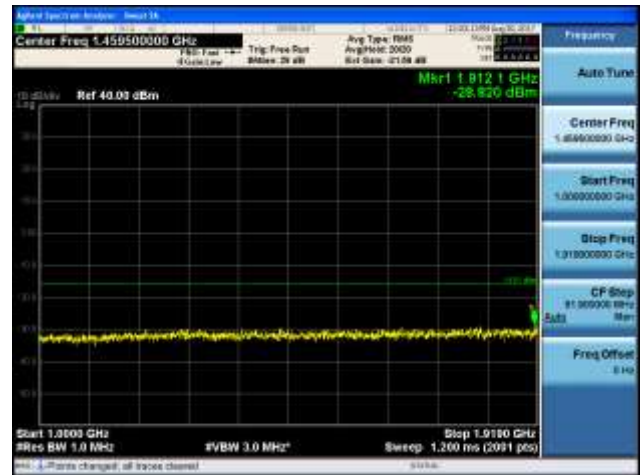



CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (152) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (153) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

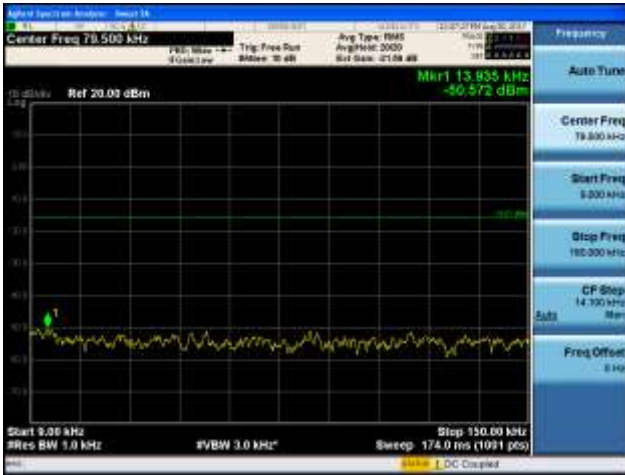

150 kHz - 30 MHz

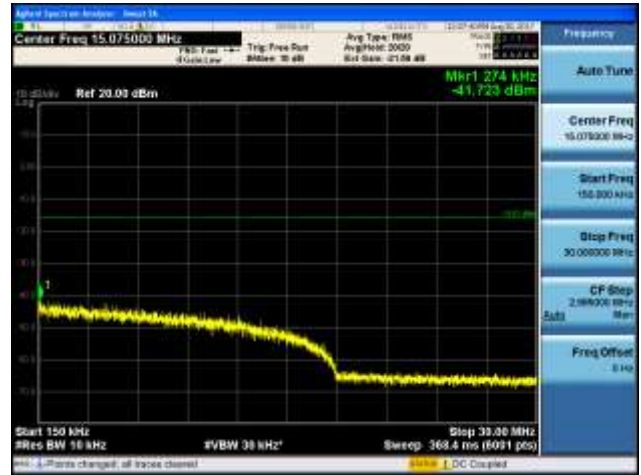

30 MHz - 1000 MHz

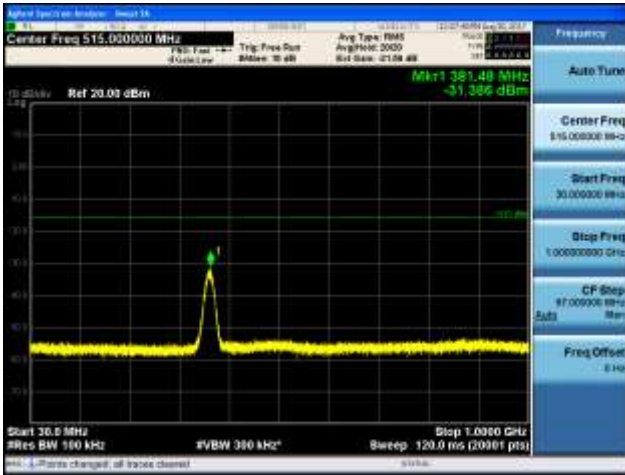

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (154) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (155) / (282)
 Pages

Band 2, BW 20MHz, Single 1 carrier, 2TX, Top
 [QPSK]


9 kHz - 150 kHz



150 kHz - 30 MHz



30 MHz - 1000 MHz

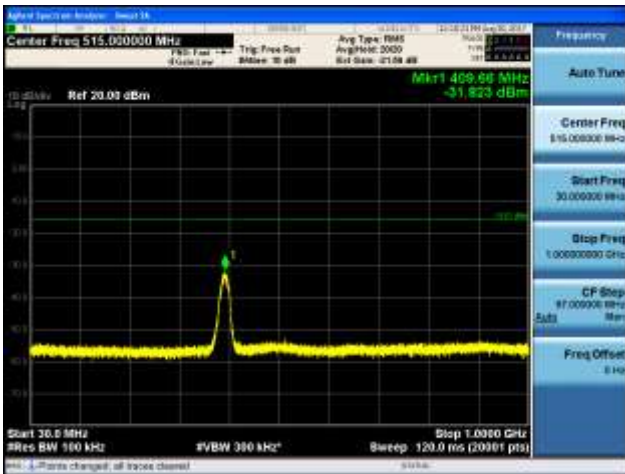

1000 MHz - 1919 MHz





CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (156) / (282)
Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (157) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz

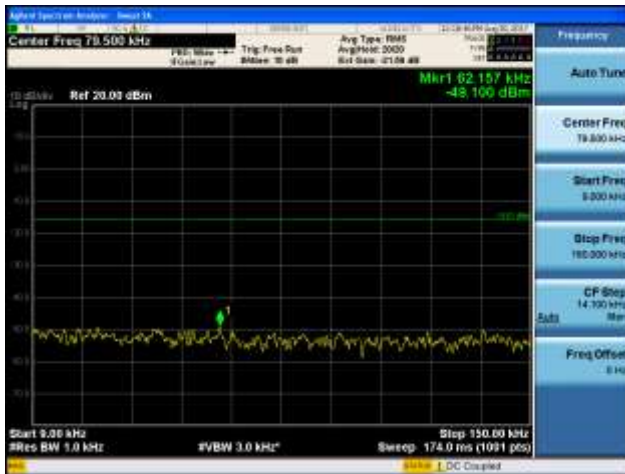

150 kHz - 30 MHz

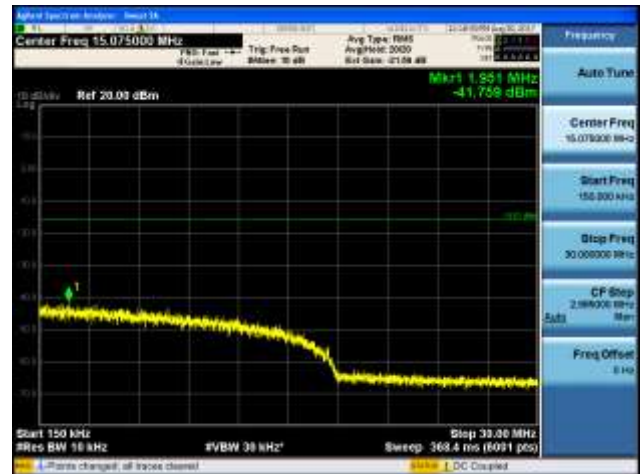

30 MHz - 1000 MHz

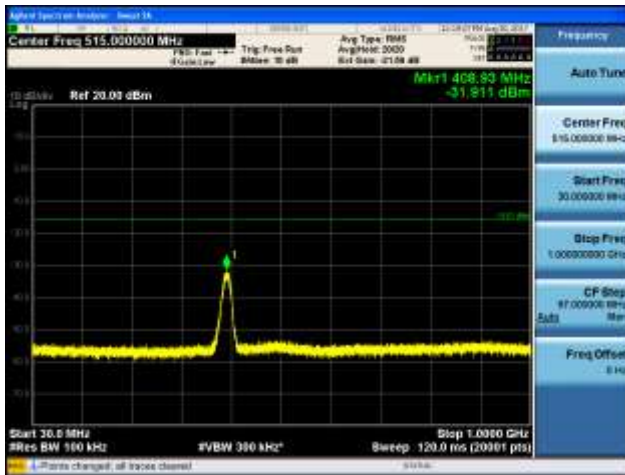

1000 MHz - 1919 MHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (158) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (159) / (282)
Pages

[64QAM]


9 kHz - 150 kHz

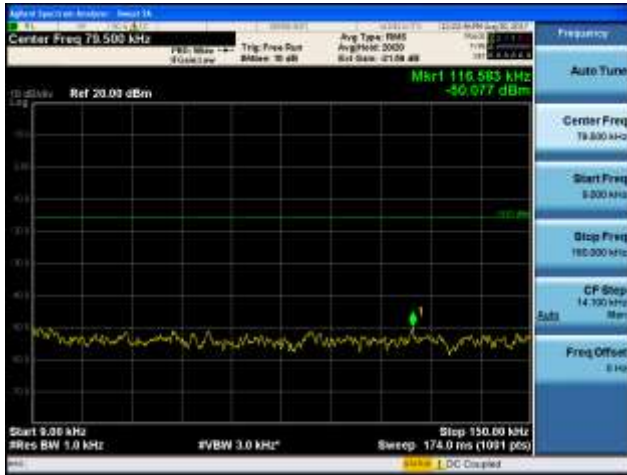


150 kHz - 30 MHz



30 MHz - 1000 MHz

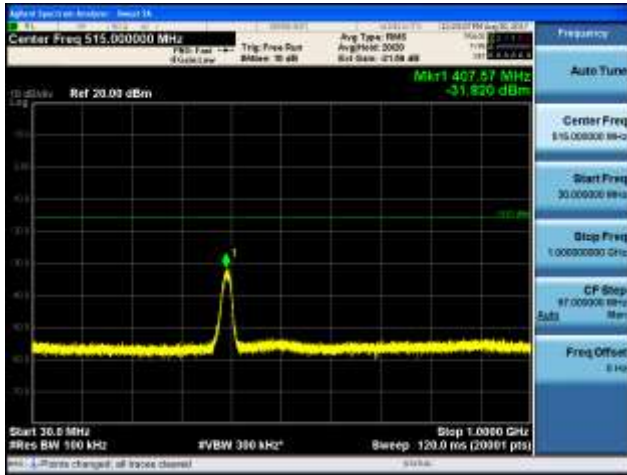

1000 MHz - 1919 MHz

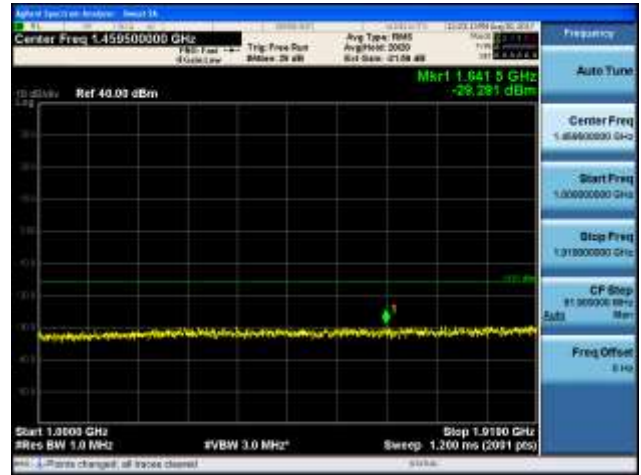




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (160) / (282)
 Pages

1919 MHz - 1929 MHz

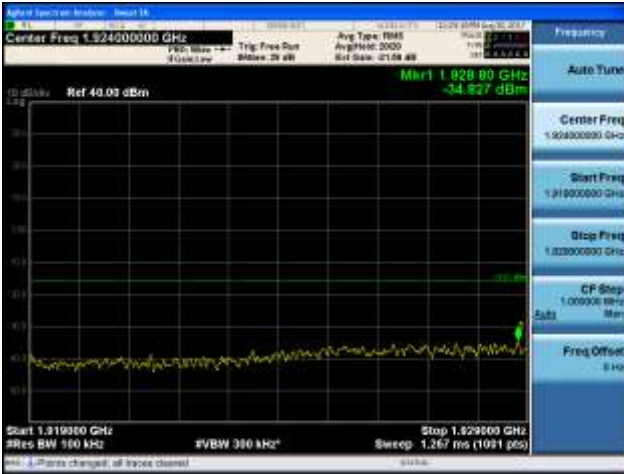

1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (161) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

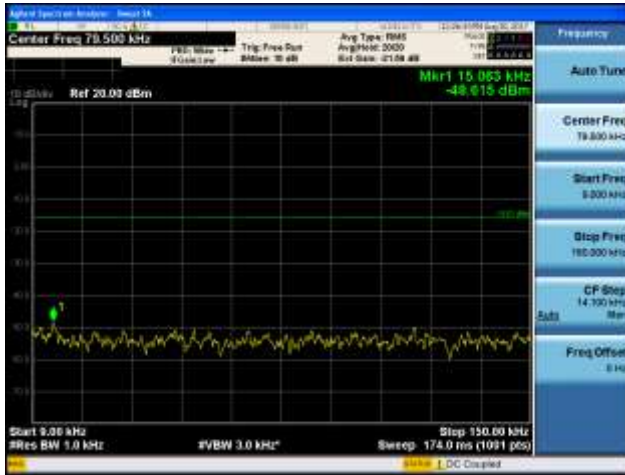


150 kHz - 30 MHz



30 MHz - 1000 MHz

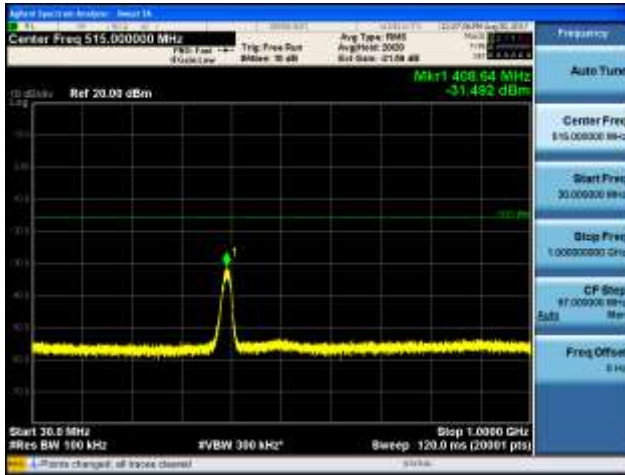

1000 MHz - 1919 MHz

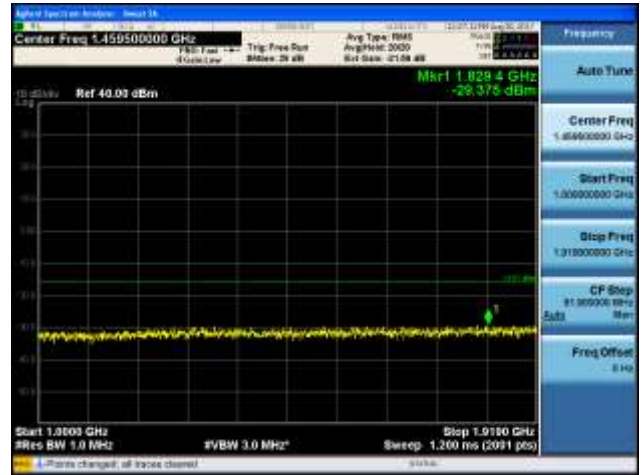



CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (162) / (282)
 Pages


1919 MHz - 1929 MHz



1991 MHz - 2001 MHz



2001 MHz - 12.75 GHz

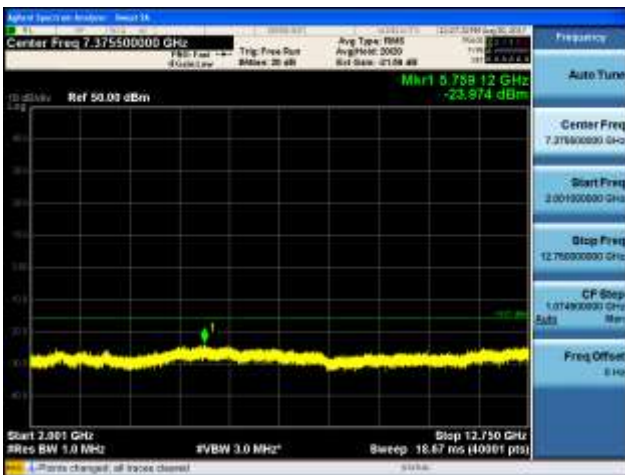

12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (163) / (282)
 Pages

Band 2, BW 20MHz, Single 1 carrier, 4TX, Bottom
 [QPSK]


9 kHz - 150 kHz

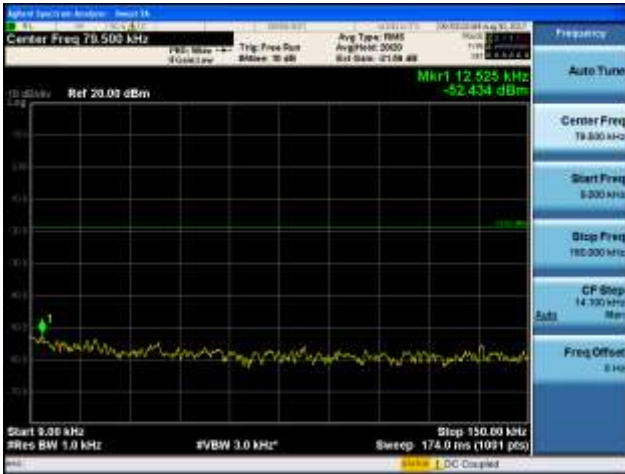


150 kHz - 30 MHz

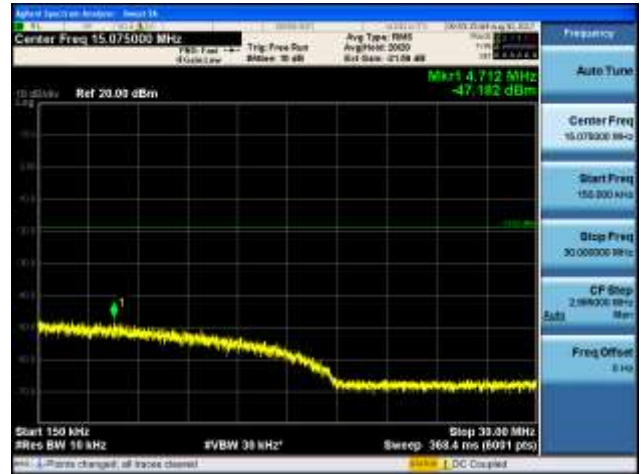

30 MHz - 1000 MHz

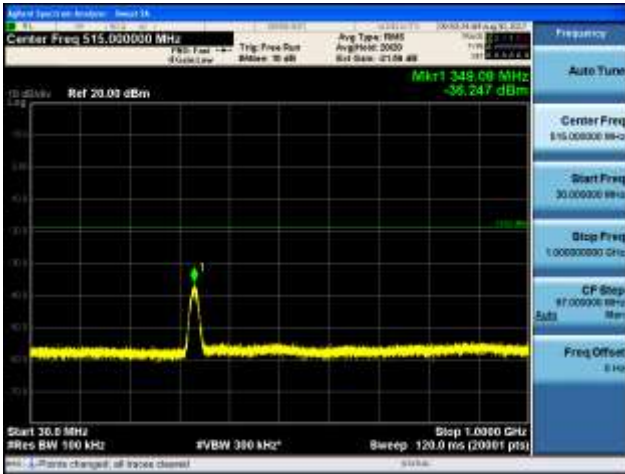

1000 MHz - 1919 MHz

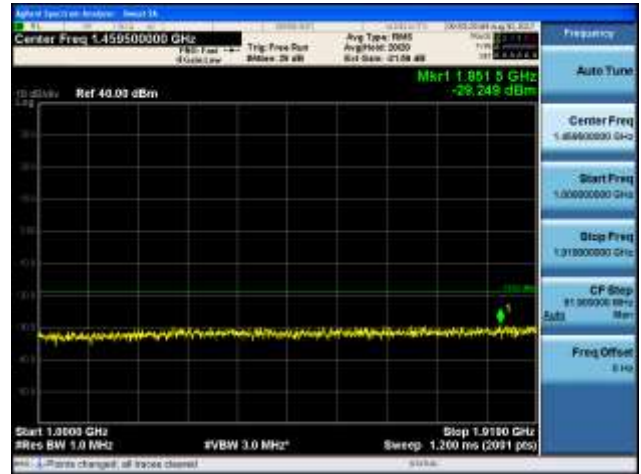




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (164) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

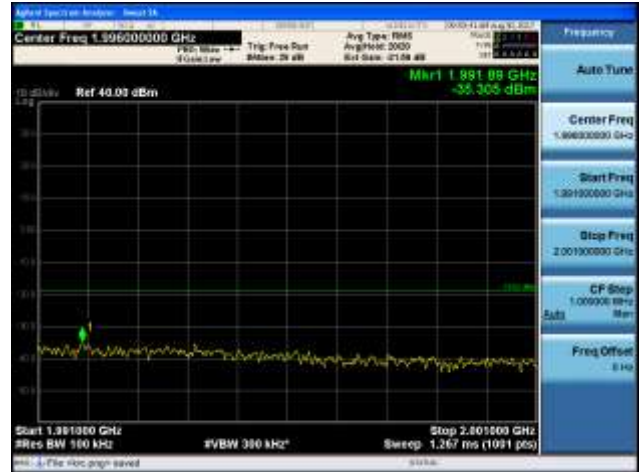

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz





CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (165) / (282)
 Pages

[16QAM]


9 kHz - 150 kHz




150 kHz - 30 MHz

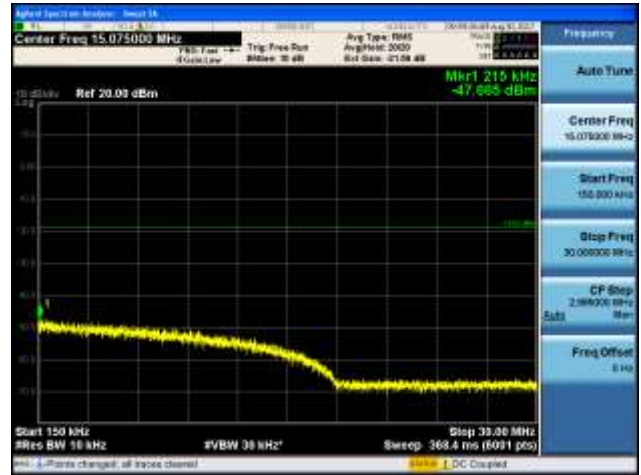

30 MHz - 1000 MHz

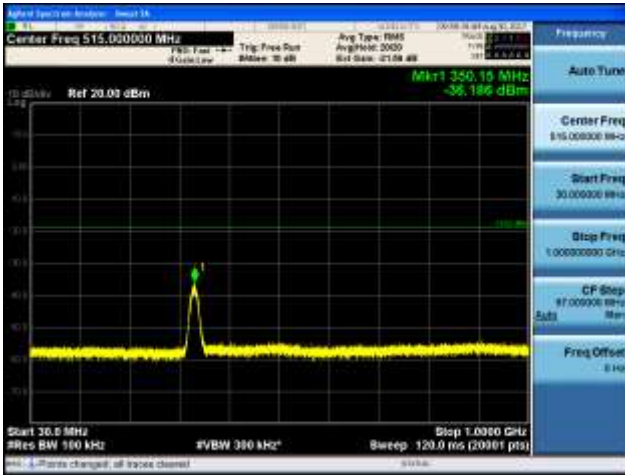

1000 MHz - 1919 MHz

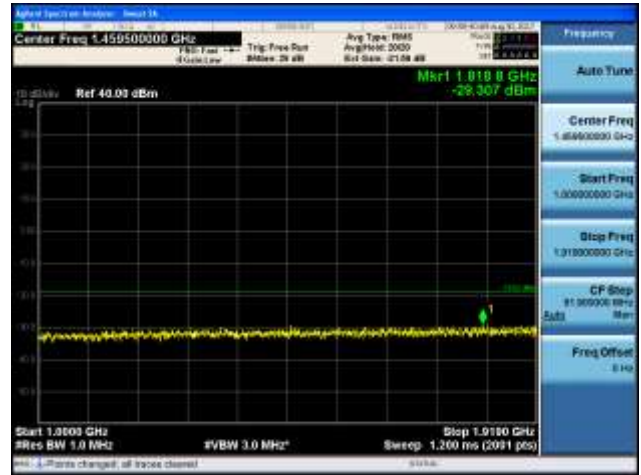




CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (166) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

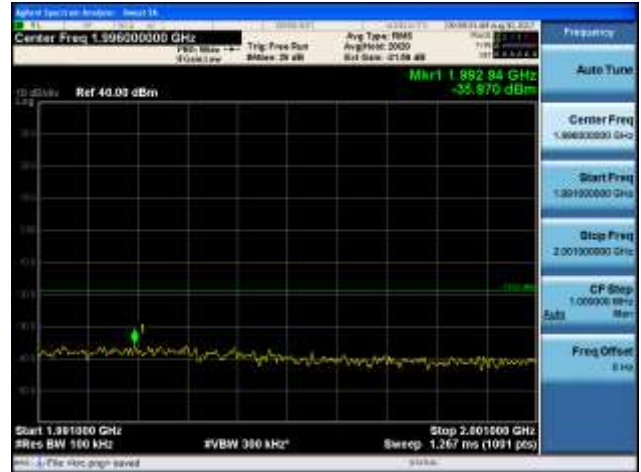

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (167) / (282)
 Pages

[64QAM]


9 kHz - 150 kHz

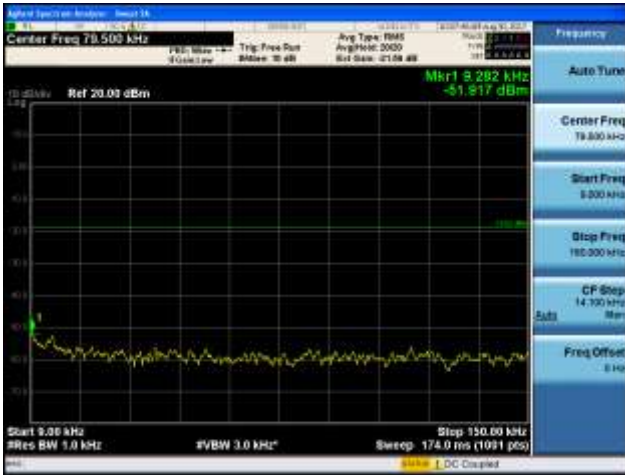

150 kHz - 30 MHz

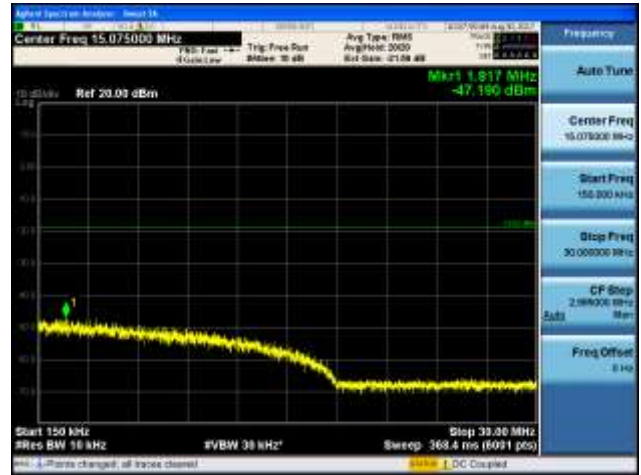

30 MHz - 1000 MHz

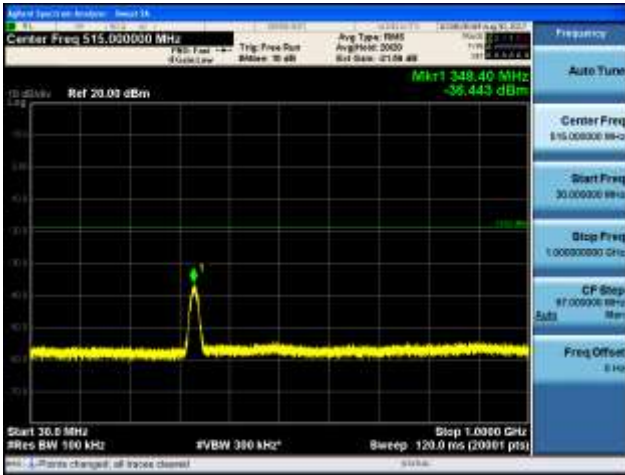

1000 MHz - 1919 MHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501

Report No.:
 CTK-2017-01618-2
 Page (168) / (282)
 Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

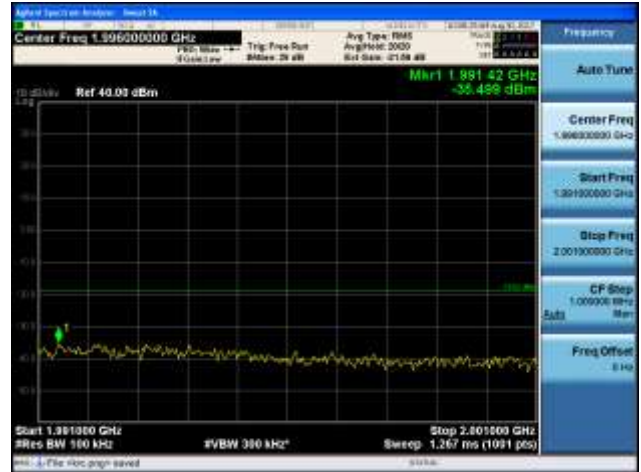

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz






CTK Co., Ltd.
 (Ho-dong), 113, Yejik-ro, Cheoin-gu,
 Yongin-si, Gyeonggi-do, Korea
 Tel: +82-31-339-9970
 Fax: +82-31-624-9501


Report No.:
 CTK-2017-01618-2
 Page (169) / (282)
 Pages

[256QAM]


9 kHz - 150 kHz

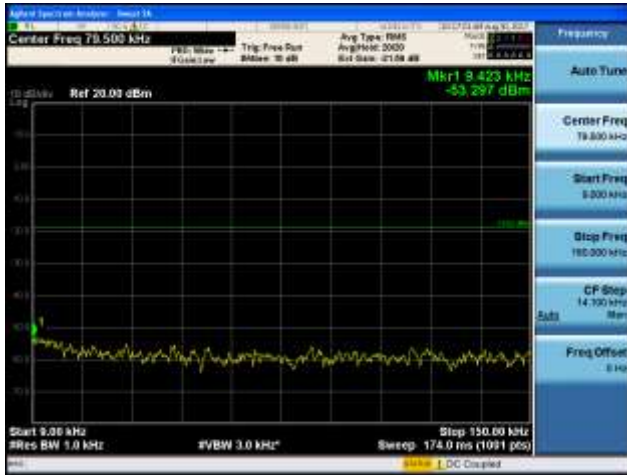

150 kHz - 30 MHz

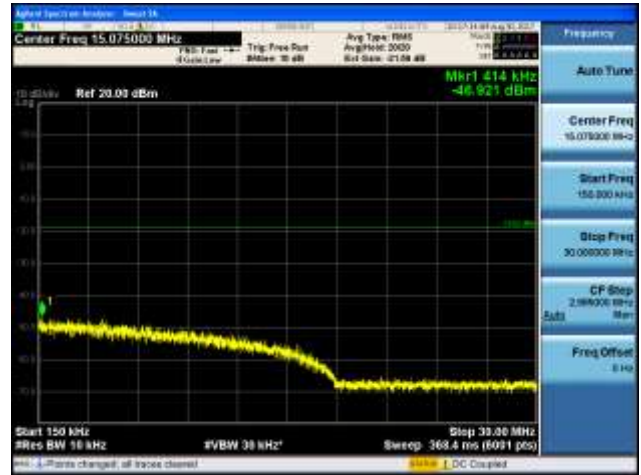

30 MHz - 1000 MHz

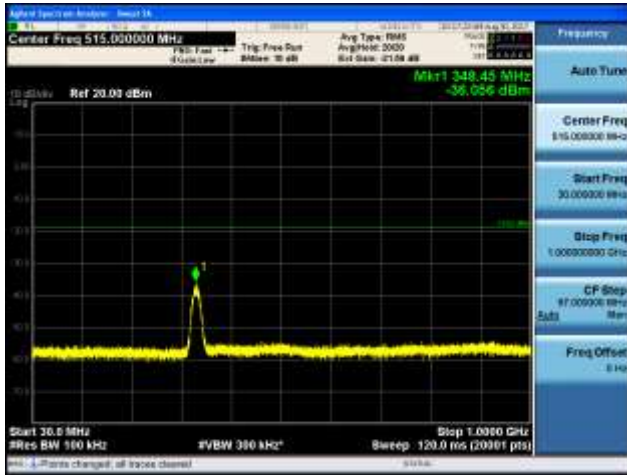

1000 MHz - 1919 MHz






CTK Co., Ltd.
(Ho-dong), 113, Yejik-ro, Cheoin-gu,
Yongin-si, Gyeonggi-do, Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.:
CTK-2017-01618-2
Page (170) / (282)
Pages

1919 MHz - 1929 MHz



1991 MHz - 2001 MHz

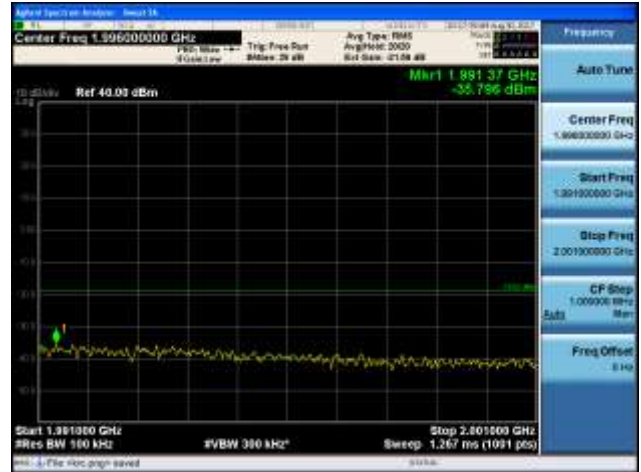

2001 MHz - 12.75 GHz



12.75 GHz - 26.5 GHz

