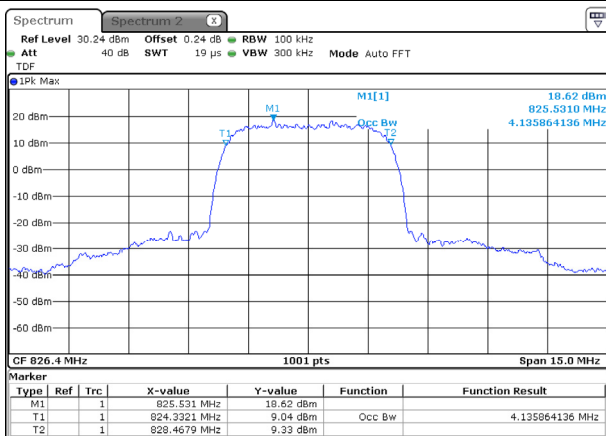
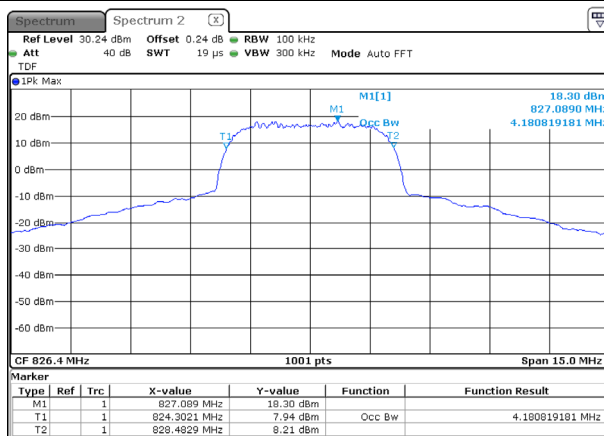
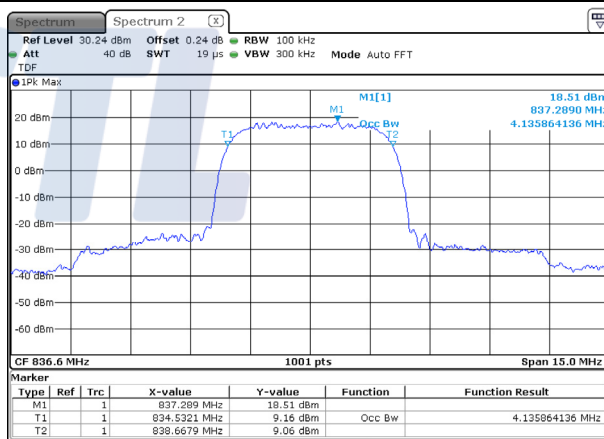
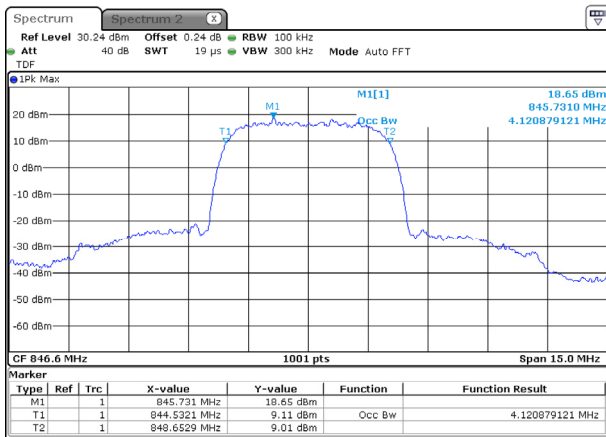
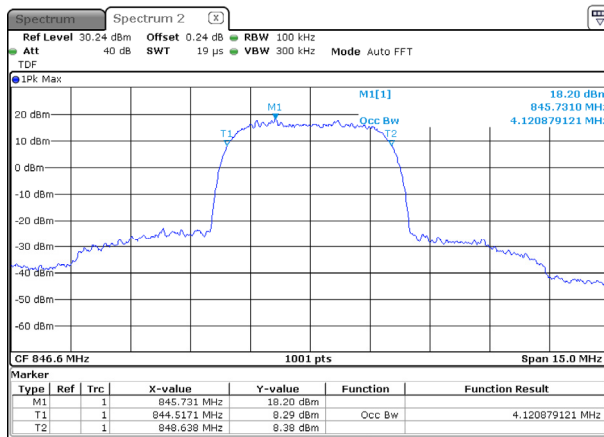


99% Occupied Bandwidth**Test mode: WCDMA 850****RMC / Low ch.****HSDPA / Low ch.****RMC / Mid ch.****HSDPA / Mid ch.****RMC / High ch.****HSDPA / High ch.**

KCTL Inc.


65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr

Report No.:
KR19-SRF0096-A


Page (22) of (67)

KCTL


HSUPA / Low ch.

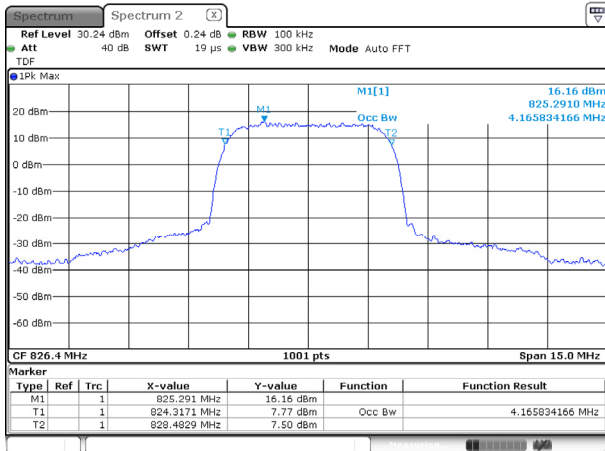

HSUPA / Mid ch.

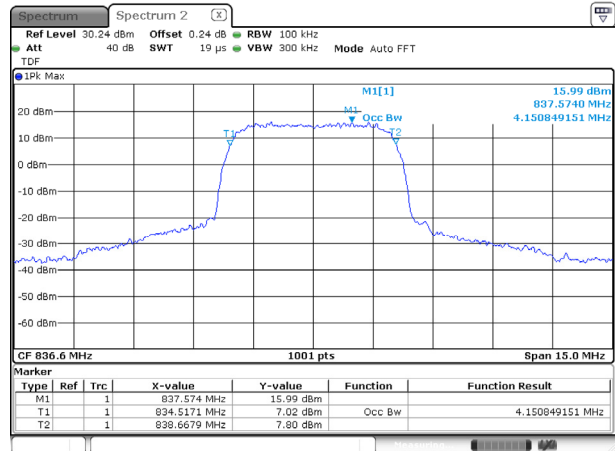

HSUPA / High ch.

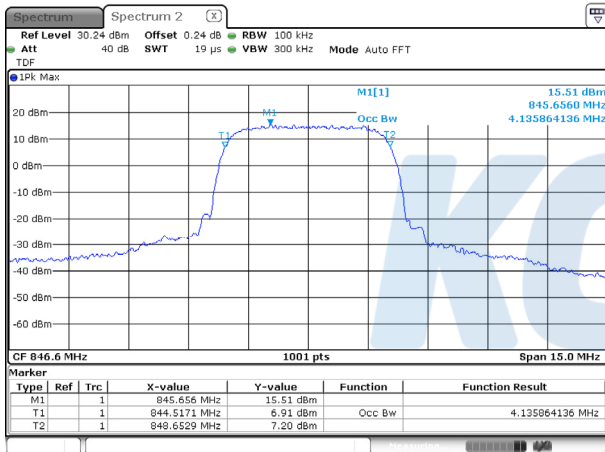

Blank

KCTL Inc.

65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr


Report No.:
KR19-SRF0096-A

Page (23) of (67)




Test mode: WCDMA 1700


RMC / Low ch.

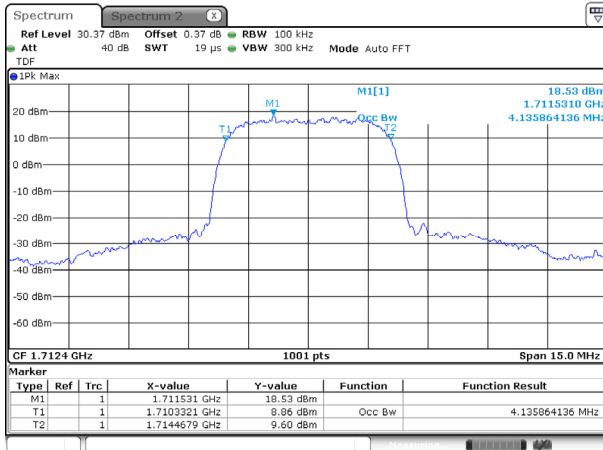


HSDPA / Low ch.

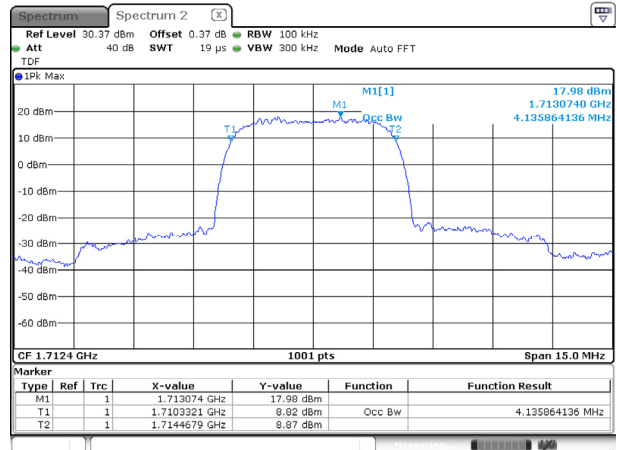


RMC / Mid ch.

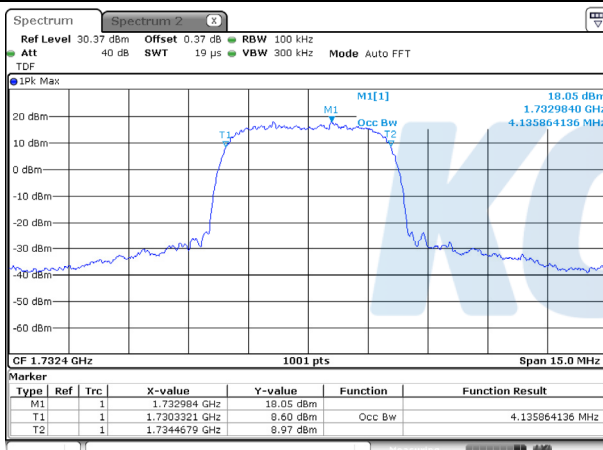


HSDPA / Mid ch.

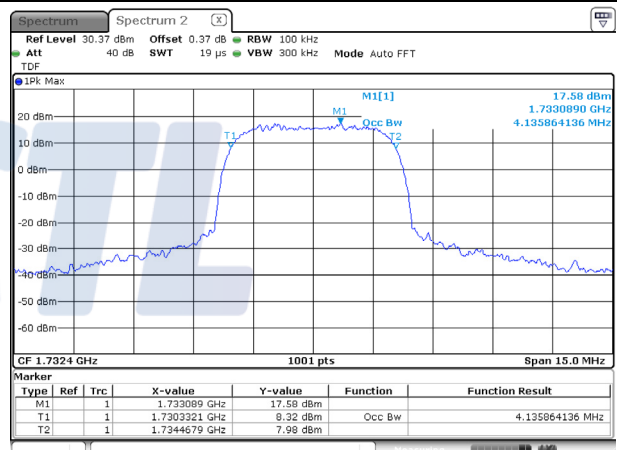

RMC / High ch.

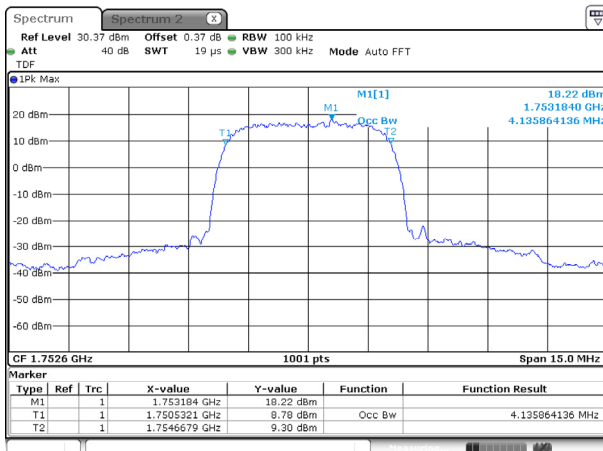

HSDPA / High ch.

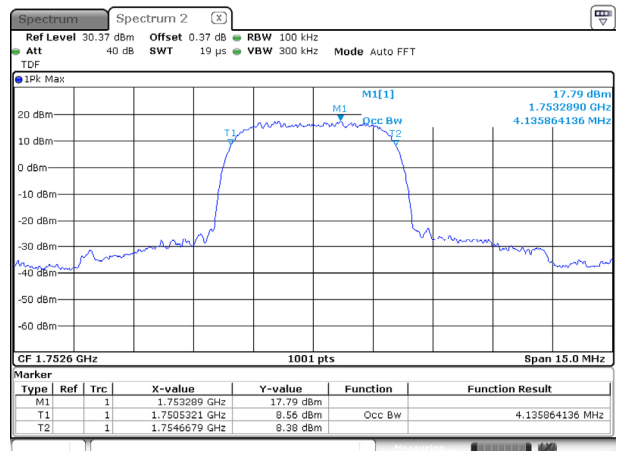

This test report shall not be reproduced, except in full, without the written approval

KCTL-TIR001-003/2

KCTL Inc.


65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr

Report No.:
KR19-SRF0096-A


Page (24) of (67)

KCTL

HSUPA / Low ch.

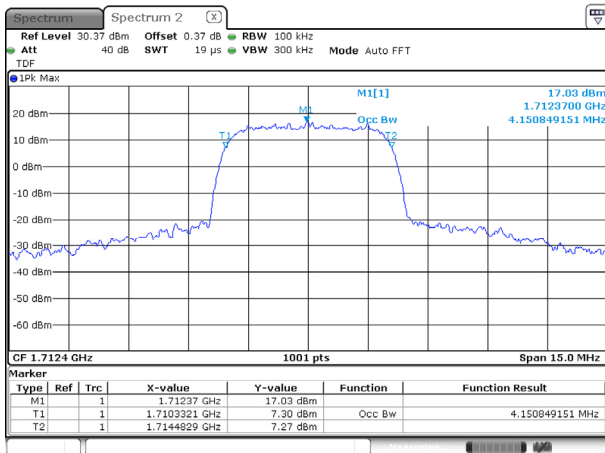

HSUPA / Mid ch.

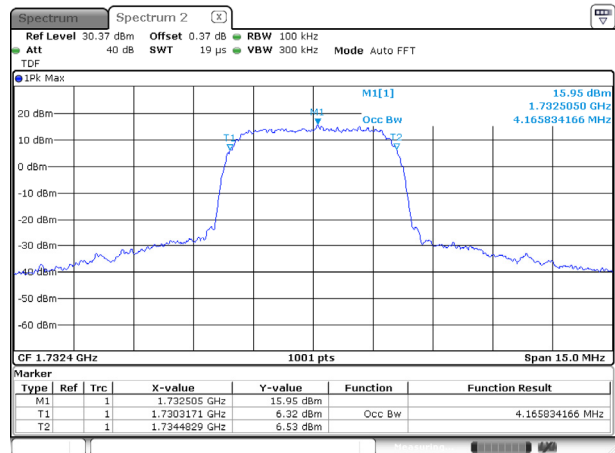

HSUPA / High ch.



Blank

KCTL Inc.

65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr


Report No.:
KR19-SRF0096-A

Page (25) of (67)




Test mode: WCDMA 1900


RMC / Low ch.

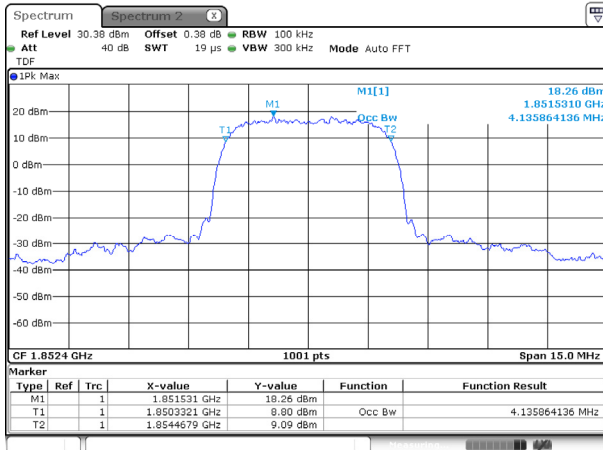


HSDPA / Low ch.

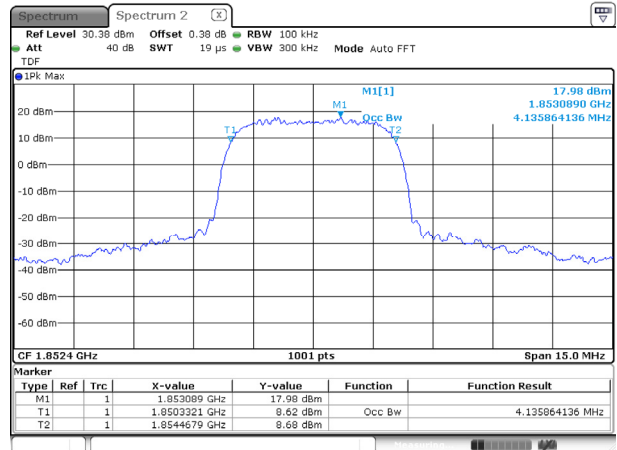


RMC / Mid ch.

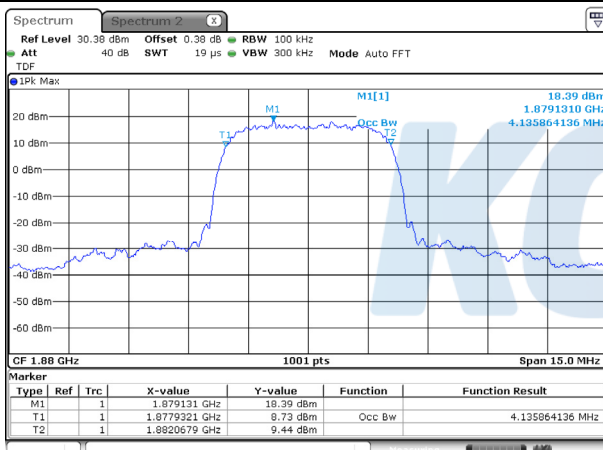


HSDPA / Mid ch.

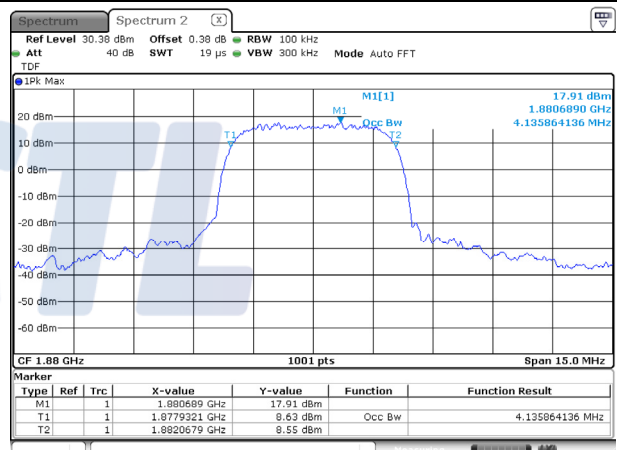

RMC / High ch.

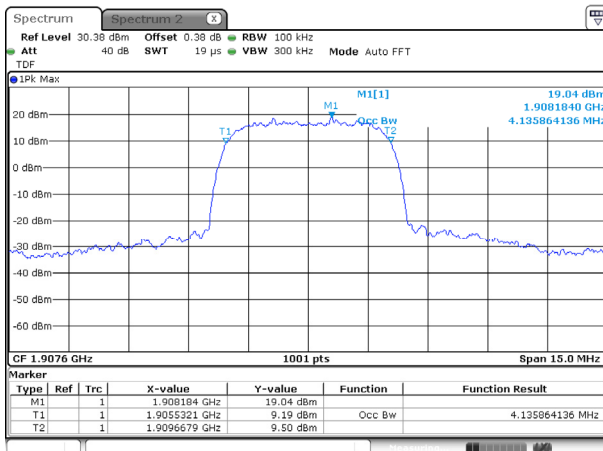

HSDPA / High ch.

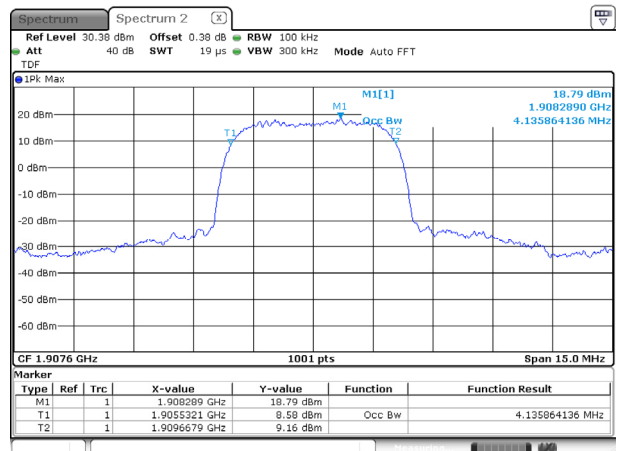

This test report shall not be reproduced, except in full, without the written approval

KCTL-TIR001-003/2

KCTL Inc.


65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr

Report No.:
KR19-SRF0096-A


Page (26) of (67)

KCTL


HSUPA / Low ch.

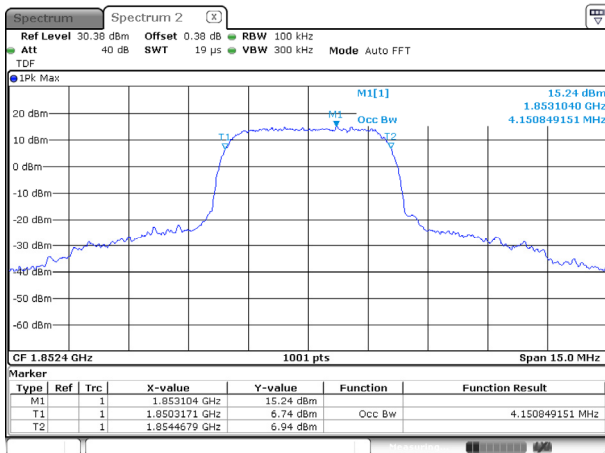

HSUPA / Mid ch.

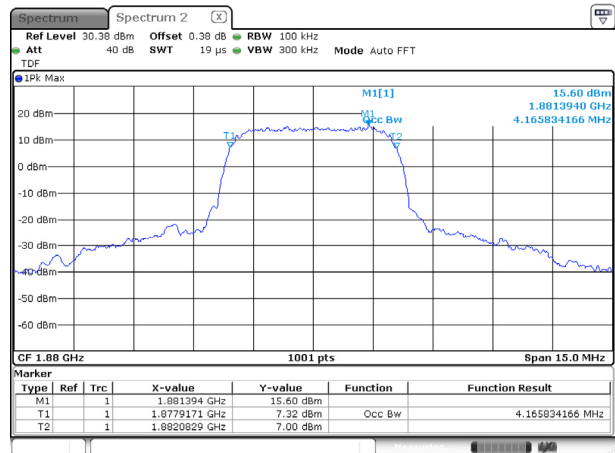


HSUPA / High ch.

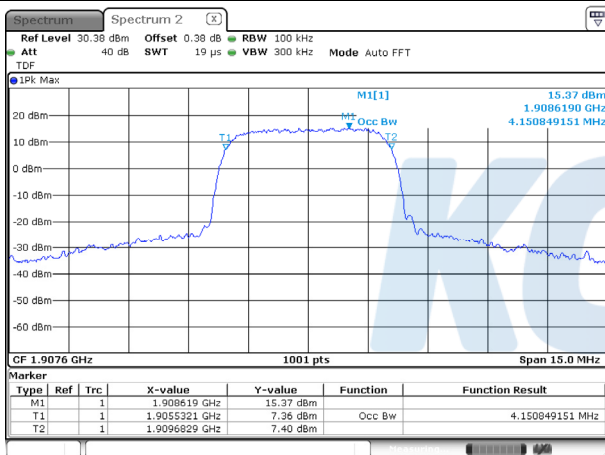

Blank

7.3. Spurious Emissions at Antenna Terminal

Test setup

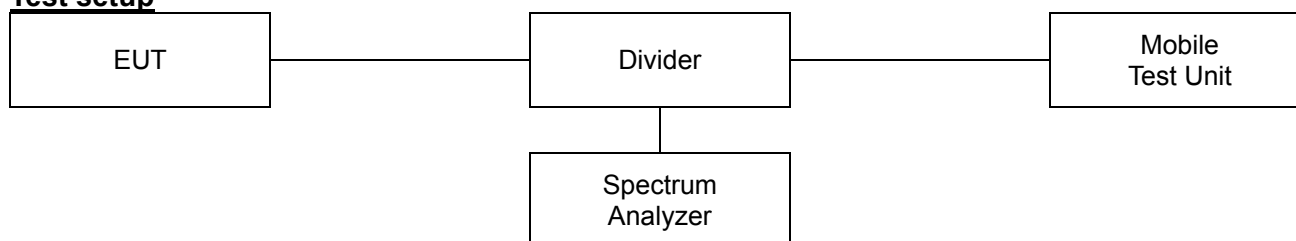

Limit

According to §22.917(a), §24.238(a) and RSS-132(5.5), RSS-133(6.5), the power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least $43 + 10\log(P)$ dB.

According to §27.53(h) and RSS-139(6.6), the power of any emission outside a licensee's frequency block shall be attenuated below the transmitter power (P) in watts by at least $43 + 10\log(P_{\text{[Watts]}})$ dB.

Test procedure

971168 D01 v03r01 - Section 6
 ANSI 63.26-2015 – Section 5.7

Test settings

- 1) Start frequency was set to 30 MHz and stop frequency was set to at least 10th the fundamental frequency.
- 2) Detector = RMS
- 3) Sweep time = auto couple.
- 4) Trace mode = trace average
- 5) Allow trace to fully stabilize.
- 6) Please see test notes below RBW and VBW settings.

Notes:

1. Per 22.917(b), 24.238(b), 27.53(h) and RSS-132(5.5), RSS-133(6.5), RSS-139(6.6) compliance with these provisions is based on the use of measurement instrumentation employing a resolution bandwidth of 100 kHz or greater for frequencies less than 1 GHz and 1 MHz or greater for frequencies greater than 1 GHz.

The emission bandwidth is defined as the width of the signal between two points, one below the carrier center frequency and one above the carrier center frequency, outside of which all emissions are attenuated at least 26 dB below the transmitter power.

KCTL Inc.

65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr

Report No.:
KR19-SRF0096-A


Page (28) of (67)

KCTL


Test results

Test mode: WCDMA 850


RMC / Low ch.

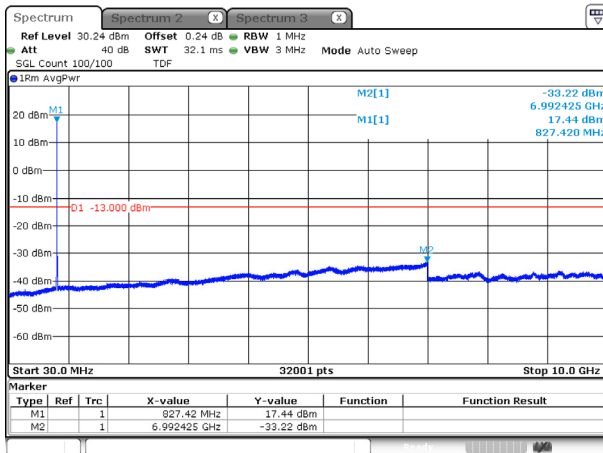


HSDPA / Low ch.

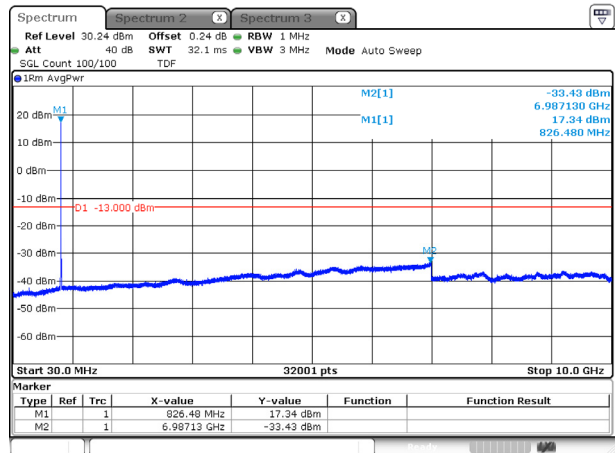


RMC / Mid ch.

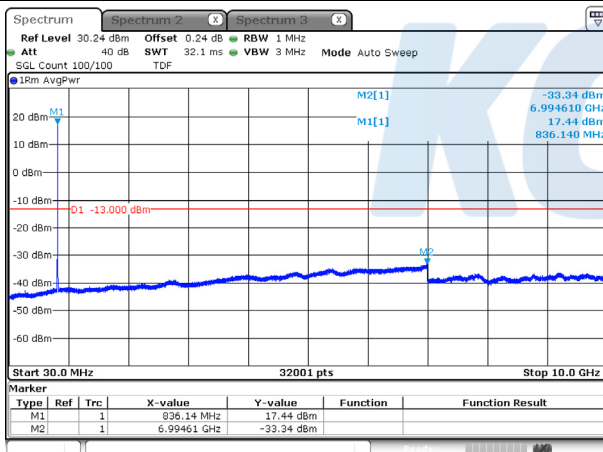


HSDPA / Mid ch.

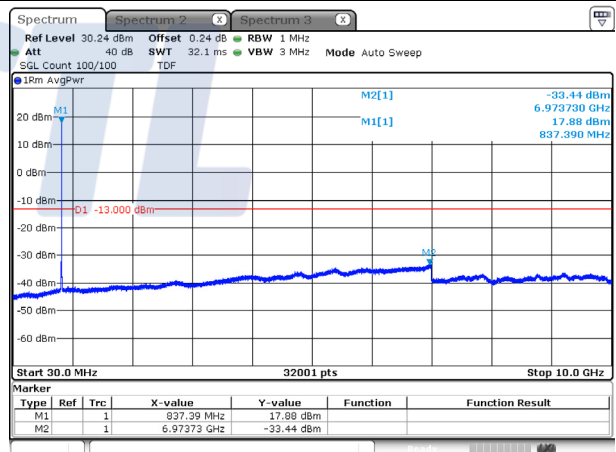

RMC / High ch.

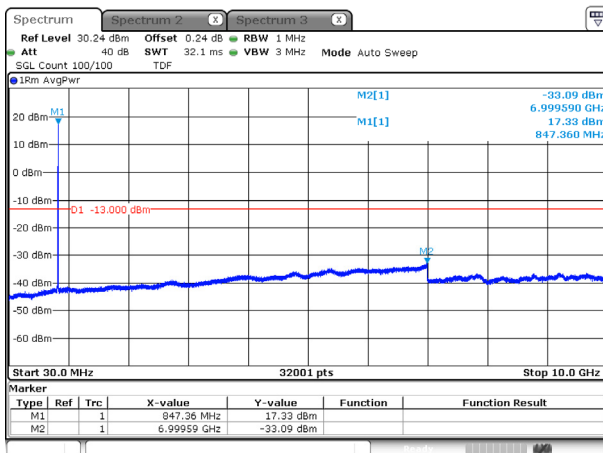

HSDPA / High ch.

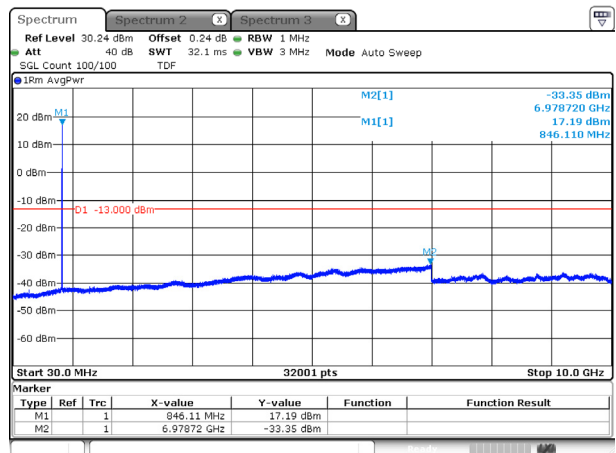

This test report shall not be reproduced, except in full, without the written approval

KCTL-TIR001-003/2

KCTL Inc.


65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr

Report No.:
KR19-SRF0096-A


Page (29) of (67)

KCTL


HSUPA / Low ch.

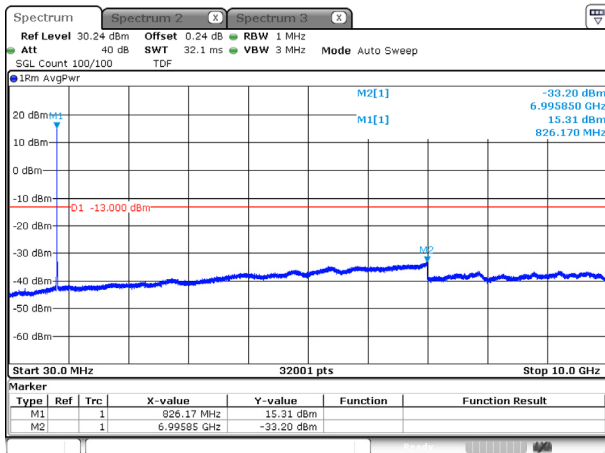

HSUPA / Mid ch.

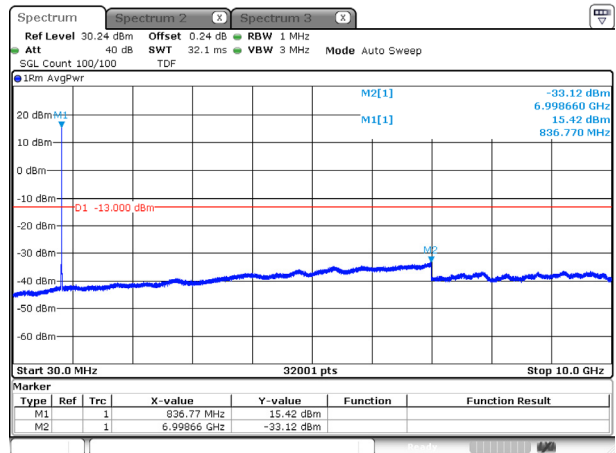

HSUPA / High ch.

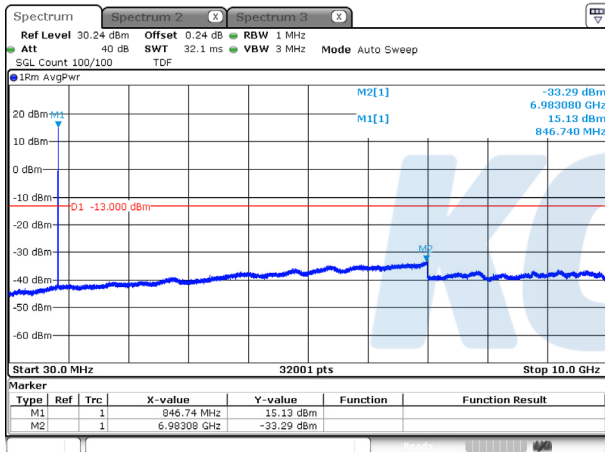

Blank

KCTL Inc.

65, Sinwon-ro, Yeongtong-gu,
Suwon-si, Gyeonggi-do, 16677, Korea
TEL: 82-31-285-0894 FAX: 82-505-299-8311
www.kctl.co.kr


Report No.:
KR19-SRF0096-A

Page (30) of (67)


KCTL

Test mode: WCDMA 1700


RMC / Low ch.

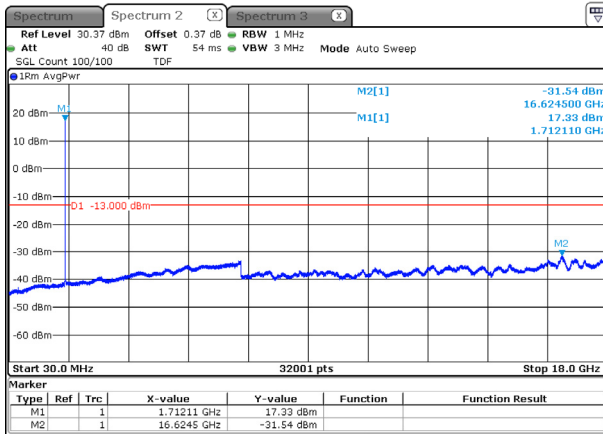


HSDPA / Low ch.

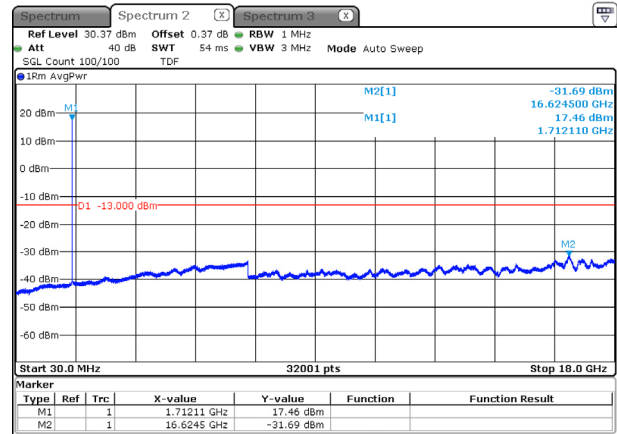


RMC / Mid ch.

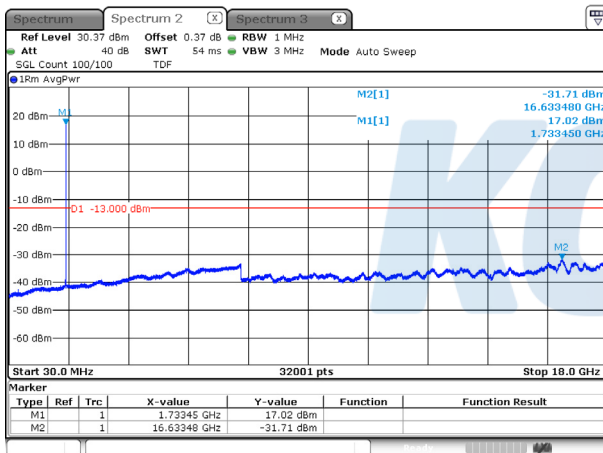

HSDPA / Mid ch.

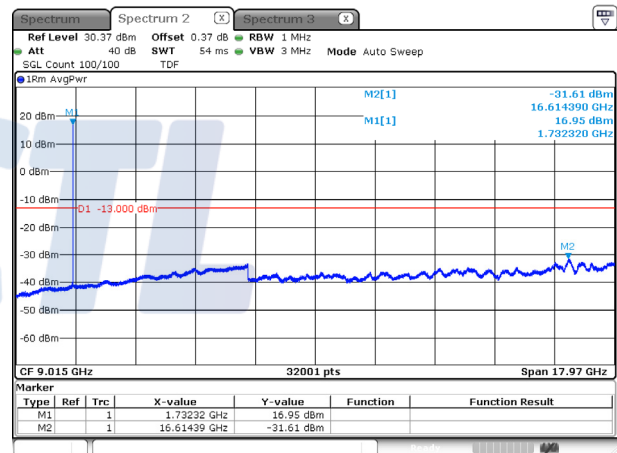

RMC / High ch.

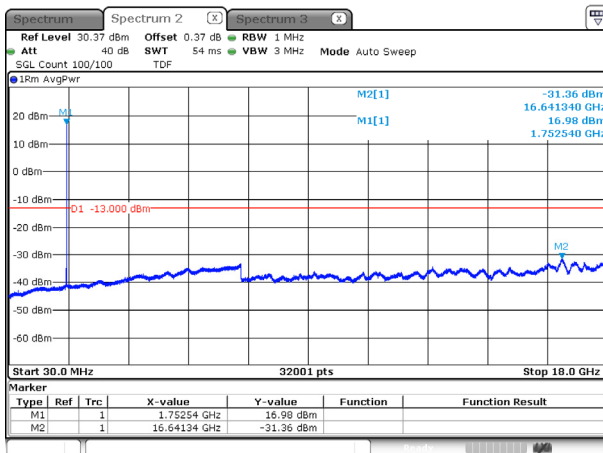

HSDPA / High ch.

