ROHDE&SCHWARZ



 Material No
 1048.0371.02
 Serial No
 101811
 Certificate
 0001A300623436

 Page
 2/3
 Number

Calibration Procedure

The measuring object is an RF harmonic mixer, which converts an RF signal at one frequency into a signal at another frequency (here: IF). The conversion loss was measured using a vector network analyzer. The RF output power as well as the IF input power of the corresponding ports of the VNA were traced back to a power sensor. The conversion loss is defined as the ratio of the power at the IF frequency to the power at the RF frequency with a given LO power. (IF: Intermediate frequency; LO: Local Oscillator) The traceability is represented in the table Working Standards used.

Working Standards used	ing Standards used				
Item	Туре	Serial Number	Calibration Certificate Number	Cal. Due	
Therm.Power Sensor DC-44GHz	NRP-Z55	140170	0023 D-K-15195-01-00 2020-12	2022-02-28	
Thermal Waveguide Power Sensor	NRP90TWG	910001	0001A300621305	2022-10-31	
Vector Network Analyzer 4 Port	ZVA67	101175	0023 D-K-15195-01-00 2021-03	2022-03-31	

Re	marks

ROHDE&SCHWARZ



Material No 1048.0371.02 **Serial No** 101811 Certificate 0001A300623436 Page 3/3 Number

Environmental Conditions	nmental Conditions			
Ambient Temperature	(23 ± 1) °C	Relative Humidity	20%-60%	

Comments on Measurement Results

The measurement results in the test report stated below have been tested for compliance with the given specifications and marked if necessary. The associated uncertainty of measurement has been taken into account, if not otherwise stated.

Measurement results that are not covered by the DAkkS accreditation are marked with ¹. Ref.: ILAC G8:09/2019 'Guidelines on Decision Rules and Statements of Conformity'.

The expanded measurement uncertainty corresponds to the measurement results from the standard measurement uncertainty multiplied by the coverage factor k = 2.

It was determined in accordance with EA-4/02 M:2013. The true value is located in the corresponding interval with a probability of 95 %.

In addition to the calibration results, the calibration certificate includes functional measurements that might have an influence on the measurement uncertainty of the calibration results. The functional measurement results are marked and are not intended to be used to support the further dissemination of metrological traceability. They are intended to verify the requirements on the measurement object according to manufacturer specifications and technical standards.

Outgoing Results

Designation: HARMONIC MIXER

Type: FS-Z90

Material No.: 1048.0371.02

Serial No.: 101811

Certificate No.: 0001A300623436

Referring to Test Documentation: 5038.8323.01-PB-02.00

Test Department: 3MM-P

Name: Johannes Negele

Date: 2021-11-16

\$	Page
ROHDE&SCHWARZ	1/6

The following abbreviations may be used in this document

{a}	No measurement uncertainty stated because the errors always add together. So it is sure
	that a management manufactured as UDACCU is management.

that a measurement result evaluated as "PASS" is pass.

{b} The measurement uncertainty depends on the measurement result. The stated measurement

uncertainty is valid for the close area around the specification. Measurement results outside

the close area have a higher measurement uncertainty but are within the specification.

{c} Functional test, therefore no measurement uncertainty is stated.

{d} Typical value, refer to performance test.

{e} The measurement uncertainty is taken into account when setting the measuring system.

{f} Verification of specified requirements. Technical operation that consist of the determination of one or more

characteristics to a specified procedure.

DL or DT Data Limit for symmetrical tolerance limits

DLL Datasheet Lower Limit
DUL Datasheet Upper Limit

MU Symmetrical Measurement Uncertainty
MLL or MLV Measurement Uncertainty Lower Value
MUL or MUV Measurement Uncertainty Upper Value

Nom. Nominal Value
Dev. Deviation
Act. Actual Value


UGB Uncertainty Guard Band: Measuring uncertainty violates the data (spec.) limit.

UGB1 A compliance statement may be possible where a confidence level of less than 95 % is acceptable.

UGB2 A non-compliance statement may be possible where a confidence level of less than 95 % is acceptable.

DU Datasheet Uncertainty

Explanation of charts

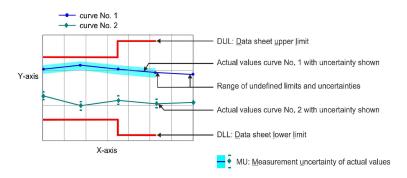

S	oftware used for measurement	4
1.	. Conversion Loss (6. Harmonic)	5
	1.1 Conversion Loss (IF = 404.4 MHz)	
	1.2 Conversion Loss (IF = 729 MHz)	5
	1.3 Conversion Loss (IF = 1330 MHz)	6
	1.4 Continuity response within 1 GHz	6

Software used for measurement			
Item	Туре	Version	Remark
Suite	Setup	V12.10.02	Test Management Software G5
Test Program (7012.8706.00_)	Component	V01.05	