



Report No.: FG380306I

FCC Part 96.47 TEST REPORT

FCC ID : A4RG8HHN

Equipment : Phone : G8HHN **Model Name**

Applicant : Google LLC

1600 Amphitheatre Parkway,

Mountain View, California, 94043 USA

Standard : FCC Part 96.47

RF Interface : NR n48

The product was received on Aug. 25, 2023, and testing was performed from Sep. 20, 2023 to Sep. 21, 2023. We, Sporton International Inc. Wensan Laboratory, would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. Wensan Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai

Sporton International Inc. Wensan Laboratory

No.58, Aly. 75, Ln. 564, Wenhua 3rd, Rd., Guishan Dist., Taoyuan City 333010, Taiwan (R.O.C.)

TEL: 886-3-327-0868 : 1 of 11 Page Number FAX: 886-3-327-0855 : Nov. 14, 2023 Issue Date Report Version : 01

Report Template No.: BU5- CR247WL5G AC MA Version 2.1

Table of Contents

Report No. : FG380306I

His	story o	of this test report	
	-	ry of Test Result	
	Gene	eral Description	
	1 1	Product Feature of Equipment Under Test	ŗ
	1.2	Modification of EUT	Ę
		Testing Laboratory	ŗ
		Applicable Standards	
2		Configuration of Equipment Under Test	
_		Connection Diagram of Test System	
3		User Device additional requirement	
-		Test Requirement	
		Test Procedure	
	3.3	Test Result	
4	List	of Measuring Equipment	11
		ix Δ. Setun Photographs	

TEL: 886-3-327-0868 Page Number : 2 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

Report Version

: 01

Report Template No.: BU5- CR247WL5G AC MA Version 2.1

History of this test report

Report No. : FG380306I

Report No.	Version	Description	Issue Date
FG380306I	01	Initial issue of report	Nov. 14, 2023

TEL: 886-3-327-0868 Page Number : 3 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

Summary of Test Result

Report No.: FG380306I

Report Clause	Ref Std. Clause	Test Items	Result (PASS/FAIL)	Remark
3	96.47	End User Device additional requirement	Pass	-

Conformity Assessment Condition:

The test results (PASS/FAIL) with all measurement uncertainty excluded are presented against the regulation limits or in accordance with the requirements stipulated by the applicant/manufacturer who shall bear all the risks of non-compliance that may potentially occur if measurement uncertainty is taken into account.

Disclaimer

The product specifications of the EUT presented in the test report that may affect the test assessments are declared by the manufacturer who shall take full responsibility for the authenticity.

Reviewed by: William Chen
Report Producer: Ming Chen

TEL: 886-3-327-0868 Page Number : 4 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

1 General Description

1.1 Product Feature of Equipment Under Test

Product Feature

Report No.: FG380306I

General Specs

GSM/WCDMA/LTE/5G NR, Bluetooth, BLE, BLE channel sounding, Wi-Fi 2.4GHz 802.11b/g/n/ac/ax, Wi-Fi 5GHz 802.11a/n/ac/ax, Wi-Fi 6GHz 802.11a/ax, NFC, WPC Rx and GNSS Rx.

Antenna Type

WWAN:

<Ant. 0>: ILA Antenna <Ant. 1>: ILA Antenna <Ant. 2>: IFA Antenna <Ant. 5>: IFA Antenna <Ant. 6>: IFA Antenna

Remark: The above EUT's information was declared by manufacturer. Please refer to Disclaimer in report summary.

EUT Information List			
S/N	Performed Test Item		
38011JEKB00251	Conducted Measurement		

1.2 Modification of EUT

No modifications are made to the EUT during all test items.

1.3 Testing Laboratory

Test Site	Sporton International Inc. Wensan Laboratory			
Test Site Location	No.58, Aly. 75, Ln. 564, Wenhua 3rd, Rd., Guishan Dist., Taoyuan City 333010, Taiwan (R.O.C.) TEL: +886-3-327-0868 FAX: +886-3-327-0855			
Test Site No.	Sporton Site No.			
Test Site No.	TH05-HY			
Test Engineer	Alston Tsai			
Temperature	22 ~ 25 °C			
Relative Humidity	41 ~ 45 %			

FCC designation No.: TW3786

TEL: 886-3-327-0868 Page Number : 5 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

1.4 Applicable Standards

- FCC Part 96.47
- FCC KDB 940660 D01 Part 96 CBRS Eqpt v03
- WINNF-TS-0122-V1.0.2 CBRS CBSD Test Specification

Remark:

1. All test items were verified and recorded according to the standards and without any deviation during the test.


Report No.: FG380306I

2. The TAF code is not including all the FCC KDB listed without accreditation.

TEL: 886-3-327-0868 Page Number : 6 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

2 Test Configuration of Equipment Under Test

2.1 Connection Diagram of Test System

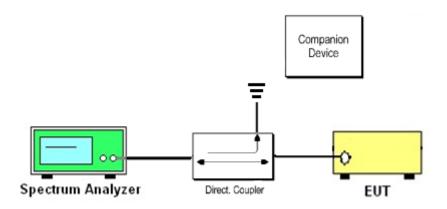

Report No.: FG380306I

The companion device is certified NR CBSD (FCC ID: PIDAS2900)

TEL: 886-3-327-0868 Page Number : 7 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

3 End User Device additional requirement

3.1 Test Requirement

FCC Part 96.47

(a) End User Devices may operate only if they can positively receive and decode an authorization signal transmitted by a CBSD, including the frequencies and power limits for their operation.

Report No.: FG380306I

(1) An End User Device must discontinue operations, change frequencies, or change its operational power level within 10 seconds of receiving instructions from its associated CBSD.


3.2 Test Procedure

Following procedure can be done by applying WINNF-TS-0122-V1.0.2 CBRS CBSD Test Specification, use the certified Airspan NR CBSD (FCC ID: PIDAS2900) as companion device to show compliance with Part 96.47 requirement for End User Device (EUD):


- 1. Configure SAS granted CBSD to operate at frequency 3560-3600 MHz and power level 10 dBm/MHz
- 2. Enable CBSD service from Airspan ACP management
- 3. Check EUD Tx Frequency and power
- 4. Disable CBSD service from Airspan ACP management
 - a. Check EUD stops transmission within 10 seconds.
- 5. Configure SAS granted CBSD to operate at frequency 3650-3690 MHz and power level 20 dBm/MHz
- 6. Enable CBSD service from Airspan ACP management
- 7. Check EUD Tx Frequency and power
- 8. Disable CBSD service from Airspan ACP management
 - a. Check EUD stops transmission within 10 seconds.

TEL: 886-3-327-0868 Page Number : 8 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

3.3 Test Result

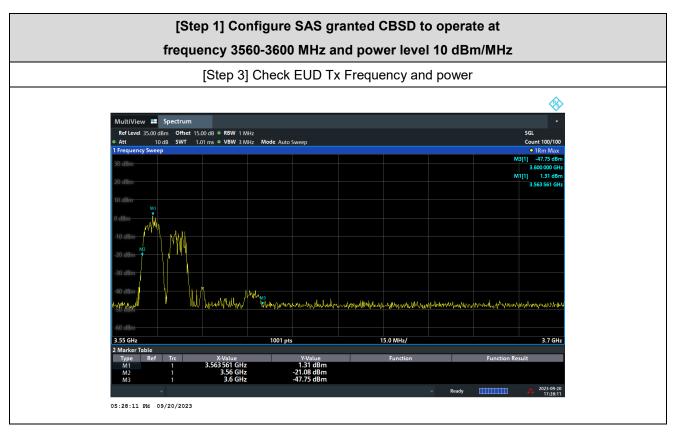


Report No.: FG380306I

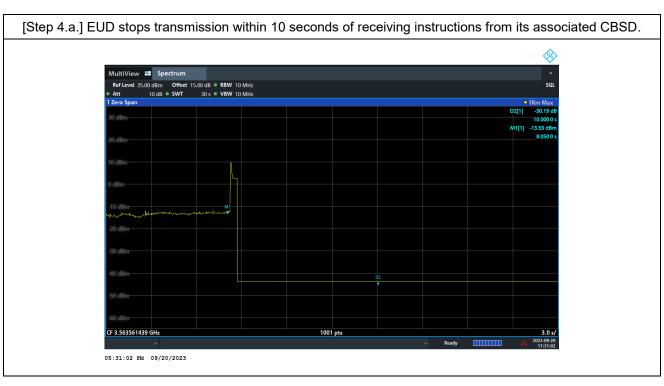


TEL: 886-3-327-0868 Page Number : 9 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023



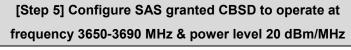

Report No.: FG380306I

[Step 7] Check EUD Tx Frequency and power

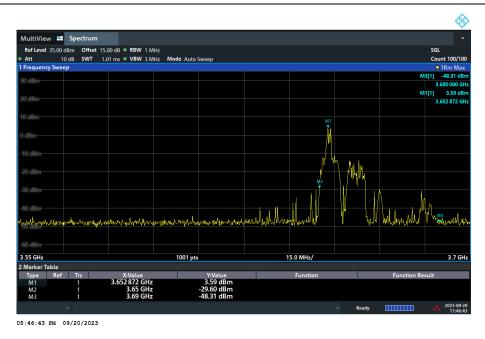

[Step 8.a.] After changing the frequency and power level,

The module (EUT) discontinues operations, change frequencies, or change its operational power level within 10 seconds of receiving instructions from its associated CBSD. Test result is PASS.



TEL: 886-3-327-0868 Page Number : 10 of 11 FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

Report Template No.: BU5- CR247WL5G AC MA Version 2.1

Report Version : 01

4 List of Measuring Equipment

Instrument	Brand Name	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV3044	101467	10Hz~44GHz	Feb. 01, 2023	Sep. 20, 2023~ Sep. 21, 2023	Jan. 31, 2024	Conducted (TH05-HY)
Programmable Power Supply	GW Instek	PSS-2005	EL890001	1V~20V 0.5A~4A	Sep. 12, 2023	Sep. 20, 2023~ Sep. 21, 2023	Sep. 11, 2024	Conducted (TH05-HY)

Report No. : FG380306I



TEL: 886-3-327-0868 Page Number : 11 of 11 FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023