

Safety - EMI - Telecom - ISO Guide 25

CLASS II PERMISSIVE CHANGE

ENGINEERING TEST REPORT

ON:

VT1901 / VT1920C CORDLESS TELEPHONE

O Sony SPP-ID910 except cometic

FCC ID: EW780-4042-00

IN ACCORDANCE WITH: FCC PART 15, SUBPART C PARAGRAPH 15.249 - 900 MHz CORDLESS TELEPHONES

PROJECT NO.: 7VT025-14CS1

TESTED FOR:

VTECH ENGINEERING CANADA LTD. 200-7671 ALDERBRIDGE WAY RICHMOND, BC V6X 1Z9

TESTED BY:

CERTELECOM LABORATORIES INC. 3325 RIVER ROAD, R.R. 5 OTTAWA, ONTARIO K1V 1H2

JANUARY 1998

This document contains 30 pages including this one.

Certelecom Laboratories Inc. authorizes the above named company to reproduce this report provided it is reproduced in its entirety and for use by the company's employees only.

Any use which a third party makes of this report, or any reliance on or decisions to be made based on it, are the responsibility of such third parties. Certelecom Laboratories Inc. accepts no responsibility for damages, if any, suffered by any third party as a result of decisions made or actions based on this report.

This report applies only to the items tested.

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

EQUIPMENT DESCRIPTION:

900 MHz Cordless Telephone

MODEL NO .:

VT1901 / VT1920C

SERIAL NO.:

Base

Handset

261097002000002

2621097002000002

GENERAL:

The models VT1901 and VT1920c are identical other than VT1920c has LCD display and caller identification decoder.

These tests were conducted on a sample of the equipment for the purpose of demonstrating compliance with FCC Part 15 Subpart C, Paragraph 15.249.

ABSTRACT:

NAME OF TEST	PARA. NO.	RESULTS		
	HANDSET			
Radiated Emissions	15.249	Complies		
	BASE			
Radiated Emissions	15.249	Complies		
Powerline Conducted Emissions		Complies		

THIS TEST REPORT RELATES ONLY TO THE ITEM(S) TESTED.

THE FOLLOWING DEVIATIONS FROM, ADDITIONS TO, OR EXCLUSIONS FROM THE TEST SPECIFICATIONS HAVE BEEN MADE. None

TESTED BY:

Wayne Cłarke, Technologist

DATE: [CB17, 98

APPROVED BY:

W. Waterhouse, RF Engineering Lab Manager

DATE: 174 Teb 199R

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

General Equipment Information (HANDSET)

TRANSMITTER

Frequency Range:

925 - 928 MHz

Frequency of Sample Tested:

925.37 MHz, 927.17 MHz

Tunable Bands:

One

Number of Channels:

10

Channel Spacing:

200 kHz

Emission Designator:

102k5F1D

Crystal Frequencies:

18.25 MHz

User Frequency Adjustment:

None

RECEIVER

Type of Receiver:

Super Heterodyne

Intermediate Frequencies:

10.7 MHz

Primary Power Requirement:

NICAD Battery Pack

Frequency Range:

902.3 - 905 MHz

Tunable Bands:

One

Designated Reception Mode:

102k5F1D

Operating Frequency of Sample Tested:

902.35, 904.45 MHz

User Frequency Adjustment:

None

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

EQUIPMENT MODIFICATIONS

Introduction

The following is a summary, of the changes between the original PDL and the PDL MKII cordless telephone platforms. The purpose of the MKII is to perform a cost reduction as well as performance improvements over the MKI platform. This document will discuss the changes to handset and to the base unit separately in the following sections.

Handset Changes

Changes to the handset do not involve any exterior cosmetic or chassis changes. The PCB dimensions remain unchanged as well as most of the major component locations and general topology. There is no change to the antenna or antenna structure.

Handset Unit RF Circuit Changes

The RF changes do not significantly change the RF circuit layout - most changes are limited to component values only. The structure of the RF circuit, the RF shielding configuration (including the location of internal partition walls), and the IF and LO frequencies are not changed in any way. Frequency control of the on-board oscillators is via an unchanged reference frequency circuit, and an unchanged PLL.

Change	Reason For Change
 SAW Filter F3 is changed from a leaded to a surface mount package. 	Cost reduction, no performance change.
- Change Q2 from NE68139 to NE85630	Change package style for receiver LNA transistor for cost reduction. Transistor die remains the same.
- Change Q4 from NE85633 to NE85630	Change package style for 2 nd receiver amp for cost reduction. Transistor die remains the same.
- Change Q1 from BFR92A to 2SC4083	Change transistor in transmit amp for cost reduction. Transistor die does not remain the same; however, its performance for this application is similar to that provided by the original transistor.

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

Handset Unit RF Circuit Changes, continued

Change	Reason For Change
- Delete Q10, Q11 (BFR92A)	More detailed testing along with an improvement
- Delete R56, R544	in the minimum input level spec for synthesizer U2
- Change R55, R43, C80, C73 to Or	has revealed that the transmit and receive PLL
- Delete C25, C90	buffers Q10 and Q11 are not required. Identical
- Change R32, R41 from 470r to 300r	performance can be obtained eliminating Q10 &
,	Q11 and slightly increasing the input level by
	reducing R32 and R41.
- Change Q8 from BFR92A to 2SC4083	Change transistor in transmit VCO for cost
- Change R31 from 150r 1% to 100r 1%	reduction. Transistor die does not remain the
- Change R29 from 47 r to 24r	same; however, its performance for this application
	is similar to that provided by the original transistor.
	2 bias resistor changes were made to maintain
	system performance.
- Change Q9 from BFR92A to 2SC4083	Change transistor in receive VCO for cost
- Change R39 from 15k0 1% to 10k0 1%	reduction. Transistor die does not remain the
- Change R38 from 10k0 1% to 11k0 1%	same; however, its performance for this application
	is similar to that provided by the original transistor.
	2 bias resistor changes were made to maintain
	system performance
- Remove C49 tuning cap	Remove tuning capacitor from transmit VCO for
- Remove C53	cost reduction and to improve manufacturability
- Change C54 from 1p5 to N/U	and long-term reliability. Our manufacturing
- Change C52 from 7p5 to 4p7	process control has demonstrated that we can
- Change R58 from 3k9 to 1k8	remove the tuning capacitor from the VCO while
- Change C83 from 470n to 1u	maintaining the required level of performance.
- Change C84 from 100n to 220n	Removing the tuning cap eliminates any potential
	problems caused by drift and mechanical vibration.
	Surrounding capacitor and resistor changes are to
	compensate for the removal of the tuning cap.
- Remove C88 tuning cap	Remove tuning capacitor from transmit VCO for
- Remove C68	cost reduction and to improve manufacturability
- Change C69 from 4p7 to 10p	and long-term reliability. Our manufacturing
- Change C67 from 2p7 to 1p8	process control has demonstrated that we can
- Change R47 from 51k to 18k	remove the tuning capacitor from the VCO while
- Change C76 from 15n to 39n	maintaining the required level of performance.
- Change C89 from 4n7 to 12n	Removing the tuning cap eliminates any potential
	problems caused by drift and mechanical vibration.
	Surrounding capacitor and resistor changes are to
	compensate for the removal of the tuning cap

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

Handset Unit Audio Circuit Changes

The handset audio changes consist of changes to different packages and component substitutions to facilitate cost reductions.

Change	Reason For Change			
 C103 & C87 have been changed from an SMD to a leaded package (now C91 & C123) 	Cost reduction; no performance change.			
 U11 will be directly die-bonded to a small daughter PCB and soldered directly to the main PCB. 	Cost reduction; the exact same semiconductor die will be used, only the package is changed.			
 Voltage regulator U5 (NS LP2981) will be substituted with a Torex XC62AP30 (U6) 	Cost reduction; drop in replacement part.			
 C98, C94 changed from SMD to leaded capacitor (now C93, C99) C119 deleted 	Cost reduction.			

Base Unit Changes

Changes to the base do not involve any exterior cosmetic or chassis changes. There is no change to the antenna or antenna structure.

Changes to the base components are made to the RF circuit (the same changes as those made to the handset RF circuit), to the audio circuits and to the PCB construction. The original base unit consists of a single PCB that contains the RF, audio, and telephone line interface circuits. The revised base unit will contain 2 PCBs, splitting the telephone line interface from the RF and audio circuits.

Base Unit RF Circuit Changes

The RF changes made to the base unit do not significantly change the RF circuit layout - most changes are limited to component values only. The structure of the RF circuit, the RF shielding configuration (including the location of internal partition walls), and the IF and LO frequencies are not changed in any way. Frequency control of the onboard oscillators is via an unchanged reference frequency circuit, and an unchanged PLL.

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

Base Unit RF Circuit Changes, continued

Change	Reason For Change
 SAW Filter F3 is changed from a leaded to a surface mount package. 	Cost reduction, no performance change.
 Change Q2 from NE68139 to NE68130 (now Q24) 	Change package style for receiver LNA transistor for cost reduction. Transistor die remains the same.
- Change Q4 from NE85633 to NE85630	Change package style for 2 nd receiver amp for cost reduction. Transistor die remains the same.
- Change Q1 from BFR92A to 2SC4083	Change transistor in transmit amp for cost reduction. Transistor die does not remain the same; however, its performance for this application is similar to that provided by the original transistor.
 Delete Q10, Q11 (BRF92A) Delete R56, R44, R55, R43,C80, C73, C25 and C90 	More detailed testing along with an improvement in the minimum input level spec for synthesizer U2 has revealed that the transmit and receive PLL buffers Q10 and Q11 are not required.
- Change Q8 from BFR92A to 2SC4083	Change transistor in transmit VCO for cost reduction. Transistor die does not remain the same; however, its performance for this application is similar to that provided by the original transistor.
- Change Q9 from BFR92A to 2SC4083	Change transistor in transmit VCO for cost reduction. Transistor die does not remain the same; however, its performance for this application is similar to that provided by the original transistor.
 Remove C49 tuning cap Remove C53 Change C52 from 4p7 to 9p1 Change R58 from 3k9 to 1k8 Change C83 from 470n to 1u Change C84 from 100n to 220n 	Remove tuning capacitor from transmit VCO for cost reduction and to improve manufacturability and long-term reliability. Our manufacturing process control has demonstrated that we can remove the tuning capacitor from the VCO while maintaining the required level of performance. Removing the tuning cap eliminates any potential problems caused by drift and mechanical vibration. Surrounding capacitor and resistor changes are to compensate for the removal of the tuning cap.

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

Base Unit RF Circuit Changes, continued

Change	Reason For Change
- Remove C88 tuning cap	Remove tuning capacitor from transmit VCO for
- Remove C68	cost reduction and to improve manufacturability
- Change C69 from 4p7 to 10p	and long-term reliability. Our manufacturing
- Change C67 from 2p7 to 1p8	process control has demonstrated that we can
- Change R48 from 51k to 18k	remove the tuning capacitor from the VCO while
- Change C76 from 15n to 39n	maintaining the required level of performance.
- Change C89 from 4n7 to 12n	Removing the tuning cap eliminates any potential
- Change Gos Rom 12, to 122	problems caused by drift and mechanical vibration.
	Surrounding capacitor and resistor changes are to
	compensate for the removal of the tuning cap.

Base Unit Baseband Changes

Change	Reason For Change			
All components on the Line Interface PC8 are not leaded components (as opposed to SDM). All values are the same except as described below.	Cost reduction.			
 U8 will be directly die-bonded to a small daughter PCB and soldered directly to the main PCB. 	Cost reduction; the exact same semiconductor die will be used, only the packaging is changed.			
 Voltage regulator U6 (NS LP2981) will be substituted with a Torex XC6AP30 U9 	Cost reduction; drop in replacement part.			
 C120, C87 changed from SMD to leaded capacitor (now C91, C99) 	Cost reduction			
 Optocoupler U4 deleted Delete R46, R84, R85, R88, R86 and Q12 Change U10C to U10A 	Circuit simplification which will allow the ring detection to take place using the high input impedance OP-Amp circuit already in place for extracting type II CID information from tip and ring.			
 Change U10D to U1C on line interface PCB Delete Q14, R116 and R120 Delete U10 to U1 on the line interface PCB 	Designator and change to leaded on line interface PCB.			
Delete LM324 U9 and replace with an LM393 comparator U10	Replace LM324 where used as a comparator with an actual comparator for cost reduction.			

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

NAME OF TEST: Radiated Emissions (HANDSET)

PARA. NO.: 15.249(a) & (c)

TESTED BY: Wayne Clarke

DATE: January 29, 1998

TEST CONDITIONS:

Standard Temperature and Humidity

Standard Test Voltage

MINIMUM STANDARD:

Fundamental	Field Strength	Field Strength	Field	Field Strength
Frequency	of Fundamental	of Fundamental	Strength	of Spurious
(MHz)	(mV/m @ 3m)	(dBµV/m @	of Spurious	(dBµV/m @
, , ,		3m)	$(\mu V/m @ 3m)$	3m)
902 - 928	50	94	500	54

The fundamental was searched up to the 10th harmonic with all relevant emissions being noted.

Any emissions radiated outside the specified frequency band, except for harmonics shall be attenuated by at least 50 dB below the level of the fundamental emission or meet the following limits, whichever is the lesser attenuation.

Frequency	Field Strength	Field Strength
(MHz)	(μV/m @ 3m)	(db @ 3m)
30 - 88	100	40.0
88 - 216	150	43.5
216 - 960	200	46.0
Above 960	500	54.0

TEST RESULTS:

Complies. The worst-case emission level is 85.9 dB $\mu V/m$ @ 3m $\,$

at 925.37MHz. This is 8.1 dB below the specification limit.

MEASUREMENT DATA: See attached table.

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00


TESTED BY: Wayne Clarke			DATE: January 29, 1998			RECEIVER: ESVP 014					
E.U.T. M/N.: VT1920C			TEST DISTANCE(metres): 3			RBW: 120 kHz, 1 MHz					
E.U.T. S	S/N.: H	Iandset ((262109)	70020000	002) RA	NGE: A				OR: CISPI	
FREQ.	ANT.		ANT.	TABLE	RCVD	ANT.	AMP	DUTY	FIELD	LIMIT	MARGIN
	*		HGT		SIGNAL	FACTOR	GAIN	CYCLE			(IP)
(MHz)		(V/H)	(m)	(Deg.)	(dBuV)	(dB)**	(dB)	(dB)	(dBuV/m)	(dBuV/m)	(dB)
			<u></u>				***		05.0	0.4	8.1
925.37	Н	V			51.0	34.9			85.9	94	15.1
925.37	H	H			44.0	34.9			78.9	94	l
927.17	H	V			49.4	34.9			84.3	94	9.7
927.17	Н	H			48.2	34.9			83.1	94	10.9
*		V									
		H								· · · · · · · · · · · · · · · · · · ·	
		V									
		Н									
		V						<u> </u>			
	-	H									
 		V						[
-		H									
-		v	<u> </u>								
		Н	ļ								
		V	 - 								
		H		-			· · ·				
	 -	V	-			-					
	ļ	H	 								
		$\frac{1}{V}$		 							
-		H	 					·			
 	<u>-</u>	v	 				_				
	ļ	H	 								
	<u> </u>	V		 							
		H	 	 							
		V	ļ ———		<u> </u>						
								<u> </u>			
		H V									
<u></u>			 		 					<u> </u>	
NOTES	<u> </u>	Н	<u> </u>	<u></u>	L	l	L	1	l		


NOTES:


B/C = Biconical, B/L = Biconilog, L/P = Log-Periodic, H = Horn, D/P = Dipole


- Re-measured using dipole antenna.
- ** Includes cable loss when amplifier is not used.
- *** Includes cable loss.
 - () Denotes failing emission level.

^{*} The E.U.T. was searched to the 10th harmonic with no harmonics detected. The noise floor was sufficient to measure 20 dB down from limit.

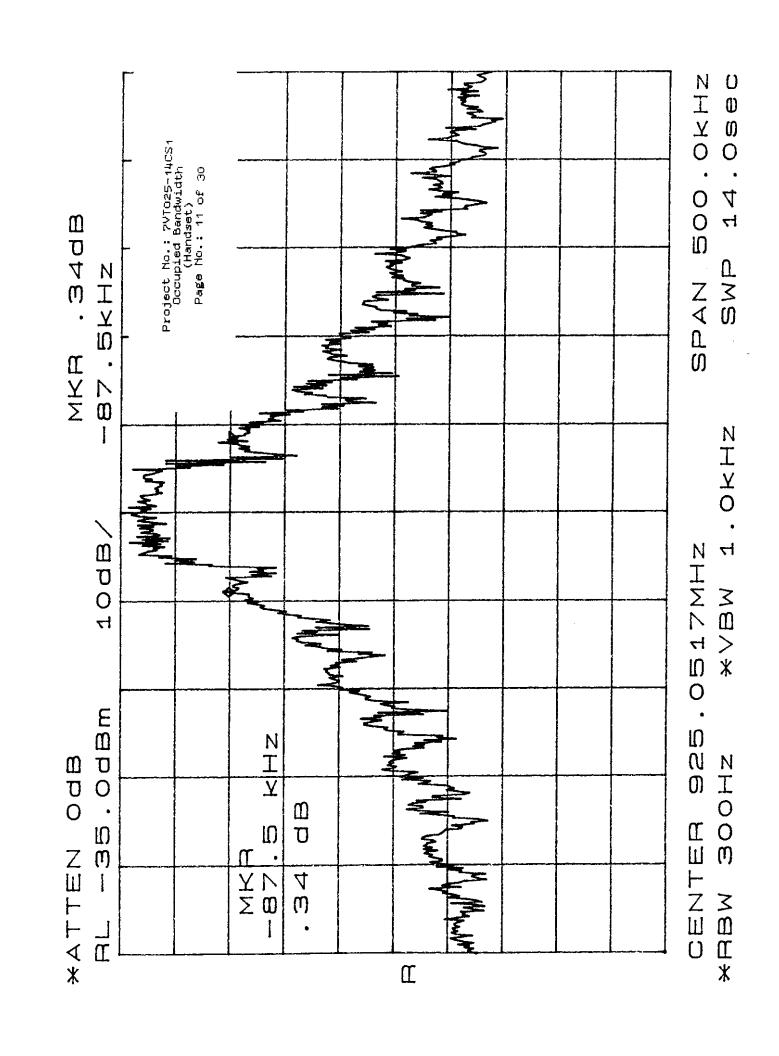

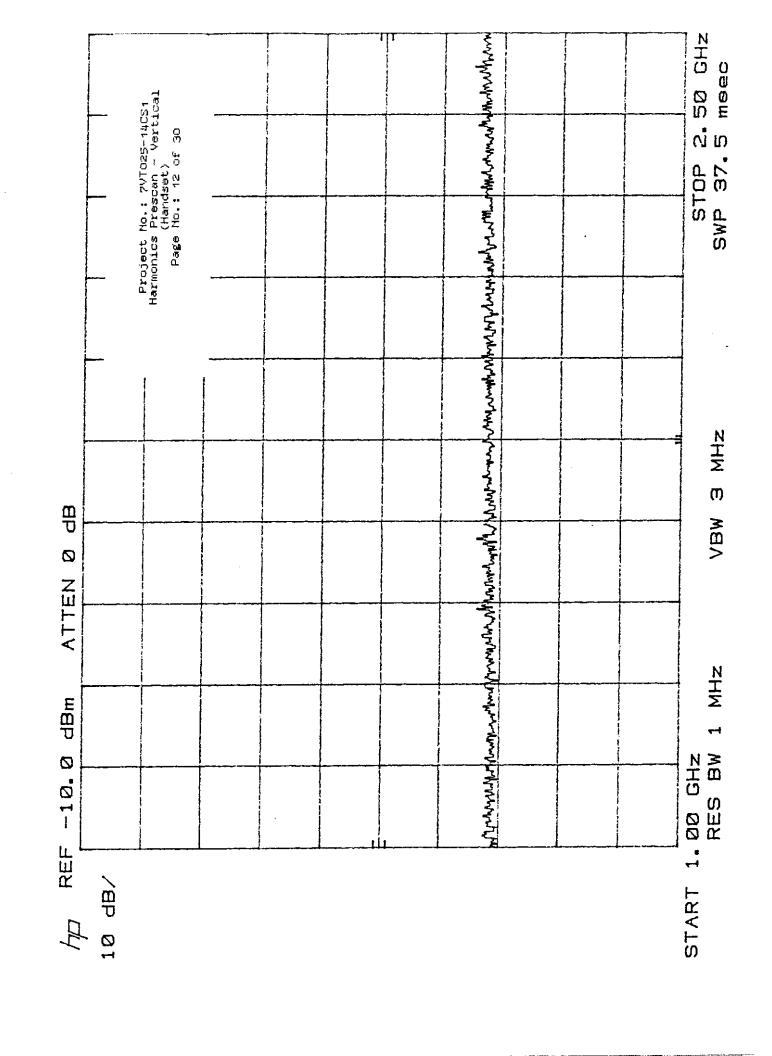

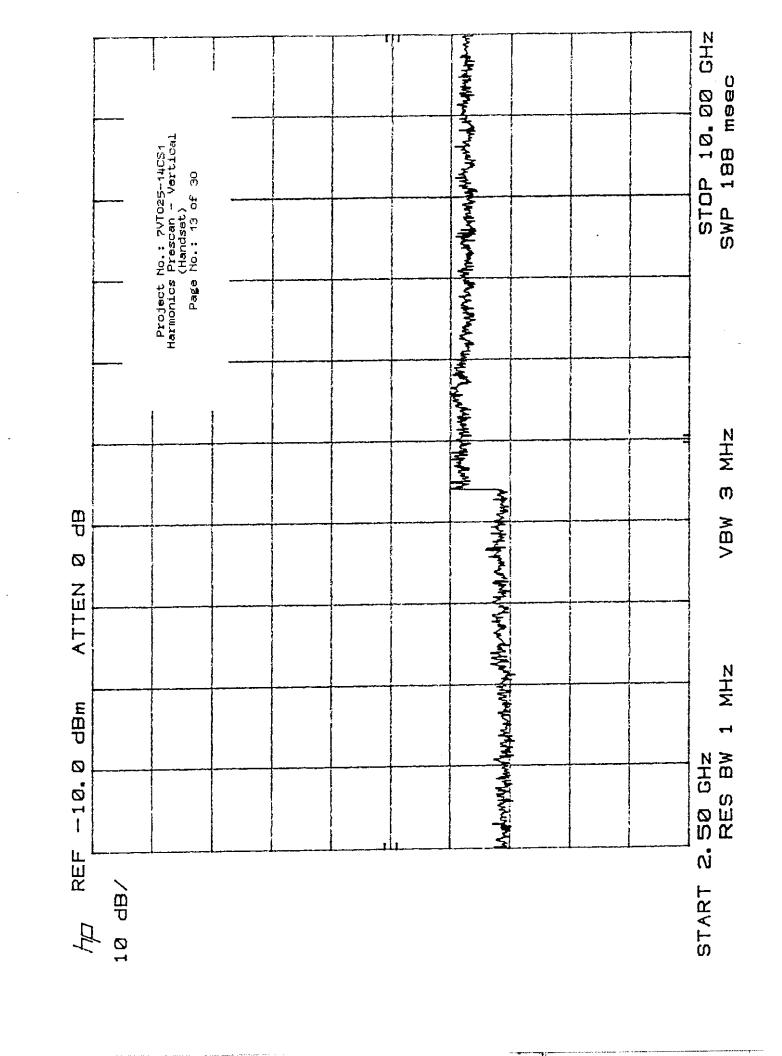

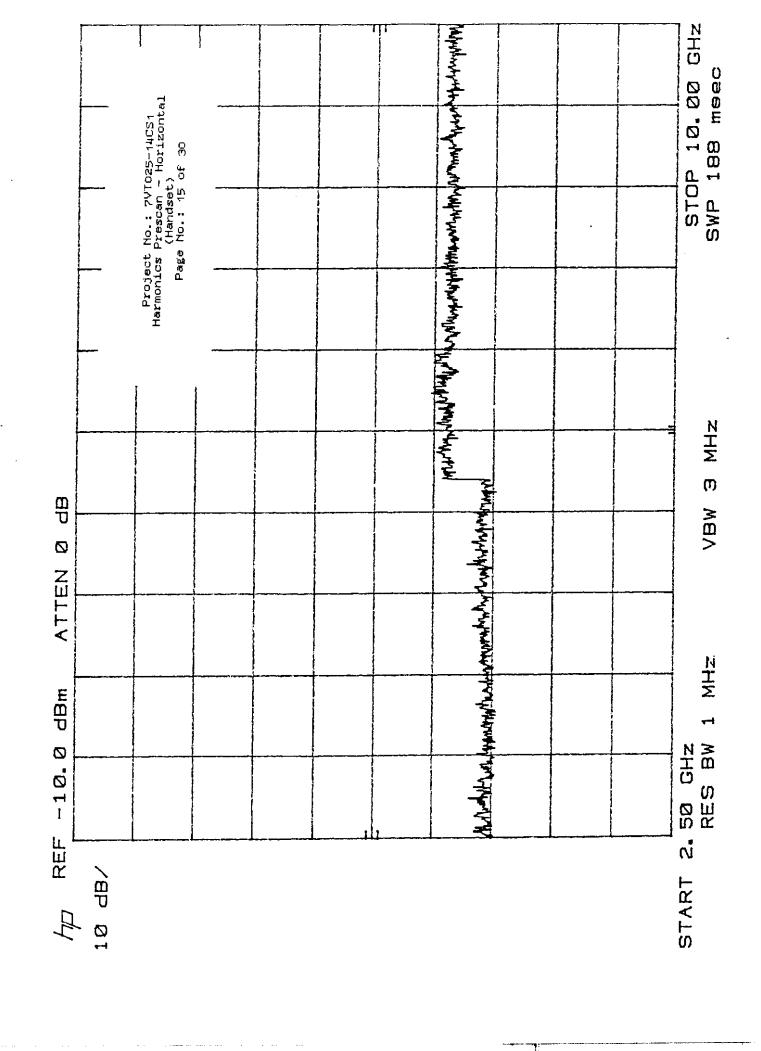

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

General Equipment Information (BASE)

TRANSMITTER

Frequency Range:

902.3 - 905 MHz

Frequency of Sample Tested:

902.35, 904.45 MHz

Tunable Bands:

One

Number of Channels:

10

Channel Spacing:

200 kHz

Emission Designator:

102k5F1D

Crystal Frequencies:

18.25, 3.58 MHz

User Frequency Adjustment:

None

RECEIVER

Type of Receiver:

Super Heterodyne

Intermediate Frequencies:

10.7 MHz

Primary Power Requirement:

120 VAC

Frequency Range:

925 - 927.75

Tunable Bands:

One

Designated Reception Mode:

102k5F1D

Operating Frequency of Sample Tested:

925.37, 927.17

User Frequency Adjustment:

None

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

NAME OF TEST: Radiated Emissions (BASE)

PARA. NO.: 15.249(a) & (c)

TESTED BY: Wayne Clarke

DATE: January 29, 1997

TEST CONDITIONS:

Standard Temperature and Humidity

Standard Test Voltage

MINIMUM STANDARD:

Fundamental	Field Strength of	Field Strength	Field Strength	Field Strength
Frequency	Fundamental	Fundamental of Fundamental		of Spurious
(MHz)	(mV/m @ 3m)	$(dB\mu V/m @ 3m)$	$(\mu V/m @ 3m)$	$(dB\mu V/m @ 3m)$
902 - 928	50	94	500	54

The fundamental was searched up to the 10th harmonic with all relevant emissions being noted.

Any emissions radiated outside the specified frequency band, except for harmonics shall be attenuated by at least 50 dB below the level of the fundamental emission or meet the following limits, whichever is the lesser attenuation.

Frequency (MHz)	Field Strength (μV/m @ 3m)	Field Strength (db @ 3m)
30 - 88	100	40.0
88 - 216	150	43.5
216 - 960	200	46.0
Above 960	500	54.0

TEST RESULTS:

Complies. The worst-case emission level is 86.3 dB $\mu V/m$ @ 3m $\,$

at 904.45 MHz. This is 7.7 dB below the specification limit.

MEASUREMENT DATA: See attached table.

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00


TESTE	D BY:	Wayne (Clarke		DA	TE: Januar	v 29, 199	8	RECEIV	ER: ESVP	014		
		VT19200				ST DISTAN		RBW: 120 kHz, 1 MHz					
		Base (261		000002)		NGE: A			DETECTOR: CISPR				
FREQ.	ANT.		ANT.	TABLE		ANT.	AMP	DUTY	FIELD	LIMIT	MARGIN		
	*		HGT		SIGNAL	FACTOR	GAIN	CYCLE	STRENGTH	•			
(MHz)		(V/H)	(m)	(Deg.)	(dBuV)	(dB)**	(dB)	(dB)	(dBuV/m)	(dBuV/m)	(dB)		
` .							***						
902.35	H	V			51.5	34.5			86.0	94.0	8.0		
902.35	Н	Н			44.5	34.5			79.0	94.0	15.0		
904.45	Н	V		-	51.8	34.5			86.3	94.0	7.7		
904.45	Н	Н			44.7	34.5			79.2	94.0	14.8		
*		V			_								
		H											
		v	-										
		Н											
		V											
		Н											
	-	V											
		Н											
		v											
		Н											
		V											
		Н											
		V											
		Н											
		v											
		H											
		V											
		H											
		$\frac{1}{v}$				·							
		H											
		- <u>v</u> -											
-		V									-		
		H											
NOTES		11		<u> </u>						L			

NOTES:

B/C = Biconical, B/L = Biconilog, L/P = Log-Periodic, H = Horn, D/P = Dipole

- * Re-measured using dipole antenna.
- ** Includes cable loss when amplifier is not used.
- *** Includes cable loss.
 - () Denotes failing emission level.

^{*} The E.U.T. was searched to the 10th harmonic with no harmonics detected. The noise floor was sufficient to measure 20 dB down from limit.

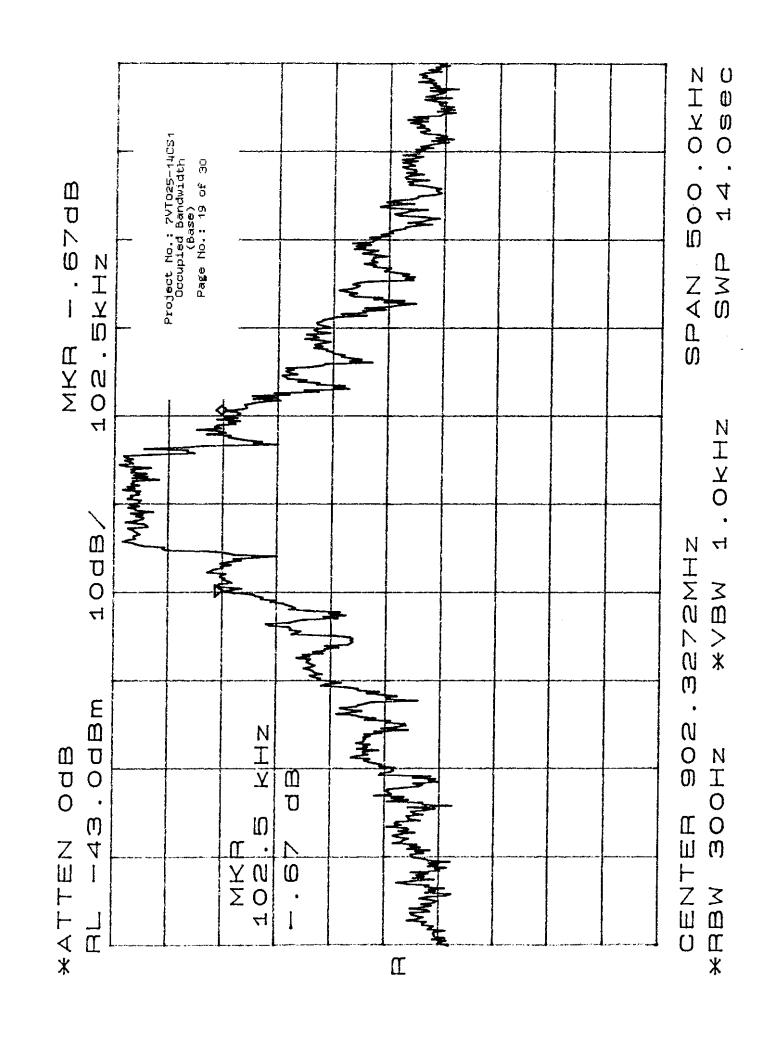

	! ~!					Annia Santania Ja			- 1
	. No.: ?VTO25-14CS1 s Prescan - Vertical (Base) e No.: 20 of 30		Appropriate in the control of the co			horal-Ungravit			C
	ject No.: ?v] nics Prescan (Base) Page No.: 20		7.	F		Arend Man Stee	Andread of the fact of the control o		acta
	Project Harmonics Page					ละใปเมในการใก			
	name of the second seco					Jack My New Jone			
						1-4-4/8-4-14-4-1-4-1-4-1-4-1-4-1-4-1-4-1-4-1-4		The state of the s	110
						And by Ball			
						AN LANGE AND			
						Jacky My My My			and a second of the second of
						Money by Mary many many many many many many many man			DO GHZ
		_		.	<u> </u>		 		1.
10 dB/									START


, ...

, ...,


.


Some


Section 200

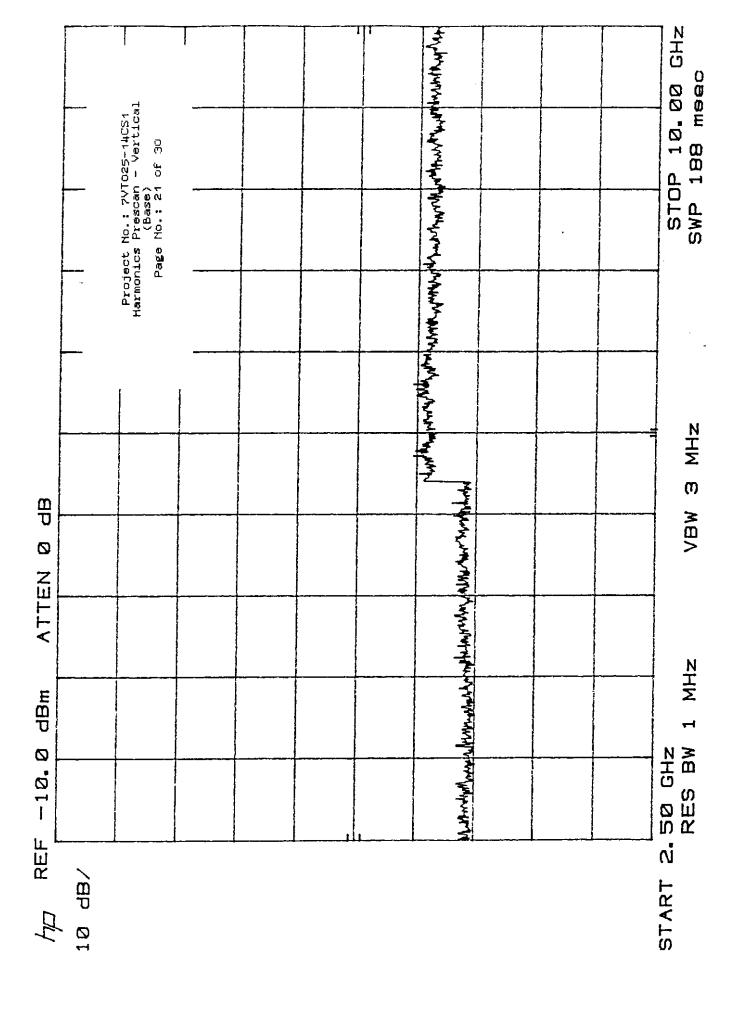

						Anthone	and of the same of	50 GHz
		7VTozs-14CS1 an - Horizontal se) 22 of 30				Mary Charles and the contraction of		STOP 2. 5
		No.: 7VTO2 Prescan - F (Base) (Base)	***************************************			Jan Mary		SWP
		Project No.: 7VT Harmonics Prescen - (Base) Page No.: 22			*	Allega A. Landerson	i	e productiva de la companya de la co
			1			- Andrody Reserved		N
dB						A Shark Walland And And And And And And And And And A		 V 3 MHz
Ø						A STANCE OF THE		VBV
ATTEN						John Lower Top Rogers		ħ
Ø dBm						orme southwelf god and fine of spectage traff or the source for		w 1 MHz
-10.0				•		a mondowly		ØØ GHZ RES BW
HD REF	10 dB/							START 1.

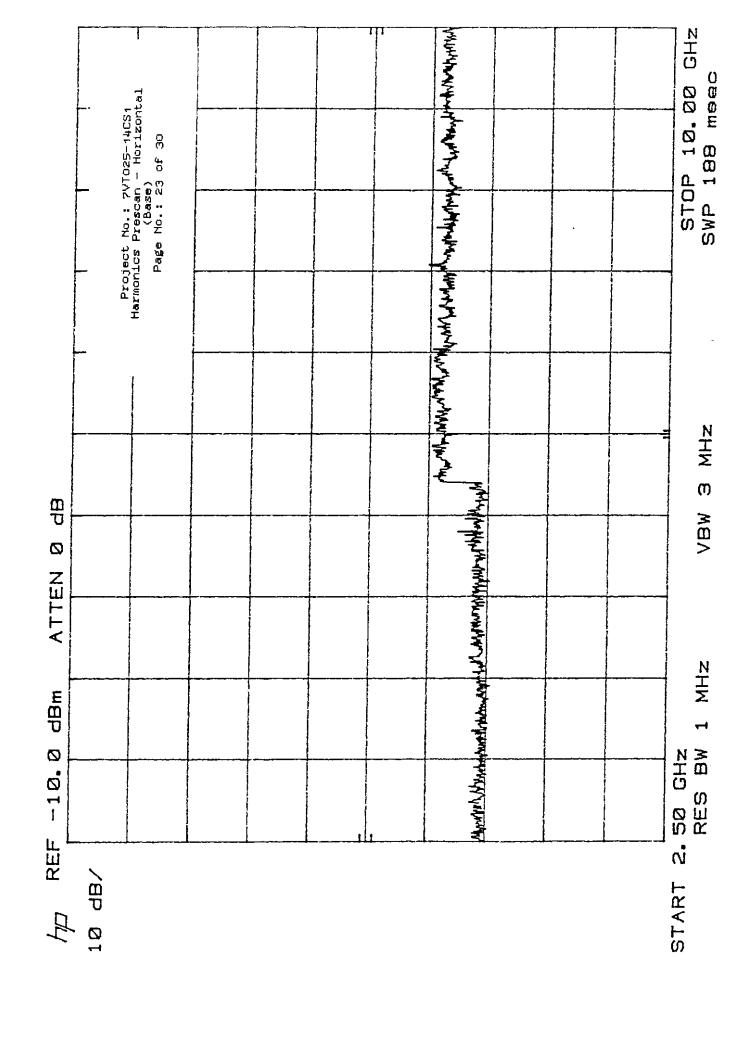

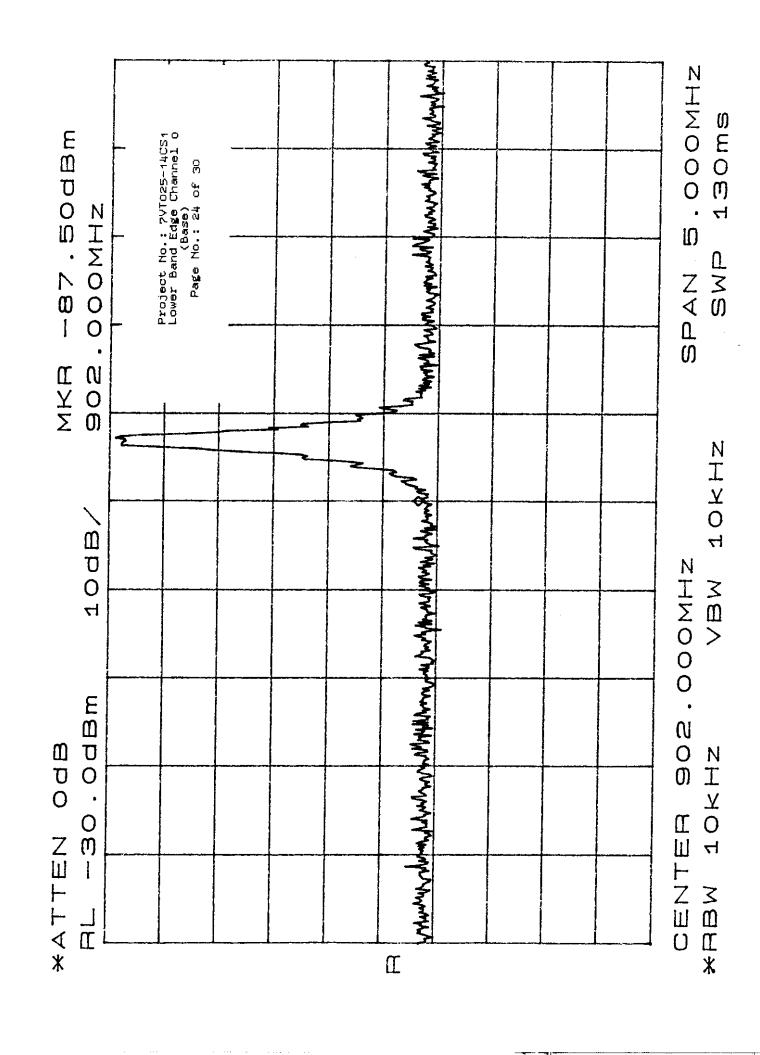

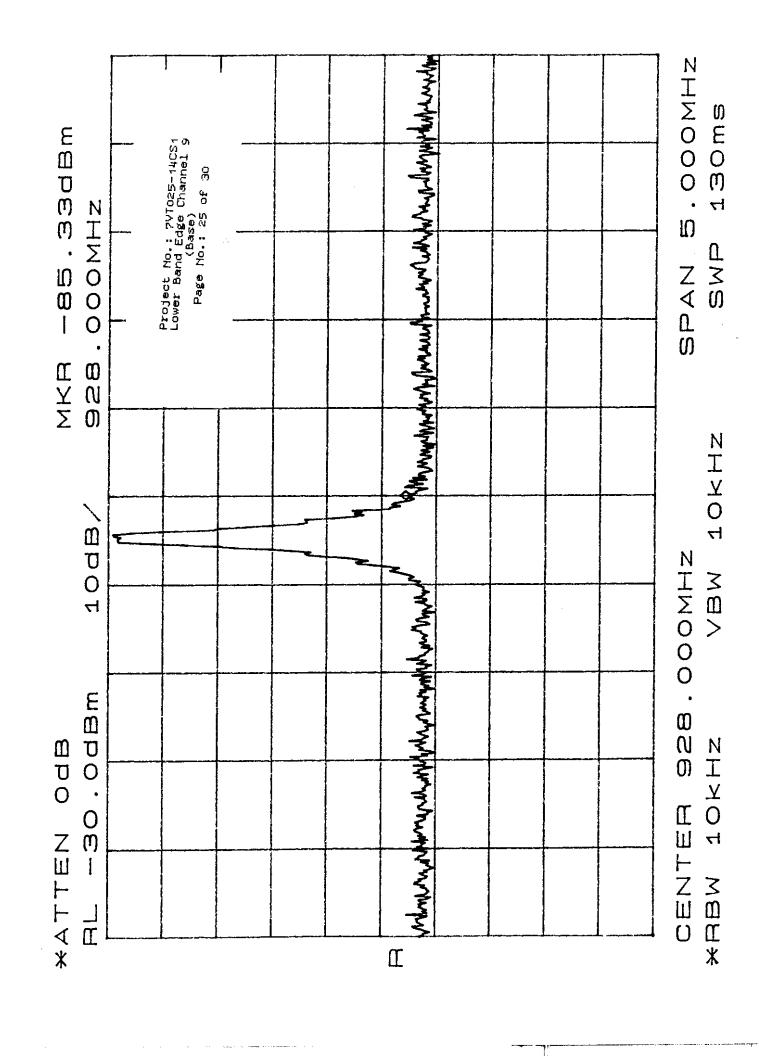

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

NAME OF TEST: Powerline Conducted Emissions

PARA. NO.: 15.207(a)

TESTED BY: Wayne Clarke

DATE: January 27, 1998

TEST CONDITIONS:

Standard Temperature and Humidity

Standard Test Voltage

MINIMUM STANDARD:

The R.F. that is conducted back onto the AC power line on any

frequency within the band 0.45 to 30 MHz shall not exceed


 $250\mu V$ (48 dB μV) across 50 ohms.


TEST RESULTS:

Complies. See attached graphs.

MEASUREMENT DATA:

See attached graphs.

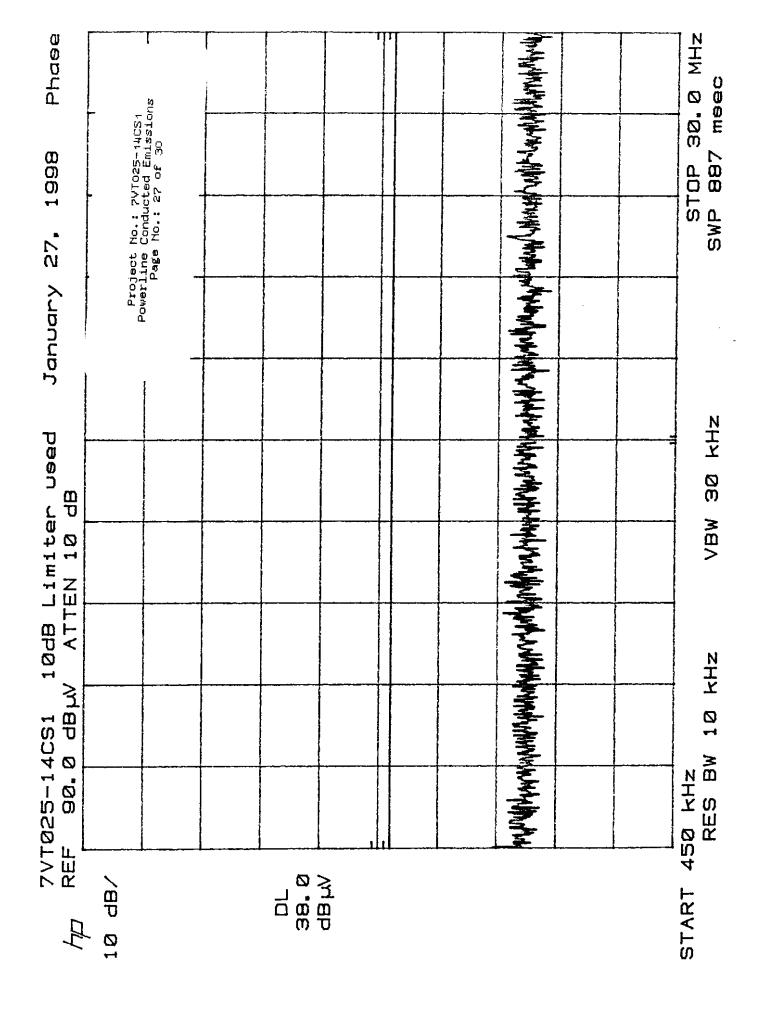

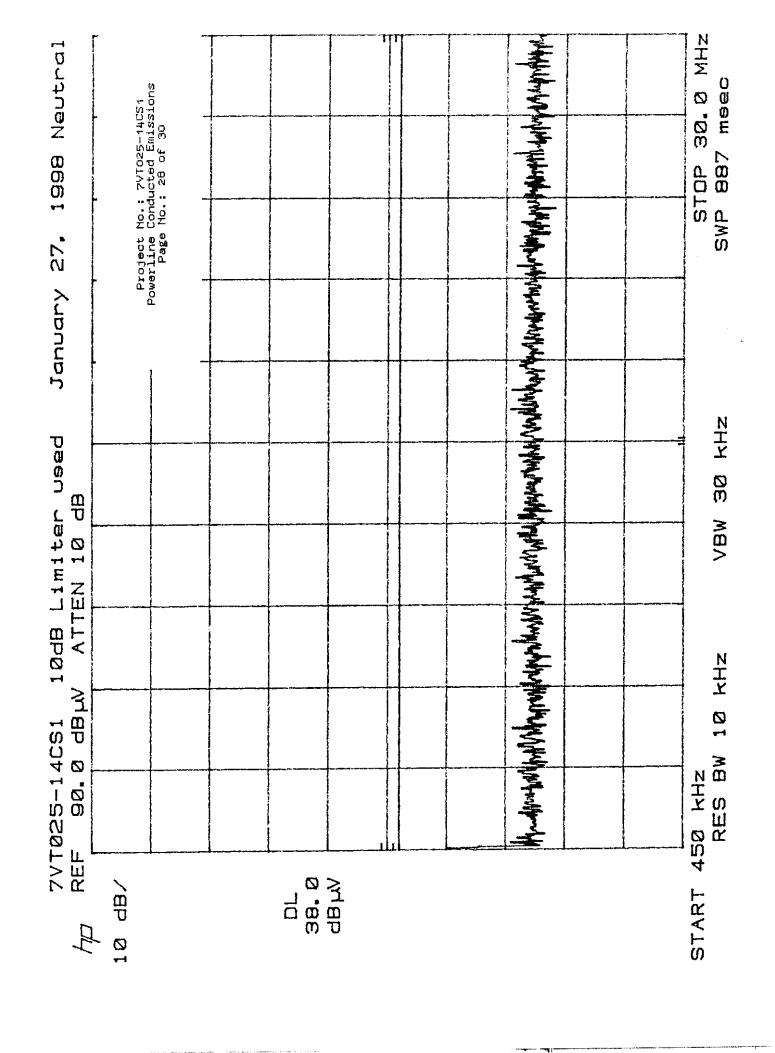

Sec. 1


FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone


FCC ID: EW780-4042-00

Block Diagrams

TEST SITE FOR RADIATED EMISSIONS

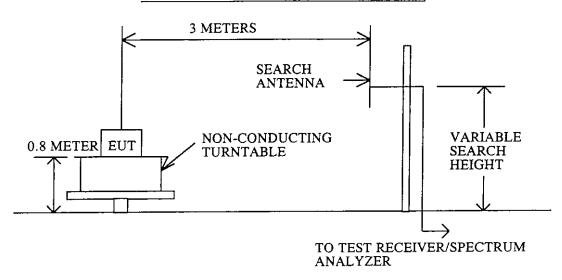

CONDUCTED EMISSIONS



SHIELDED ROOM

FCC PART 15, SUBPART C PROJECT NO.: 7VT025-14CS1

EQUIPMENT: VT1901 / VT1920C Cordless Telephone

FCC ID: EW780-4042-00

RADIO TEST EQUIPMENT LIST

CAL	EQUIPMENT	MANUFACTURER	MODEL	SERIAL	LAST	NEXT
CYCLE					CAL.	CAL.
	Plotter	Hewlett Packard	7470A	2308A30807	NCR	NCR
1 Year	Spectrum Analyzer	Hewlett Packard	8566B	2311A02238	Sept. 30/97	Sept. 30/98
1 Year	Spectrum Analyzer Display	Hewlett Packard	8566B	2314A04759	Sept. 30/97	Sept. 30/98
1 Year	Spectrum Analyzer	Hewlett Packard	8566B	1950A00400	Oct. 3/97	April 3/98
l Year	Spectrum Analyzer Display	Hewlett Packard	8566B	1950A01177	Oct. 3/97	April 3/98
1 Year	Quasi Peak Adaptor	Hewlett Packard	8565B	2251A00620	Aug. 19/97	Feb. 19/98
1 Year	LISN	Rohde & Schwarz	ESH2-Z5	890485/017	July 25/97	July 25/98
1 Year	Receiver	Rohde & Schwarz	ESVP	892661/014	Mar. 25/97	Mar. 25/98
	Biconilog Antenna	EMCO	3143	1038	NCR	NCR
2 Year	Horn Antenna	EMCO #1	3115	3132	Feb. 5/96	Feb. 5/98
l Year	Dipole Antenna Set	EMCO	3121C	1029	Oct. 28/97	Oct. 28/98
1 Year	Low Noise Amplifier	Avantek	AWT-8035	1005	Oct. 24/97	Oct. 24/98

NA: Not Applicable NCR: No Cal Required