

849 NW State Road 45 Newberry, FL 32669 USA Phone: 888.472.2424 or

352.472.5500

Email: <a href="mailto:info@timcoengr.com">info@timcoengr.com</a>
Website: <a href="mailto:www.timcoengr.com">www.timcoengr.com</a>

# FCC PART 15.109 RADAR DETECTOR REPORT

Applicant	COBRA ELECTRONICS CORPORATION		
Address	6500 WEST CORTLAND STREET		
	CHICAGO IL 60707		
Product Model Number	SPX 6655IVT		
Product Description	RADAR DETECTOR		
FCC ID:	BBOSPX6655A		
Date Sample Received	3/19/2018		
Date Tested	3/21/2018		
Tested By	Tim Royer		
Approved By	Franklin Rose		

Report	Version	Description	Issue Date	
Number	Number			
396UT18TestReport	Rev1	Initial Issue	03/21/2018	
396UT18TestReport	Rev2	Correction in signature	03/30/2018	

THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.

# **TABLE OF CONTENTS**

SENERAL REMARKS	3
SENERAL INFORMATION	.4
EST RESULTS SUMMARY	4
ADIATED SPURIOUS EMISSIONS	5
ADIATED SPURIOUS EMISSIONS	6
Test Data: Peak Plot	.7
EST EQUIPMENT LIST	.8



### **GENERAL REMARKS**

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

### **Summary**

The	device under test does:
$\boxtimes$	Fulfill the general approval requirements as identified in this test report and
	was selected by the customer.
	Not fulfill the general approval requirements as identified in this test report

#### **Attestations**

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025 requirements.

I attest that the necessary measurements were made at:

Timco Engineering Inc. 849 NW State Road 45 Newberry, FL 32669



Tested by:

Name and Title: Tim Royer, Project Manager/Testing Engineer

Date: 3/21/2018

Reviewed and approved by:

Name and Title: Franklin Rose, Project Manager / EMC Testing Technician

Date: 03/27/2018

Applicant: COBRA ELECTRONICS CORPORATION <u>TABLE OF CONTENTS</u>

FCC ID: BBOSPX6655A

Report: 396UT18TestReport\_Rev1 Page 3 of 8



### **GENERAL INFORMATION**

**EUT Specification** 

EUT Description	RADAR DETECTOR		
FCC ID	BBOSPX6655A		
Model Number	SPX 6655IVT		
Operating Frequency	10.525GHz(X-Band), 24.150 GHz (K-Band), 33.4- 36.0G Hz (Ka Band)		
	☐ 110-120Vac/50- 60Hz		
EUT Power Source	☑ DC Power 12V		
	☐ Battery Operated Exclusively		
	☐ Prototype		
Test Item	☐ Pre-Production		
Type of Equipment	Fixed		
	☐ Portable		
	Temperature: 24-26°C		
Test Conditions	Relative humidity: 50-65%		
	Barometric Pressure: 30.01"		
Modification to the EUT	None		
Test Exercise	se The EUT was operated in a normal mode.		
Applicable Standards	ls FCC Pt 15.109		
Test Procedure	ure ANSI C63.4: 2014		
	Timco Engineering, Inc.		
Test Site	849 NW State Road 45		
	Newberry, FL 32669		
	Designation #: US1070		

# **TEST RESULTS SUMMARY**

The test results relate only to the items tested.			
FCC Rules Part No.	RESULTS Pass/Fail/NA		
15.109 Radiated Emissions	Pass		

Applicant: COBRA ELECTRONICS CORPORATION <u>TABLE OF CONTENTS</u>

FCC ID: BBOSPX6655A

Report: 396UT18TestReport\_Rev1 Page 4 of 8



TABLE OF CONTENTS

### RADIATED SPURIOUS EMISSIONS

**Rules Part No.:** 15.109 (h)

Requirements:

Frequency	Limits
11.7 to 12.2GHz	54.0 dBµV/m measured @ 3 meters

**Test Procedure:** Measurements in the 11.7 to 12.2GHz band were made with a Standard Gain Horn. The measurements in the 11.7 to 12.2GHz band represent the ambient noise levels. The attached plots were made with peak detector with the analyzer in a maximum hold for 2 minutes.

Testing was done in accordance with the standard list above & 15.35(b) specifies the use of an average detector in this band. In addition, the peak level of an emission shall not exceed the average limit by more than 20 dB using a minimum Resolution Bandwidth (RBW) of 1 MHz and minimum Video Bandwidth (VBW) OF 1 MHz. The following procedure is designed to determine if there are any spurious emissions from the local oscillator within the band of interest along with any additional spurious emissions caused by other circuitry within the device.

1) Determine the frequency of the peak emission:

Start Frequency 11.7 GHz

Stop Frequency 12.2 GHz

RBW equal to or greater than 1 MHz

VBW equal to or greater than 1 MHz

**Detector Function Peak** 

Maximize the emissions with regards to device orientation, antenna polarization, and antenna height. Sweep the band using Max Hold for a minimum of 2 minutes. Record this frequency for measuring the peak emission. In addition record the frequency of other spurious emissions noted.

Applicant: COBRA ELECTRONICS CORPORATION

FCC ID: BBOSPX6655A

Report: 396UT18TestReport\_Rev1 Page 5 of 8



# RADIATED SPURIOUS EMISSIONS Test Procedure (Cont.):

2) Determine the peak level of the emission:

Center Frequency Set to the frequency determined in Step 1 RBW Equal to or greater than 1 MHz VBW Equal to or greater than 1 MHz Detector Function Peak Measure the value of the peak emission using Max Hold for a minimum of 2 minutes. This can be done at zero spans or a frequency span where the analyzer does not show a "Measurement Uncalibrated" message. Record the peak value. If the peak measurement is compliant with the average limit an average measurement is not necessary. If the peak value exceeds the average limit by less than 20 dB proceed to Step 3.

3) Determine the average level of the emission:

Center Frequency Set to the frequency determined in Step 1 Span Zero

RBW Equal to or greater than 1 MHz

VBW Equal to or greater than 10 Hz

**Detector Function Peak** 

This measurement uses video averaging and must be done in linear mode. The analyzer Reference Level is adjusted so that a signal is clearly visible on the screen. Measure the value of the emission using Max Hold for a minimum of 2 minutes. Record this as the average value. Step 2 and Step 3 should be repeated for other spurious emissions.

**Formula of Conversion Factors:** The field strength at 3m was established by adding the meter reading of the spectrum analyzer (which is set to read in units of dBuV) to the antenna correction factor supplied by the antenna manufacturer. The antenna correction factors are stated in terms of dB. The gain of the preselector was accounted for in the spectrum analyzer meter reading.

### Example:

Freq (MHz) Meter Reading + ACF + CL = FS 33 20 dBuV + 10.36 dB/m + 0.40 dB = 30.36 dBuV/m @ 3m

**MEASUREMENT PROCEDURES:** The unit under test was placed on a table 80 cm high and with dimensions of 1m by 1.5m. The table used for radiated measurements is capable of continuous rotation. When an emission was found, the table was rotated to produce the maximum signal strength. At this point, the antenna was raised and lowered from 1m to 4m. The antenna was placed in both the horizontal and vertical planes.

Applicant: COBRA ELECTRONICS CORPORATION TABLE OF CONTENTS


FCC ID: BBOSPX6655A

Report: 396UT18TestReport\_Rev1 Page 6 of 8



### RADIATED SPURIOUS EMISSIONS

TEST DATA: **PEAK PLOT** 

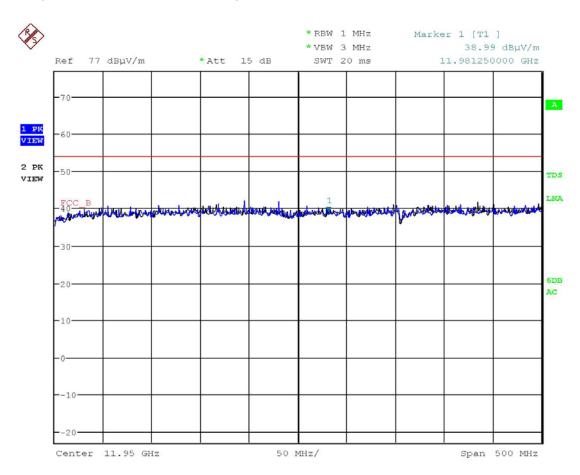

Date: 21.MAR.2018 07:19:52

Ant Polarity: T1 (Blue) = Vertical, T2 (Black) = Horizontal

### Notes:

No emissions were found in excess of the reported noise figures in the plot above.

# **Results - Meets Requirements**

COBRA ELECTRONICS CORPORATION Applicant:

FCC ID: BBOSPX6655A

Report: 396UT18TestReport\_Rev1 Page 7 of 8

**TABLE OF CONTENTS** 



**TABLE OF CONTENTS** 

### **TEST EQUIPMENT LIST**

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
DC Power Supply	HP	6286A	2411A09414	N/A	N/A
CHAMBER	Panashield	3M	N/A	04/25/16	03/31/18
Antenna: Double- Ridged Horn/ETS Horn 2	ETS-Lindgren	3117	00041534	03/01/17	03/01/19
Software: Field Strength Program	Timco	N/A	Version 4.10.7.0	N/A	N/A
EMI Test Receiver R & S ESU 40 Chamber	Rohde & Schwarz	ESU 40	100320	04/01/16	04/01/18
Coaxial Cable - Chamber 3 cable set (Primary)	Micro-Coax	Chamber 3 cable set (Primary)	KMKM-0244- 01; KMKM- 0670-00; KFKF-0198- 01	08/09/16	08/09/18
Bore-sight Antenna Positioning Tower	Sunol Sciences	TLT2	N/A	N/A	N/A
Pre-amp	RF-LAMBDA	RLNA00M45GA	NA	01/04/16	01/04/19

### \*EMI RECEIVER SOFTWARE VERSION

The receiver firmware used was version 4.43 Service Pack 3

END OF TEST REPORT

COBRA ELECTRONICS CORPORATION Applicant:

FCC ID: BBOSPX6655A

Report: Page 8 of 8

396UT18TestReport\_Rev1