

# TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)



## Test Report

Product Name: WIRELESS MICROPHONE

FCC ID: BZB51HT

Applicant:

**AZDEN CORPORATION  
147 NEW HYDE PARK ROAD  
FRANKLIN SQUARE, NY 11010**

**Date Receipt: JULY 13, 2004**

**Date Tested: JULY 28, 2004**

**APPLICANT: AZDEN CORPORATION**

**FCC ID: BZB51HT**

**REPORT #: A\AZDEN\1083AUT4\1083AUT4\TestReport.doc**

**COVER SHEET**

# TIMCO ENGINEERING INC.

849 NW State Road 45  
Newberry, Florida 32669  
<http://www.timcoengr.com>  
888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

## TABLE OF CONTENTS LIST

### TEST REPORT CONTAINING:

PAGE 1.....	GENERAL INFORMATION & TECHNICAL DESCRIPTION
PAGE 2.....	TECHNICAL DESCRIPTION RF POWER OUTPUT
PAGE 3.....	MODULATION LIMITING CHARACTERISTICS AUDIO FREQUENCY RESPONSE GRAPH
PAGE 4.....	MODULATION LIMITEING GRAPH AUDIO LOW PASS FILTER GRAPH
PAGE 5.....	OCCUPIED BANDWIDTH
PAGE 6.....	OCCUPIED BANDWIDTH PLOT
PAGE 7.....	RADIATED EMISSIONS TEST DATA
PAGE 8.....	METHOD OF MEASURING RADIATED SPURIOUS EMISSIONS
PAGE 9.....	FREQUENCY STABILITY TEST DATA
PAGE 10-11.....	EQUIPMENT LIST

### EXHIBITS CONTAINING:

BLOCK DIAGRAM  
SCHEMATICS  
PARTS LIST  
USERS MANUAL  
LABEL SAMPLE  
LABEL LOCATION  
EXTERNAL PHOTOGRAPHS  
INTERNAL PHOTOGRAPHS  
TUNING PROCEDURE  
CIRCUIT DESCRIPTION  
TEST SET UP PHOTOGRAPH

**APPLICANT:** AZDEN CORPORATION  
**FCC ID:** BZB51HT  
**REPORT #:** A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

**TABLE OF CONTENTS**

# TIMCO ENGINEERING INC.

849 NW State Road 45  
Newberry, Florida 32669  
<http://www.timcoengr.com>  
888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

## GENERAL INFORMATION REQUIRED FOR TYPE ACCEPTANCE

2.1033(c)(1) AZDEN CORPORATION will manufacture the 51HT in  
2.1033(c)(2) quantity, for use under FCC RULES PART 74.801,  
LOW POWER AUXILIARY STATIONS.

AZDEN CORPORATION  
147 NEW HYDE PARK ROAD  
FRANKLIN SQUARE, NY 11010

## 2.1033 TECHNICAL DESCRIPTION

- (c)(3) Instruction book. The instruction manual is included in the exhibits.
- (c)(4) Type of Emission: 120K0F3E  
Bn = 2M + 2DK  
M = 20000  
D = 40kHz(Peak Deviation)  
K = 1  
Bn = 2(20k) + 2(40k)(1) = 120k
- 74.861 (e)(5) ALLOWED AUTHORIZED BANDWIDTH = 200kHz.
- (c)(5) Frequency Range: 793 - 806 MHz
- (c)(6) Power Range and Controls: UNIT has no controls.
- (c)(7) Maximum Output Power Rating: .020 Watts into 50 ohms resistive load.
- (c)(8) DC Voltages and Current into Final Amplifier:  
FINAL AMPLIFIER ONLY  
Vce = 3.80 Volts  
Ice = 0.12 mA.  
Pin = 0.47 Watts
- (c)(9) Tune-up procedure. The tune-up procedure is given in the exhibits.
- (c)(10) Complete Circuit Diagrams: The circuit diagram and block diagram are included in the exhibits.

**APPLICANT:** AZDEN CORPORATION

**FCC ID:** BZB51HT

**REPORT #:** A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

- 2.1033(c)(11) Photo or drawing of label and sketch of location are included in the exhibits.
- 2.1033(c)(12) Photos of the equipment are included in the exhibits.
- (c)(13) Description of all circuitry and devices provided for determining and stabilizing frequency.
- Description of any circuits or devices employed for suppression of spurious radiation, for limiting modulation, and for limiting power.
- This circuitry is included in the exhibits.,
- Limiting Modulation: The microphone element make the unit self limiting.
- Limiting Power:  
There is no provision for limiting power.
- (13) Digital modulation. This unit does not use digital modulation.
- 2.1033(c)(14) The data required by 2.1046 through 2.1057 is submitted below.


2.1046

## **RF power output**

RF power measured is:

OUTPUT POWER: .051 WATTS ERP

## **R.F. POWER OUTPUT TEST PROCEDURE**

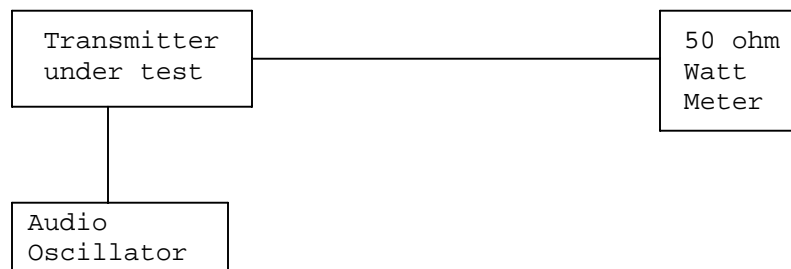

**APPLICANT:** AZDEN CORPORATION

**FCC ID:** BZB51HT

**REPORT #:** A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.


849 NW State Road 45  
Newberry, Florida 32669  
<http://www.timcoengr.com>  
888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

## 2.1047(a)(b) Modulation characteristics:

### AUDIO FREQUENCY RESPONSE

The audio frequency response was measured in accordance with TIA/EIA Specification 603. The audio frequency response curve is shown below.

## 1083AUT4 Audio Frequency Response

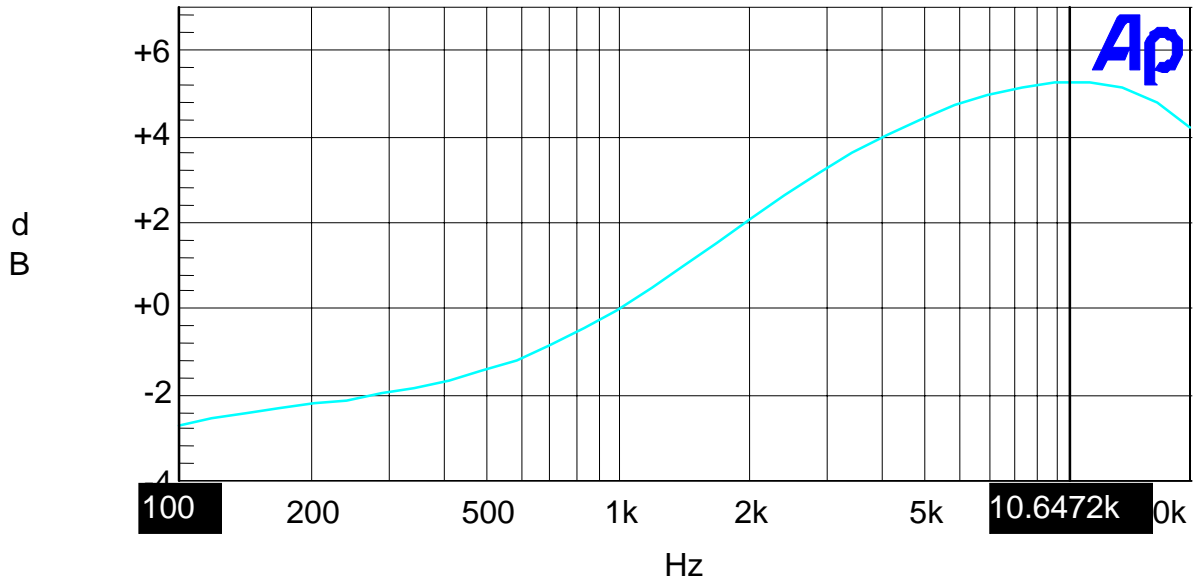

APPLICANT: AZDEN CORPORATION

FCC ID: BZB51HT

REPORT #: A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.

849 NW State Road 45  
Newberry, Florida 32669  
<http://www.timcoengr.com>  
888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)


2.1047(b)  
74.861 (d)

## Audio input versus modulation

A plot of the audio input versus deviation is shown below.

### 1083AUT4 Modulation Limiting

blue 2.5K, green 1K, yellow 300Hz

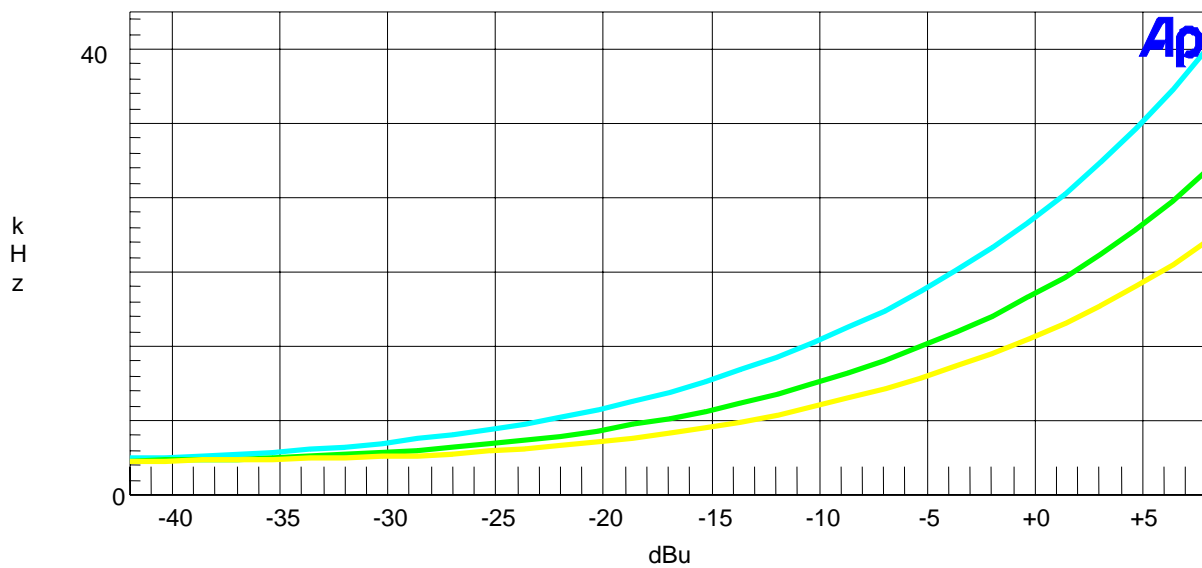

### AUDIO LOW PASS FILTER

The audio low pass filter is not required in this unit.

APPLICANT: AZDEN CORPORATION

FCC ID: BZB51HT

REPORT #: A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.

849 NW State Road 45  
Newberry, Florida 32669  
<http://www.timcoengr.com>  
888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)


## 2.1049(c) Occupied Bandwidth:

Data in the plots show that all sidebands between 50 & 100% for the authorized bandwidth are attenuated by at least 25dB. From 100 to 250% of the authorized bandwidth they are attenuated by at least 35dB and beyond 250%  $43 \log(P_o)$  dB. The plot shows the transmitter modulated with 15000 Hz (the highest modulation frequency), adjusted for 50% modulation plus 16 dB. The spectrum analyzer was set with the un-modulated carrier at the top of the screen. The test procedure diagram and occupied bandwidth plots follow.

### Wireless Microphone transmitter:

Test procedure diagram

### OCCUPIED BANDWIDTH MEASUREMENT

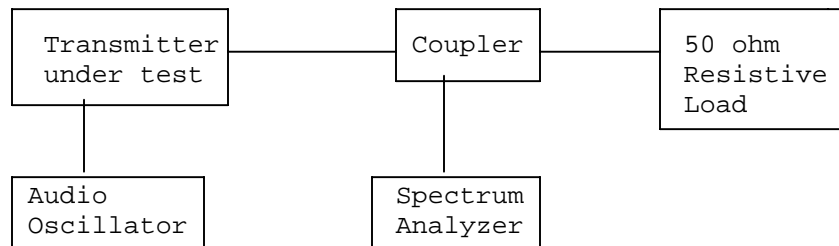

**REQUIREMENT: PART 74: 200kHz EMISSION BANDWIDTH.**

**APPLICANT: AZDEN CORPORATION**

**FCC ID: BZB51HT**

**REPORT #: A\AZDEN\1083AUT4\1083AUT4\TestReport.doc**


# TIMCO ENGINEERING INC.

849 NW State Road 45  
 Newberry, Florida 32669  
 http://www.timcoengr.com  
 888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

## OCCUPIED BANDWIDTH

### NOTES:

#### 1083aut4 occupied bandwidth

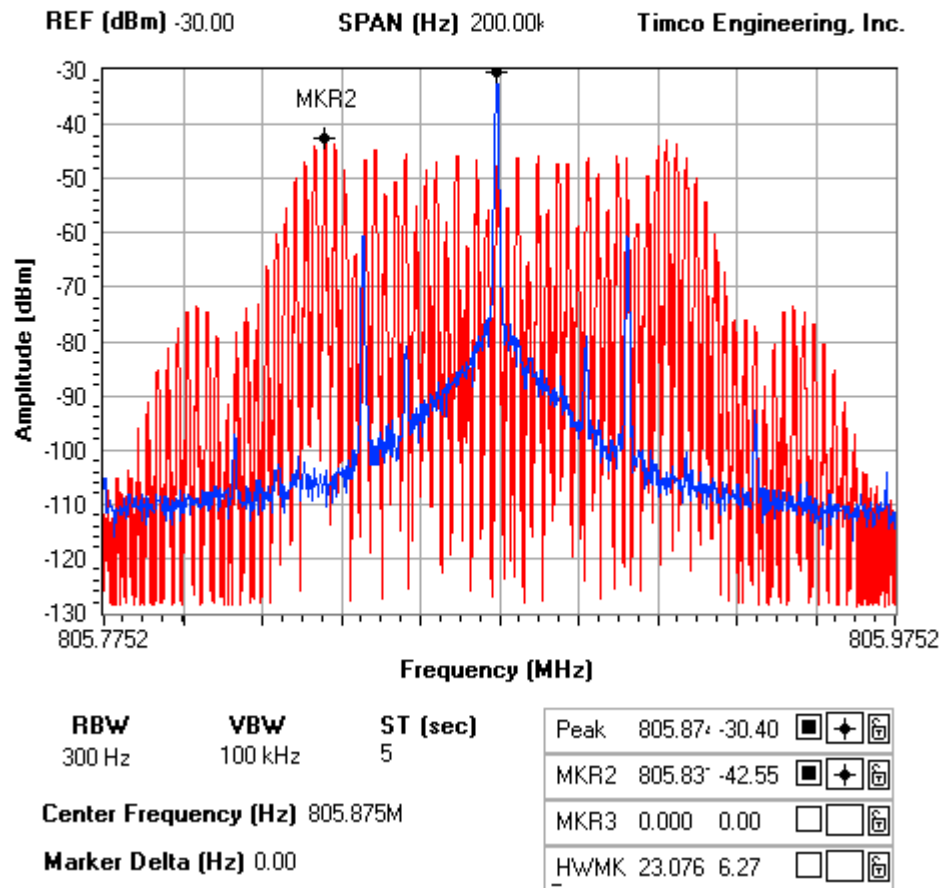

APPLICANT: AZDEN CORPORATION

FCC ID: BZB51HT

REPORT #: A\AZDEN\1083AUT4\1083AUT4\TestReport.doc



# TIMCO ENGINEERING INC.

849 NW State Road 45  
 Newberry, Florida 32669  
 http://www.timcoengr.com  
 888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

**2.1051** Spurious emissions at antenna terminals (conducted):  
 Not Applicable no antenna connector.

**2.1053(a)(b)** Field strength of spurious emissions:

**NAME OF TEST:** RADIATED SPURIOUS EMISSIONS

**REQUIREMENTS:** Emissions must be  $43 + 10\log(P_o)$  dB below the mean power output of the transmitter.

$$43 + 10 \log(0.05) = 30 \text{ dB}$$

**TEST DATA (793.7 MHz):**

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
793.70	V	18.30	0	-1.25	0
1587.40	V	-52.20	1.11	5.00	65.36
2381.10	H	-25.40	1.27	6.46	37.25
3174.80	V	-32.90	1.36	7.35	43.96
3968.50	H	-49.00	1.44	7.55	59.94
4762.30	V	-42.10	1.55	8.035	52.67
5556.10	H	-59.70	1.72	8.42	70.04
7143.80	H	-56.30	2	7.75	67.6

**TEST DATA (805.8 MHz):**  $43 + 10 \log(0.05) = 30 \text{ dB}$

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
805.80	V	16.80	0	-1.25	0
1611.60	V	-47.90	1.12	5.01	59.55
2417.50	H	-20.90	1.28	6.58	31.15
3223.30	V	-40.30	1.37	7.38	49.84
4029.20	H	-48.00	1.45	7.59	57.40
4835.00	V	-37.20	1.56	7.95	46.36
5640.80	V	-49.60	1.75	8.55	58.36
6446.90	H	-50.90	1.94	8.78	59.61
7252.80	H	-51.30	2	8.06	60.79
8058.40	H	-58.00	2.11	7.50	68.16

**APPLICANT:** AZDEN CORPORATION


**FCC ID:** BZB51HT

**REPORT #:** A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.

849 NW State Road 45  
Newberry, Florida 32669  
<http://www.timcoengr.com>  
888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

## Method of Measuring Radiated Spurious Emissions

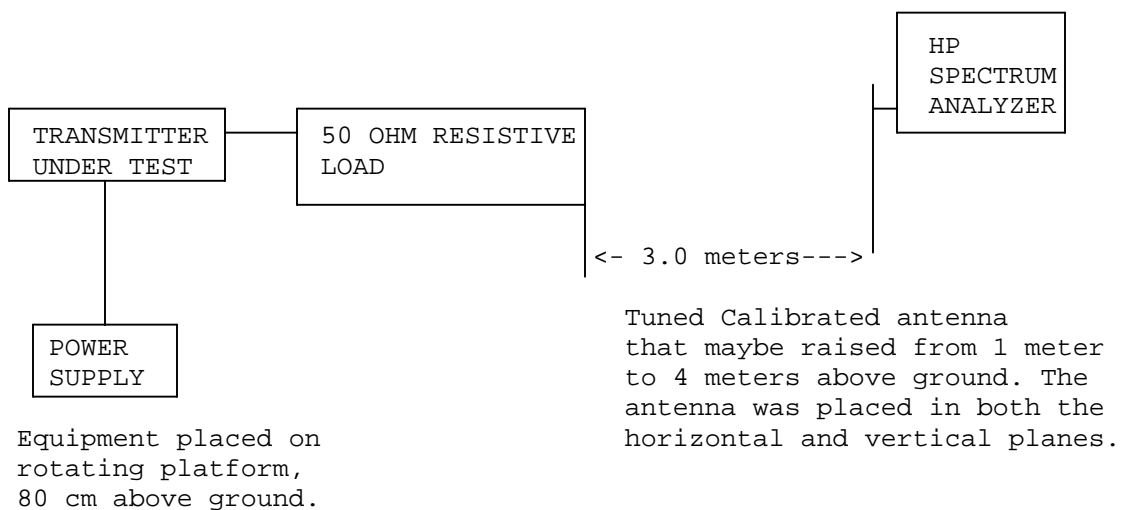

**METHOD OF MEASUREMENT:** The procedure used was TIA/EIA STANDARD 603. The spectrum was scanned from 30 to at least the tenth harmonic of the fundamental using a HP model 8566B spectrum analyzer and an appropriate antenna. Measurements were made at the open field test site of TIMCO ENGINEERING INC. located at 849 NW SR 45 Newberry, Florida 32669.

**APPLICANT:** AZDEN CORPORATION

**FCC ID:** BZB51HT

**REPORT #:** A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.

849 NW State Road 45  
Newberry, Florida 32669  
<http://www.timcoengr.com>  
888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

**2.1055 Frequency stability:**  
S74.861 (e)(4)

Temperature and voltage tests were performed to verify that the frequency remains within the .0050%, (50 ppm)(74.861 e.4) specification limit.

The test was conducted as follows: The transmitter was placed in the temperature chamber at 25 degrees C and allowed to stabilize for one hour. The transmitter was keyed ON for one minute during which four frequency readings were recorded at 15-second intervals. The worse case number was taken for temperature plotting. The assigned channel frequency was considered to be the reference frequency. The temperature was then reduced to -30 degrees C after which the transmitter was again allowed to stabilize for one hour. The transmitter was keyed ON for one minute, and again frequency readings were noted at 15-second intervals. The worst-case number was recorded for temperature plotting. This procedure was repeated in 10-degree increments up to + 50 degrees C.

**MEASUREMENT DATA:**

Assigned Frequency (Ref. Frequency): 805.875 013 MHz

<u>TEMPERATURE °C</u>	<u>FREQUENCY MHz</u>	<u>PPM</u>
REFERENCE_____	805.875 013	00.00
-30_____	805.867 4	- 9.45
-20_____	805.869 680	- 6.62
-10_____	805.873 218	- 2.23
0_____	805.875 018	+ 0.01
+10_____	805.875 535	+ 0.65
+20_____	805.875 945	+ 1.16
+30_____	805.874 93	- 0.10
+40_____	805.874 316	- 0.86
+50_____	805.874 052	- 1.19

<u>BATT</u>	<u>VOLTS</u>	<u>%BATT. DATA</u>	<u>BATT. PPM</u>
-15%	2.55	805.874 998	- 0.02

**RESULTS OF MEASUREMENTS:** The test results indicates that the EUT meets the requirements.

**APPLICANT:** AZDEN CORPORATION

**FCC ID:** BZB51HT

**REPORT #:** A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.

849 NW State Road 45  
 Newberry, Florida 32669  
<http://www.timcoengr.com>  
 888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

## EMC Equipment List

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
3/10-Meter OATS	TEI	N/A	N/A	Listed 3/27/04	3/26/07
3-Meter OATS	TEI	N/A	N/A	Listed 1/13/03	1/12/06
AC Voltmeter	HP	400FL	2213A14499	CAL 10/9/01	10/9/03
Blue Tower Quasi-Peak Adapter	HP	85650A	2811A01279	CAL 4/15/03	4/15/05
Blue Tower RF Preselector	HP	85685A	2620A00294	CAL 4/27/04	4/27/06
Blue Tower Spectrum Analyzer	HP	8568B	2928A04729 2848A18049	CAL 4/15/03	4/15/05
Coaxial Cable #64	Semflex Inc.	60637	Timco #64	CHAR 1/24/02	1/24/04
Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	152	CAL 3/21/01	3/21/04
Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	153	CAL 9/26/02	9/26/05
Frequency Counter	HP	5385A	2730A03025	CAL 3/7/03	3/7/05
Hygro-Thermometer	Extech	445703	0602	CAL 10/4/02	10/4/04
Log-Periodic Antenna	Electro-Metrics	LPA-25	1122	CAL 10/2/01	10/2/03
Measuring Tape-7.5M	Kraftixx	7.5M		CHAR 2/1/02	2/1/04
Modulation Analyzer	HP	8901A	3435A06868	CAL 9/5/01	9/5/03
Multimeter	Fluke	FLUKE-77-3	79510405	CHAR 9/26/01	9/26/03
Silver Tower Preamplifier	HP	8449B	3008A01075	CAL 3/22/04	3/22/06
Silver Tower Quasi-Peak Adapter	HP	85650A	3303A01844	CAL 3/22/04	3/22/06
Silver Tower RF Preselector	HP	85685A	2926A00983	CAL 3/22/04	3/22/06

APPLICANT: AZDEN CORPORATION

FCC ID: BZB51HT

REPORT #: A\AZDEN\1083AUT4\1083AUT4\TestReport.doc

# TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: [sid@timcoengr.com](mailto:sid@timcoengr.com)

Silver Tower	HP	8566B Opt	3552A22064	CAL	3/22/06
Spectrum		462	3638A08608	3/22/04	
Analyzer					
System One	Audio	System	SYS1-45868	CHAR	4/25/04
	Precision	One		4/25/02	
Tan Tower	HP	8449B-H02	3008A00372	CAL	9/23/05
Preamplifier				9/23/03	
Tan Tower	HP	85650A	3303A01690	CAL	9/23/05
Quasi-Peak				9/23/03	
Adapter					
Tan Tower RF	HP	85685A	3221A01400	CAL	9/23/05
Preselector				9/23/03	
Tan Tower	HP	8566B Opt	3138A07786	CAL	9/23/05
Spectrum		462	3144A20661	9/23/03	
Analyzer					
Temperature	Tenney	TTRC	11717-7	CHAR	1/22/04
Chamber	Engineering			1/22/02	

APPLICANT: AZDEN CORPORATION

FCC ID: BZB51HT

REPORT #: A\AZDEN\1083AUT4\1083AUT4\TestReport.doc