



MODEL 416

List of Exhibits

Exhibit 1

Instruction manual , model 416 (preliminary)
with circuit diagrams.

Exhibit 2

Measurement data and test equipment.

Exhibit 3

Photographs.

Exhibit 4

Description of circuits for suppression of
spurious radiation.



MODEL 416


BAND POS.	FREQ. MHZ	P-in WATTS	P-out WATTS	GAIN Db	HARMONICS Db			IMD Db
					2ND	3RD	4TH	
160 A	1.813	60	1500	13.9	-46	-64		
160 B	1.980	60	1500	13.9	-51	-70		
80	3.800	60	1500	13.9	-54			
40 A	7.000	60	1500	13.9	-55			
40 B	7.150	65	1500	13.6	-56			
20	14.025	70	1500	13.3	-52			
15	21.065	75	1500	13	-56			

DATA TAKEN BY: Hardy A. Shelton

DATE: 2 Sept 98



MODEL 416 14.1 Mhz

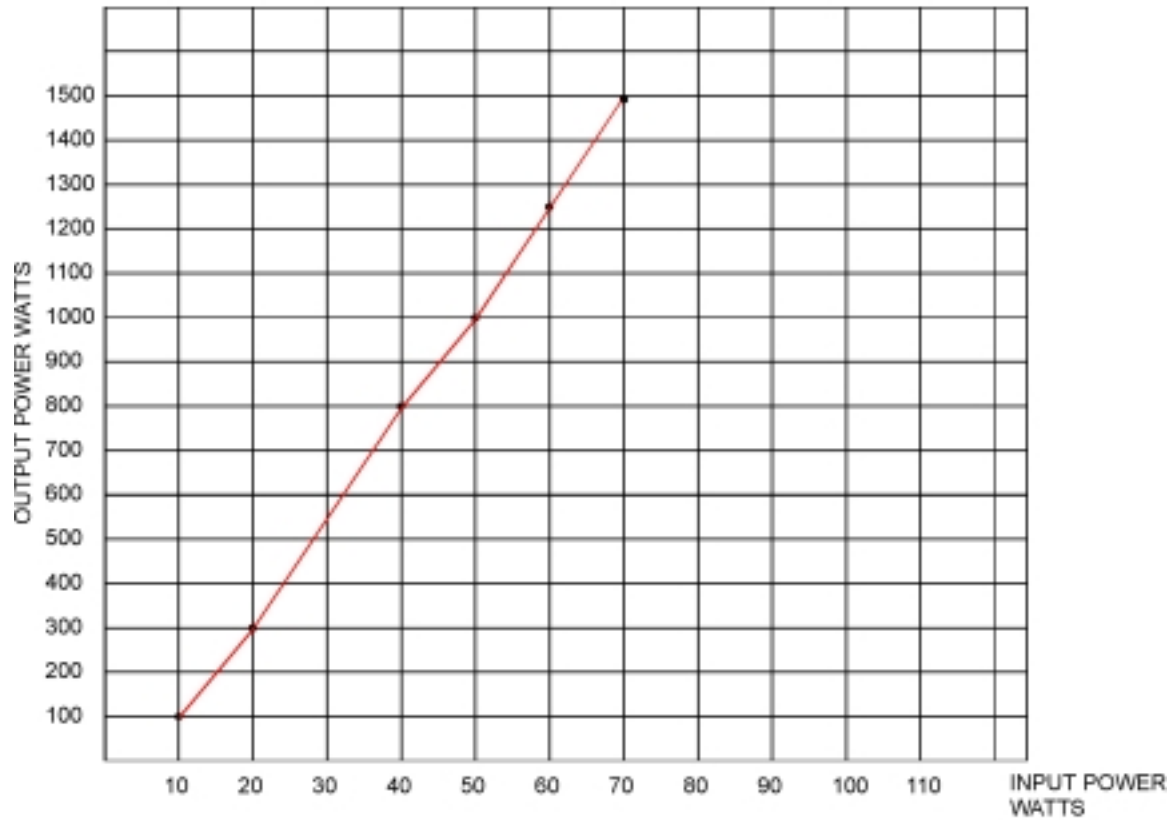


DATA TAKEN BY: Hardy A. Shelton

DATE: 2 Sept 98



MODEL 416

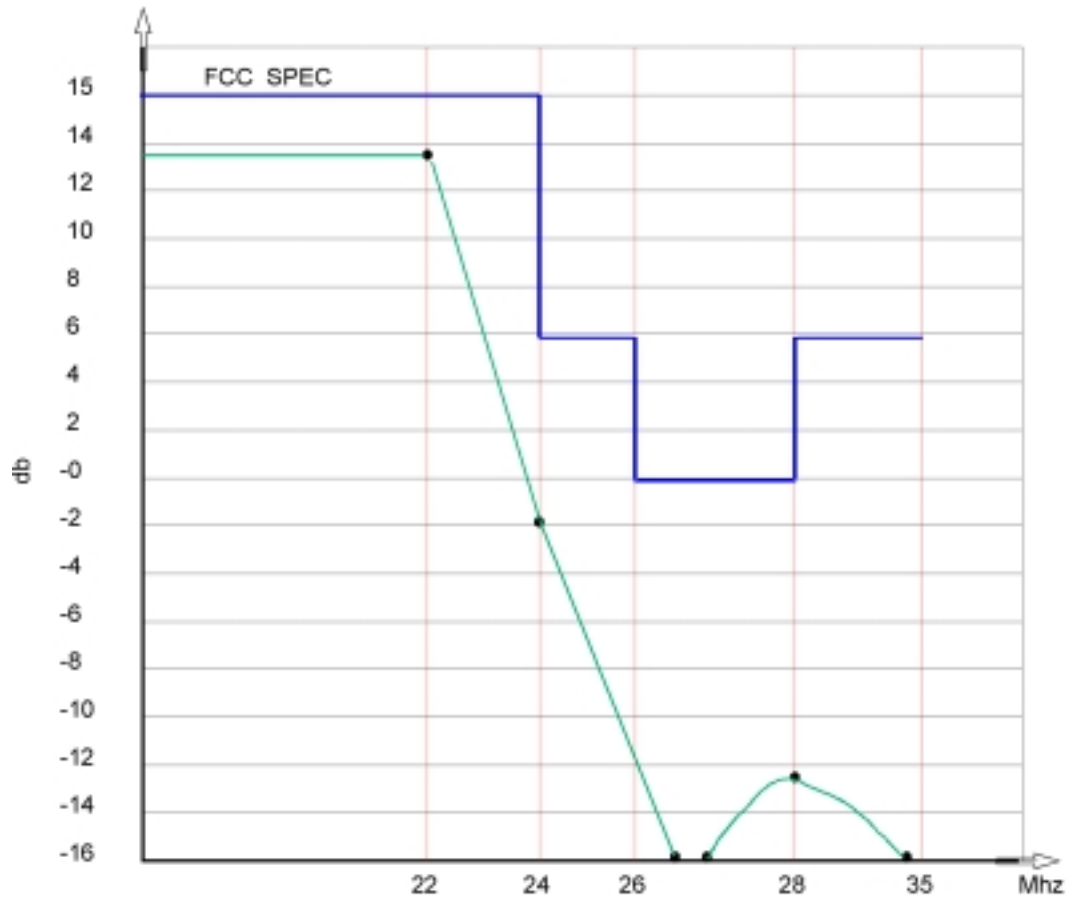

DATA TAKEN BY: Hardy A. Shelton

DATE: 2 Sept 98

