

Report No.: FG372001B



WINNF-TS-0122 Test Report

FCC ID : GKRAOW4PXC1

Equipment : Outdoor Radio Unit

Brand Name : Compal

Model Name : Cypress AOW4P-XC1

Applicant : Compal Electronics, Inc.

No.581 & 581-1, Ruiguang Rd., Neihu District, Taipei, (114) Taiwan

Manufacturer : Compal Electronics, Inc.

No.581 & 581-1, Ruiguang Rd., Neihu District, Taipei, (114) Taiwan

Standard : WINNF-TS-0122 Version V1.0.2

RF Interface : NR n48

The product was received on Aug. 16, 2023 and testing was performed from Aug. 16, 2023 to Sep. 20, 2023. We, Sporton International Inc. Wensan Laboratory, would like to declare that the tested sample has been evaluated in accordance with the test procedures given in WINNF-TS-0122 Version V1.0.2 and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval from Sporton International Inc. Wensan Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai

Sporton International Inc. Wensan Laboratory

No.58, Aly. 75, Ln. 564, Wenhua 3rd, Rd., Guishan Dist., Taoyuan City 333010, Taiwan (R.O.C.)

TEL: 886-3-327-0868 Page Number : 1 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

Table of Contents

1.	Admi	inistration Data	4
	1.1	Testing Laboratory	4
2.	Gene	eral Information	4
	2.1	Description of Unit Under Test (UUT)	4
	2.2	Protocol Test Summary	5
	2.3	Support Equipment	6
	2.4	Measuring Equipment List	6
3.	Meas	surement Environment	7
	3.1	Test configuration without Domain Proxy	8
	3.2	Standards	8
4.		ocol Test Results	9
	4.1	[WINNF.FT.C.REG.1] Multi-Step registration	9
	4.2	[WINNF.FT.C.REG.5] Single-Step registration for CBSD with CPI signed data	10
	4.3	[WINNF.FT.C.REG.7] Registration due to change of an installation parameter	11
	4.4	[WINNF.FT.C.REG.8] Missing Required parameters (responseCode 102)	12
	4.5	[WINNF.FT.C.REG.10] Pending registration (responseCode 200)	13
	4.6	[WINNF.FT.C.REG.12] Invalid parameter (responseCode 103)	14
	4.7	[WINNF.FT.C.REG.14] Blacklisted CBSD (responseCode 101)	15
	4.8	[WINNF.FT.C.REG.16] Unsupported SAS protocol version (responseCode 100)	16
	4.9	[WINNF.FT.C.REG.18] Group Error (responseCode 201)	1/
		[WINNF.FT.C.GRA.1] Unsuccessful Grant responseCode=400 (INTERFERENCE)	
	4.11		19
	4.12	[WINNF.FT.C.HBT.1] Heartbeat Success Case (first Heartbeat Response)[WINNF.FT.C.HBT.3] Heartbeat responseCode=105 (DEREGISTER)	20
	4.13	[WINNF.FT.C.HBT.4] Heartbeat responseCode=103 (DEREGISTER)[WINNF.FT.C.HBT.4] Heartbeat responseCode=500 (TERMINATED_GRANT)	22
	4.14	[WINNF.FT.C.HBT.5] Heartbeat responseCode=500 (TERMINATED_GRANT) in First Heartbeat	23 st
	Poer	[WINNI : 1.C.TID 1.3] Treatibeat TesponseCode=301 (303F LNDLD_3NANT) IIT IIST Treatibea	21
	/ 16	[WINNF.FT.C.HBT.6] Heartbeat responseCode=501 (SUSPENDED_GRANT) in Subsequent F	24 Joorthoot
	Resr	[WINNE.F1.C.HB1.0] Healibeal TesponseCode=501 (503FENDED_GRANT) III Subsequent F	16a1106a1 25
	4 17	[WINNF.FT.C.HBT.7] Heartbeat responseCode=502 (UNSYNC_OP_PARAM)	27
	4.17 4.18	[WINNF.FT.C.HBT.9] Heartbeat Response Absent (First Heartbeat)	28
	4 19	[WINNF.FT.C.HBT.10] Heartbeat Response Absent (Subsequent Heartbeat)	29
	4 20	[WINNF.FT. C.HBT.11] Successful Grant Renewal in Heartbeat Test Case	30
	4.21	[WINNF.FT.C.RLQ.1] Successful Relinquishment	32
	4.22	[WINNF.FT.C.RLQ.3] Unsuccessful Relinquishment, responseCode=102	33
	4.23	[WINNF.FT.C.RLQ.5] Unsuccessful Relinquishment, responseCode=103	34
	4.24	WINNF.FT.C.DRG.11 Successful Deregistration	35
	4.25	[WINNF.FT.C.DRG.3] Deregistration responseCode=102	36
	4.26	[WINNF.FT.C.DRG.5] Deregistration responseCode=103	37
	4.27	[WINNF.FT.C.SCS.1] Successful TLS connection between UUT and SAS Test Harness	38
	4.28	[WINNF.FT.C.SCS.2] TLS failure due to revoked certificate	39
	4.29	[WINNF.FT.C.SCS.3] TLS failure due to expired server certificate	40
	4.30	[WINNF.FT.C.SCS.4] TLS failure when SAS Test Harness certificate is issued by an unknown	CA 41
	4.31	[WINNF.FT.C.SCS.5] TLS failure when certificate at the SAS Test Harness is corrupted	42
	4.32	[WINNF.PT.C.HBT] UUT RF Transmit Power Measurement	43

Appendix A. Setup Photo Appendix B. RF measurement plots

TEL: 886-3-327-0868 Page Number : 2 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

History of this test report

Report No.	Version	Description	Issue Date
FG372001B	01	Initial issue of report	Oct. 04, 2023

Conformity Assessment Condition:

The test results (PASS/FAIL) with all measurement uncertainty excluded are presented against the regulation limits or in accordance with the requirements stipulated by the applicant/manufacturer who shall bear all the risks of non-compliance that may potentially occur if measurement uncertainty is taken into account.

Disclaimer:

The product specifications of the EUT presented in the test report that may affect the test assessments are declared by the manufacturer who shall take full responsibility for the authenticity.

Reviewed by: William Chen Report Producer: Clio Lo

TEL: 886-3-327-0868 Page Number : 3 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

1. Administration Data

1.1 Testing Laboratory

Test Site	Sporton International Inc. Wensan Laboratory	
Test Site Location	No.58, Aly. 75, Ln. 564, Wenhua 3rd, Rd., Guishan Dist., Taoyuan City 333010, Taiwan (R.O.C.) TEL: +886-3-327-0868 FAX: +886-3-327-0855	
Test Site No.	Sporton Site No.	
rest site No.	TH05-HY	
Test Engineer	Thomas Chen	
Temperature	21 ~ 24 °C	
Relative Humidity	48 ~ 53 %	

FCC designation No.: TW3786

2. General Information

2.1 Description of Unit Under Test (UUT)

Product Feature & Specification			
UUT Type	Outdoor Radio Unit		
Brand Name	Compal		
Model Name	Cypress AOW4P-XC1		
FCC ID	GKRAOW4PXC1		
Professional Installation	■ Yes □ No		
Unit Under Test Type	■ BTS-CBSD product (Base Station)□ CPE-CBSD product (Customer Premises Equipment)		
Unit Under Test Category	□ Category A ■ Category B		
Domain Proxy support	☐ CBSD with Domain Proxy ■ CBSD without Domain Proxy		
UUT Antenna Gain	12 dBi		
UUT HW Version	V2.0.2.4.4		
UUT FW Version	1.0.3.010		
UUT Serial Number	RS8582-213900078		

TEL: 886-3-327-0868 Page Number : 4 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

2.2 Protocol Test Summary

Section	Test Case ID	Test Case Title	Test Result
6.1.4.1.1	WINNF.FT.C.REG.1	Multi-Step registration	PASS
6.1.4.1.5	WINNF.FT.C.REG.5	Single-Step registration for CBSD with CPI signed data	PASS
6.1.4.1.7	WINNF.FT.C.REG.7	Registration due to change of an installation parameter	PASS
6.1.4.2.1	WINNF.FT.C.REG.8	Missing Required parameters (responseCode 102)	PASS
6.1.4.2.3	WINNF.FT.C.REG.10	Pending registration (responseCode 200)	PASS
6.1.4.2.5	WINNF.FT.C.REG.12	Invalid parameter (responseCode 103)	PASS
6.1.4.2.7	WINNF.FT.C.REG.14	Blacklisted CBSD (responseCode 101)	PASS
6.1.4.2.9	WINNF.FT.C.REG.16	Unsupported SAS protocol version (responseCode 100)	PASS
6.1.4.2.11	WINNF.FT.C.REG.18	Group Error (responseCode 201)	PASS
6.3.4.2.1	WINNF.FT.C.GRA.1	Unsuccessful Grant responseCode=400 (INTERFERENCE)	PASS
6.3.4.2.2	WINNF.FT.C.GRA.2	Unsuccessful Grant responseCode=401 (GRANT_CONFLICT)	PASS
6.4.4.1.1	WINNF.FT.C.HBT.1	Heartbeat Success Case (first Heartbeat Response)	PASS
6.4.4.2.1	WINNF.FT.C.HBT.3	Heartbeat responseCode=105 (DEREGISTER)	PASS
6.4.4.2.2	WINNF.FT.C.HBT.4	Heartbeat responseCode=500 (TERMINATED_GRANT)	PASS
6.4.4.2.3	WINNF.FT.C.HBT.5	Heartbeat responseCode=501 (SUSPENDED_GRANT) in First Heartbeat Response	PASS
6.4.4.2.4	WINNF.FT.C.HBT.6	Heartbeat responseCode=501 (SUSPENDED_GRANT) in Subsequent Heartbeat Response	PASS
6.4.4.2.5	WINNF.FT.C.HBT.7	Heartbeat responseCode=502 (UNSYNC_OP_PARAM)	PASS
6.4.4.3.1	WINNF.FT.C.HBT.9	Heartbeat Response Absent (First Heartbeat)	PASS
6.4.4.3.2	WINNF.FT.C.HBT.10	Heartbeat Response Absent (Subsequent Heartbeat)	PASS
6.4.4.4.1	WINNF.FT.C.HBT.11	Successful Grant Renewal in Heartbeat Test Case	PASS
6.6.4.1.1	WINNF.FT.C.RLQ.1	Successful Relinquishment	PASS
6.6.4.2.1	WINNF.FT.C.RLQ.3	Unsuccessful Relinquishment, responseCode=102	PASS
6.6.4.3.1	WINNF.FT.C.RLQ.5	Unsuccessful Relinquishment, responseCode=103	PASS
6.7.4.1.1	WINNF.FT.C.DRG.1	Successful Deregistration	PASS
6.7.4.2.1	WINNF.FT.C.DRG.3	Deregistration responseCode=102	PASS
6.7.4.3.1	WINNF.FT.C.DRG.5	Deregistration responseCode=103	

TEL: 886-3-327-0868 Page Number : 5 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

Section	Test Case ID	Test Case Title	Test Result
6.8.4.1.1	WINNF.FT.C.SCS.1	Successful TLS connection between UUT and SAS Test Harness	PASS
6.8.4.2.1	WINNF.FT.C.SCS.2	TLS failure due to revoked certificate	PASS
6.8.4.2.2	WINNF.FT.C.SCS.3	TLS failure due to expired server certificate	PASS
6.8.4.2.3	WINNF.FT.C.SCS.4	TLS failure when SAS Test Harness certificate is issue by unknown CA	PASS
6.8.4.2.4	WINNF.FT.C.SCS.5	TLS failure when certificate at the SAS Test Harness is corrupted	PASS
7.1.4.1.1	WINNF.PT.C.HBT	UUT RF Transmit Power Measurement	PASS

2.3 Support Equipment

Name	Brand Name	Type/Model	SW Version
CU	Compal	SYS 110P-FWTR	0.0.1.b1
DU	Compal	SYS 110P-FWTR	03.00.00

2.4 Measuring Equipment List

Name	Drand Name	Tyme/Madal	Carial Number	Calib	ration
Name	Brand Name	Type/Model	Serial Number	Last Cal.	Due Date
Spectrum Analyzer	Rohde & Schwarz	FSV3044	101467	Feb. 01, 2023	Jan. 31, 2024

TEL: 886-3-327-0868 Page Number : 6 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

3. Measurement Environment


Measurement Environment Information		
SAS Test Harness version	1.0.0.3	
Operating System	Windows 10	
TLS version	V 1.2	
Python version	V 2.7	

Conditional Test Case				
Support (Yes / No)	Condition	Definition		
Yes	C1	Mandatory for UUT which supports multi-step registration message		
No	C2	Mandatory for UUT which supports single-step registration with no CPI-signed data in the registration message. By definition, this is a subset of Category A devices which determine all registration information, including location, without CPI intervention.		
Yes	C3	Mandatory for UUT which supports single-step registration containing CPIsigned data in the registration message.		
No	C4	Mandatory for UUT which supports RECEIVED_POWER_WITHOUT_GRANT measurement report type		
No	C5	Mandatory for UUT which supports RECEIVED_POWER_WITH_GRANT measurement report type.		
Yes	C6	Mandatory for UUT which supports parameter change being made at the UUT and prior to sending a deregistration.		

TEL: 886-3-327-0868 Page Number : 7 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

3.1 Test configuration without Domain Proxy

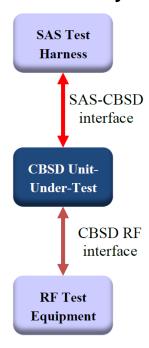

3.2 Standards

[n.1]. WINNF-TS-0122 Version 1.0.2, "Conformance and Performance Test Technical Specification; CBSD/DP as Unit Under Test (UUT)", 25 November 2020

[n.2]. WINNF-TS-0016 Version 1.2.7, "SAS to CBSD Technical Specification", 21 March 2022

TEL: 886-3-327-0868 Page Number : 8 of 44

FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4. Protocol Test Results

4.1 [WINNF.FT.C.REG.1] Multi-Step registration

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with the SAS Test Harness	
	UUT is in the Unregistered state	
	CBSD sends correct Registration request information, as specified in [n.5],	
	to the SAS Test Harness:	
	The required userId, fccId and cbsdSerialNumber registration	
	parameters shall be sent from the CBSD and conform to proper	
2	format and acceptable ranges.	PASS
	Any REG-conditional or optional registration parameters that may	
	be included in the message shall be verified that they conform to	
	proper format and are within acceptable ranges.	
	Note: It is outside the scope of this document to test the Registration	
	information that is supplied via another means.	
	SAS Test Harness sends a CBSD Registration Response as	
	follows:	
3	- cbsdld=C	
	 measReportConfig shall not be included 	
	- responseCode = 0	
	After completion of step 3, SAS Test Harness will not provide any	
4	positive response (responseCode=0) to further request messages from the	
	UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-0868 Page Number : 9 of 44

FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.2 [WINNF.FT.C.REG.5] Single-Step registration for CBSD with CPI signed data

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
1	Authentication with SAS Test Harness	
'	UUT is in the Unregistered state	
	All of the required and REG-Conditional parameters shall be	
	configured and CPI signature provided	
	CBSD sends Registration request to the SAS Test Harness:	
	The required userId, fccId and cbsdSerialNumber and REG-	
2	Conditional cbsdCategory, airInterface, measCapability and	PASS
	cpiSignatureData registration parameters shall be sent from the	
	CBSD and conform to proper format and acceptable ranges.	
	Any optional registration parameters that may be included in the	
	message shall be verified that they conform to proper format and are	
	within acceptable ranges.	
	SAS Test Harness sends a CBSD Registration Response as	
	follows:	
3	- cbsdld=C	
	 measReportConfig shall not be included. 	
	- responseCode = 0	
4	After completion of step 3, SAS Test Harness will not provide any positive	
	response (responseCode=0) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-0868 Page Number : 10 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.3 [WINNF.FT.C.REG.7] Registration due to change of an installation parameter

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
2	UUT has successfully registered with SAS Test Harness	1
	Change an installation parameters at the UUT (time T)	
3	Tester needs to record the current time at which the parameter change is	
	executed.	
	Monitor the SAS-CBSD interface.	
4	UUT sends a deregistrationRequest to the SAS Test Harness	PASS
	The deregistration request shall be sent within (T + 60 seconds) from step 3.	

TEL: 886-3-327-0868 Page Number : 11 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.4 [WINNF.FT.C.REG.8] Missing Required parameters (responseCode 102)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	SAS response does not include cbsdld	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=0) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-0868 Page Number : 12 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.5 [WINNF.FT.C.REG.10] Pending registration (responseCode 200)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	SAS response does not include cbsdld	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=200) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

 TEL: 886-3-327-0868
 Page Number
 : 13 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.6 [WINNF.FT.C.REG.12] Invalid parameter (responseCode 103)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
	SAS response does not include cbsdld	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=103) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

 TEL: 886-3-327-0868
 Page Number
 : 14 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.7 [WINNF.FT.C.REG.14] Blacklisted CBSD (responseCode 101)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	SAS response does not include cbsdld	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=101) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-0868 Page Number : 15 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.8 [WINNF.FT.C.REG.16] Unsupported SAS protocol version (responseCode 100)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	SAS response does not include cbsdld	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=100) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

 TEL: 886-3-327-0868
 Page Number
 : 16 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.9 [WINNF.FT.C.REG.18] Group Error (responseCode 201)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	SAS response does not include cbsdld	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=201) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-0868 Page Number : 17 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.10 [WINNF.FT.C.GRA.1] Unsuccessful Grant responseCode=400 (INTERFERENCE)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has registered successfully with SAS Test Harness, with	
	cbsdld= C	
2	UUT sends valid Grant Request.	
	SAS Test Harness sends a Grant Response message, including	
3	• cbsdld=C	
	• responseCode = R	
4	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=0) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

 TEL: 886-3-327-0868
 Page Number
 : 18 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.11 [WINNF.FT.C.GRA.2] Unsuccessful Grant responseCode=401 (GRANT_CONFLICT)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has registered successfully with SAS Test Harness, with	
	cbsdld= C	
2	UUT sends valid Grant Request.	
	SAS Test Harness sends a Grant Response message, including	
3	• cbsdld=C	
	• responseCode = R	
4	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=401) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-0868 Page Number : 19 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.12 [WINNF.FT.C.HBT.1] Heartbeat Success Case (first Heartbeat Response)

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has registered successfully with SAS Test Harness, with cbsdld = C 	+
2	UUT sends a message: • If message is type Spectrum Inquiry Request, go to step 3, or • If message is type Grant Request, go to step 5	
3	 UUT sends Spectrum Inquiry Request. Validate: cbsdld = C List of frequencyRange objects sent by UUT are within the CBRS frequency range 	PASS
4	SAS Test Harness sends a Spectrum Inquiry Response message, including the following parameters: • cbsdld = C • availableChannel is an array of availableChannel objects • responseCode = 0	
5	 UUT sends Grant Request message. Validate: cbsdld = C maxEIRP is at or below the limit appropriate for CBSD category as defined by Part 96 operationFrequencyRange, F, sent by UUT is a valid range within the CBRS band 	PASS
6	SAS Test Harness sends a Grant Response message, including the parameters: • cbsdld = C • grantld = G = a valid grant ID • grantExpireTime = UTC time greater than duration of the test • responseCode = 0	
7	UUT sends a first Heartbeat Request message. Verify Heartbeat Request message is formatted correctly, including: • cbsdld = C • grantld = G • operationState = "GRANTED"	PASS

TEL: 886-3-327-0868 Page Number : 20 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

#	Test Execution Steps	Results
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
8	• cbsdld=C	
	• grantId = G	
	• transmitExpireTime = current UTC time + 200 seconds	
	• responseCode = 0	
	For further Heartbeat Request messages sent from UUT after completion	
	of step 8, validate message is sent within latest specified heartbeat Interval,	
	and:	
	• cbsdld=C	
	• grantId = G	
9	• operationState = "AUTHORIZED"	PASS
	and SAS Test Harness responds with a Heartbeat Response message	17.00
	including the following parameters:	
	• cbsdld=C	
	• grantId = G	
	 transmitExpireTime = current UTC time + 200 seconds 	
	• responseCode = 0	
	Monitor the RF output of the UUT from start of test until UUT	
	transmission commences. Verify:	
40	UUT does not transmit at any time prior to completion of the first	D400
10	heartbeat response	PASS
	UUT transmits after step 8 is complete, and its transmission is	
	limited to within the bandwidth range F.	

TEL: 886-3-327-0868 Page Number : 21 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.13 [WINNF.FT.C.HBT.3] Heartbeat responseCode=105 (DEREGISTER)

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry: • UUT has registered successfully with SAS Test Harness • UUT has a valid single grant as follows: • valid cbsdld = C • valid grantld = G • grant is for frequency range F, power P • grantExpireTime = UTC time greater than duration of the test • UUT is in AUTHORIZED state and is transmitting within the grant bandwidth F on RF interface	
2	UUT sends a Heartbeat Request message. Ensure Heartbeat Request message is sent within Heartbeat Interval specified in the latest Heartbeat Response, and formatted correctly, including: • cbsdld = C • grantId = G • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = Current UTC time • responseCode = 105 (DEREGISTER)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the RF output of the UUT. Verify: • UUT shall stop transmission within (T + 60 seconds) of completion of step 3	PASS

TEL: 886-3-327-0868 Page Number : 22 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.14 [WINNF.FT.C.HBT.4] Heartbeat responseCode=500 (TERMINATED_GRANT)

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has registered successfully with SAS Test Harness UUT has a valid single grant as follows: valid cbsdld = C valid grantld = G grant is for frequency range F, power P grantExpireTime = UTC time greater than duration of the test UUT is in AUTHORIZED state and is transmitting within the grant bandwidth F on RF interface 	
2	UUT sends a Heartbeat Request message. Ensure Heartbeat Request message is sent within latest specified heartbeatInterval, and is formatted correctly, including: • cbsdld = C • grantId = G • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = current UTC time • responseCode = 500 (TERMINATED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the RF output of the UUT. Verify: • UUT shall stop transmission within (T + 60 seconds) of completion of step 3	PASS

TEL: 886-3-327-0868 Page Number : 23 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.15 [WINNF.FT.C.HBT.5] Heartbeat responseCode=501 (SUSPENDED_GRANT) in First Heartbeat Response

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has registered successfully with SAS Test Harness UUT has a valid single grant as follows: valid cbsdld = C valid grantId = G grant is for frequency range F, power P grantExpireTime = UTC time greater than duration of the test UUT is in GRANTED, but not AUTHORIZED state (i.e. has not performed its first Heartbeat Request) 	
2	UUT sends a Heartbeat Request message. Verify Heartbeat Request message is formatted correctly, including: • cbsdld = C • grantld = G • operationState = "GRANTED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = current UTC time • responseCode = 501 (SUSPENDED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the SAS-CBSD interface. Verify either A OR B occurs: A. UUT sends a Heartbeat Request message. Ensure message is sent within latest specified heartbeatInterval, and is correctly formatted with parameters: • cbsdld = C • grantId = G • operationState = "GRANTED" B. UUT sends a Relinquishment request message. Ensure message is correctly formatted with parameters: • cbdsId = C • grantId = G Monitor the RF output of the UUT. Verify: • UUT does not transmit at any time	PASS

TEL: 886-3-327-0868 Page Number : 24 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.16 [WINNF.FT.C.HBT.6] Heartbeat responseCode=501 (SUSPENDED_GRANT) in Subsequent Heartbeat Response

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has registered successfully with SAS Test Harness	
	UUT has a valid single grant as follows:	
	○ valid <i>cbsdld</i> = C	
1	○ valid <i>grantId</i> = G	
'	o grant is for frequency range F, power P	
	 grantExpireTime = UTC time greater than duration of the 	
	test	
	UUT is in AUTHORIZED state and is transmitting within the grant	
	bandwidth F on RF interface	
	UUT sends a Heartbeat Request message.	PASS
	Verify Heartbeat Request message is sent within latest specified	
2	heartbeatInterval, and is formatted correctly, including:	
	• cbsdld = C	
	• grantId = G	
	operationState = "AUTHORIZED"	
	SAS Test Harness sends a Heartbeat Response message, including the	
	following parameters:	
3	• cbsdld = C	
3	• grantId = G	
	 transmitExpireTime = T = current UTC time 	
	• responseCode = 501 (SUSPENDED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further	
	grants to the UUT.	

TEL: 886-3-327-0868 Page Number : 25 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

#	Test Execution Steps	Results
	Monitor the SAS-CBSD interface. Verify either A OR B occurs:	PASS
	A. UUT sends a Heartbeat Request message. Ensure message is	
	sent within latest specified heartbeatInterval, and is correctly	
	formatted with parameters:	
	• cbsdld = C	
	• grantId = G	
5	operationState = "GRANTED"	
3	B. UUT sends a Relinquishment Request message. Ensure	
	message is correctly formatted with parameters:	
	• cbdsld = C	
	• grantId = G	
	Monitor the RF output of the UUT. Verify:	
	 UUT shall stop transmission within (T + 60 seconds) of 	
	completion of step 3	

TEL: 886-3-327-0868 Page Number : 26 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.17 [WINNF.FT.C.HBT.7] Heartbeat responseCode=502 (UNSYNC_OP_PARAM)

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry: ■ UUT has registered successfully with SAS Test Harness ■ UUT has a valid single grant as follows: □ valid cbsdld = C □ valid grantId = G □ grant is for frequency range F, power P □ grantExpireTime = UTC time greater than duration of the test ■ UUT is in AUTHORIZED state and is transmitting within the grant bandwidth F on RF interface	
2	UUT sends a Heartbeat Request message. Verify Heartbeat Request message is sent within latest specified heartbeatInterval, and is formatted correctly, including: • cbsdld = C • grantId = G • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = Current UTC Time • responseCode = 502 (UNSYNC_OP_PARAM)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the SAS-CBSD interface. Verify: • UUT sends a Grant Relinquishment Request message. Verify message is correctly formatted with parameters: • cbdsId = C • grantId = G Monitor the RF output of the UUT. Verify: • UUT shall stop transmission within (T+60) seconds of completion of step 3.	PASS

TEL: 886-3-327-0868 Page Number : 27 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.18 [WINNF.FT.C.HBT.9] Heartbeat Response Absent (First Heartbeat)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has registered successfully with SAS Test Harness	
	UUT has a valid single grant as follows:	
	○ valid cbsdld=C	
1	○ valid <i>grantId</i> = G	
'	 grant is for frequency range F, power P 	_
	 grantExpireTime = UTC time greater than duration of the 	
	test	
	UUT is in GRANTED, but not AUTHORIZED state (i.e. has not	
	performed its first Heartbeat Request)	
	UUT sends a Heartbeat Request message.	
	Ensure Heartbeat Request message is sent within latest specified	PASS
2	heartbeatInterval, and is formatted correctly, including:	
	• cbsdld = C	1 700
	• grantId = G	
	operationState = "GRANTED"	
3	After completion of Step 2, SAS Test Harness does not respond to any	
	further messages from UUT to simulate loss of network connection	
	Monitor the RF output of the UUT from start of test to 60 seconds after step 3.	
4	Verify:	PASS
	At any time during the test, UUT shall not transmit on RF	F A 3 3
	interface	

TEL: 886-3-327-0868 Page Number : 28 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.19 [WINNF.FT.C.HBT.10] Heartbeat Response Absent (Subsequent Heartbeat)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has registered successfully with SAS Test Harness	
	UUT has a valid single grant as follows:	
	○ valid <i>cbsdld</i> = C	
1	○ valid <i>grantId</i> = G	_
'	 grant is for frequency range F, power P 	_
	 grantExpireTime = UTC time greater than duration of the 	
	test	
	 UUT is in AUTHORIZED state and is transmitting within the grant 	
	bandwidth F on RF interface	
	UUT sends a Heartbeat Request message.	
	Verify Heartbeat Request message issent within the latest specified	
2	heartbeatInterval, and is formatted correctly, including:	PASS
	• cbsdld = C	1 700
	• grantId = G	
	operationState = "AUTHORIZE D"	
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
3	• cbsdld = C	
	• grantId = G	
	 transmitExpireTime = current UTC time + 200 seconds 	
	• responseCode = 0	
4	After completion of Step 3, SAS Test Harness does not respond to any	
	further messages from UUT	
	Monitor the RF output of the UUT. Verify:	
5	 UUT shall stop all transmission on RF interface within 	PASS
5	(transmitExpireTime + 60 seconds), using the	1 7.00
	transmitExpireTime sent in Step 3.	

TEL: 886-3-327-0868 Page Number : 29 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.20 [WINNF.FT.C.HBT.11] Successful Grant Renewal in Heartbeat Test Case

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has registered successfully with SAS Test Harness	
	UUT has a valid single grant as follows:	
	○ valid <i>cbsdld</i> = C	
	○ valid <i>grantId</i> = G	
	o grant is for frequency range F, power P	
1	 UUT is in AUTHORIZED state and is transmitting within the grant bandwidth F on RF interface. 	
	Grant has the following parameters at the start of the test:	
	 grantExpireTime =UTC time equal to time at start of test + 	
	300 seconds = Tgrant_expire	
	o transmitExpireTime = UTC time equal to time at start of test +	
	200 seconds	
	 heartbeatInterval = 60 seconds 	
	UUT sends a Heartbeat Request message.	
2	If Heartbeat Request message contains grantRenew = TRUE, go to Step	
	6, else go to Step 3.	
	Verify Heartbeat Request message is sent within the latest specified	
	heartbeatInterval, and is formatted correctly, including:	
3	• cbsdld = C	PASS
	● grantId = G	
	operationState = "AUTHORIZED"	
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
	• cbsdld = C	
4	● grantId = G	
	 transmitExpireTime = current UTC + 200 seconds 	
	• grantExpireTime = same as Step 1	
	• responseCode = 0	
5	Go to Step 2	

TEL: 886-3-327-0868 Page Number : 30 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

#	Test Execution Steps	Results
	Verify Heartbeat Request message is sent within the latest specified	
	heartbeatInterval, and is formatted correctly, including:	
6	• cbsdld=C	PASS
0	• grantId = G	PASS
	operationState = "AUTHORIZED"	
	• grantRenew = TRUE	
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
	• cbsdld=C	
7	• grantId = G	
	grantExpireTime = UTC time set far in the future	
	• transmitExpireTime = current UTC time + 200 seconds	
	• responseCode = 0	
	Continue to respond to any subsquentHeartbeat Request from CBSD with	
	Heartbeat Response with the following parameters:	
8	• cbsdld=C	
	• grantId = G	
	 transmitExpireTime = same as Step 7 	
	• responseCode = 0	
	Monitor RF transmission of UUT from start of test until Tgrant_expire	
9	+ 60 seconds and ensure UUT continues to transmit throughout the time	PASS
	period.	

TEL: 886-3-327-0868 Page Number : 31 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.21 [WINNF.FT.C.RLQ.1] Successful Relinquishment

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
1	 UUT has successfully registered with SAS Test Harness, with cbsdld=C 	
	 UUT has received a valid grant with grantId = G 	
	UUT is in Grant State AUTHORIZED and is actively	
	transmitting within the bounds of its grant.	
	Invoke trigger to relinquish UUT Grant from the SAS Test Harness	
	UUT sends a Relinquishment Request message. Verify message contains	
2	all required parameters properly formatted, and specifically:	PASS
	• cbsdld = C	1 700
	• grantId = G	
	SAS Test Harness shall approve the request with a Relinquishment	
	Response message with parameters:	
3	- cbsdld=C	
	- grantId = G	
	– responseCode = 0	
	After completion of step 3, SAS Test Harness will not provide any	
4	additional positive response (responseCode=0) to further request	
	messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall stop RF transmission at any time between triggering the relinquishment and UUT sending the relinquishment request	FASS
L	<u> </u>	<u> </u>

 TEL: 886-3-327-0868
 Page Number
 : 32 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.22 [WINNF.FT.C.RLQ.3] Unsuccessful Relinquishment, responseCode=102

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
1	 UUT has successfully registered with SAS Test Harness, with cbsdld=C 	
	 UUT has received a valid grant with grantId = G 	
	UUT is in Grant State AUTHORIZED and is actively	
	transmitting within the bounds of its grant.	
	Invoke trigger to Relinquish UUT Grant from the SAS Test Harness	
	UUT sends a Relinquishment Request message. Verify message contains	
2	all required parameters properly formatted, and specifically:	
	• cbsdld=C	
	• grantId = G	
	SAS Test Harness shall send a Relinquishment Response message with	
	parameters:	
3	• cbsdld = C	
	No grantId	
	• responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any	
4	positive response (responseCode=0) to further request messages from the	
	UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
5	UUT stopped RF transmission at any time between triggering the	FASS
	relinquishment and UUT sending the relinquishment request	

TEL: 886-3-327-0868 Page Number : 33 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.23 [WINNF.FT.C.RLQ.5] Unsuccessful Relinquishment, responseCode=103

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	 UUT has successfully completed SAS Discovery and 	
	Authentication with SAS Test Harness	
1	 UUT has successfully registered with SAS Test Harness, with cbsdld=C 	
	 UUT has received a valid grant with grantId = G 	
	 UUT is in Grant State AUTHORIZED and is actively 	
	transmitting within the bounds of its grant.	
	Invoke trigger to Relinquish UUT Grant from the SAS Test Harness	
	UUT sends a Relinquishment Request message. Verify message contains	
2	all required parameters properly formatted, and specifically:	
_	• cbsdld=C	
	● grantId = G	
	SAS Test Harness shall send a Relinquishment Response message with	
	parameters:	
3	• cbsdld = C	
	No grantId	
	• responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any	
4	positive response (responseCode=103) to further request messages from	
	the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	 UUT stopped RF transmission at any time between triggering the 	. 7.55
	relinquishment and UUT sending the relinquishment request	

TEL: 886-3-327-0868 Page Number : 34 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.24 [WINNF.FT.C.DRG.1] Successful Deregistration

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully registered with SAS Test Harness, with cbsdld=C	
	 UUT has received a valid grant with grantId = G UUT is in Grant State AUTHORIZED and is actively transmitting within the bounds of its grant. Invoke trigger to deregister UUT from the SAS Test Harness 	
2	UUT sends a Relinquishment request and receives Relinquishment response with responseCode=0	
3	UUT sends Deregistration Request to SAS Test Harness with <i>cbsdld</i> = C.	PASS
4	SAS Test Harness shall approve the request with a Deregistration Response message with parameters: • cbsdld = C • responseCode = 0	
5	After completion of step 3, SAS Test Harness will not provide any additional positive response (<i>responseCode</i> =0) to further request messages from the UUT.	
6	Monitor the RF output of the UUT from start of test until 60 seconds after Step 4 is complete. This is the end of the test. Verify: • UUT stopped RF transmission at any time between triggering the deregistration and either A OR B occurs: A. UUT sending a Registration Request message, as this is not mandatory	PASS
	B. UUT sending a Deregistration Request message	

 TEL: 886-3-327-0868
 Page Number
 : 35 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.25 [WINNF.FT.C.DRG.3] Deregistration responseCode=102

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
	 UUT has successfully registered with SAS Test Harness, with 	
	cbsdld=C	
	 UUT has received a valid grant with grantId = G 	
	UUT is in Grant State AUTHORIZED and is actively	
	transmitting within the bounds of its grant.	
	Invoke trigger to deregister UUT from the SAS Test Harness	
2	UUT sends a Relinquishment request and receives Relinquishment	
	response with responseCode=0	
3	UUT sends Deregistration Request to SAS Test Harness with <i>cbsdld</i> = C	
	The SAS Test Harness sends the Deregistration Response Message to UUT	
4	with:	
4	No cbsdld	_
	• responseCode = 102	
5	After completion of step 3, SAS Test Harness will not provide any positive	
	response (responseCode=0) to further request messages from the UUT.	
6	Monitor the RF output of the UUT from start of test until 60 seconds	
	after Step 4 is complete. This is the end of the test. Verify:	
	UUT stopped RF transmission at any time between triggering the	
	deregistration and either A OR B occurs:	PASS
	A. UUT sending a Registration Request message, as this is not	
	mandatory	
	B. UUT sending a Deregistration Request message	

 TEL: 886-3-327-0868
 Page Number
 : 36 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.26 [WINNF.FT.C.DRG.5] Deregistration responseCode=103

#	Test Execution Steps	Results						
	Ensure the following conditions are met for test entry:							
	UUT has successfully completed SAS Discovery and							
	Authentication with SAS Test Harness							
	UUT has successfully registered with SAS Test Harness, with							
1	cbsdld=C							
	 UUT has received a valid grant with grantId = G 							
	UUT is in Grant State AUTHORIZED and is actively							
	transmitting within the bounds of its grant.							
	Invoke trigger to deregister UUT from the SAS Test Harness							
2	UUT sends a Relinquishment request and receives Relinquishment							
	response with responseCode=0							
3	UUT sends Deregistration Request to SAS Test Harness with cbsdld = C							
	The SAS Test Harness sends the Deregistration Response Message to UUT							
4	with:							
4	No cbsdld							
	• responseCode = 103							
_	After completion of step 3, SAS Test Harness will not provide any positive							
5	response (responseCode=0) to further request messages from the UUT.							
	Monitor the RF output of the UUT from start of test until 60 seconds							
	after Step 4 is complete. This is the end of the test. Verify:							
6	UUT stopped RF transmission at any time between triggering the							
	deregistration and either A OR B occurs:	PASS						
	A. UUT sending a Registration Request message, as this is not							
	mandatory							
	B. UUT sending a Deregistration Request message							

 TEL: 886-3-327-0868
 Page Number
 : 37 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.27 [WINNF.FT.C.SCS.1] Successful TLS connection between UUT and SAS Test Harness

#	Test Execution Steps	Results
1	 UUT shall start CBSD-SAS communication with the security procedure The UUT shall establish a TLS handshake with the SAS Test Harness using configured certificate. Configure the SAS Test Harness to accept the security procedure and establish the connection 	PASS
2	 Make sure that Mutual authentication happens between UUT and the SAS Test Harness. Make sure that UUT uses TLS v1.2 Make sure that cipher suites from one of the following is selected, TLS_RSA_WITH_AES_128_GCM_SHA256 TLS_RSA_WITH_AES_256_GCM_SHA384 TLS_ECDHE_ECDSA_WITH_AES_128_GCM_SHA2 56 TLS_ECDHE_ECDSA_WITH_AES_256_GCM_SHA3 84 TLS_ECDHE_RSA_WITH_AES_128_GCM_SHA256 	PASS
3	A successful registration is accomplished using one of the test cases described in section 6.1.4.1, depending on CBSD capability. • UUT sends a registration request to the SAS Test Harness and the SAS Test Harness sends a Registration Response with responseCode = 0 and cbsdld. Monitor the RF output of the UUT from start of test until 60 seconds after	PASS
4	Step 3 is complete. This is the end of the test. Verify: • UUT shall not transmit RF	PASS

TEL: 886-3-327-0868 Page Number : 38 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.28 [WINNF.FT.C.SCS.2] TLS failure due to revoked certificate

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication with the security procedures	PASS
2	 Make sure that UUT uses TLS v1.2 for security establishment. Make sure UUT selects the correct cipher suite. UUT shall use CRL or OCSP to verify the validity of the server certificate. Make sure that Mutual authentication does not happen between UUT 	PASS
3	and the SAS Test Harness. UUT may retry for the security procedure which shall fail	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify: • UUT shall not transmit RF	PASS

 TEL: 886-3-327-0868
 Page Number : 39 of 44

 FAX: 886-3-327-0855
 Issue Date : Oct. 04, 2023

Report Version : 01

4.29 [WINNF.FT.C.SCS.3] TLS failure due to expired server certificate

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication with the security procedures	PASS
	Make sure that UUT uses TLS v1.2 for security establishment.	
	Make sure UUT selects the correct cipher suite.	
2	 UUT shall use CRL or OCSP to verify the validity of the server certificate. 	PASS
	Make sure that Mutual authentication does not happen between UUT	
	and the SAS Test Harness.	
3	UUT may retry for the security procedure which shall fail.	PASS
4	SAS Test-Harness shall not receive any Registration request or any	
4	application data.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

 TEL: 886-3-327-0868
 Page Number
 : 40 of 44

 FAX: 886-3-327-0855
 Issue Date
 : Oct. 04, 2023

Report Version : 01

4.30 [WINNF.FT.C.SCS.4] TLS failure when SAS Test Harness certificate is issued by an unknown CA

#	Test Execution Steps	Results
1	 UUT shall start CBSD-SAS communication with the security procedures 	PASS
	Make sure that UUT uses TLS ∨1.2 for security establishment.	
	 Make sure UUT selects the correct cipher suite. 	
2	 UUT shall use CRL or OCSP to verify the validity of the server 	PASS
_	certificate	1 700
	Make sure that Mutual authentication does not happen between UUT	
	and the SAS Test Harness.	
3	UUT may retry for the security procedure which shall fail.	PASS
4	SAS Test-Harness shall not receive any Registration request or any	
	application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

 TEL: 886-3-327-0868
 Page Number : 41 of 44

 FAX: 886-3-327-0855
 Issue Date : Oct. 04, 2023

Report Version : 01

4.31 [WINNF.FT.C.SCS.5] TLS failure when certificate at the SAS Test Harness is corrupted

#	Test Execution Steps	Results				
1	UUT shall start CBSD-SAS communication withthe security procedures	PASS				
	Make sure that UUT uses TLS ∨1.2 for security establishment.					
	Make sure UUT selects the correct cipher suite.					
2	 UUT shall use CRL or OCSP to verify the validity of the server 	PASS				
_	certificate.	17.00				
	Make sure that Mutual authentication does not happen between UUT					
	and the SAS Test Harness.					
3	UUT may retry for the security procedure which shall fail.	PASS				
4	SAS Test-Harness shall not receive any Registration request or any					
	application data.					
	Monitor the RF output of the UUT from start of test until 60 seconds after					
5	Step 3 is complete. This is the end of the test. Verify:	PASS				
	UUT shall not transmit RF					

TEL: 886-3-327-0868 Page Number : 42 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

4.32 [WINNF.PT.C.HBT] UUT RF Transmit Power Measurement

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry: UUT has successfully completed SAS Discovery and	
1	 Authentication with the SAS Test Harness UUT has registered with the SAS, with CBSD ID = C UUT has a single valid grant G with parameters {lowFrequency = FL, highFrequency = FH, maxEirp = Pi}, with grant in AUTHORIZED state, and grantExpireTime set to a value far past the duration of this test case 	
	Note: in order for the UUT to request a grant with the parameters {lowFrequency, highFrequency, maxEirp), the SAS Test Harness may need to provide appropriate guidance in the availableChannel object of the spectrumInquiry response message, and the operationParam object of the grant response message. Alternately, the UUT vendor may provide the ability to set those parameters on the UUT so that the UUT will request a grant with those parameters.	
2	UUT and SAS Test Harness perform a series of Heartbeat Request/Response cycles, which continues until the other test steps are complete. Messaging for each cycle is as follows: • UUT sends Heartbeat Request, including: • cbsdld = C • grantId = G • SAS Test Harness responds with Heartbeat Response, including: • cbsdld = C • grantId = G • transmitExpireTime = current UTC time + 200 seconds • responseCode = 0	

TEL: 886-3-327-0868 Page Number : 43 of 44
FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

#	Test Execution Steps	Results				
	Tester performs power measurement on RF interface(s) of UUT, and verifies it					
	complies with the maxEirp setting, Pi. The RF measurement method is out of					
	scope of this document, but may include additional configuration of the UUT, as					
	required, to fulfil the requirements of the power measurement method.					
3		PASS				
	Note: it may be required for the vendor to provide a method or					
	configuration to bring the UUT to a mode which is required by the					
	measurement methodology. Any such mode is vendor-specific and					
	depends upon UUT behavior and the measurement methodology.					

Note: For test 4.32, please find the Appendix B for RF measurement plots.

TEL: 886-3-327-0868 Page Number : 44 of 44 FAX: 886-3-327-0855 Issue Date : Oct. 04, 2023

Report Version : 01

Appendix B. RF measurement plots

Appendix B.1 [WINNF.PT.C.HBT] UUT RF Transmit Power Measurement


Report Clause 4.32 [WINNF.PT.C.HBT] UUT RF Transmit Power Measurement

Center Frequency	BW M	Granted MaxEIRP	Conducted PSD [dBm/MHz]				Antenna Gain	Duty Cycle	UUT total MaxEIRP		
[MHz]		[MHz]	[MHz]	[dBm/MHz]	ANT	ANT	ANT	ANT	[dBi]	Factor	[dBm/MHz]
			1	2	3	4		[dB]			
		16	-5.75	-5.02	-6.82	-6.1			13.45		
	5 10	20	-1.68	-1.13	-3.55	-2.01			17.32		
3555		25	3.27	4.28	2.17	2.98			22.57		
		30	7.45	9.13	6.92	7.56			27.17		
		37	12.26	13.15	12.18	12.57	12	1.3	31.88		
			16	-3.25	-2.85	-6.07	-5.57	12	1.5	15.11	
		20	0.74	0.89	-1.86	-1.47			19.08		
3680	40	25	4.87	5.29	3.16	3.3			23.58		
		30	9.65	9.45	7.72	8.56			28.24		
		37	11.9	12.92	12.23	11.52			31.50		

Report No.: FG372001B

Note: The total path loss is offset with 10.5 dB.

Duty Cycle factor:

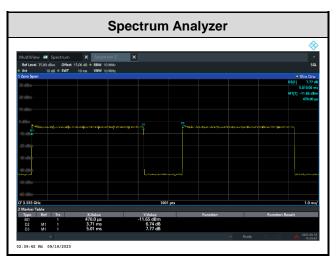

Note: The duty cycle value is 74.05%, add 10log(1/duty cycle) to the measured power level to compute the average power during continuous transmission.


TEL: 886-3-327-0868 Page Number : B1 of B11

Appendix B.1.1 Test Procedure


[WINNF.PT.C.HBT] UUT RF Transmit Power Measurement defined in clause 4.32 of this test report.

Report No.: FG372001B

Appendix B.1.2 Test Result

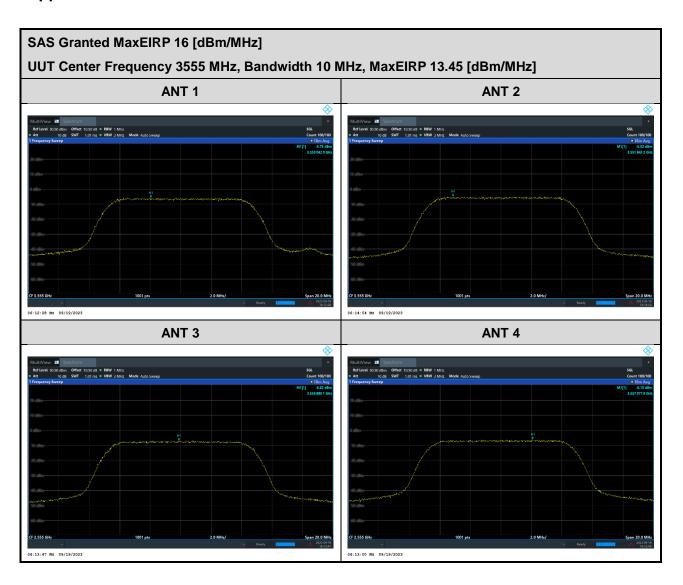


TEL: 886-3-327-0868 Page Number : B2 of B11

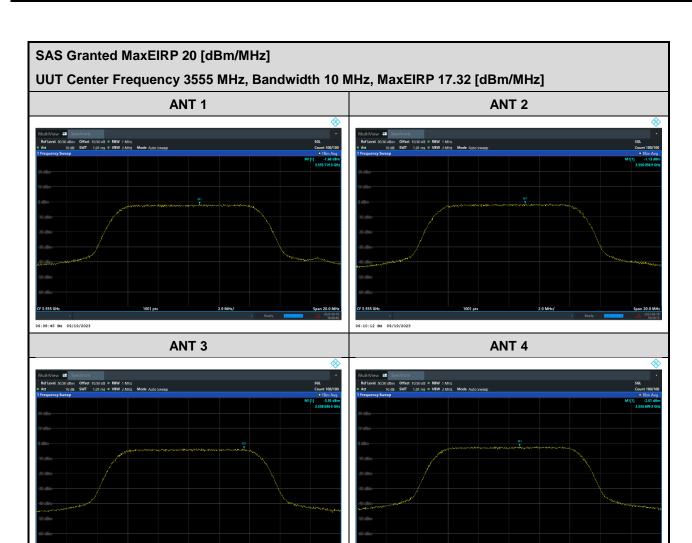

TEL: 886-3-327-0868 Page Number : B3 of B11

FAX: 886-3-327-0855

06:07:33 PM 09/19/2023

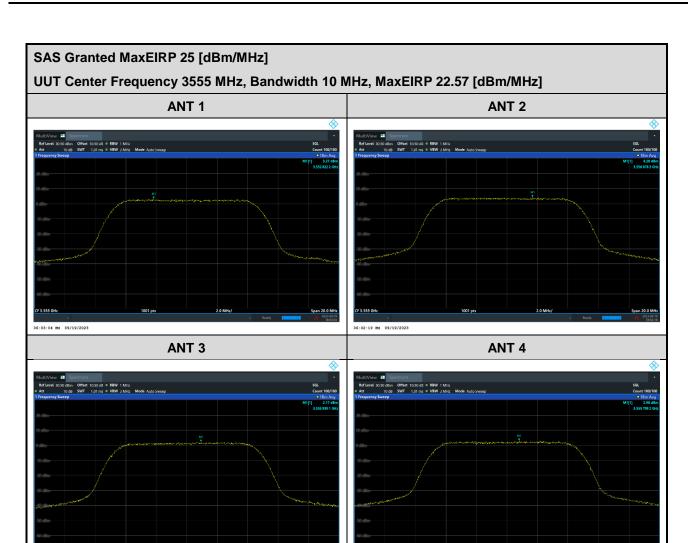

06:03:39 PM 09/19/2023

Report No.: FG372001B

TEL: 886-3-327-0868 Page Number : B4 of B11

FAX: 886-3-327-0855

06:04:21 PM 09/19/2023

SAS Granted MaxEIRP 30 [dBm/MHz]

UUT Center Frequency 3555 MHz, Bandwidth 10 MHz, MaxEIRP 27.17 [dBm/MHz]

ANT 1

ANT 2

White a language of the language of

Report No.: FG372001B

TEL: 886-3-327-0868 Page Number : B5 of B11

FAX: 886-3-327-0855

05:58:03 PM 09/19/2023



06:31:52 PM 09/19/2023

Report No.: FG372001B

TEL: 886-3-327-0868 Page Number : B6 of B11




TEL: 886-3-327-0868 Page Number : B7 of B11



05:04:01 PM 09/19/2023

TEL: 886-3-327-0868 Page Number : B8 of B11

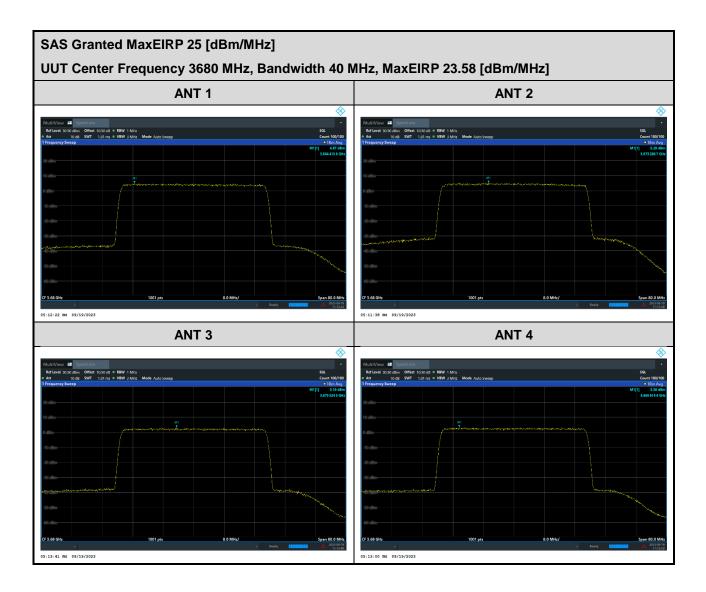


: B9 of B11 TEL: 886-3-327-0868 Page Number



TEL: 886-3-327-0868 Page Number : B10 of B11



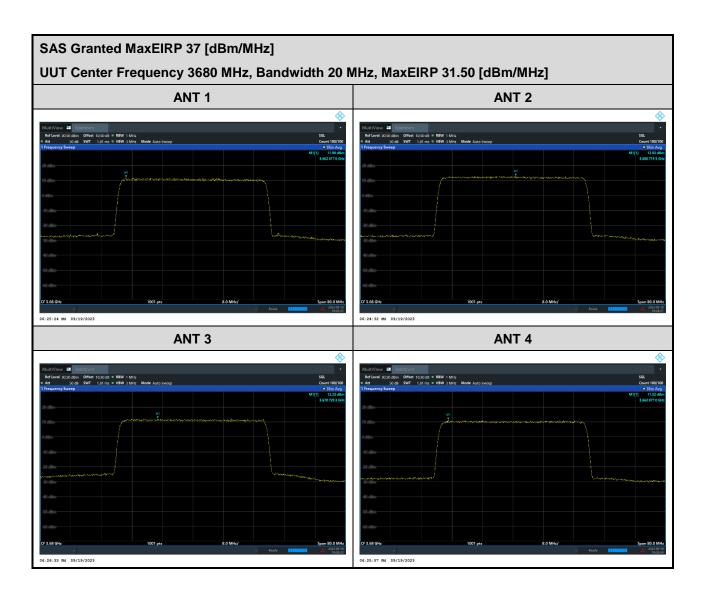

-----THE END-----

TEL: 886-3-327-0868 Page Number : B11 of B11