





# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919  
 20MHz

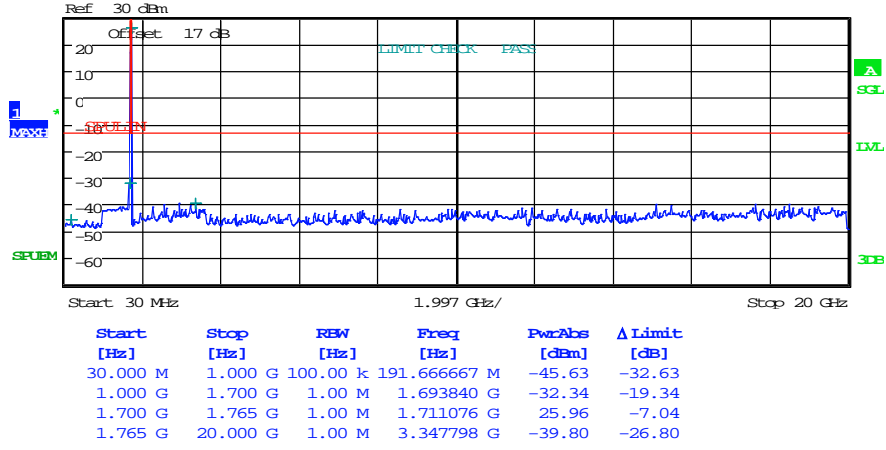


Date: 3.AUG.2020 15:29:00

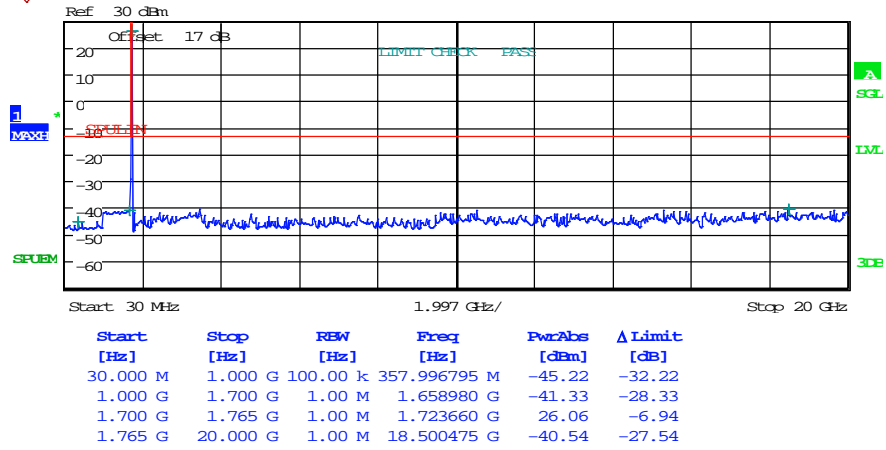

Date: 3.AUG.2020 15:24:20




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

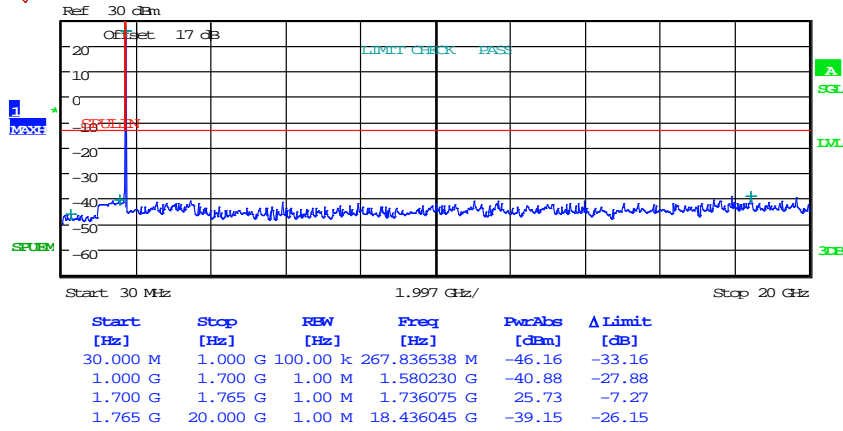


Date: 3.AUG.2020 15:29:18

Band VII  
 16QAM  
 5MHz

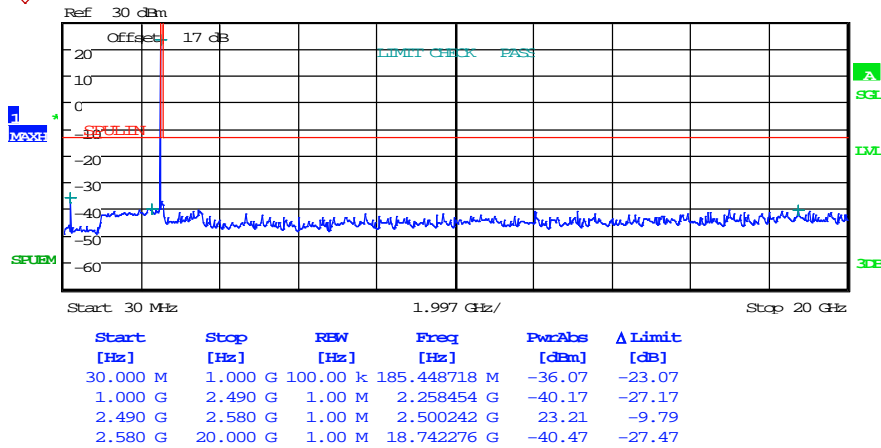


Date: 3.AUG.2020 16:15:28

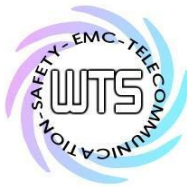


# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

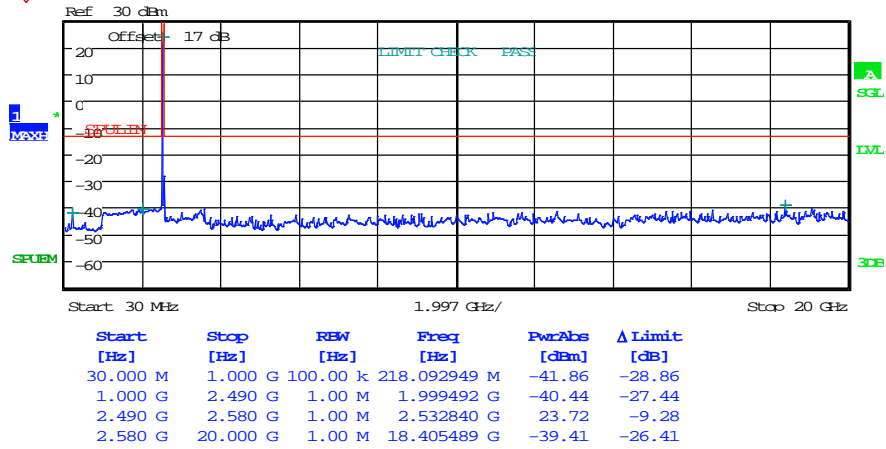

Date: 3.AUG.2020 16:14:34

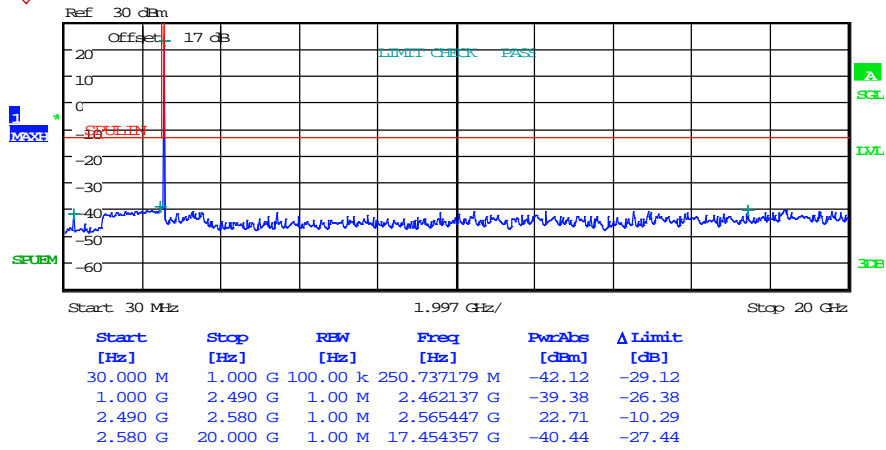

Date: 3.AUG.2020 16:14:58




# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

10MHz

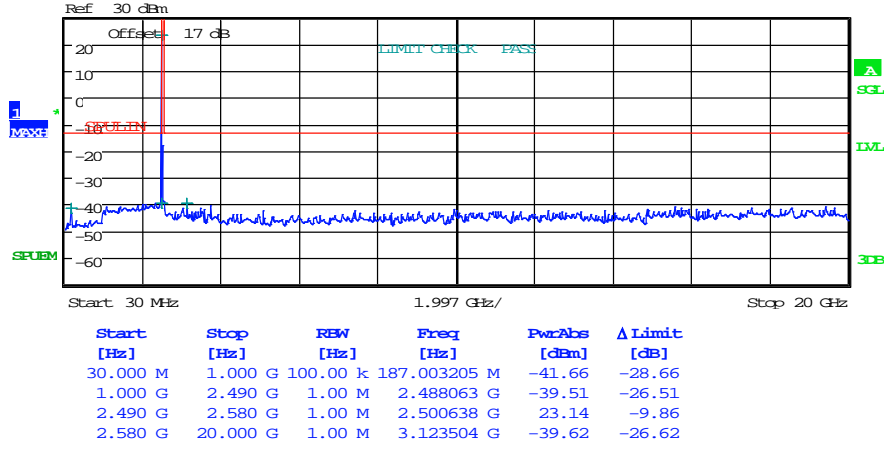

Date: 3.AUG.2020 16:18:33

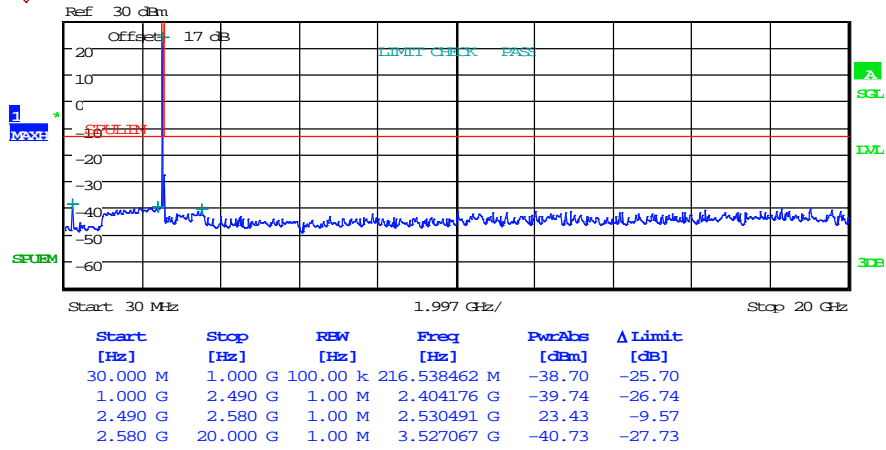


Date: 3.AUG.2020 16:19:17




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

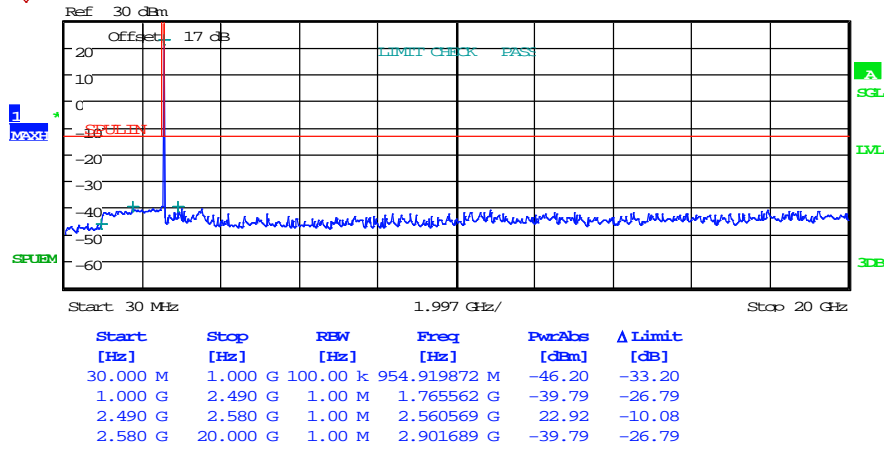


Date: 3.AUG.2020 16:19:00

15MHz

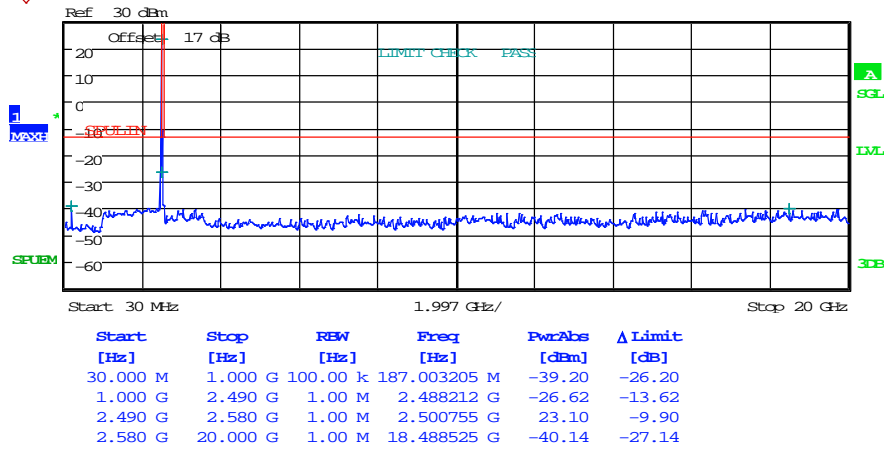


Date: 3.AUG.2020 16:34:21

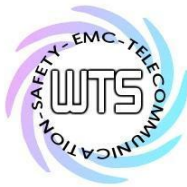


# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

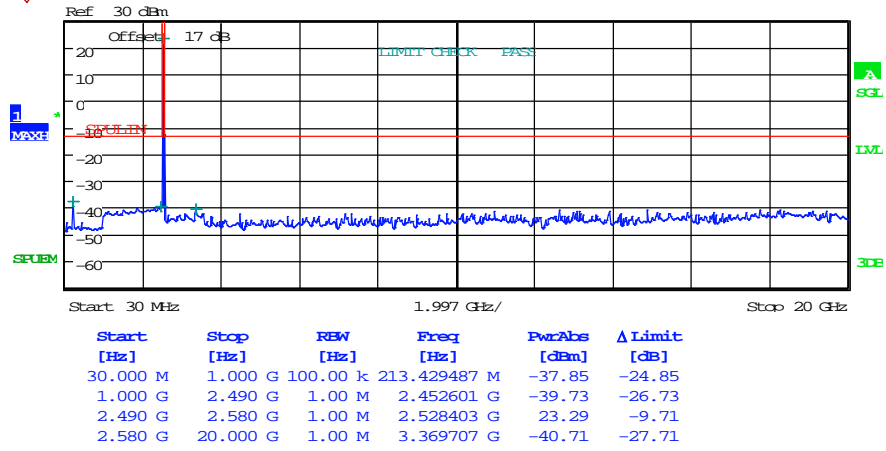

Date: 3.AUG.2020 16:34:43

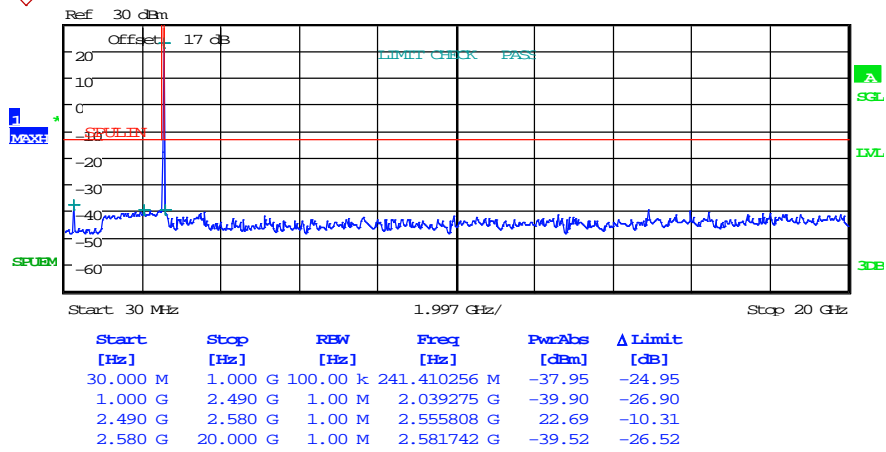


Date: 3.AUG.2020 16:34:00




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

20MHz

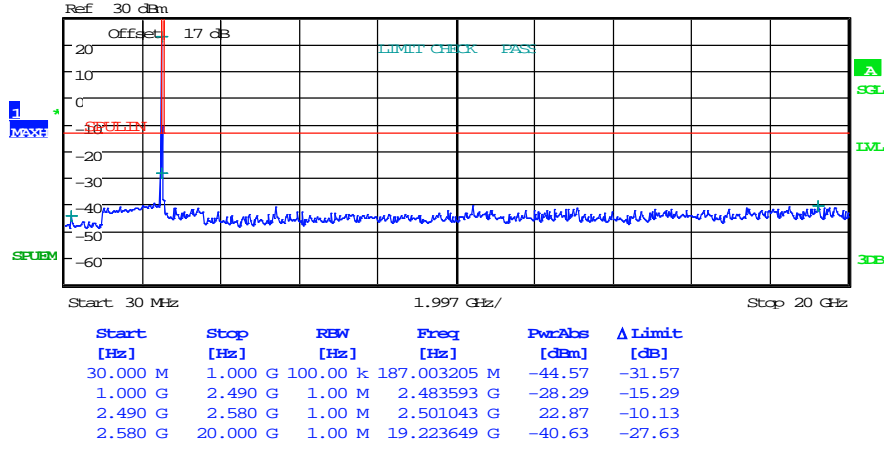

Date: 3.AUG.2020 16:45:27

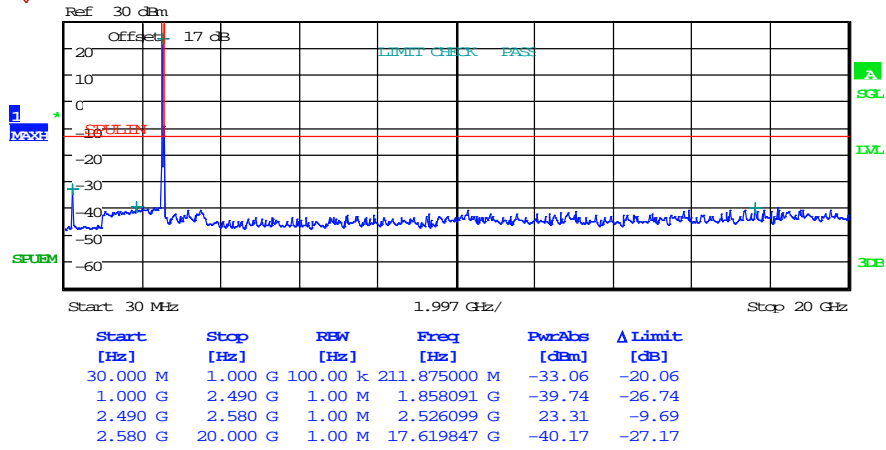


Date: 3.AUG.2020 16:37:22




# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

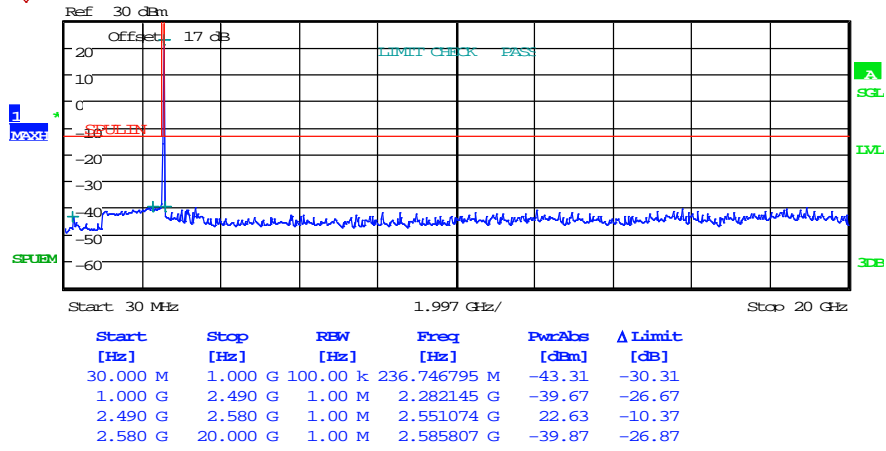


Date: 3.AUG.2020 16:38:04

QPSK  
5MHz

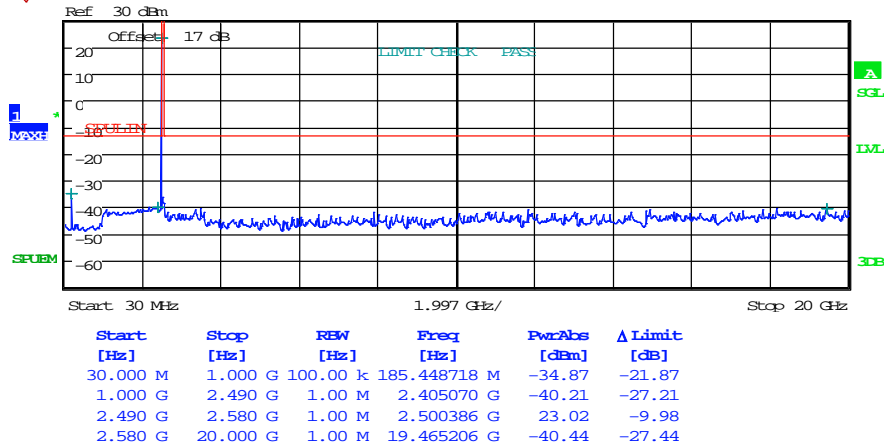

Date: 3.AUG.2020 16:16:01




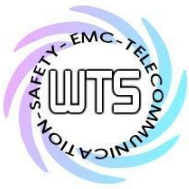


# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

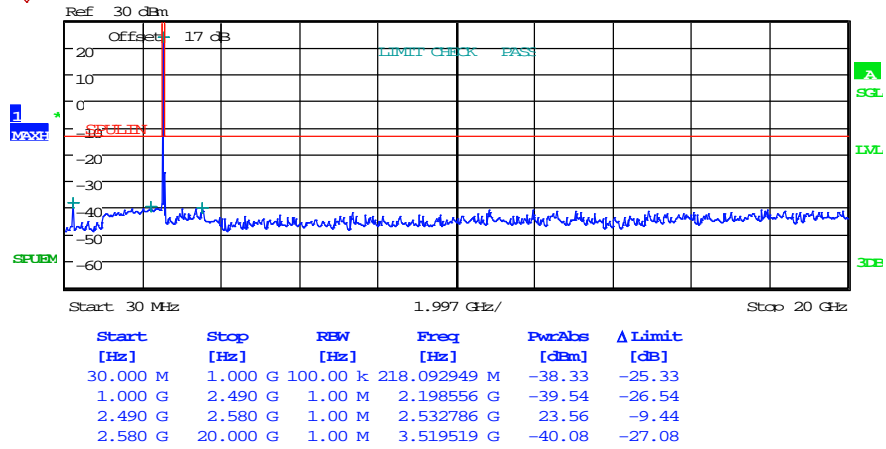

Date: 3.AUG.2020 16:16:38

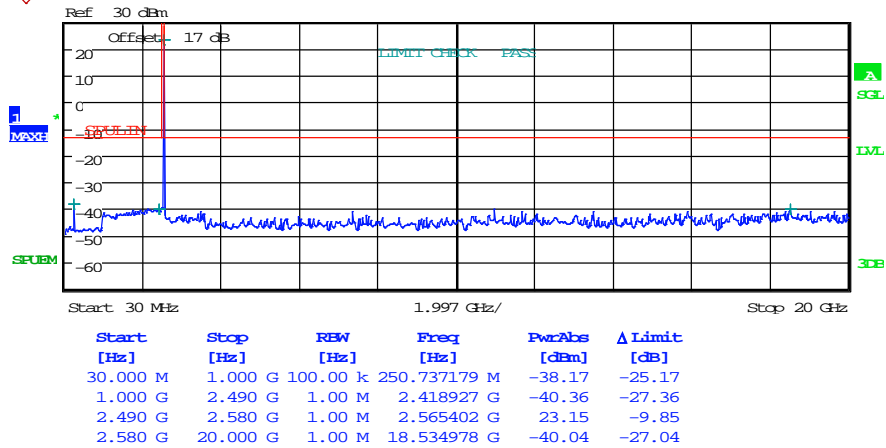


Date: 3.AUG.2020 16:16:18




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919


10MHz

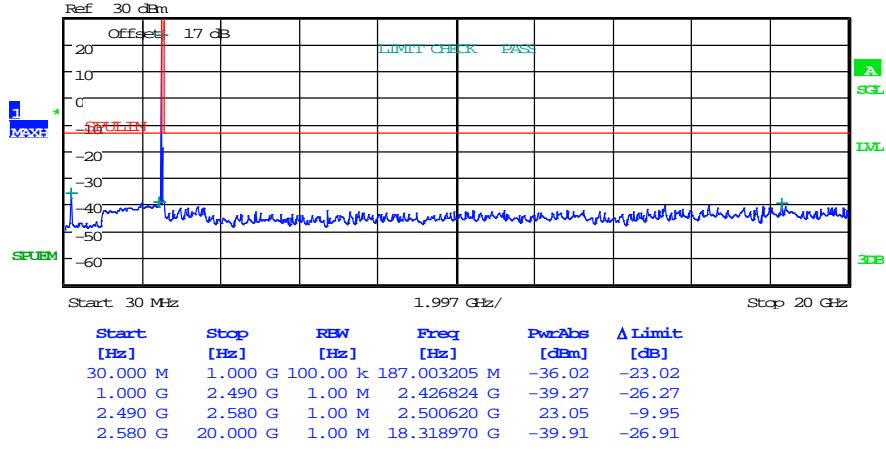


Date: 3.AUG.2020 16:20:12

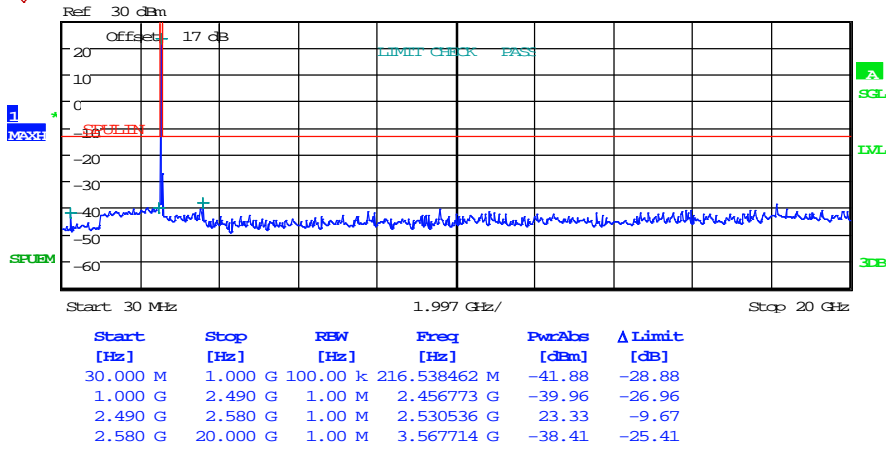

Date: 3.AUG.2020 16:19:49

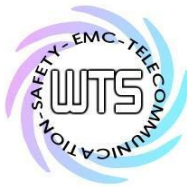


Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

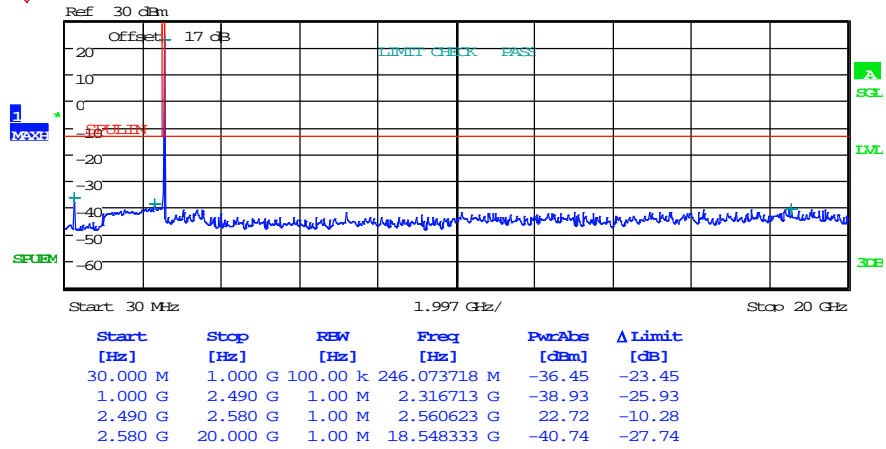


Date: 3.AUG.2020 16:20:29

15MHz

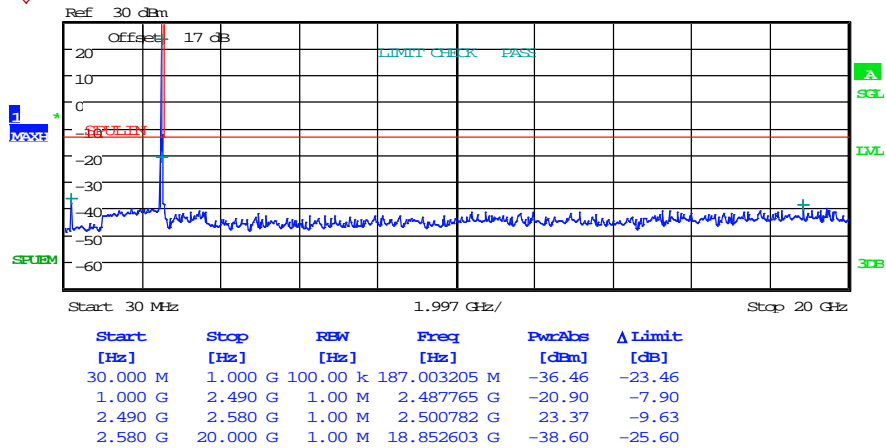


Date: 3.AUG.2020 16:32:57

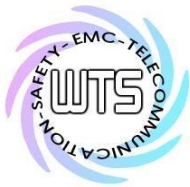


# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

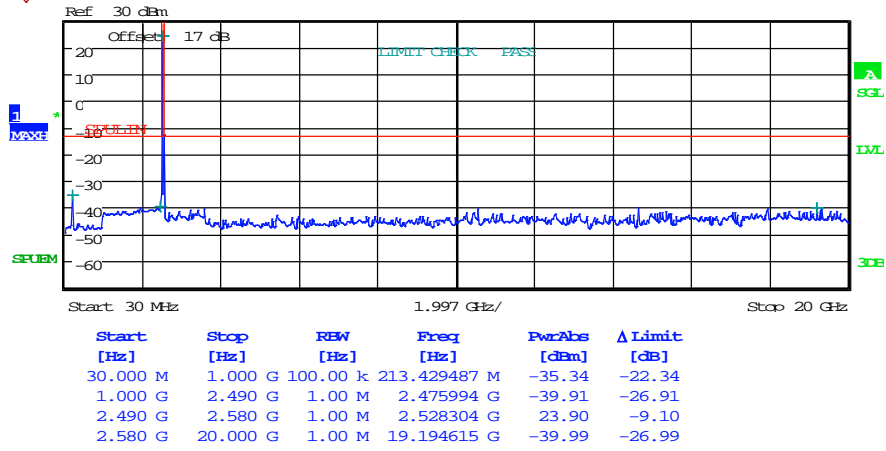

Date: 3.AUG.2020 16:32:28

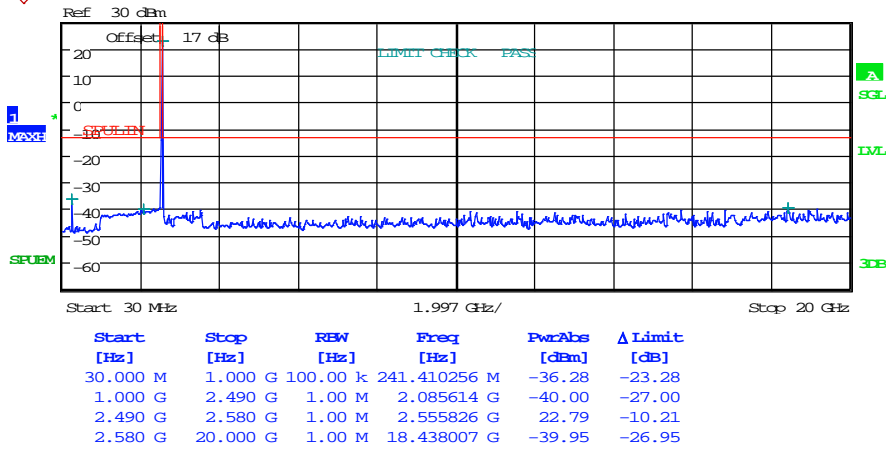

Date: 3.AUG.2020 16:33:24




# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

20MHz

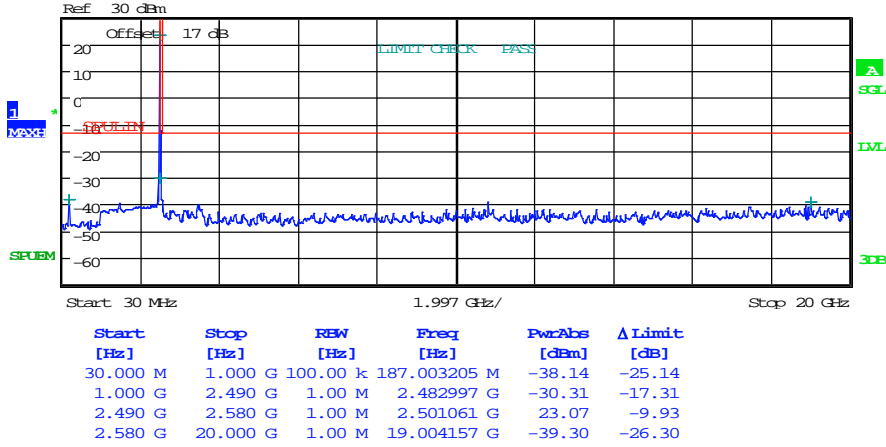

Date: 3.AUG.2020 16:46:12

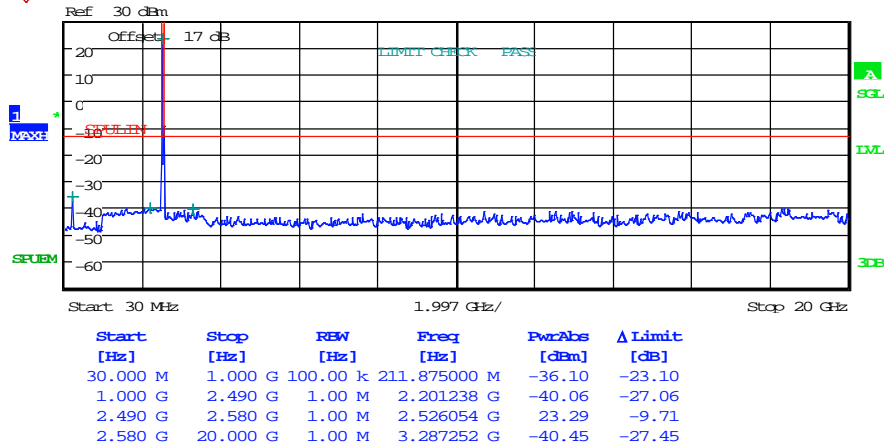


Date: 3.AUG.2020 16:46:53




# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

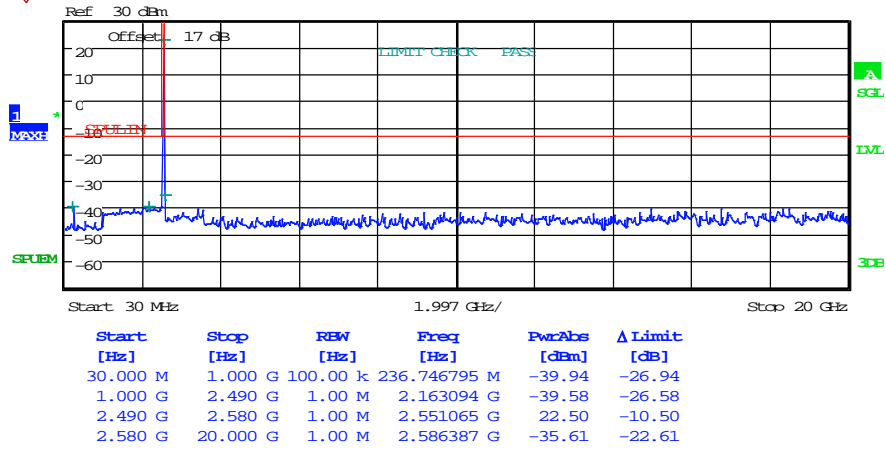

Date: 3.AUG.2020 16:46:35

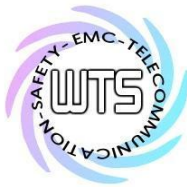

# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919


Band XXVIII

16QAM

3MHz

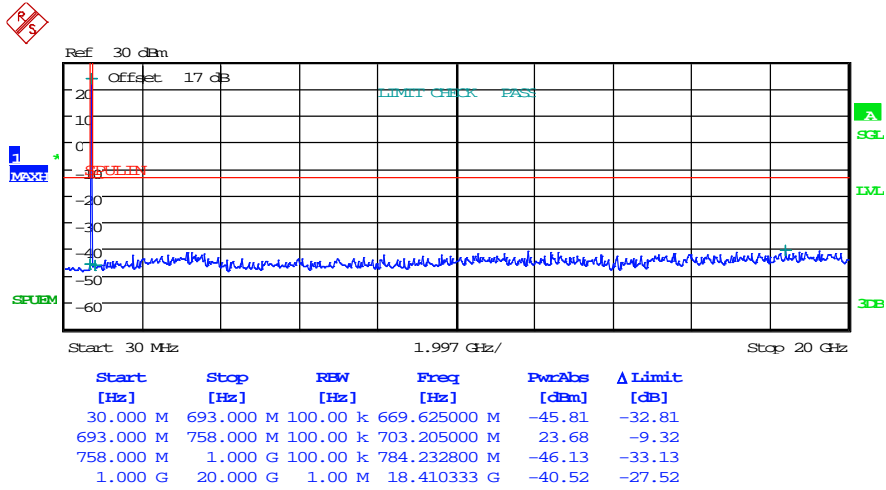

Date: 3.AUG.2020 17:10:19

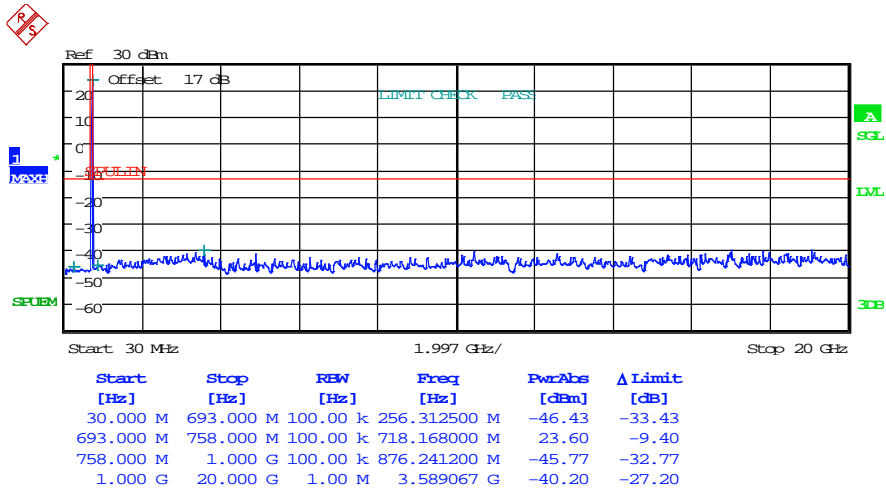


Date: 3.AUG.2020 17:10:51




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

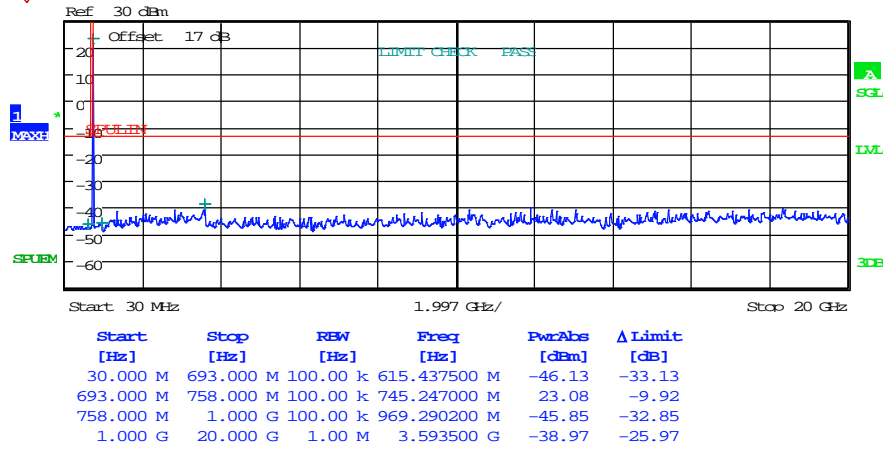

Date: 3.AUG.2020 17:10:01

5MHz

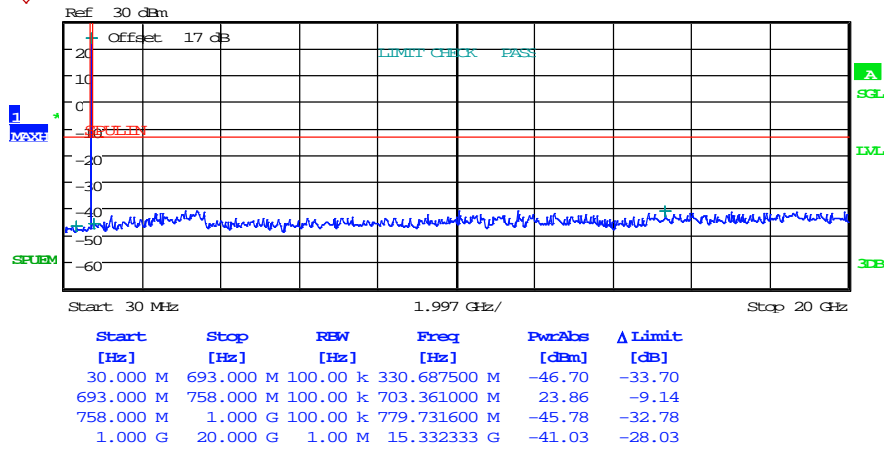

Date: 3.AUG.2020 17:05:43







# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247


FCC ID: GX9HSGWF1919

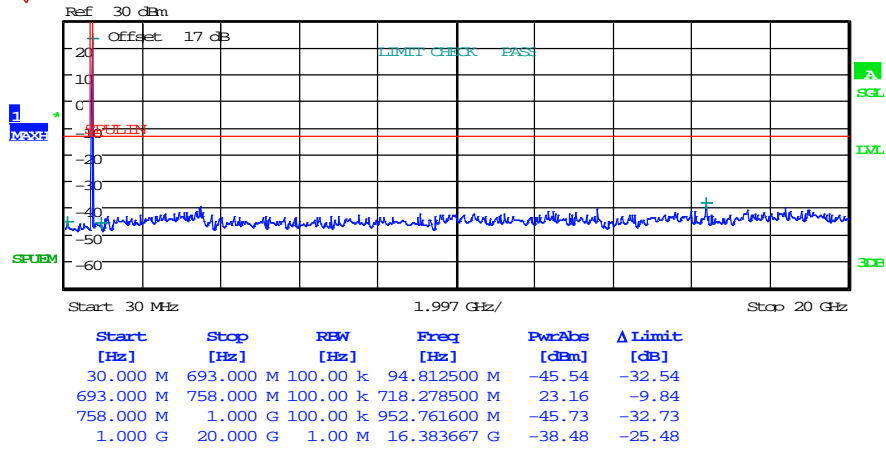

Date: 3.AUG.2020 17:06:05

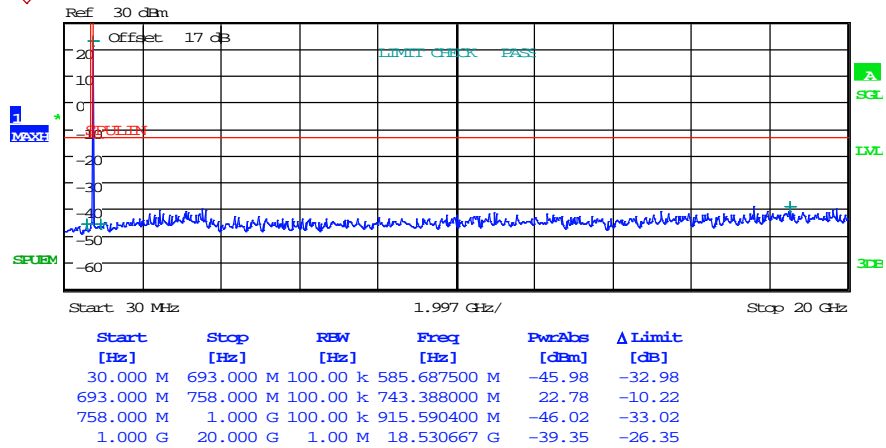

Date: 3.AUG.2020 17:06:29

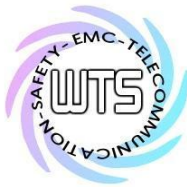


# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

10MHz

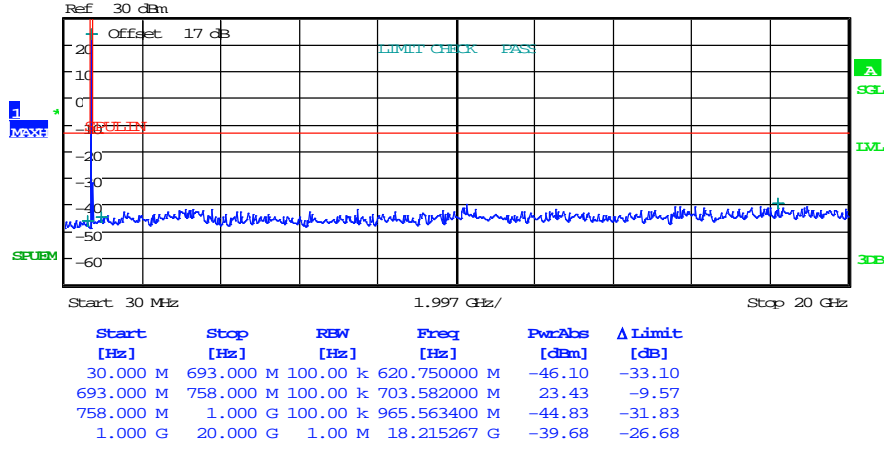


Date: 3.AUG.2020 17:04:25

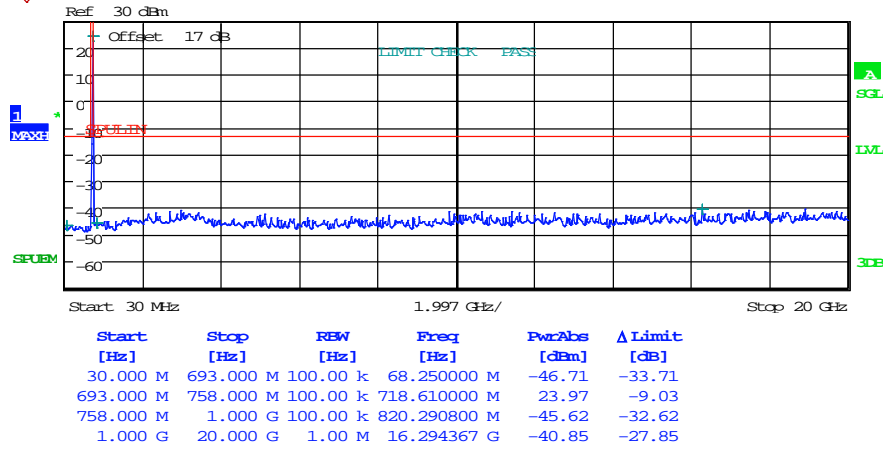

Date: 3.AUG.2020 17:04:55




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

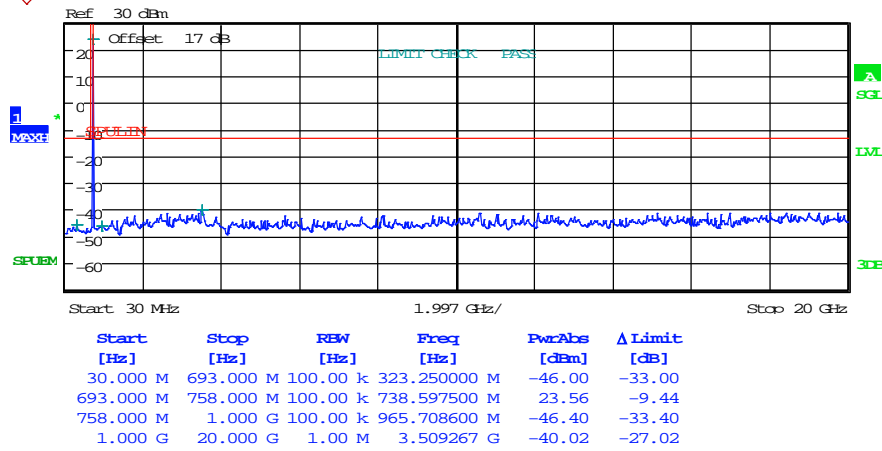


Date: 3.AUG.2020 17:04:02

15MHz

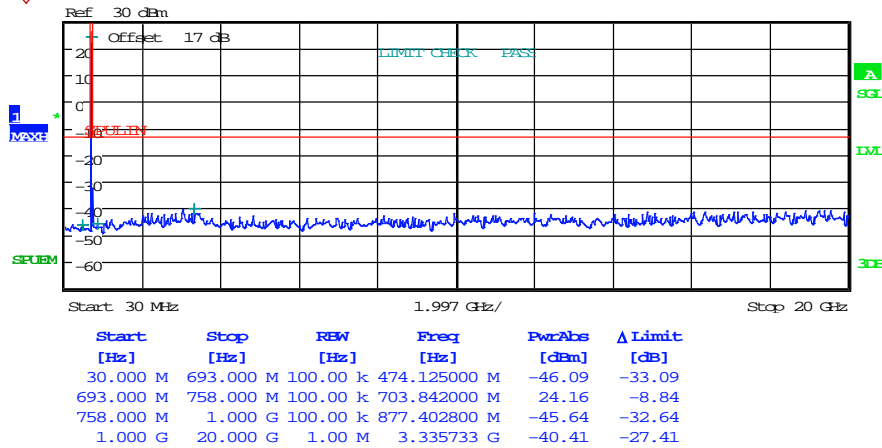


Date: 3.AUG.2020 17:00:06

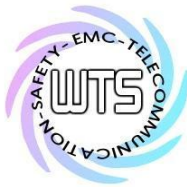


# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

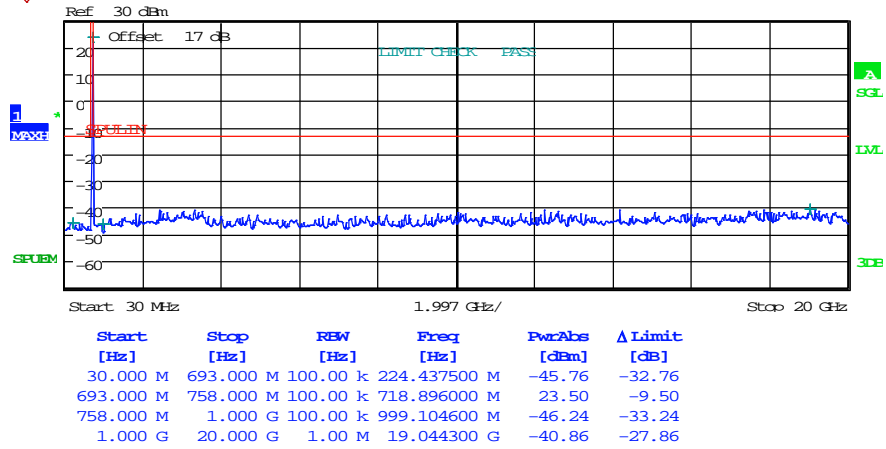

Date: 3.AUG.2020 16:59:16

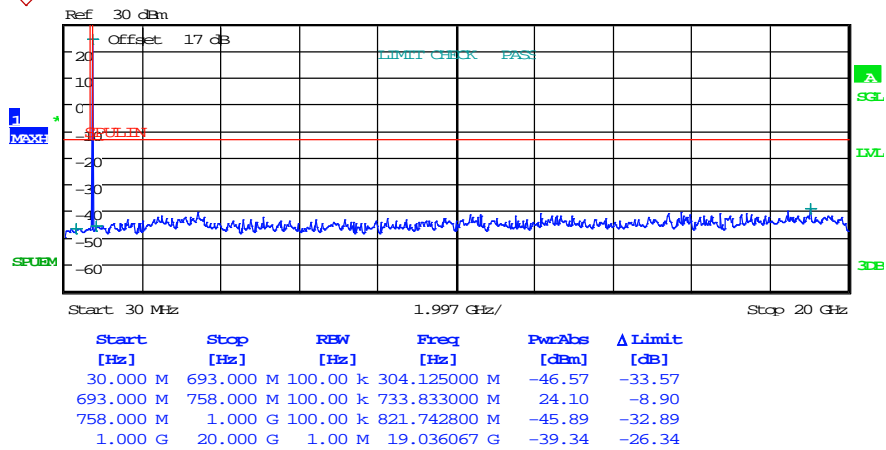

Date: 3.AUG.2020 16:59:36




# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919


20MHz

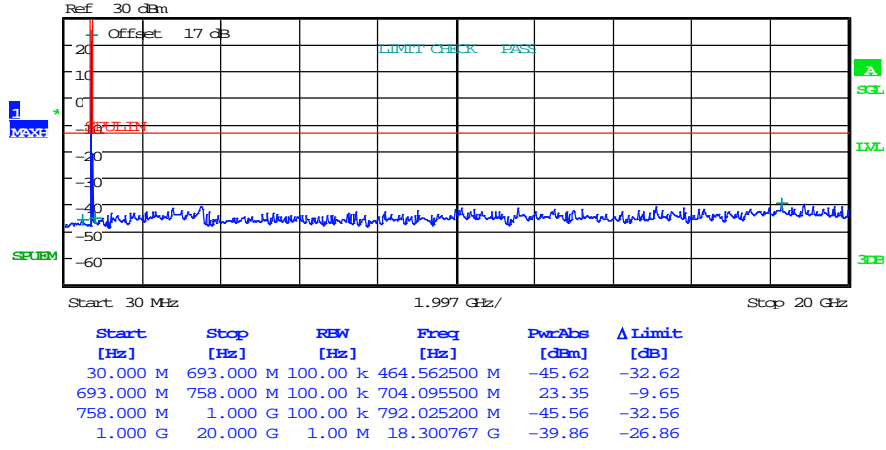

Date: 3.AUG.2020 16:56:37

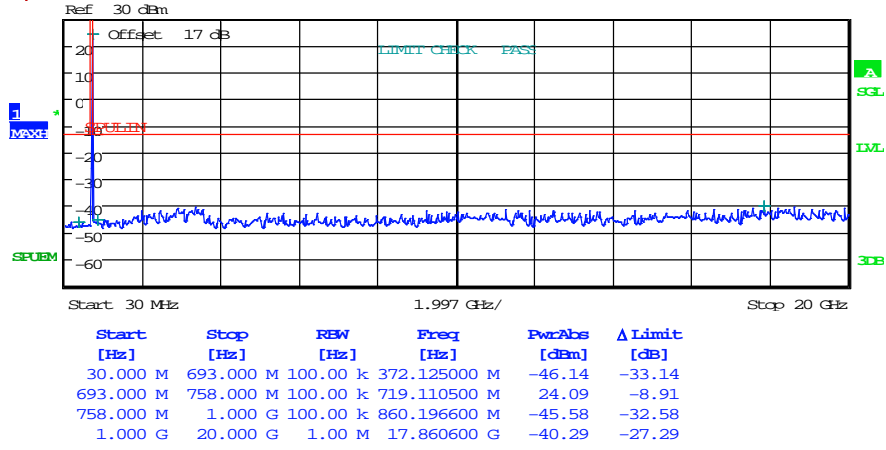


Date: 3.AUG.2020 16:55:57

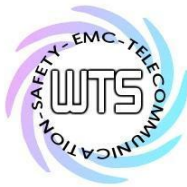

# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

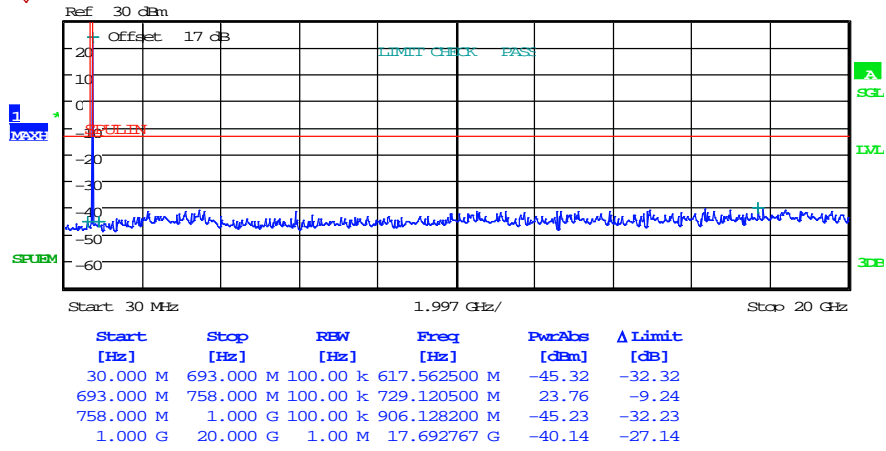

Date: 3.AUG.2020 16:56:18

QPSK  
3MHz

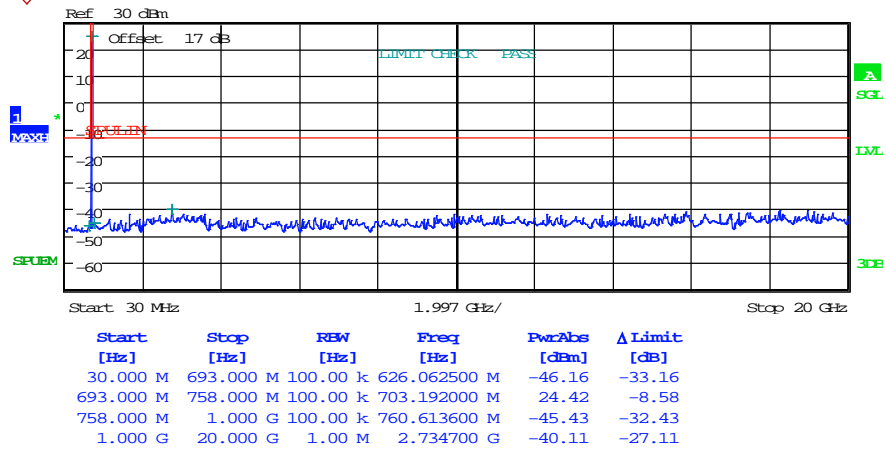


Date: 3.AUG.2020 17:08:41




# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

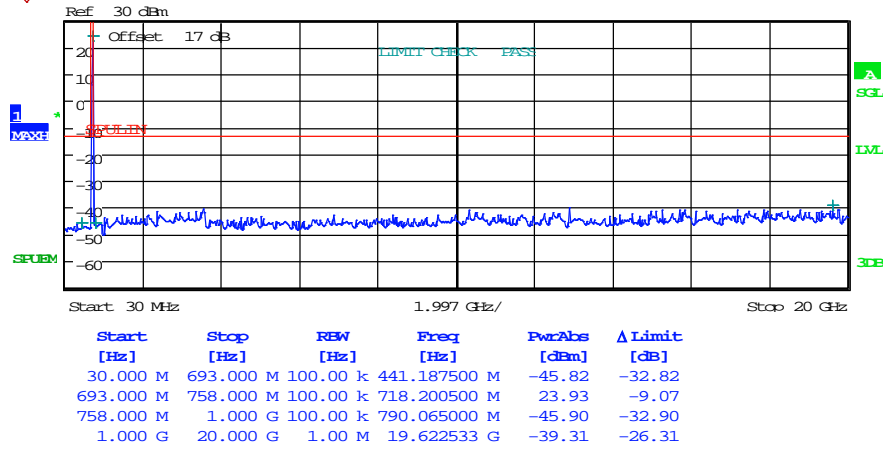

Date: 3.AUG.2020 17:09:09

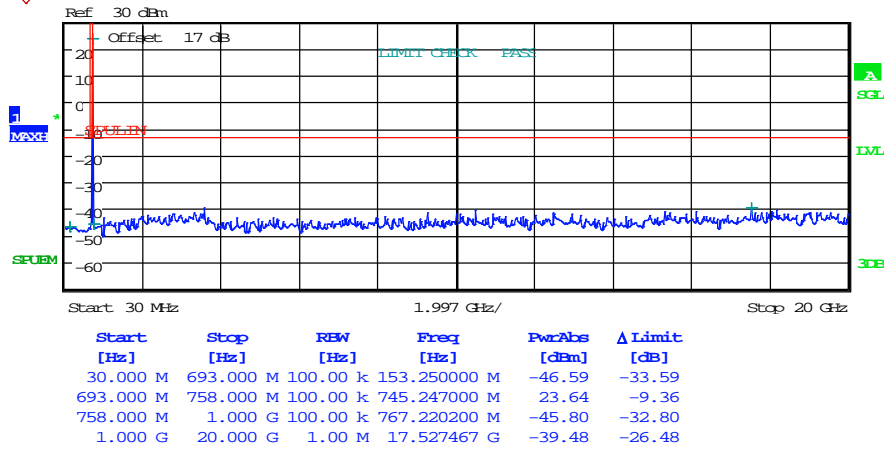

Date: 3.AUG.2020 17:09:34




# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

5MHz

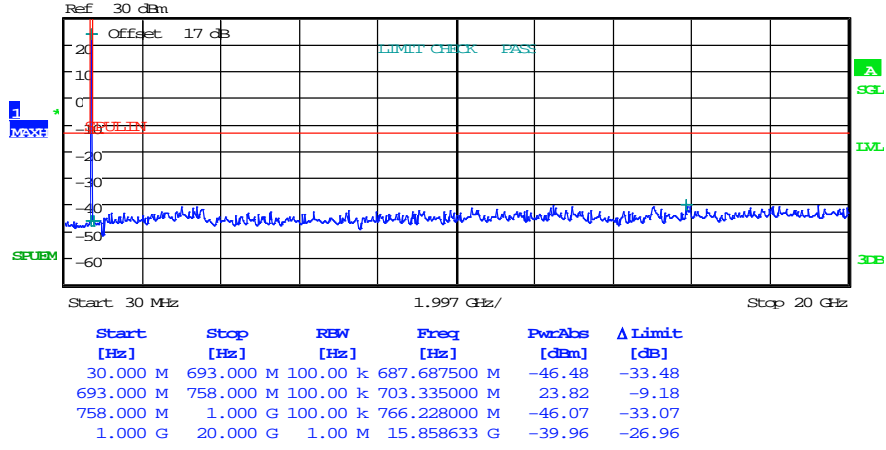


Date: 3.AUG.2020 17:07:21

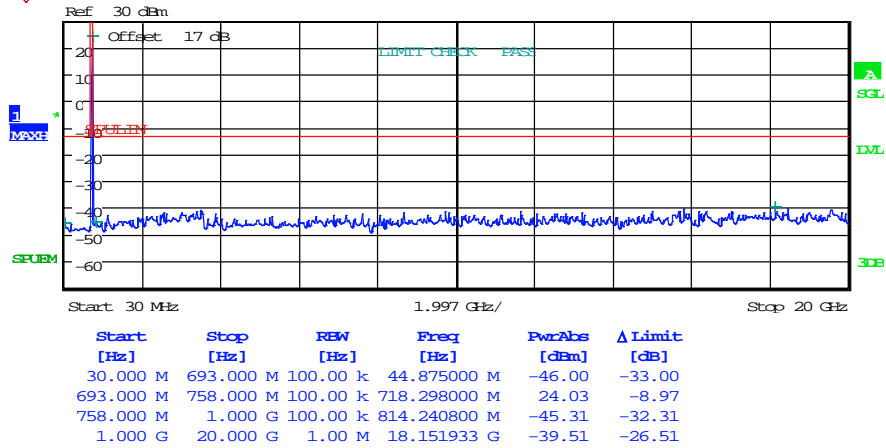

Date: 3.AUG.2020 17:07:48




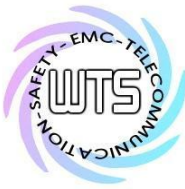

# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

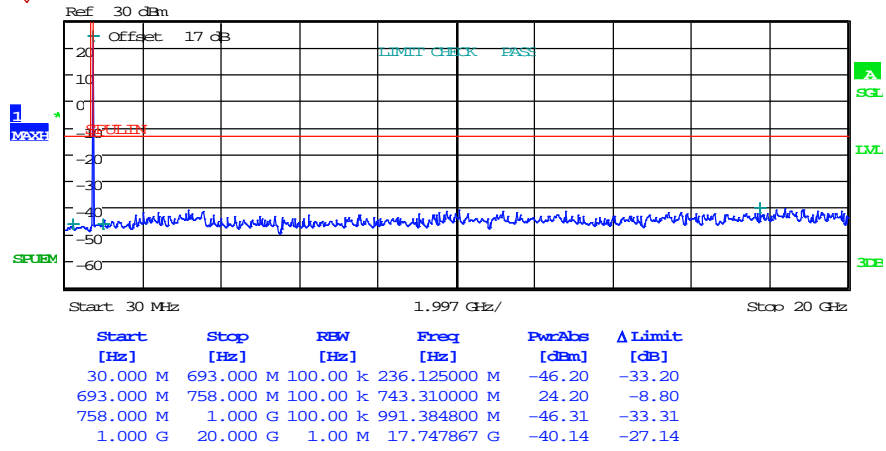

Date: 3.AUG.2020 17:06:57

10MHz

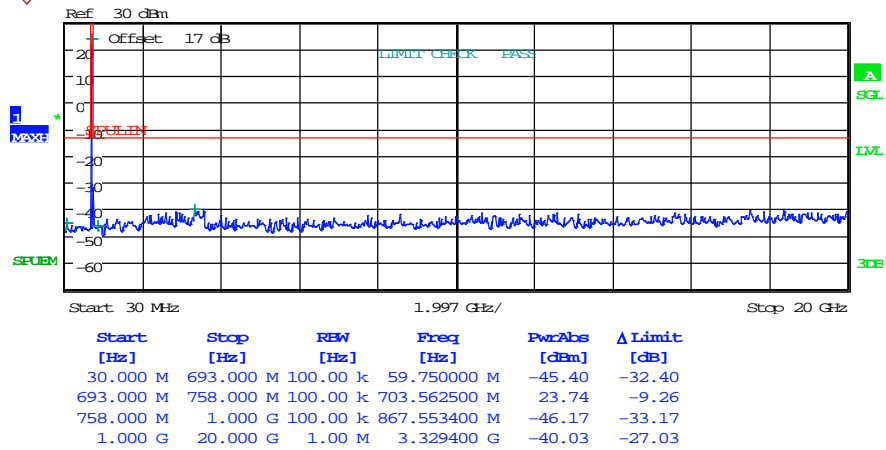


Date: 3.AUG.2020 17:02:27




# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

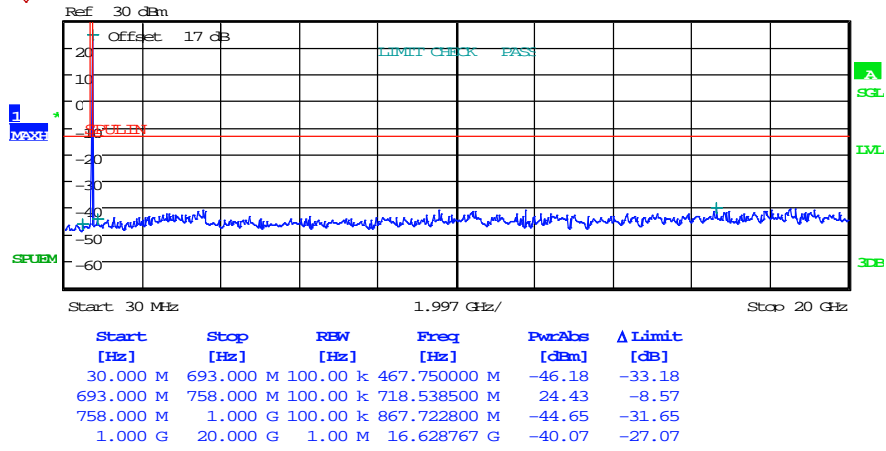

Date: 3.AUG.2020 17:02:46

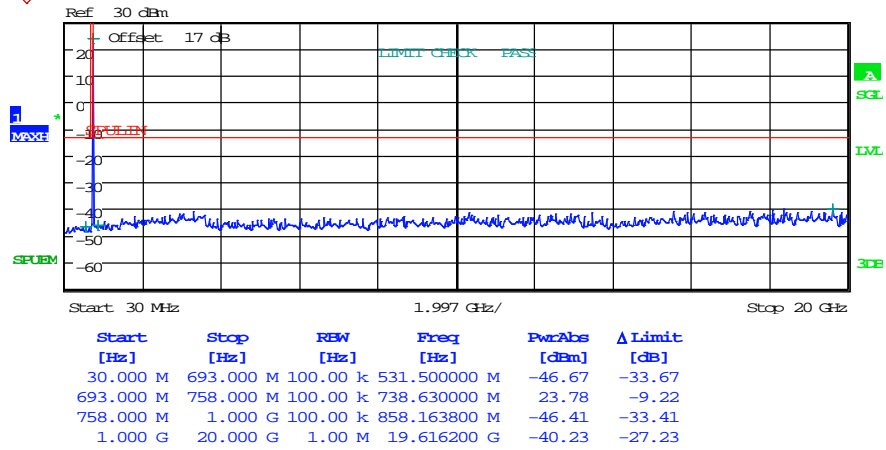

Date: 3.AUG.2020 17:03:31




# Worldwide Testing Services(Taiwan) Co., Ltd.


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919


15MHz

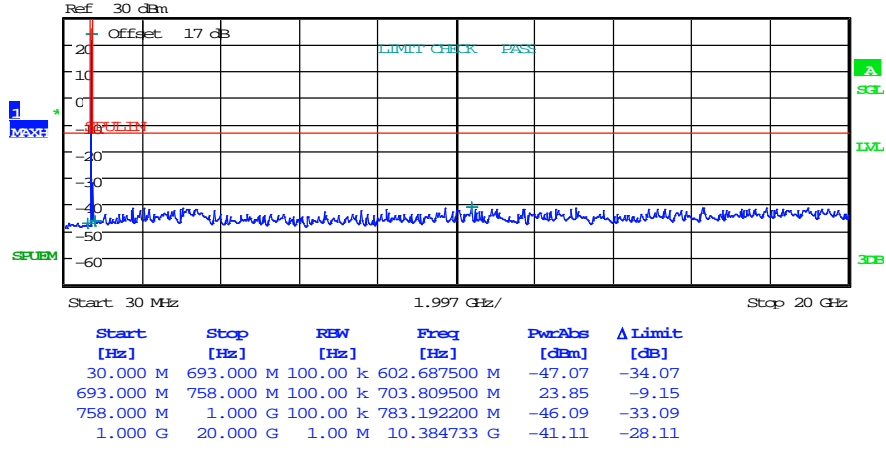

Date: 3.AUG.2020 17:00:56

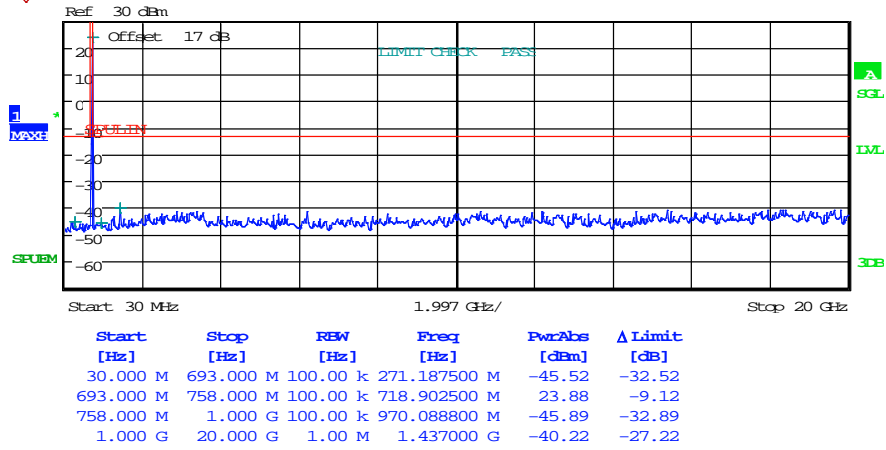


Date: 3.AUG.2020 17:01:39

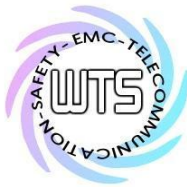


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

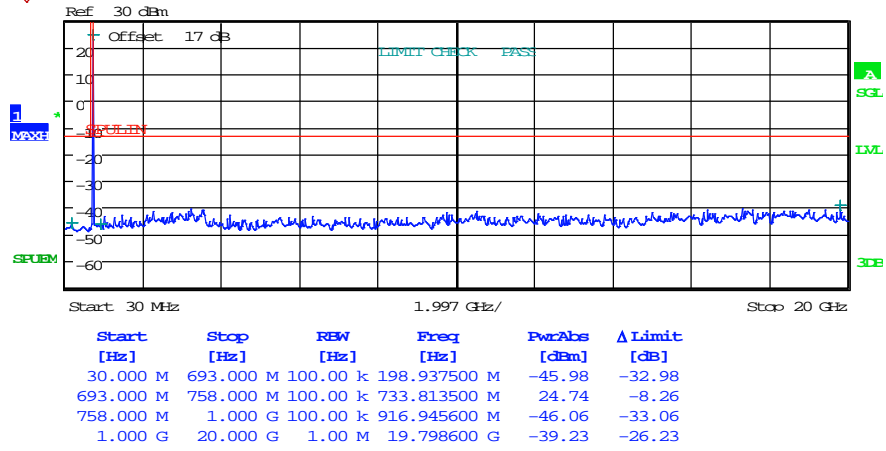

Date: 3.AUG.2020 17:01:18

20MHz

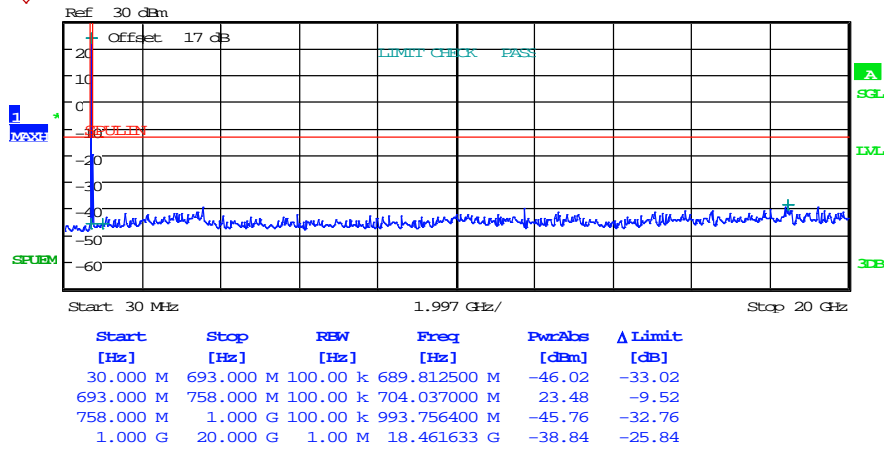


Date: 3.AUG.2020 16:51:14




# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

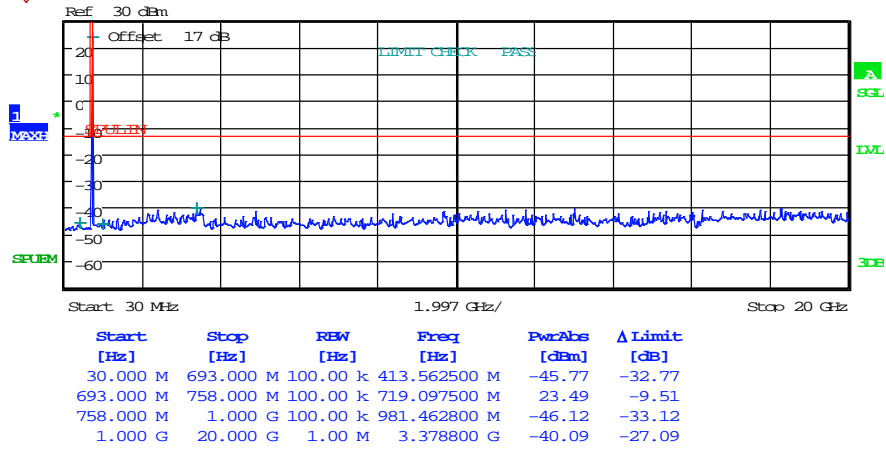

Date: 3.AUG.2020 16:55:23

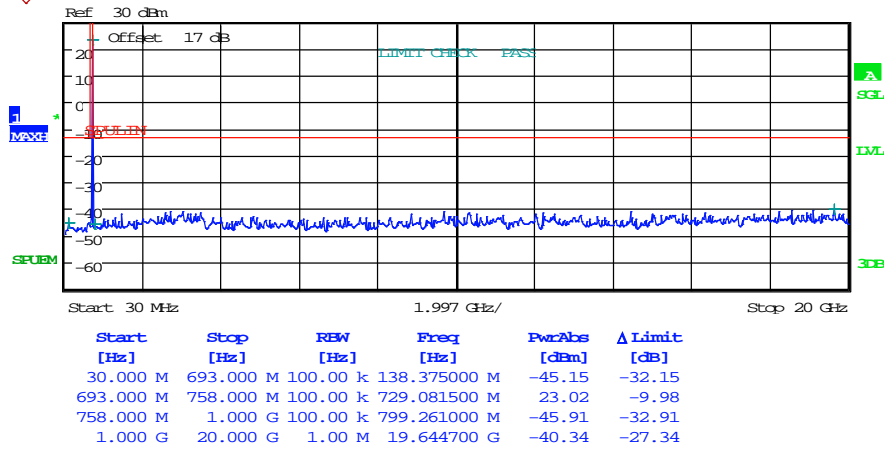

Date: 3.AUG.2020 16:54:44

Test equipment: ETSTW-RE 055, ETSTW-GSM 002, ETSTW-GSM 023, ETSTW-GSM 004



Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

### **7.3 Explanation of test result**

All factors like cable loss and external attenuation etc. are already included in the provided measurement results. This is done by using validated test software and calibrated test system according the accreditation requirements.

### **7.4 Calculation of Limit for Spurious at Antenna Terminals**

Compliance with § 22.917, §24.238, §27.53 requires that any emission be attenuated below the transmitter power at least  $43 + 10 \log P$  ( $P$  = transmitter power in Watts).

Limit for Spurious Emissions at Antenna Terminals:  $L=P-A=-13\text{dBm}$



Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

**8. Field Strength of Spurious Radiation**

**8.1 Test procedure**

The test procedure for filed strength measurement is same as radiated power except for a notch filter or band pass filter is used to avoid the influence of fundamental to the pre-amplifier. The measurements below 1GHz were performed with a measurement bandwidth of 100kHz, above 1GHz with a bandwidth of 1 MHz.

**8.2 Test Results**

The measurements of the spurious emission are at the upper, center and lower channel.

Model: HSGW-G8 Date:   
 Mode: -- Temperature: -- °C Engineer: --   
 Polarization: Horizontal Humidity: -- %

Frequency (MHz)	Reading (dBm) Peak	Factor (dB) Corr.	Result (dBm)	Limit (dBm)	Margin (dB)	Table Degree (Deg.)	Ant. High (cm)
--	--	--	--	--	--	--	--
--	--	--	--	--	--	--	--

Polarization: Vertical

Frequency (MHz)	Reading (dBm) Peak	Factor (dB) Corr.	Result (dBm)	Limit (dBm)	Margin (dB)	Table Degree (Deg.)	Ant. High (cm)
--	--	--	--	--	--	--	--
--	--	--	--	--	--	--	--

- Note**
1. Correction Factor = Antenna factor + Cable loss - Preamplifier
  2. The formula of measured value as: Test Result = Reading + Correction Factor
  3. Detector function in the form: PK = Peak, QP = Quasi Peak, AV = Average
  4. All not in the table noted test results are more than 20 dB below the relevant limits.
  5. See attached diagrams in appendix.

**8.3 Explanation of test result**

Result Level = Reading Level + Corrected Factor  
 Corrected Factor = SG level – Received level-Cable loss + substitution antenna gain

**8.4 Calculation of Limit for Field Strength of Spurious**

Compliance with § 22.917, § 24.238, § 27.53 requires that any emission be attenuated below the transmitter power at least 43 + 10 log P (P = transmitter power in Watts).  
 Limit for Spurious Emissions at Antenna Terminals: L=P-A=-13dBm

Test equipment: ETSTW-RE 004, ETSTW-RE 018, ETSTW-RE 030, ETSTW-RE 062, ETSTW-RE 142, ETSTW-RE 147, ETSTW-GSM 004



Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

## 8.5 Test result of band edge emissions

Test date: August 02, 2020~August 03, 2020


Temperature: 23.8 °C

Humidity: 53.4 %

Tester: Sora

GSM

Band 850 MHz

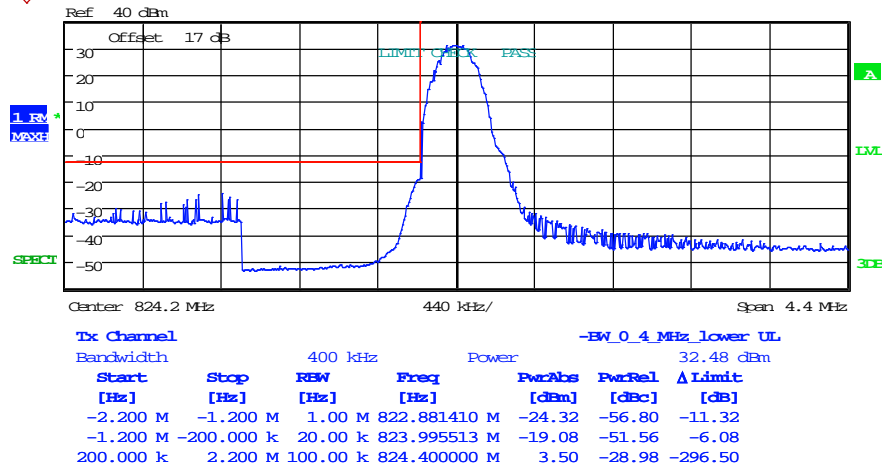


Date: 2.AUG.2020 14:52:50






Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

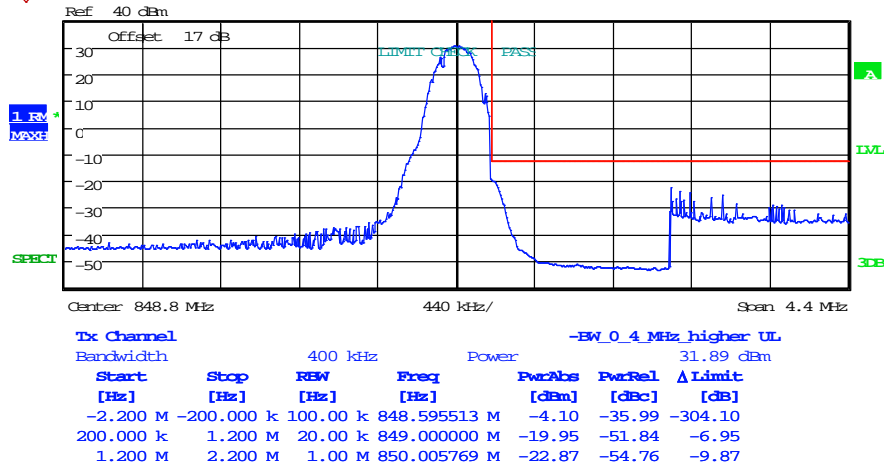

Date: 2.AUG.2020 14:53:54


## Band 1900 MHz

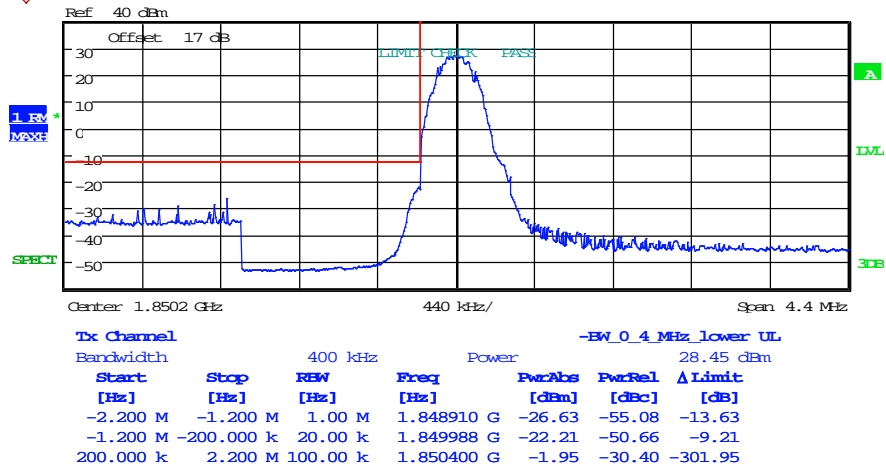

Date: 2.AUG.2020 15:49:20




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

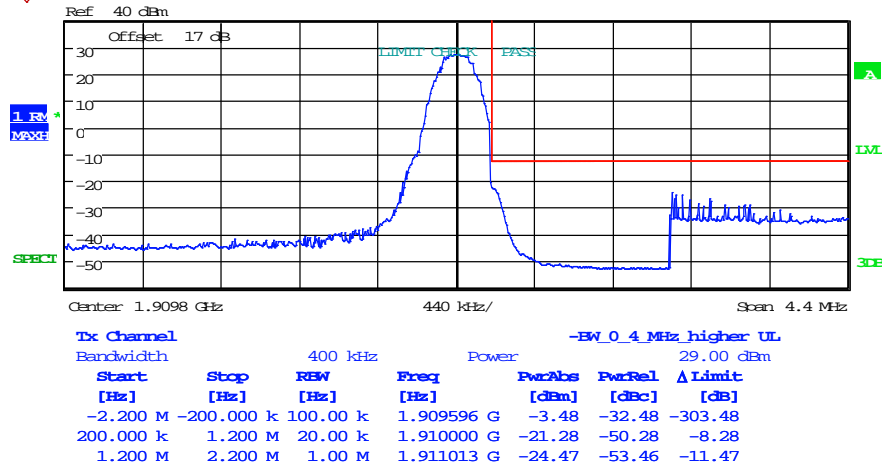


Date: 2.AUG.2020 15:48:22

## WCDMA Band II

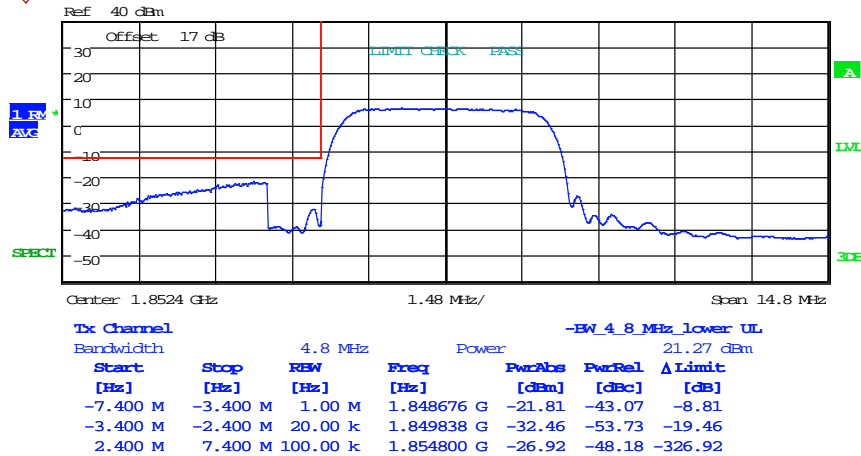


Date: 2.AUG.2020 12:42:31

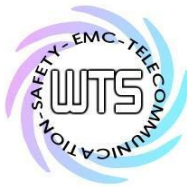


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

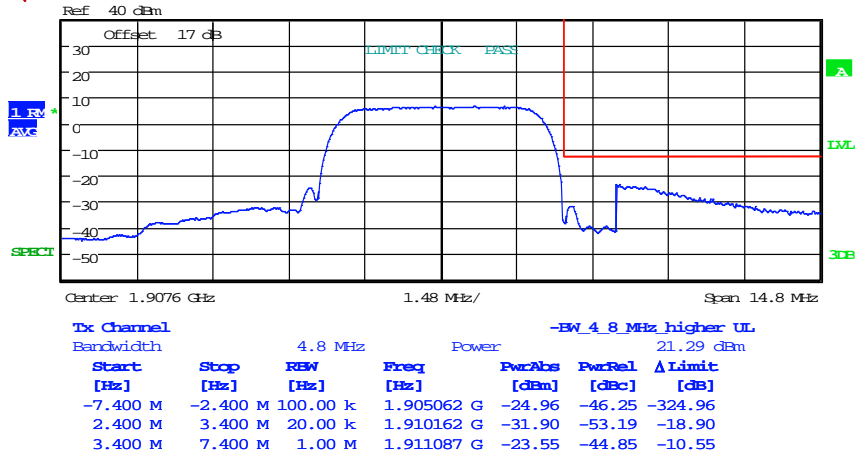

Date: 2.AUG.2020 12:43:52

## Band V

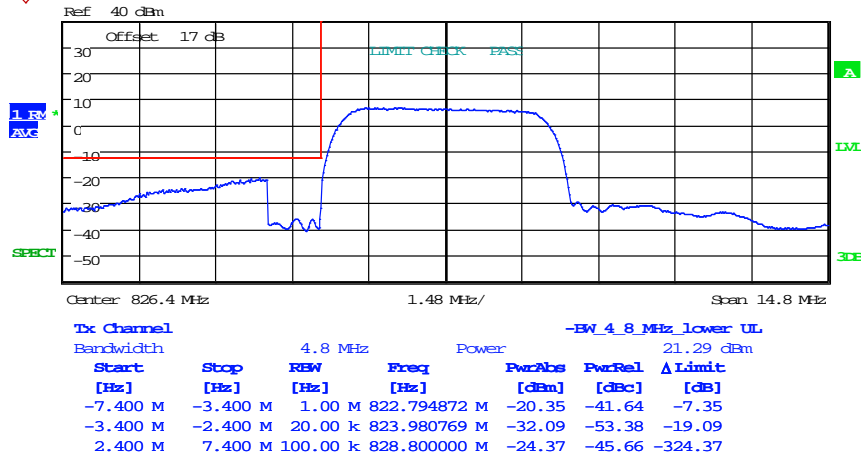


Date: 2.AUG.2020 12:47:44




# Worldwide Testing Services(Taiwan) Co., Ltd.

Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

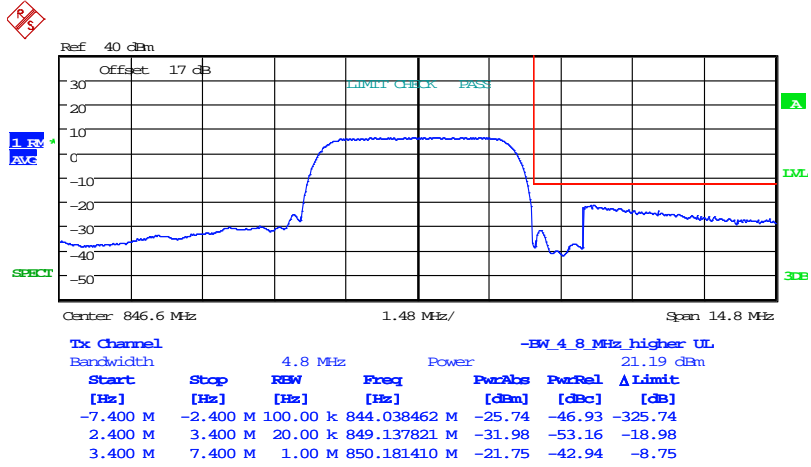

Date: 2.AUG.2020 12:46:24

LTE  
 Band II  
 16QAM  
 1RB  
 1.4MHz

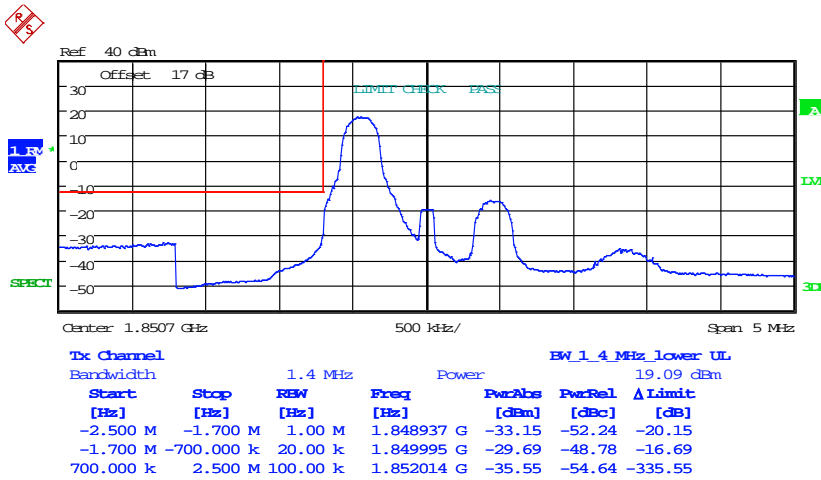


Date: 3.AUG.2020 13:59:29




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

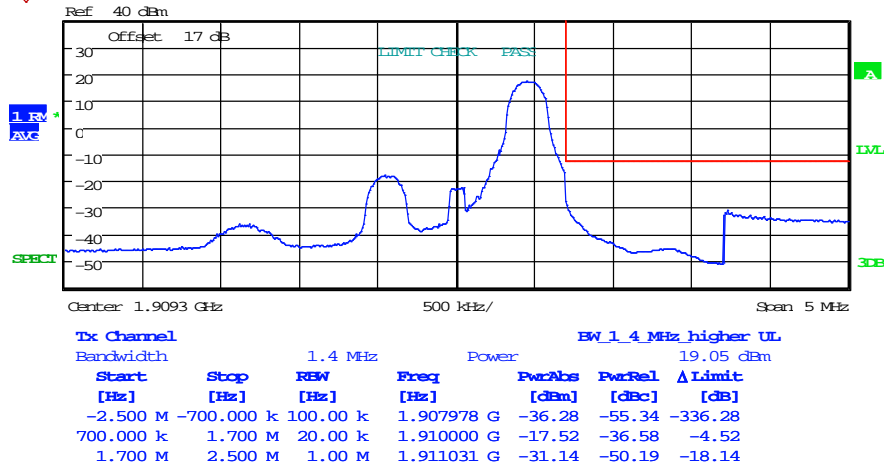

Date: 3.AUG.2020 14:01:07


3MHz

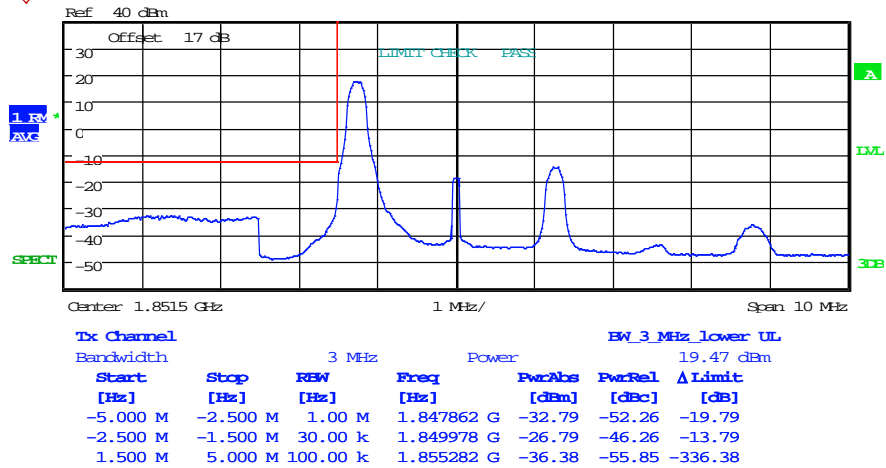

Date: 3.AUG.2020 13:47:55




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

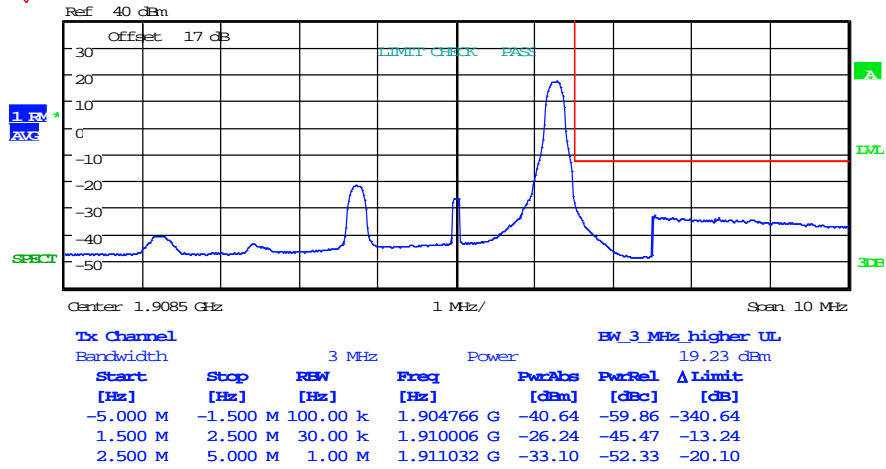

Date: 3.AUG.2020 13:48:41

5MHz

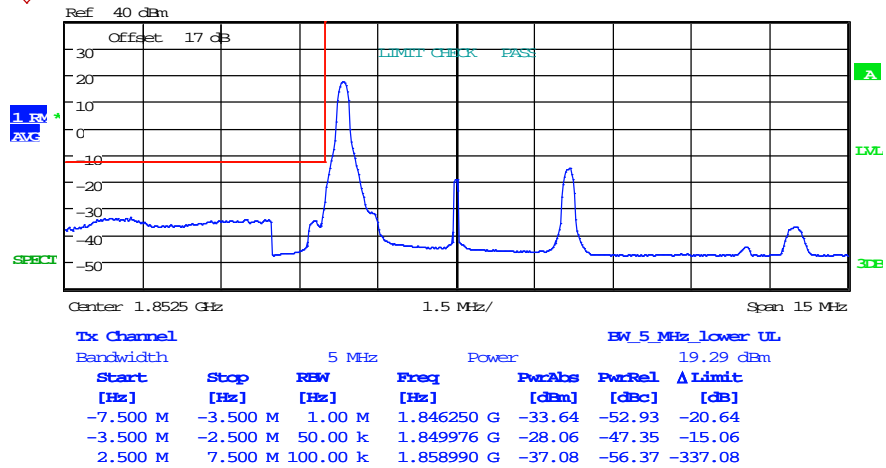


Date: 3.AUG.2020 13:42:19




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

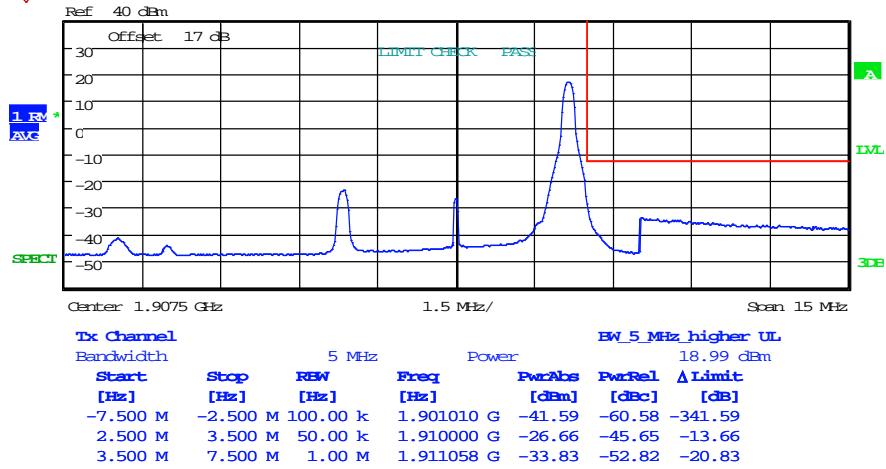

Date: 3.AUG.2020 13:43:02

10MHz

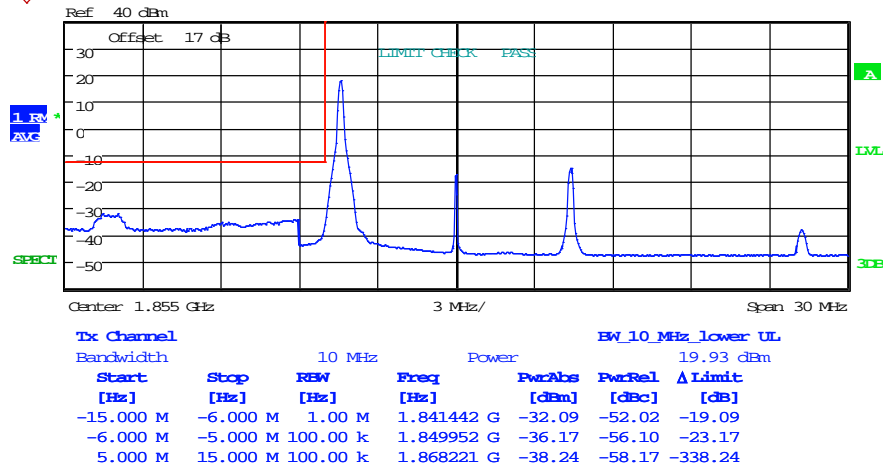


Date: 3.AUG.2020 13:04:06




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

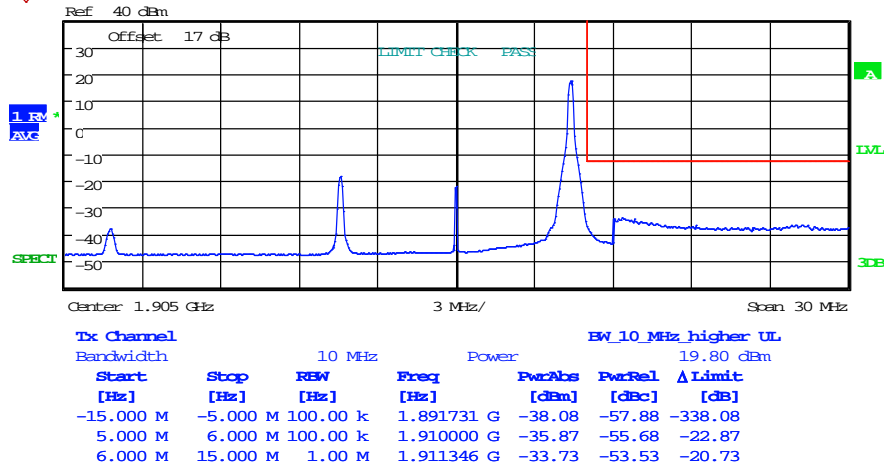

Date: 3.AUG.2020 13:04:58

15MHz

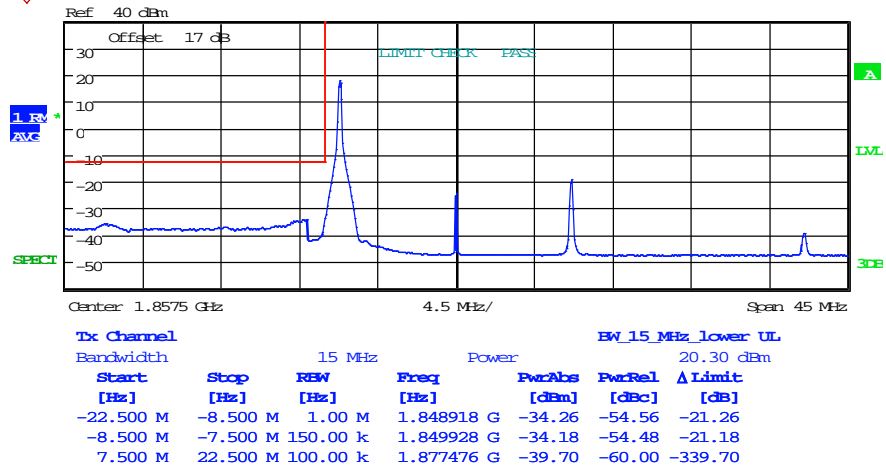


Date: 3.AUG.2020 11:57:35






Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

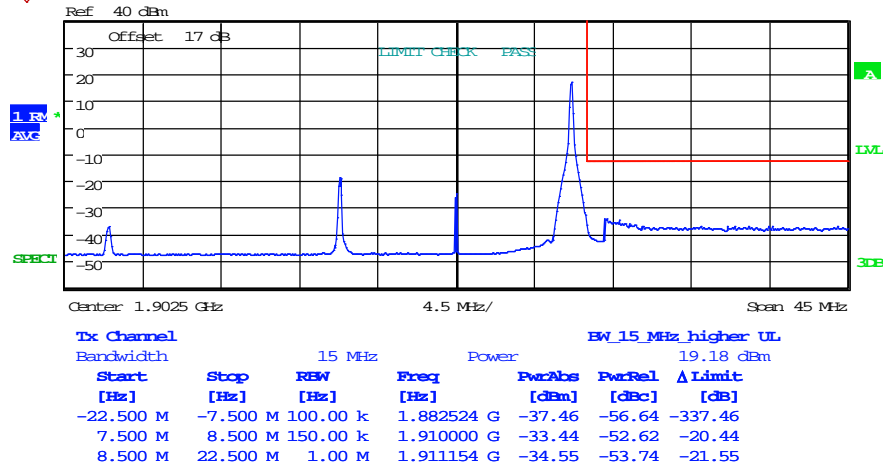

Date: 3.AUG.2020 11:58:14

20MHz

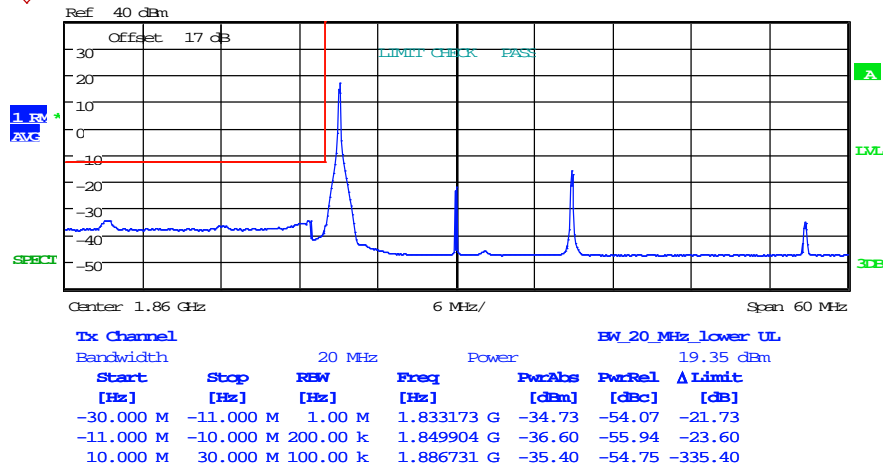


Date: 3.AUG.2020 11:05:45




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

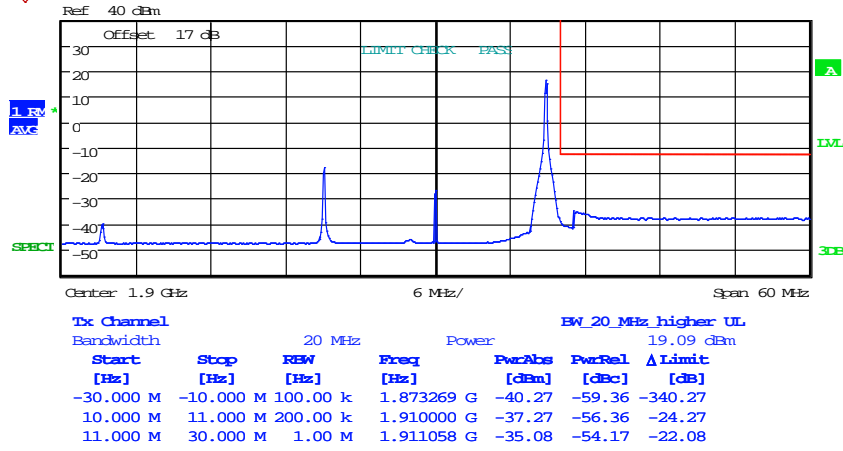

Date: 3.AUG.2020 11:03:46

QPSK  
FRB  
1.4MHz

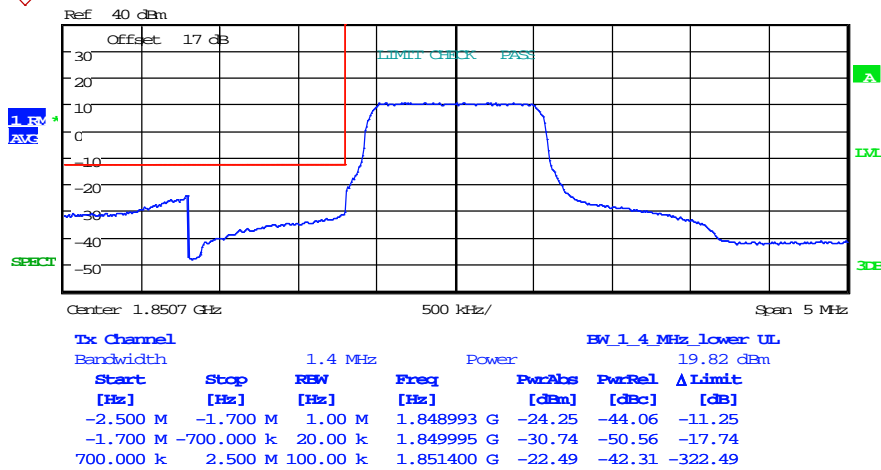


Date: 3.AUG.2020 13:57:40




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

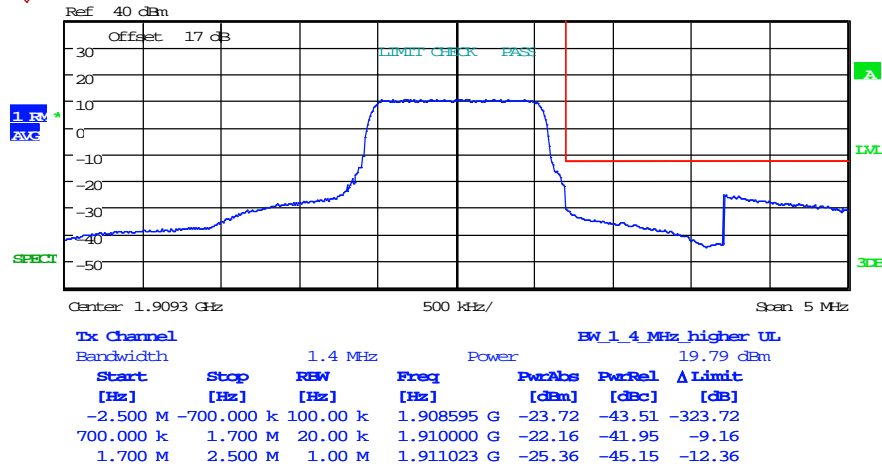


Date: 3.AUG.2020 14:01:43


3MHz

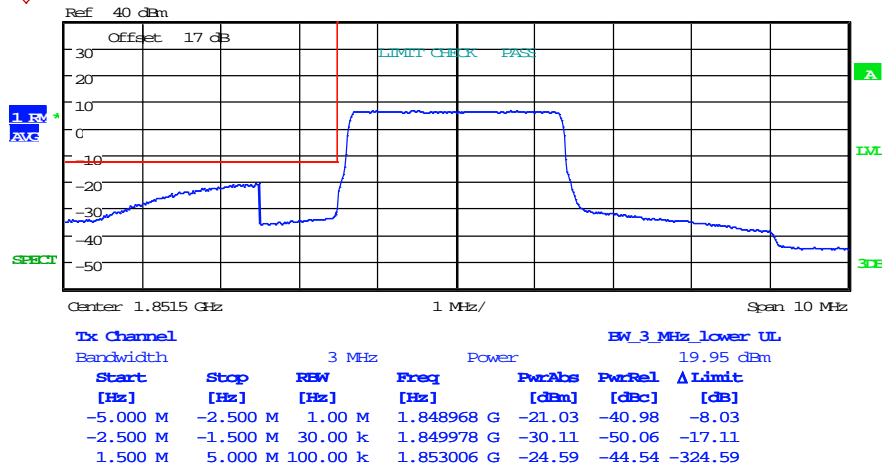

Date: 3.AUG.2020 13:47:13

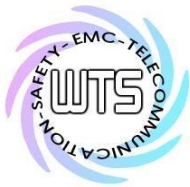


Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

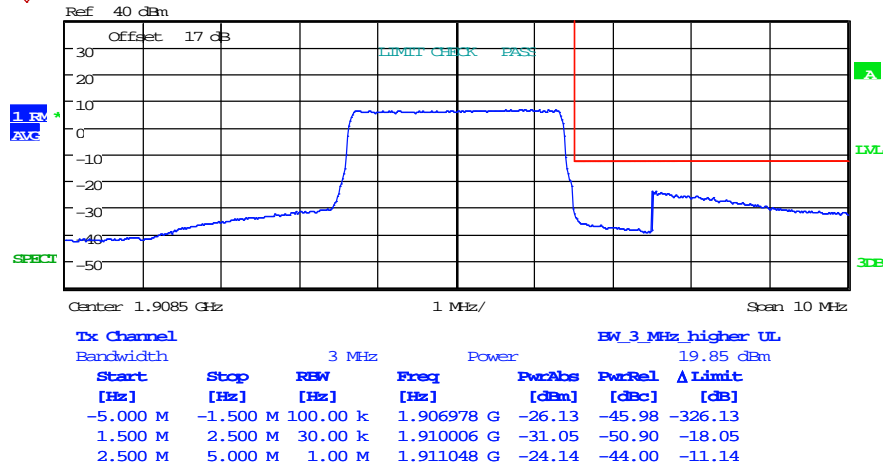

Date: 3.AUG.2020 13:49:07


5MHz

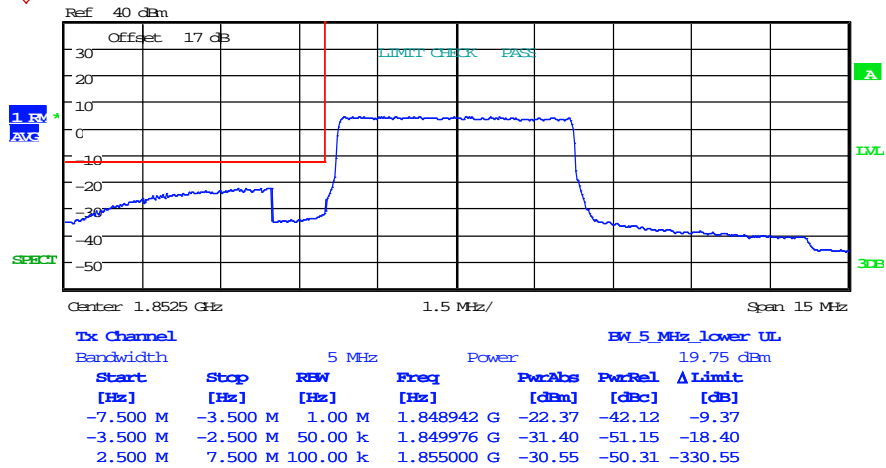

Date: 3.AUG.2020 13:41:54




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

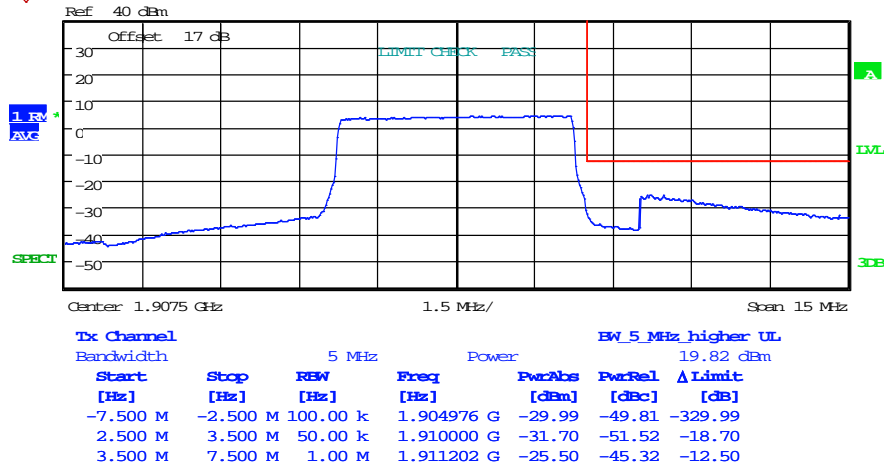

Date: 3.AUG.2020 13:43:24


10MHz

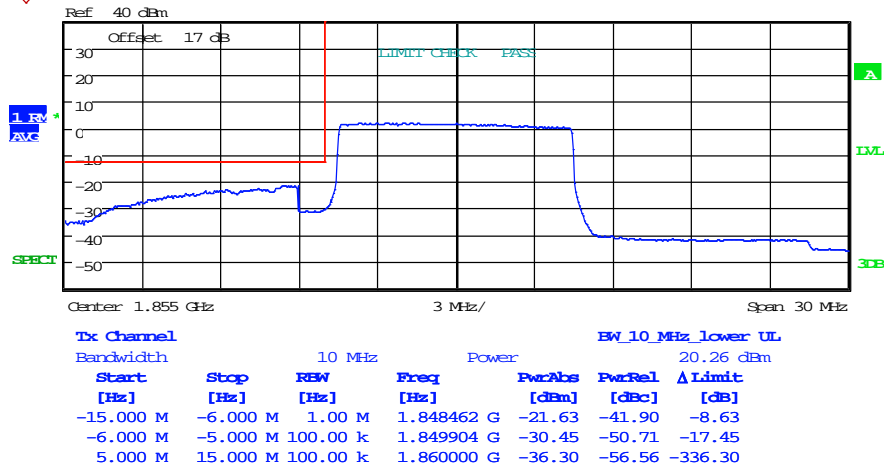

Date: 3.AUG.2020 13:02:26




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

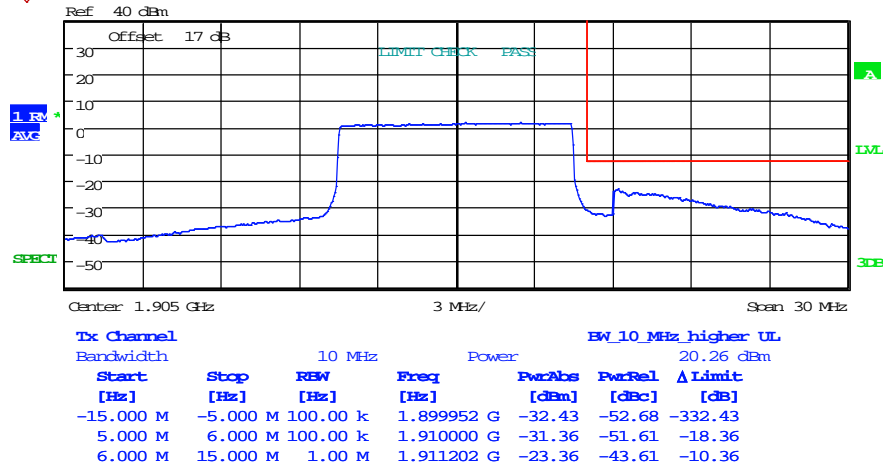

Date: 3.AUG.2020 13:05:28


## 15MHz

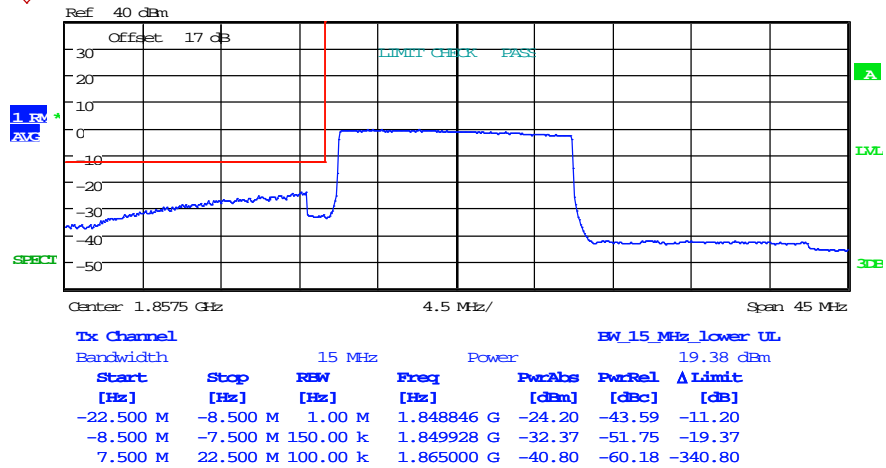

Date: 3.AUG.2020 11:57:10




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

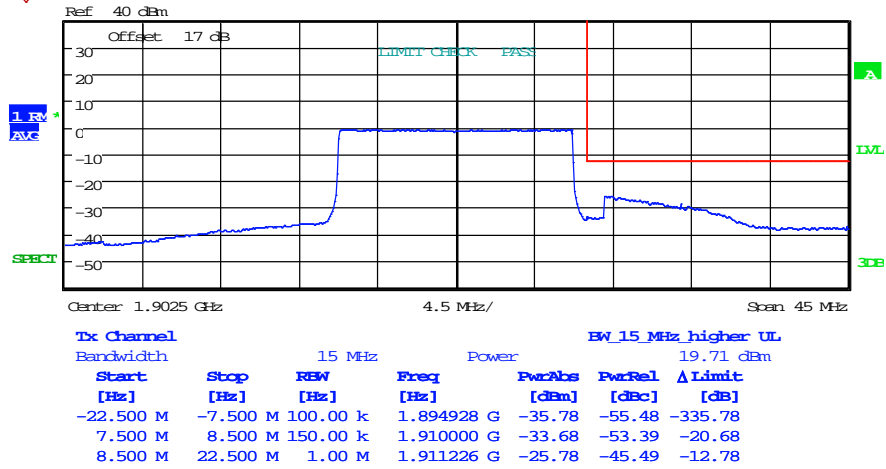

Date: 3.AUG.2020 11:58:39

20MHz

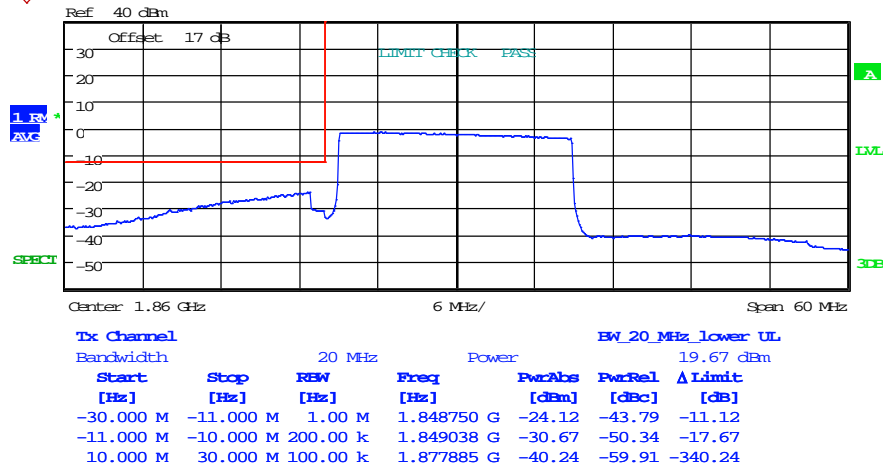


Date: 3.AUG.2020 11:06:29




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

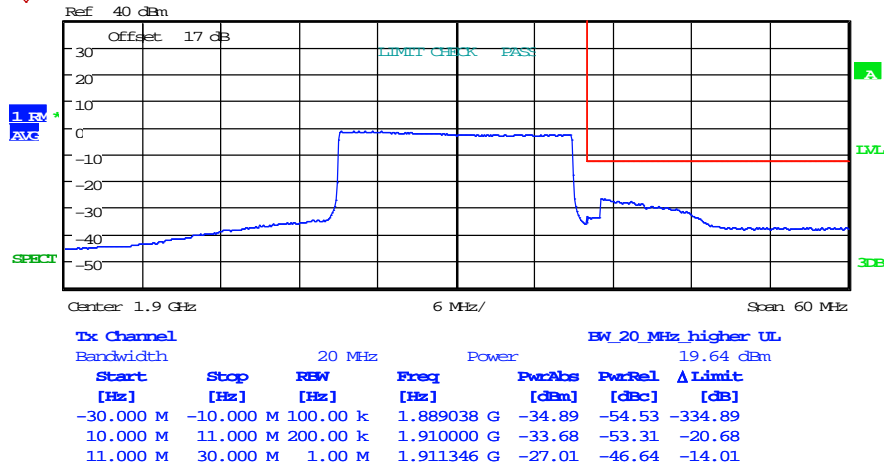

Date: 3.AUG.2020 11:08:32

1RB  
1.4MHz

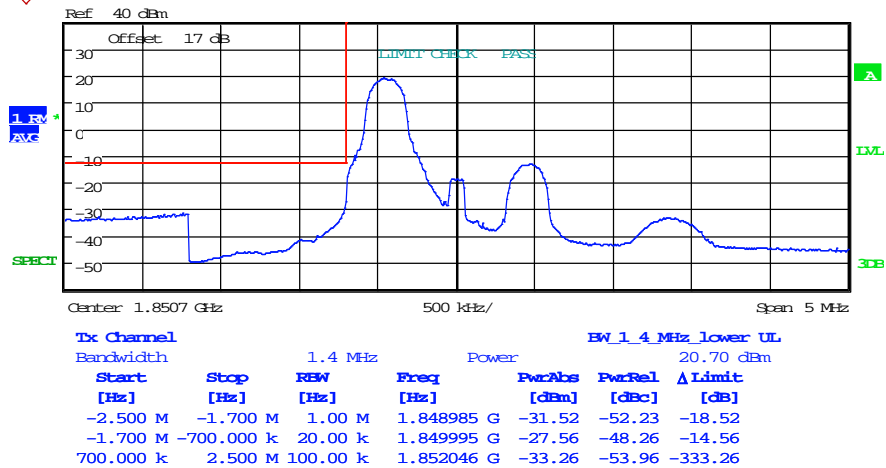


Date: 3.AUG.2020 13:58:53






Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

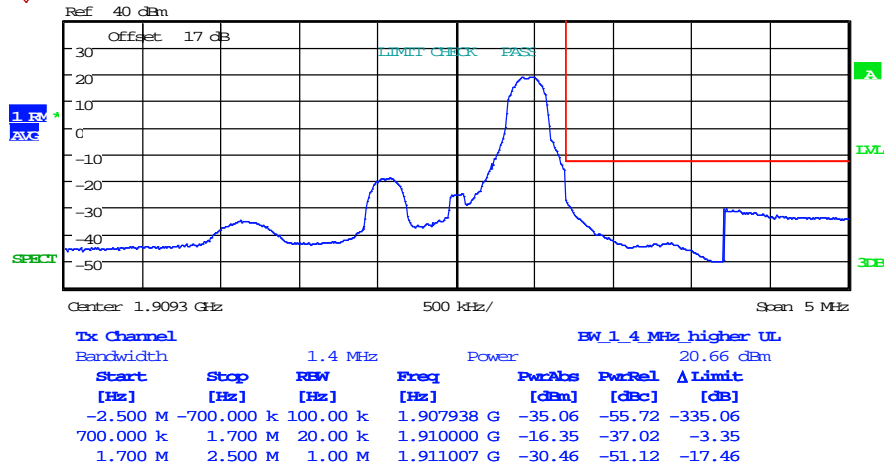

Date: 3.AUG.2020 14:02:32


3MHz

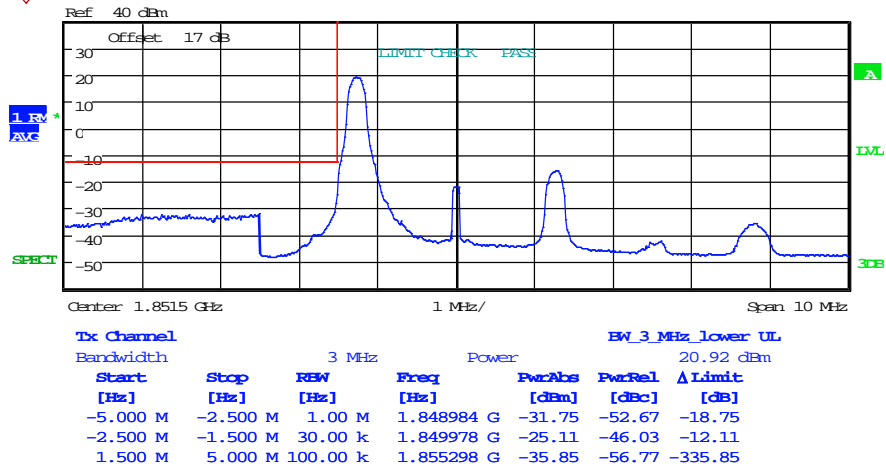

Date: 3.AUG.2020 13:47:28




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

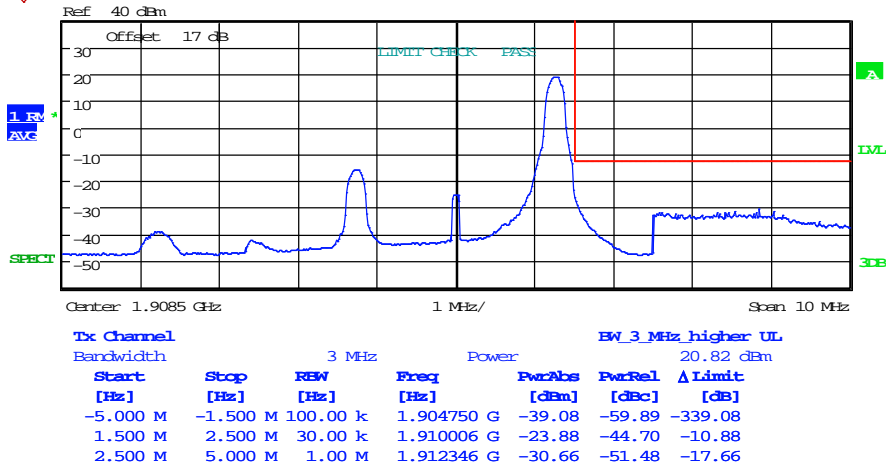

Date: 3.AUG.2020 13:49:24


5MHz

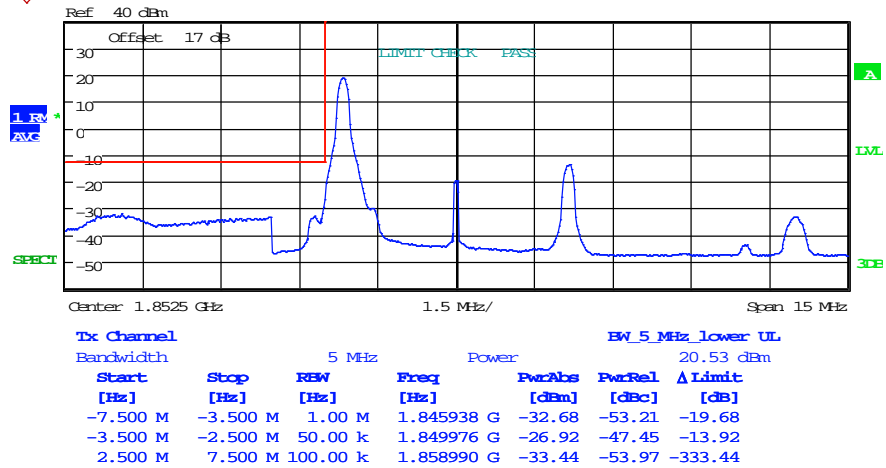

Date: 3.AUG.2020 13:41:36




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

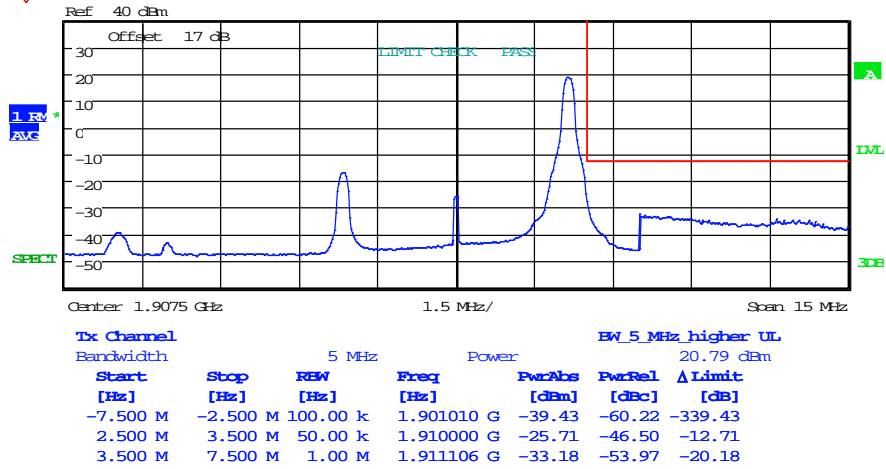


Date: 3.AUG.2020 13:43:46


10MHz

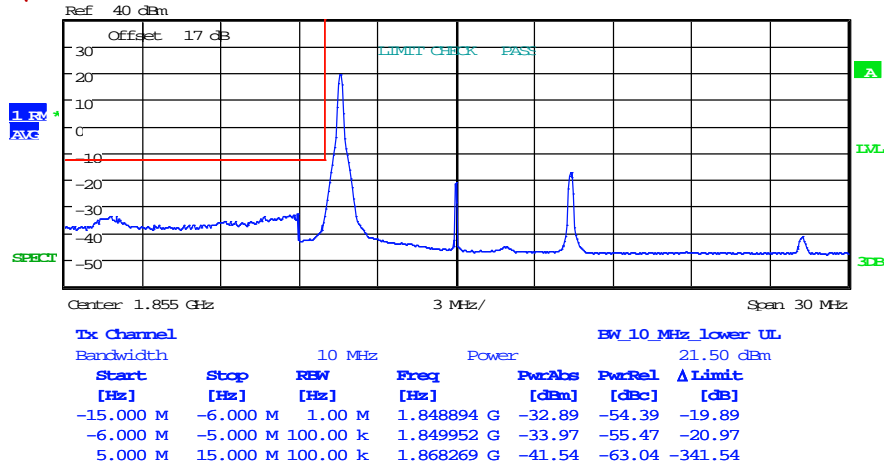

Date: 3.AUG.2020 13:02:48

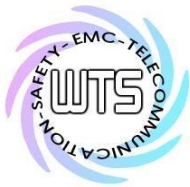


Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

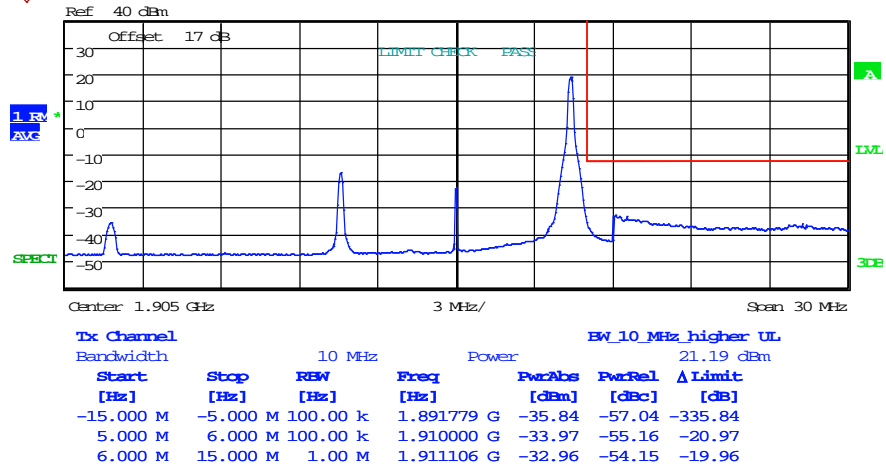

Date: 3.AUG.2020 13:05:52


15MHz

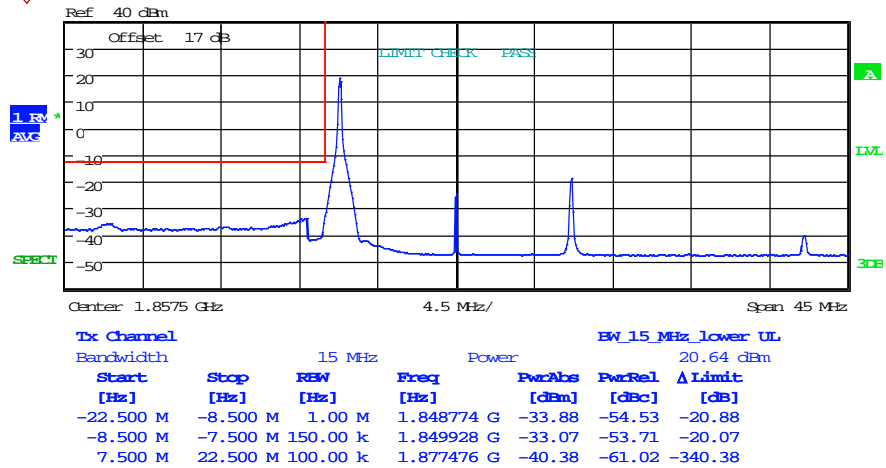

Date: 3.AUG.2020 11:56:50




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

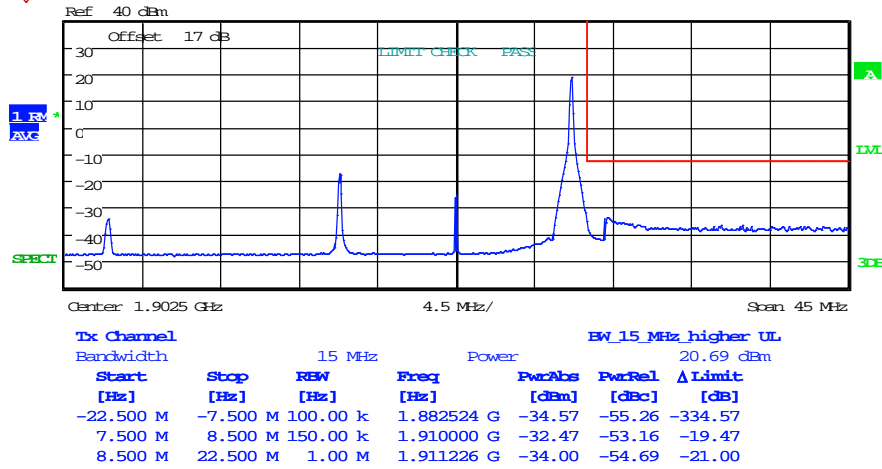

Date: 3.AUG.2020 11:58:55


20MHz

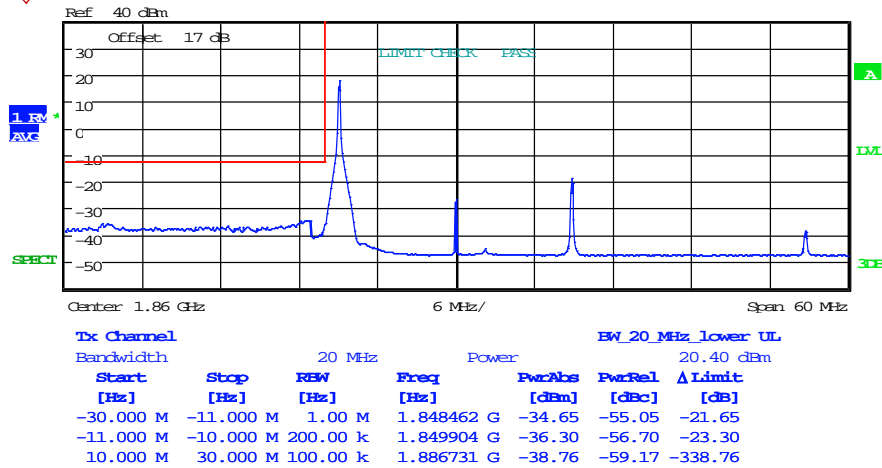

Date: 3.AUG.2020 11:06:58




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

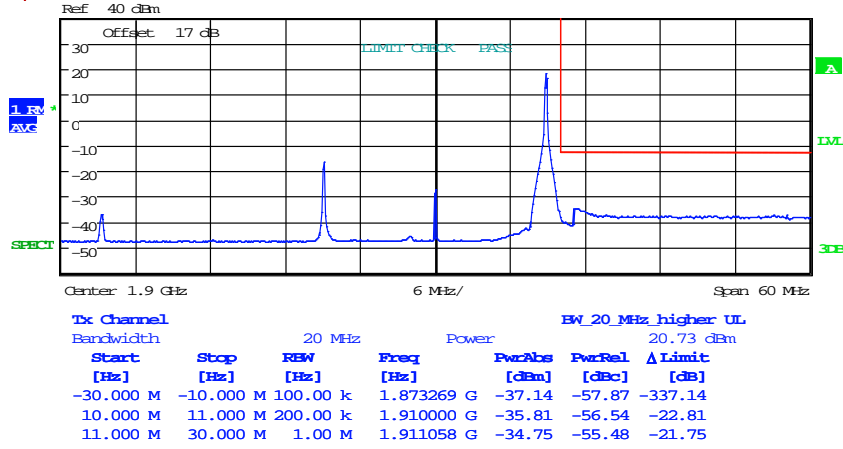


Date: 3.AUG.2020 11:07:49


Band IV  
 16QAM  
 1RB  
 1.4MHz

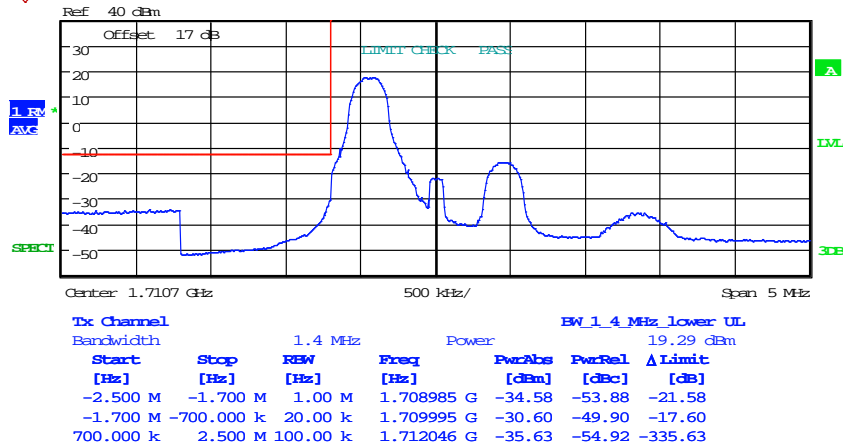

Date: 3.AUG.2020 14:05:31

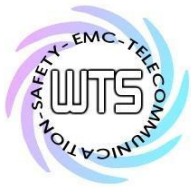


Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

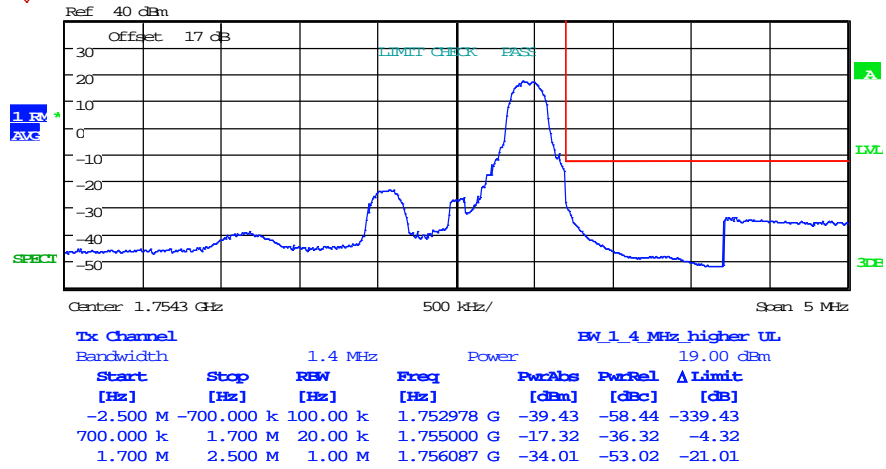

Date: 3.AUG.2020 14:04:31

3MHz

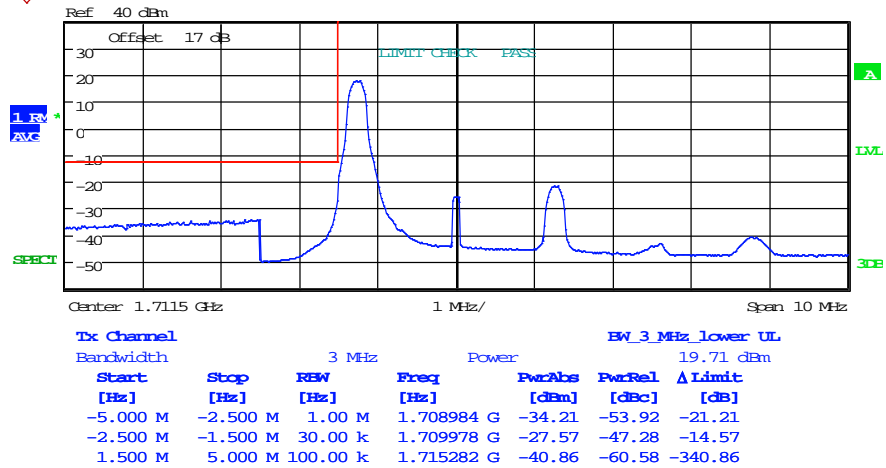


Date: 3.AUG.2020 13:51:32




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

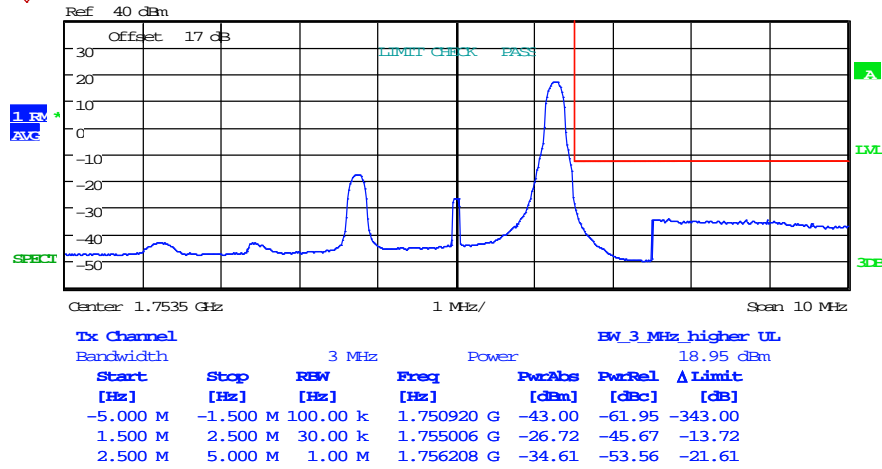

Date: 3.AUG.2020 13:50:56

5MHz

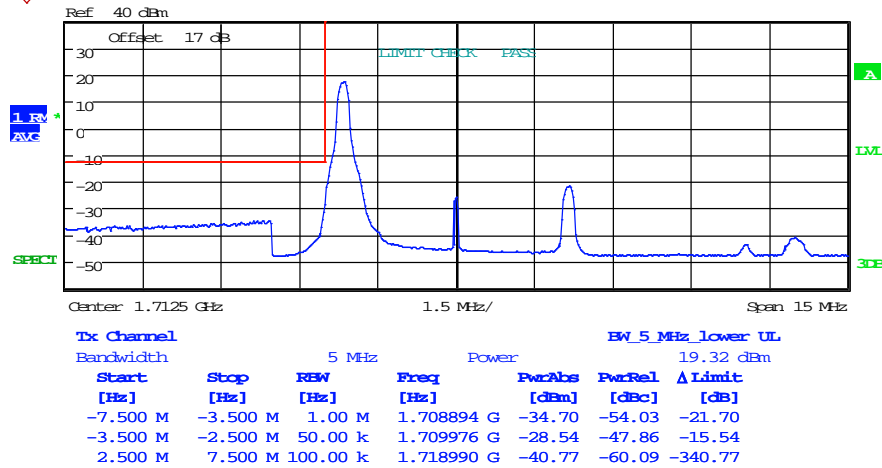


Date: 3.AUG.2020 13:40:09






Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

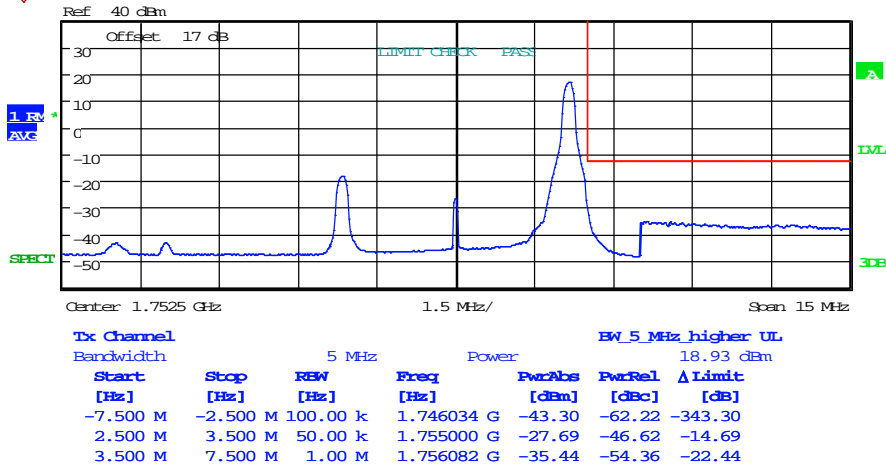

Date: 3.AUG.2020 13:39:08

10MHz

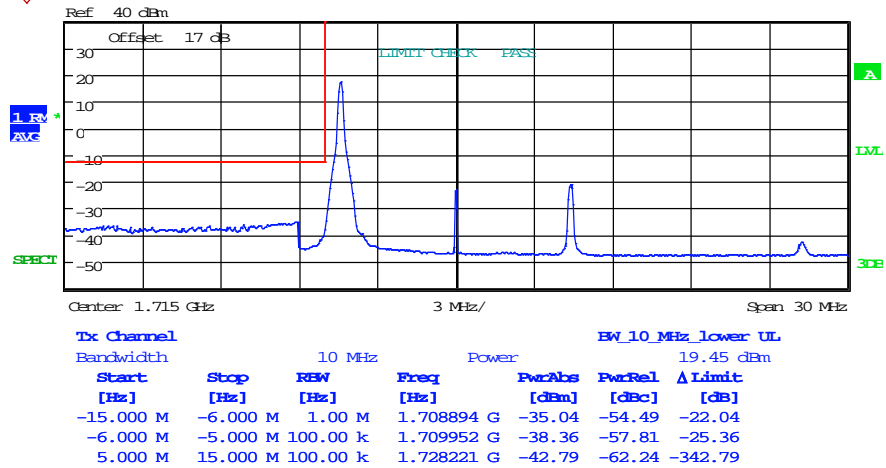


Date: 3.AUG.2020 13:08:03




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

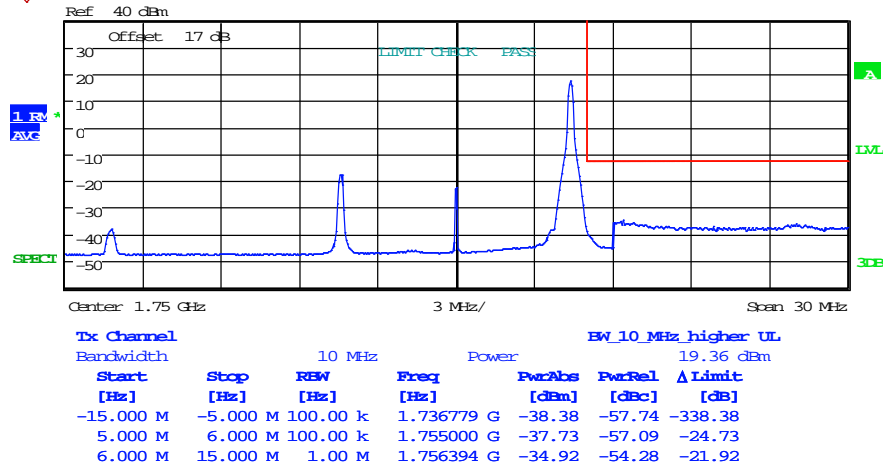

Date: 3.AUG.2020 13:07:18


15MHz

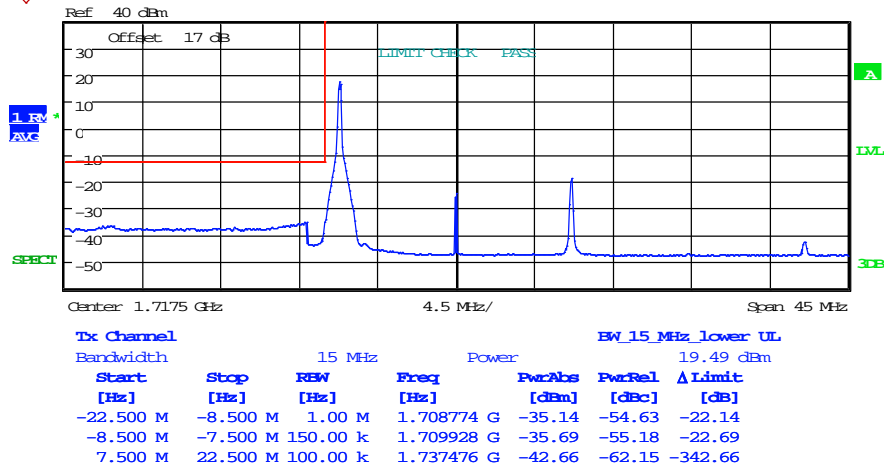

Date: 3.AUG.2020 11:50:12




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

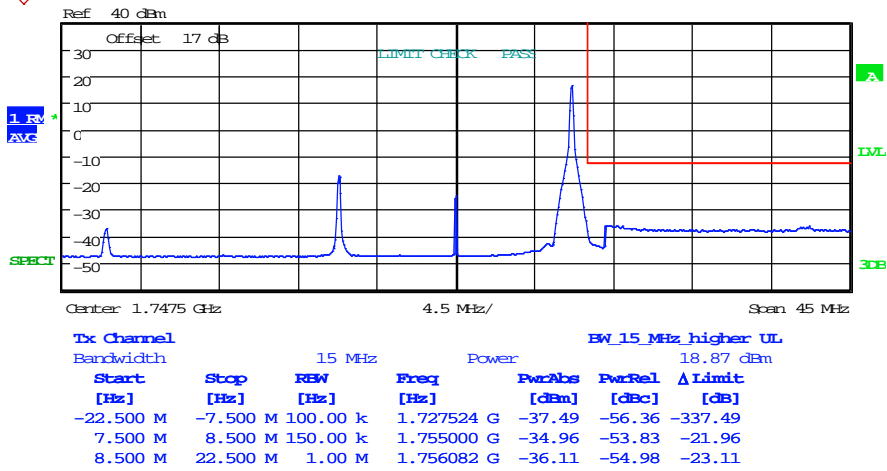


Date: 3.AUG.2020 11:49:31

20MHz

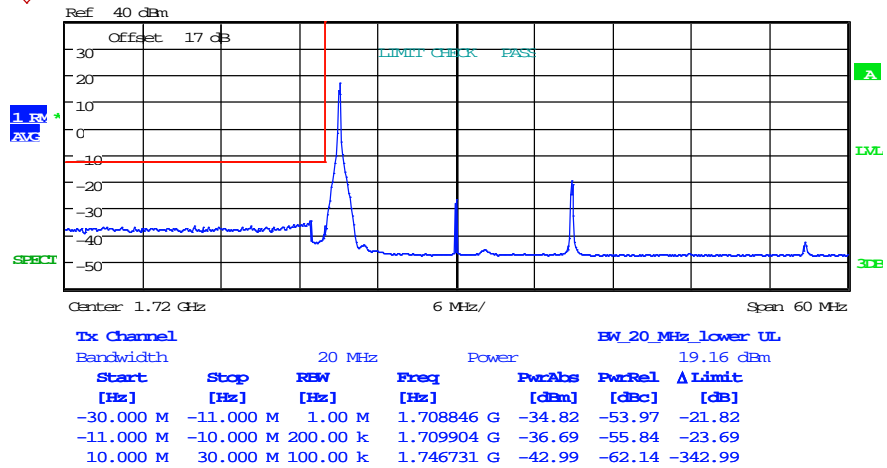


Date: 3.AUG.2020 11:11:29

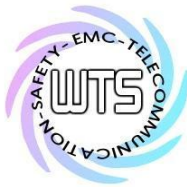


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

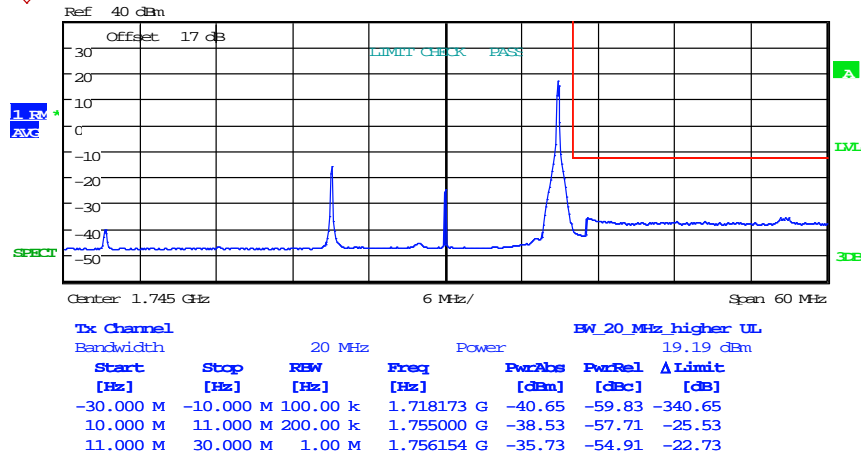

Date: 3.AUG.2020 11:10:37


QPSK  
FRB  
1.4MHz

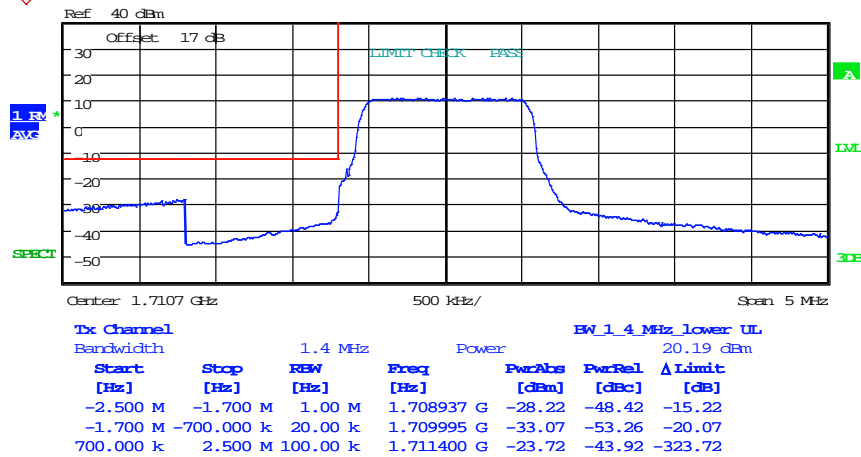

Date: 3.AUG.2020 14:05:57




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

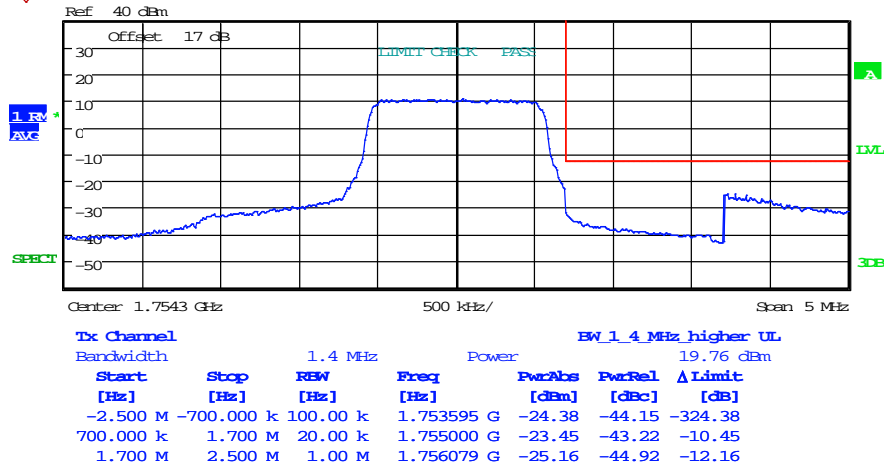

Date: 3.AUG.2020 14:03:35

3MHz

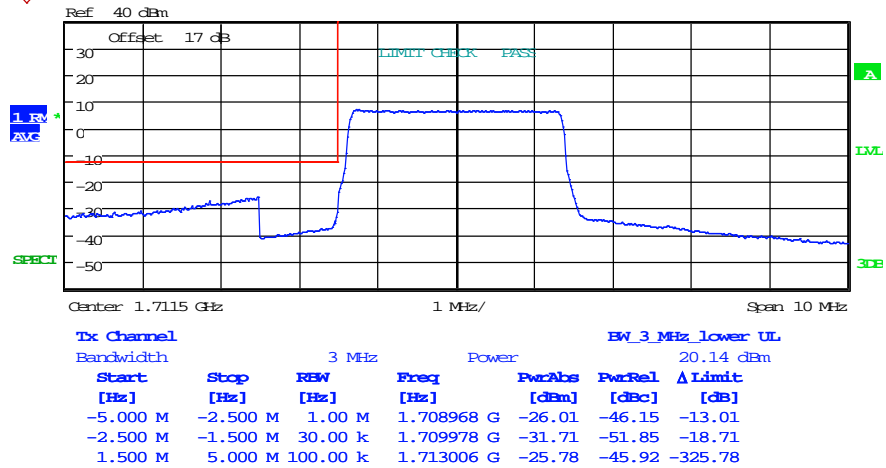


Date: 3.AUG.2020 13:52:12




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

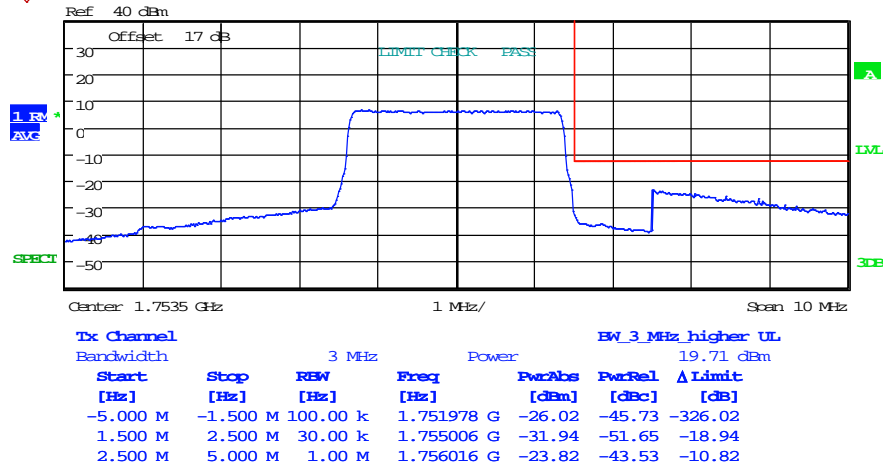

Date: 3.AUG.2020 13:50:27


5MHz

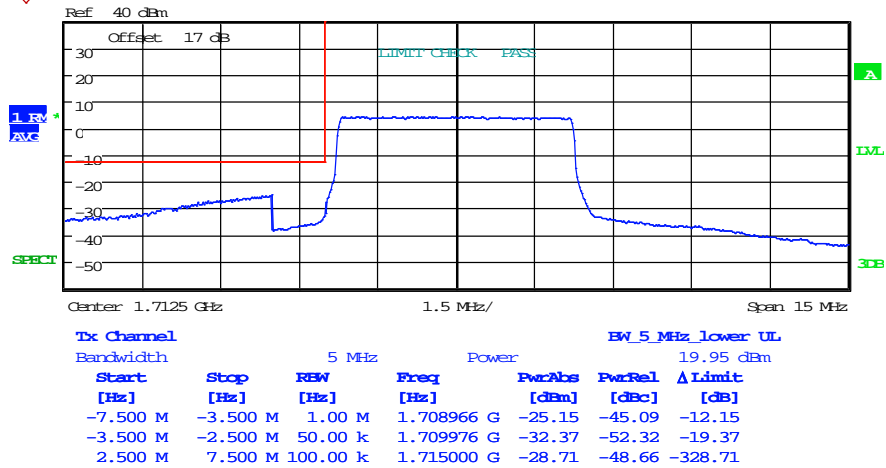

Date: 3.AUG.2020 13:40:33




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

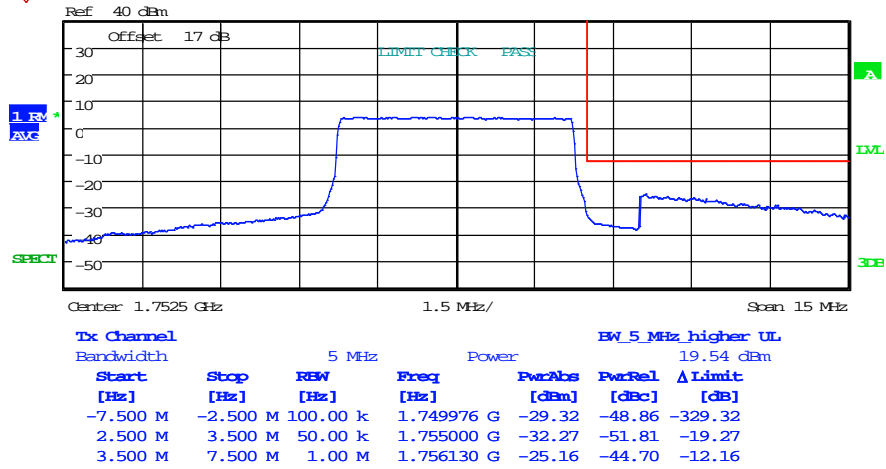

Date: 3.AUG.2020 13:38:42


10MHz

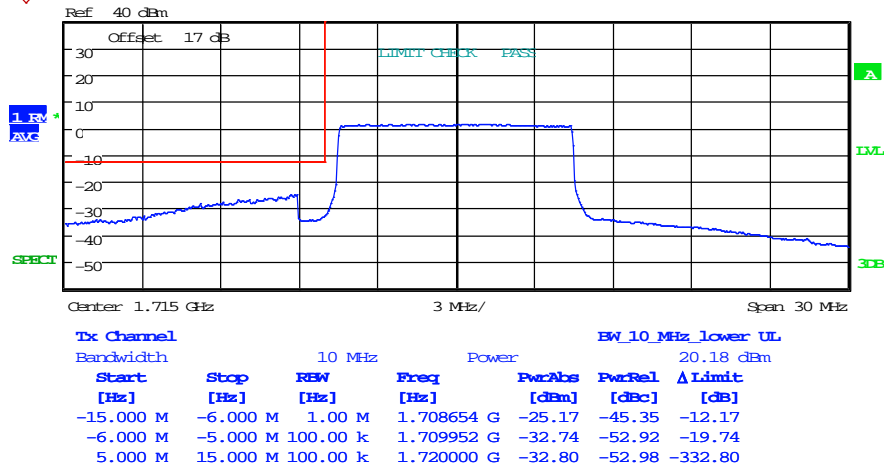

Date: 3.AUG.2020 13:08:27




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

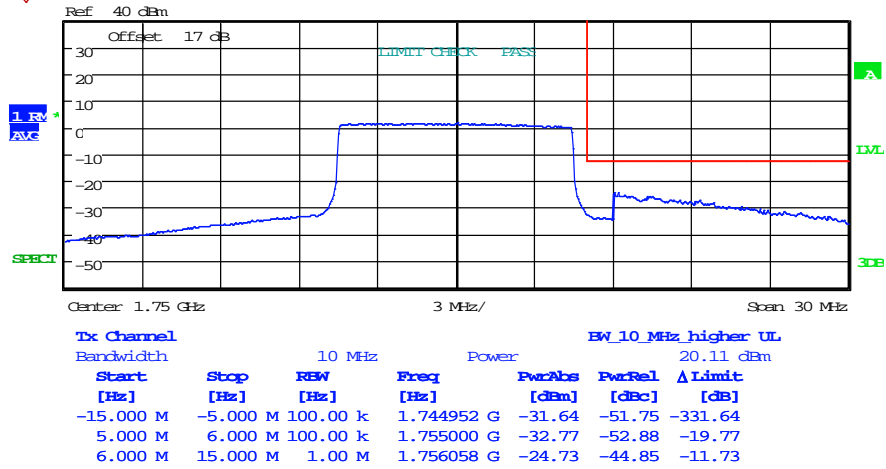

Date: 3.AUG.2020 13:06:51

15MHz

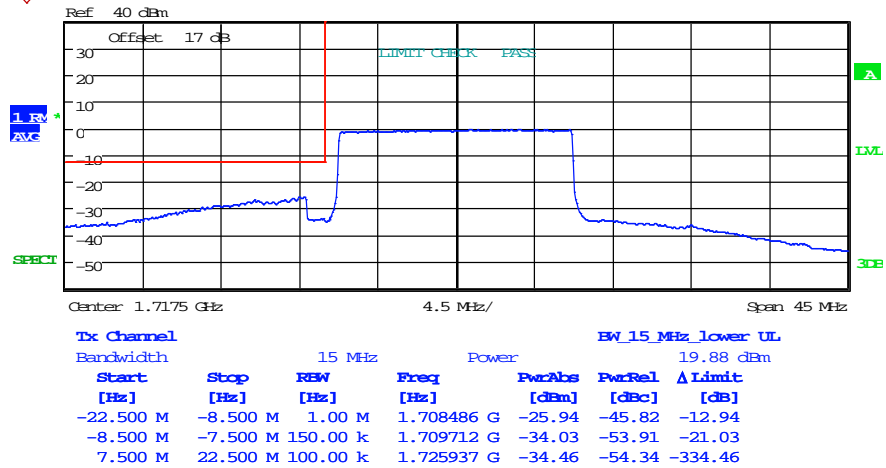


Date: 3.AUG.2020 11:50:50






Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

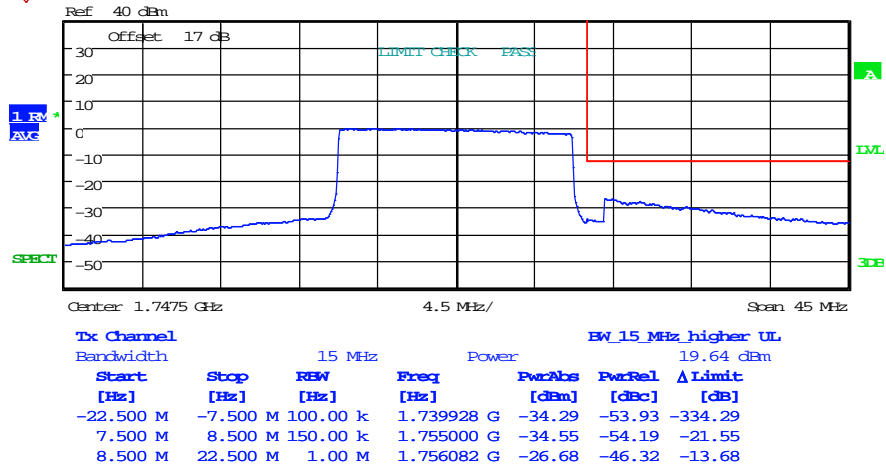

Date: 3.AUG.2020 11:48:54


20MHz

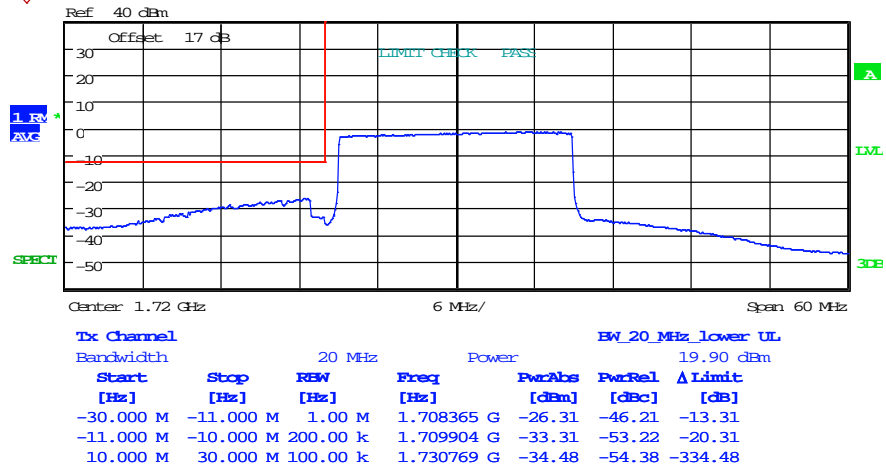

Date: 3.AUG.2020 11:12:00




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

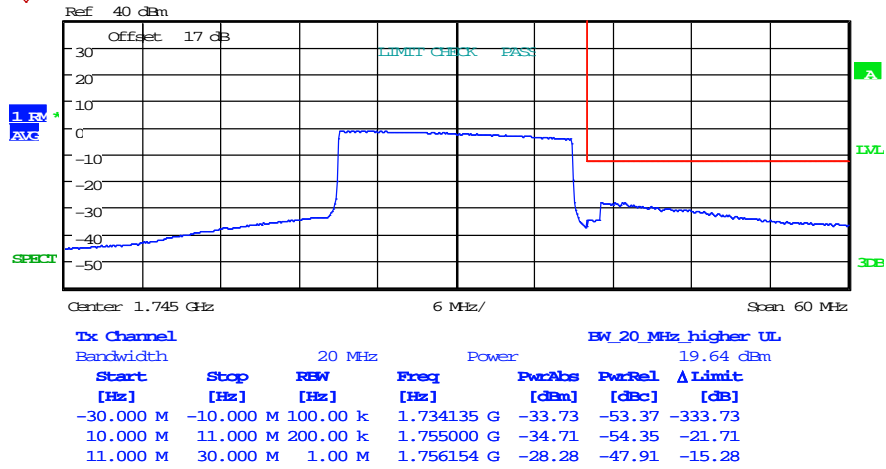

Date: 3.AUG.2020 11:09:30


1RB  
 1.4MHz

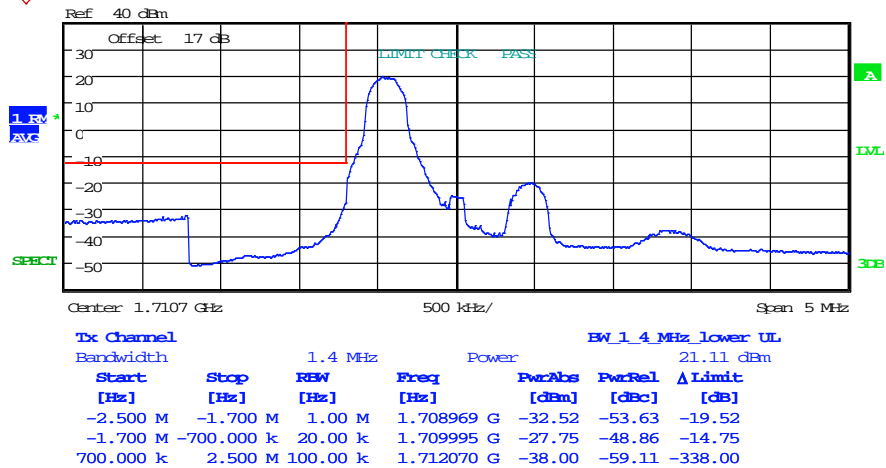

Date: 3.AUG.2020 14:06:17




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

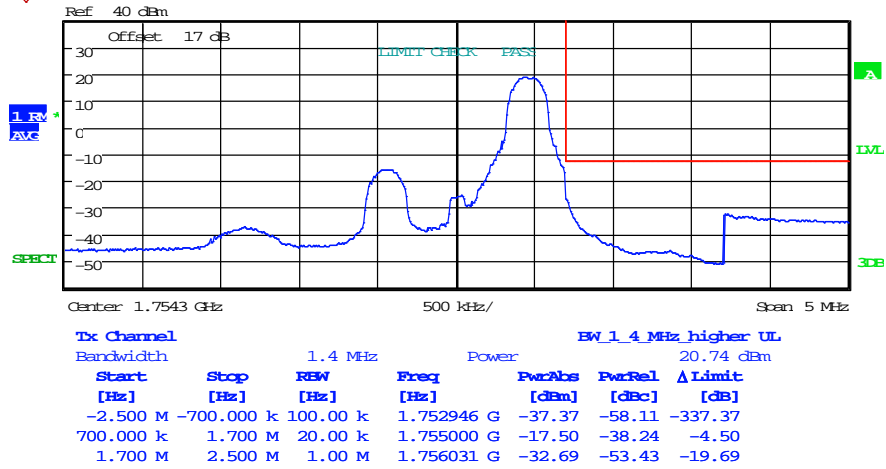


Date: 3.AUG.2020 14:03:15


3MHz

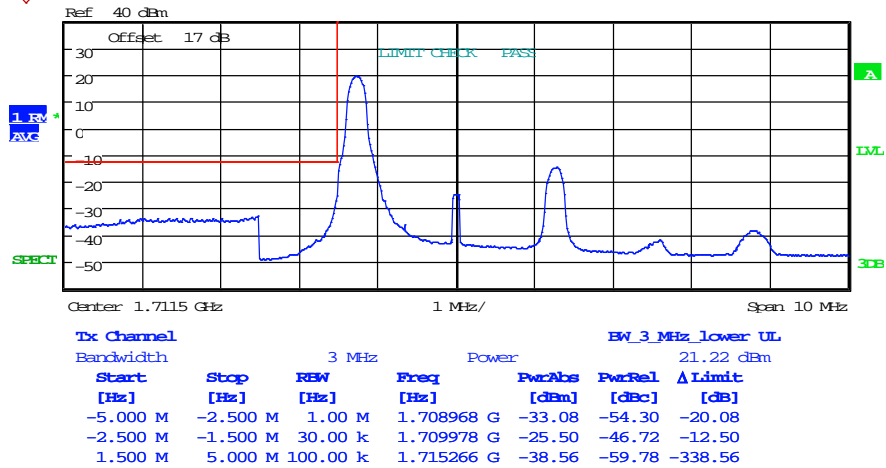

Date: 3.AUG.2020 13:51:55

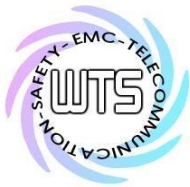


Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

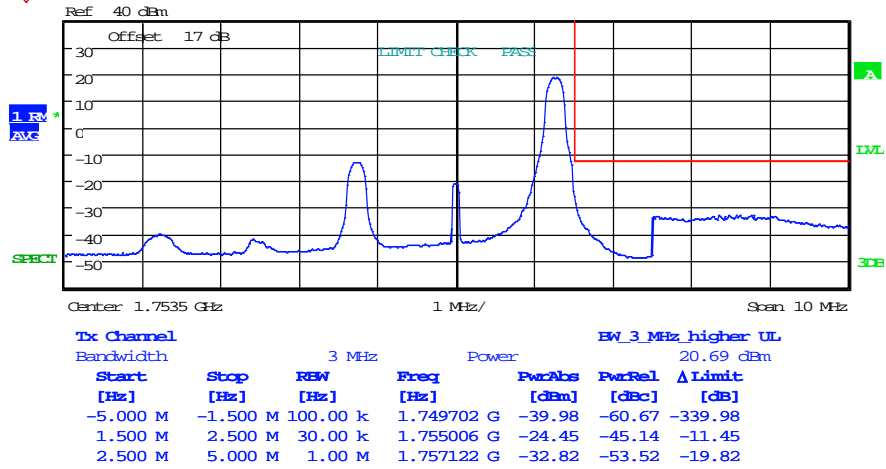

Date: 3.AUG.2020 13:50:12


5MHz

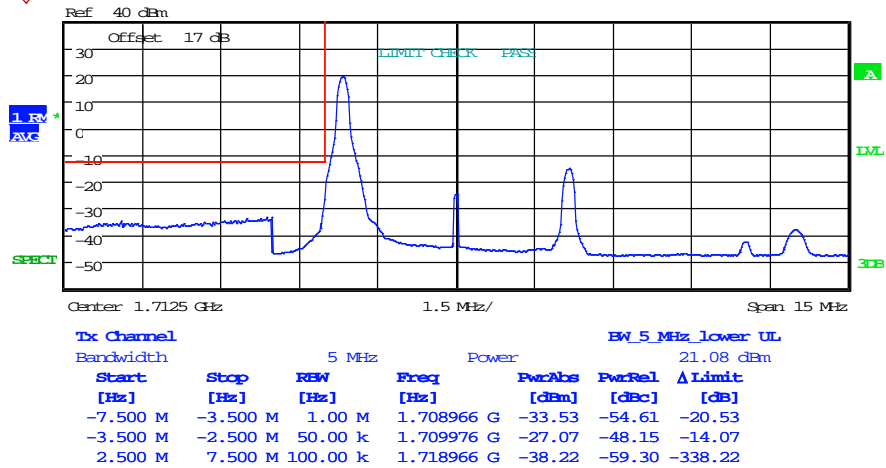

Date: 3.AUG.2020 13:40:49




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

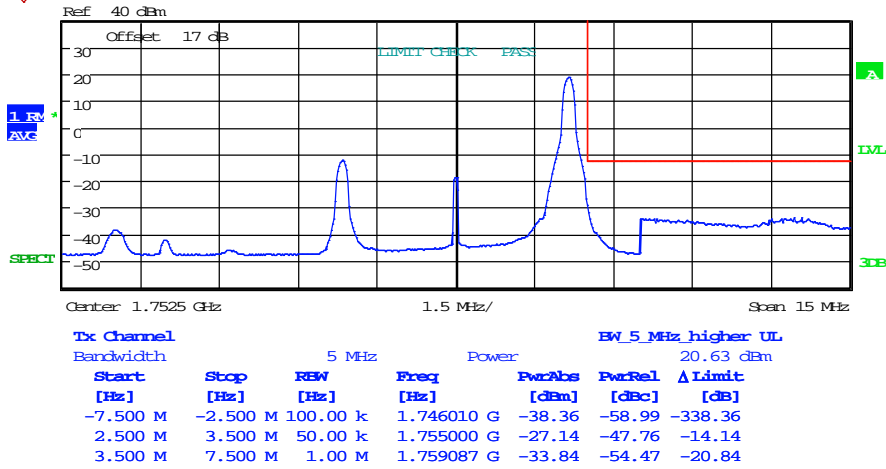

Date: 3.AUG.2020 13:38:26


10MHz

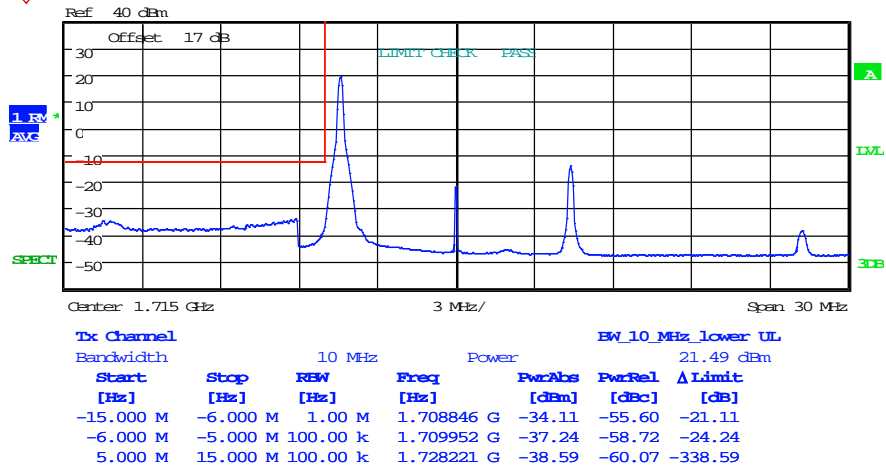

Date: 3.AUG.2020 13:08:48




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

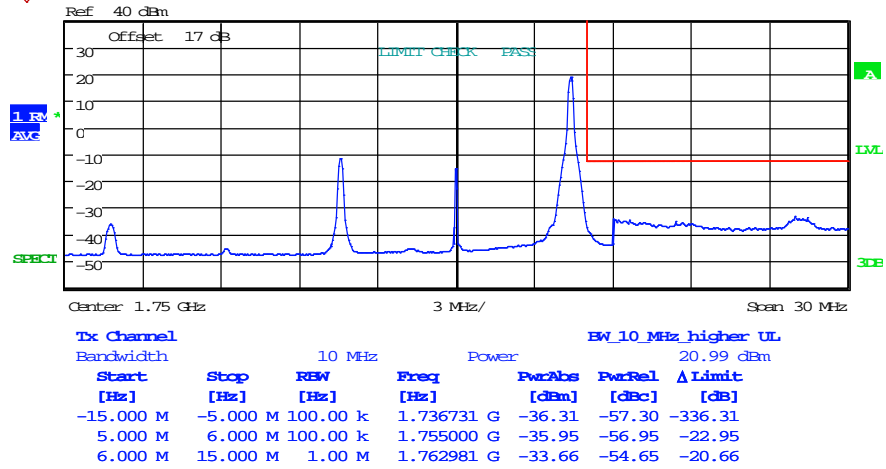

Date: 3.AUG.2020 13:06:34

15MHz

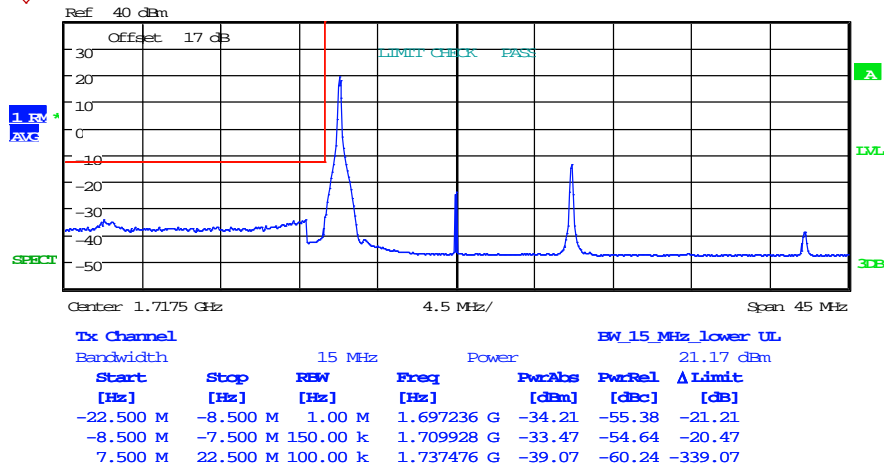


Date: 3.AUG.2020 11:51:06




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

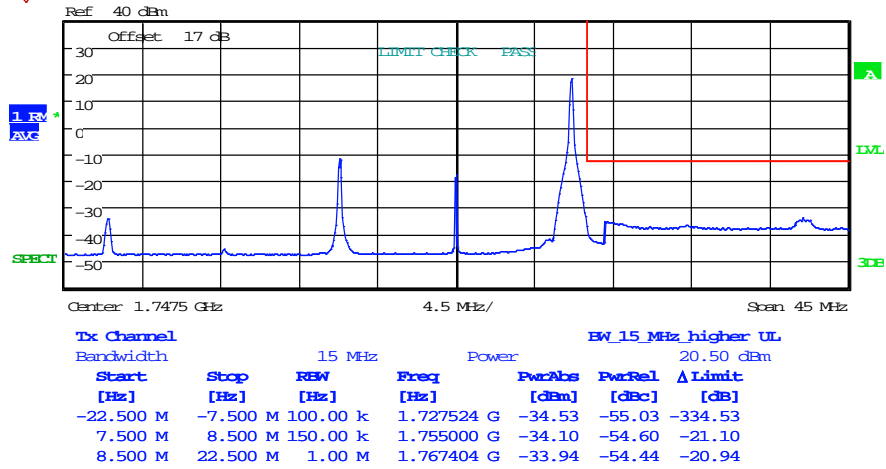

Date: 3.AUG.2020 11:48:29


20MHz

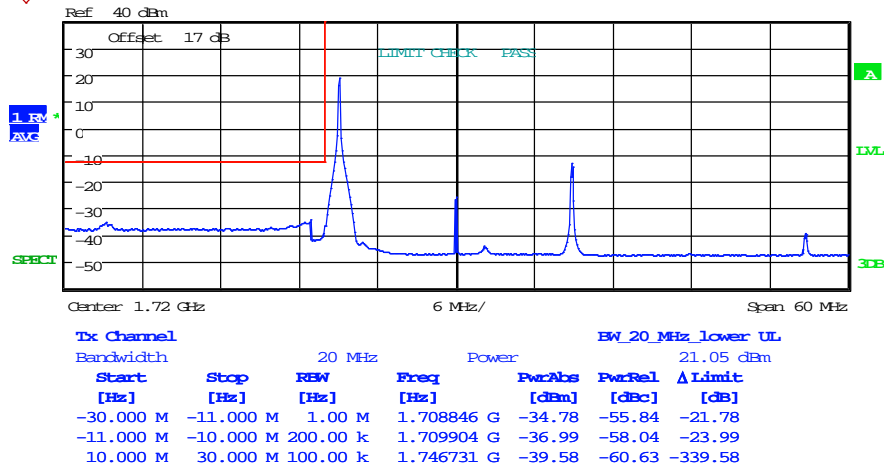

Date: 3.AUG.2020 11:12:24




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

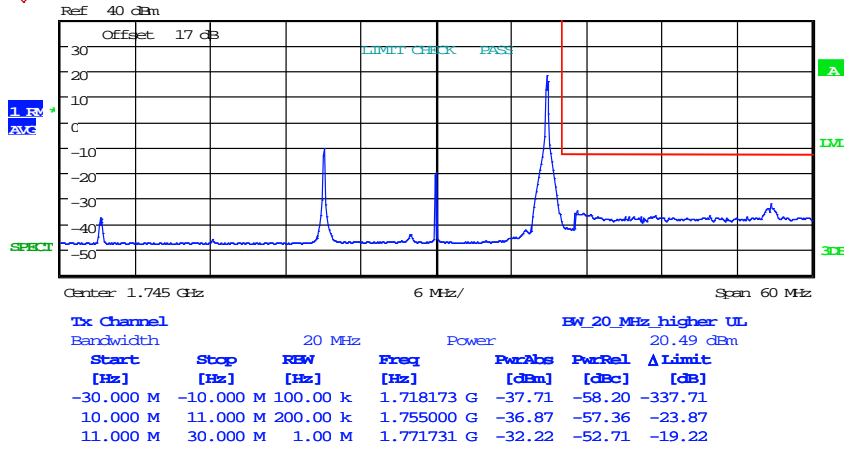

Date: 3.AUG.2020 11:10:01

Band VII  
 16QAM  
 1RB  
 5MHz

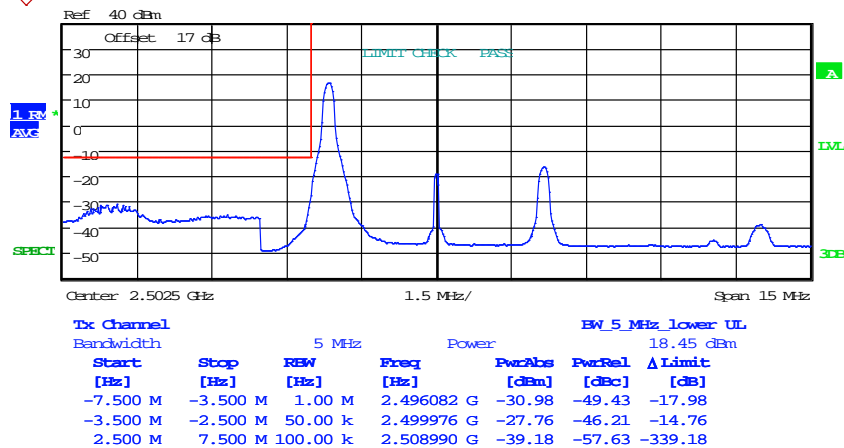


Date: 3.AUG.2020 13:22:09






Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

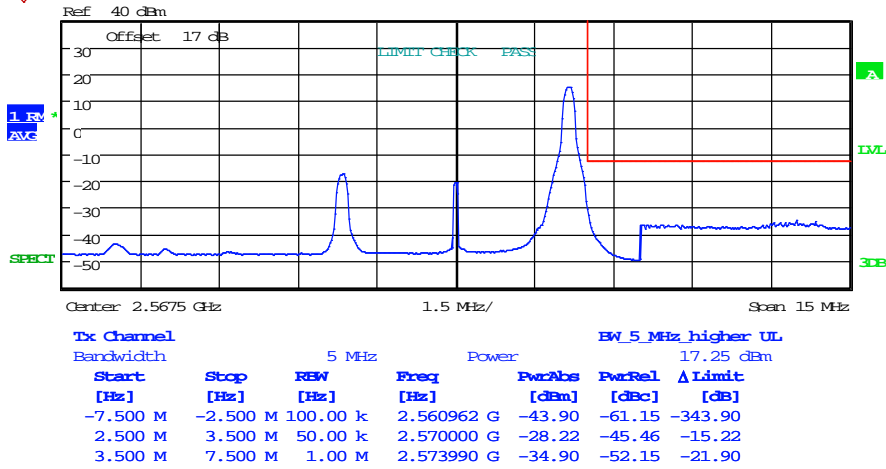

Date: 3.AUG.2020 13:23:28

10MHz

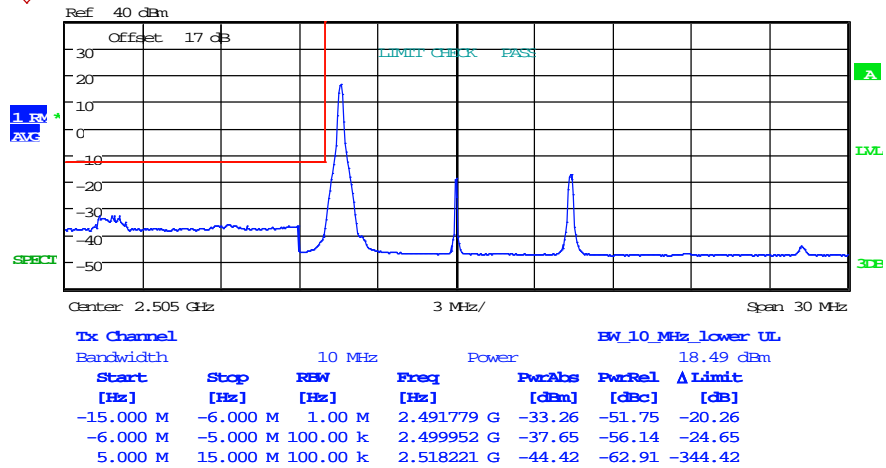


Date: 3.AUG.2020 13:10:32




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

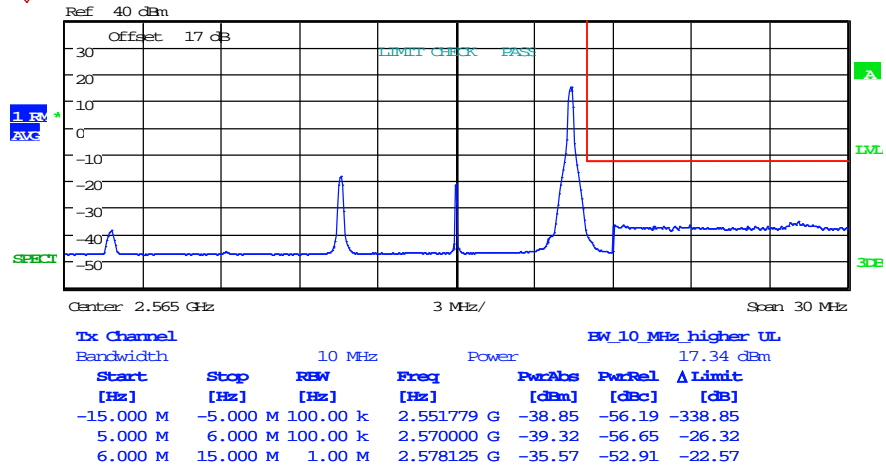

Date: 3.AUG.2020 13:11:26

15MHz

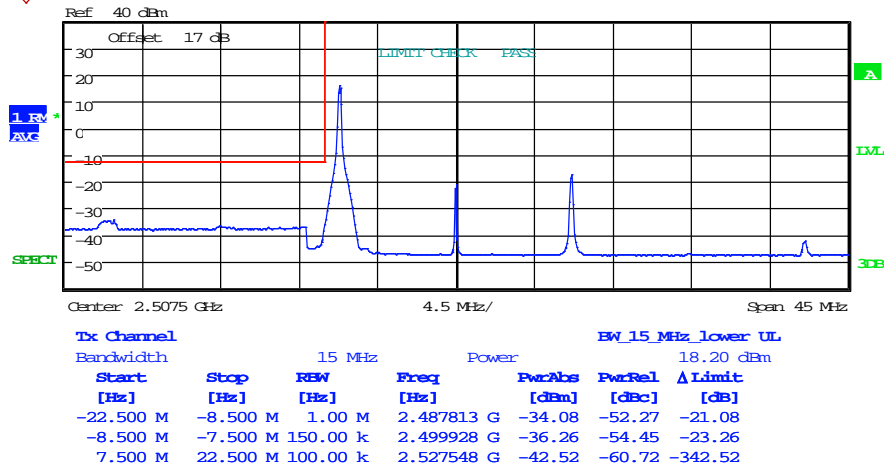


Date: 3.AUG.2020 11:43:38




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

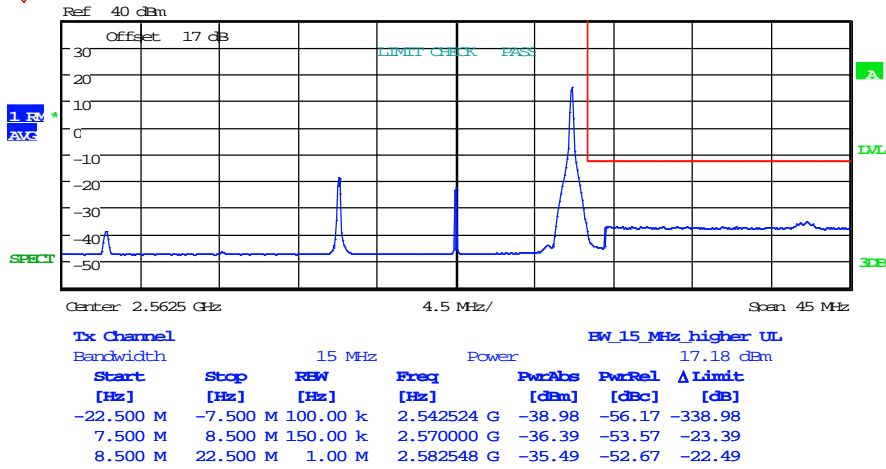


Date: 3.AUG.2020 11:44:47

20MHz

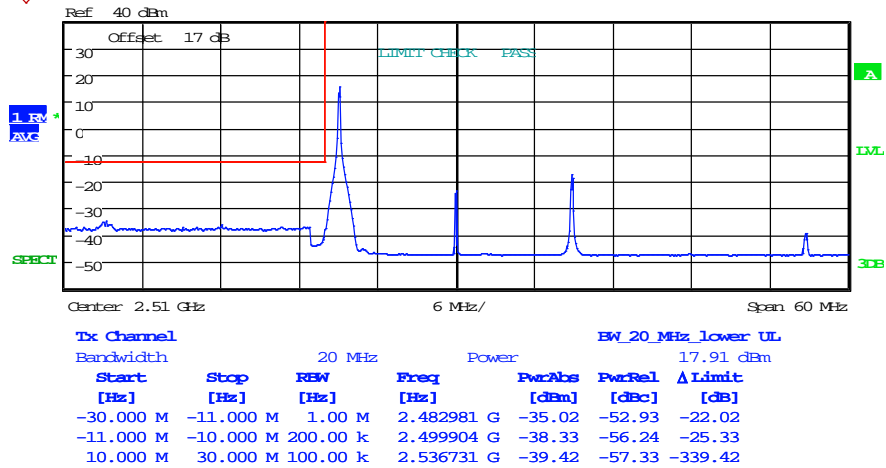


Date: 3.AUG.2020 11:18:54

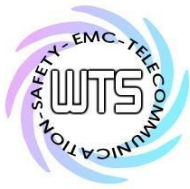


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

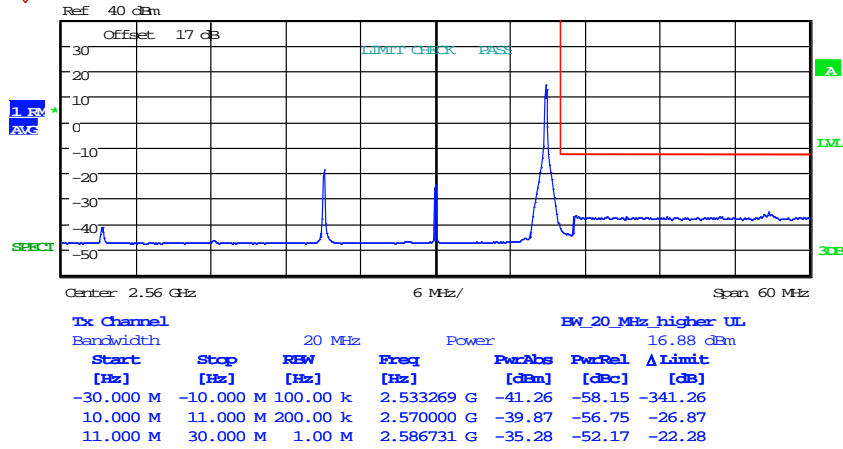

Date: 3.AUG.2020 11:19:46

QPSK  
FRB  
5MHz

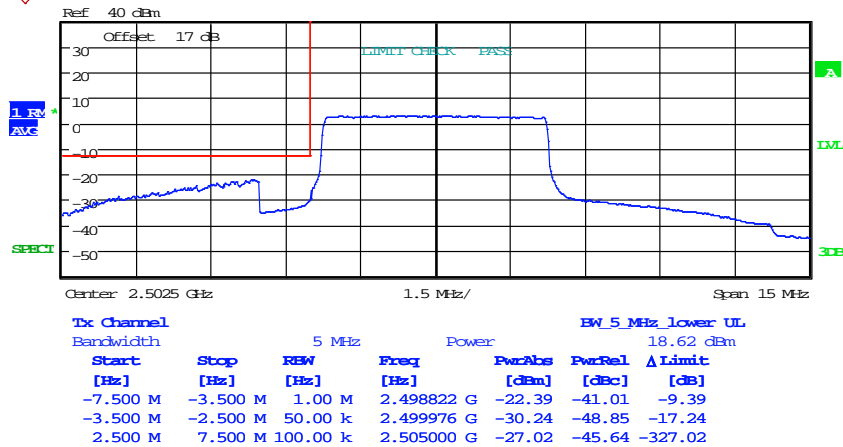


Date: 3.AUG.2020 13:21:45




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

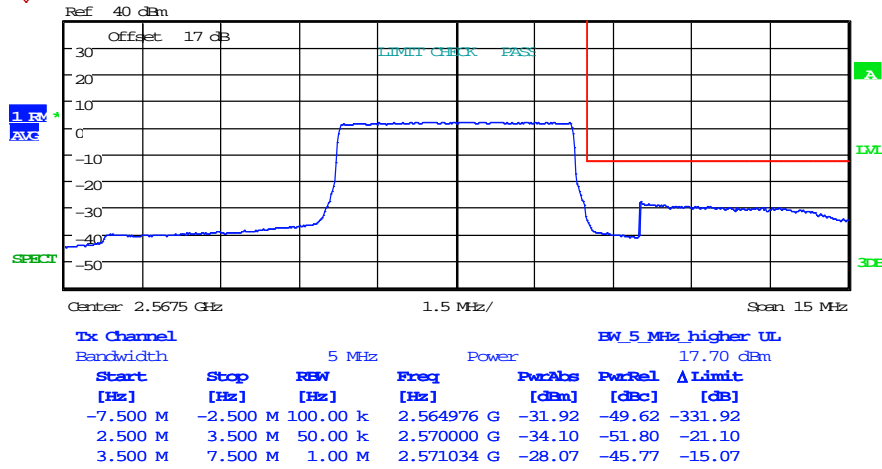

Date: 3.AUG.2020 13:24:31

10MHz

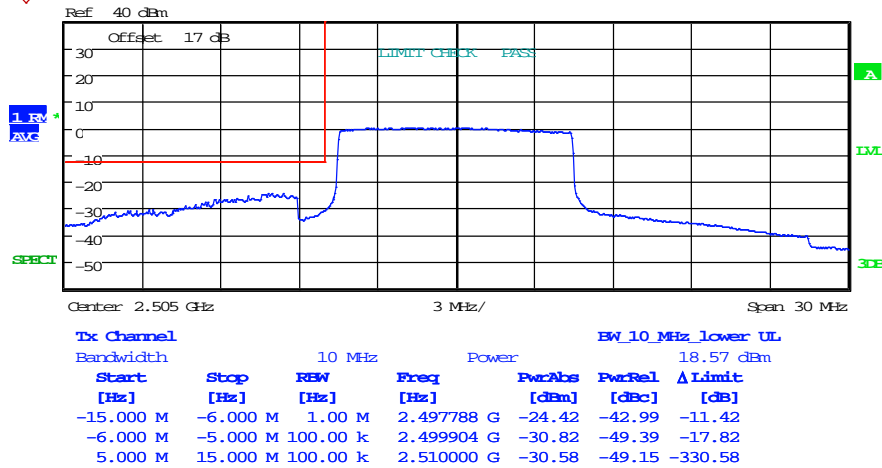


Date: 3.AUG.2020 13:10:11




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

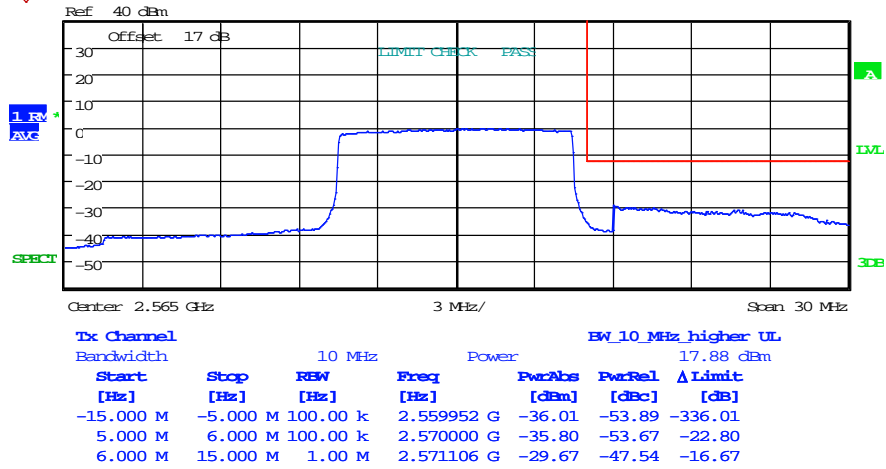

Date: 3.AUG.2020 13:11:50


15MHz

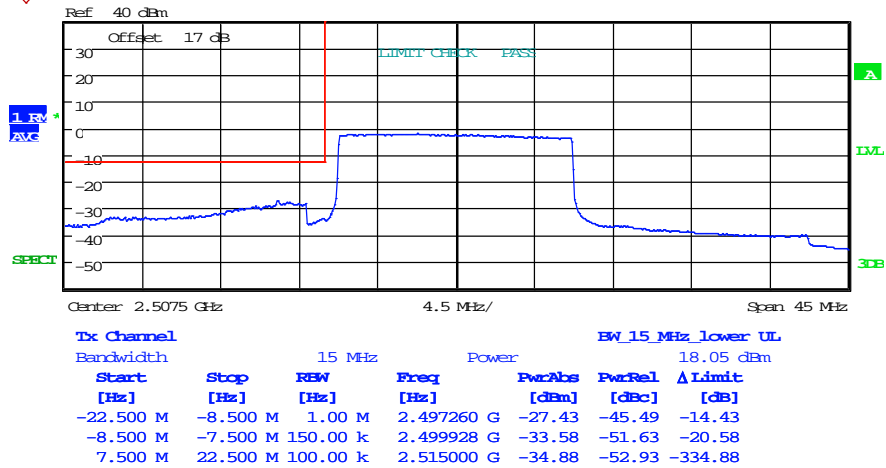

Date: 3.AUG.2020 11:43:06




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

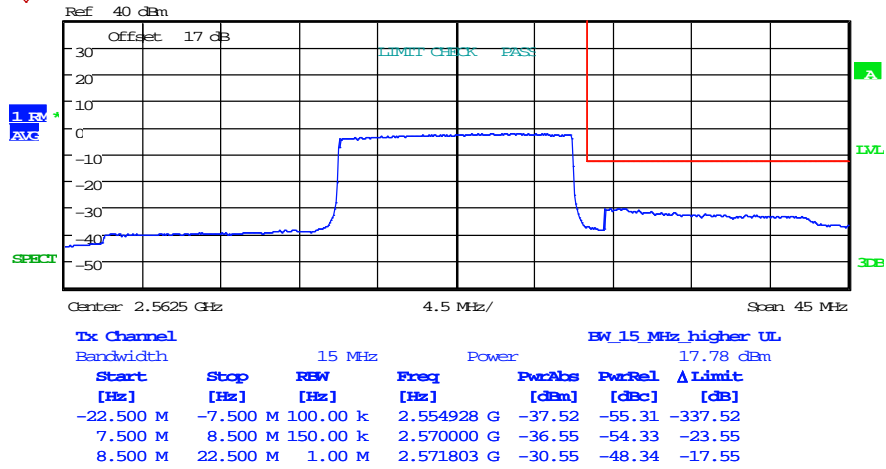

Date: 3.AUG.2020 11:45:09


20MHz

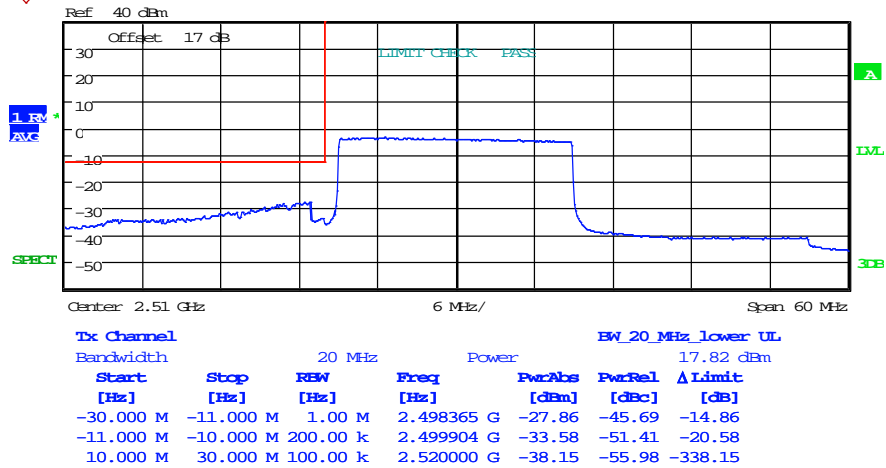

Date: 3.AUG.2020 11:18:26




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

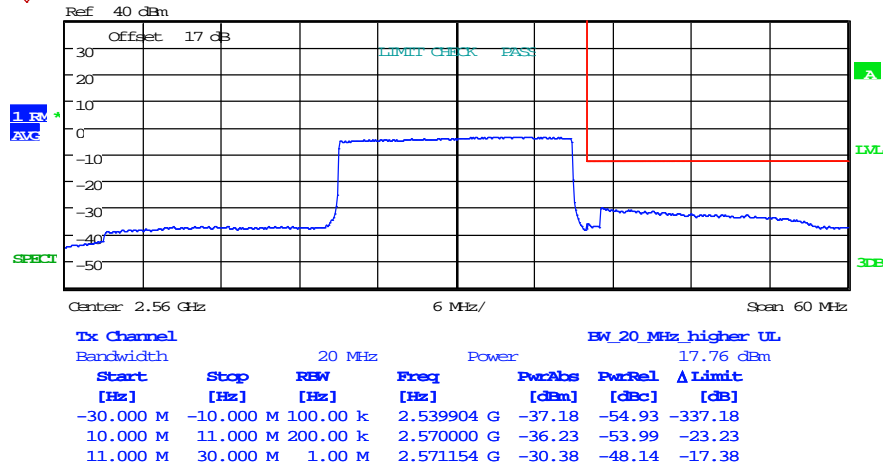

Date: 3.AUG.2020 11:20:22

1RB  
5MHz

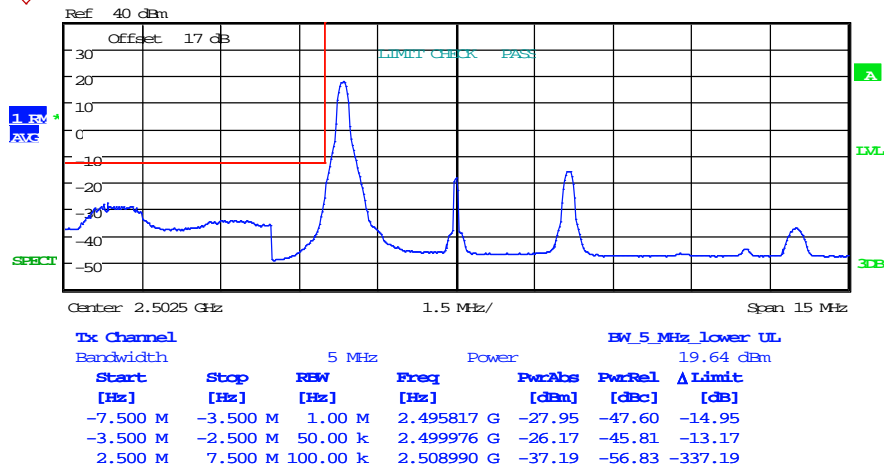


Date: 3.AUG.2020 13:21:29






Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

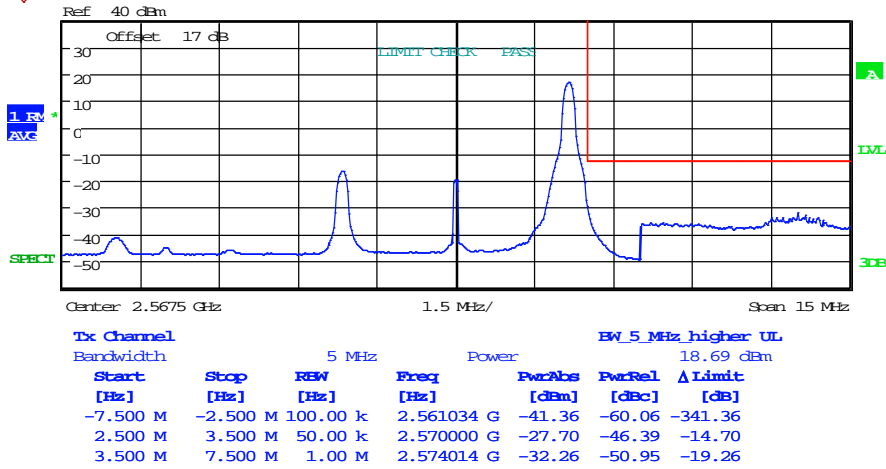

Date: 3.AUG.2020 13:24:56

10MHz

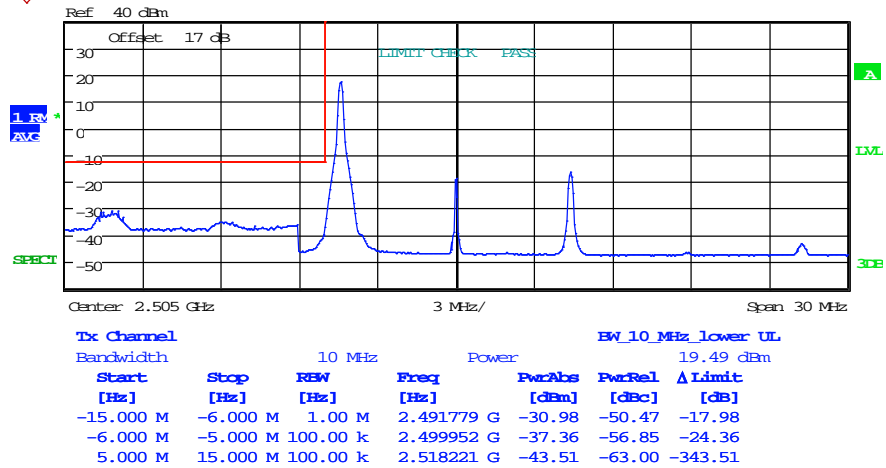


Date: 3.AUG.2020 13:09:55




Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

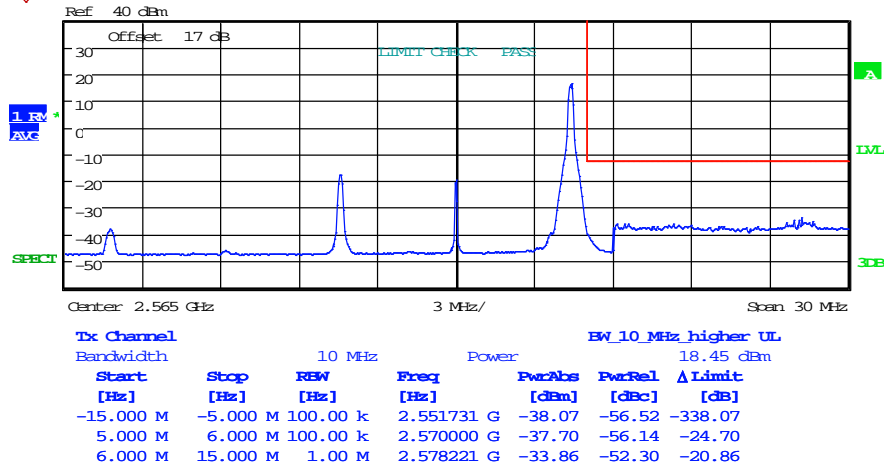

Date: 3.AUG.2020 13:12:10


15MHz

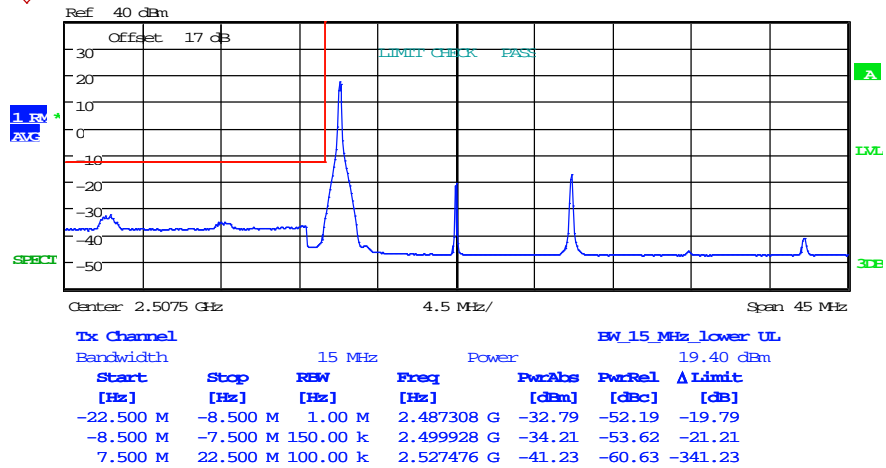

Date: 3.AUG.2020 11:39:32




Report Number: W6M22007-20039-P-247  
 FCC ID: GX9HSGWF1919

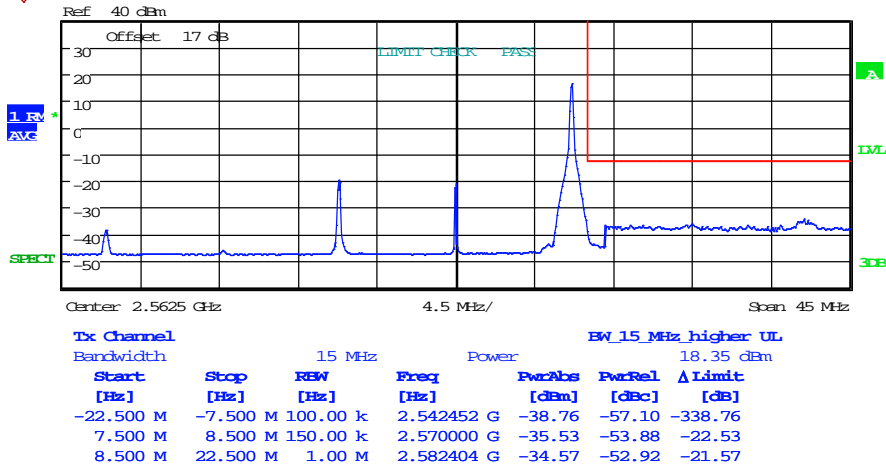


Date: 3.AUG.2020 11:45:28

20MHz

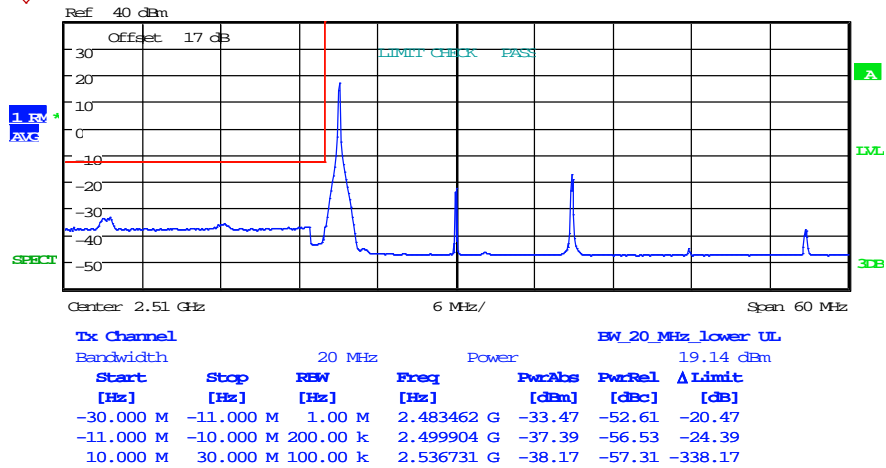


Date: 3.AUG.2020 11:18:04

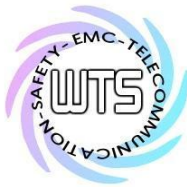


Report Number: W6M22007-20039-P-247

FCC ID: GX9HSGWF1919

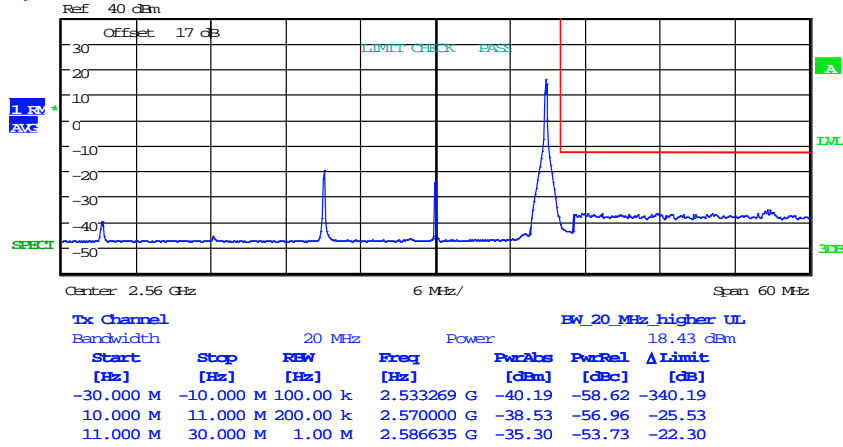

Date: 3.AUG.2020 11:20:42

Band XXVIII  
16QAM  
1RB  
3MHz

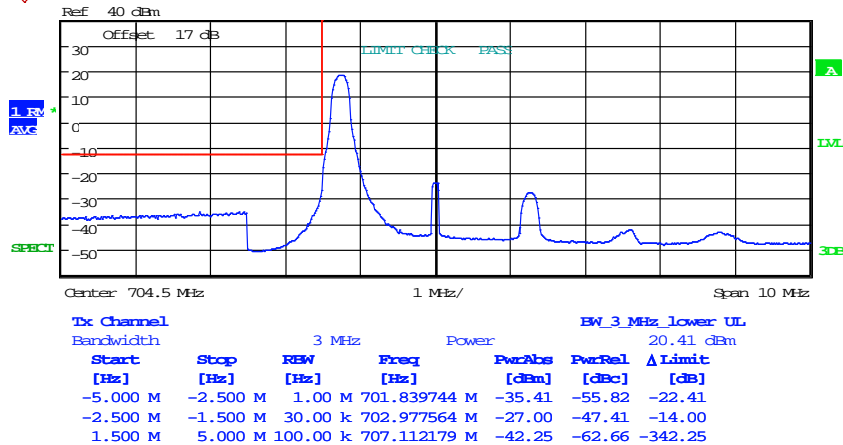

Date: 3.AUG.2020 13:53:37