


Test Setup for Conducted Measurements




Test Setup for Radiated Measurements

Page No: 89 of 96

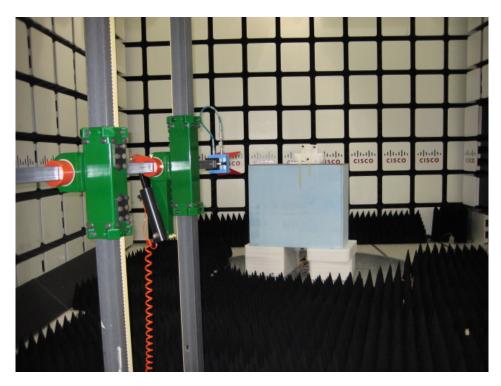

Conducted Emissions

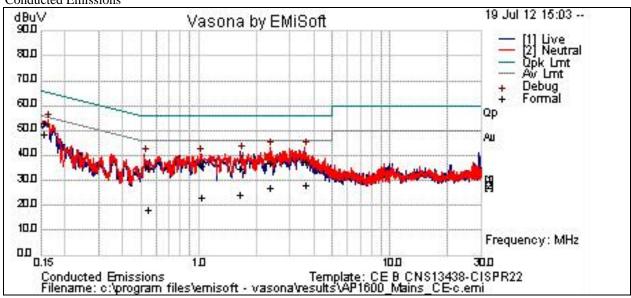


Frequency	Raw	Cable	Factors	Level	Measurem	Line	Limit	Margin	Pass	Comments
MHz	dBuV	Loss	dB	dBuV	ent Type		dBuV	dB	/Fail	
0.155687	25.7	21.4	1.6	48.7	Av	N	55.7	-7	Pass	
0.155687	29.8	21.4	1.6	52.8	Qp	N	65.7	-12.9	Pass	
0.538798	14	20.1	0.6	34.6	Qp	N	56	-21.4	Pass	
0.538798	-2.7	20.1	0.6	18	Av	N	46	-28	Pass	
1.027	15.3	20	0.5	35.9	Qp	N	56	-20.1	Pass	
1.027	2.4	20	0.5	23	Av	N	46	-23	Pass	
1.645	14.1	20.2	0.5	34.7	Qp	L	56	-21.3	Pass	
1.645	3.7	20.2	0.5	24.3	Av	L	46	-21.7	Pass	
2.359	6.5	20.3	0.5	27.3	Av	N	46	-18.7	Pass	
2.359	16	20.3	0.5	36.7	Qp	N	56	-19.3	Pass	
3.617	7.3	20.4	0.5	28.3	Av	N	46	-17.7	Pass	
3.617	16.8	20.4	0.5	37.7	Qp	N	56	-18.3	Pass	





Conducted Emissions Configuration Photograph



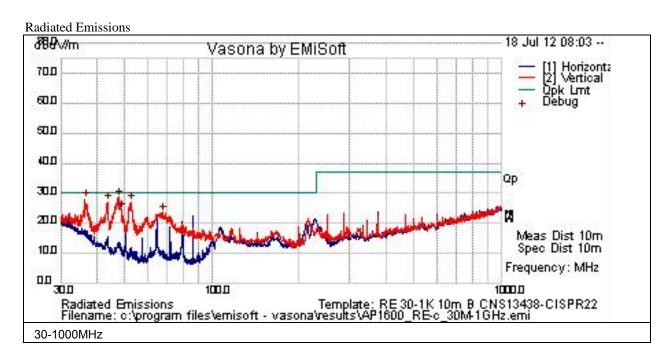

Frequency	Raw	Cable	AF dB	Level	Measurem	Pol	Hgt	Azt	Limit	Margin	Pass	Comments
MHz	dBuV	Loss		dBuV/m	ent Type		cm	Deg	dBuV/m	dB	/Fail	
36.355	34.7	0.6	-10.1	25.2	Qp	V	208	102	30	-4.8	Pass	
43.321	37.9	0.6	-15.1	23.4	Qp	V	350	138	30	-6.6	Pass	
47.511	42.6	0.7	-17.6	25.6	Qp	V	261	78	30	-4.4	Pass	
52.426	40.3	0.7	-19.1	22	Qp	V	221	121	30	-8	Pass	
250.015	34.1	1.5	-14.1	21.5	Qp	V	111	195	37	-15.5	Pass	
375.005	30.6	1.8	-11.1	21.3	Qp	V	101	186	37	-15.7	Pass	
1000	24.8	3	-3.1	24.7	Qp	V	283	60	37	-12.3	Pass	



Radiated Emissions Configuration Photograph