

Report No.: FG130414A



# WINNF-TS-0122 Test Report

FCC ID : PKRISGFW2010

Equipment : 5G High Performance Sub6 & mmWave Outdoor CPE

Brand Name : Inseego

Model Name : FW2010-1, FW2010e-1

Marketing Name: FW2010

Applicant : Inseego Corp.

9710 Scranton Road Suite 200, San Diego, CA 92121

Manufacturer : MeiG Smart Technology Co., Ltd

Floor 2, Office Building No. 5, Lingxia Road, Fenghuang Community, Fuyong Street, Bao 'an District, Shenzhen

Standard : WINNF-TS-0122 Version V1.0.2

The product was received on Mar. 08, 2021 and testing was started from Mar. 11, 2021 and completed on Mar. 15, 2021. We, Sporton International Inc. EMC & Wireless Communications Laboratory, would like to declare that the tested sample has been evaluated in accordance with the test procedures given in WINNF-TS-0122 Version V1.0.2 and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai

Sporton International Inc. EMC & Wireless Communications Laboratory

No.52, Huaya 1st Rd., Guishan Dist., Taoyuan City 333, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page Number : 1 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# **Table of Contents**

Re	vision	History	4
1.	Admi	inistration Data	5
	1.1	Testing Laboratory	5
2.	Gene	eral Information	6
	2.1	Description of Equipment Under Test (EUT)	6
	2.2	Protocol Test Summary	7
	2.3	Time test for getting Grant Summary	8
	2.4	Support Equipment	8
	2.5	Test Equipment List	8
3.	Meas	surement Environment	9
	3.1	Test configuration without Domain Proxy	10
	3.2	Standards	11
	3.3	Protocol test procedure	11
	3.4	Time test for getting Grant Procedure	11
4.	Proto	ocol Test Results	12
	4.1	[WINNF.FT.C.REG.1] Multi-Step registration	12
	4.2	[WINNF.FT.C.REG.5] Single-Step registration for CBSD with CPI signed data	13
	4.3	[WINNF.FT.C.REG.8] Missing Required parameters (responseCode 102)	14
	4.4	[WINNF.FT.C.REG.10] Pending registration (responseCode 200)	15
	4.5	[WINNF.FT.C.REG.12] Invalid parameter (responseCode 103)	16
	4.6	[WINNF.FT.C.REG.14] Blacklisted CBSD (responseCode 101)	17
	4.7	[WINNF.FT.C.REG.16] Unsupported SAS protocol version (responseCode 100)	18
	4.8	[WINNF.FT.C.REG.18] Group Error (responseCode 201)	19
	4.9	[WINNF.FT.C.GRA.1] Unsuccessful Grant responseCode=400 (INTERFERENCE)	20
	4.10	[WINNF.FT.C.GRA.2] Unsuccessful Grant responseCode=401 (GRANT_CONFLICT)	21
	4.11	[WINNF.FT.C.HBT.1] Heartbeat Success Case (first Heartbeat Response)	22
	4.12	[WINNF.FT.C.HBT.3] Heartbeat responseCode=105 (DEREGISTER)	24
	4.13	[WINNF.FT.C.HBT.4] Heartbeat responseCode=500 (TERMINATED_GRANT)	25
	4.14	[WINNF.FT.C.HBT.5] Heartbeat responseCode=501 (SUSPENDED_GRANT) in First Heartbea	t
	Resp	oonse	26
	4.15	[WINNF.FT.C.HBT.6] Heartbeat responseCode=501 (SUSPENDED_GRANT) in Subsequent H	eartbeat
	Resp	oonse	27
	4.16	[WINNF.FT.C.HBT.7] Heartbeat responseCode=502 (UNSYNC_OP_PARAM)	29
	4.17	[WINNF.FT.C.HBT.9] Heartbeat Response Absent (First Heartbeat)	30
		[WINNF.FT.C.HBT.10] Heartbeat Response Absent (Subsequent Heartbeat)	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number : 2 of 45 Issued Date : Mar. 29, 2021

Report No.: FG130414A

Report Version : 01



# WINNF-TS-0122 Test Report

	4.19	[WINNF.FT.C.RLQ.1] Successful Relinquishment	32
	4.20	[WINNF.FT.C.DRG.1] Successful Deregistration	33
	4.21	[WINNF.FT.C.SCS.1] Successful TLS connection between UUT and SAS Test Harness	34
	4.22	[WINNF.FT.C.SCS.2] TLS failure due to revoked certificate	35
	4.23	[WINNF.FT.C.SCS.3] TLS failure due to expired server certificate	36
	4.24	[WINNF.FT.C.SCS.4] TLS failure when SAS Test Harness certificate is issued by an unknown C	;A37
	4.25	[WINNF.FT.C.SCS.5] TLS failure when certificate at the SAS Test Harness is corrupted	38
	4.26	[WINNF.PT.C.HBT] UUT RF Transmit Power Measurement	39
5.	Resu	It of Time test for getting Grant	41
	5.1	1 second within any 10-second period	41
	5.2	10 seconds within any 300-second period	42
	5.3	20 seconds within any 3600-second period	43
6.	UUT	registers with the SAS irrespective of power levels	44
	6.1	Test Procedure	44
	6.2	Result	44

Appendix A. Setup Plot

Appendix B. RF measurement plots

TEL: 886-3-327-3456 Page Number FAX: 886-3-328-4978 Issued Date

: Mar. 29, 2021

: 3 of 45

Report No.: FG130414A

Report Version : 01

### **Revision History**

Report No.: FG130414A

Report No.	Version	Description	Issued Date
FG130414A	01	Initial issue of report	Mar. 29, 2021

#### **Declaration of Conformity:**

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

#### **Comments and Explanations:**

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

Reviewed by: Louis Wu Report Producer: Dara Chiu

TEL: 886-3-327-3456 Page Number : 4 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

### 1. Administration Data

# 1.1 Testing Laboratory

Test Site	Sporton International Inc. EMC & Wireless Communications Laboratory
Test Site Location	No.52, Huaya 1st Rd., Guishan Dist., Taoyuan City 333, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978
Test Site No.	Sporton Site No. DFS02-HY
Test Engineer	Thomas Chen
Temperature	21 ~ 23 ℃
Relative Humidity	51 ~ 58 %

FCC Designation No.: TW1190

TEL: 886-3-327-3456 Page Number : 5 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

#### 2. General Information

### 2.1 Description of Equipment Under Test (EUT)

	Product Feature & Specification		
Professional Installation	<ul><li>✓ Yes</li><li>□ No</li></ul>		
Unit Under Test Type	<ul><li>□ BTS-CBSD product (Base Station)</li><li>⊠ CPE-CBSD product (Customer Premises Equipment)</li></ul>		
UUT Category	<ul><li>□ Category A</li><li>⊠ Category B</li></ul>		
Domain Proxy support	<ul><li>☐ UUT with Domain Proxy</li><li>☑ UUT without Domain Proxy</li></ul>		
UUT Antenna Type	Fixed Internal Antenna		
UUT Antenna Gain	7.45 dBi		
UUT HW Version	4		
UUT FW Version	3.0.6		
UUT SW Version	2.384		
UUT Serial Number	FG121020E20002		

**Remark:** The above EUT's information was declared by manufacturer. Please refer to Comments and Explanations in report summary.

TEL: 886-3-327-3456 Page Number : 6 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 2.2 Protocol Test Summary

Section	Test Case ID	Test Case Title	Test Result
6.1.4.1.1	WINNF.FT.C.REG.1	Multi-Step registration	PASS
6.1.4.1.5	WINNF.FT.C.REG.5	Single-Step registration for CBSD with CPI signed data	PASS
6.1.4.2.1	WINNF.FT.C.REG.8	Missing Required parameters (responseCode 102)	PASS
6.1.4.2.3	WINNF.FT.C.REG.10	Pending registration (responseCode 200)	PASS
6.1.4.2.5	WINNF.FT.C.REG.12	Invalid parameter (responseCode 103)	PASS
6.1.4.2.7	WINNF.FT.C.REG.14	Blacklisted CBSD (responseCode 101)	PASS
6.1.4.2.9	WINNF.FT.C.REG.16	Unsupported SAS protocol version (responseCode 100)	PASS
6.1.4.2.11	WINNF.FT.C.REG.18	Group Error (responseCode 201)	PASS
6.3.4.2.1	WINNF.FT.C.GRA.1	Unsuccessful Grant responseCode=400 (INTERFERENCE)	PASS
6.3.4.2.2	WINNF.FT.C.GRA.2	Unsuccessful Grant responseCode=401 (GRANT_CONFLICT)	PASS
6.4.4.1.1	WINNF.FT.C.HBT.1	Heartbeat Success Case (first Heartbeat Response)	PASS
6.4.4.2.1	WINNF.FT.C.HBT.3	Heartbeat responseCode=105 (DEREGISTER)	PASS
6.4.4.2.2	WINNF.FT.C.HBT.4	Heartbeat responseCode=500 (TERMINATED_GRANT)	PASS
6.4.4.2.3	WINNF.FT.C.HBT.5	Heartbeat responseCode=501 (SUSPENDED_GRANT) in First Heartbeat Response	PASS
6.4.4.2.4	WINNF.FT.C.HBT.6	Heartbeat responseCode=501 (SUSPENDED_GRANT) in Subsequent Heartbeat Response	PASS
6.4.4.2.5	WINNF.FT.C.HBT.7	Heartbeat responseCode=502 (UNSYNC_OP_PARAM)	PASS
6.4.4.3.1	WINNF.FT.C.HBT.9	Heartbeat Response Absent (First Heartbeat)	PASS
6.4.4.3.2	WINNF.FT.C.HBT.10	Heartbeat Response Absent (Subsequent Heartbeat)	PASS
6.6.4.1.1	WINNF.FT.C.RLQ.1	Successful Relinquishment	PASS
6.7.4.1.1	WINNF.FT.C.DRG.1	Successful Deregistration	PASS
6.8.4.1.1	WINNF.FT.C.SCS.1	Successful TLS connection between UUT and SAS Test Harness	PASS
6.8.4.2.1	WINNF.FT.C.SCS.2	TLS failure due to revoked certificate	PASS
6.8.4.2.2	WINNF.FT.C.SCS.3	TLS failure due to expired server certificate	PASS
6.8.4.2.3	WINNF.FT.C.SCS.4	TLS failure when SAS Test Harness certificate is issue by unknown CA	PASS
6.8.4.2.4	WINNF.FT.C.SCS.5	TLS failure when certificate at the SAS Test Harness is corrupted	PASS
7.1.4.1.1	WINNF.PT.C.HBT	UUT RF Transmit Power Measurement	PASS

TEL: 886-3-327-3456 Page Number : 7 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 2.3 Time test for getting Grant Summary

Trail	Time limit	Monitoring time	Measured result	Verdict
1	1 second	10 seconds	4.4ms	PASS
2	10 seconds	300 seconds	15ms	PASS
3	20 seconds	3600 seconds	180ms	PASS

#### 2.4 Support Equipment

Name	Manufacturer	Type/Model	Serial Number	FCC ID
Q710	Ruckus	P01-Q710-US02	991929000175	S9GQ710US02

### 2.5 Test Equipment List

Nama	Manufacturer	Type/Model	Carial Number	Calibration	
Name	Manufacturer		Serial Number	Last Cal.	Due Date
Spectrum Analyzer	Rohde & Schwarz	FSV3044	101048	Apr. 29, 2020	Apr. 28, 2021

TEL: 886-3-327-3456 Page Number : 8 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 3. Measurement Environment


Measurement Environment Information		
SAS Test Harness version	1.0.0.3	
Operating System	Windows 10	
TLS version	V 1.2	
Python version	V 2.7	

	Conditional Test Case				
Support (Yes / No) Condition		Definition			
Yes	C1	Mandatory for UUT which supports multi-step registration message			
No C2		Mandatory for UUT which supports single-step registration with no CPI-signed data in the registration message. By definition, this is a subset of Category A devices which determine all registration information, including location, without CPI intervention.			
Yes	С3	Mandatory for UUT which supports single-step registration containing CPIsigned data in the registration message.			
No	C4	Mandatory for UUT which supports RECEIVED_POWER_WITHOUT_GRANT measurement report type			
No	C5	Mandatory for UUT which supports RECEIVED_POWER_WITH_GRANT measurement report type.			
No	C6	Mandatory for UUT which supports parameter change being made at the UUT and prior to sending a deregistration.			

TEL: 886-3-327-3456 Page Number : 9 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

### 3.1 Test configuration without Domain Proxy

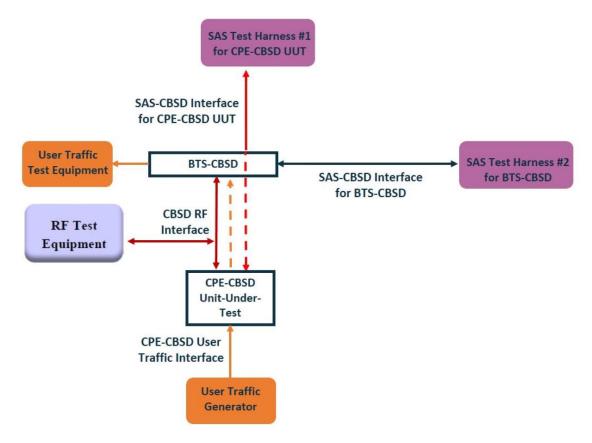

CPE-CBSD as UUT, BTS-CBSD direct communication.

TEL: 886-3-327-3456 Page Number : 10 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

#### 3.2 Standards

[n.1]. FCC KDB 940660 D02 CPE-CBSD Handshake Procedures v02, 22 October 2019

[n.2]. WINNF-TS-0122 Version 1.0.2, "Conformance and Performance Test Technical Specification; CBSD/DP as Unit Under Test (UUT)", 25 November 2020

[n.3]. WINNF-TS-0016 Version 1.2.6, "SAS to CBSD Technical Specification", 25 November 2020

#### 3.3 Protocol test procedure

The test cases for SAS<->CBSD protocol in [n.2] apply for CPE-CBSD device type. Following the [n.1], when running the test cases in [n.2] for CPE-CBSD device type, verify that:

- CPE-CBSD can begin transmitting its RF only after receiving radio signal from its compatible BTS-CBSD.
- 2. For all CPE-CBSD RF transmissions, the CPE-CBSD UUT radio frequency range and bandwidth are less or equal to the frequency range and bandwidth of its compatible BTS-CBSD.
- 3. Judging the last execution step appearing in [n.2] with "User data traffics" instead of "RF transmission."

#### 3.4 Time test for getting Grant Procedure

Use the WinnForum SAS Harness run test case WINNF.FT.C.GRA.1. Without answering the last question in WINNF.FT.C.GRA.1 will keep UUT's grant request being rejected, then measure the time.

TEL: 886-3-327-3456 Page Number : 11 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4. Protocol Test Results

# 4.1 [WINNF.FT.C.REG.1] Multi-Step registration

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with the SAS Test Harness	
	UUT is in the Unregistered state	
	CBSD sends correct Registration request information, as specified in [n.5],	
	to the SAS Test Harness:	
	The required userId, fccId and cbsdSerialNumber registration  parameters shall be cent from the CRSD and conform to proper.	
	parameters shall be sent from the CBSD and conform to proper	
2	format and acceptable ranges.	PASS
	Any REG-conditional or optional registration parameters that may  he included in the manage shall be varified that they conform to	
	be included in the message shall be verified that they conform to	
	proper format and are within acceptable ranges.	
	Note: It is outside the scope of this document to test the Registration	
	information that is supplied via another means.	
	<ul> <li>SAS Test Harness sends a CBSD Registration Response as follows:</li> </ul>	
2		
3	- cbsdld = C	
	measReportConfig shall not be included	
	- responseCode = 0	
	After completion of step 3, SAS Test Harness will not provide any	
4	positive response ( <i>responseCode</i> =0) to further request messages from the	
	UUT.	
_	Monitor the RF output of the UUT from start of test until 60 seconds after	DAGG
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 12 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.2 [WINNF.FT.C.REG.5] Single-Step registration for CBSD with CPI signed data

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:</li> <li>UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness</li> <li>UUT is in the Unregistered state</li> <li>All of the required and REG-Conditional parameters shall be configured and CPI signature provided</li> </ul>	
2	CBSD sends Registration request to the SAS Test Harness:     The required userId, fccId and cbsdSerialNumber and REG-Conditional cbsdCategory, airInterface, measCapability and cpiSignatureData registration parameters shall be sent from the CBSD and conform to proper format and acceptable ranges.	PASS
	Any optional registration parameters that may be included in the message shall be verified that they conform to proper format and are within acceptable ranges.	
3	<ul> <li>SAS Test Harness sends a CBSD Registration Response as follows:</li> <li>- cbsdld = C</li> <li>- measReportConfig shall not be included.</li> <li>- responseCode = 0</li> </ul>	
4	After completion of step 3, SAS Test Harness will not provide any positive response ( <i>responseCode</i> =0) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after  Step 3 is complete. This is the end of the test. Verify:  • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 13 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.3 [WINNF.FT.C.REG.8] Missing Required parameters (responseCode 102)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	<ul> <li>SAS response does not include cbsdld</li> </ul>	 
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=0) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 14 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.4 [WINNF.FT.C.REG.10] Pending registration (responseCode 200)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	<ul> <li>SAS response does not include cbsdld</li> </ul>	
	– responseCode = R	
١,	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=200) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 15 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.5 [WINNF.FT.C.REG.12] Invalid parameter (responseCode 103)

#	Test Execution Steps	Results
1	UUT has successfully completed SAS Discovery and     Authentication with SAS Test Harness     UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
3	SAS Test Harness rejects the request by sending a CBSD Registration Response as follows:  - SAS response does not include cbsdld - responseCode = R	1
4	After completion of step 3, SAS Test Harness will not provide any positive response ( <i>responseCode</i> =103) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after  Step 3 is complete. This is the end of the test. Verify:  • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 16 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.6 [WINNF.FT.C.REG.14] Blacklisted CBSD (responseCode 101)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	<ul> <li>SAS response does not include cbsdld</li> </ul>	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=101) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 17 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.7 [WINNF.FT.C.REG.16] Unsupported SAS protocol version (responseCode 100)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
	<ul> <li>SAS response does not include cbsdld</li> </ul>	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=100) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 18 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.8 [WINNF.FT.C.REG.18] Group Error (responseCode 201)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	<ul> <li>SAS response does not include cbsdld</li> </ul>	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=201) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 19 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.9 [WINNF.FT.C.GRA.1] Unsuccessful Grant responseCode=400 (INTERFERENCE)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	<ul> <li>UUT has registered successfully with SAS Test Harness, with cbsdld = C</li> </ul>	
2	UUT sends valid Grant Request.	
	SAS Test Harness sends a Grant Response message, including	
3	• cbsdld=C	
	• responseCode = R	
4	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=0) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 20 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.10 [WINNF.FT.C.GRA.2] Unsuccessful Grant responseCode=401 (GRANT\_CONFLICT)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	<ul> <li>UUT has registered successfully with SAS Test Harness, with cbsdld = C</li> </ul>	
2	UUT sends valid Grant Request.	
	SAS Test Harness sends a Grant Response message, including	
3	• cbsdld=C	
	• responseCode = R	
4	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=401) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 21 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.11 [WINNF.FT.C.HBT.1] Heartbeat Success Case (first Heartbeat Response)

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:</li> <li>UUT has registered successfully with SAS Test Harness, with cbsdld = C</li> </ul>	
2	<ul> <li>UUT sends a message:</li> <li>If message is type Spectrum Inquiry Request, go to step 3, or</li> <li>If message is type Grant Request, go to step 5</li> </ul>	
3	<ul> <li>UUT sends Spectrum Inquiry Request. Validate:</li> <li>cbsdld = C</li> <li>List of frequencyRange objects sent by UUT are within the CBRS frequency range</li> </ul>	PASS
4	SAS Test Harness sends a Spectrum Inquiry Response message, including the following parameters:  • cbsdld = C  • availableChannel is an array of availableChannel objects  • responseCode = 0	
5	<ul> <li>UUT sends Grant Request message. Validate:         <ul> <li>cbsdld = C</li> </ul> </li> <li>maxEIRP is at or below the limit appropriate for CBSD category as defined by Part 96</li> <li>operationFrequencyRange, F, sent by UUT is a valid range within the CBRS band</li> </ul>	PASS
6	SAS Test Harness sends a Grant Response message, including the parameters:  • cbsdld = C  • grantld = G = a valid grant ID  • grantExpireTime = UTC time greater than duration of the test  • responseCode = 0	
7	UUT sends a first Heartbeat Request message.  Verify Heartbeat Request message is formatted correctly, including:  • cbsdld = C  • grantld = G  • operationState = "GRANTED"	PASS

TEL: 886-3-327-3456 Page Number : 22 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

	SAS Test Harness sends a Heartbeat Response message, with the	
8	following parameters:	
	• cbsdld = C	
	• grantId = G	
	<ul> <li>transmitExpireTime = current UTC time + 200 seconds</li> </ul>	
	• responseCode = 0	
	For further Heartbeat Request messages sent from UUT after completion	
	of step 8, validate message is sent within latest specified heartbeatInterval,	
	and:	
	• cbsdld = C	
	● grantId = G	
9	<ul><li>operationState = "AUTHORIZED"</li></ul>	PASS
	and SAS Test Harness responds with a Heartbeat Response message	17.00
	including the following parameters:	
	• cbsdld = C	
	● grantId = G	
	<ul> <li>transmitExpireTime = current UTC time + 200 seconds</li> </ul>	
	• responseCode = 0	
	Monitor the RF output of the UUT from start of test until UUT	
10	transmission commences. Verify:	
	UUT does not transmit at any time prior to completion of the first	DAGG
	heartbeat response	PASS
	UUT transmits after step 8 is complete, and its transmission is	
	limited to within the bandwidth range F.	

TEL: 886-3-327-3456 Page Number : 23 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.12 [WINNF.FT.C.HBT.3] Heartbeat responseCode=105 (DEREGISTER)

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:         <ul> <li>UUT has registered successfully with SAS Test Harness</li> </ul> </li> <li>UUT has a valid single grant as follows:         <ul> <li>valid cbsdld = C</li> <li>valid grantId = G</li> <li>grant is for frequency range F, power P</li> <li>grantExpireTime = UTC time greater than duration of the test</li> </ul> </li> <li>UUT is in AUTHORIZED state and is transmitting within the grant bandwidth F on RF interface</li> </ul>	
2	UUT sends a Heartbeat Request message.  Ensure Heartbeat Request message is sent within Heartbeat Interval specified in the latest Heartbeat Response, and formatted correctly, including:  • cbsdld = C • grantld = G • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters:  • cbsdld = C • grantld = G • transmitExpireTime = T = Current UTC time • responseCode = 105 (DEREGISTER)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the RF output of the UUT. Verify:  • UUT shall stop transmission within (T + 60 seconds) of completion of step 3	PASS

TEL: 886-3-327-3456 Page Number : 24 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.13 [WINNF.FT.C.HBT.4] Heartbeat responseCode=500 (TERMINATED\_GRANT)

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:         <ul> <li>UUT has registered successfully with SAS Test Harness</li> <li>UUT has a valid single grant as follows:</li></ul></li></ul>	
2	UUT sends a Heartbeat Request message.  Ensure Heartbeat Request message is sent within latest specified heartbeatInterval, and is formatted correctly, including:  • cbsdld = C  • grantId = G  • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters:  • cbsdld = C  • grantld = G  • transmitExpireTime = T = current UTC time  • responseCode = 500 (TERMINATED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the RF output of the UUT. Verify:  UUT shall stop transmission within (T + 60 seconds) of completion of step 3	PASS

TEL: 886-3-327-3456 Page Number : 25 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.14 [WINNF.FT.C.HBT.5] Heartbeat responseCode=501 (SUSPENDED\_GRANT) in First Heartbeat Response

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:         <ul> <li>UUT has registered successfully with SAS Test Harness</li> <li>UUT has a valid single grant as follows:</li></ul></li></ul>	
2	UUT sends a Heartbeat Request message.  Verify Heartbeat Request message is formatted correctly, including:  • cbsdld = C  • grantld = G  • operationState = "GRANTED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters:  • cbsdld = C  • grantld = G  • transmitExpireTime = T = current UTC time  • responseCode = 501 (SUSPENDED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the SAS-CBSD interface. Verify either A OR B occurs:  A. UUT sends a Heartbeat Request message. Ensure message is sent within latest specified heartbeatInterval, and is correctly formatted with parameters:  • cbsdld = C • grantld = G • operationState = "GRANTED"  B. UUT sends a Relinquishment request message. Ensure message is correctly formatted with parameters:  • cbdsld = C • grantld = G  Monitor the RF output of the UUT. Verify:  • UUT does not transmit at any time	PASS

TEL: 886-3-327-3456 Page Number : 26 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.15 [WINNF.FT.C.HBT.6] Heartbeat responseCode=501 (SUSPENDED\_GRANT) in Subsequent Heartbeat Response

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has registered successfully with SAS Test Harness	
	UUT has a valid single grant as follows:	
	○ valid <i>cbsdld</i> = C	
1	○ valid <i>grantld</i> = G	
'	<ul> <li>grant is for frequency range F, power P</li> </ul>	
	<ul> <li>grantExpireTime = UTC time greater than duration of the</li> </ul>	
	test	
	UUT is in AUTHORIZED state and is transmitting within the grant	
	bandwidth F on RF interface	
	UUT sends a Heartbeat Request message.	
	Verify Heartbeat Request message is sent within latest specified	PASS
2	heartbeatInterval, and is formatted correctly, including:	
	• cbsdld = C	
	• grantId = G	
	operationState = "AUTHORIZED"	
	SAS Test Harness sends a Heartbeat Response message, including the	
	following parameters:	
3	• cbsdld = C	
	• grantId = G	
	<ul> <li>transmitExpireTime = T = current UTC time</li> </ul>	
	<ul><li>responseCode = 501 (SUSPENDED_GRANT)</li></ul>	
4	After completion of step 3, SAS Test Harness shall not allow any further	
	grants to the UUT.	

TEL: 886-3-327-3456 Page Number : 27 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

	<del>-</del>	
	Monitor the SAS-CBSD interface. Verify either A OR B occurs:	
	A. UUT sends a Heartbeat Request message. Ensure message is	
	sent within latest specified heartbeatInterval, and is correctly	
	formatted with parameters:	
	• cbsdld = C	
	• grantId = G	
_	<ul><li>operationState = "GRANTED"</li></ul>	D400
5	B. UUT sends a Relinquishment Request message. Ensure	PASS
	message is correctly formatted with parameters:	
	• cbdsld = C	
	• grantId = G	
	Monitor the RF output of the UUT. Verify:	
	<ul> <li>UUT shall stop transmission within (T + 60 seconds) of</li> </ul>	
	completion of step 3	

 TEL: 886-3-327-3456
 Page Number
 : 28 of 45

 FAX: 886-3-328-4978
 Issued Date
 : Mar. 29, 2021

Report Version : 01

# 4.16 [WINNF.FT.C.HBT.7] Heartbeat responseCode=502 (UNSYNC\_OP\_PARAM)

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:         <ul> <li>UUT has registered successfully with SAS Test Harness</li> <li>UUT has a valid single grant as follows:</li></ul></li></ul>	
2	UUT sends a Heartbeat Request message.  Verify Heartbeat Request message is sent within latest specified  heartbeatInterval, and is formatted correctly, including:  • cbsdld = C  • grantId = G  • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters:  • cbsdld = C  • grantld = G  • transmitExpireTime = T = Current UTC Time  • responseCode = 502 (UNSYNC_OP_PARAM)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the SAS-CBSD interface. Verify:  • UUT sends a Grant Relinquishment Request message. Verify message is correctly formatted with parameters:  • cbdsld = C  • grantld = G  Monitor the RF output of the UUT. Verify:  • UUT shall stop transmission within (T+60) seconds of completion of step 3.	PASS

TEL: 886-3-327-3456 Page Number : 29 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.17 [WINNF.FT.C.HBT.9] Heartbeat Response Absent (First Heartbeat)

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:</li> <li>UUT has registered successfully with SAS Test Harness</li> <li>UUT has a valid single grant as follows:         <ul> <li>valid cbsdld = C</li> <li>valid grantld = G</li> <li>grant is for frequency range F, power P</li> <li>grantExpireTime = UTC time greater than duration of the test</li> </ul> </li> <li>UUT is in GRANTED, but not AUTHORIZED state (i.e. has not</li> </ul>	
2	performed its first Heartbeat Request)  UUT sends a Heartbeat Request message.  Ensure Heartbeat Request message is sent within latest specified heartbeatInterval, and is formatted correctly, including:  • cbsdld = C  • grantId = G  • operationState = "GRANTED"	PASS
3	After completion of Step 2, SAS Test Harness does not respond to any further messages from UUT to simulate loss of network connection	
4	Monitor the RF output of the UUT from start of test to 60 seconds after step 3.  Verify:  • At any time during the test, UUT shall not transmit on RF interface	PASS

TEL: 886-3-327-3456 Page Number : 30 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.18 [WINNF.FT.C.HBT.10] Heartbeat Response Absent (Subsequent Heartbeat)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has registered successfully with SAS Test Harness	
	UUT has a valid single grant as follows:	
	○ valid <i>cbsdld</i> = C	
4	○ valid <i>grantId</i> = G	
1	<ul> <li>grant is for frequency range F, power P</li> </ul>	
	<ul> <li>grantExpireTime = UTC time greater than duration of the</li> </ul>	
	test	
	UUT is in AUTHORIZED state and is transmitting within the grant bandwidth F on RF interface	
	UUT sends a Heartbeat Request message.	
	Verify Heartbeat Request message issent within the latest specified	
2	heartbeatInterval, and is formatted correctly, including:	PASS
	• cbsdld = C	
	• grantId = G	
	operationState = "AUTHORIZED"  OAGT AND TO THE STATE OF THE STATE	
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
3	• cbsdld = C	
	• grantId = G	
	transmitExpireTime = current UTC time + 200 seconds	
	• responseCode = 0	
4	After completion of Step 3, SAS Test Harness does not respond to any	
	further messages from UUT	
	Monitor the RF output of the UUT. Verify:	
5	UUT shall stop all transmission on RF interface within	PASS
-	(transmitExpireTime + 60 seconds), using the	
	transmitExpireTime sent in Step 3.	

TEL: 886-3-327-3456 Page Number : 31 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.19 [WINNF.FT.C.RLQ.1] Successful Relinquishment

#	Test Execution Steps	Results
1	<ul> <li>Ensure the following conditions are met for test entry:         <ul> <li>UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness</li> <li>UUT has successfully registered with SAS Test Harness, with cbsdld=C</li> <li>UUT has received a valid grant with grantId = G</li> <li>UUT is in Grant State AUTHORIZED and is actively transmitting within the bounds of its grant.</li> </ul> </li> <li>Invoke trigger to relinquish UUT Grant from the SAS Test Harness</li> </ul>	
2	UUT sends a Relinquishment Request message. Verify message contains all required parameters properly formatted, and specifically:  • cbsdld = C  • grantId = G	PASS
3	SAS Test Harness shall approve the request with a Relinquishment Response message with parameters:  - cbsdld = C  - grantld = G  - responseCode = 0	-
4	After completion of step 3, SAS Test Harness will not provide any additional positive response ( <i>responseCode</i> =0) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after  Step 3 is complete. This is the end of the test. Verify:  • UUT shall stop RF transmission at any time between triggering the relinquishment and UUT sending the relinquishment request	PASS

TEL: 886-3-327-3456 Page Number : 32 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.20 [WINNF.FT.C.DRG.1] Successful Deregistration

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	<ul> <li>UUT has successfully completed SAS Discovery and</li> </ul>	
	Authentication with SAS Test Harness	
1	<ul> <li>UUT has successfully registered with SAS Test Harness, with cbsdld=C</li> </ul>	
	<ul> <li>UUT has received a valid grant with grantId = G</li> </ul>	
	<ul> <li>UUT is in Grant State AUTHORIZED and is actively</li> </ul>	
	transmitting within the bounds of its grant.	
	Invoke trigger to deregister UUT from the SAS Test Harness	
2	UUT sends a Relinquishment request and receives Relinquishment	
	response with responseCode=0	
3	UUT sends Deregistration Request to SAS Test Harness with <i>cbsdld</i> = C.	PASS
	SAS Test Harness shall approve the request with a Deregistration Response	
4	message with parameters:	
_	• cbsdld = C	
	• responseCode = 0	
	After completion of step 3, SAS Test Harness will not provide any	
5	additional positive response (responseCode=0) to further request	
	messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 4 is complete. This is the end of the test. Verify:	
	<ul> <li>UUT stopped RF transmission at any time between triggering the</li> </ul>	
6	deregistration and either A OR B occurs:	PASS
	A. UUT sending a Registration Request message, as this is not	
	mandatory	
	B. UUT sending a Deregistration Request message	

TEL: 886-3-327-3456 Page Number : 33 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.21 [WINNF.FT.C.SCS.1] Successful TLS connection between UUT and SAS Test Harness

#	Test Execution Steps	Results
1	<ul> <li>UUT shall start CBSD-SAS communication with the security procedure</li> <li>The UUT shall establish a TLS handshake with the SAS Test Harness using configured certificate.</li> <li>Configure the SAS Test Harness to accept the security</li> </ul>	PASS
	procedure and establish the connection	
2	<ul> <li>Make sure that Mutual authentication happens between UUT and the SAS Test Harness.</li> <li>Make sure that UUT uses TLS v1.2</li> <li>Make sure that cipher suites from one of the following is selected,</li> <li>TLS_RSA_WITH_AES_128_GCM_SHA256</li> <li>TLS_RSA_WITH_AES_256_GCM_SHA384</li> <li>TLS_ECDHE_ECDSA_WITH_AES_128_GCM_SHA2 56</li> <li>TLS_ECDHE_ECDSA_WITH_AES_256_GCM_SHA3 84</li> <li>TLS_ECDHE_RSA_WITH_AES_128_GCM_SHA256</li> </ul>	PASS
3	A successful registration is accomplished using one of the test cases described in section 6.1.4.1, depending on CBSD capability.  • UUT sends a registration request to the SAS Test Harness and the SAS Test Harness sends a Registration Response with responseCode = 0 and cbsdld.	PASS
4	Monitor the RF output of the UUT from start of test until 60 seconds after  Step 3 is complete. This is the end of the test. Verify:  • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 34 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.22 [WINNF.FT.C.SCS.2] TLS failure due to revoked certificate

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication with the security procedures	PASS
2	<ul> <li>Make sure that UUT uses TLS v1.2 for security establishment.</li> <li>Make sure UUT selects the correct cipher suite.</li> <li>UUT shall use CRL or OCSP to verify the validity of the server certificate.</li> <li>Make sure that Mutual authentication does not happen between UUT and the SAS Test Harness.</li> </ul>	PASS
3	UUT may retry for the security procedure which shall fail	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after  Step 3 is complete. This is the end of the test. Verify:  • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 35 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.23 [WINNF.FT.C.SCS.3] TLS failure due to expired server certificate

#	Test Execution Steps	Results
1	<ul> <li>UUT shall start CBSD-SAS communication with the security procedures</li> </ul>	PASS
2	<ul> <li>Make sure that UUT uses TLS v1.2 for security establishment.</li> <li>Make sure UUT selects the correct cipher suite.</li> <li>UUT shall use CRL or OCSP to verify the validity of the server certificate.</li> <li>Make sure that Mutual authentication does not happen between UUT and the SAS Test Harness.</li> </ul>	PASS
3	UUT may retry for the security procedure which shall fail.	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after  Step 3 is complete. This is the end of the test. Verify:  • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 36 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.24 [WINNF.FT.C.SCS.4] TLS failure when SAS Test Harness certificate is issued by an unknown CA

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication with the security procedures	PASS
2	<ul> <li>Make sure that UUT uses TLS v1.2 for security establishment.</li> <li>Make sure UUT selects the correct cipher suite.</li> <li>UUT shall use CRL or OCSP to verify the validity of the server certificate</li> <li>Make sure that Mutual authentication does not happen between UUT and the SAS Test Harness.</li> </ul>	PASS
3	UUT may retry for the security procedure which shall fail.	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after  Step 3 is complete. This is the end of the test. Verify:  UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 37 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.25 [WINNF.FT.C.SCS.5] TLS failure when certificate at the SAS Test Harness is corrupted

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication withthe security procedures	PASS
2	<ul> <li>Make sure that UUT uses TLS v1.2 for security establishment.</li> <li>Make sure UUT selects the correct cipher suite.</li> <li>UUT shall use CRL or OCSP to verify the validity of the server certificate.</li> <li>Make sure that Mutual authentication does not happen between UUT</li> </ul>	PASS
	and the SAS Test Harness.	2100
3	UUT may retry for the security procedure which shall fail.	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 38 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 4.26 [WINNF.PT.C.HBT] UUT RF Transmit Power Measurement

#	Test Execution Steps	Results		
	Ensure the following conditions are met for test entry:			
	UUT has successfully completed SAS Discovery and			
	Authentication with the SAS Test Harness			
	<ul> <li>UUT has registered with the SAS, with CBSD ID = C</li> </ul>			
	UUT has a single valid grant G with parameters {lowFrequency			
	= FL, highFrequency = FH, maxEirp = Pi}, with grant in			
	AUTHORIZED state, and grantExpireTime set to a value far past			
1	the duration of this test case			
'				
	Note: in order for the UUT to request a grant with the parameters			
	{lowFrequency, highFrequency, maxEirp), the SAS Test Harness may need			
	to provide appropriate guidance in the availableChannel object of the			
	spectrumInquiry response message, and the operationParam object of the			
	grant response message. Alternately, the UUT vendor may provide the ability			
	to set those parameters on the UUT so that the UUT will request a grant with			
	those parameters.			
	UUT and SAS Test Harness perform a series of Heartbeat Request/Response			
	cycles, which continues until the other test steps are complete. Messaging for			
	each cycle is as follows:			
	UUT sends Heartbeat Request, including:			
	○ cbsdld = C			
2	○ grantId = G			
_	<ul> <li>SAS Test Harness responds with Heartbeat Response,</li> </ul>			
	including:			
	○ cbsdld = C			
	○ grantId = G			
	<ul> <li>transmitExpireTime = current UTC time + 200 seconds</li> </ul>			
	o responseCode = 0			

TEL: 886-3-327-3456 Page Number : 39 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01



Tester performs power measurement on RF interface(s) of UUT, and verifies it complies with the maxEirp setting, Pi. The RF measurement method is out of scope of this document, but may include additional configuration of the UUT, as required, to fulfil the requirements of the power measurement method.

PASS

Note: it may be required for the vendor to provide a method or configuration to bring the UUT to a mode which is required by the measurement methodology. Any such mode is vendor-specific and depends upon UUT behavior and the measurement methodology.


Note: For test 4.26, pleaes find the Appendix B for RF measurement plots.

TEL: 886-3-327-3456 Page Number : 40 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 5. Result of Time test for getting Grant

## 5.1 1 second within any 10-second period

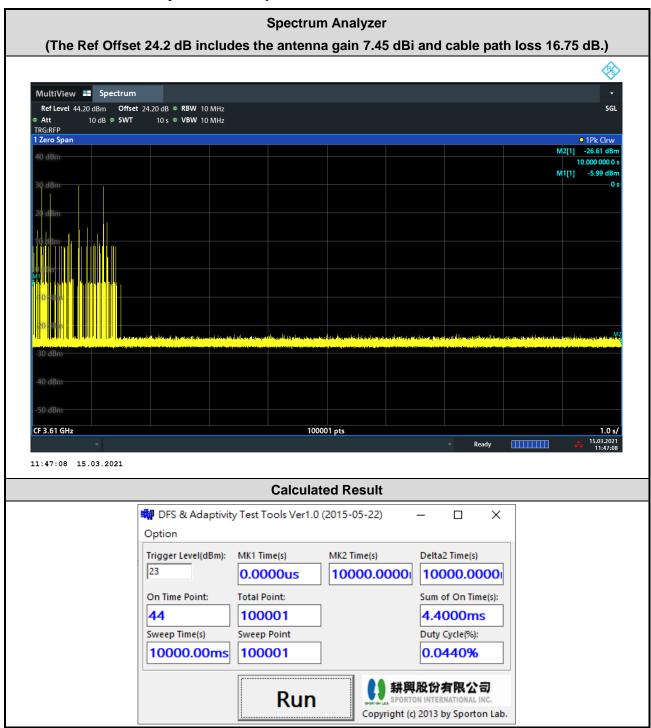


The sum of On Time (aggregated time from marker 1 to 2): 4.4ms < 1s, Pass.

TEL: 886-3-327-3456 Page Number : 41 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

## 5.2 10 seconds within any 300-second period

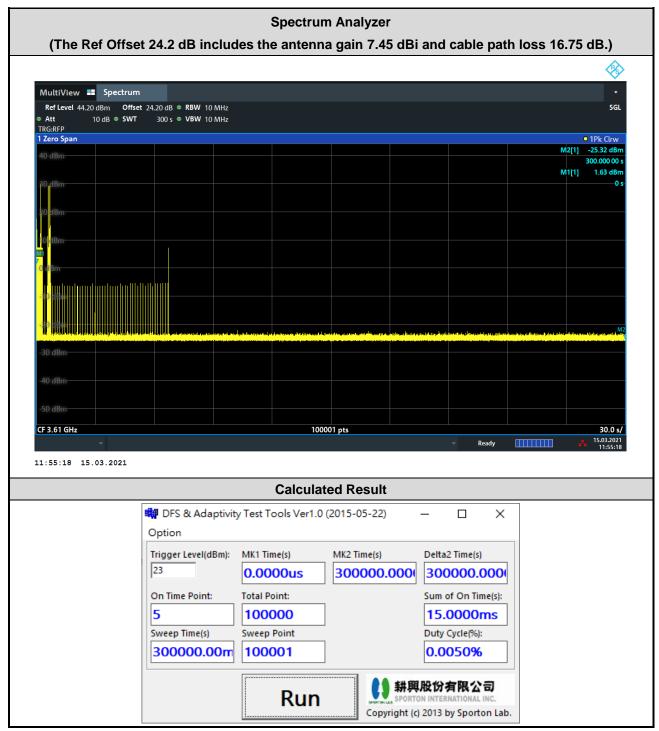


The sum of On Time (aggregated time from marker 1 to 2): 15ms < 10s, Pass.

TEL: 886-3-327-3456 Page Number : 42 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

## 5.3 20 seconds within any 3600-second period

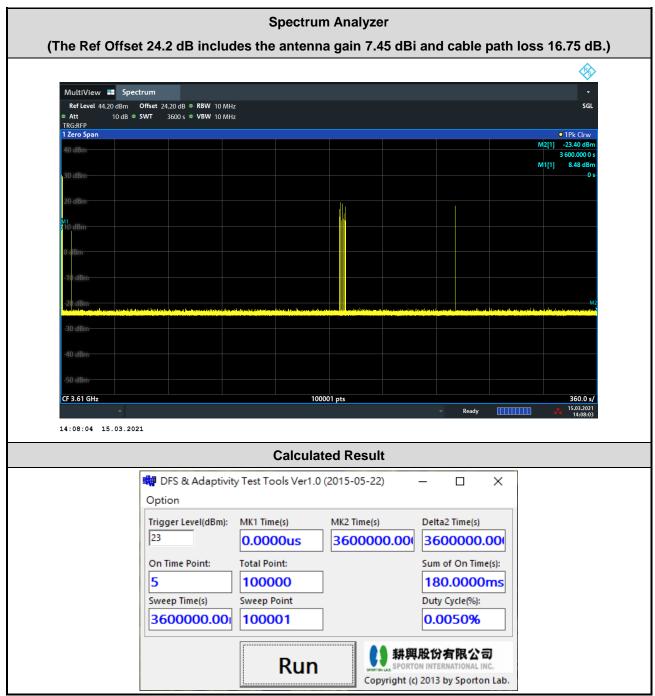

The sum of On Time (aggregated time from marker 1 to 2): 180ms < 20s, Pass.

TEL: 886-3-327-3456 Page Number : 43 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

# 6. UUT registers with the SAS irrespective of power levels

#### 6.1 Test Procedure

- 1. Set the SAS test harness to grant UUT with the highest EIRP higier than 23dBm.
- Check if UUT has successfully registered with SAS Test Harness, when operating EIRP higher than 23 dBm.
- 3. Set the SAS test harness to grant UUT with EIRP less than 23 dBm, repeatedly.
- 4. Check if UUT has successfully registered with SAS Test Harness, when operating EIRP less than 23 dBm.

#### 6.2 Result

The UUT can register with SAS under above operating conditions to meet the FCC criteria that the UUT will register with the SAS irrespective of power levels at which the device is set to operate – even below 23 dBm.



Marker 1: The UUT successfully registered with SAS Test Harness, when operating 25.79 dBm EIRP. Marker 2: After the UUT granted/authorized by the SAS, it can transmit with power less than the maxEIRP granted from SAS.


The UUT successfully registered with SAS Test Harness, when operating EIRP higher than 23 dBm

Test Result: PASS

Note: The total offset 24.2 dB includes the antenna gain 7.45 dBi and cable path loss 16.75 dB.

TEL: 886-3-327-3456 Page Number : 44 of 45 FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01

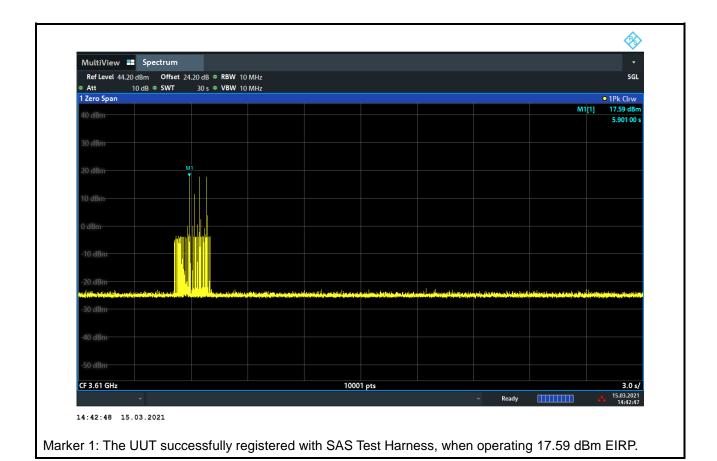

TEL: 886-3-327-3456 Page Number : 45 of 45
FAX: 886-3-328-4978 Issued Date : Mar. 29, 2021

Report Version : 01



Appendix B. RF measurement plots

# Appendix B.1 [WINNF.PT.C.HBT] UUT RF Transmit Power Measurement

Report Clause 4.26 [WINNF.PT.C.HBT] UUT RF Transmit Power Measurement

Center Frequency [MHz]	Bandwidth [MHz]	Granted MaxEIRP [dBm/MHz]	Conducted PSD [dBm/MHz]	Antenna Gain [dBi]	UUT MaxEIRP [dBm/MHz]	
3560	20		14.54		21.99 dBm	
3610			14.09		21.54 dBm	
3690			27	14.31	7.45	21.76 dBm
3555		- 27	16.69	7.45	24.14 dBm	
3605			17.02		24.47 dBm	
3695			17.38		24.83 dBm	

Report No.: FG130414A

Note 1: The total path loss is offset with 16.75 dB. The antenna gain is 7.45 dBi.

Note 2: The MaxEIRP Pi declared by manufactuer only supports one power level step, i.e. 27dBm/MHz as MaxEIRP. If any request from SAS to perform power control level change below 27dBm/MHz, the UUT would cease transmission immediately on the channel. Refer to Appendix B.2. for this characteristics verify.

TEL: 886-3-327-3456 Page Number : B1 of B9



**Appendix B.1.1 Test Procedure** 

[WINNF.PT.C.HBT] UUT RF Transmit Power Measurement defined in clause 4.26 of this test report.


Report No.: FG130414A

# **Appendix B.1.2 Test Result**




TEL: 886-3-327-3456 Page Number : B2 of B9



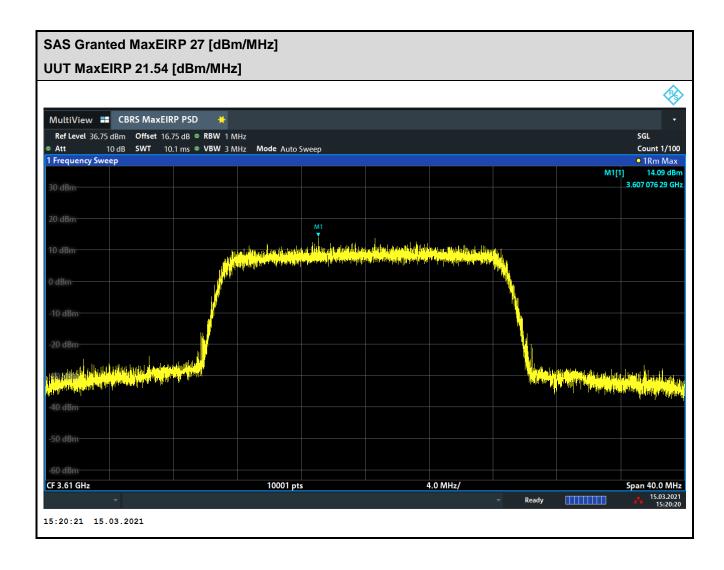


TEL: 886-3-327-3456 Page Number : B3 of B9

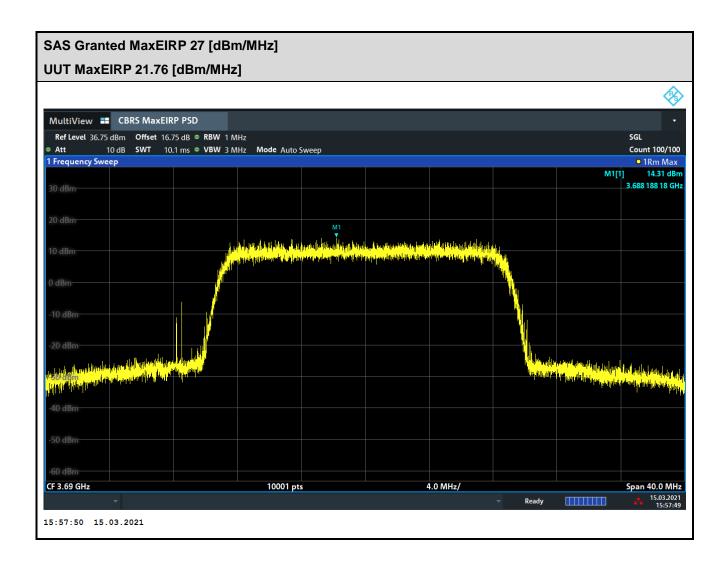


TEL: 886-3-327-3456 Page Number: B4 of B9



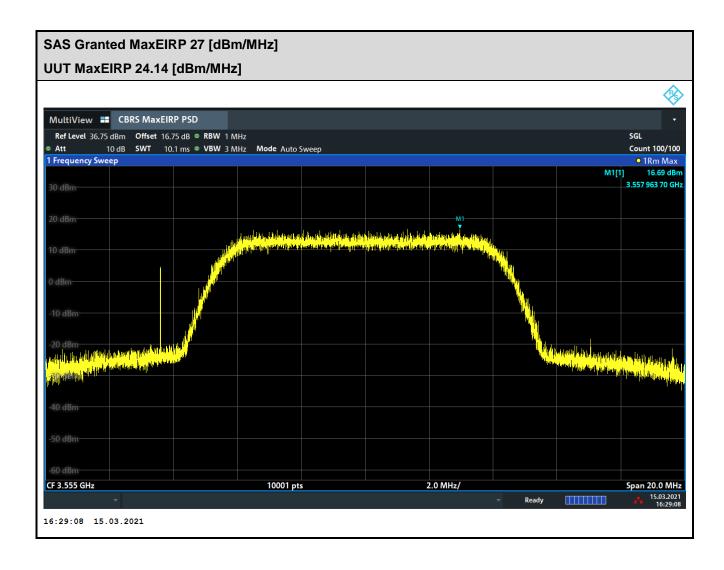


TEL: 886-3-327-3456 Page Number : B5 of B9



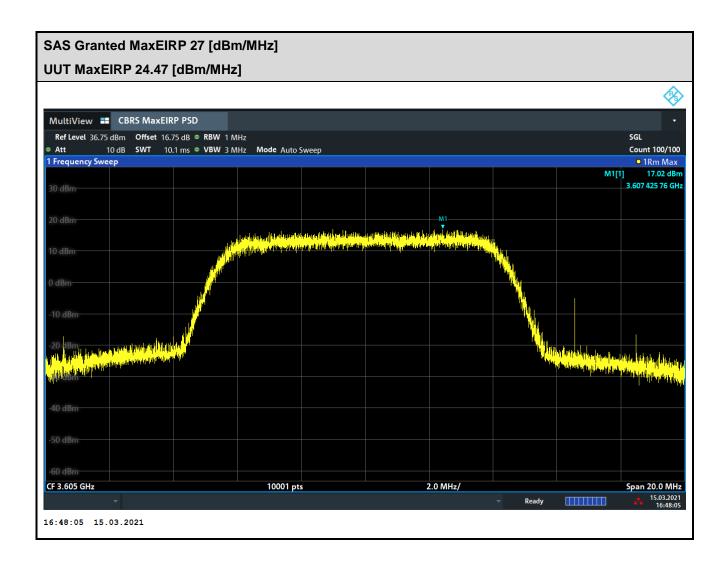

TEL: 886-3-327-3456 Page Number : B6 of B9

ment plots Report No. : FG130414A

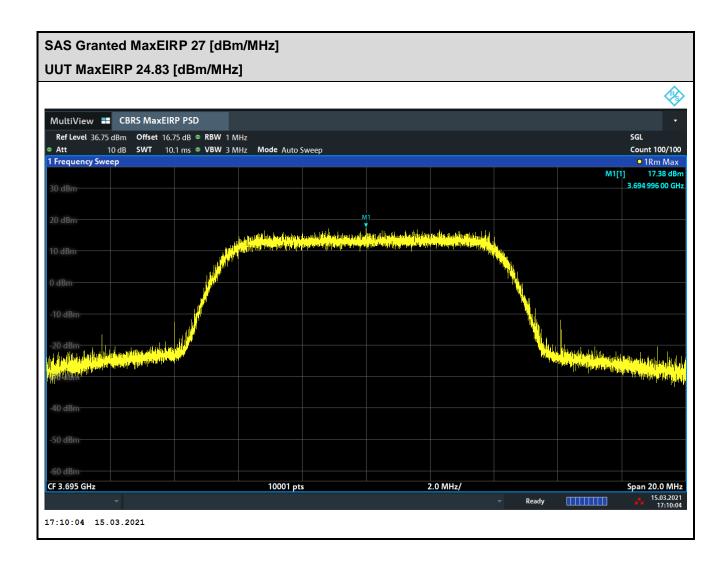

TEL: 886-3-327-3456 Page Number: B7 of B9

### Appendix B.2 Unsuccessful responses from the SAS Test Harness

According to the KDB 940660 D02 CPE-CBSD Handshake Procedures v02, "After the CPE-CBSD is registered and authorized by the SAS, the CPE-CBSD can start data transmission in the CBRS band using the channels and power levels authorized by the SAS." The result below is provided as a means to ensure that evidence is provided showing compliance to this requirement.

Report No.: FG130414A

This test is to verify if any request from SAS to perform power control level change below 32.1dBm/MHz, the UUT would cease transmission immediately on the channel

Unsuccessful responses from the SAS Test Harness by setting SAS granted MaxEIRP below 32.1 dBm/MHz.

Center Frequency [MHz]	Frequency   Bandwidth   MaxEIRP		Monitor the data transmission of the UUT until 60 seconds after responseCode = 400, received from SAS	Result
3610	20	26	CPE-CBSD UUT shall not transmit user traffic	PASS

#### **B.2.1 Test Procedure**


- Make SAS test harness to grant UUT power level below 27 dBm EIRP.
   Set SAS granted MaxEIRP: 26 dBm/MHz.
- 2. Ensure the UUT registered successfully with SAS Test Harness, with cbsdld = C.
- 3. UUT sends valid Grant Request.
- SAS Test Harness sends a Grant Response message, including: cbsdld=C, responseCode = 400,
- 5. Monitor the data transmission of the UUT from start of test until 60 seconds after Step 4 is complete.

TEL: 886-3-327-3456 Page Number : B8 of B9



#### **B.2.2 Test Result**

CPE-CBSD UUT shall not transmit user traffic.

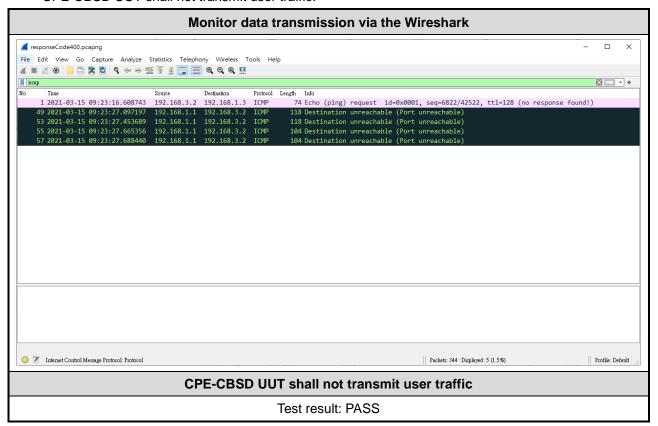



TEL: 886-3-327-3456 Page Number: B9 of B9