

Report No.: HA881333-01B



HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : PY7-04706A

Brand Name : Sony T-Rating : T4

Applicant : Sony Mobile Communications Inc.

4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo,

140-0002, Japan

Manufacturer : Sony Mobile Communications Inc.

4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo,

140-0002, Japan

Standard: FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received on Sep. 05, 2018 and testing was started from Sep. 17, 2018 and completed on Sep. 18, 2018. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The report must not be used by the client to claim product certification, approval, or endorsement by TAF or any agency of government.

The test results in this variant report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Cona Huang / Deputy Manager

SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 25 FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

Table of Contents

Report No.: HA881333-01B

1.	Attest	ation of Test Results	4					
2.	General Information							
3.	Testing Location							
4.	Applie	ed Standards	6					
5.	Air Int	erface and Operating Mode	7					
6.	Measu	rement standards for T-Coil	8					
	6.1	Frequency Response	8					
	6.2	T-Coil Signal Quality Categories	8					
7.	T-Coil	Test Procedure	9					
	7.1	Test Flow Chart						
	7.2	Test Setup Diagram	11					
	7.3	Description of EUT Test Position	13					
8.	Test E	quipment Listquipment List	14					
9.	T-Coil	testing for CMRS Voice	15					
	9.1	GSM Tests Results						
	9.2	UMTS Tests Results	16					
10.	T-Coil	testing for CMRS IP Voice	17					
	10.1	VoLTE Tests Results	17					
	10.2	VoWiFi Tests Results	19					
11.	T-Coil	testing for OTT VoIP Application	21					
		tainty Assessment						
		ences						

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Form version: 181113

History of this test report

Report No.: HA881333-01B

Report No.	Version	Description	Issued Date
HA881333-01B	Rev. 01	Initial issue of report	Dec. 12, 2018

TEL: 886-3-327-3456 Page: 3 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency Response	Magnetic Intensity	
	GSM850	T4	Pass	Pass	
GSM CMRS Voice	GSM1900	T4	Pass	Pass	
	EDGE850	T4	Pass	Pass	
OTT over EDGE	EDGE1900	T4	Pass	Pass	
	Band 2	T4	Pass	Pass	
UMTS CMRS Voice	Band 4	T4	Pass	Pass	
	Band 5	T4	Pass	Pass	
	Band 2	T4	Pass	Pass	
OTT over UMTS	Band 4	T4	Pass	Pass	
	Band 5	T4	Pass	Pass	
	Band 2	T4	Pass	Pass	
	Band 4	T4	Pass	Pass	
	Band 5	T4	Pass	Pass	
	Band 7	T4	Pass	Pass	
VoLTE	Band 12	T4	Pass	Pass	
	Band 13	T4	Pass	Pass	
	Band 17	T4	Pass	Pass	
	Band 25	T4	Pass	Pass	
	Band 66	T4	Pass	Pass	
OTT over LTE	Band 7	T4	Pass	Pass	
	2450	T4	Pass	Pass	
	5200	T4	Pass	Pass	
VoWiFI	5300	T4	Pass	Pass	
	5500	T4	Pass	Pass	
	5800	T4	Pass	Pass	
OTT over WiFi	2450	T4	Pass	Pass	
OTT over WiFi	5300	T4	Pass	Pass	
Date Tested	2018/09/17 ~ 2018/09/18				

Report No.: HA881333-01B

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

Reviewed by: <u>Jason Wang</u> Report Producer: <u>Daisy Peng</u>

TEL: 886-3-327-3456 Page: 4 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

2. General Information

Product Feature & Specification						
Applicant Name Sony Mobile Communications Inc.						
Equipment Name	GSM/WCDMA/LTE Phone+Bluetooth, DTS/UNII a/b/g/n/ac and NFC					
Brand Name	Sony					
FCC ID	PY7-04706A					
S/N	CQ30013GW1					
HW Version	A					
SW Version	1.27					
EUT Stage	Production Unit					

Report No.: HA881333-01B

Wireless Technologies	Frequency	Operating Mode		
GSM	850 1900	· GSM Voice · GPRS (GMSK) · EDGE (8PSK)	Multi-Slot Class: Class 33	
	Does device support dual transfer	mode? (Yes)		
W-CDMA (UMTS)	Band 5 Band 4 Band 2	· AMR / RMC 12.2Kbps · HSDPA · HSUPA · DC-HSDPA		
LTE (FDD)	Band 2 Band 4 Band 5 Band 7 Band 12 Band 13 Band 17 Band 25 Band 66	· QPSK · 16QAM · 64QAM · Rel 12 Carrier Aggregation	n Downlink only	
	2.4GHz: 2412 MHz ~ 2472 MHz	· 11b · 11g · 11n (HT20)		
WiFi	5GHz: 5.2GHz: 5180 MHz ~ 5240 MHz 5.3GHz: 5260 MHz ~ 5320 MHz 5.5GHz: 5500 MHz ~ 5720 MHz 5.8GHz: 5745 MHz ~ 5825 MHz	· 11a · 11n (HT20) · 11n (HT40) · 11ac (VHT20) · 11ac (VHT40) · 11ac (VHT80)		
Bluetooth	2.4GHz	· BR / EDR / LE		
NFC	13.56MHz	· ASK	_	

TEL: 886-3-327-3456 Page: 5 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

3. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Report No.: HA881333-01B

Testing Laboratory					
Test Site SPORTON INTERNATIONAL INC.					
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978				
Test Site No.	Sporton Site No.: SAR04-HY				

4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

TEL: 886-3-327-3456 Page: 6 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction													
	GSM850	VO	Vaa	WLAN, BT	OMDO Vaisa	No													
0014	GSM1900	VO	Yes	WLAN, BT	CMRS Voice	No													
GSM	EDGE850	VD	Yes	VALLANI DT	Google Duo ⁽¹⁾	No													
	EDGE1900	VD	res	WLAN, BT	Google Duo	No													
	850			WLAN, BT		No													
LIMTO	1750	VO	Yes	WLAN, BT	CMRS Voice	No													
UMTS	1900			WLAN, BT		No													
	HSPA	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No													
	Band 2			WLAN, BT		No													
	Band 4			WLAN, BT		No													
	Band 5	VD \	VD Yes	VD Yes	Yes	Yes		WLAN, BT		No									
	Band 7						WLAN, BT	VoLTE	No										
LTE (FDD)	Band 12						VD Yes WLAN, BT Google WLAN, BT WLAN, BT WLAN, BT WLAN, BT	1	No										
(100)	Band 13																WLAN, BT	Google Duo ⁽¹⁾	No
	Band 17																		No
	Band 25																		
	Band 66			WLAN, BT		No													
	2450					No													
	5200				VoWiFi ⁽¹⁾	No													
Wi-Fi	5300	VD	Yes	GSM,WCDMA,LTE	/	No													
	5500				Google Duo ⁽¹⁾	No													
	5800					No													
BT	2450	DT	No	GSM,WCDMA,LTE	NA	No													

Report No.: HA881333-01B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

Remark:

- 1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.
- 2. The device have similar frequency in some LTE bands: LTE B12/17, 2/25, 4/66, since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.


TEL: 886-3-327-3456 Page: 7 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA881333-01B

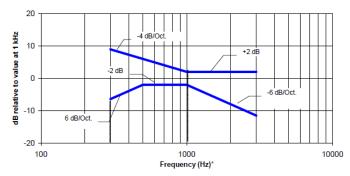

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

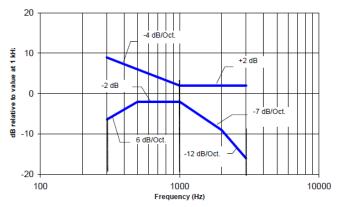

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

TEL: 886-3-327-3456 Page: 8 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA881333-01B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,


Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 9 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

7.1 Test Flow Chart

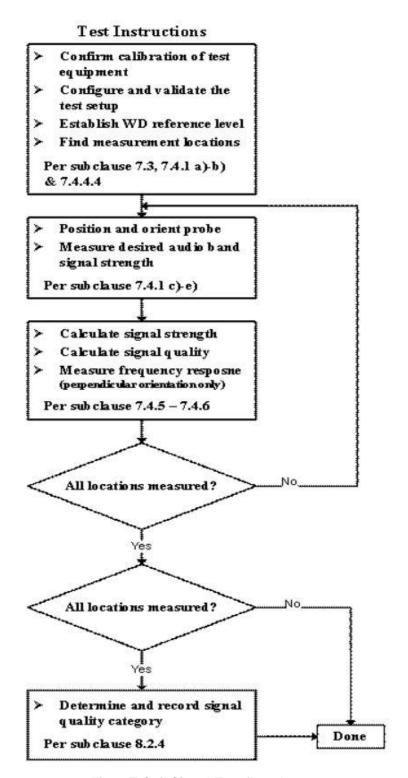


Report No.: HA881333-01B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 10 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

7.2 Test Setup Diagram

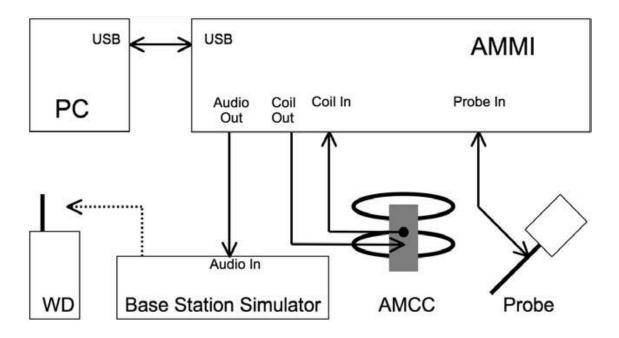

Report No.: HA881333-01B

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - GSM input level: -16dBm0
 - UMTS input level: -16dBm0
 - CDMA input level: -18dBm0
 - VoLTE input level: -16dBm0
 - VoWiFi input level: -20dBm0
 - OTT VoIP input Level: -20dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. The test setup used for VoLTE over IMS and VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- 5. The test setup used for Google DUO VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.

TEL : 886-3-327-3456 Page : 11 of 25 FAX : 886-3-328-4978 Issued Date : Dec. 12, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA881333-01B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k csek 8k 441 white 10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k voice 300-3000 2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Calculation formula:

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.47	3.14
10	20	-19.85	-14.24
8.17	18.24	-21.61	-16

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

TEL: 886-3-327-3456 Page: 12 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA881333-01B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

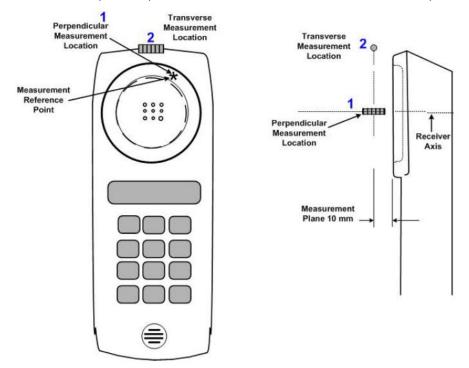


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 13 of 25 FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

8. Test Equipment List

Manufacturer	Name of Equipment	Type/Medel	Serial Number	Calibration	
Manufacturer		Type/Model	Serial Number	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018
SPEAG	Data Acquisition Electronics	DAE4	910	Jun. 21, 2018	Jun. 20, 2019
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
TESTO	Hygro meter	608-H1	34913631	Aug. 27, 2018	Aug. 26, 2019
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR
R&S	Base Station	CMW500	115793	May. 24, 2018	May. 23, 2019
R&S	Base Station	CMU200	116457	May. 30, 2018	May. 29, 2019

Report No.: HA881333-01B

Note:

TEL: 886-3-327-3456 Page: 14 of 25 FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

^{1.} NCR: "No-Calibration Required"

9. T-Coil testing for CMRS Voice

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.

Report No.: HA881333-01B

2. Air Interface Investigation:

- a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
- b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

9.1 GSM Tests Results

<Codec Investigation>

Codec	FR_V1	HR_V1	Orientation	Band / Channel
ABM 1 (dBA/m)	2.41	2.74		
ABM 2 (dBA/m)	-31.61	-33.28	Axial	CCM050 / 400
Signal Quality (dB)	34.02	36.02	Axiai	GSM850 / 189
Freq. Response	Pass	Pass		

Remark: According to codec investigation, the worst codec is FR_V1

<Air Interface Investigation>

Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response												
01	GSM850	Voice(speech	Voice(speech	Voice(speech	189	Axial (Z)	2.41	-31.61	34.02	T4	-50.35	2	PASS										
01	GSIVIOSO	codec handset low)	109	Transversal (Y)	-0.33	-38.86	38.53	T4	-50.25	2	1 733												
02	GSM1900	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	Voice(speech	664	Axial (Z)	5.00	-33.85	38.85	T4	-50.39	1.86	PASS
02	codec handset lov	661	Transversal (Y)	2.80	-37.31	40.11	T4	-50.29	1.00	PASS													

TEL: 886-3-327-3456 Page: 15 of 25 FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

9.2 UMTS Tests Results

<Codec Investigation>

Codec	AMR 4.75Kbps	AMR 7.95Kbps	AMR 12.2Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	2.42	3.92	4.31		
ABM 2 (dBA/m)	-39.79	-39.12	-38.01	Axial	Band 5 / 4182
Signal Quality (dB)	42.21	43.04	42.32	Axiai	Banu 5 / 4162
Freq. Response	Pass	Pass	Pass		

Report No.: HA881333-01B

Remark: According to codec investigation, the worst codec is AMR 4.75Kbps

<Air Interface Investigation>

Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position	dB	ABM2 dB (A/m)	~ ~ iii	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response					
03	WCDMA II	Voice (speech	9400	Axial (Z)	2.42	-39.79	42.21	T4	-50.32	1.07	PASS					
03	WCDIVIA II	codec low)	9400	Transversal (Y)	3.01	-39.82	42.83	T4	-50.21	1.07	FASS					
04	MCDMA IV	Voice (speech	1413	Axial (Z)	5.53	-38.03	43.56	T4	-50.36	1.63	PASS					
04	WCDMA IV	WCDMA IV	codec low)					1413	Transversal (Y)	3.98	-39.49	43.47	T4	-50.26	1.03	PASS
05	WCDMA V	Voice (speech codec low)	Voice (speech	Voice (speech	4182	Axial (Z)	6.17	-37.44	43.61	T4	-50.38	1.41	PASS			
05	05 WCDIVIA V		4102	Transversal (Y)	4.68	-38.80	43.48	T4	-50.26	1.41	PASS					

TEL: 886-3-327-3456 Page: 16 of 25 FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

10. T-Coil testing for CMRS IP Voice

10.1 VoLTE Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.

Report No.: HA881333-01B

- b. Select LTE FDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration, the observed variation is very little to be within 1.5 dB which is much less than the margin from the rating threshold.
- c. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

LTE FDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	3.8	0.18	4.45	1.2	1.83	1.18	1.15	1.78	1.07	1.56		
ABM 2 (dBA/m)	-38.36	-38.55	-36.47	-37.99	-37.49	-38.18	-38.03	-37.47	-38.49	-37.84		B25 / 20M
Signal Quality (dB)	42.16	38.73	40.92	39.19	39.32	39.36	39.18	39.25	39.56	39.4	Axial	/ 26340
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 17 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

<Air Interface Investigation>

,	Air Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B25	20	QPSK	1	0	26340	-0.04	-38.12	38.08
	LTE B25	20	QPSK	50	0	26340	0.08	-38.44	38.52
	LTE B25	20	QPSK	100	0	26340	0.49	-38.06	38.55
	LTE B25	20	16QAM	1	0	26340	0.64	-38.00	38.64
FDD	LTE B25	20	64QAM	1	0	26340	0.41	-38.22	38.63
FDD	LTE B25	15	QPSK	1	0	26340	0.38	-37.87	38.25
	LTE B25	10	QPSK	1	0	26340	-0.07	-38.39	38.32
	LTE B25	5	QPSK	1	0	26340	0.08	-38.33	38.41
	LTE B25	3	QPSK	1	0	26340	0.20	-38.13	38.33
	LTE B25	1.4	QPSK	1	0	26340	0.39	-37.97	38.36

Report No.: HA881333-01B

Plot No.	Air Interface	Modulation	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Kesponse	Frequency Response					
06	LTE Band 5	10M QPSK 1 0	20525	Axial (Z)	0.23	-38.73	38.96	T4	-50.33	1.62	PASS					
00	LTL Ballu 3	TOWI_QF3K_T_0	20323	Transversal (Y)	-1.66	-40.81	39.15	T4	-50.22	1.02	FASS					
07	LTE Band 7	20M QPSK 1 0	21100	Axial (Z)	-1.03	-38.15	37.12	T4	-50.31	1 51	DACC					
07	LIE Ballu 7	20W_Q1 3N_1_0	21100	Transversal (Y)	-3.38	-41.74	38.36	T4	-50.23	1.54	PASS					
08	LTE Band 12	10M_QPSK_1_0	10M ODSK 1 0	10M OPSK 1 0	23095	Axial (Z)	0.22	-38.01	38.23	T4	-50.34	2	PASS			
08	LIE Band 12		23095	Transversal (Y)	-1.61	-40.82	39.21	T4	-50.22	2	FASS					
09	LTC Dand 12	10M ODSK 1 0	22220	Axial (Z)	0.42	-37.82	38.24	T4	-50.36	4 57	PASS					
09	LTE Band 13	10M_QPSK_1_0	23230	Transversal (Y)	-1.94	-41.02	39.08	T4	-50.24	1.57	PASS					
10	LTE Band 25	20M_QPSK_1_0	2014 2721/ 4 2	0014 0701/ 4 0	0014 0001/ 4 0	0014 00014 4 0	- 1 05 00M 0D0K 1 0 000		Axial (Z)	0.18	-38.55	38.73	T4	-50.37	1.64	PASS
10	LIE Band 25		26340	Transversal (Y)	-2.89	-41.70	38.81	T4	-50.23	1.04	PASS					
11	LTE Band 66	S6 20M OPSK 1 0	2014 ODGK 4 0 4222	TE Bond 66 20M OBSK 1 0 1222	122222	Axial (Z)	-0.28	-38.72	38.44	T4	-50.30	30				
11	LTE Band 66 20M_QPSK_1_0	132322	Transversal (Y)	-2.67	-41.56	38.89	T4	-50.19	1.5	PASS						

TEL: 886-3-327-3456 Page: 18 of 25 FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

10.2 VoWiFi Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations
(WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It
is only necessary to document this for one channel/band, the following worst investigation codec would be remarked
to be used for the testing for the handset.

Report No.: HA881333-01B

- 2. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
 - b. Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
 - c. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	4.88	0.39	4.97	2.11	2.08	1.97	2.03	2.22	2.2	2.18		
ABM 2 (dBA/m)	-36.66	-37.29	-35.53	-36.59	-36.45	-36.49	-36.47	-36.6	-36.57	-36.04		2.4GHz
Signal Quality (dB)	41.54	37.68	40.5	38.7	38.53	38.46	38.5	38.82	38.77	38.22	Axial	WLAN / 6
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 19 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

<Air Interface Investigation>

Frequency Bands	Modulation	BW (MHz)	Data Rate	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	802.11b	20	1M	6	-0.20	-37.48	37.28
	802.11b	20	11M	6	0.35	-37.34	37.69
WLAN 2.4GHz	802.11g	20	6M	6	0.21	-37.44	37.65
WLAN 2.4GHZ	802.11g	20	54M	6	0.02	-37.44	37.46
	802.11n-HT20	20	MCS0	6	-0.07	-37.37	37.30
	802.11n-HT20	20	MCS7	6	0.39	-37.41	37.80
	802.11a	20	6M	40	-1.36	-39.51	38.15
	802.11a	20	54M	40	-1.05	-39.57	38.52
	802.11an-HT20	20	MCS0	40	-1.14	-39.55	38.41
	802.11an-HT20	20	MCS7	40	-1.26	-39.48	38.22
	802.11an-HT40	40	MCS0	38	-1.05	-39.36	38.31
WLAN 5GHz	802.11an-HT40	40	MCS7	38	-0.87	-39.44	38.57
WLAN 5GHZ	802.11ac-VHT20	20	MCS0	40	-0.78	-39.41	38.63
	802.11ac-VHT20	20	MCS8	40	-1.10	-39.37	38.27
	802.11ac-VHT40	40	MCS0	38	-1.19	-39.45	38.26
	802.11ac-VHT40	40	MCS8	38	-0.96	-39.37	38.41
	802.11ac-VHT80	80	MCS0	50	-1.08	-39.40	38.32
	802.11ac-VHT80	80	MCS8	50	-1.07	-39.35	38.28

Report No.: HA881333-01B

Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Variation	Frequency Response										
12	WLAN2.4GHz	802.11b 1Mbps	6	Axial (Z)	0.39	-37.29	37.68	T4	-50.31	1.39	PASS										
12	WLAINZ.4GHZ	602.11b Tivibps	0	Transversal (Y)	-2.65	-39.71	37.06	T4	-50.21	1.59	PASS										
13	WLAN5GHz	802.11a 6Mbps	40	Axial (Z)	-0.94	-39.48	38.54	T4	-50.33	1.74	PASS										
13	WLANSGHZ	602.11a divibps	40	Transversal (Y)	-2.56	-41.17	38.61	T4	-50.25	1.74	1 700										
14	WLAN5GHz	000 44 - CMb	902 11a 6Mbna	802.11a 6Mbps	60	Axial (Z)	-1.63	-39.67	38.04	T4	-50.36	1.55	PASS								
14	WLANSGHZ	602.11a divibps	60	Transversal (Y)	-2.46	-40.94	38.48	T4	-50.22	1.55	PASS										
15	WLAN5GHz	000 44 - 0141	000 44 - 014	000 44 - 000-	000 44 - 014	000 44 - 014	000 44 - 0Mb	202 11a CMbaa	902 44a 6Mbna	802.11a 6Mbps	202 11a 6Mbna	902 11a 6Mbpa	124	Axial (Z)	0.14	-38.15	38.29	T4	-50.34	1.67	PASS
15	WLANSGEZ	602.11a bivibps	124	Transversal (Y)	-2.26	-40.83	38.57	T4	-50.26	1.07	PASS										
16	MI ANECHA	/LAN5GHz 802.11a 6Mbps	M/I ANECH 202 110 6Mbps	157	Axial (Z)	0.21	-38.29	38.50	T4	-50.37	4 77	DACC									
16	WLANSGHZ		157	Transversal (Y)	-2.61	-41.19	38.58	T4	-50.24	1.77	PASS										

TEL: 886-3-327-3456 Page: 20 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

11. T-Coil testing for OTT VoIP Application

General Notes:

- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.
- 2. The google Duo VoIP application are pre-installed on this device. According to KDB 285076 D02, all air interfaces via a data connection with VoIP application need to be considered HAC testing.

Report No.: HA881333-01B

- 3. The Google Duo only support OPUS audio codec and support 6Kbps to 75Kbps bitrate.
- 4. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 5. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 6. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VoLTE and VoWiFi test results of air interface investigation, the worst configuration and frequency band of air interface was used for OTT T-Coil testing.
 - -LTE FDD worst configuration and band: LTE Band 7/20MHz/QPSK/1RB Size
 - -WLAN2.4GHz worst configuration: 802.11b /1Mbps
 - -WLAN5GHz worst configuration and Band: WLAN 5.3GHz /11a/6Mbps

<Codec Investigation>

EDGE

Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	3.33	3.94	3.79		
ABM 2 (dBA/m)	-35.08	-34.17	-33.22	- Axial	0011050 / 400
Signal Quality (dB)	38.41	38.11	37.01		GSM850 / 189
Freq. Response	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 21 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

SPORTON LAB. HAC T-COIL TEST REPORT

HSPA

Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	Orientation	Band / Channel		
ABM 1 (dBA/m)	3.75	4.75	5.68				
ABM 2 (dBA/m)	-40.42	-38.47	-36.63		LIMTO DO / 0400		
Signal Quality (dB)	44.17	43.22	42.31	Axial	UMTS B2 / 9400		
Freq. Response	Pass	Pass	Pass				

Report No.: HA881333-01B

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

LTE FDD

Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	Orientation	Band / Channel	
ABM 1 (dBA/m)	6.55	7.18	6.81			
ABM 2 (dBA/m)	-38.11	-35.97	-35.08	Audal	D7 / 20M / 244 00	
Signal Quality (dB)	44.66	43.15	41.89	Axial	B7 / 20M / 21100	
Freq. Response	Pass	Pass	Pass			

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

WLAN

Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	Orientation	Band / Channel	
ABM 1 (dBA/m)	6.3	7.06	7.1			
ABM 2 (dBA/m)	-36.52	-35.26	-34.45		WLAN2.4G / 6	
Signal Quality (dB)	42.82	42.32	41.55	Axial	WLANZ.4G / 6	
Freq. Response	Pass	Pass	Pass			

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 22 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	~ ~ u.,	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
17	17 GSM850	EDGE 2 Tx Slots	189	Axial (Z)	3.79	-33.22	37.01	T4	-50.20	1.96	PASS
17	G3101630			Transversal (Y)	2.52	-37.82	40.34	T4	-50.29		
10	18 GSM1900 EDGE 2 Tx S	EDOE 0 Ty Clata	661	Axial (Z)	4.02	-35.00	39.02	T4	-50.31	1.97	PASS
10		EDGE 2 1X 31018	001	Transversal (Y)	2.64	-37.46	40.10	T4	-50.22		
19	WCDMA II HSPA	9400	Axial (Z)	5.68	-36.63	42.31	T4	-50.25	1.98	PASS	
19	WCDIVIA II	HOFA	9400	Transversal (Y)	1.83	-39.91	41.74	T4	-50.26	1.96	FASS
20	WCDMA IV HSPA	1413	Axial (Z)	5.42	-37.39	42.81	T4	-50.22	2	PASS	
20	WCDIVIA IV	ПЭГА	1413	Transversal (Y)	1.45	-41.16	42.61	T4	-50.29		PASS
21	21 WCDMA V	HSPA	4182	Axial (Z)	5.49	-36.59	42.08	T4	-50.27	1.92	PASS
21	WCDIVIA V	ПЭГА	4102	Transversal (Y)	2.01	-40.01	42.02	T4	-50.23	1.92	
22	22 LTE Band 7	20M_QPSK_1_0	21100	Axial (Z)	6.81	-35.08	41.89	T4	-50.25	1.91	PASS
22				Transversal (Y)	2.81	-38.49	41.30	T4	-50.23		
22	23 WLAN2.4GHz	802.11b 1Mbps	6	Axial (Z)	7.10	-34.45	41.55	T4	-50.29	1.82	PASS
23				Transversal (Y)	4.86	-32.98	37.84	T4	-50.22		
24	24 WLAN5GHz	802.11a 6Mbps	60	Axial (Z)	6.20	-32.84	39.04	T4	-50.28	1.77	PASS
24				Transversal (Y)	4.08	-34.11	38.19	T4	-50.22		

Report No.: HA881333-01B

Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- 2. The detail frequency response results please refer to appendix A.
- 3. Test Engineer: Steven Chang Nick Yu and Galen Chang

TEL: 886-3-327-3456 Page: 23 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

12. <u>Uncertainty Assessment</u>

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2. The judgment of conformity in the report is based on the measurement results excluding the measurement uncertainty.

Report No.: HA881333-01B

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)	
Probe Sensitivity								
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %	
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %	
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %	
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %	
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %	
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %	
Probe System								
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %	
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %	
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %	
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %	
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %	
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %	
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %	
		Test Siç	gnal					
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %	
		Position	ning					
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %	
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %	
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %	
External Contributions								
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %	
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %	
Combined Standard Uncertainty							± 6.1 %	
Coverage Factor for 95 %						K = 2		
	Expanded	Uncertainty				± 8.1 %	± 12.3 %	

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 24 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018

13. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA881333-01B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 25 of 25
FAX: 886-3-328-4978 Issued Date: Dec. 12, 2018