



FCC Test Report

FOR:

**3SI Security Systems
Model Name: AT140704US**

**Product Description:
Asset Tracking and Alert Device**

FCC ID: Q6KAT140704A

47 CFR Part 90

**TEST REPORT #: EMC-3SISE-038-14001_FCC_90
DATE: 2014-12-03**



**FCC listed:
A2LA Accredited
IC recognized #
3462B-1**

CETECOM Inc.

411 Dixon Landing Road ♦ Milpitas, CA 95035 ♦ U.S.A.

Phone: + 1 (408) 586 6200 ♦ Fax: + 1 (408) 586 6299 ♦ E-mail: info@cetecomusa.com ♦ <http://www.cetecom.com>

CETECOM Inc. is a Delaware Corporation with Corporation number: 2113686
Board of Directors: Dr. Harald Ansorge, Dr. Klaus Matkey, Hans Peter May


Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

TABLE OF CONTENTS

1 Assessment _____ **3**

2 Administrative Data _____ **4**

2.1 Identification of the Testing Laboratory Issuing the EMC Test Report _____ **4**

2.2 Identification of the Client _____ **4**

2.3 Identification of the Manufacturer _____ **4**

3 Equipment under Test (EUT) _____ **5**

3.1 Specification of the Equipment under Test _____ **5**

3.2 Identification of the Equipment Under Test (EUT) _____ **6**

3.3 Identification of Accessory equipment _____ **6**

4 Subject Of Investigation _____ **7**

5 Measurements _____ **8**

5.1 Radiated Measurement Procedure _____ **8**

Maximum Peak Output Power _____ **9**

 5.1.1 References: _____ 9

 5.1.2 Limits _____ 9

 5.1.3 Test Result: _____ 9

 5.1.4 Test Plot _____ 10

5.2 Occupied Bandwidth _____ **11**

 5.2.1 References: _____ 11

 5.2.2 Limits: _____ 11

 5.2.3 Measurement Method. _____ 11

 5.2.4 Test Result: _____ 11

 5.2.5 Test Data/plots: _____ 12

5.3 Modulation Characteristics _____ **13**

5.4 Transmit Spectrum Mask _____ **13**

 5.4.1 Transmit Spectrum Mask FCC Part 90 _____ 13

5.5 Frequency Tolerance _____ **15**

 5.5.1 219.6 MHz Beacon _____ 15

 5.5.2 References: _____ 15

 5.5.3 Limits: _____ 15

 5.5.4 Results: _____ 15


5.6 Transmitter Spurious Emissions- Radiated _____ **16**

 5.6.1 219.6 MHz Beacon _____ 16

6 Equipment List _____ **19**

7 Block Diagrams _____ **20**

8 Revision History _____ **22**

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

1 Assessment.

The following device was evaluated against the applicable criteria specified in FCC rules Parts 90 of Title 47 of the Code of Federal Regulations and no deviations were ascertained during the course of the tests performed.

Company	Description	Model #
3SI Security Systems	Asset tracking and alert devices	AT140704US

This report is reviewed by:

Franz Engert
 2014-12-03 Compliance (Manager Compliance)


Date	Section	Name	Signature
------	---------	------	-----------

Responsible for the Report:

James Donnellan
 2014-12-03 Compliance (Senior EMC Test Engineer)

Date	Section	Name	Signature
------	---------	------	-----------

The test results of this test report relate exclusively to the test item specified in Section3. CETECOM Inc. USA does not assume responsibility for any conclusions and generalizations drawn from the test results with regard to other specimens or samples of the type of the equipment represented by the test item. The test report may only be reproduced or published in full. Reproduction or publication of extracts from the report requires the prior written approval of the CETECOM Inc USA.

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

2 Administrative Data

2.1 Identification of the Testing Laboratory Issuing the EMC Test Report


Company Name:	CETECOM Inc.
Department:	Compliance
Address:	411 Dixon Landing Road Milpitas, CA 95035 U.S.A.
Telephone:	+1 (408) 586 6200
Fax:	+1 (408) 586 6299
Responsible Test Lab Manager:	Franz Engert.
Responsible Project Leader:	James Devasia.

2.2 Identification of the Client

Applicant's Name:	3SI Security Systems
Street Address:	2055 N Brown Road, ste 225, Lawrenceville
City/Zip Code	GA 30043
Country	USA
Contact Person:	Waldemar Sierocinski
Phone No.	954-214-5398
Fax:	954-214-5398
e-mail:	Waldemar_Sierocinski@3sisecurity.com

2.3 Identification of the Manufacturer


Manufacturer's Name:	Same as above.
Manufacturers Address:	
City/Zip Code	
Country	

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

3 Equipment under Test (EUT)

3.1 Specification of the Equipment under Test

Marketing Name / Description:	Asset Tracking and Alert Device
Model Number:	AT140704US
FCC-ID :	Q6KAT140704A
IC Cert Number:	5043A-AT140704A
HW / SW Revision :	P2 / 12.1.18203
Product Description:	Asset Tracking and Alert Device equipped with 3G cellular radio module, beacon radio and GPS
Type(s) of Modulation:	no modulation, pulsed CW at 20% duty cycle, repetition rate 1 Hz
Frequency Range / number of channels:	1 channel, center at 219.6MHz, OBW: 6.25 KHz
Antenna info:	Internal, PCB trace loop antenna (around pcb perimeter)
Output Power:	ERP: -13.46 dBm
Other Radios	<ul style="list-style-type: none"> • 3G radio module GSM: 850/1900 & UMTS FDD: Band II/Band V • GPS 1575.42 MHz
Power supply	Battery Pack 3.7V DC;
operating temperature range	-20°C to 60°C
Prototype / Production unit	Prototype


Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

3.2 Identification of the Equipment Under Test (EUT)

EUT #	Serial Number	HW Version	SW Version	Notes	Cetecom ID
1	IMEI: 354676050448264	(P2)	12.1.18147	RT REVB # 7	-
2	IMEI 354676050452894	(P2)	12.1.18147	RT REVB #8	-
3	Support Board	-	N/A	AEBP1#69	-

3.3 Identification of Accessory equipment

AE #	Type	PN	Notes
1	3.7 V Li-ion Battery Pack	52010556 T	
4	GPS/GSM Multi Band Combo Antenna	S/N 0018110	-

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

4 Subject Of Investigation

The objective of the evaluation documented in this report was to assess if the performance of the EUT meets the relevant requirements specified in FCC rules Part 90 of Title 47 of the Code of Federal Regulations.

This test report is to support a request for new equipment authorization under the FCC ID: Q6KAT140704A


All testing was performed on the product samples referred to in Section 3 as EUT.

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM™
Date :	2014-12-03		

5 Measurements

5.1 Radiated Measurement Procedure


Ref: TIA-603C 2004 -2.2.17.2 Effective Radiated Power (ERP) or Effective Isotropic Radiated Power (EIRP)

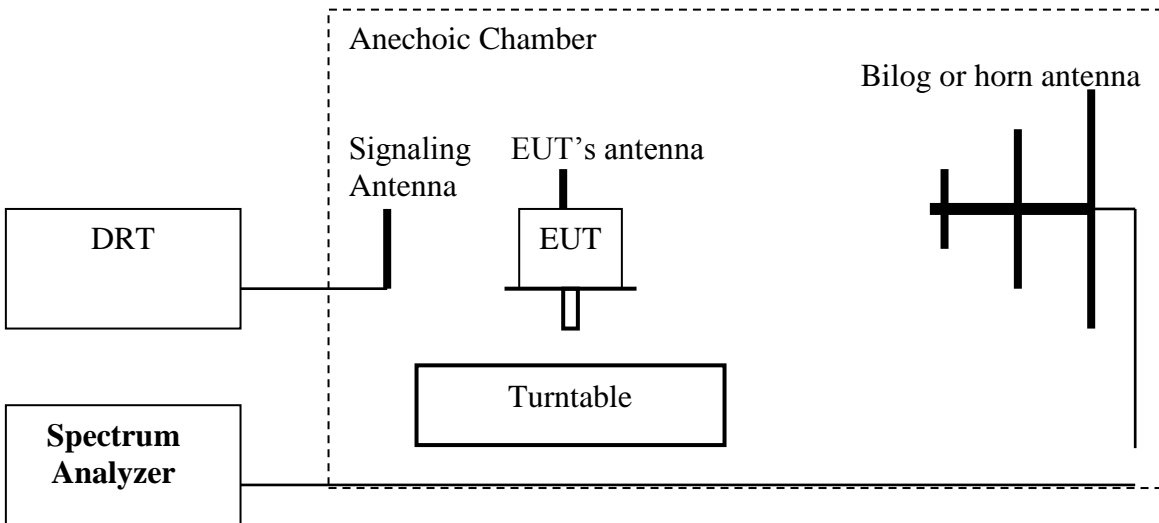

1. Connect the equipment as shown in the above diagram with the EUT's antenna in a vertical orientation.
2. Configure the EUT to its maximum power at the required channel.
3. Set the spectrum analyzer to the channel frequency. Set the analyzer to measure peak hold with the required settings.
4. Rotate the EUT 360°. Find the peak level
5. With EUT in peak Level position from step 4, adjust the antenna height to get peak power level in dBm (LVL). Replace the EUT with a vertically polarized half wave dipole or known gain antenna. The center of the antenna should be at the same location as the center of the EUT's antenna.
6. Connect the antenna to a signal generator with known output power and record the path loss in dB (**LOSS**). **LOSS** = Generator Output Power (dBm) – Analyzer reading (dBm).
7. Determine the ERP using the following equation:

$$\mathbf{ERP\ (dBm) = LVL\ (dBm) + LOSS\ (dB)}$$
8. Determine the EIRP using the following equation:

$$\mathbf{EIRP\ (dBm) = ERP\ (dBm) + 2.14\ (dB)}$$
9. Measurements are to be performed with the EUT set to the low, middle and high channels.
Spectrum analyzer settings: RBW=VBW=3MHz

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

Maximum Peak Output Power

5.1.1 References:

FCC: Part 90.205; 90.259

5.1.2 Limits

FCC CFR 90.259(a): 2W, Class C

Test Conditions:

Tnom: 22.3 °C; Vnom


5.1.3 Test Result:


Frequency (MHz)	Max Peak Output Power- Conducted (dBm)	Radiated ERP (dBm)
219.6	N/A	-13.46
Measurement Uncertainty: ±3dB		

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM TM <small>ESTABLISHED 1987</small>
Date :	2014-12-03		

5.1.4 Test Plot

ERP 219.6 MHz Beacon.

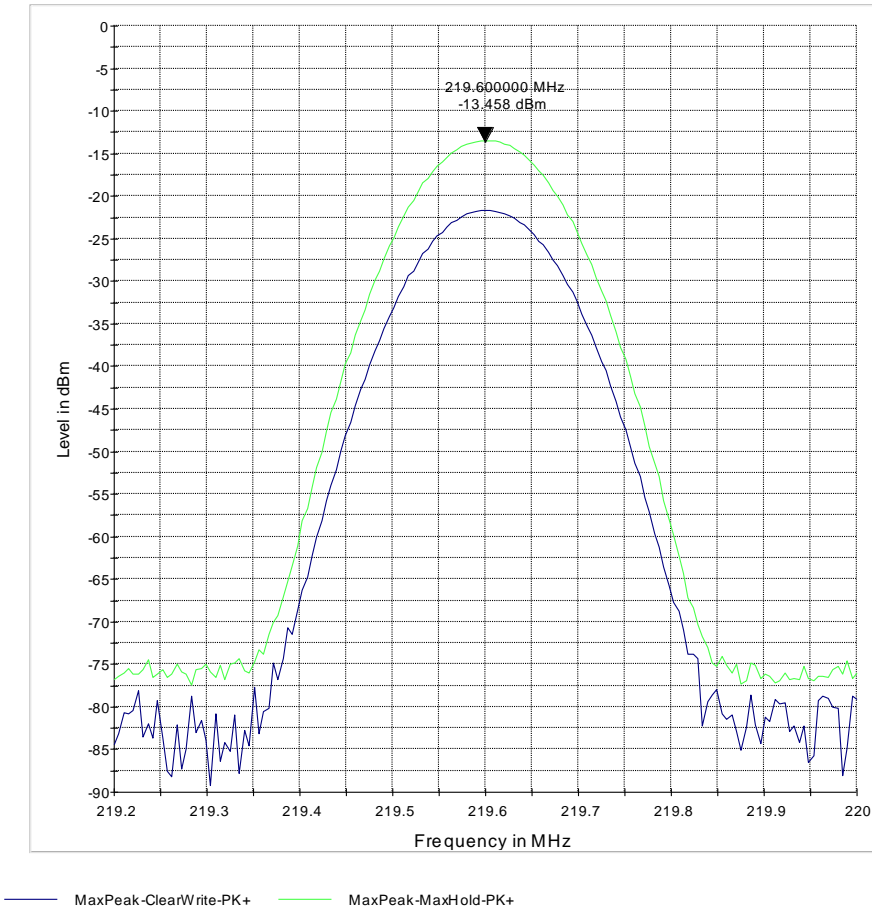

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

5.2 Occupied Bandwidth

5.2.1 References:

FCC: 2.1049, 90.209, 90.259(8)

5.2.2 Limits:

According to CFR 47 section 90.209, operations using equipment designed to operate with a 6.25 kHz channel bandwidth, the authorized bandwidth is 6 kHz.

According to CFR 47 section 90.259(8), assignable 6.25 kHz channels will occur in increment of 6.25kHz from 217.00625 MHz to 219.99375MHz.

5.2.3 Measurement Method.


The beacon was set to 100% duty cycle and max power setting.
Analyzer setting as depicted in the plot.

5.2.4 Test Result:


Channel	Frequency (MHz)	99% Occupied Bandwidth in Hz	26 dB Emission Bandwidth in Hz
1	219.6	21.8	29.4 Hz

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM™
Date :	2014-12-03		

5.2.5 Test Data/plots: Occupied Bandwidth 219.6 MHz Beacon

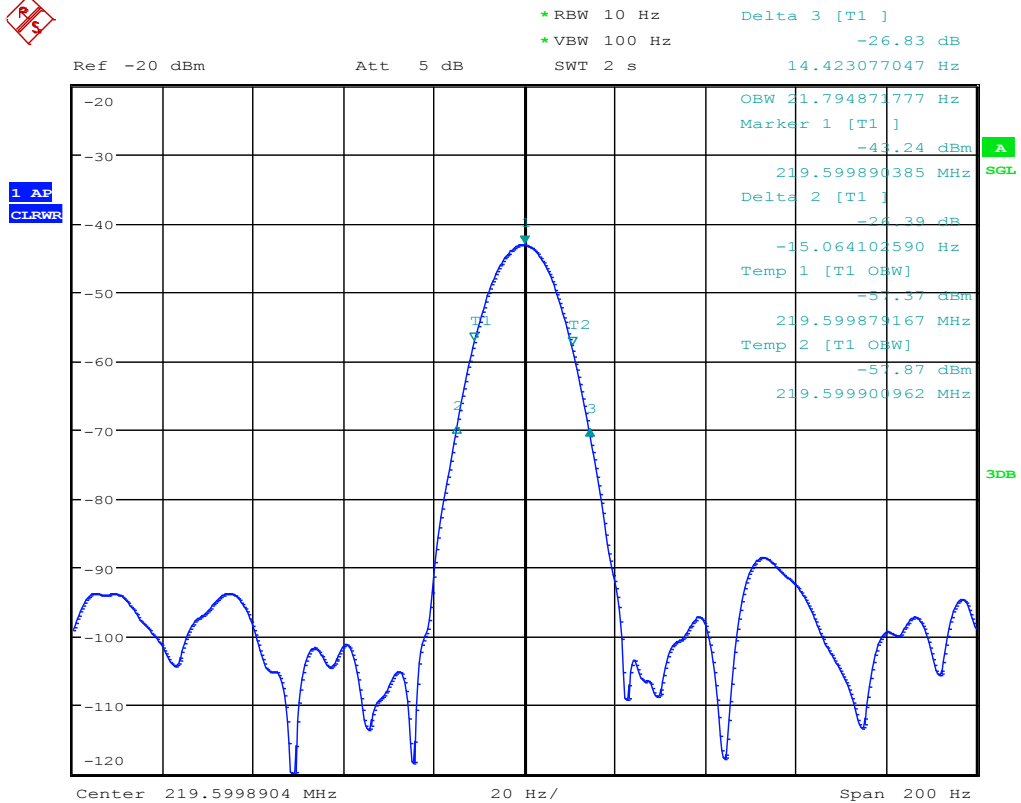

Date: 4.DEC.2014 18:01:14

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

5.3 Modulation Characteristics

In 100% duty cycle mode there is no modulation apparent on the 219.6 MHz Beacon.

5.4 Transmit Spectrum Mask

5.4.1 Transmit Spectrum Mask FCC Part 90

5.4.1.1 References:

FCC: 90.210,

5.4.1.2 Limits:


According to CFR 47 section 90.210c, the power of each unwanted emission shall be less than Transmitted Power as specified below:

- 1) On any frequency removed from the center of the authorized bandwidth by a displacement frequency (f_d in KHz) of more than 5 KHz, but not more than 10KHz: At least $83 \log (f_d/5)$ dB.
- 2) On any frequency removed from the center of the authorized bandwidth by a displacement frequency (f_d in KHz) by more than 10KHz, but not more than 250 percent of the authorized bandwidth: At least $29 \log (f_d^2/11)$ dB or 50dB, which is the lesser attenuation;
- 3) At least $43+10 \log_{10} (TP)$ dB on any frequency removed from the center of the authorized bandwidth by more than 250 percent.

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM™
Date :	2014-12-03		


5.4.1.3 Test Plot

219.6 MHz Beacon with 100% duty cycle setting.

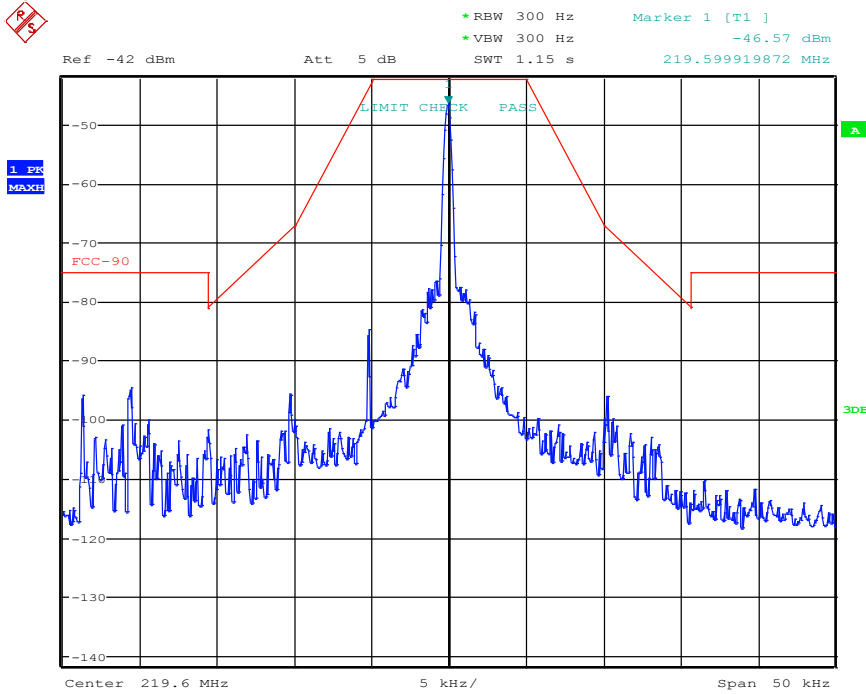

low

Date: 4.NOV.2014 16:20:22

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

5.5 Frequency Tolerance

5.5.1 219.6 MHz Beacon

5.5.2 References:

FCC: 2.1055, 90.213

5.5.3 Limits:

+/- 1 ppm

5.5.4 Results:

219.6 (MHz) Beacon	Measured Frequency (MHz)	Frequency Error (MHz)	Frequency Error (ppm)
Nominal Battery	219.5999281	7.1876E-05	-0.327304189
3.15 V	219.5999323	6.7688E-05	-0.308233151
4.25 V	219.599943	5.6987E-05	-0.259503643

Temperature °C	Measured Frequency (MHz)	Frequency Error (Hz)	Frequency Error (ppm)
50	219.5999148	8.52E-05	-0.387978142
40	219.5999048	9.52E-05	-0.433515483
30	219.5999115	8.852E-05	-0.403096539
20	219.5999498	5.02E-05	-0.22859745
10	219.5999617	3.828E-05	-0.17431694
0	219.6000096	-9.6E-06	0.043715847
-10	219.6000526	-5.26E-05	0.239526412
-20	219.6000718	-7.176E-05	0.326775956

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM™
Date :	2014-12-03		

5.6 Transmitter Spurious Emissions- Radiated

5.6.1 219.6 MHz Beacon


5.6.1.1 References

FCC: CFR Part 2.1053, 90.215

5.6.1.2 Test Result:

Horizontal and Vertical Polarizations, Worst case for all channels


5.6.1.2.1 Test Results 9 KHz – 30 MHz

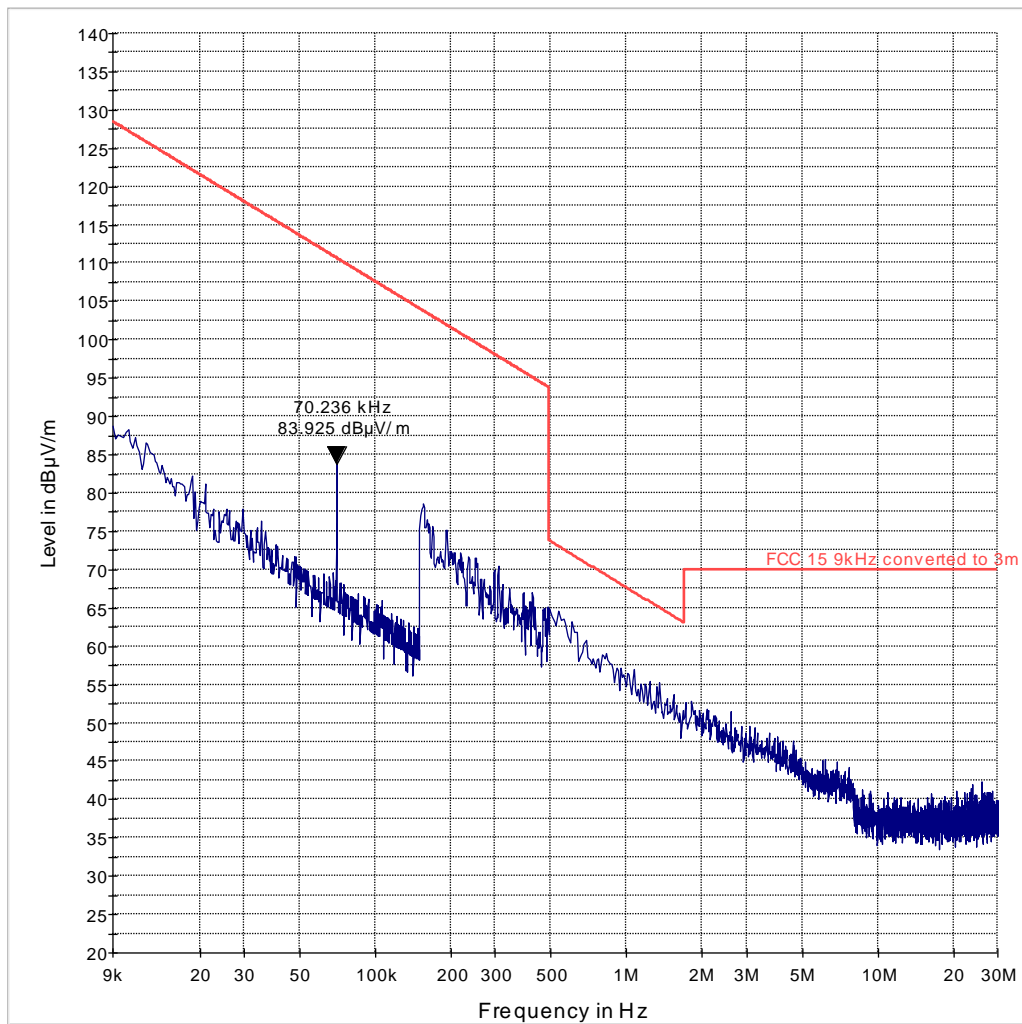

— FCC 15 9kHz converted to 3m — Preview Result 1-PK+

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM™
Date :	2014-12-03		


5.6.1.2.2 Test Result 30 MHz - 1 GHz:

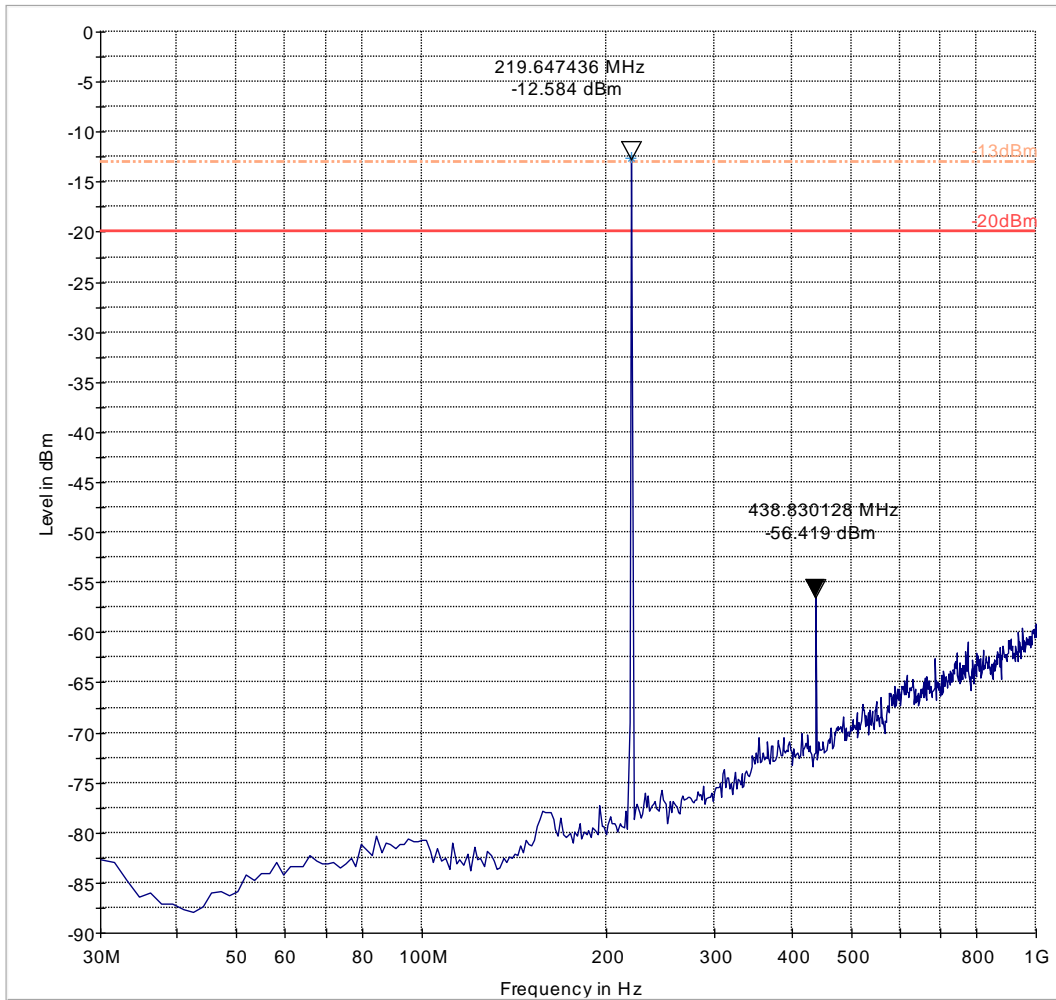


— -20dBm
— Preview Result 1-PK+
- - - -13dBm.LimitLine
* Data Reduction Result 1 [2]-PK+

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM TM
Date :	2014-12-03		

5.6.1.2.3 Test Result 1 GHz – 6 GHz:

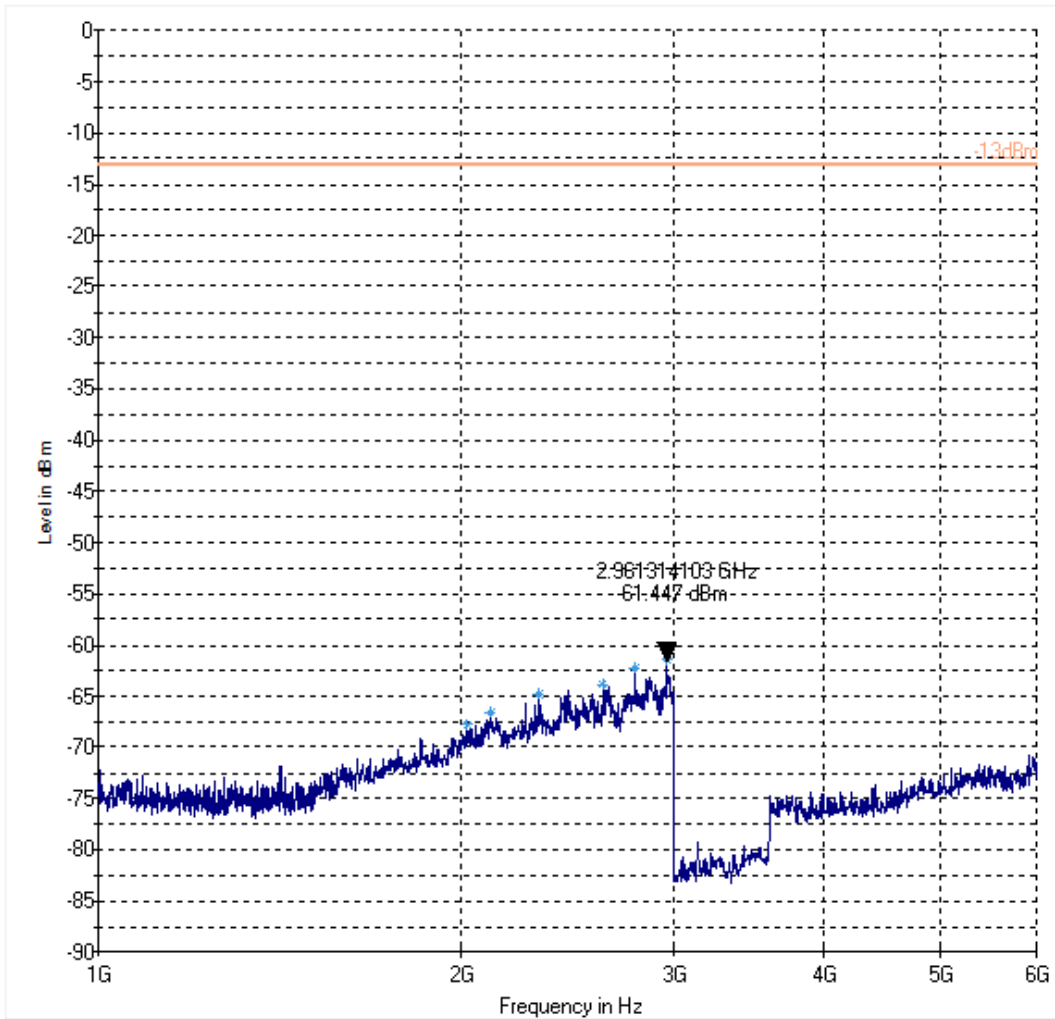

— -13dBm — Preview Result 1-PK+ + Data Reduction Result 1 [3]-PK+

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

6 Equipment List


No.	Equipment Name	Manufacturer	Type/model	Serial No.	Cal Date	Cal Interval
3m Semi- Anechoic Chamber:						
	Turn table	EMCO	2075	N/A	N/A	N/A
	MAPS Position Controller	ETS Lindgren	2092	0004-1510	N/A	N/A
	Antenna Mast	EMCO	2075	N/A	N/A	N/A
	Relay Switch Unit	Rohde&Schwarz	RSU	338964/001	N/A	N/A
	EMI Receiver/Analyzer	Rohde&Schwarz	ESU 40	100251	Sep 2013	2 Year
	1500MHZ HP Filter	Filtek	HP12/1700	14c48	N/A	N/A
	2800 MHZ HP Filter	Filtek	HP12/2800	14C47	N/A	N/A
	Pre-Amplifier	Miteq	JS40010260	340125	N/A	N/A
	Binconilog Antenna	EMCO	3141	0005-1186	Apr 2012	3 Years
	Horn Antenna	EMCO	3115	35114	Mar 2012	3 Years
Ancillary equipment						
	Spectrum Analyzer	Rohde&Schwarz	FSU	200256	Jun 2013	2 Years
	Multimeter	Klein Tools	MM200	CET-0002	Oct 2013	1 Years
	Vector Signal Generator	Rohde&Schwarz	SMU200A	101935	Feb 2013	2 Years
	Signal Generator	Rohde&Schwarz	SMP04	100151	Jun 2013	2 Years
	Thermometer Humidity	Dickson	SM320	09309168	Jul 2014	1 Year
	Temperature Chamber	Test Equity	115	150384	N/A	N/A
	DC Power Supply	HP	E3610A	KR83023316	N/A	N/A

Equipment used meets the measurement uncertainty requirements as required per applicable standards for 95% confidence levels. Calibration due dates, unless defined specifically, falls on the last day of the month. Items indicated "N/A" for cal status either do not specifically require calibration or is internally characterized before use

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM™
Date :	2014-12-03		


7 Block Diagrams


30M-1GHz Measurements Setup.

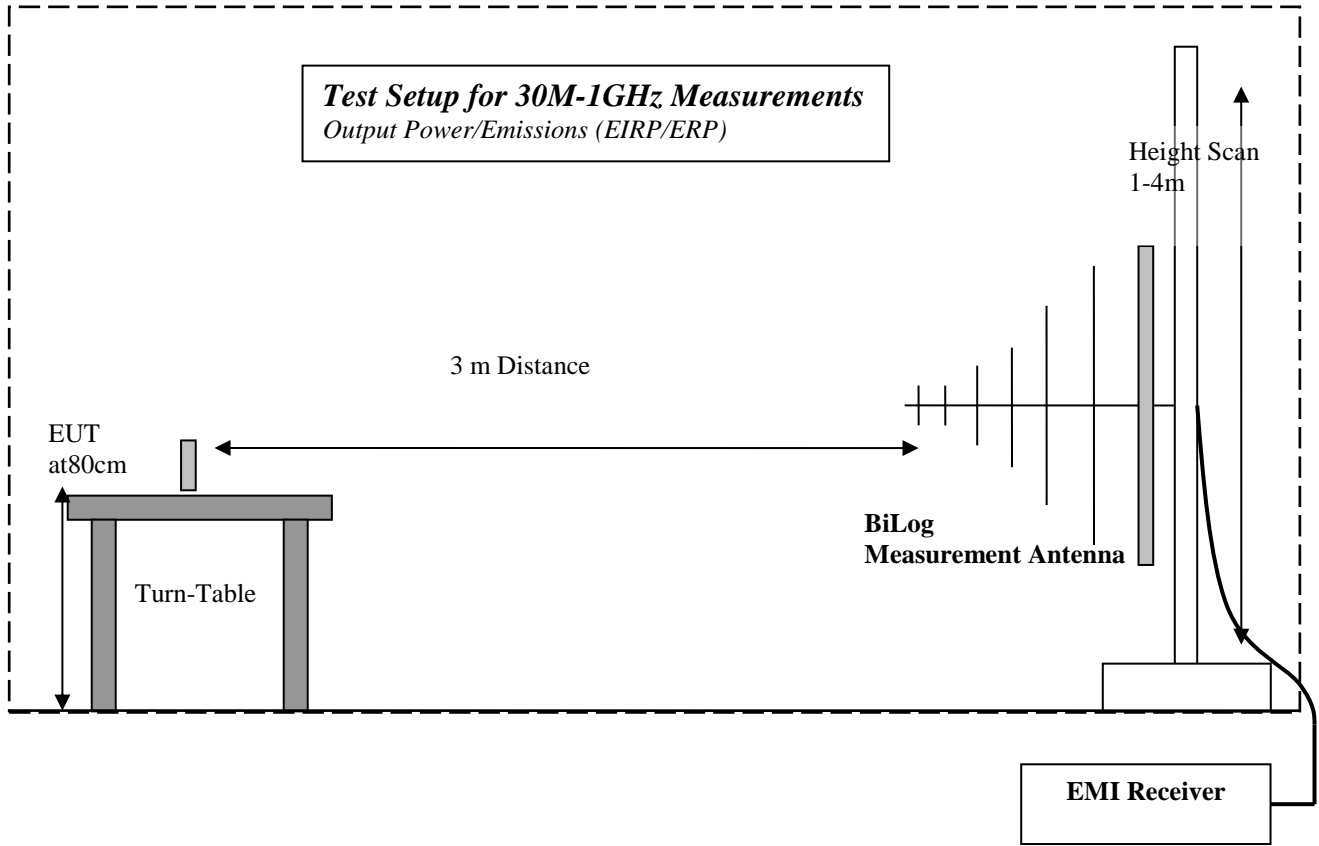

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	CETECOM™
Date :	2014-12-03		

1GHz – 18 GHz Measurements Setup

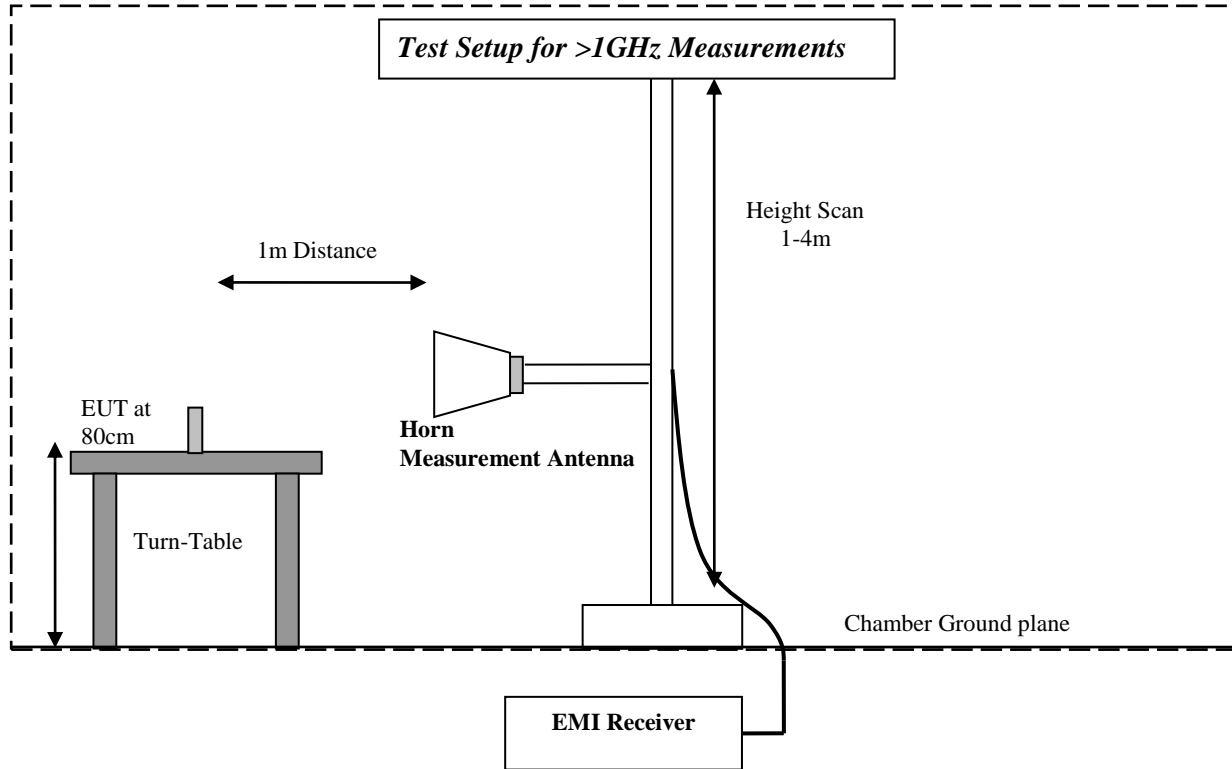

Report #:	EMC-3SISE-038-14001-ATM_FCC_90	FCC ID: Q6KAT140704A	
Date :	2014-12-03		

8 Revision History

Date	Report Name	Changes to report	Report prepared by
2014-12-03	EMC-3SISE-038-14001-ATM_FCC90	First official version	James Donnellan