



849 NW State Road 45  
Newberry, FL 32669 USA  
Phone: 888.472.2424 or  
352.472.5500  
Email: [info@timcoengr.com](mailto:info@timcoengr.com)  
Website: [www.timcoengr.com](http://www.timcoengr.com)

## FCC PART 15.109 RADAR DETECTOR REPORT

<b>Applicant</b>	BELTRONICS USA INC.
<b>Address</b>	5442 WEST CHESTER ROAD WEST CHESTER OH 45069
<b>Product Model Number</b>	BEL GT-1
<b>Product Description</b>	RADAR DETECTOR WITH BLUETOOTH MODULE
<b>FCC ID:</b>	QL4G1S5
<b>Date Sample Received</b>	04/17/2018
<b>Date Tested</b>	05/16/2018
<b>Tested By</b>	Tim Royer
<b>Approved By</b>	Franklin Rose

Report Number	Version Number	Description	Issue Date
529BUT18TestReport	Rev1	Initial Issue	05/16/2018

**THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL  
WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.**

## Table of Contents

GENERAL REMARKS .....	3
GENERAL INFORMATION .....	4
TEST RESULTS SUMMARY.....	4
RADIATED SPURIOUS EMISSIONS.....	5
Test Data: 11.7 – 12.2 GHz 3 Meter Field Strength.....	7
Test Data: 11.7 – 12.2 GHz 3 Meter Field Strength.....	8
TEST EQUIPMENT LIST .....	9

## GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

## Summary

The device under test does:

- Fulfill the general approval requirements as identified in this test report and was selected by the customer.
- Not fulfill the general approval requirements as identified in this test report

## Attestations

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025 requirements.

I attest that the necessary measurements were made at:

**Timco Engineering Inc.**  
**849 NW State Road 45**  
**Newberry, FL 32669**



Sr. EMC Engineer  
EMC-003838-NE



## Tested by

Name and Title: Tim Royer, Project Manager/Testing Engineer

**Date: 05/16/2018**



## Reviewed and approved by:

Name and Title: Franklin Rose, Project Manager/Testing Engineer

**Date: 05/17/2018**

## GENERAL INFORMATION

<b>EUT Description</b>	RADAR DETECTOR WITH BLUETOOTH MODULE
<b>FCC ID</b>	QL4GIS5
<b>Model Number</b>	BEL GT-1
<b>Operating Frequency</b>	10.525 GHz (X-Band); 24.150 GHz (K-Band); 33.4-36.0 GHz (Ka Band)
<b>EUT Power Source</b>	<input type="checkbox"/> 110–120Vac/50– 60Hz
	<input checked="" type="checkbox"/> DC Power 12V
	<input type="checkbox"/> Battery Operated Exclusively
<b>Test Item</b>	<input type="checkbox"/> Prototype
	<input checked="" type="checkbox"/> Pre-Production
	<input type="checkbox"/> Production
<b>Type of Equipment</b>	<input type="checkbox"/> Fixed
	<input checked="" type="checkbox"/> Mobile
	<input type="checkbox"/> Portable
<b>Test Conditions</b>	Temperature: 24-26°C Relative humidity: 50-65% Barometric Pressure: 30.01"
<b>Modification to the EUT</b>	None
<b>Test Exercise</b>	The EUT was operated in a normal mode.
<b>Applicable Standards</b>	FCC Pt 15.109
<b>Test Procedure</b>	ANSI C63.4: 2014
<b>Test Facility</b>	Timco Engineering Inc. at 849 NW State Road 45 Newberry, FL 32669 USA. Designation #: US1070

## TEST RESULTS SUMMARY

<b>FCC Rules Part No.</b>	<b>RESULTS Pass/Fail/NA</b>
15.109 Radiated Emissions	Pass

## RADIATED SPURIOUS EMISSIONS

Rules Part No.: 15.109

### Requirements:

Frequency	Limits
11.7 to 12.2GHz	54.0 dB $\mu$ V/m measured @ 3 meters

**Test Procedure:** Measurements in the 11.7 to 12.2GHz band were made with a Standard Gain Horn. The measurements in the 11.7 to 12.2GHz band represent the ambient noise levels. The attached plots were made with peak detector with the analyzer in a maximum hold for 2 minutes.

Testing was done in accordance with the standard list above & 15.35(b) specifies the use of an average detector in this band. In addition, the peak level of an emission shall not exceed the average limit by more than 20 dB using a minimum Resolution Bandwidth (RBW) of 1 MHz and minimum Video Bandwidth (VBW) OF 1 MHz. The following procedure is designed to determine if there are any spurious emissions from the local oscillator within the band of interest along with any additional spurious emissions caused by other circuitry within the device.

- 1) Determine the frequency of the peak emission:  
 Start Frequency 11.7 GHz  
 Stop Frequency 12.2 GHz  
 RBW equal to or greater than 1 MHz  
 VBW equal to or greater than 1 MHz  
 Detector Function Peak  
 Maximize the emissions with regards to device orientation, antenna polarization, and antenna height. Sweep the band using Max Hold for a minimum of 2 minutes. Record this frequency for measuring the peak emission. In addition record the frequency of other spurious emissions noted.
  
- 2) Determine the peak level of the emission:  
 Center Frequency Set to the frequency determined in Step 1 RBW Equal to or greater than 1 MHz VBW Equal to or greater than 1 MHz Detector Function Peak  
 Measure the value of the peak emission using Max Hold for a minimum of 2 minutes. This can be done at zero spans or a frequency span where the analyzer does not show a "Measurement Uncalibrated" message. Record the peak value. If the peak measurement is compliant with the average limit an average measurement is not necessary. If the peak value exceeds the average limit by less than 20 dB proceed to Step 3.
  
- 3) Determine the average level of the emission:  
 Center Frequency Set to the frequency determined in Step 1  
 Span Zero  
 RBW Equal to or greater than 1 MHz  
 VBW Equal to or greater than 10 Hz  
 Detector Function Peak

## RADIATED SPURIOUS EMISSIONS

- 3) Continued: This measurement uses video averaging and must be done in linear mode. The analyzer Reference Level is adjusted so that a signal is clearly visible on the screen. Measure the value of the emission using Max Hold for a minimum of 2 minutes. Record this as the average value. Step 2 and Step 3 should be repeated for other spurious emissions.

**Formula of Conversion Factors:** The field strength at 3m was established by adding the meter reading of the spectrum analyzer (which is set to read in units of dBuV) to the antenna correction factor supplied by the antenna manufacturer. The antenna correction factors are stated in terms of dB. The gain of the preselector was accounted for in the spectrum analyzer meter reading.

### Example:


Freq (MHz)	Meter Reading	+ ACF	+CL	= FS
33	20 dBuV	+ 10.36 dB/m	+0.40 dB	=30.36 dBuV/m @ 3m

**MEASUREMENT PROCEDURES:** The unit under test was placed on a table 80 cm high and with dimensions of 1m by 1.5m. The table used for radiated measurements is capable of continuous rotation. When an emission was found, the table was rotated to produce the maximum signal strength. At this point, the antenna was raised and lowered from 1m to 4m. The antenna was placed in both the horizontal and vertical planes.

# RADIATED SPURIOUS EMISSIONS

## TEST DATA: 11.7 – 12.2 GHZ 3 METER FIELD STRENGTH

### 3 Meter Field Strength Plot:

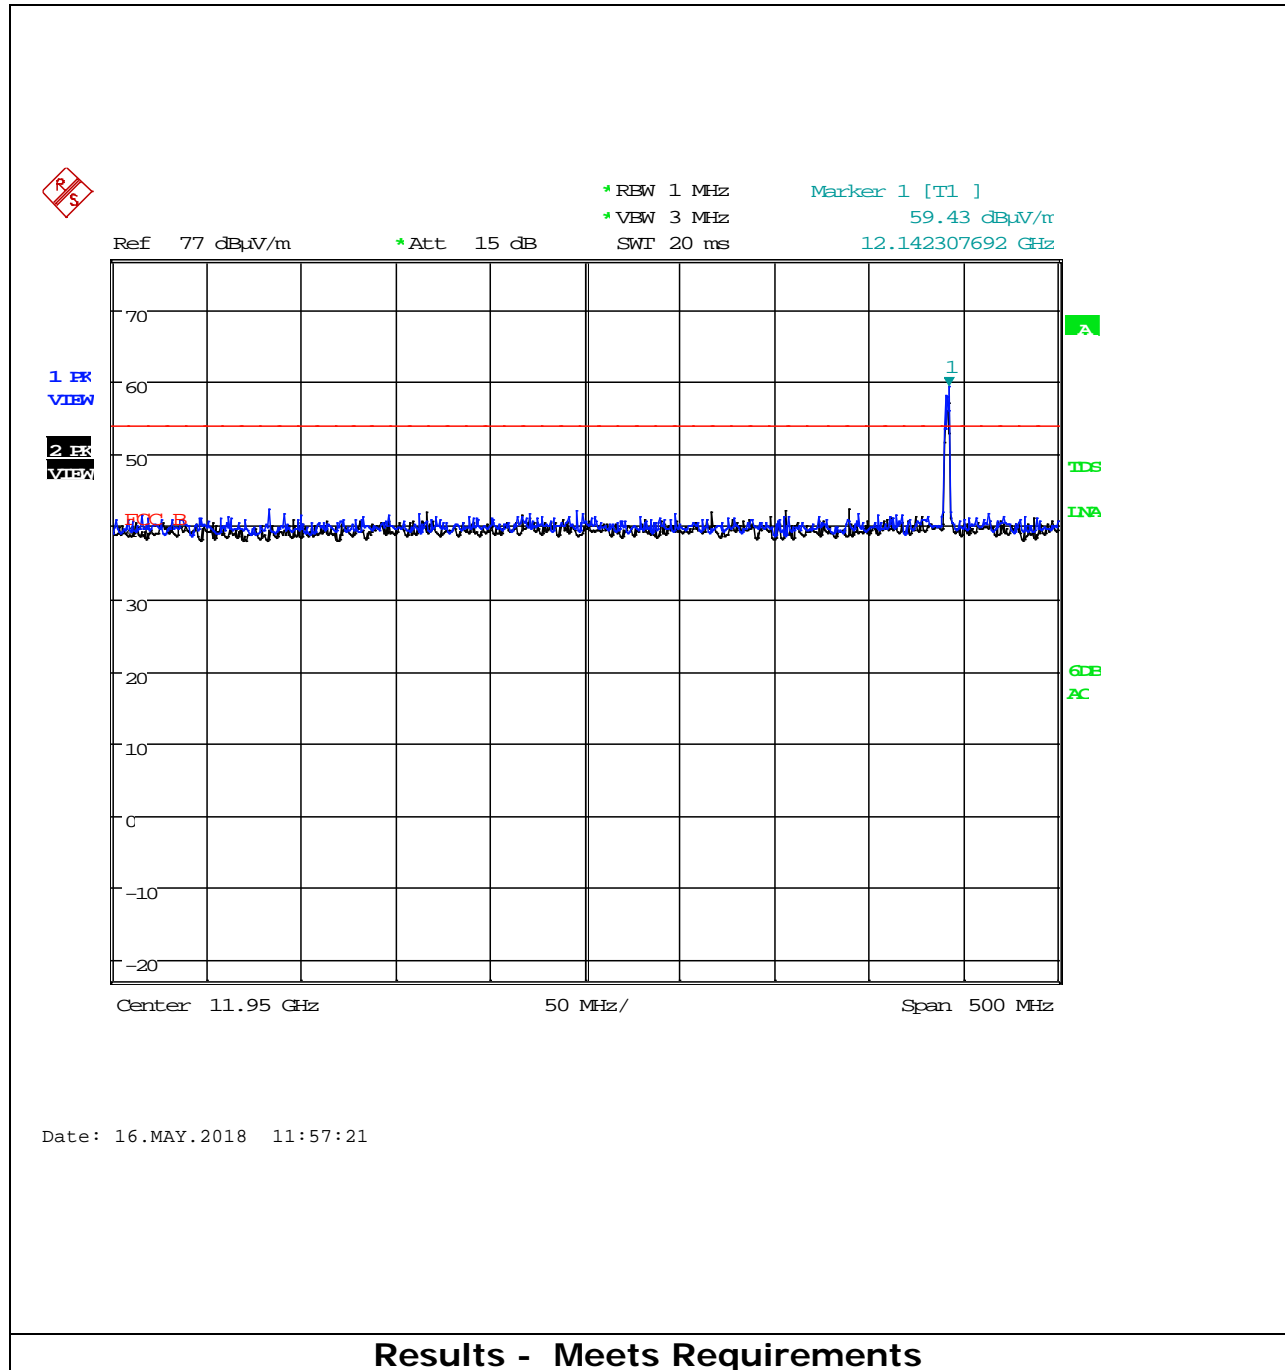


Ant Polarity: T1 (Blue) =Vertical, T2 (Black) =Horizontal

# RADIATED SPURIOUS EMISSIONS

## TEST DATA: 11.7 – 12.2 GHZ 3 METER FIELD STRENGTH

### 3 Meter Field Strength Vertical Zoomed Plot:

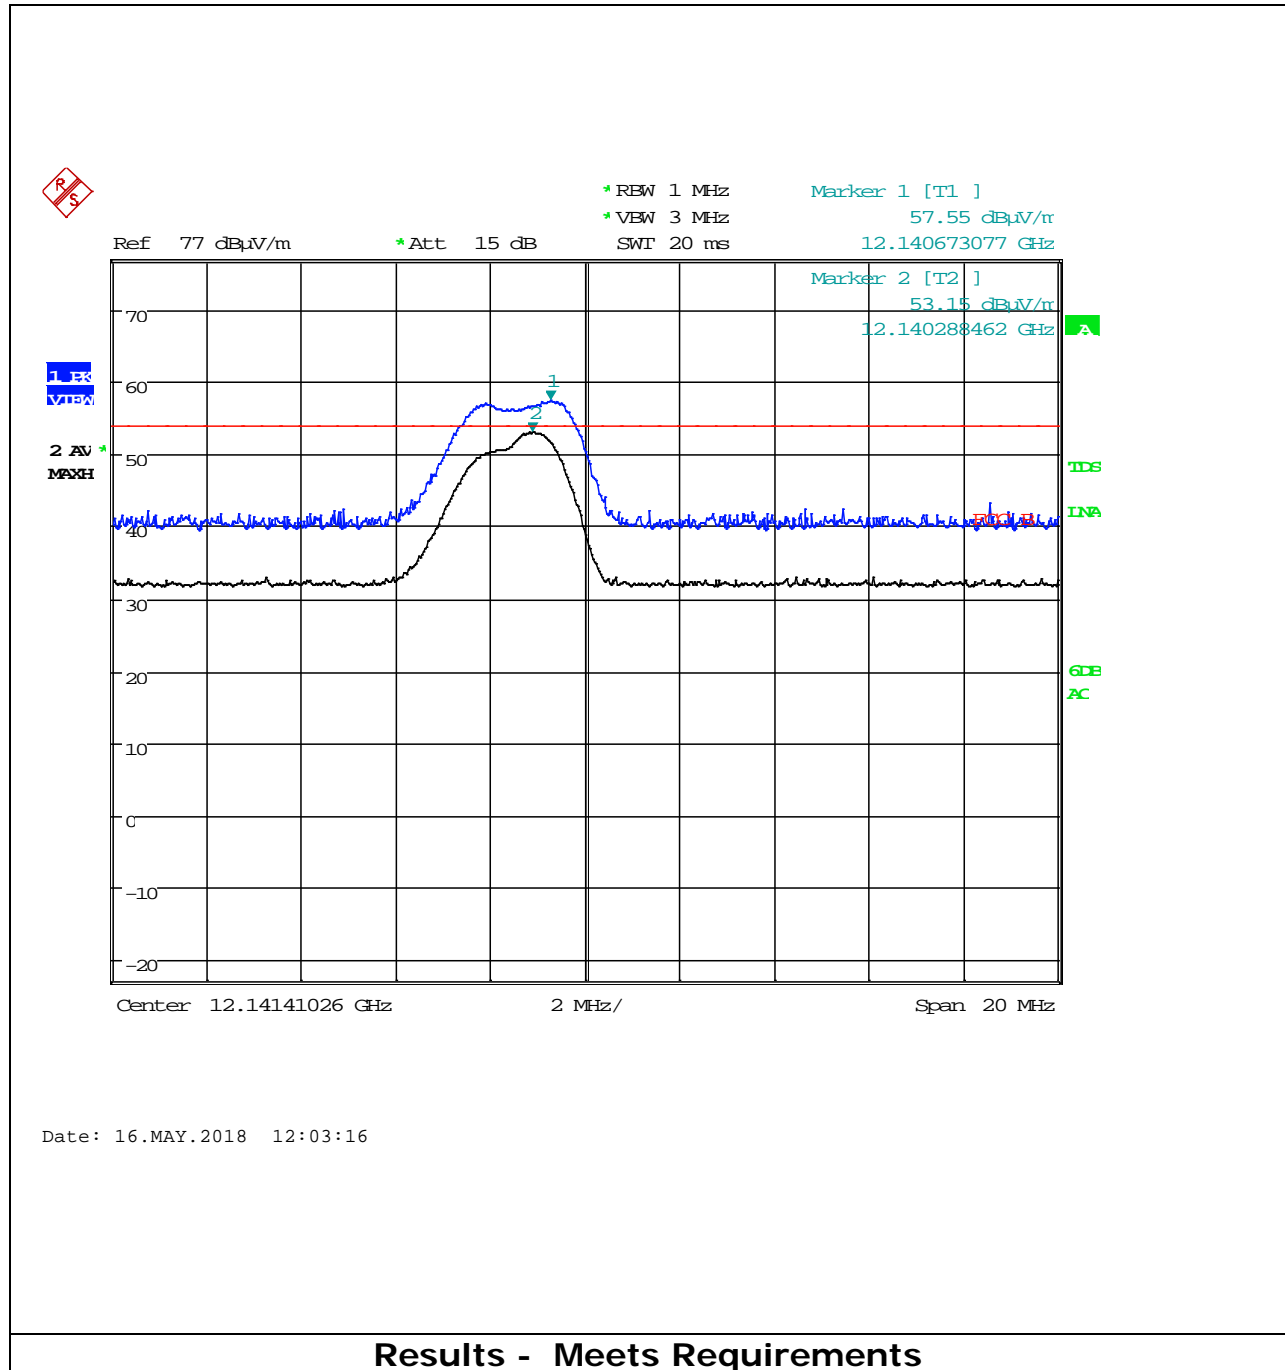

Ant Polarity: T1 (Blue) =Peak Trace, T2 (Black) =Average trace



## TEST EQUIPMENT LIST

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
DC Power Supply	HP	6286A	1744A03842	N/A	N/A
CHAMBER	Panashield	3M	N/A	12/31/17	12/31/19
Antenna: Double-Ridged Horn/ETS Horn 2	ETS-Lindgren	3117	00041534	03/01/17	03/01/19
Software: Field Strength Program	Timco	N/A	Version 4.10.7.0	N/A	N/A
EMI Test Receiver R & S ESU 40 Chamber	Rohde & Schwarz	ESU 40	100320	04/01/16	04/01/19
Coaxial Cable - Chamber 3 cable set (Primary)	Micro-Coax	Chamber 3 cable set (Primary)	KMKM-0244-01; KMKM-0670-00; KFKF-0198-01	08/09/16	08/09/18
Bore-sight Antenna Positioning Tower	Sunol Sciences	TLT2	N/A	N/A	N/A
Pre-amp	RF-LAMBDA	RLNA00M45GA	N/A	01/04/16	01/04/19

**\*EMI RECEIVER SOFTWARE VERSION:**

The receiver firmware used was version 4.43 Service Pack 3

**END OF REPORT**