

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE20)	Channel	185
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5826.4	63.06	-11.74	51.32	88.2	-36.88	PK
		5913.2	52.2	-11.74	40.46	68.2	-27.74	AVG
	@	6875	112.9	-11.74	101.16	N/A	N/A	PK
	@	6875	102.34	-11.74	90.6	N/A	N/A	AVG
		7170.4	63.33	-11.74	51.59	88.2	-36.61	PK
		7222.2	51.52	-11.74	39.78	68.2	-28.42	AVG
		13750	58.92	-11.74	47.18	88.2	-41.02	PK
		13750	52.23	-11.74	40.49	68.2	-27.71	AVG
Chain 1		5893.6	64.54	-11.74	52.8	88.2	-35.4	PK
		5896.4	51.88	-11.74	40.14	68.2	-28.06	AVG
	@	6875	109.5	-11.74	97.76	N/A	N/A	PK
	@	6875	100.78	-11.74	89.04	N/A	N/A	AVG
		7185.8	62.32	-11.74	50.58	88.2	-37.62	PK
		7202.6	51.7	-11.74	39.96	68.2	-28.24	AVG
		13750	59.38	-11.74	47.64	88.2	-40.56	PK
		13750	52.65	-11.74	40.91	68.2	-27.29	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

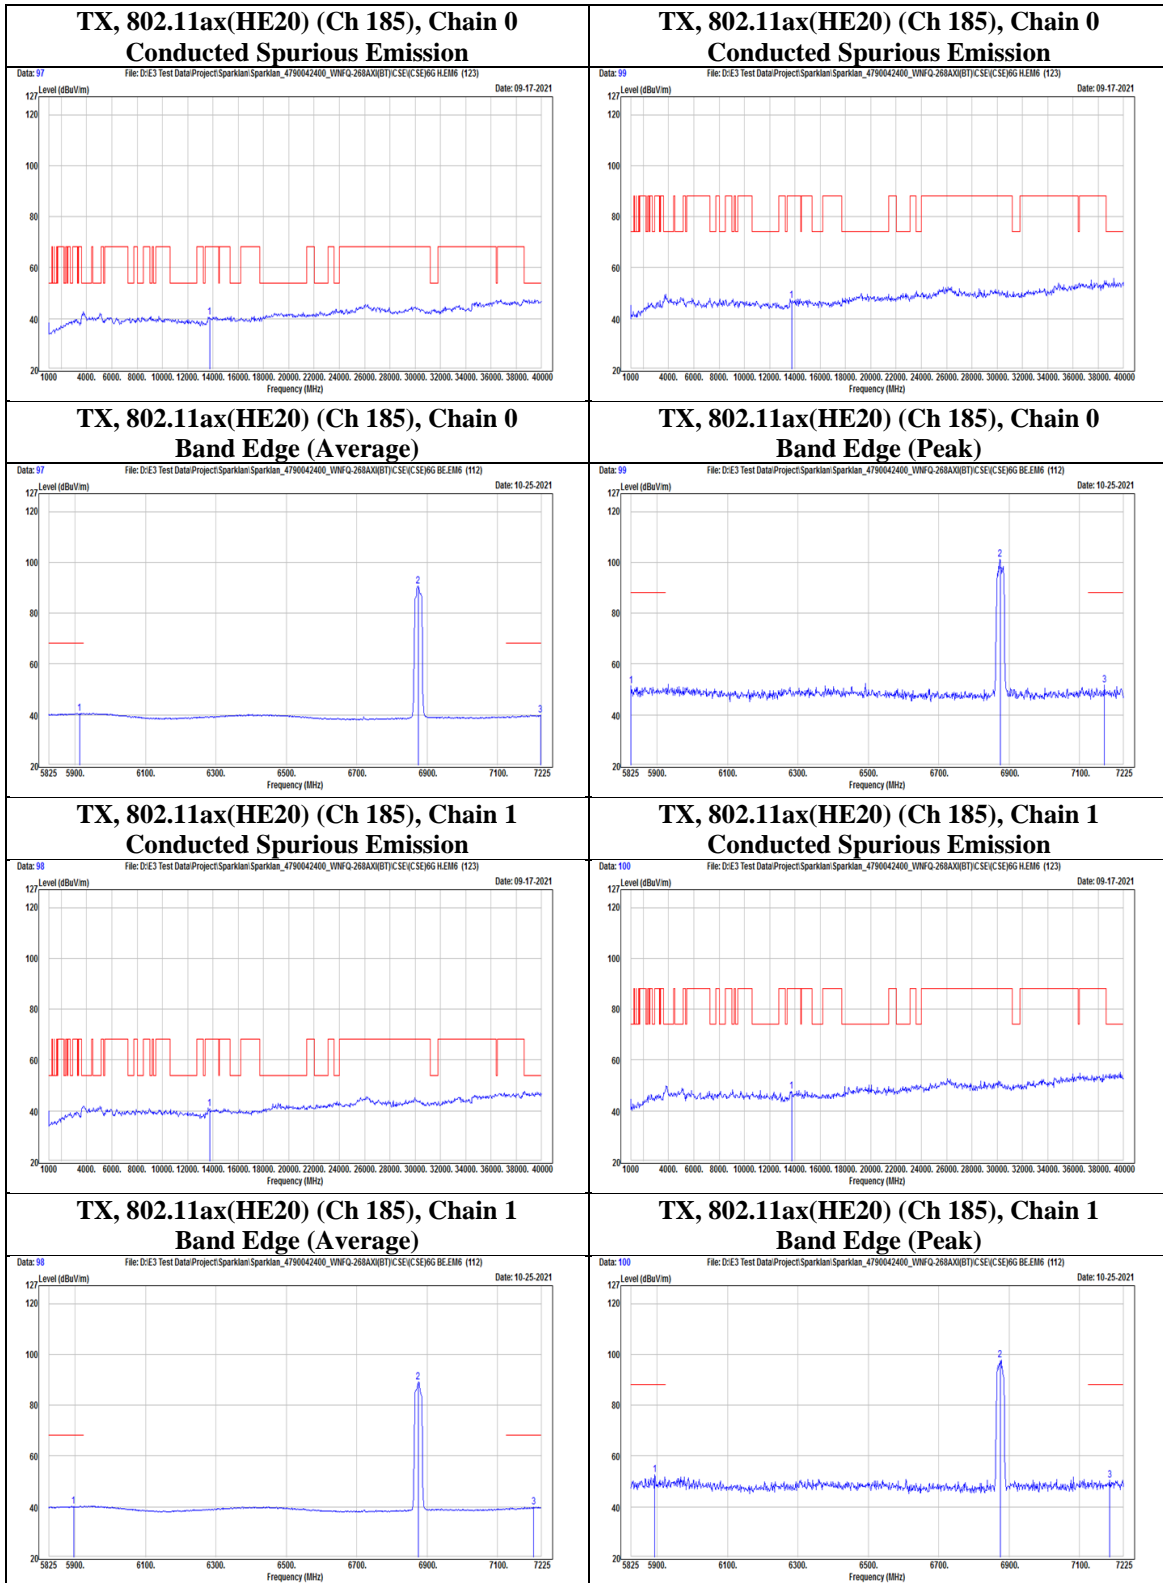



Test report No. : 4790042400-US-R2-V0
Page : 289 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	209
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	6995	114.01	-11.74	102.27	N/A	N/A	PK
	@	6995	102.48	-11.74	90.74	N/A	N/A	AVG
		7162	62.12	-11.74	50.38	88.2	-37.82	PK
		7202.6	51.5	-11.74	39.76	68.2	-28.44	AVG
		13990	58.13	-11.74	46.39	88.2	-41.81	PK
		13990	51.77	-11.74	40.03	68.2	-28.17	AVG
Chain 1	@	6995	109.05	-11.74	97.31	N/A	N/A	PK
	@	6995	100.5	-11.74	88.76	N/A	N/A	AVG
		7205.4	51.51	-11.74	39.77	68.2	-28.43	AVG
		7208.2	62.5	-11.74	50.76	88.2	-37.44	PK
		13990	58.7	-11.74	46.96	88.2	-41.24	PK
		13990	52.1	-11.74	40.36	68.2	-27.84	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

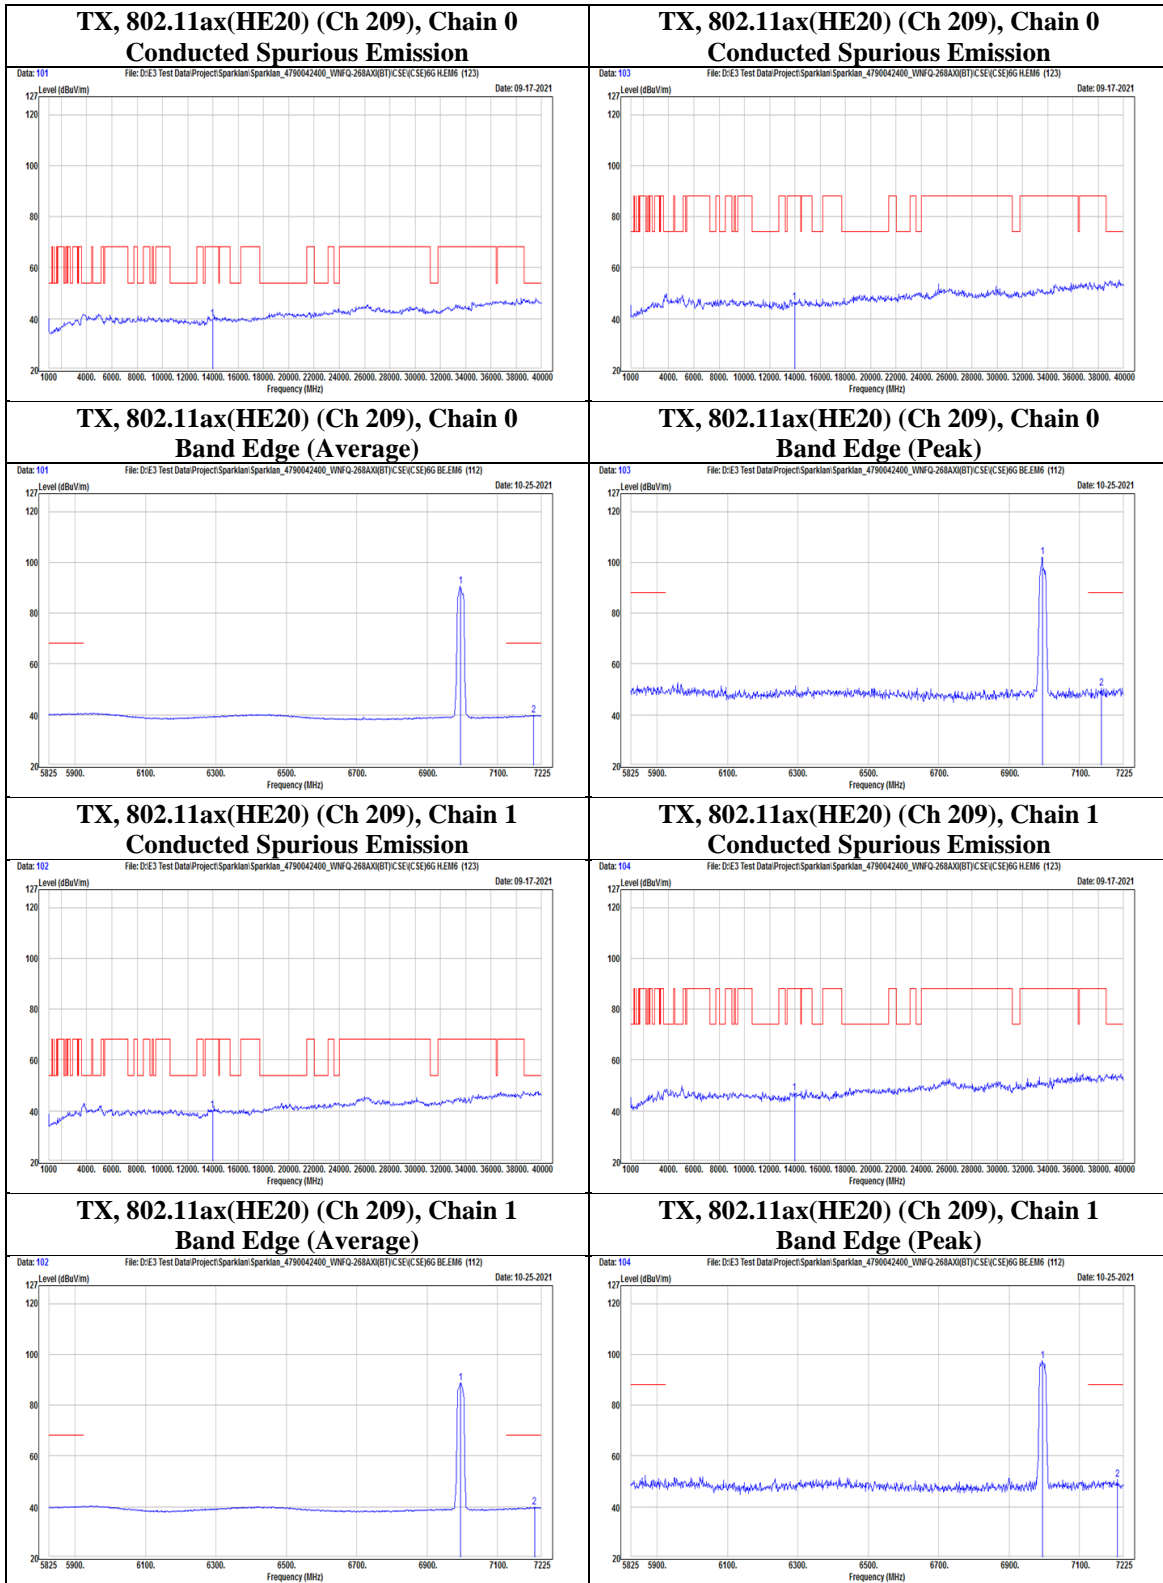

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 291 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	229
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	7095	111.65	-11.74	99.91	N/A	N/A	PK
	@	7095	102.44	-11.74	90.7	N/A	N/A	AVG
		7129.8	62.38	-11.74	50.64	88.2	-37.56	PK
		7206.8	51.57	-11.74	39.83	68.2	-28.37	AVG
		14190	58.78	-11.74	47.04	88.2	-41.16	PK
		14190	52.29	-11.74	40.55	68.2	-27.65	AVG
Chain 1	@	7095	110.71	-11.74	98.97	N/A	N/A	PK
	@	7095	100.56	-11.74	88.82	N/A	N/A	AVG
		7153.6	62.23	-11.74	50.49	88.2	-37.71	PK
		7216.6	51.61	-11.74	39.87	68.2	-28.33	AVG
		14190	58.87	-11.74	47.13	88.2	-41.07	PK
		14190	52.81	-11.74	41.07	68.2	-27.13	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

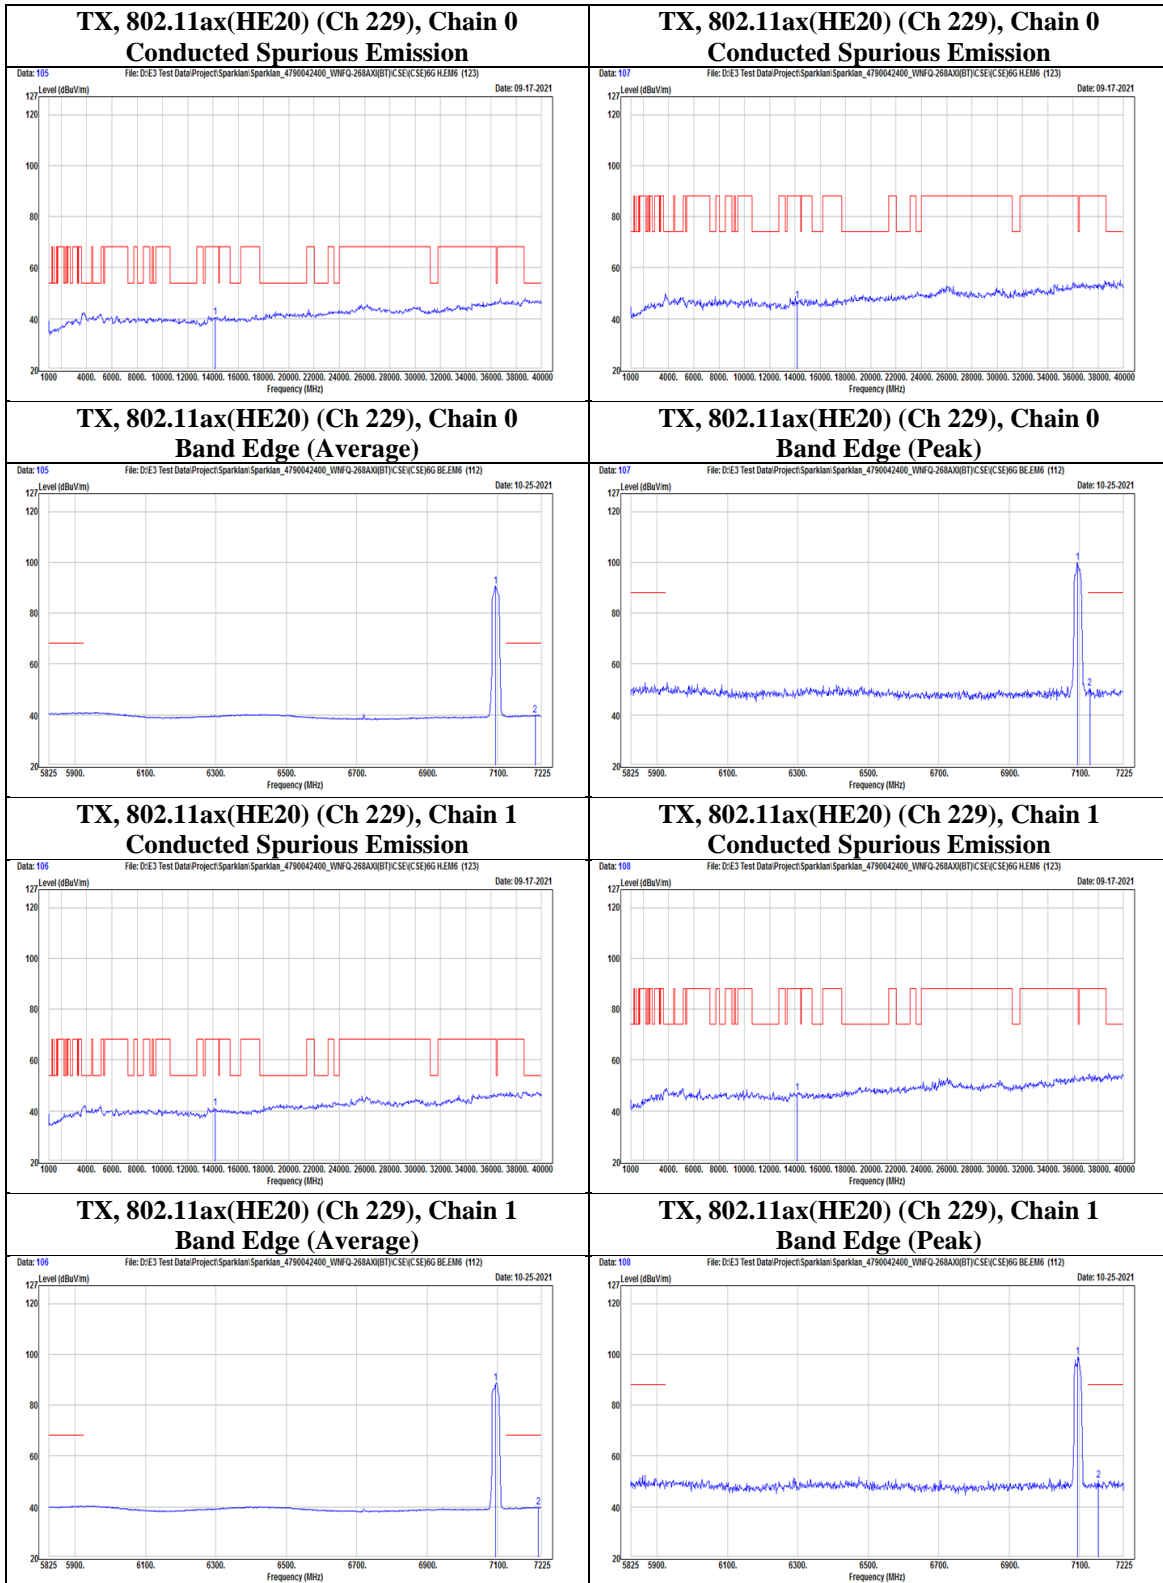



Test report No. : 4790042400-US-R2-V0
Page : 293 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	233
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	7115	113.06	-11.74	101.32	N/A	N/A	PK
	@	7115	102.48	-11.74	90.74	N/A	N/A	AVG
		7125	89.7	-11.74	77.96	88.2	-10.24	PK
		7125	72.95	-11.74	61.21	68.2	-6.99	AVG
		14230	59.35	-11.74	47.61	88.2	-40.59	PK
		14230	52.12	-11.74	40.38	68.2	-27.82	AVG
Chain 1	@	7115	108.8	-11.74	97.06	N/A	N/A	PK
	@	7115	100.36	-11.74	88.62	N/A	N/A	AVG
		7125	90.21	-11.74	78.47	88.2	-9.73	PK
		7125	73.65	-11.74	61.91	68.2	-6.29	AVG
		14230	59.19	-11.74	47.45	88.2	-40.75	PK
		14230	52.44	-11.74	40.7	68.2	-27.5	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

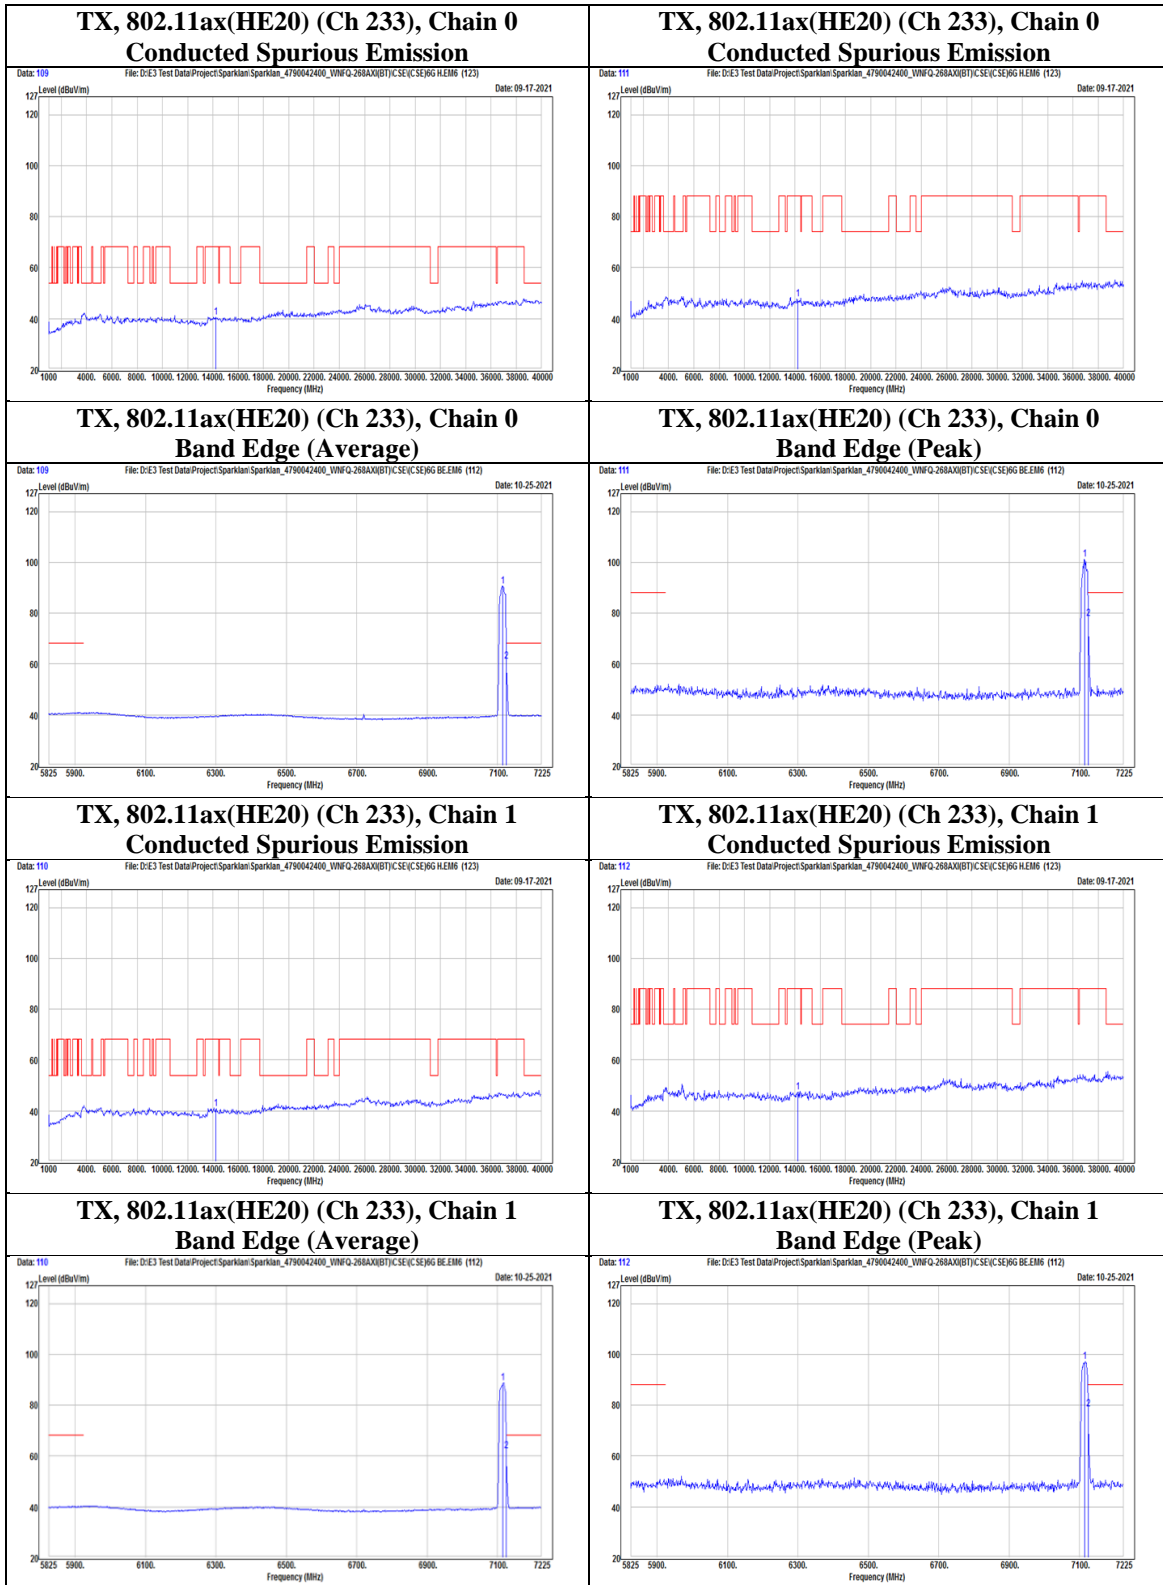



Test report No. : 4790042400-US-R2-V0
Page : 295 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	3
------	----------------	---------	---

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5916	63.47	-11.74	51.73	88.2	-36.47	PK
		5924.4	53.5	-11.74	41.76	68.2	-26.44	AVG
	@	5965	113.46	-11.74	101.72	N/A	N/A	PK
	@	5965	104.22	-11.74	92.48	N/A	N/A	AVG
		11930	57.72	-11.74	45.98	74	-28.02	PK
		11930	51.86	-11.74	40.12	54	-13.88	AVG
Chain 1		5920.2	52.58	-11.74	40.84	68.2	-27.36	AVG
		5923	63.47	-11.74	51.73	88.2	-36.47	PK
	@	5965	108.78	-11.74	97.04	N/A	N/A	PK
	@	5965	99.92	-11.74	88.18	N/A	N/A	AVG
		11930	58.34	-11.74	46.6	74	-27.4	PK
		11930	51.38	-11.74	39.64	54	-14.36	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

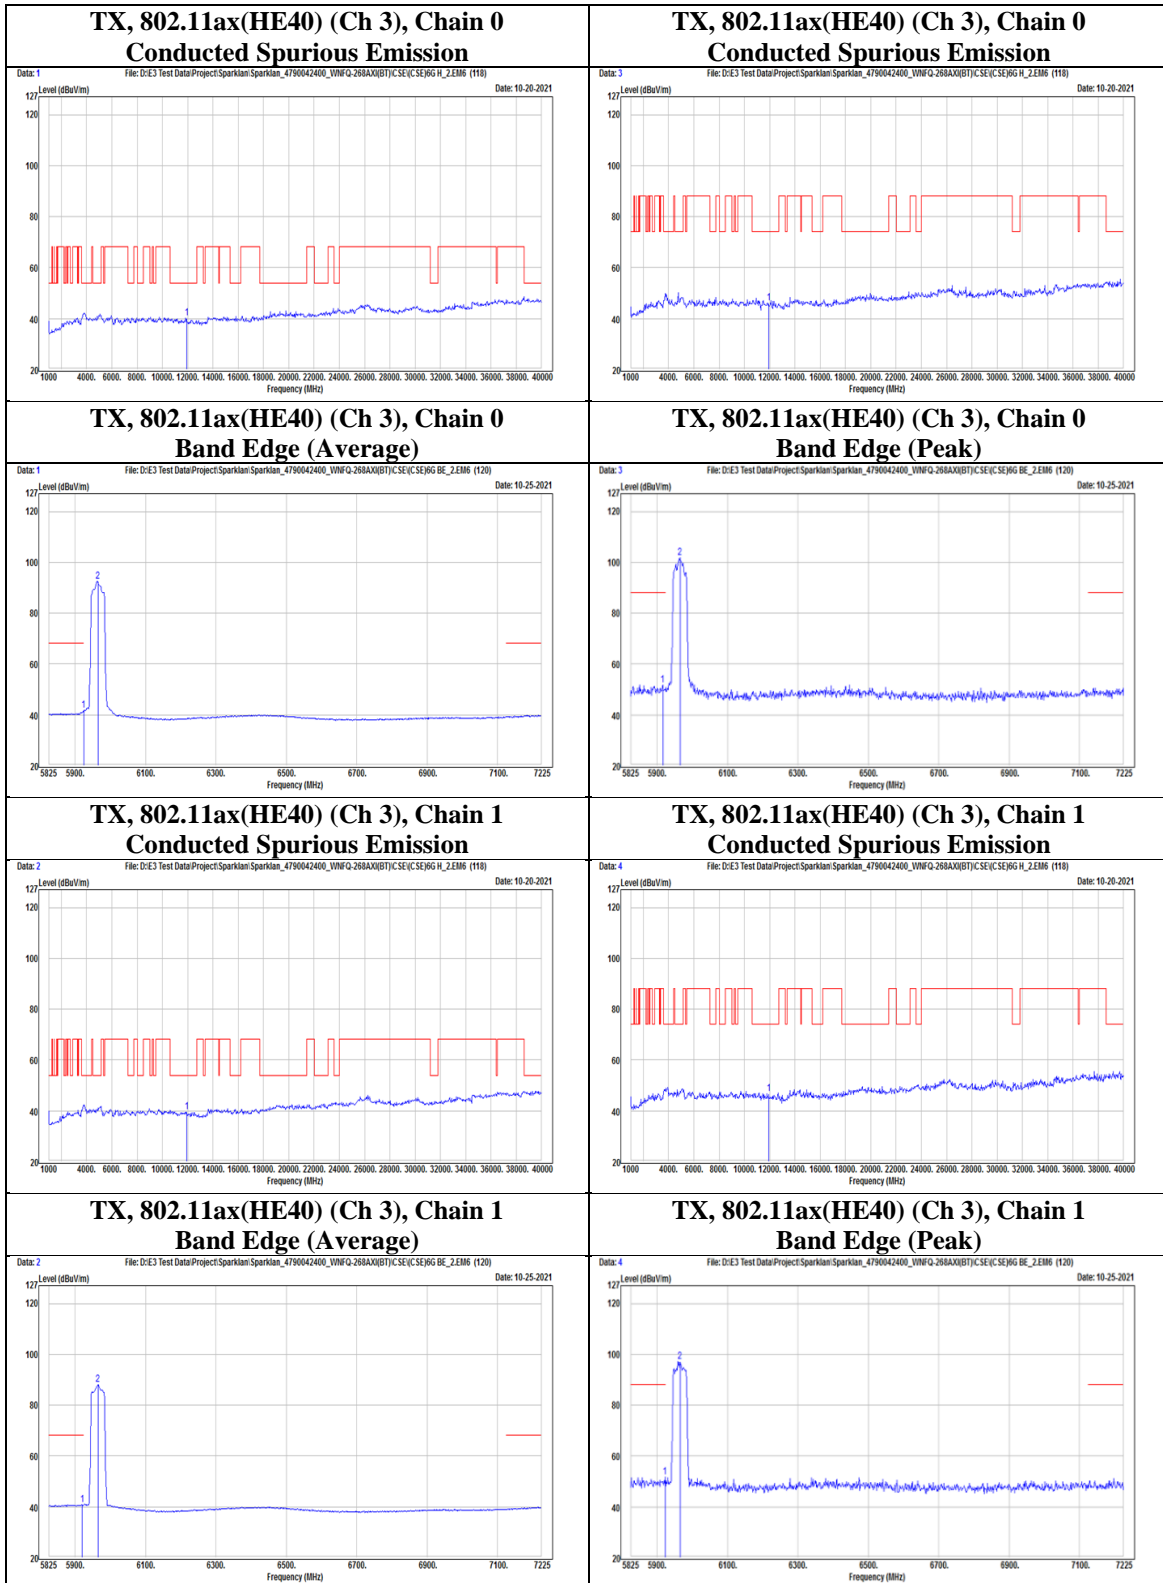

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790042400-US-R2-V0
Page : 297 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	43
------	----------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5918.8	52.3	-11.74	40.56	68.2	-27.64	AVG
		5921.6	64.01	-11.74	52.27	88.2	-35.93	PK
	@	6165	112.67	-11.74	100.93	N/A	N/A	PK
	@	6165	103.49	-11.74	91.75	N/A	N/A	AVG
		12330	59.05	-11.74	47.31	74	-26.69	PK
		12330	50.93	-11.74	39.19	54	-14.81	AVG
Chain 1		5836.2	63.68	-11.74	51.94	88.2	-36.26	PK
		5917.4	51.95	-11.74	40.21	68.2	-27.99	AVG
	@	6165	110.48	-11.74	98.74	N/A	N/A	PK
	@	6165	100.73	-11.74	88.99	N/A	N/A	AVG
		12330	57.56	-11.74	45.82	74	-28.18	PK
		12330	51.13	-11.74	39.39	54	-14.61	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

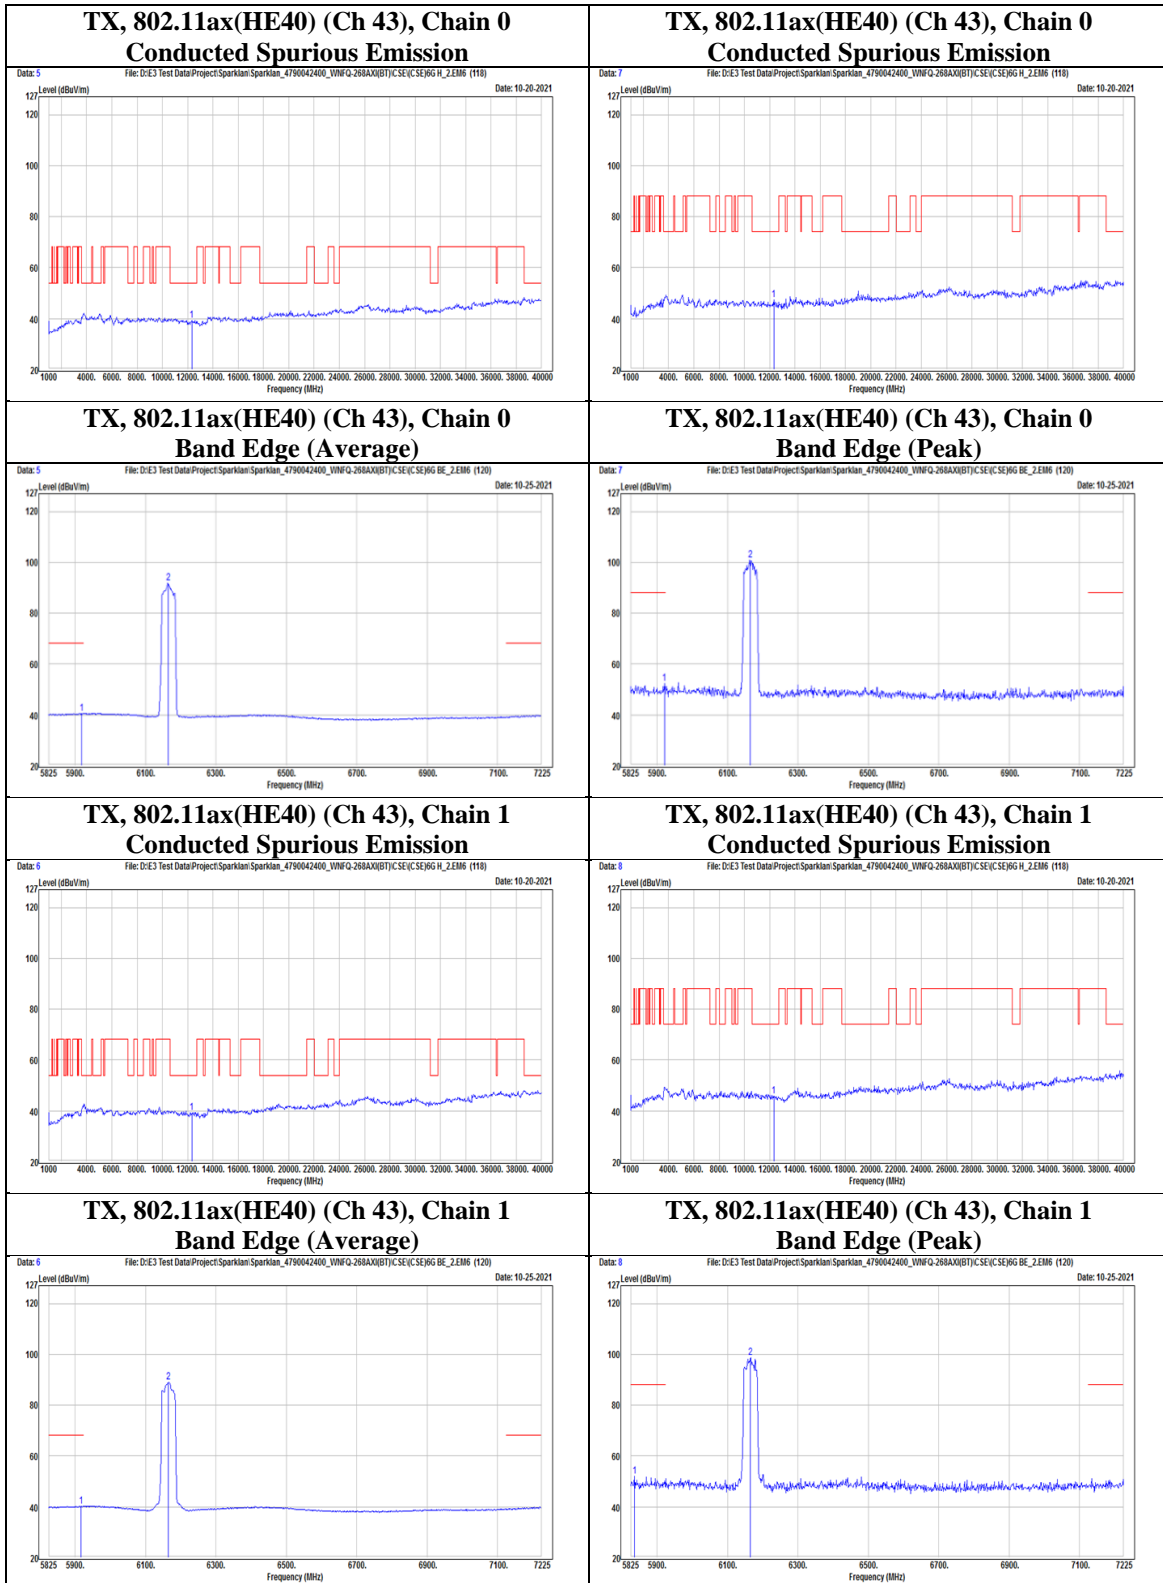



Mode	802.11ax(HE40)	Channel	91
------	----------------	---------	----


TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5848.8	64.08	-11.74	52.34	88.2	-35.86	PK
		5920.2	52.6	-11.74	40.86	68.2	-27.34	AVG
	@	6405	116.51	-11.74	104.77	N/A	N/A	PK
	@	6405	105.87	-11.74	94.13	N/A	N/A	AVG
		7159.2	61.91	-11.74	50.17	88.2	-38.03	PK
		7199.8	51.45	-11.74	39.71	68.2	-28.49	AVG
		12810	57.06	-11.74	45.32	88.2	-42.88	PK
		12810	50.72	-11.74	38.98	68.2	-29.22	AVG
Chain 1		5843.2	62.32	-11.74	50.58	88.2	-37.62	PK
		5917.4	52.03	-11.74	40.29	68.2	-27.91	AVG
	@	6405	110.99	-11.74	99.25	N/A	N/A	PK
	@	6405	101.37	-11.74	89.63	N/A	N/A	AVG
		7155	62.89	-11.74	51.15	88.2	-37.05	PK
		7222.2	51.48	-11.74	39.74	68.2	-28.46	AVG
		12810	58.12	-11.74	46.38	88.2	-41.82	PK
		12810	51.11	-11.74	39.37	68.2	-28.83	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

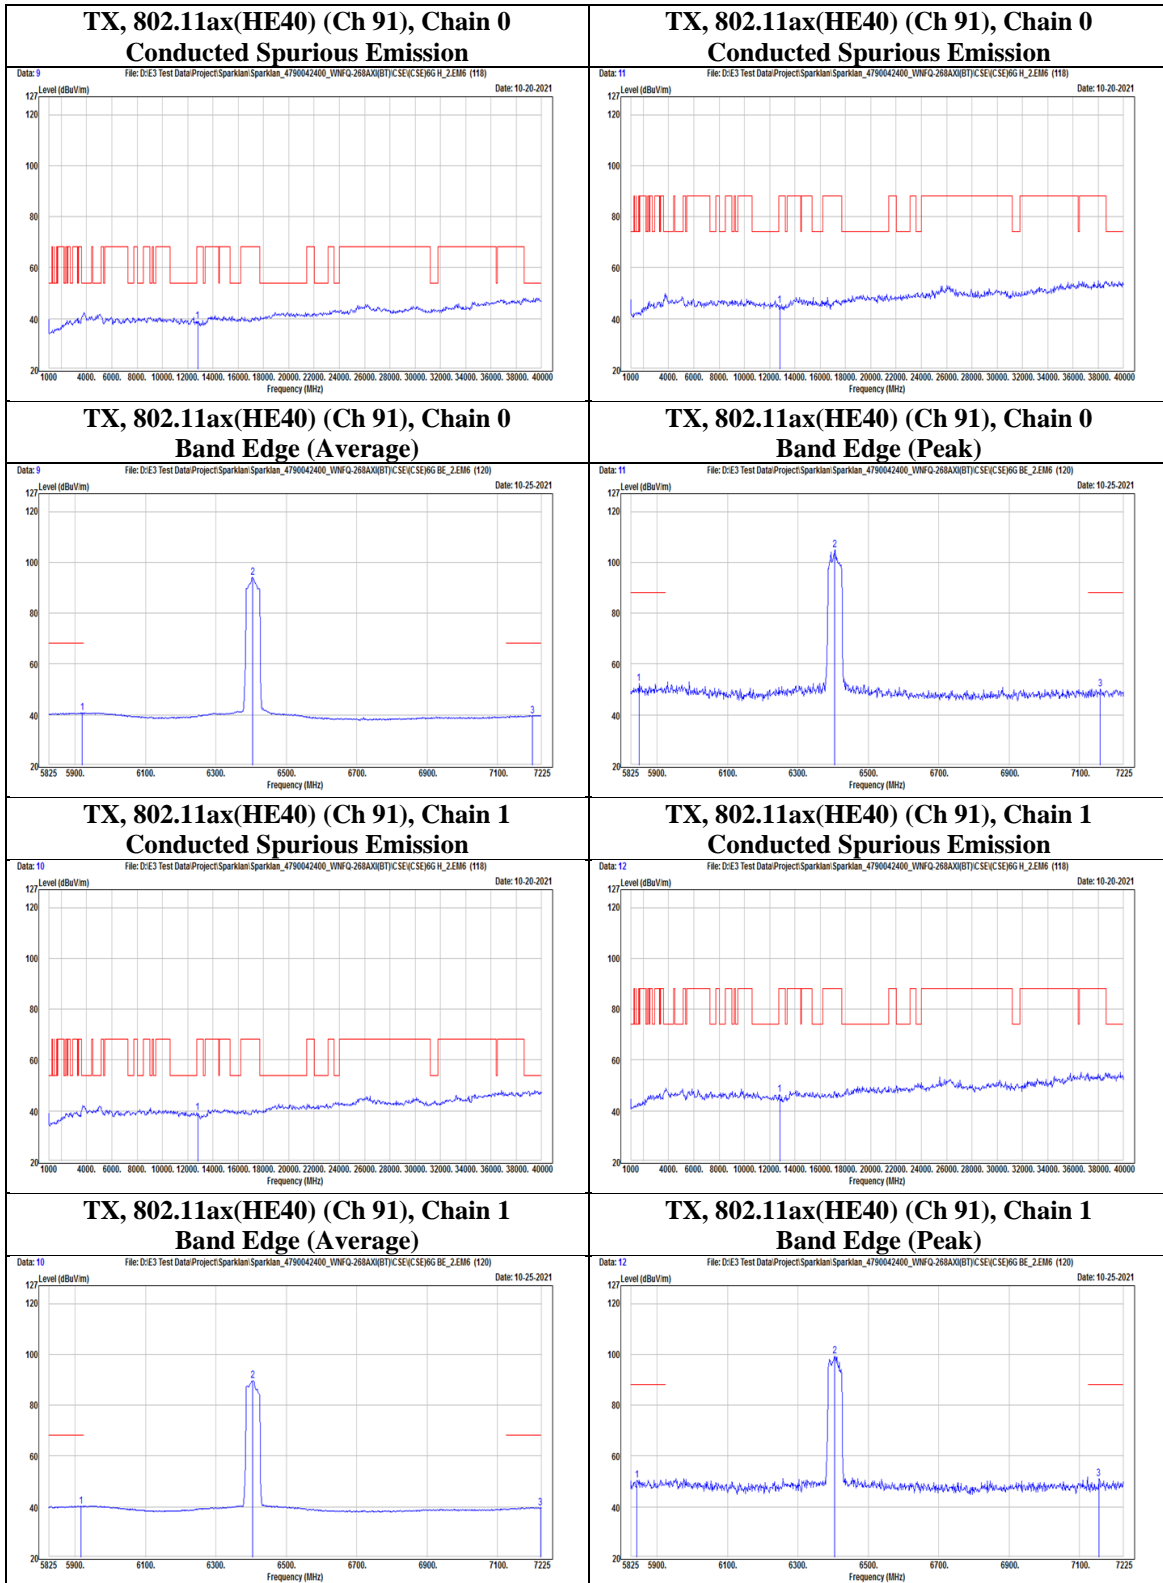

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 301 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	99
------	----------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5888	63.52	-11.74	51.78	88.2	-36.42	PK
		5910.4	52.46	-11.74	40.72	68.2	-27.48	AVG
	@	6445	115.38	-11.74	103.64	N/A	N/A	PK
	@	6445	105.5	-11.74	93.76	N/A	N/A	AVG
		7173.2	63.7	-11.74	51.96	88.2	-36.24	PK
		7211	51.62	-11.74	39.88	68.2	-28.32	AVG
		12890	57.96	-11.74	46.22	88.2	-41.98	PK
		12890	50.29	-11.74	38.55	68.2	-29.65	AVG
Chain 1		5893.6	63.43	-11.74	51.69	88.2	-36.51	PK
		5920.2	51.96	-11.74	40.22	68.2	-27.98	AVG
	@	6445	113.71	-11.74	101.97	N/A	N/A	PK
	@	6445	103.16	-11.74	91.42	N/A	N/A	AVG
		7216.6	63.28	-11.74	51.54	88.2	-36.66	PK
		7218	51.54	-11.74	39.8	68.2	-28.4	AVG
		12890	57.17	-11.74	45.43	88.2	-42.77	PK
		12890	50.7	-11.74	38.96	68.2	-29.24	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

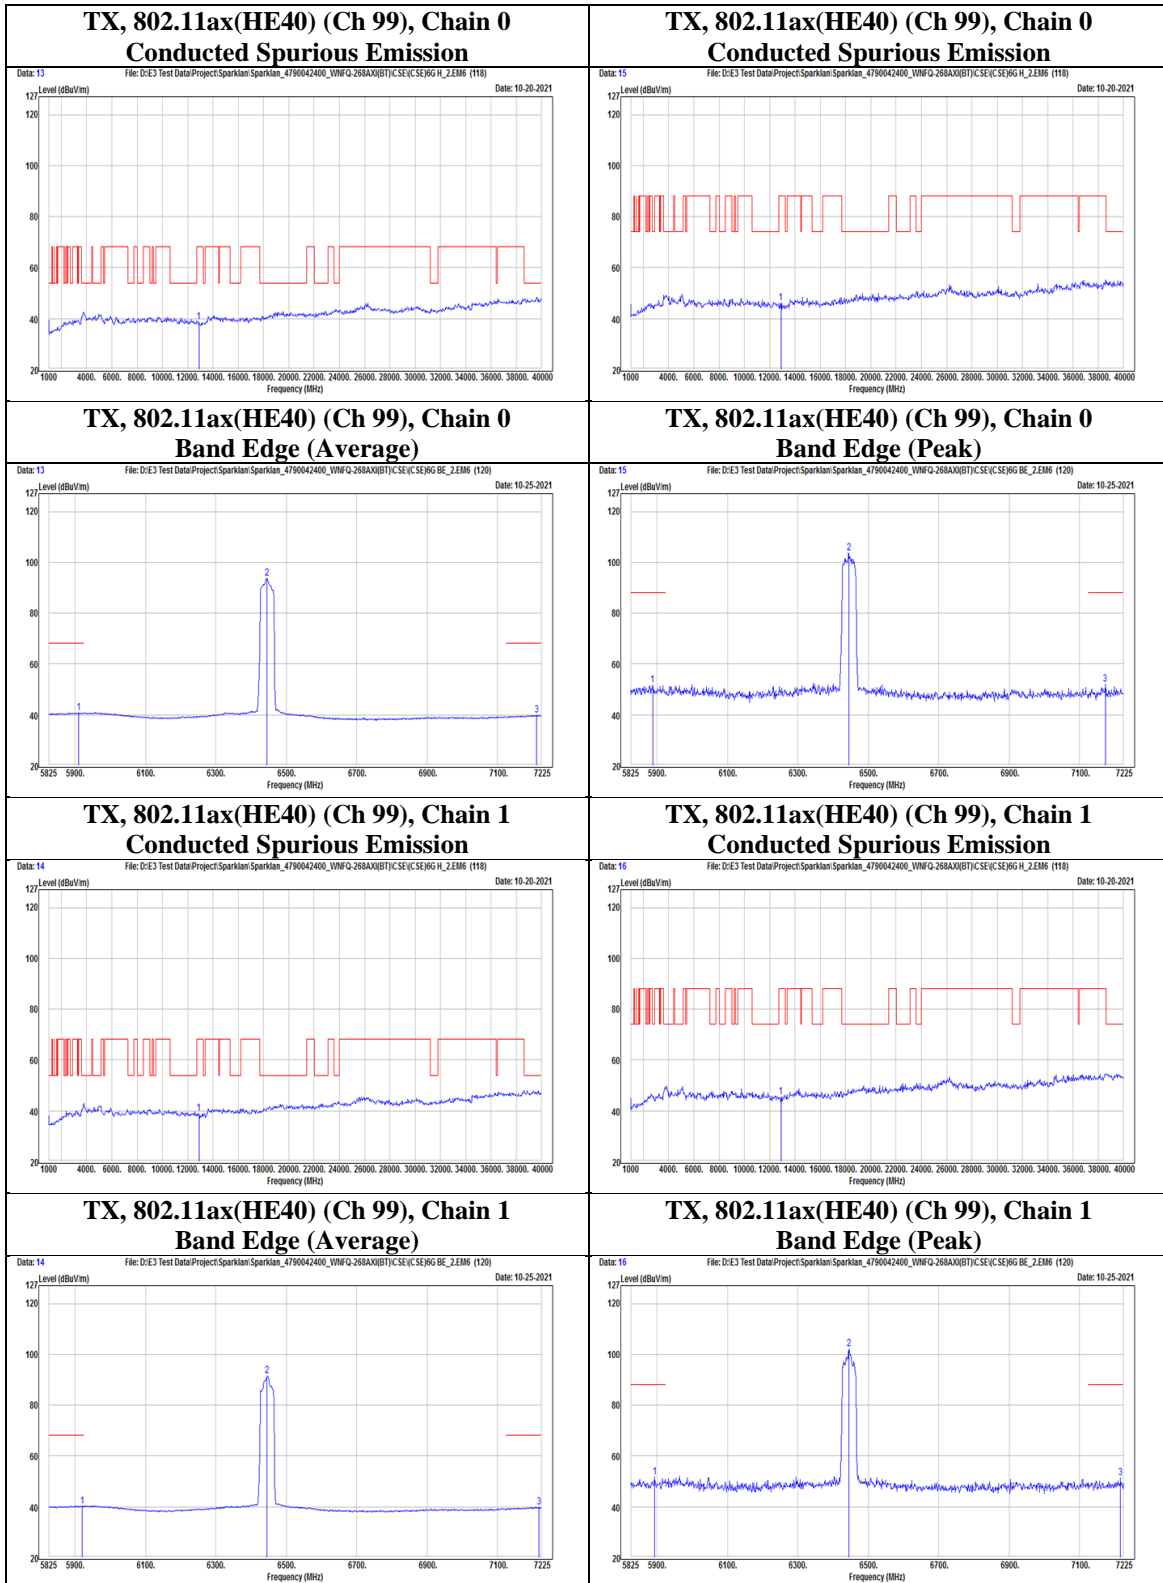



Test report No. : 4790042400-US-R2-V0
Page : 303 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	107
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5888	64.1	-11.74	52.36	88.2	-35.84	PK
		5899.2	52.71	-11.74	40.97	68.2	-27.23	AVG
	@	6485	115.7	-11.74	103.96	N/A	N/A	PK
	@	6485	106	-11.74	94.26	N/A	N/A	AVG
		7212.4	51.59	-11.74	39.85	68.2	-28.35	AVG
		7218	63.01	-11.74	51.27	88.2	-36.93	PK
		12970	57.59	-11.74	45.85	88.2	-42.35	PK
		12970	50.06	-11.74	38.32	68.2	-29.88	AVG
Chain 1		5907.6	62.25	-11.74	50.51	88.2	-37.69	PK
		5911.8	52.14	-11.74	40.4	68.2	-27.8	AVG
	@	6485	113.72	-11.74	101.98	N/A	N/A	PK
	@	6485	102.84	-11.74	91.1	N/A	N/A	AVG
		7197	62.57	-11.74	50.83	88.2	-37.37	PK
		7219.4	51.67	-11.74	39.93	68.2	-28.27	AVG
		12970	56.98	-11.74	45.24	88.2	-42.96	PK
		12970	50.28	-11.74	38.54	68.2	-29.66	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

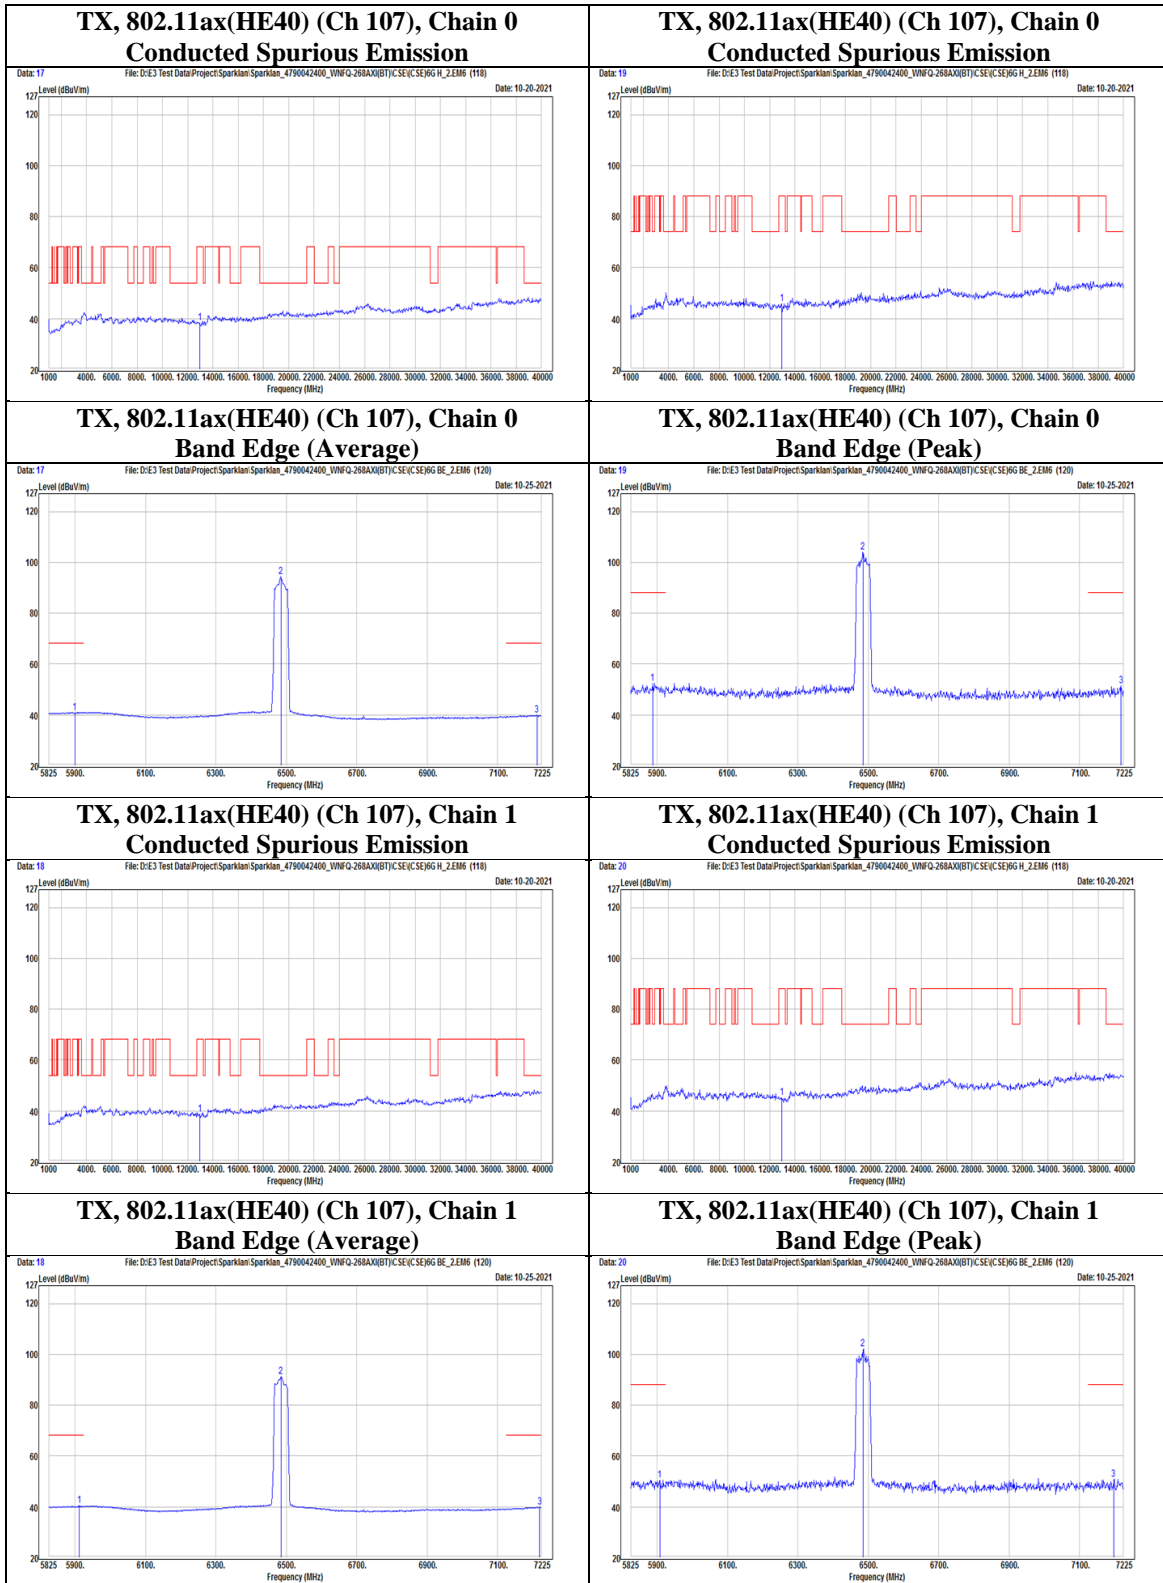



Test report No. : 4790042400-US-R2-V0
Page : 305 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	115
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5906.2	63.35	-11.74	51.61	88.2	-36.59	PK
		5916	52.32	-11.74	40.58	68.2	-27.62	AVG
	@	6525	114.88	-11.74	103.14	N/A	N/A	PK
	@	6525	104.1	-11.74	92.36	N/A	N/A	AVG
		7157.8	62.31	-11.74	50.57	88.2	-37.63	PK
		7218	51.51	-11.74	39.77	68.2	-28.43	AVG
		13050	56.5	-11.74	44.76	88.2	-43.44	PK
		13050	50.05	-11.74	38.31	68.2	-29.89	AVG
Chain 1		5917.4	51.94	-11.74	40.2	68.2	-28	AVG
		5920.2	63.02	-11.74	51.28	88.2	-36.92	PK
	@	6525	111.66	-11.74	99.92	N/A	N/A	PK
	@	6525	102.15	-11.74	90.41	N/A	N/A	AVG
		7171.8	62.61	-11.74	50.87	88.2	-37.33	PK
		7213.8	51.7	-11.74	39.96	68.2	-28.24	AVG
		13050	56.96	-11.74	45.22	88.2	-42.98	PK
		13050	49.85	-11.74	38.11	68.2	-30.09	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

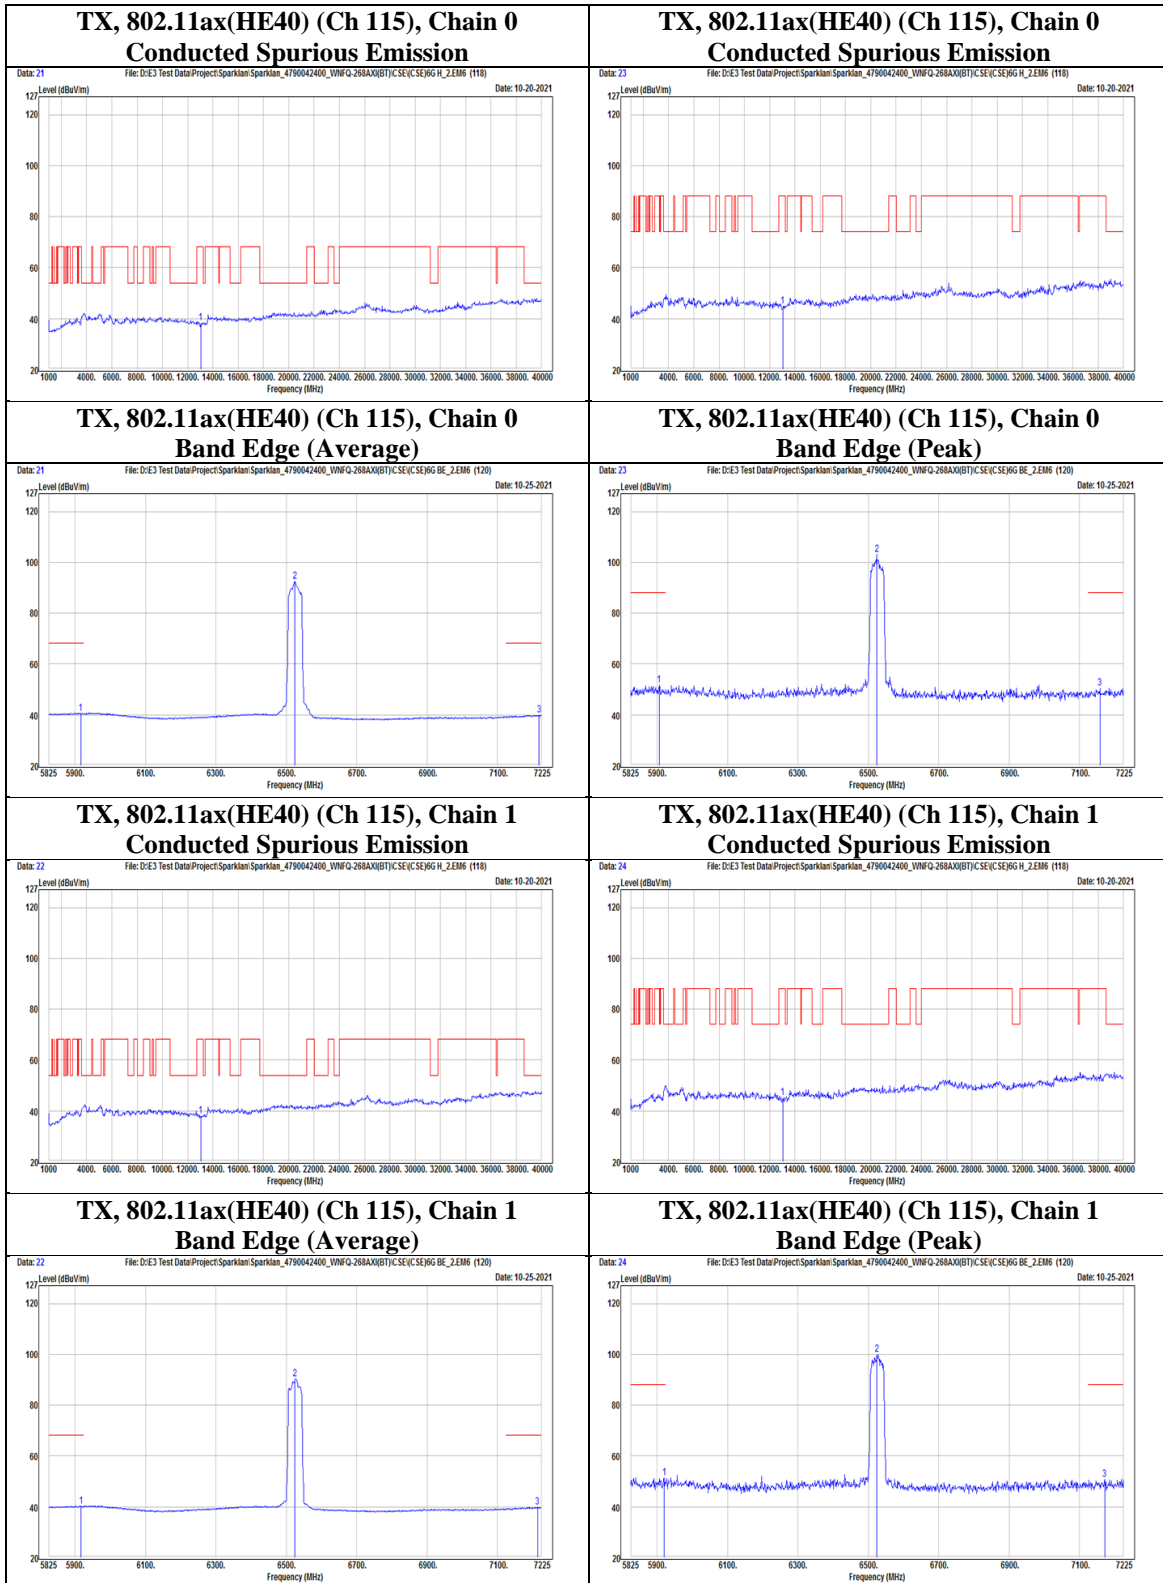



Mode	802.11ax(HE40)	Channel	123
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5843.2	63.26	-11.74	51.52	88.2	-36.68	PK
		5914.6	52.47	-11.74	40.73	68.2	-27.47	AVG
	@	6565	113.76	-11.74	102.02	N/A	N/A	PK
	@	6565	104.04	-11.74	92.3	N/A	N/A	AVG
		7170.4	62.42	-11.74	50.68	88.2	-37.52	PK
		7204	51.49	-11.74	39.75	68.2	-28.45	AVG
		13130	57.5	-11.74	45.76	88.2	-42.44	PK
		13130	50.57	-11.74	38.83	68.2	-29.37	AVG
Chain 1		5858.6	63	-11.74	51.26	88.2	-36.94	PK
		5914.6	52.01	-11.74	40.27	68.2	-27.93	AVG
	@	6565	114.06	-11.74	102.32	N/A	N/A	PK
	@	6565	102.53	-11.74	90.79	N/A	N/A	AVG
		7209.6	62.25	-11.74	50.51	88.2	-37.69	PK
		7219.4	51.53	-11.74	39.79	68.2	-28.41	AVG
		13130	57.3	-11.74	45.56	88.2	-42.64	PK
		13130	50.44	-11.74	38.7	68.2	-29.5	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

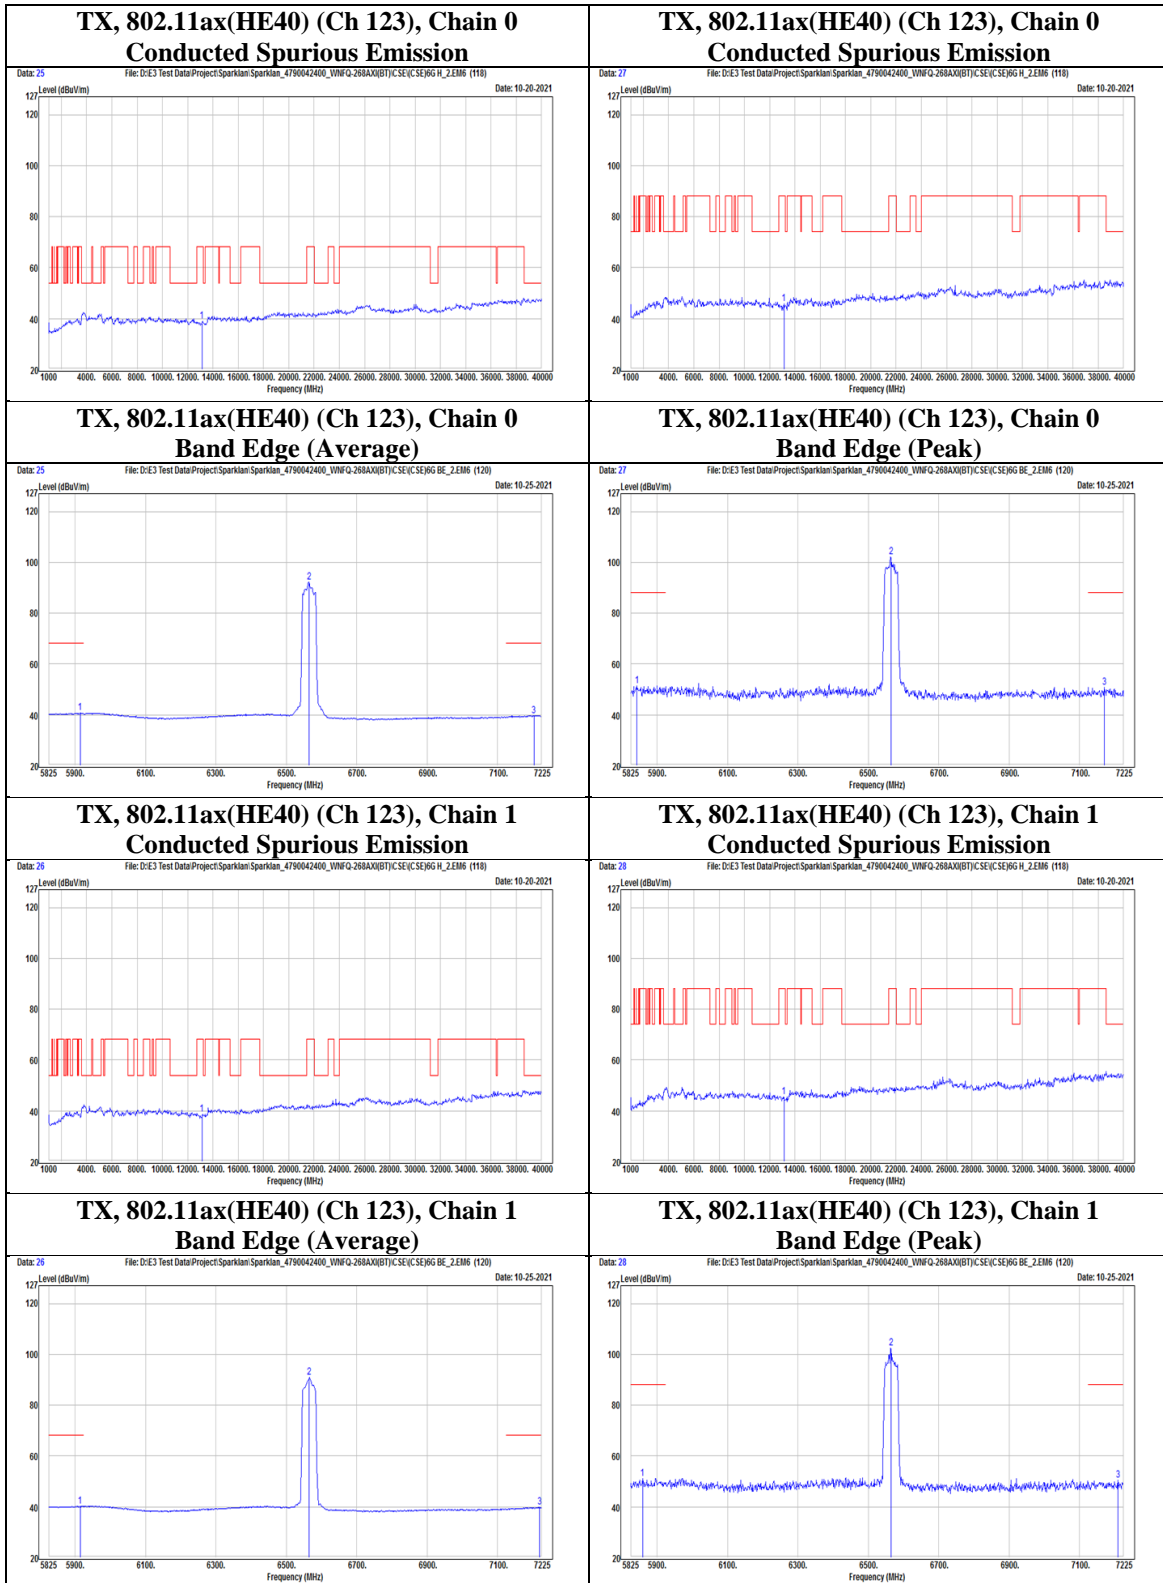

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 309 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	155
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5827.8	63.48	-11.74	51.74	88.2	-36.46	PK
		5904.8	52.43	-11.74	40.69	68.2	-27.51	AVG
	@	6725	115.25	-11.74	103.51	N/A	N/A	PK
	@	6725	104.28	-11.74	92.54	N/A	N/A	AVG
		7215.2	51.58	-11.74	39.84	68.2	-28.36	AVG
		7220.8	62.82	-11.74	51.08	88.2	-37.12	PK
		13450	58.22	-11.74	46.48	88.2	-41.72	PK
		13450	50.22	-11.74	38.48	68.2	-29.72	AVG
Chain 1		5888	63.84	-11.74	52.1	88.2	-36.1	PK
		5920.2	51.96	-11.74	40.22	68.2	-27.98	AVG
	@	6725	110.97	-11.74	99.23	N/A	N/A	PK
	@	6725	101.1	-11.74	89.36	N/A	N/A	AVG
		7190	63.22	-11.74	51.48	88.2	-36.72	PK
		7219.4	51.49	-11.74	39.75	68.2	-28.45	AVG
		13450	57.3	-11.74	45.56	88.2	-42.64	PK
		13450	50.85	-11.74	39.11	68.2	-29.09	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0