

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790460525-US-R0-V0
Page : 98 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| Mode | CH | Freq (MHz) | Directional Gain (dBi) | Total PSD (dBm/MHz) | Limit (dBm/MHz) | Result |
|-----------------|-----|------------|------------------------|---------------------|-----------------|--------|
| 802.11ax(HE160) | 15 | 6025 | 8.01 | -1.214 | -1 | PASS |
| | 47 | 6185 | 8.01 | -1.42 | -1 | PASS |
| | 79 | 6345 | 8.01 | -1.155 | -1 | PASS |
| | 111 | 6505 | 8.01 | -1.435 | -1 | PASS |
| | 143 | 6665 | 8.01 | -1.537 | -1 | PASS |
| | 175 | 6825 | 8.01 | -1.537 | -1 | PASS |
| | 207 | 6985 | 8.01 | -1.092 | -1 | PASS |

| Mode | CH | Freq (MHz) | PSD per Chain (dBm/MHz) | |
|-----------------|-----|------------|-------------------------|---------|
| | | | Chain 0 | Chain 1 |
| 802.11ax(HE160) | 15 | 6025 | -13.286 | -11.173 |
| | 47 | 6185 | -13.085 | -11.234 |
| | 79 | 6345 | -11.908 | -11.88 |
| | 111 | 6505 | -12.201 | -11.921 |
| | 143 | 6665 | -12.396 | -12.508 |
| | 175 | 6825 | -12.199 | -12.107 |
| | 207 | 6985 | -12.329 | -11.681 |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

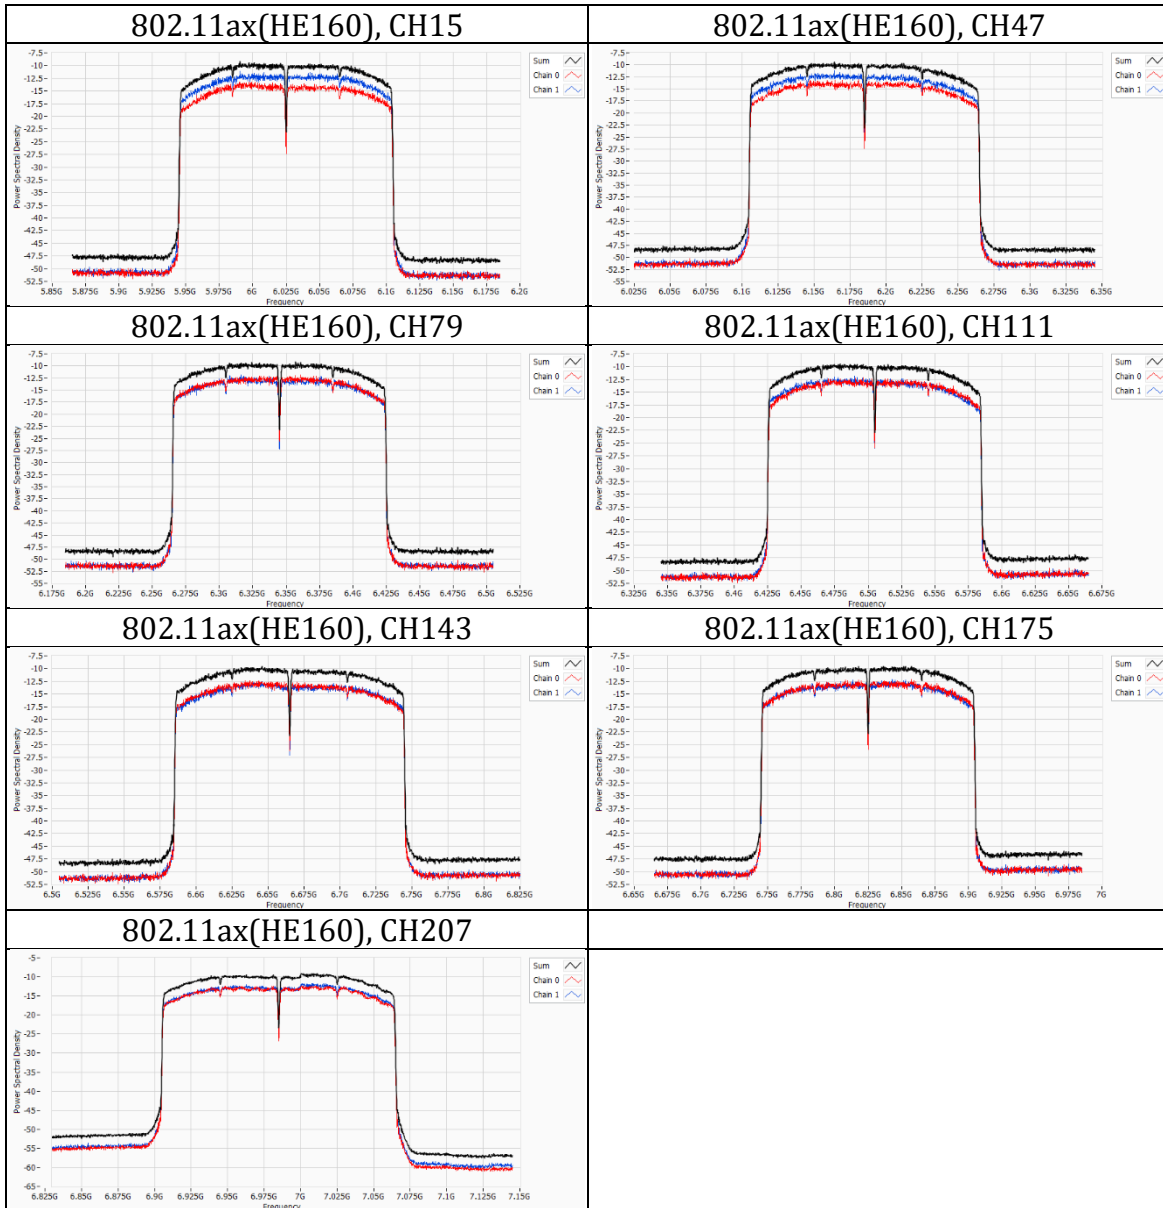

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



9.5. Frequency Stability


Requirements

The frequency of the carrier signal shall be maintained within band of operation.

Test procedure

- The EUT was placed inside the environmental test chamber and powered by nominal voltage.
- Turn the EUT on and couple its output to a spectrum analyzer.
- Turn the EUT off and set the chamber to the highest temperature specified.
- Allow sufficient time (approximately 30 min) for the temperature of the chamber to stabilize, turn the EUT on and measure the operating frequency after 2, 5, and 10 Minutes.
- Repeat step 2 and 3 with the temperature chamber set to the lowest temperature.
- The test chamber was allowed to stabilize at +20 degree C for a minimum of 30 Minutes. The supply voltage was then adjusted on the EUT from 85% to 115% and the frequency record.

Test Setup

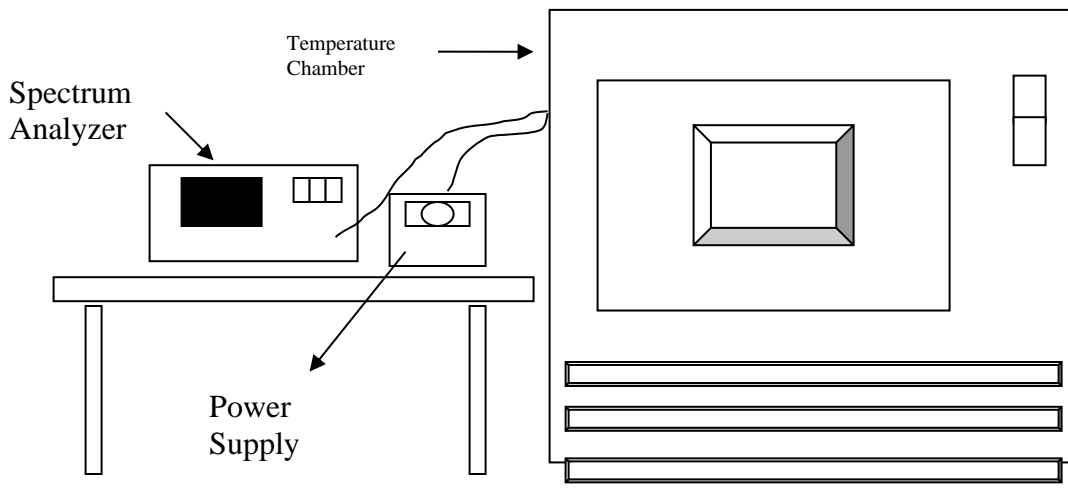

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test Data

| Frequency Stability Versus Temp. | | | | | | | | | |
|----------------------------------|--------------------------|--------------------------------|----------------------|--------------------------------|----------------------|--------------------------------|----------------------|--------------------------------|----------------------|
| Operating Frequency: 5955 MHz | | | | | | | | | |
| TEMP. (°C) | Power Supply (Vac) | 0 Minute | | 2 Minute | | 5 Minute | | 10 Minute | |
| | | Measured Frequency (MHz) | Freq. Drift (ppm) | Measured Frequency (MHz) | Freq. Drift (ppm) | Measured Frequency (MHz) | Freq. Drift (ppm) | Measured Frequency (MHz) | Freq. Drift (ppm) |
| 50 | 120 | 5954.9871 | -2.17 | 5954.9865 | -2.27 | 5954.9842 | -2.65 | 5954.9839 | -2.70 |
| 40 | 120 | 5955.0278 | 4.67 | 5955.0263 | 4.42 | 5955.0247 | 4.15 | 5955.0234 | 3.93 |
| 30 | 120 | 5954.9749 | -4.21 | 5954.9778 | -3.73 | 5954.9763 | -3.98 | 5954.978 | -3.69 |
| 20 | 120 | 5955.0162 | 2.72 | 5955.0155 | 2.60 | 5955.0156 | 2.62 | 5955.0183 | 3.07 |
| 10 | 120 | 5955.0042 | 0.71 | 5955.0031 | 0.52 | 5954.9993 | -0.12 | 5955.0001 | 0.02 |
| 0 | 120 | 5954.9861 | -2.33 | 5954.9885 | -1.93 | 5954.9895 | -1.76 | 5954.9854 | -2.45 |
| -10 | 120 | 5954.9727 | -4.58 | 5954.9725 | -4.62 | 5954.9709 | -4.89 | 5954.9715 | -4.79 |
| -20 | 120 | 5955.0061 | 1.02 | 5955.0021 | 0.35 | 5955.0038 | 0.64 | 5955.0018 | 0.30 |
| -30 | 120 | 5954.9954 | -0.77 | 5954.997 | -0.50 | 5954.9968 | -0.54 | 5954.9931 | -1.16 |
| TEMP. (°C) | Power Supply (Vac) | 0 Minute | | 2 Minute | | 5 Minute | | 10 Minute | |
| | | Measured Frequency (MHz) | Freq. Drift (ppm) | Measured Frequency (MHz) | Freq. Drift (ppm) | Measured Frequency (MHz) | Freq. Drift (ppm) | Measured Frequency (MHz) | Freq. Drift (ppm) |
| 20 | 138 | 5955.0154 | 2.59 | 5955.0166 | 2.79 | 5955.0152 | 2.55 | 5955.0175 | 2.94 |
| 20 | 120 | 5955.0162 | 2.72 | 5955.0155 | 2.60 | 5955.0156 | 2.62 | 5955.0183 | 3.07 |
| 20 | 102 | 5955.017 | 2.85 | 5955.0163 | 2.74 | 5955.0157 | 2.64 | 5955.0176 | 2.96 |

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



9.6. Radiated Spurious Emission

Requirements

Radiated emissions which fall in the restricted bands must comply with the radiated emission limits specified as below table.

| Frequency(MHz) | Field strength (microvolts/meter) | Measurement distance (meters) |
|----------------|-----------------------------------|-------------------------------|
| 0.009-0.490 | 2400/F(kHz) | 300 |
| 0.490-1.705 | 24000/F(kHz) | 30 |
| 1.705-30.0 | 30 | 30 |
| 30-88 | 100 | 3 |
| 88-216 | 150 | 3 |
| 216-960 | 200 | 3 |
| Above 960 | 500 | 3 |

NOTE:

1. The lower limit shall apply at the transition frequencies.
2. Emission level (dBuV/m) = 20 log Emission level (uV/m).
3. For frequencies above 1000MHz, the field strength limits are based on average detector, however, the peak field strength of any emission shall not exceed the maximum permitted average limits, specified above by more than 20dB under any condition of modulation.

Limits of unwanted emission out of the restricted bands

| Frequencies (MHz) | EIRP Limit | Equivalent Field Strength at 3m |
|-----------------------|------------------------|---------------------------------|
| 5925MHz > F > 7125MHz | Peak:-7 (dBm/MHz) | 88.2(dBμV/m) |
| | Average: -27 (dBm/MHz) | 68.2(dBμV/m) |

Note:

The following formula is used to convert the effective isotropic radiated power (eirp) to field strength:

$$E = \frac{1000000\sqrt{30P}}{3} \mu\text{V/m, where P is the eirp (Watts).}$$

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test Procedures

[For 9 kHz ~ 30 MHz]

- a. The EUT was placed on the top of a rotating table 0.8 meters above the ground at a 3 meter chamber room. The table was rotated 360 degrees to determine the position of the highest radiation.
- b. The EUT was set 3 meters away from the interference-receiving antenna, which was mounted on the top of a variable-height antenna tower.
- c. Parallel, perpendicular, and ground-parallel orientations of the antenna are set to make the measurement.
- d. For each suspected emission, the EUT was arranged to its worst case and the rotatable table was turned from 0 degrees to 360 degrees to find the maximum reading.
- e. For measurement below 30MHz, the initial step in collecting conducted emission data is a spectrum analyzer peak detector mode pre-scanning the measurement frequency range. Significant peaks are then marked and then Quasi Peak detector mode re-measured. If the emission level of the EUT measured by the peak detector is lower than the applicable limit, the peak emission level will be reported. Otherwise, the emission measurement will be repeated using the quasi-peak detector and reported.

NOTE:

1. The resolution bandwidth and video bandwidth of test receiver/spectrum analyzer is 9kHz at frequency below 30MHz.

[For above 30 MHz]

- a. The EUT was placed on the top of a rotating table 0.8 meters (for 30MHz ~ 1GHz) / 1.5 meters (for above 1GHz) above the ground at 3 meter chamber room for test. The table was rotated 360 degrees to determine the position of the highest radiation.
- b. The EUT was set 3 meters away from the interference-receiving antenna, which was mounted on the top of a variable-height antenna tower.
- c. The height of antenna is varied from one meter to four meters above the ground to determine the maximum value of the field strength. Both horizontal and vertical polarizations of the antenna are set to make the measurement.
- d. For each suspected emission, the EUT was arranged to its worst case and then the antenna was tuned to heights from 1 meter to 4 meters and the rotatable table was turned from 0 degrees to 360 degrees to find the maximum reading.
- e. For measurement below 1GHz, the initial step in collecting conducted emission data is a spectrum analyzer peak detector mode pre-scanning the measurement frequency range. Significant peaks are then marked and then Quasi Peak detector mode re-measured. If the emission level of the EUT measured by the peak detector is lower than the applicable limit, the peak emission level will be reported. Otherwise, the emission measurement will be repeated using the quasi-peak detector and reported.
- f. The test-receiver system was set to peak and average detects function and specified bandwidth with maximum hold mode when the test frequency is above 1 GHz. If the peak reading value also meets average limit, measurement with the average detector is unnecessary.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Note:

- a. The resolution bandwidth and video bandwidth of test receiver/spectrum analyzer is 120kHz for Quasi-peak detection (QP) at frequency below 1GHz.
- b. The resolution bandwidth of test receiver/spectrum analyzer is 1 MHz and the video bandwidth is 3 MHz for Peak detection (PK) at frequency above 1GHz.
- c. The resolution bandwidth of test receiver/spectrum analyzer is 1MHz and the video bandwidth is $\geq 1/T$ (Duty cycle < 98%) or 10Hz (Duty cycle $\geq 98\%$) for Average detection (AV) at frequency above 1GHz.

| Configuration | Average | |
|------------------|---------|-------------------------------------|
| | RBW | VBW |
| 802.11ax (HE20) | 1MHz | Refer to section 6.6 for duty cycle |
| 802.11ax (HE40) | | |
| 802.11ax (HE80) | | |
| 802.11ax (HE160) | | |


- d. All modes of operation were investigated (includes all external accessories) and the worst-case emissions are reported, the other emission levels were low against the limit.
- e. Test data of Result value (dBuV/m) = Reading value (dBuV/m) + Correction Factor (dB/m).
- f. Test data of Margin(dB) = Result value (dBuV/m) - Limit value (dBuV/m).
- g. Test data of Correction Factor (dB/m) = Antenna Factor (dBuV/m) + Cable Loss (dB) - Preamp Factor (dB).
- h. Test data of Notation "@" = Fundamental Frequency
- i. Test data of Notation "*" = The peak result under 20 dB above and complies with AVG limit, AVG result is deemed to comply with AVG limit.

Underwriters Laboratories Taiwan Co., Ltd.




Test Setup

<Frequency Range 9 kHz ~ 30 MHz>

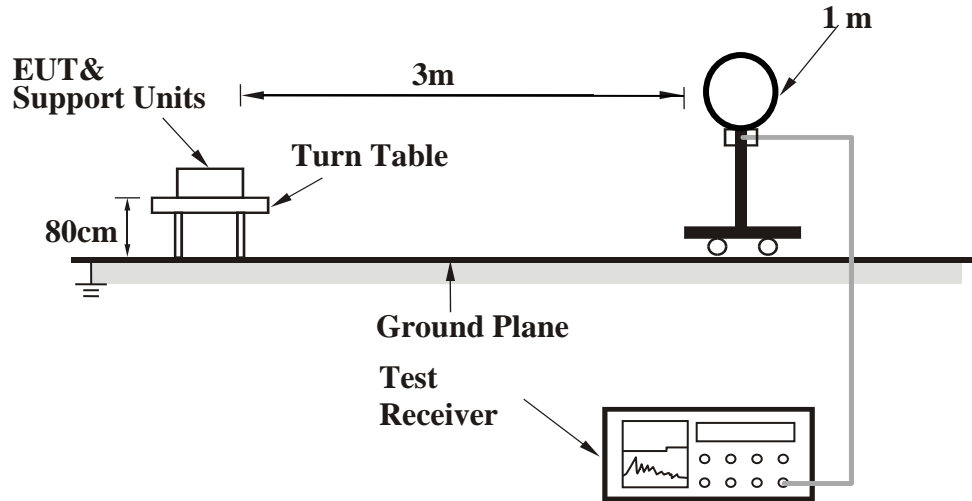

<Frequency Range 30 MHz ~ 1 GHz >

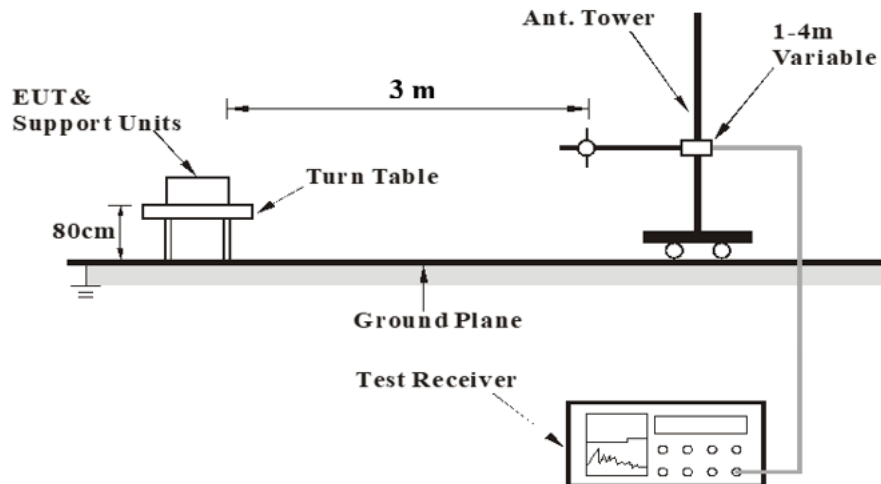

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



<Frequency Range above 1 GHz> 1 GHz ~ 40 GHz

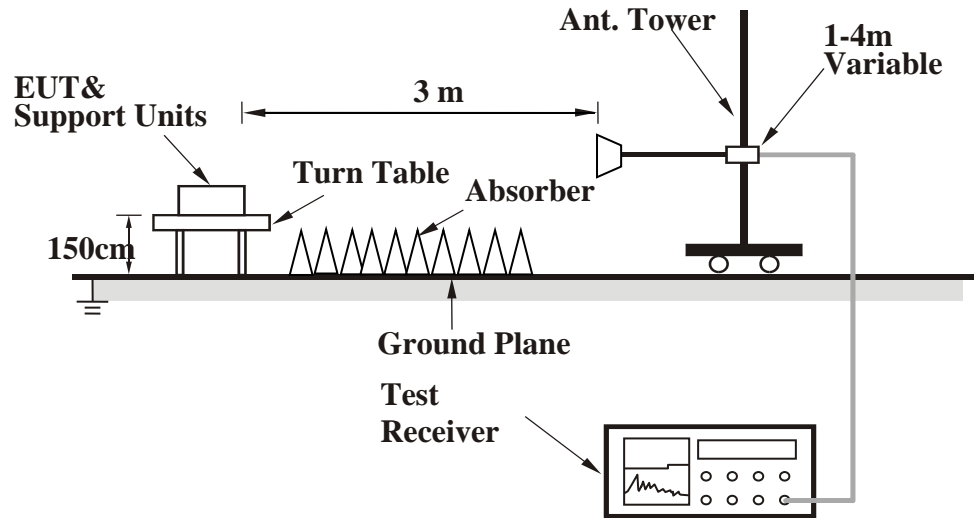

For the actual test configuration, please refer to the Setup Configurations.



Test Data

Above 1 GHz

| | | | |
|------|----------------|---------|---|
| Mode | 802.11ax(HE20) | Channel | 2 |
|------|----------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5924.4 | 57.21 | 14.96 | 72.17 | 88.2 | -16.03 | PK |
| | | 5924.4 | 41.99 | 14.96 | 56.95 | 68.2 | -11.25 | AVG |
| | @ | 5935 | 72.21 | 14.95 | 87.16 | N/A | N/A | PK |
| | @ | 5935 | 66.17 | 14.95 | 81.12 | N/A | N/A | AVG |
| | * | 11870 | 29.36 | 18.7 | 48.06 | 74 | -25.94 | PK |
| Vertical | | 5924.4 | 65.32 | 14.96 | 80.28 | 88.2 | -7.92 | PK |
| | | 5924.4 | 50.05 | 14.96 | 65.01 | 68.2 | -3.19 | AVG |
| | @ | 5935 | 84.34 | 14.95 | 99.29 | N/A | N/A | PK |
| | @ | 5935 | 75.82 | 14.95 | 90.77 | N/A | N/A | AVG |
| | * | 11870 | 29.52 | 18.7 | 48.22 | 74 | -25.78 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

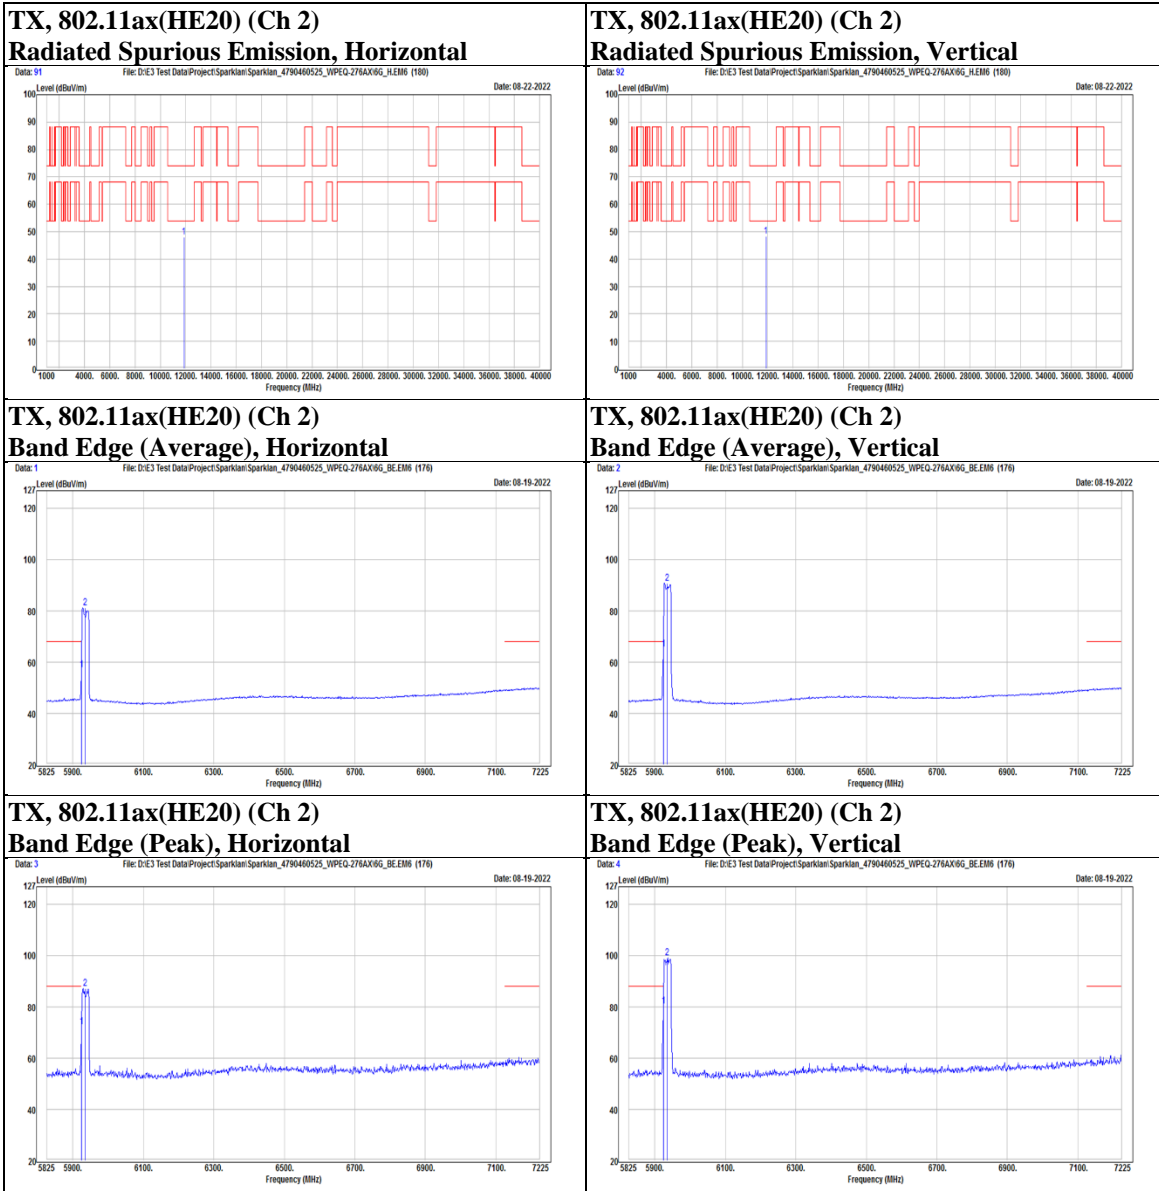

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790460525-US-R0-V0
Page : 109 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|---|
| Mode | 802.11ax(HE20) | Channel | 1 |
|------|----------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5843.2 | 40.93 | 14.61 | 55.54 | 88.2 | -32.66 | PK |
| | | 5904.8 | 30.45 | 14.97 | 45.42 | 68.2 | -22.78 | AVG |
| | @ | 5955 | 74.4 | 14.95 | 89.35 | N/A | N/A | PK |
| | @ | 5955 | 63.54 | 14.95 | 78.49 | N/A | N/A | AVG |
| | * | 11910 | 29.84 | 18.84 | 48.68 | 74 | -25.32 | PK |
| Vertical | | 5892.2 | 40.63 | 14.92 | 55.55 | 88.2 | -32.65 | PK |
| | | 5923 | 30.62 | 14.96 | 45.58 | 68.2 | -22.62 | AVG |
| | @ | 5955 | 85.5 | 14.95 | 100.45 | N/A | N/A | PK |
| | @ | 5955 | 75.26 | 14.95 | 90.21 | N/A | N/A | AVG |
| | * | 11910 | 29.46 | 18.84 | 48.3 | 74 | -25.7 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

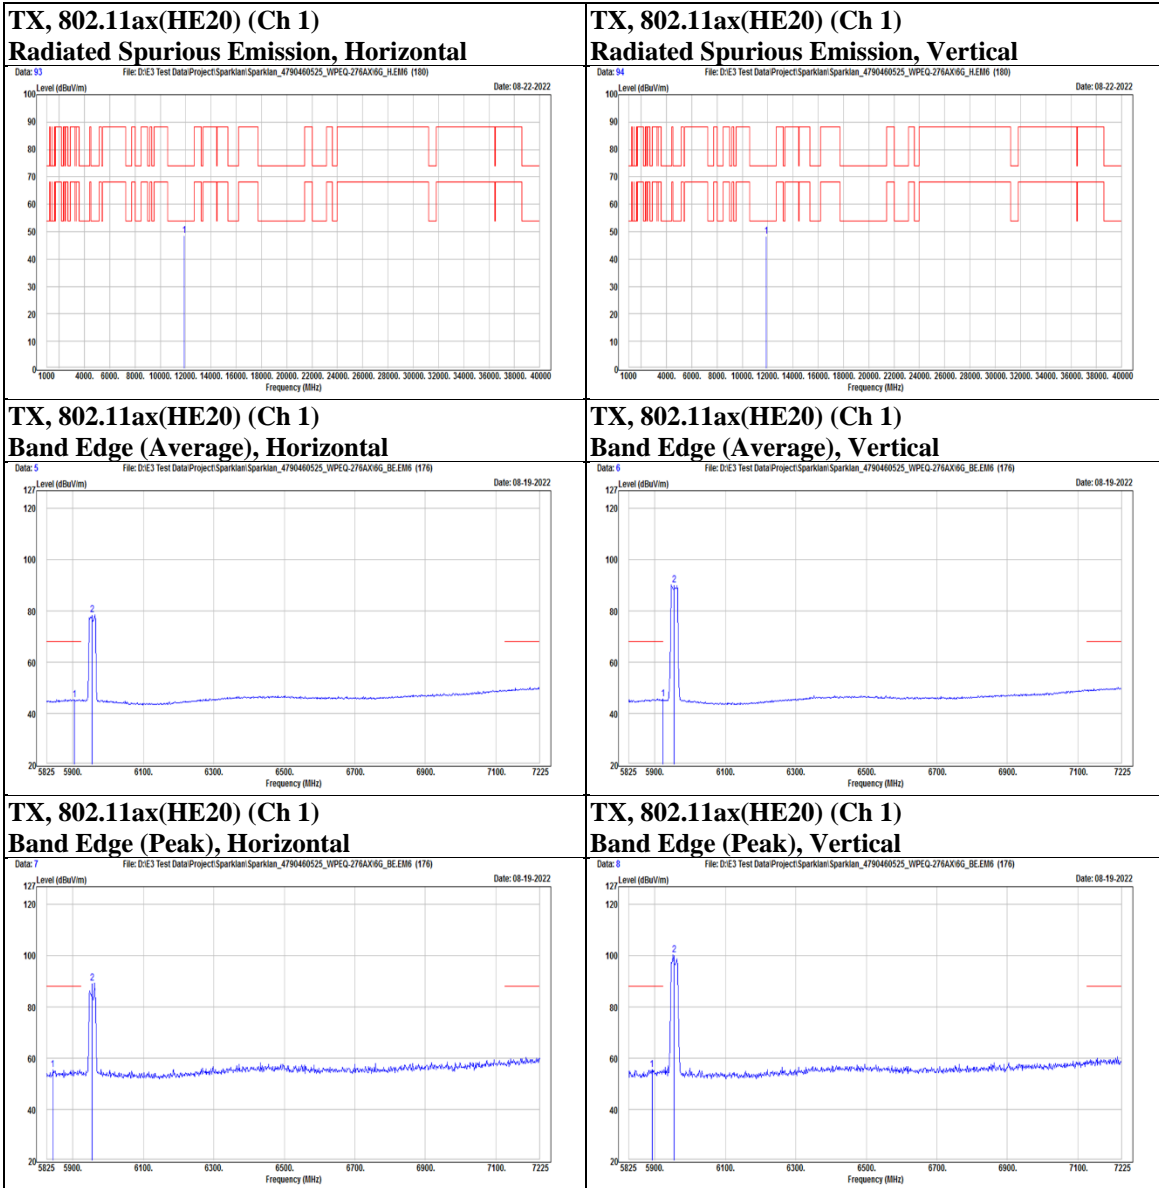

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 111 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|----|
| Mode | 802.11ax(HE20) | Channel | 45 |
|------|----------------|---------|----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5904.8 | 30.54 | 14.97 | 45.51 | 68.2 | -22.69 | AVG |
| | | 5909 | 40.58 | 14.97 | 55.55 | 88.2 | -32.65 | PK |
| | @ | 6175 | 66.79 | 15.52 | 82.31 | N/A | N/A | PK |
| | @ | 6175 | 57.72 | 15.52 | 73.24 | N/A | N/A | AVG |
| | * | 12350 | 30.3 | 19.25 | 49.55 | 74 | -24.45 | PK |
| Vertical | | 5843.2 | 41.45 | 14.61 | 56.06 | 88.2 | -32.14 | PK |
| | | 5897.8 | 30.55 | 14.96 | 45.51 | 68.2 | -22.69 | AVG |
| | @ | 6175 | 83.88 | 15.52 | 99.4 | N/A | N/A | PK |
| | @ | 6175 | 73.19 | 15.52 | 88.71 | N/A | N/A | AVG |
| | * | 12350 | 29.3 | 19.25 | 48.55 | 74 | -25.45 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

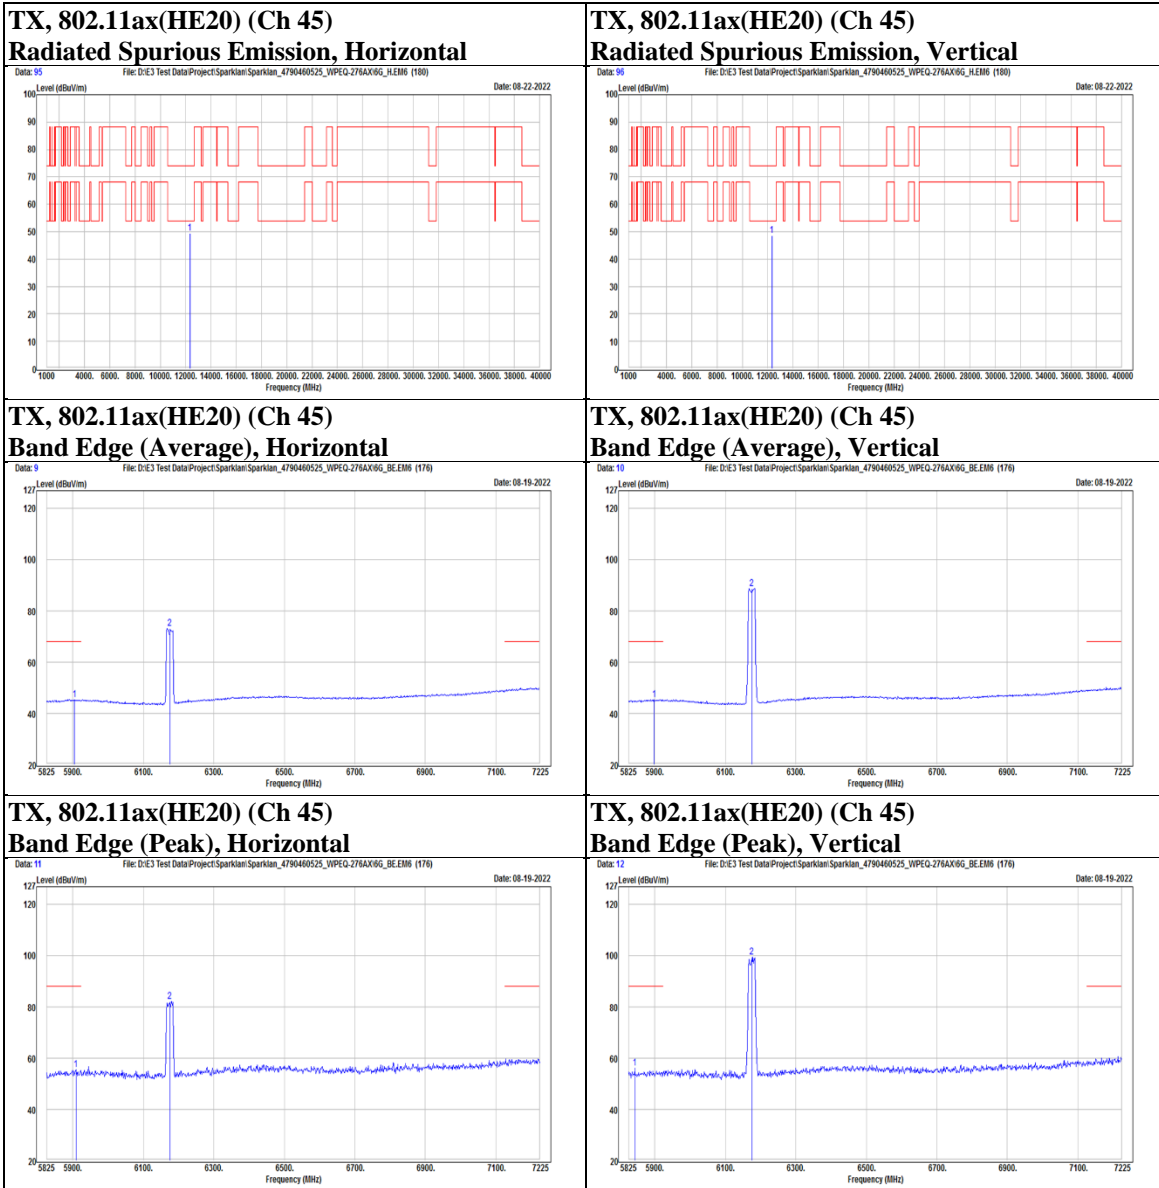

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
 Page : 113 of 230
 Issued date : 2022/10/14
 FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|----|
| Mode | 802.11ax(HE20) | Channel | 93 |
|------|----------------|---------|----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5895 | 30.41 | 14.94 | 45.35 | 68.2 | -22.85 | AVG |
| | | 5896.4 | 40.68 | 14.95 | 55.63 | 88.2 | -32.57 | PK |
| | @ | 6415 | 67.71 | 16.72 | 84.43 | N/A | N/A | PK |
| | @ | 6415 | 58.39 | 16.72 | 75.11 | N/A | N/A | AVG |
| | | 7205.4 | 40.31 | 20.15 | 60.46 | 88.2 | -27.74 | PK |
| | | 7215.2 | 29.69 | 20.21 | 49.9 | 68.2 | -18.3 | AVG |
| | * | 12830 | 28.91 | 20.62 | 49.53 | 88.2 | -38.67 | PK |
| Vertical | | 5909 | 30.5 | 14.97 | 45.47 | 68.2 | -22.73 | AVG |
| | | 5910.4 | 40.53 | 14.97 | 55.5 | 88.2 | -32.7 | PK |
| | @ | 6415 | 83.64 | 16.72 | 100.36 | N/A | N/A | PK |
| | @ | 6415 | 72.48 | 16.72 | 89.2 | N/A | N/A | AVG |
| | | 7188.6 | 29.74 | 20.06 | 49.8 | 68.2 | -18.4 | AVG |
| | | 7202.6 | 40.29 | 20.14 | 60.43 | 88.2 | -27.77 | PK |
| | * | 12830 | 29.07 | 20.62 | 49.69 | 88.2 | -38.51 | PK |

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0988 / 1.0




TX, 802.11ax(HE20) (Ch 93)
Radiated Spurious Emission, Horizontal

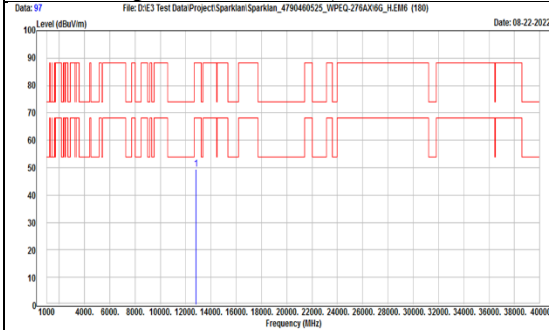


TX, 802.11ax(HE20) (Ch 93)
Radiated Spurious Emission, Vertical

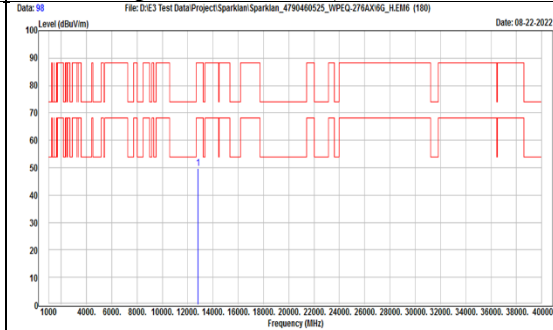


TX, 802.11ax(HE20) (Ch 93)
Band Edge (Average), Horizontal

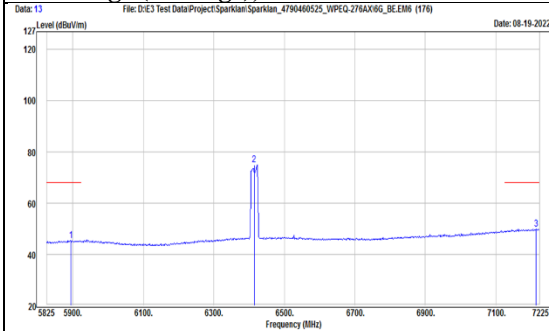


TX, 802.11ax(HE20) (Ch 93)
Band Edge (Average), Vertical

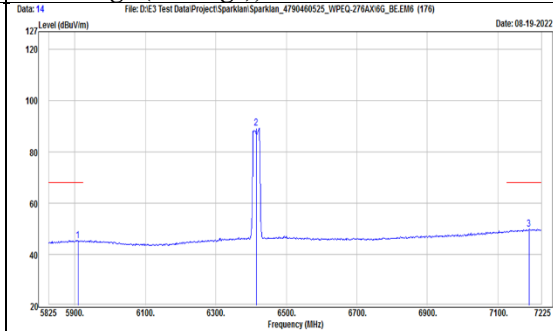

TX, 802.11ax(HE20) (Ch 93)
Band Edge (Peak), Horizontal

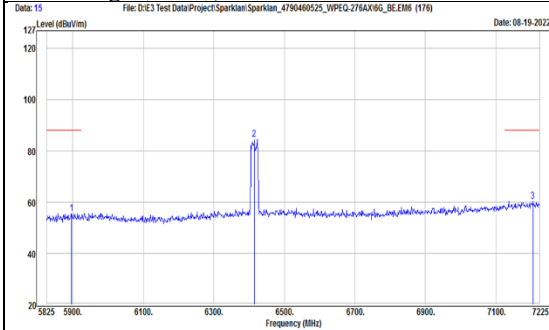

TX, 802.11ax(HE20) (Ch 93)
Band Edge (Peak), Vertical

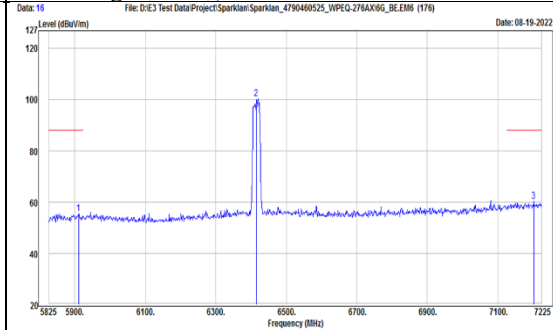

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790460525-US-R0-V0
Page : 115 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|----|
| Mode | 802.11ax(HE20) | Channel | 97 |
|------|----------------|---------|----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5889.4 | 40.49 | 14.91 | 55.4 | 88.2 | -32.8 | PK |
| | | 5906.2 | 30.53 | 14.97 | 45.5 | 68.2 | -22.7 | AVG |
| | @ | 6435 | 67.97 | 16.78 | 84.75 | N/A | N/A | PK |
| | @ | 6435 | 58.1 | 16.78 | 74.88 | N/A | N/A | AVG |
| | | 7163.4 | 40.61 | 19.92 | 60.53 | 88.2 | -27.67 | PK |
| | | 7213.8 | 29.92 | 20.2 | 50.12 | 68.2 | -18.08 | AVG |
| | * | 12870 | 30.18 | 20.73 | 50.91 | 88.2 | -37.29 | PK |
| Vertical | | 5897.8 | 40.62 | 14.96 | 55.58 | 88.2 | -32.62 | PK |
| | | 5909 | 30.63 | 14.97 | 45.6 | 68.2 | -22.6 | AVG |
| | @ | 6435 | 82.59 | 16.78 | 99.37 | N/A | N/A | PK |
| | @ | 6435 | 72.24 | 16.78 | 89.02 | N/A | N/A | AVG |
| | | 7198.4 | 40.91 | 20.11 | 61.02 | 88.2 | -27.18 | PK |
| | | 7216.6 | 29.8 | 20.22 | 50.02 | 68.2 | -18.18 | AVG |
| | * | 12870 | 29.36 | 20.73 | 50.09 | 88.2 | -38.11 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

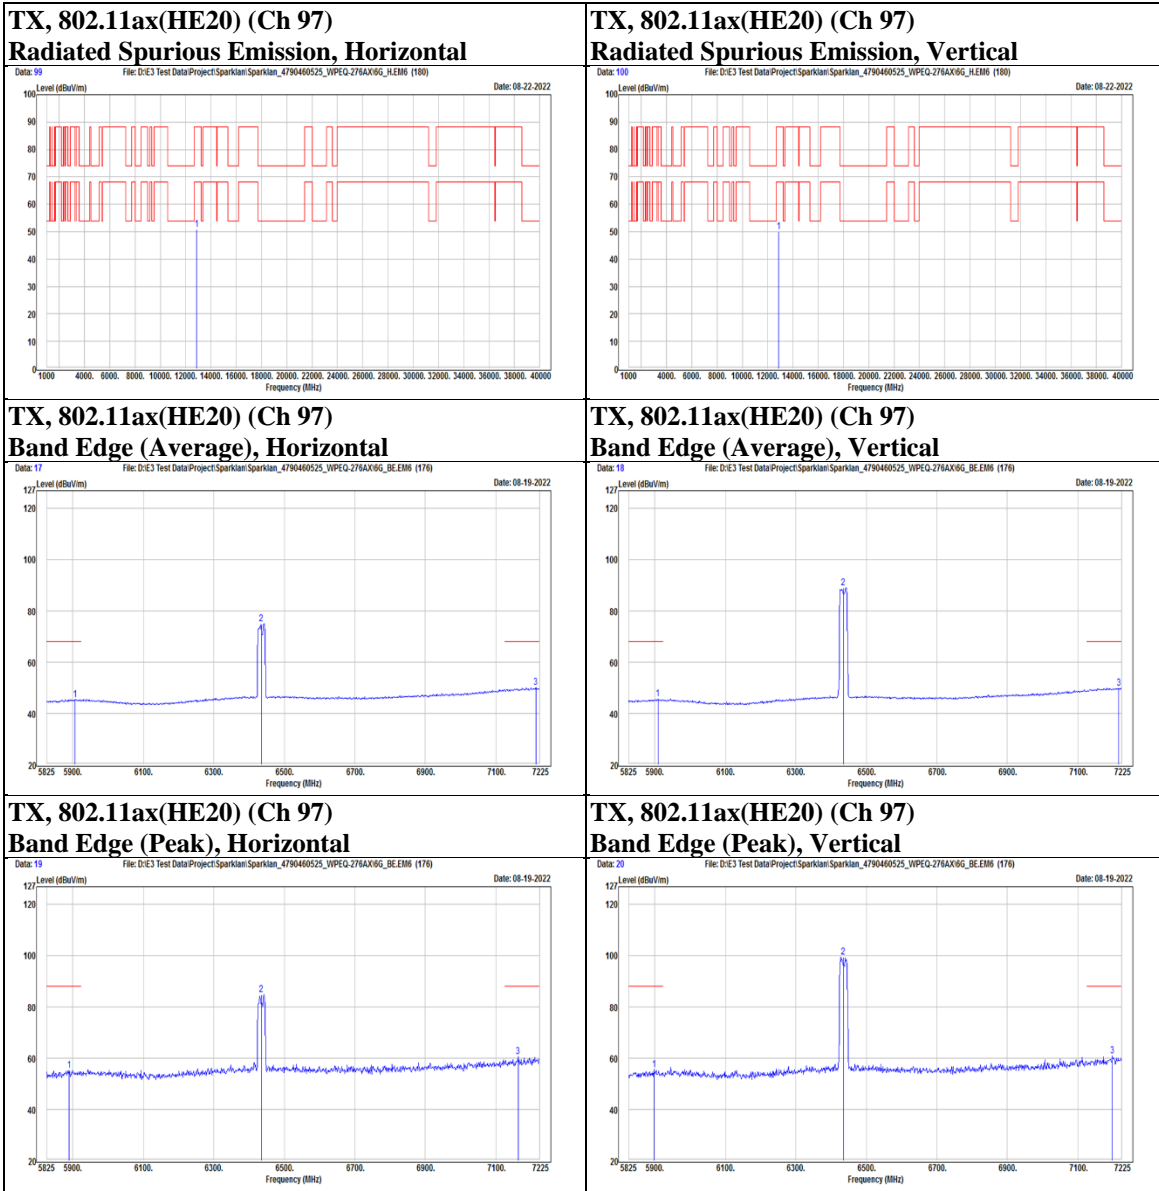

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 117 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 105 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5854.4 | 40.93 | 14.65 | 55.58 | 88.2 | -32.62 | PK |
| | | 5909 | 30.6 | 14.97 | 45.57 | 68.2 | -22.63 | AVG |
| | @ | 6475 | 67.5 | 17.06 | 84.56 | N/A | N/A | PK |
| | @ | 6475 | 57.83 | 17.06 | 74.89 | N/A | N/A | AVG |
| | | 7187.2 | 40.58 | 20.06 | 60.64 | 88.2 | -27.56 | PK |
| | | 7220.8 | 29.59 | 20.23 | 49.82 | 68.2 | -18.38 | AVG |
| | * | 12950 | 28.64 | 20.86 | 49.5 | 88.2 | -38.7 | PK |
| Vertical | | 5896.4 | 30.78 | 14.95 | 45.73 | 68.2 | -22.47 | AVG |
| | | 5900.6 | 40.48 | 14.98 | 55.46 | 88.2 | -32.74 | PK |
| | @ | 6475 | 82.74 | 17.06 | 99.8 | N/A | N/A | PK |
| | @ | 6475 | 72.2 | 17.06 | 89.26 | N/A | N/A | AVG |
| | | 7209.6 | 40.2 | 20.18 | 60.38 | 88.2 | -27.82 | PK |
| | | 7213.8 | 29.64 | 20.2 | 49.84 | 68.2 | -18.36 | AVG |
| | * | 12950 | 28.36 | 20.86 | 49.22 | 88.2 | -38.98 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

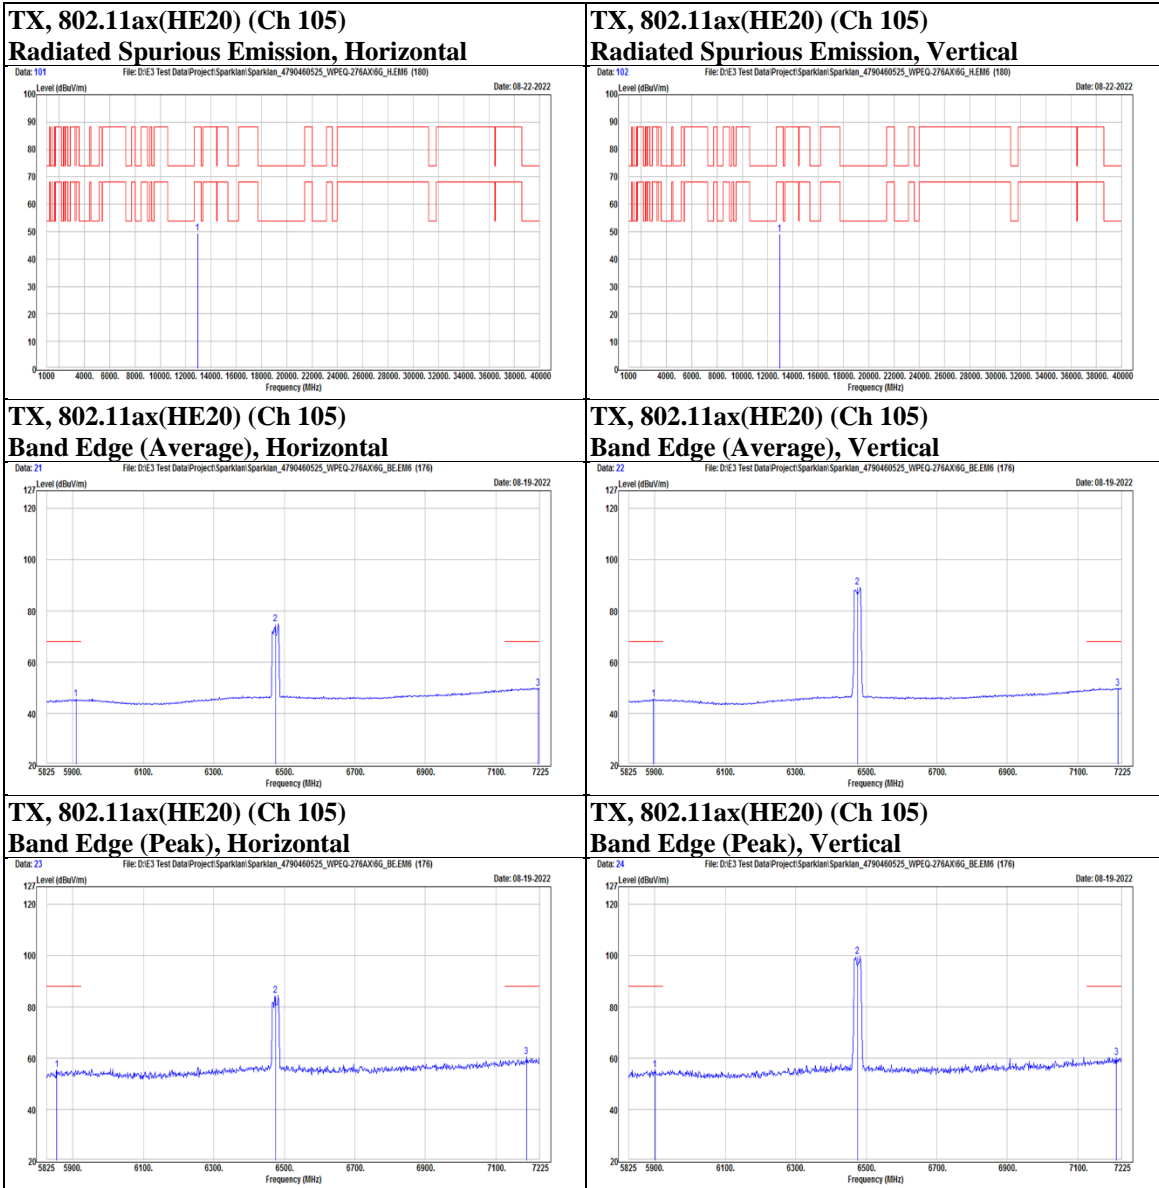



Test report No. : 4790460525-US-R0-V0
Page : 119 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 113 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5868.4 | 40.23 | 14.75 | 54.98 | 88.2 | -33.22 | PK |
| | | 5903.4 | 30.38 | 14.97 | 45.35 | 68.2 | -22.85 | AVG |
| | @ | 6515 | 71.92 | 17.31 | 89.23 | N/A | N/A | PK |
| | @ | 6515 | 61.61 | 17.31 | 78.92 | N/A | N/A | AVG |
| | | 7176 | 30.15 | 19.99 | 50.14 | 68.2 | -18.06 | AVG |
| | | 7220.8 | 40.35 | 20.23 | 60.58 | 88.2 | -27.62 | PK |
| | * | 13030 | 28.65 | 20.95 | 49.6 | 88.2 | -38.6 | PK |
| Vertical | | 5913.2 | 30.63 | 14.96 | 45.59 | 68.2 | -22.61 | AVG |
| | | 5923 | 40.62 | 14.96 | 55.58 | 88.2 | -32.62 | PK |
| | @ | 6515 | 84.15 | 17.31 | 101.46 | N/A | N/A | PK |
| | @ | 6515 | 71.98 | 17.31 | 89.29 | N/A | N/A | AVG |
| | | 7176 | 40.23 | 19.99 | 60.22 | 88.2 | -27.98 | PK |
| | | 7194.2 | 30.1 | 20.1 | 50.2 | 68.2 | -18 | AVG |
| | * | 13030 | 27.99 | 20.95 | 48.94 | 88.2 | -39.26 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

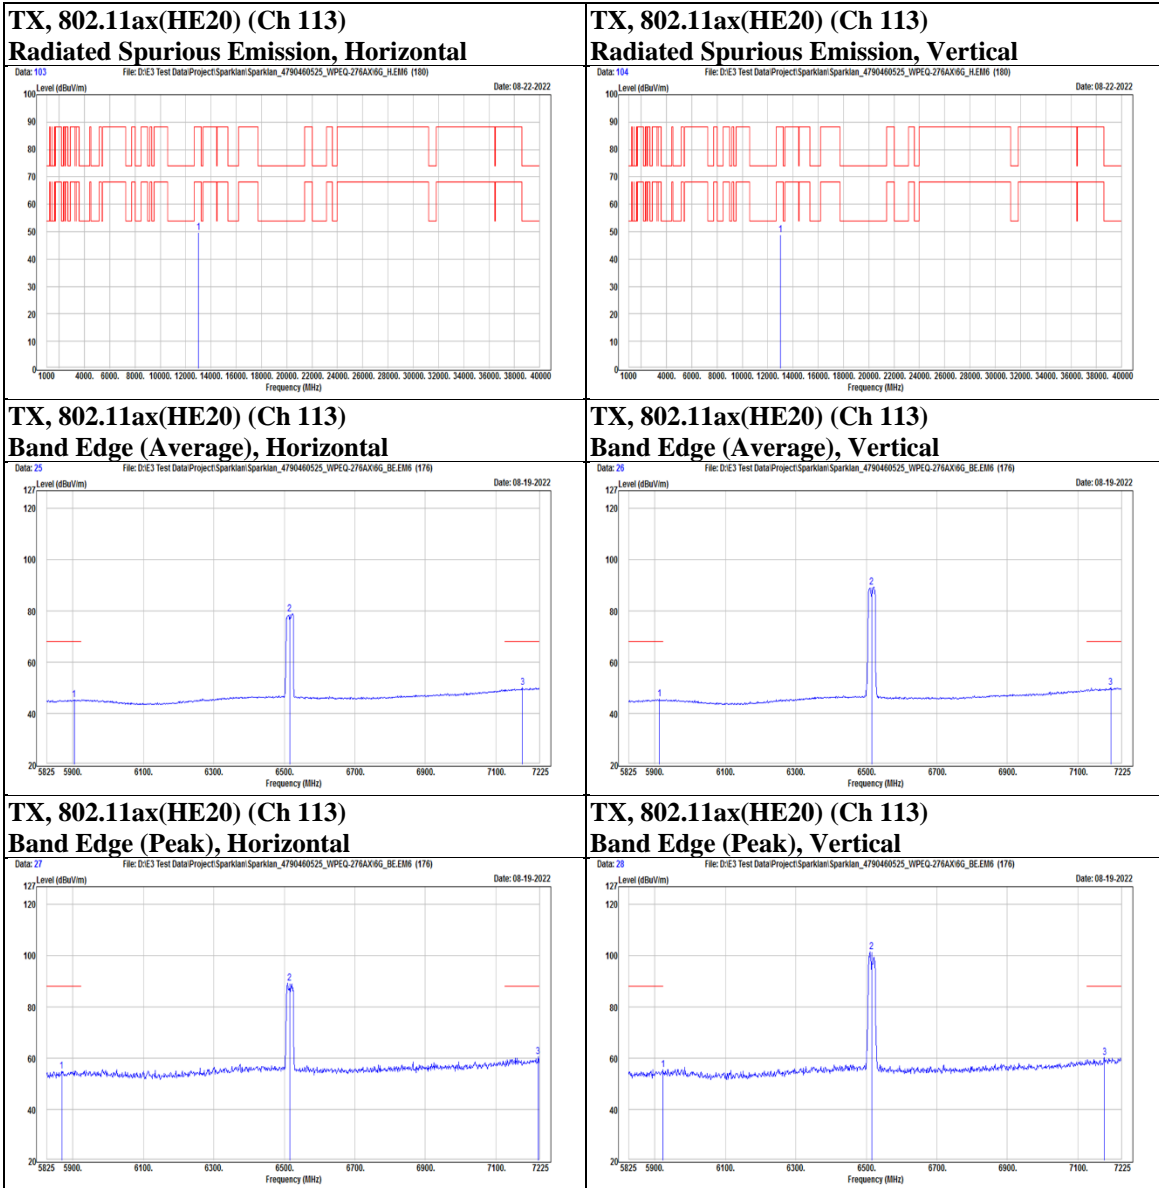

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 121 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 117 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5910.4 | 30.43 | 14.97 | 45.4 | 68.2 | -22.8 | AVG |
| | | 5911.8 | 41.08 | 14.97 | 56.05 | 88.2 | -32.15 | PK |
| | @ | 6535 | 67.06 | 17.33 | 84.39 | N/A | N/A | PK |
| | @ | 6535 | 56.72 | 17.33 | 74.05 | N/A | N/A | AVG |
| | | 7211 | 29.72 | 20.18 | 49.9 | 68.2 | -18.3 | AVG |
| | | 7215.2 | 40.1 | 20.21 | 60.31 | 88.2 | -27.89 | PK |
| | * | 13070 | 28.61 | 21.01 | 49.62 | 88.2 | -38.58 | PK |
| Vertical | | 5895 | 41.04 | 14.94 | 55.98 | 88.2 | -32.22 | PK |
| | | 5909 | 30.53 | 14.97 | 45.5 | 68.2 | -22.7 | AVG |
| | @ | 6535 | 82.82 | 17.33 | 100.15 | N/A | N/A | PK |
| | @ | 6535 | 70.98 | 17.33 | 88.31 | N/A | N/A | AVG |
| | | 7215.2 | 39.83 | 20.21 | 60.04 | 88.2 | -28.16 | PK |
| | | 7219.4 | 29.92 | 20.23 | 50.15 | 68.2 | -18.05 | AVG |
| | * | 13070 | 29.28 | 21.01 | 50.29 | 88.2 | -37.91 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

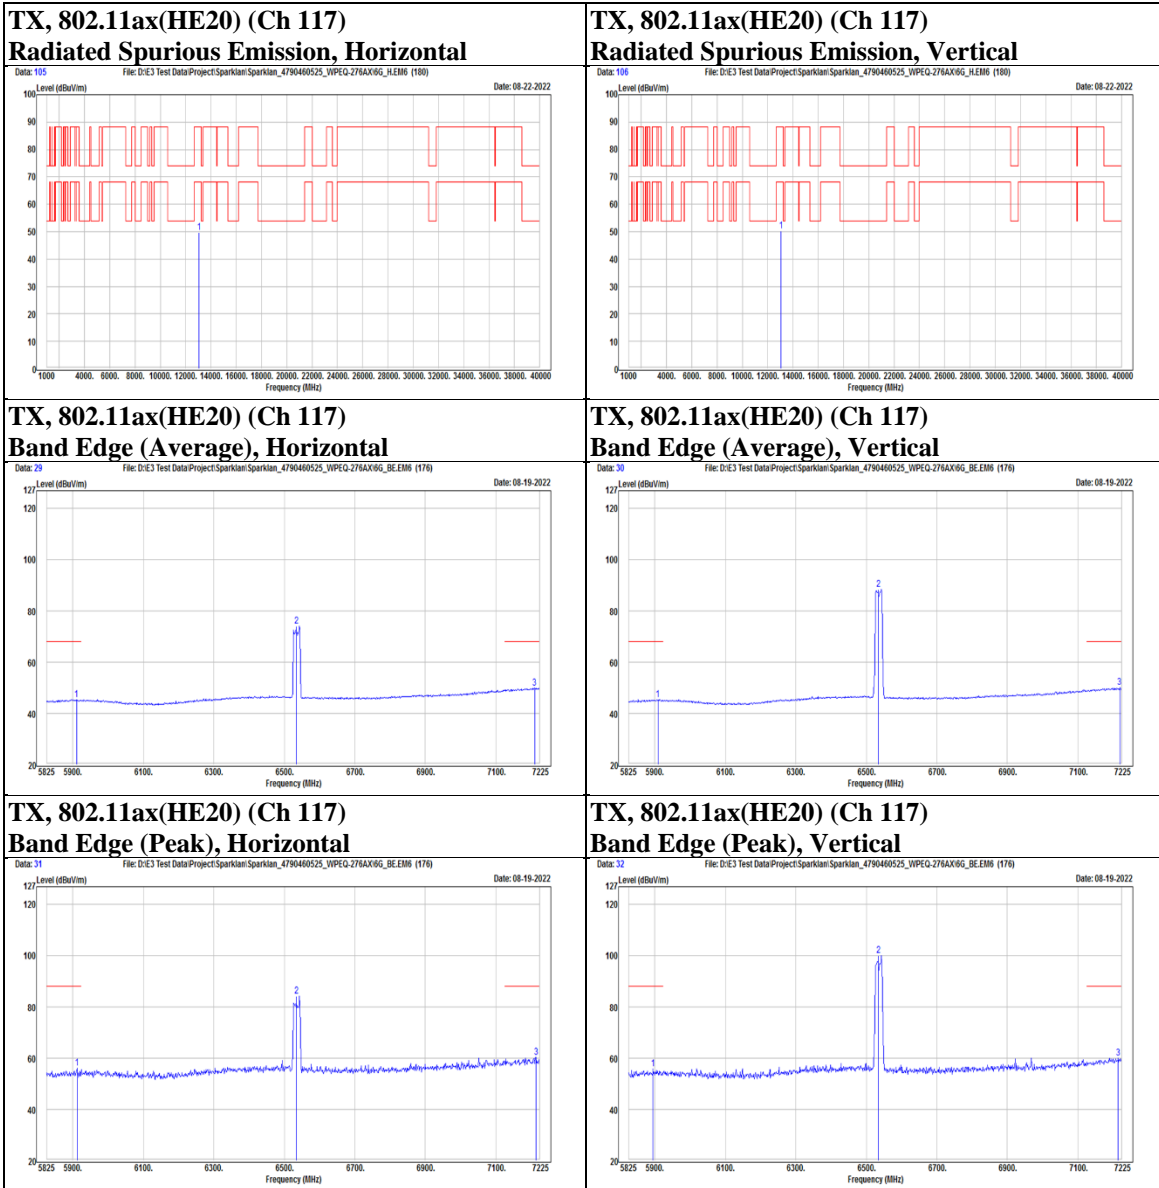

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 123 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 149 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5874 | 40.8 | 14.79 | 55.59 | 88.2 | -32.61 | PK |
| | | 5892.2 | 30.55 | 14.92 | 45.47 | 68.2 | -22.73 | AVG |
| | @ | 6695 | 64.83 | 17.5 | 82.33 | N/A | N/A | PK |
| | @ | 6695 | 55.71 | 17.5 | 73.21 | N/A | N/A | AVG |
| | | 7209.6 | 40.83 | 20.18 | 61.01 | 88.2 | -27.19 | PK |
| | | 7225 | 29.81 | 20.26 | 50.07 | 68.2 | -18.13 | AVG |
| | * | 13390 | 29.75 | 22.07 | 51.82 | 74 | -22.18 | PK |
| Vertical | | 5890.8 | 30.53 | 14.91 | 45.44 | 68.2 | -22.76 | AVG |
| | | 5924.4 | 40.76 | 14.96 | 55.72 | 88.2 | -32.48 | PK |
| | @ | 6695 | 81.89 | 17.5 | 99.39 | N/A | N/A | PK |
| | @ | 6695 | 71.17 | 17.5 | 88.67 | N/A | N/A | AVG |
| | | 7197 | 41.22 | 20.11 | 61.33 | 88.2 | -26.87 | PK |
| | | 7218 | 29.81 | 20.22 | 50.03 | 68.2 | -18.17 | AVG |
| | * | 13390 | 29.22 | 22.07 | 51.29 | 74 | -22.71 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

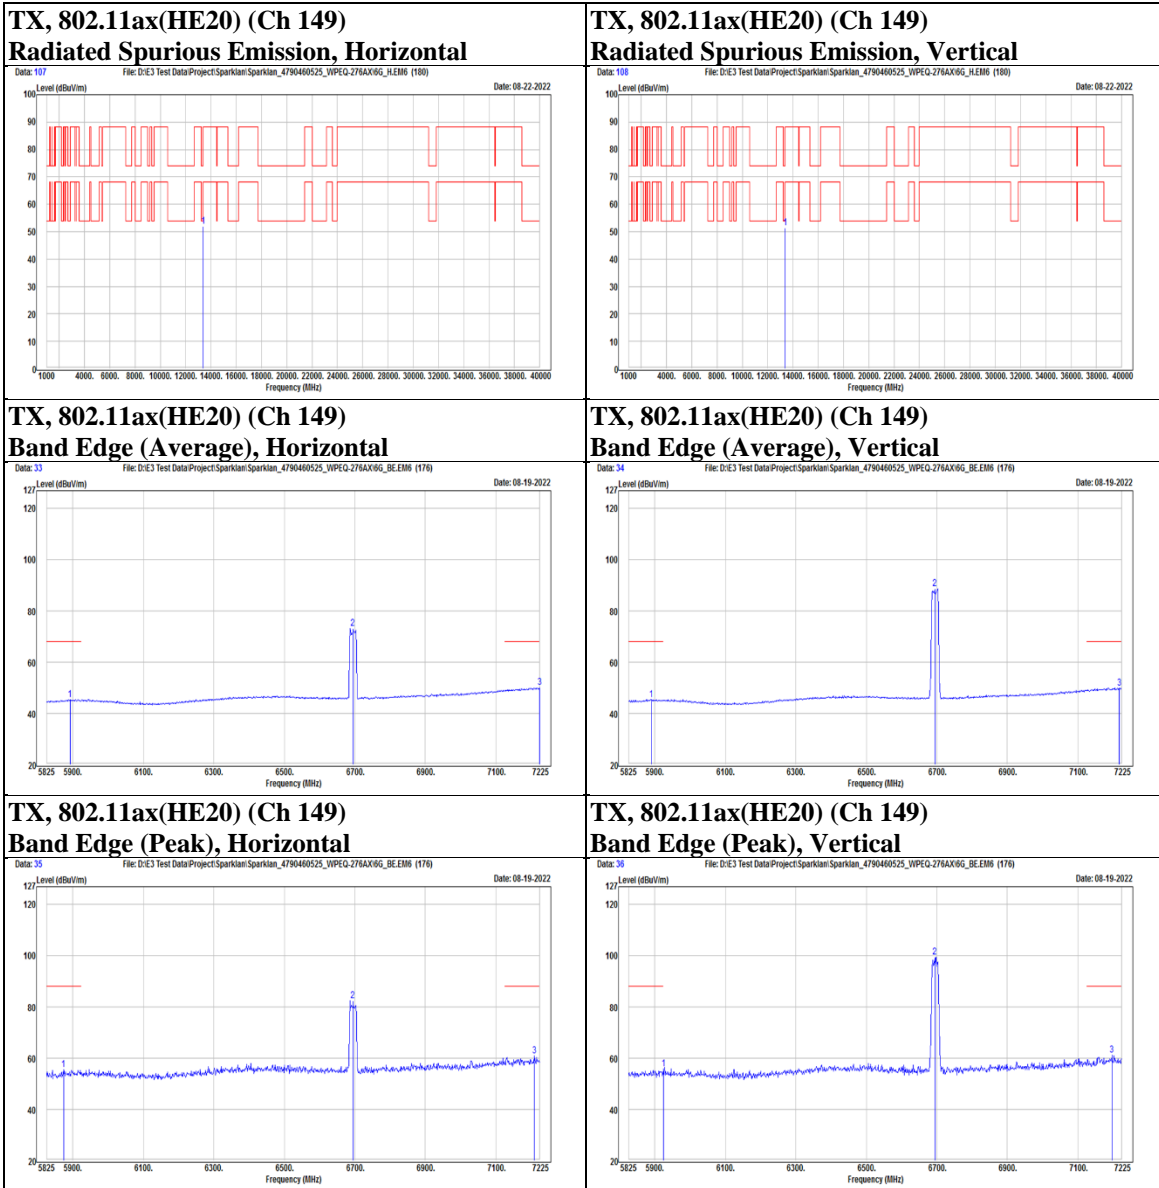



Test report No. : 4790460525-US-R0-V0
Page : 125 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 181 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5913.2 | 30.8 | 14.96 | 45.76 | 68.2 | -22.44 | AVG |
| | | 5920.2 | 40.88 | 14.96 | 55.84 | 88.2 | -32.36 | PK |
| | @ | 6855 | 66.06 | 18.28 | 84.34 | N/A | N/A | PK |
| | @ | 6855 | 56.77 | 18.28 | 75.05 | N/A | N/A | AVG |
| | | 7194.2 | 41.77 | 20.1 | 61.87 | 88.2 | -26.33 | PK |
| | | 7222.2 | 29.97 | 20.25 | 50.22 | 68.2 | -17.98 | AVG |
| | * | 13710 | 29.3 | 22.78 | 52.08 | 88.2 | -36.12 | PK |
| Vertical | | 5890.8 | 41.67 | 14.91 | 56.58 | 88.2 | -31.62 | PK |
| | | 5904.8 | 30.53 | 14.97 | 45.5 | 68.2 | -22.7 | AVG |
| | @ | 6855 | 81.89 | 18.28 | 100.17 | N/A | N/A | PK |
| | @ | 6855 | 71.58 | 18.28 | 89.86 | N/A | N/A | AVG |
| | | 7199.8 | 40.28 | 20.12 | 60.4 | 88.2 | -27.8 | PK |
| | | 7215.2 | 29.76 | 20.21 | 49.97 | 68.2 | -18.23 | AVG |
| | * | 13710 | 28.48 | 22.78 | 51.26 | 88.2 | -36.94 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

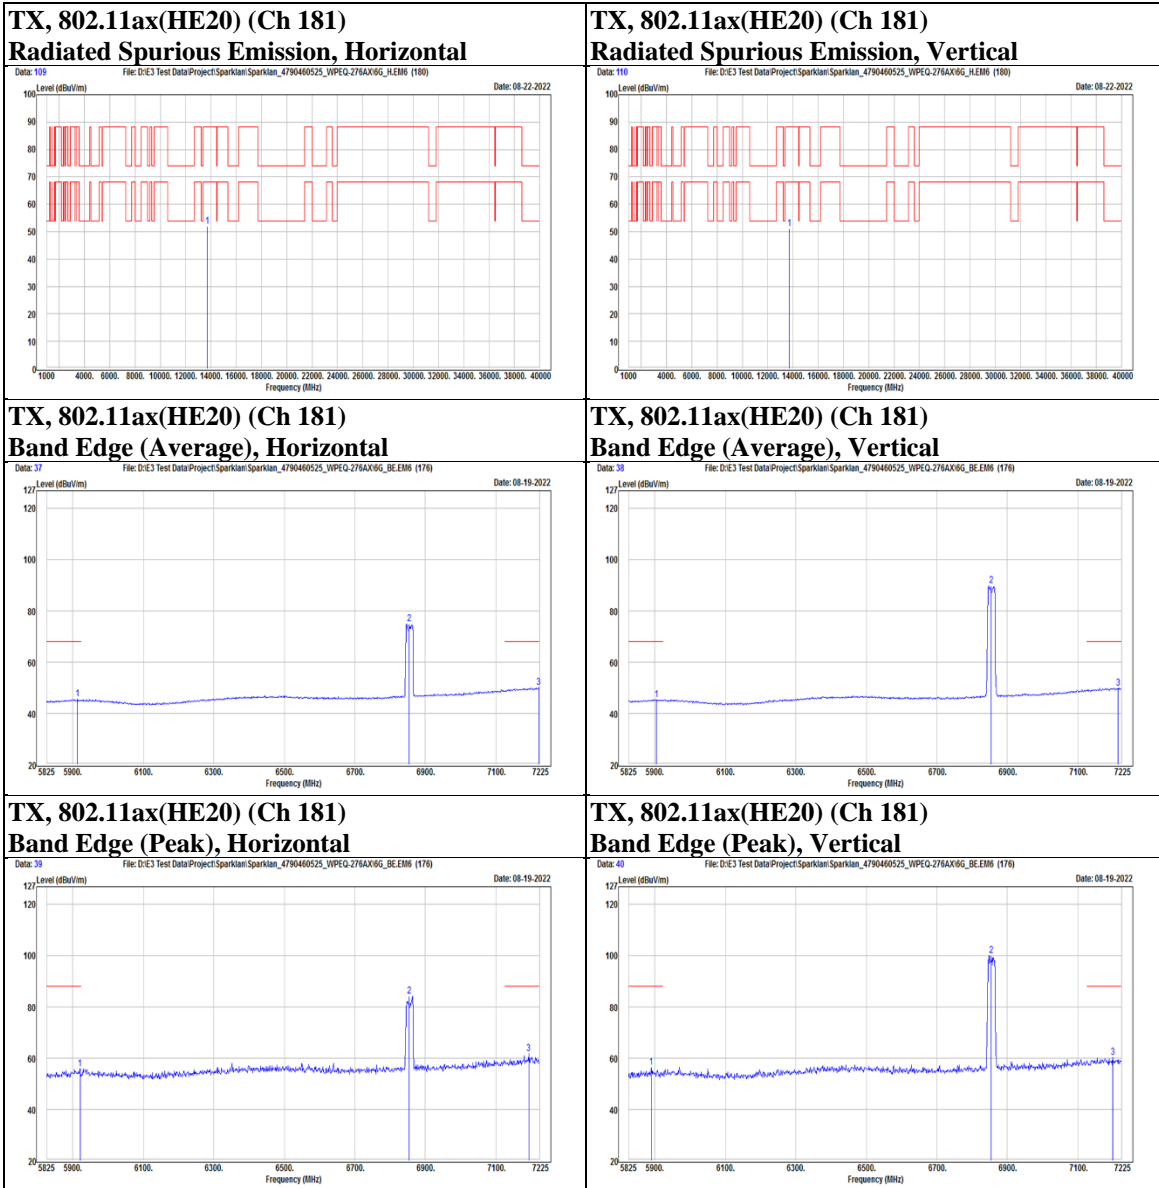

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 127 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 185 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5896.4 | 40.8 | 14.95 | 55.75 | 88.2 | -32.45 | PK |
| | | 5918.8 | 30.55 | 14.96 | 45.51 | 68.2 | -22.69 | AVG |
| | @ | 6875 | 66.65 | 18.3 | 84.95 | N/A | N/A | PK |
| | @ | 6875 | 55.18 | 18.3 | 73.48 | N/A | N/A | AVG |
| | | 7220.8 | 39.56 | 20.23 | 59.79 | 88.2 | -28.41 | PK |
| | | 7220.8 | 29.67 | 20.23 | 49.9 | 68.2 | -18.3 | AVG |
| | * | 13750 | 28.89 | 22.94 | 51.83 | 88.2 | -36.37 | PK |
| Vertical | | 5892.2 | 40.74 | 14.92 | 55.66 | 88.2 | -32.54 | PK |
| | | 5910.4 | 30.66 | 14.97 | 45.63 | 68.2 | -22.57 | AVG |
| | @ | 6875 | 82.22 | 18.3 | 100.52 | N/A | N/A | PK |
| | @ | 6875 | 70.42 | 18.3 | 88.72 | N/A | N/A | AVG |
| | | 7213.8 | 29.87 | 20.2 | 50.07 | 68.2 | -18.13 | AVG |
| | | 7216.6 | 40.59 | 20.22 | 60.81 | 88.2 | -27.39 | PK |
| | * | 13750 | 28.26 | 22.94 | 51.2 | 88.2 | -37 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

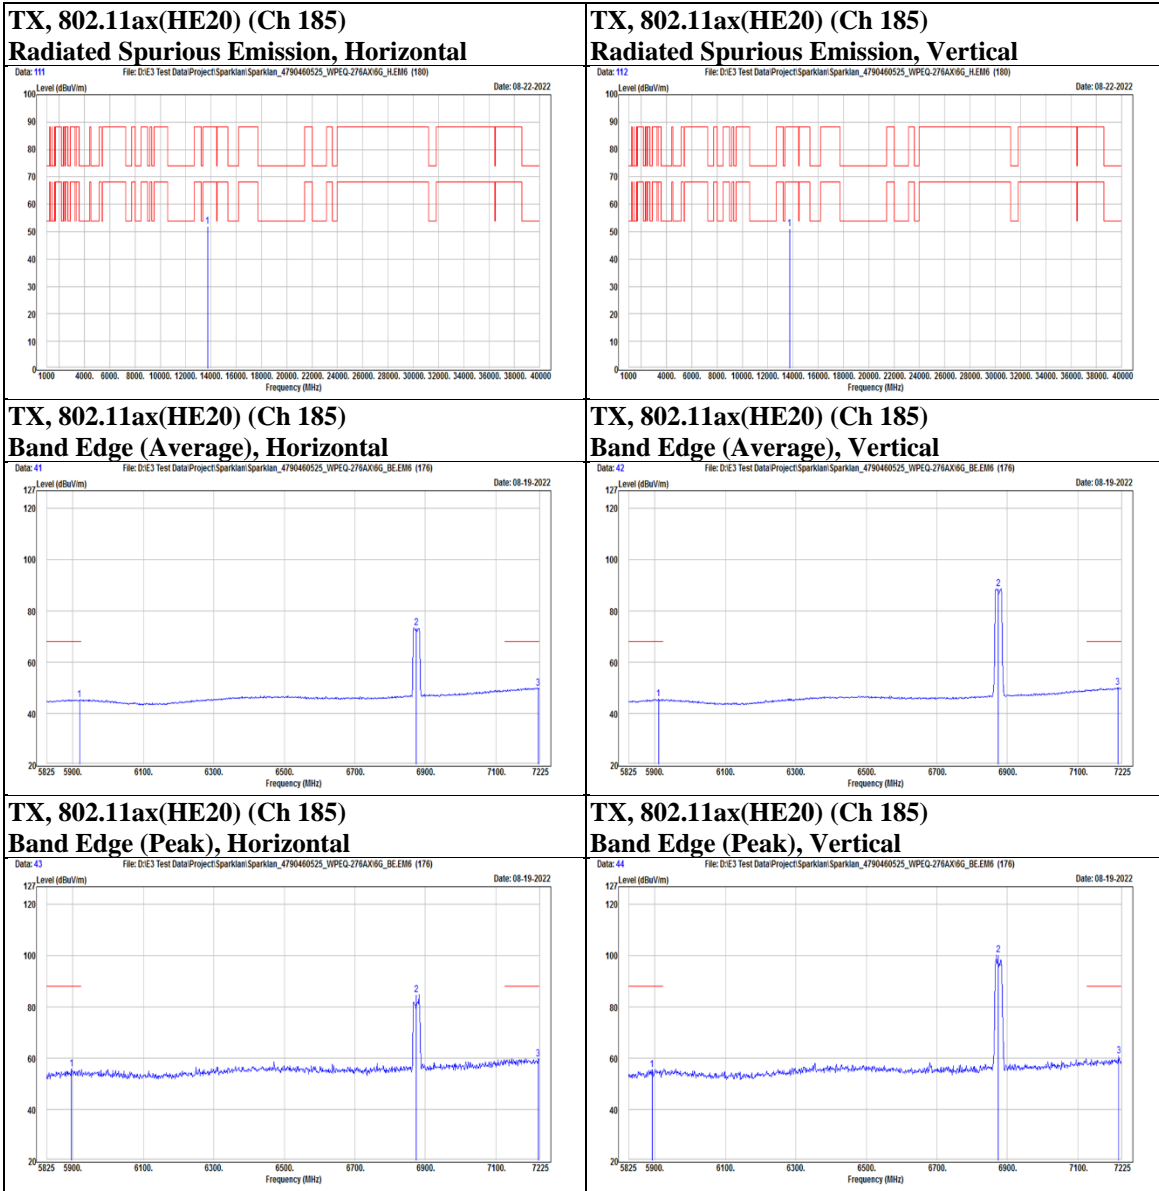

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 129 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 209 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | @ | 6995 | 64.63 | 18.71 | 83.34 | N/A | N/A | PK |
| | @ | 6995 | 56.17 | 18.71 | 74.88 | N/A | N/A | AVG |
| | | 7208.2 | 30.11 | 20.17 | 50.28 | 68.2 | -17.92 | AVG |
| | | 7225 | 39.89 | 20.26 | 60.15 | 88.2 | -28.05 | PK |
| | * | 13990 | 28.57 | 23.87 | 52.44 | 88.2 | -35.76 | PK |
| Vertical | @ | 6995 | 81.06 | 18.71 | 99.77 | N/A | N/A | PK |
| | @ | 6995 | 71.23 | 18.71 | 89.94 | N/A | N/A | AVG |
| | | 7202.6 | 40.3 | 20.14 | 60.44 | 88.2 | -27.76 | PK |
| | | 7219.4 | 29.66 | 20.23 | 49.89 | 68.2 | -18.31 | AVG |
| | * | 13990 | 28.43 | 23.87 | 52.3 | 88.2 | -35.9 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

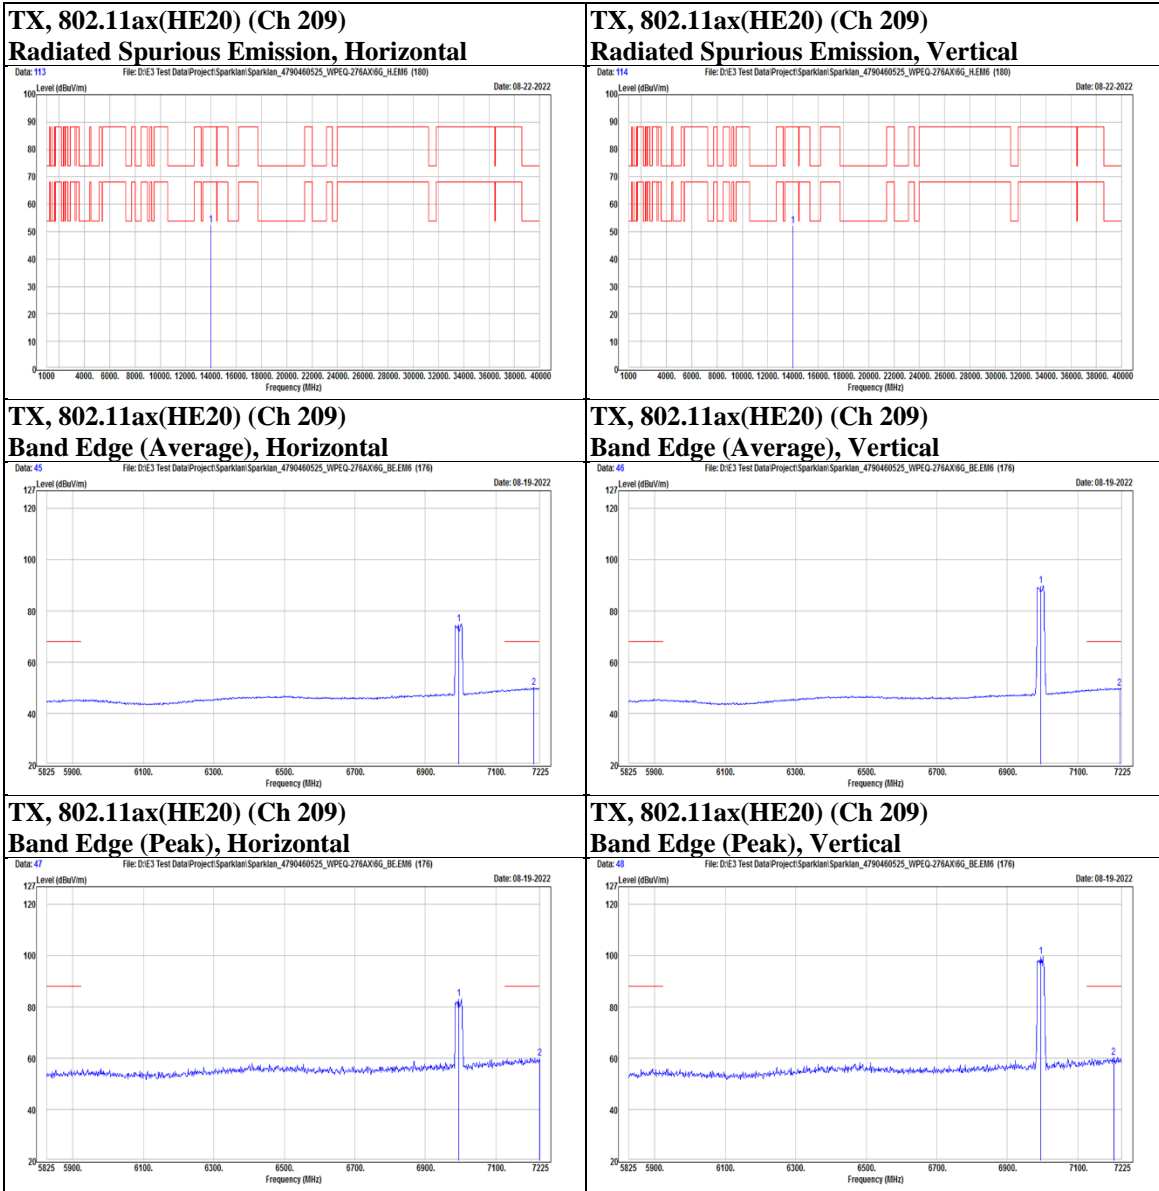



Test report No. : 4790460525-US-R0-V0
Page : 131 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 229 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | @ | 7095 | 64.88 | 19.54 | 84.42 | N/A | N/A | PK |
| | @ | 7095 | 55.46 | 19.54 | 75 | N/A | N/A | AVG |
| | | 7185.8 | 40.43 | 20.04 | 60.47 | 88.2 | -27.73 | PK |
| | | 7202.6 | 29.84 | 20.14 | 49.98 | 68.2 | -18.22 | AVG |
| | * | 14190 | 28.81 | 24.68 | 53.49 | 88.2 | -34.71 | PK |
| Vertical | @ | 7095 | 80.21 | 19.54 | 99.75 | N/A | N/A | PK |
| | @ | 7095 | 70.64 | 19.54 | 90.18 | N/A | N/A | AVG |
| | | 7215.2 | 41.07 | 20.21 | 61.28 | 88.2 | -26.92 | PK |
| | | 7218 | 29.73 | 20.22 | 49.95 | 68.2 | -18.25 | AVG |
| | * | 14190 | 28.63 | 24.68 | 53.31 | 88.2 | -34.89 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

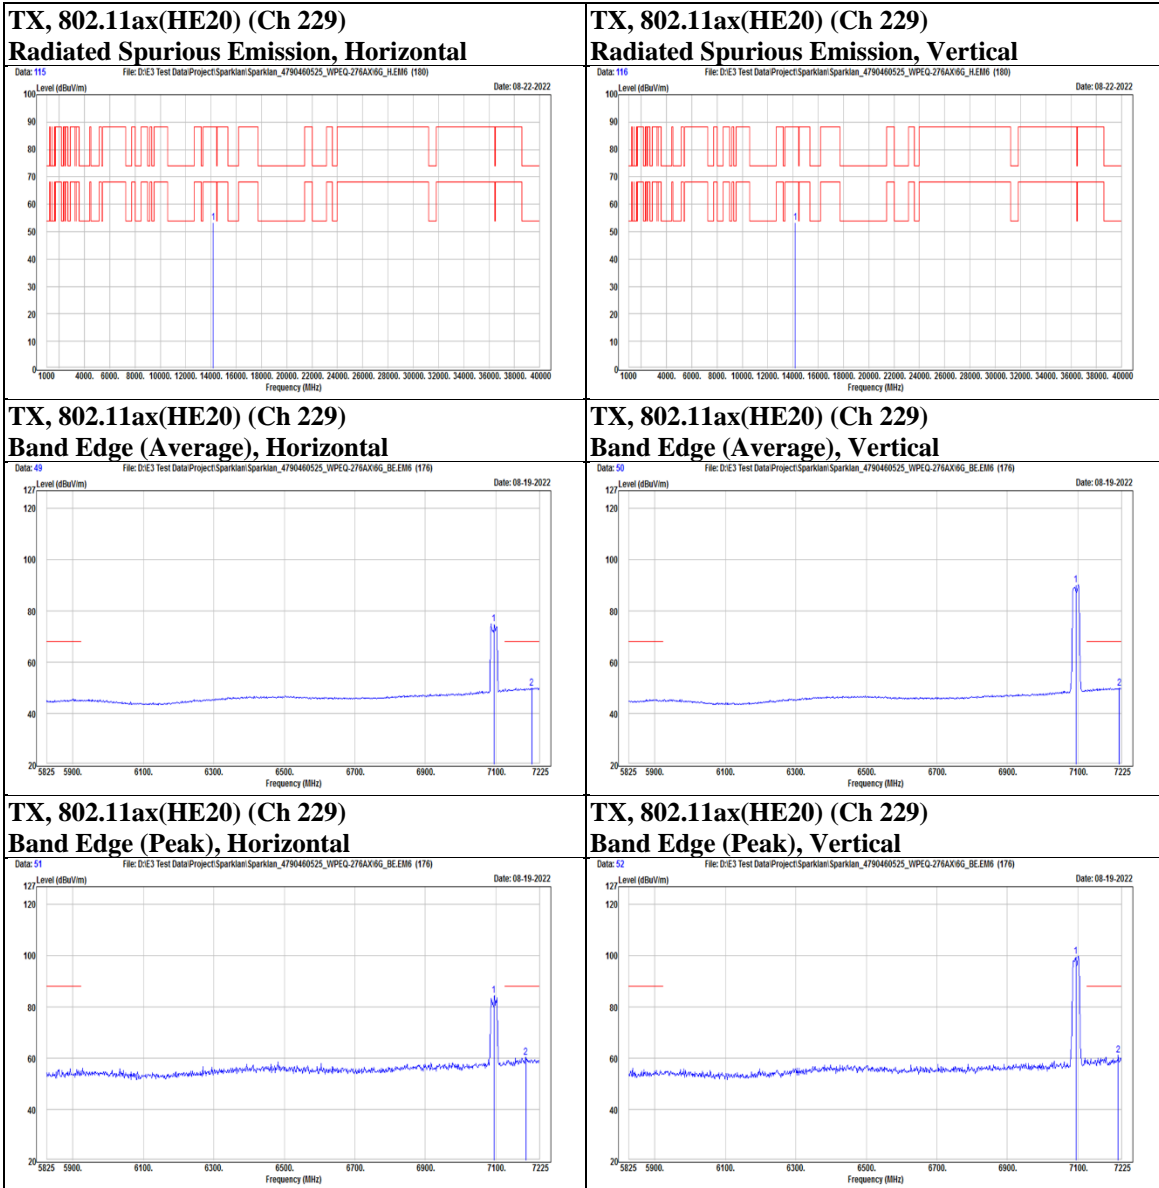

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 133 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|-----|
| Mode | 802.11ax(HE20) | Channel | 233 |
|------|----------------|---------|-----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | @ | 7115 | 64.94 | 19.66 | 84.6 | N/A | N/A | PK |
| | @ | 7115 | 55.64 | 19.66 | 75.3 | N/A | N/A | AVG |
| | | 7125.6 | 53.88 | 19.72 | 73.6 | 88.2 | -14.6 | PK |
| | | 7125.6 | 41.13 | 19.72 | 60.85 | 68.2 | -7.35 | AVG |
| | * | 14230 | 28.64 | 24.79 | 53.43 | 88.2 | -34.77 | PK |
| Vertical | @ | 7115 | 79.51 | 19.66 | 99.17 | N/A | N/A | PK |
| | @ | 7115 | 69.72 | 19.66 | 89.38 | N/A | N/A | AVG |
| | | 7125.6 | 60.27 | 19.72 | 79.99 | 88.2 | -8.21 | PK |
| | | 7125.6 | 43.65 | 19.72 | 63.37 | 68.2 | -4.83 | AVG |
| | * | 14230 | 29.56 | 24.79 | 54.35 | 88.2 | -33.85 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

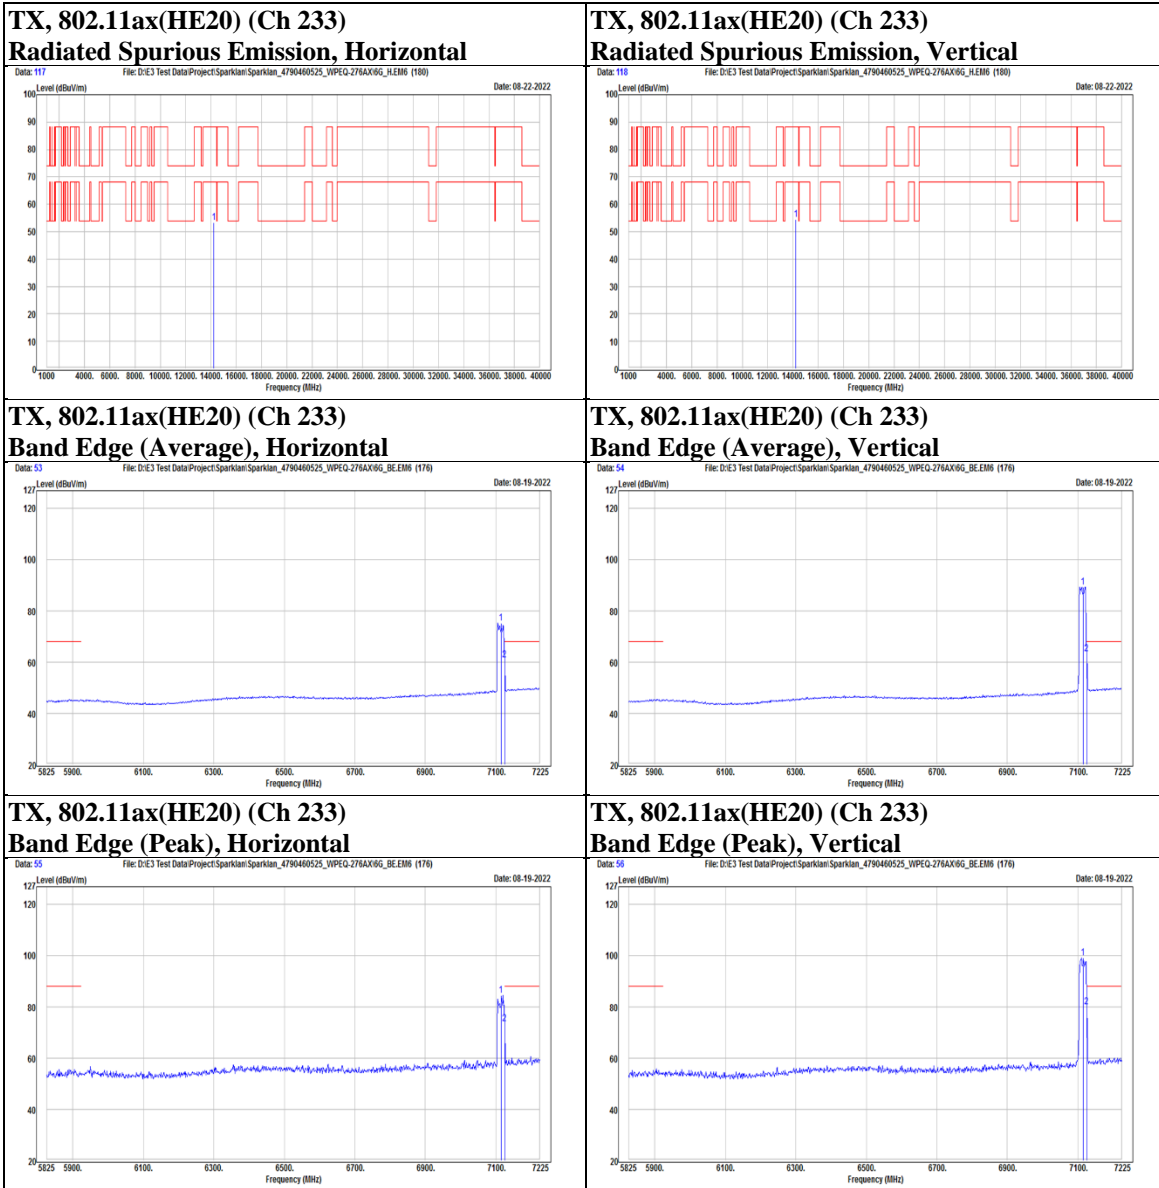

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 135 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|---|
| Mode | 802.11ax(HE40) | Channel | 3 |
|------|----------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5900.6 | 30.36 | 14.98 | 45.34 | 68.2 | -22.86 | AVG |
| | | 5913.2 | 41.13 | 14.96 | 56.09 | 88.2 | -32.11 | PK |
| | @ | 5965 | 71.8 | 14.95 | 86.75 | N/A | N/A | PK |
| | @ | 5965 | 62.8 | 14.95 | 77.75 | N/A | N/A | AVG |
| | * | 11930 | 29.33 | 18.83 | 48.16 | 74 | -25.84 | PK |
| Vertical | | 5900.6 | 41.29 | 14.98 | 56.27 | 88.2 | -31.93 | PK |
| | | 5904.8 | 30.59 | 14.97 | 45.56 | 68.2 | -22.64 | AVG |
| | @ | 5965 | 84.44 | 14.95 | 99.39 | N/A | N/A | PK |
| | @ | 5965 | 74.77 | 14.95 | 89.72 | N/A | N/A | AVG |
| | * | 11930 | 29.58 | 18.83 | 48.41 | 74 | -25.59 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

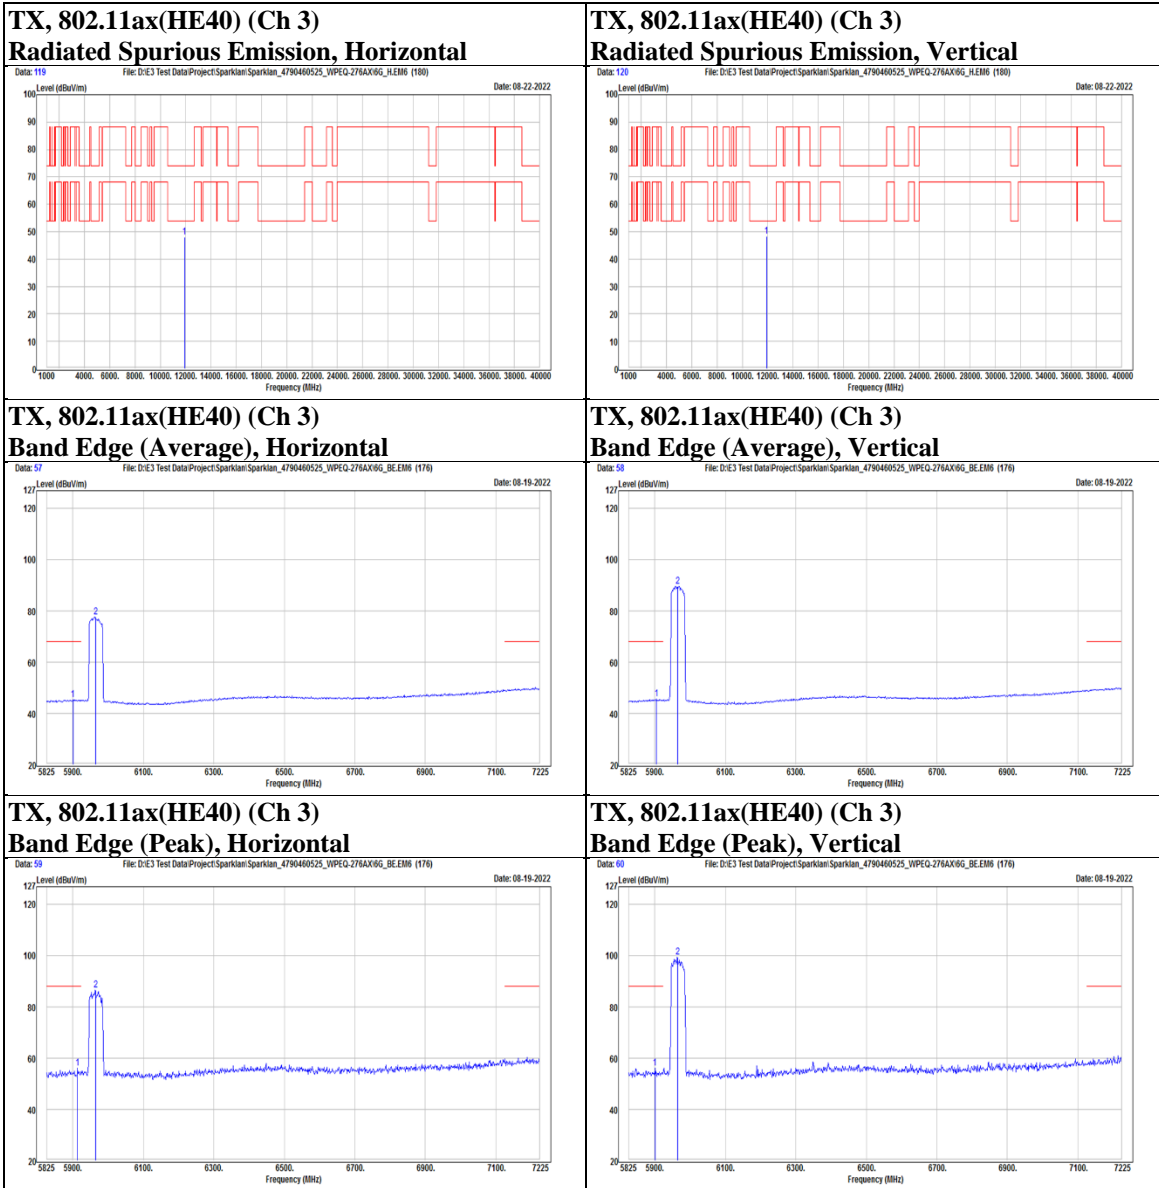

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 137 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|----|
| Mode | 802.11ax(HE40) | Channel | 43 |
|------|----------------|---------|----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5896.4 | 30.81 | 14.95 | 45.76 | 68.2 | -22.44 | AVG |
| | | 5913.2 | 40.45 | 14.96 | 55.41 | 88.2 | -32.79 | PK |
| | @ | 6165 | 68.99 | 15.46 | 84.45 | N/A | N/A | PK |
| | @ | 6165 | 58.22 | 15.46 | 73.68 | N/A | N/A | AVG |
| | * | 12330 | 29.97 | 19.29 | 49.26 | 74 | -24.74 | PK |
| Vertical | | 5886.6 | 40.82 | 14.89 | 55.71 | 88.2 | -32.49 | PK |
| | | 5907.6 | 30.62 | 14.97 | 45.59 | 68.2 | -22.61 | AVG |
| | @ | 6165 | 83.93 | 15.46 | 99.39 | N/A | N/A | PK |
| | @ | 6165 | 72.89 | 15.46 | 88.35 | N/A | N/A | AVG |
| | * | 12330 | 29.33 | 19.29 | 48.62 | 74 | -25.38 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

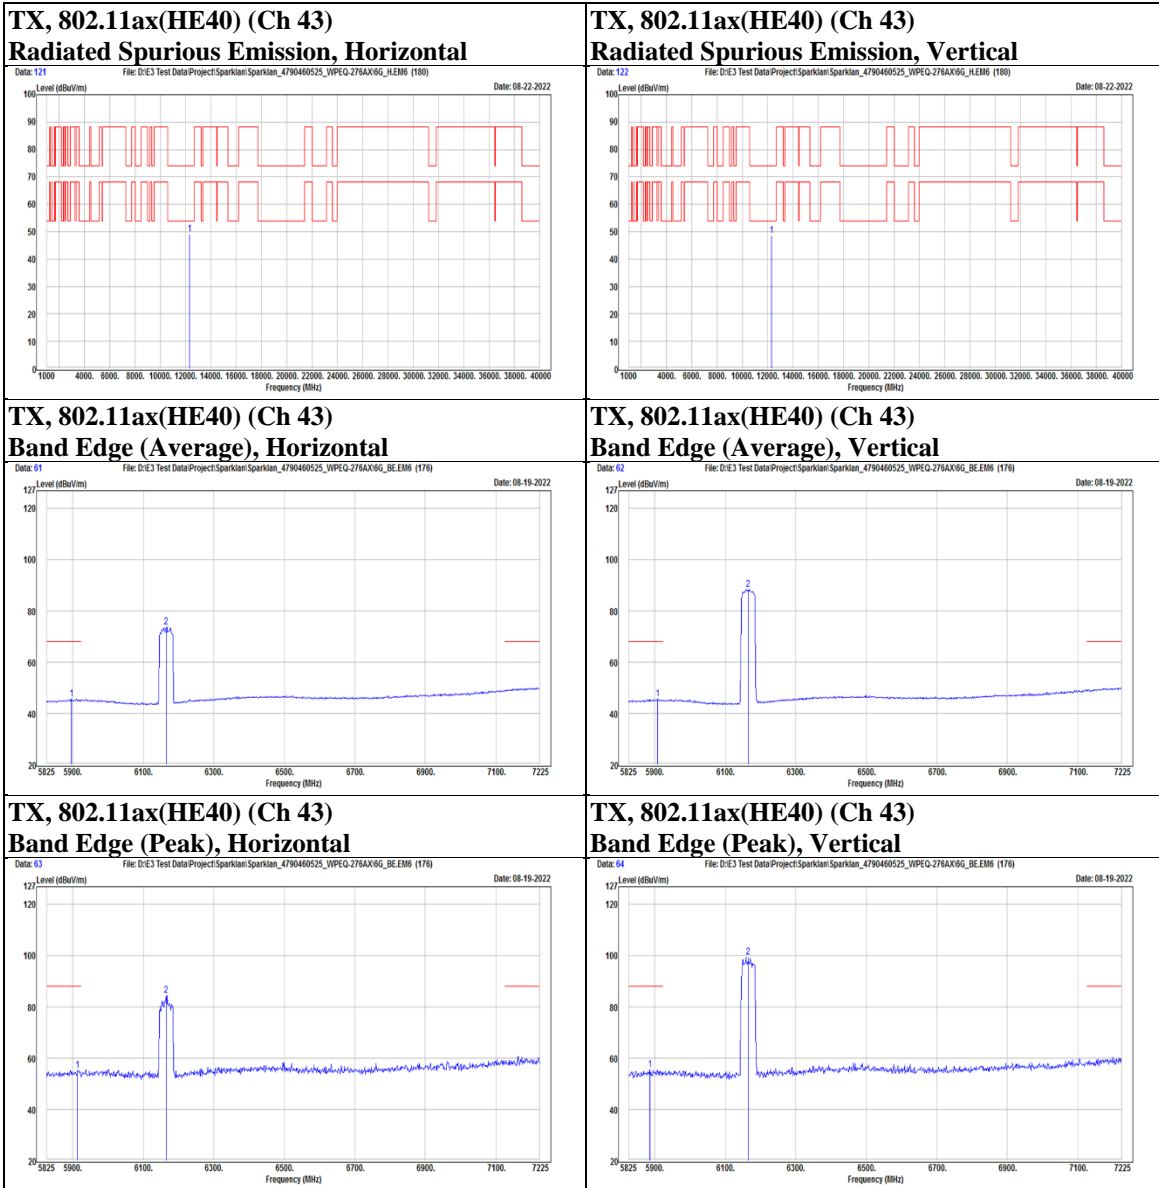

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 139 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

| | | | |
|------|----------------|---------|----|
| Mode | 802.11ax(HE40) | Channel | 91 |
|------|----------------|---------|----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 5914.6 | 30.46 | 14.96 | 45.42 | 68.2 | -22.78 | AVG |
| | | 5924.4 | 41.07 | 14.96 | 56.03 | 88.2 | -32.17 | PK |
| | @ | 6405 | 70.01 | 16.69 | 86.7 | N/A | N/A | PK |
| | @ | 6405 | 60.42 | 16.69 | 77.11 | N/A | N/A | AVG |
| | | 7212.4 | 39.52 | 20.19 | 59.71 | 88.2 | -28.49 | PK |
| | | 7215.2 | 29.74 | 20.21 | 49.95 | 68.2 | -18.25 | AVG |
| | * | 12810 | 29.46 | 20.56 | 50.02 | 88.2 | -38.18 | PK |
| Vertical | | 5829.2 | 40.87 | 14.59 | 55.46 | 88.2 | -32.74 | PK |
| | | 5896.4 | 30.78 | 14.95 | 45.73 | 68.2 | -22.47 | AVG |
| | @ | 6405 | 83.59 | 16.69 | 100.28 | N/A | N/A | PK |
| | @ | 6405 | 72.04 | 16.69 | 88.73 | N/A | N/A | AVG |
| | | 7160.6 | 41.09 | 19.91 | 61 | 88.2 | -27.2 | PK |
| | | 7205.4 | 29.85 | 20.15 | 50 | 68.2 | -18.2 | AVG |
| | * | 12810 | 29.33 | 20.56 | 49.89 | 88.2 | -38.31 | PK |

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0