



Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	I
		Frequency	TX 5180MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	



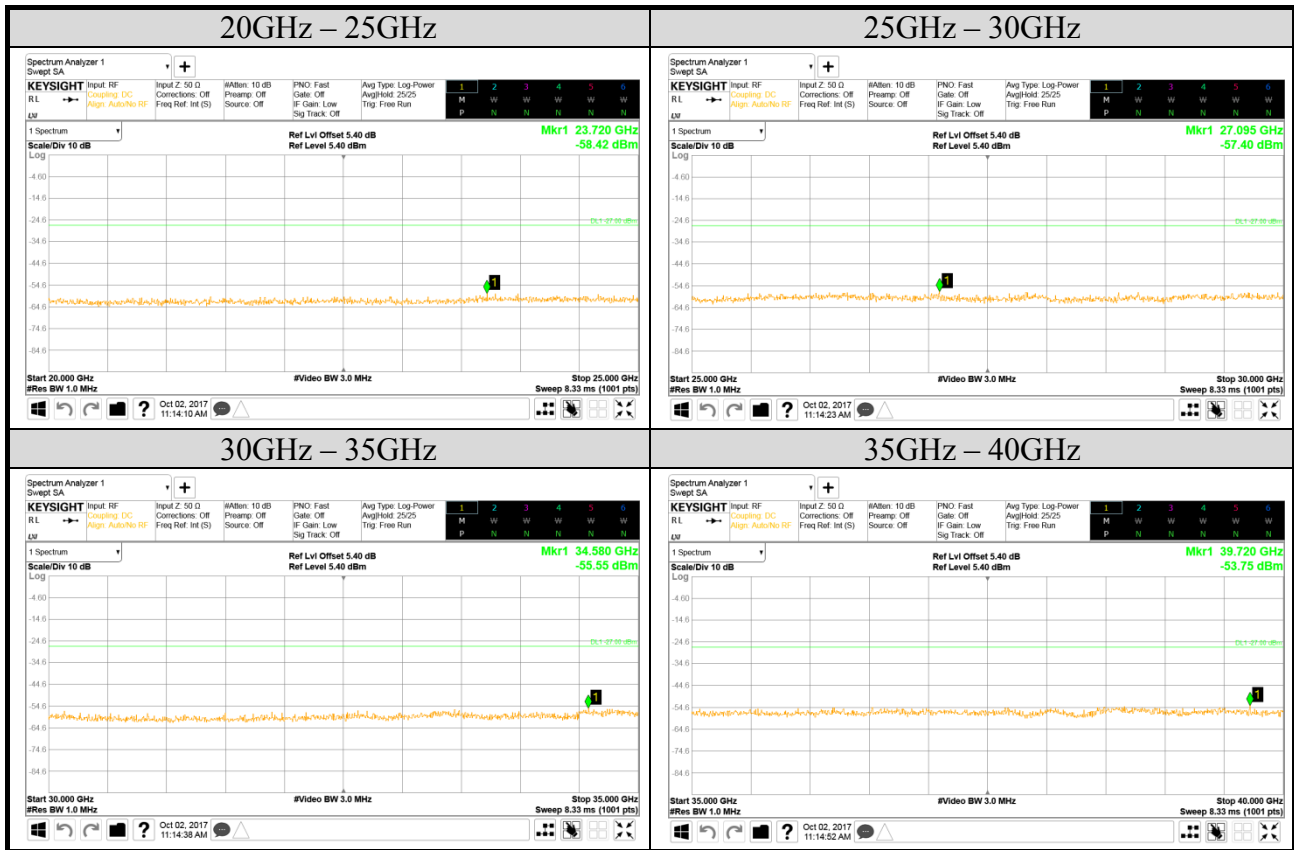



Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	I
		Frequency	TX 5200MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

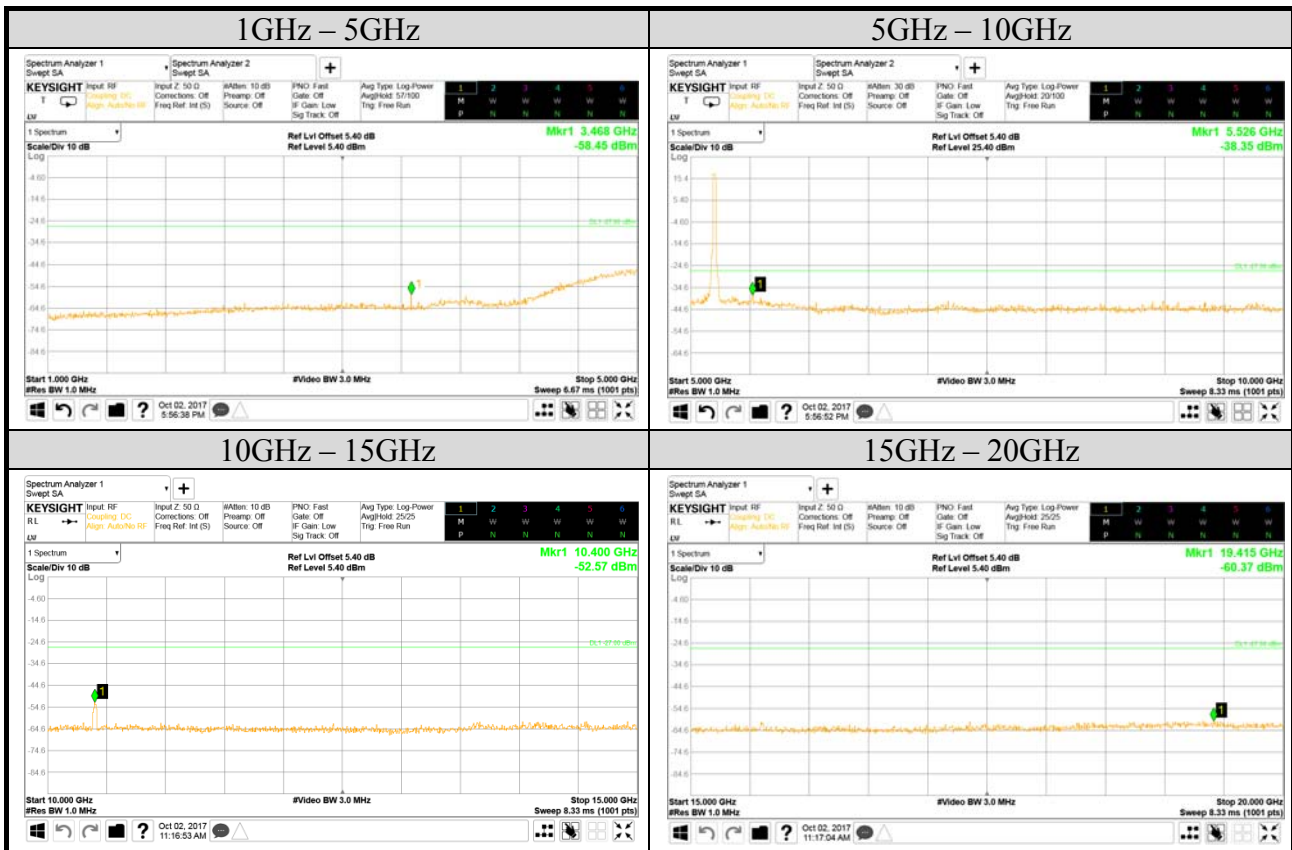





Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	I
		Frequency	TX 5240MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

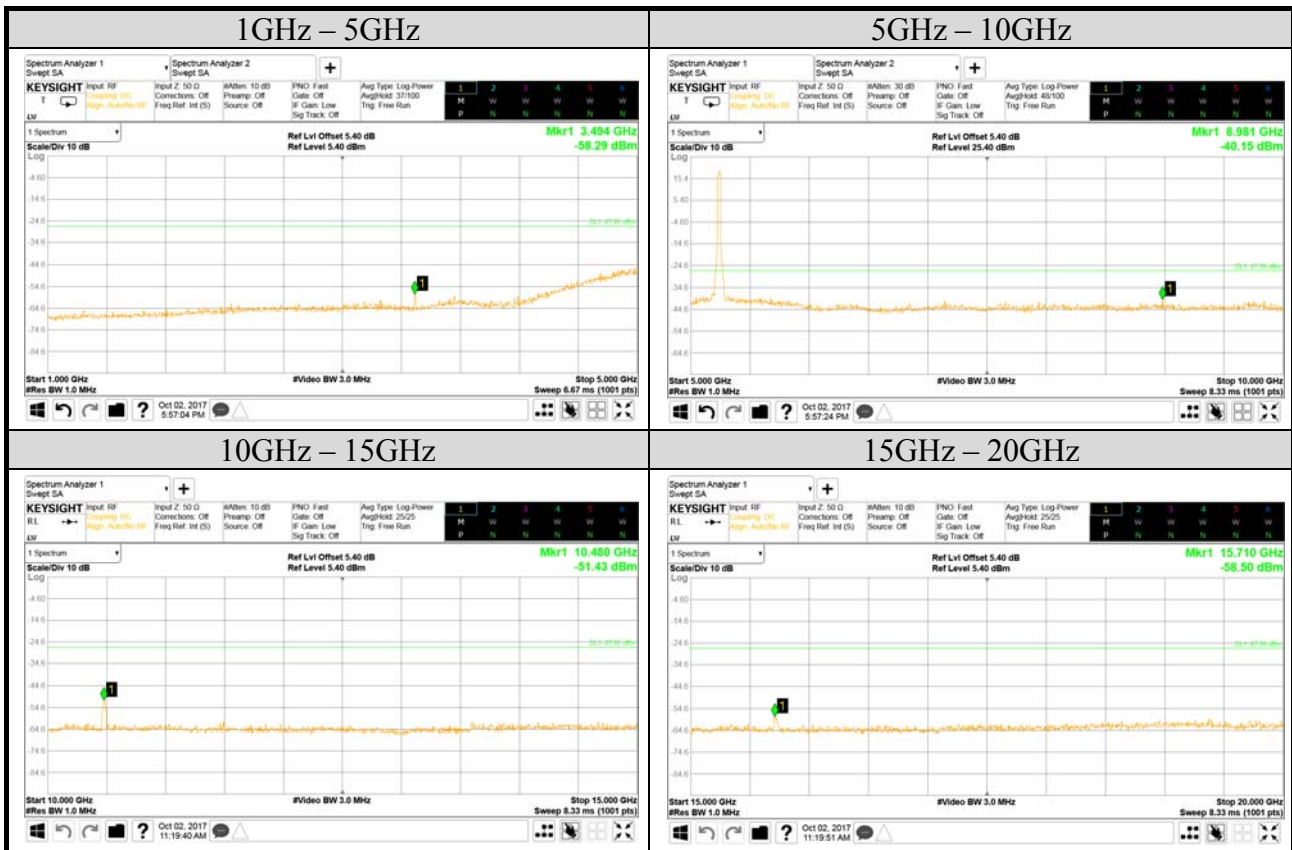

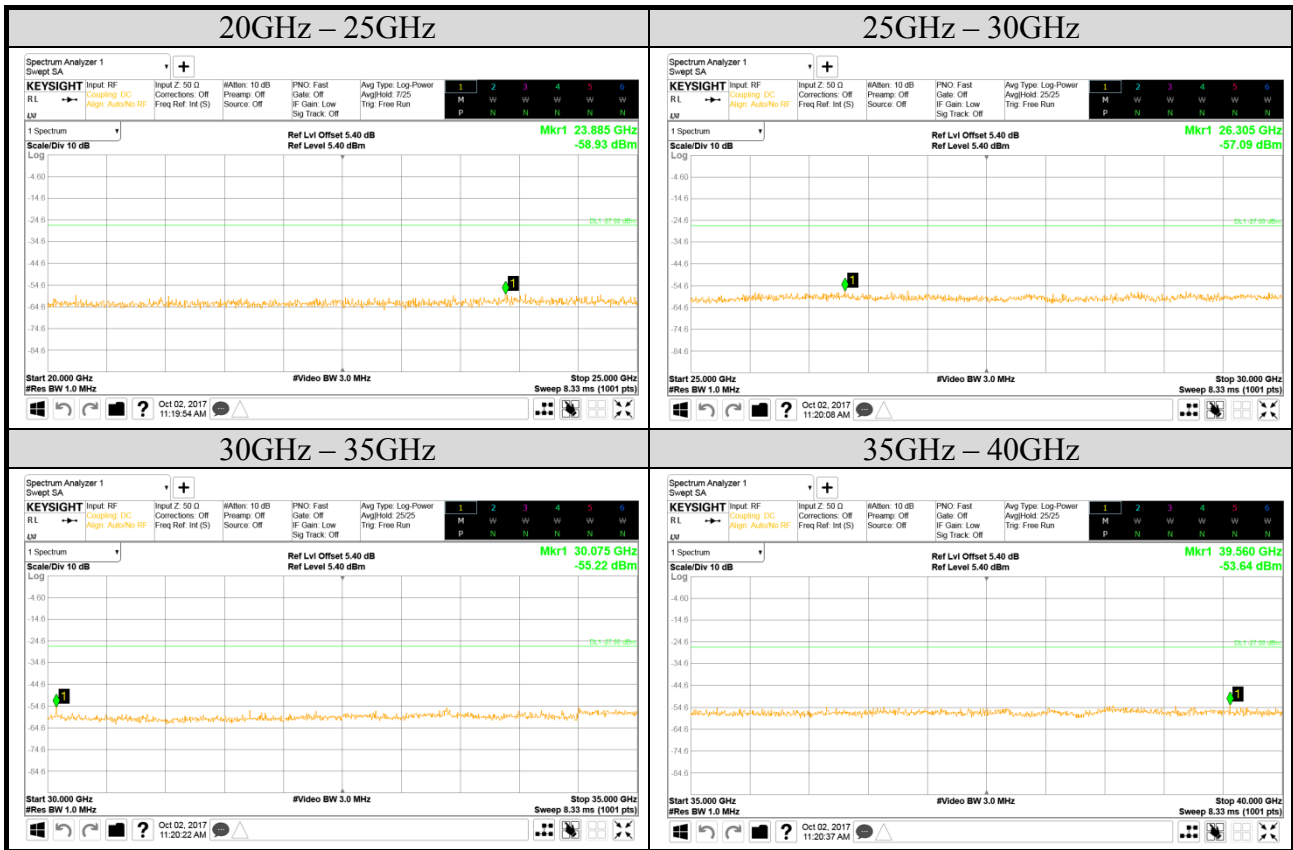

Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	II-2A
		Frequency	TX 5260MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

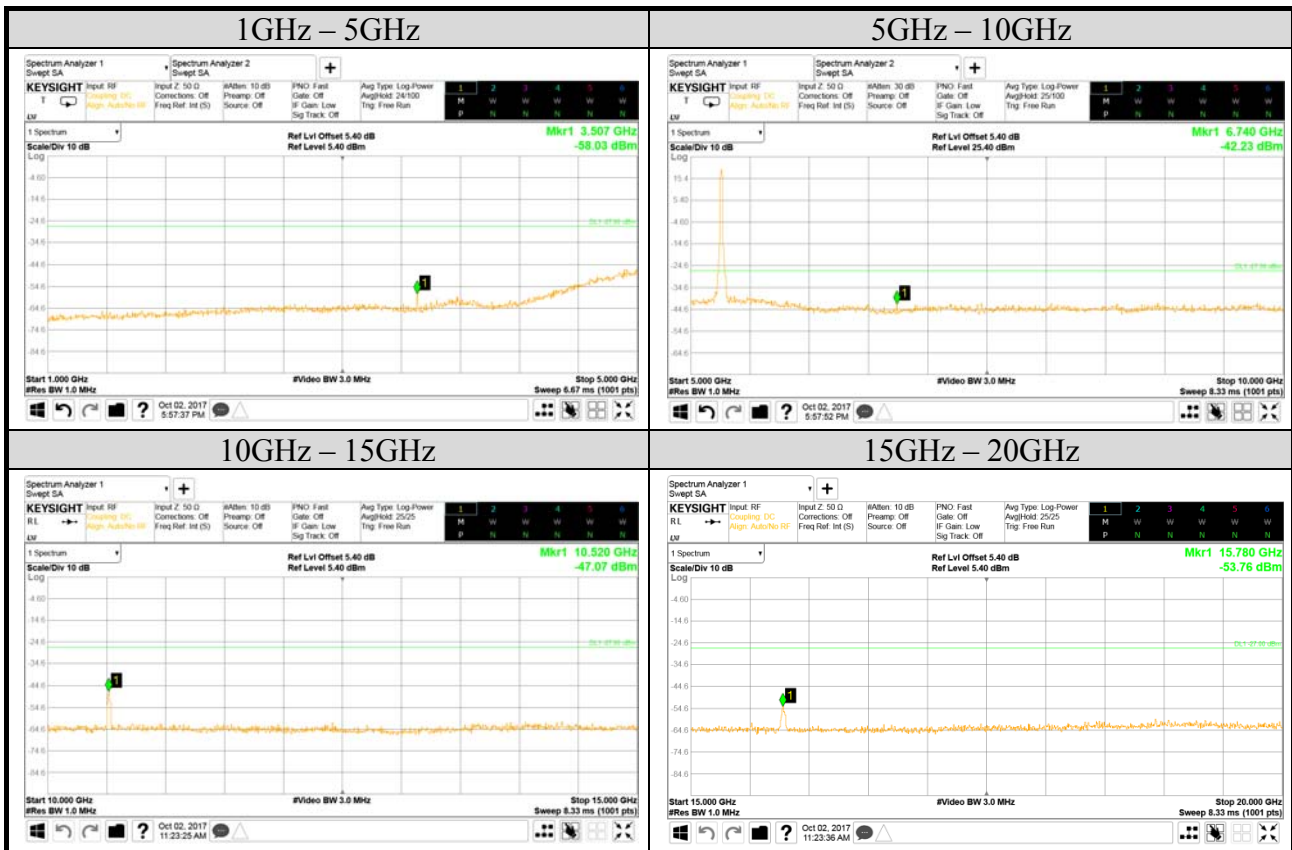

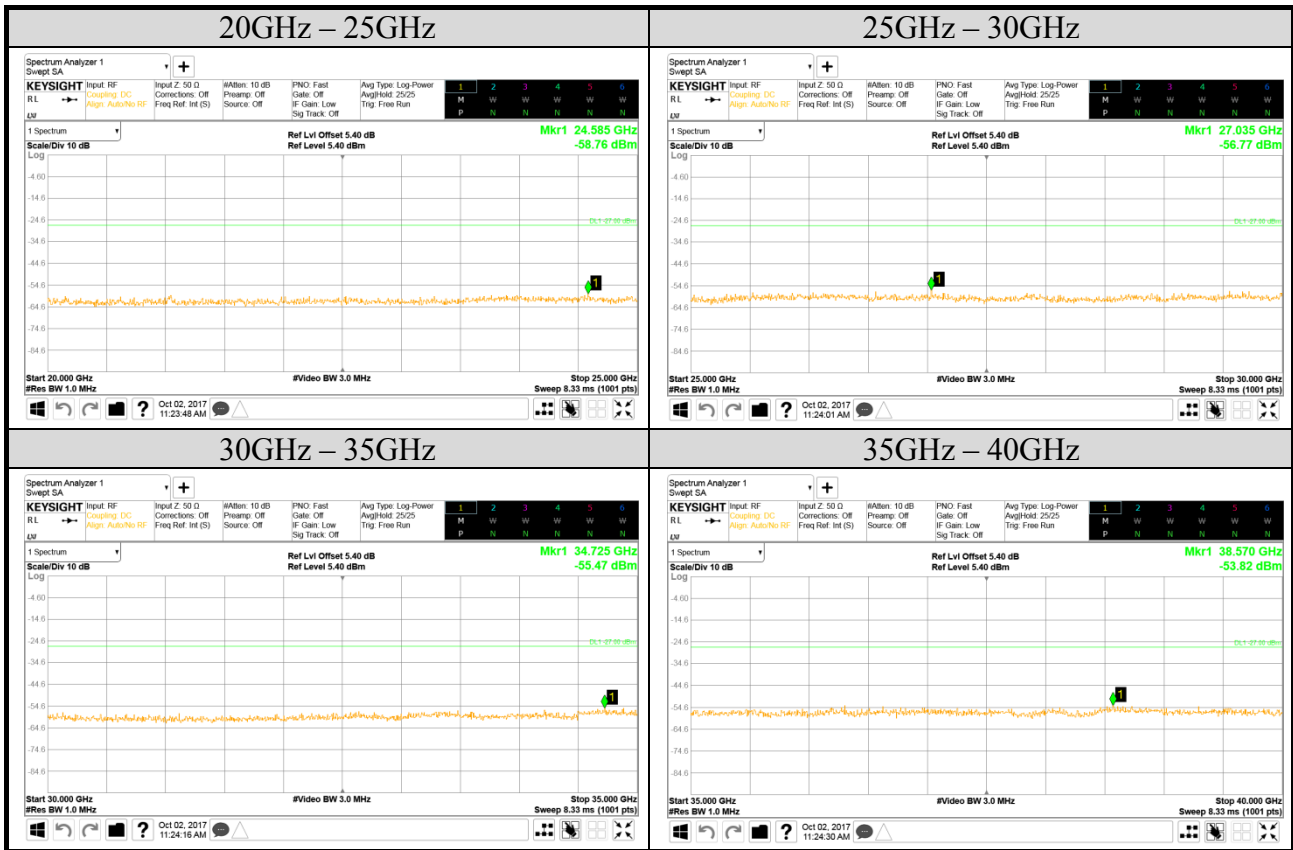





Audix Technology Corp.  
 No. 53-11, Dingfu, Linkou, Dist.,  
 New Taipei City 244, Taiwan

Tel: +886 2 26099301  
 Fax: +886 2 26099303


Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	II-2A
		Frequency	TX 5300MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

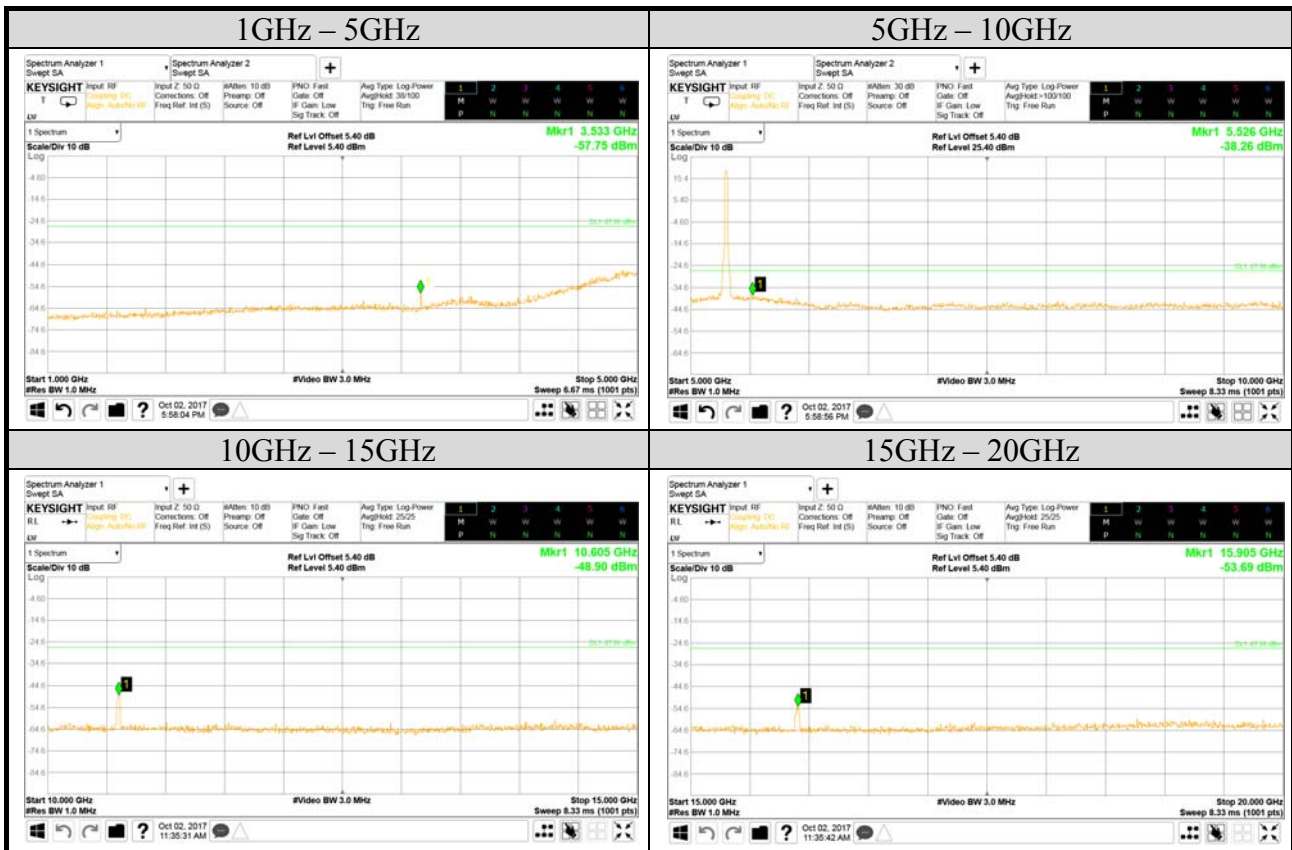

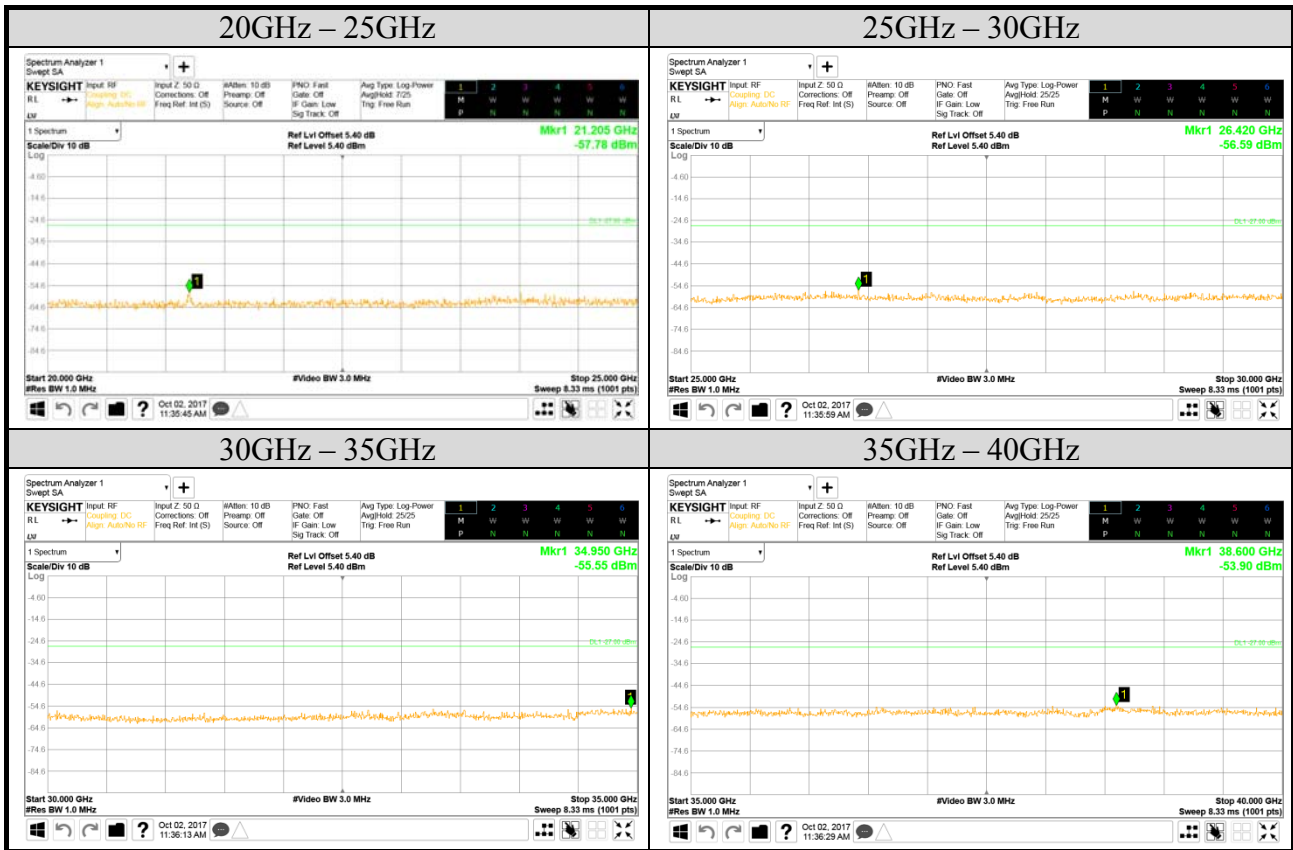


Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	II-2A
		Frequency	TX 5320MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	



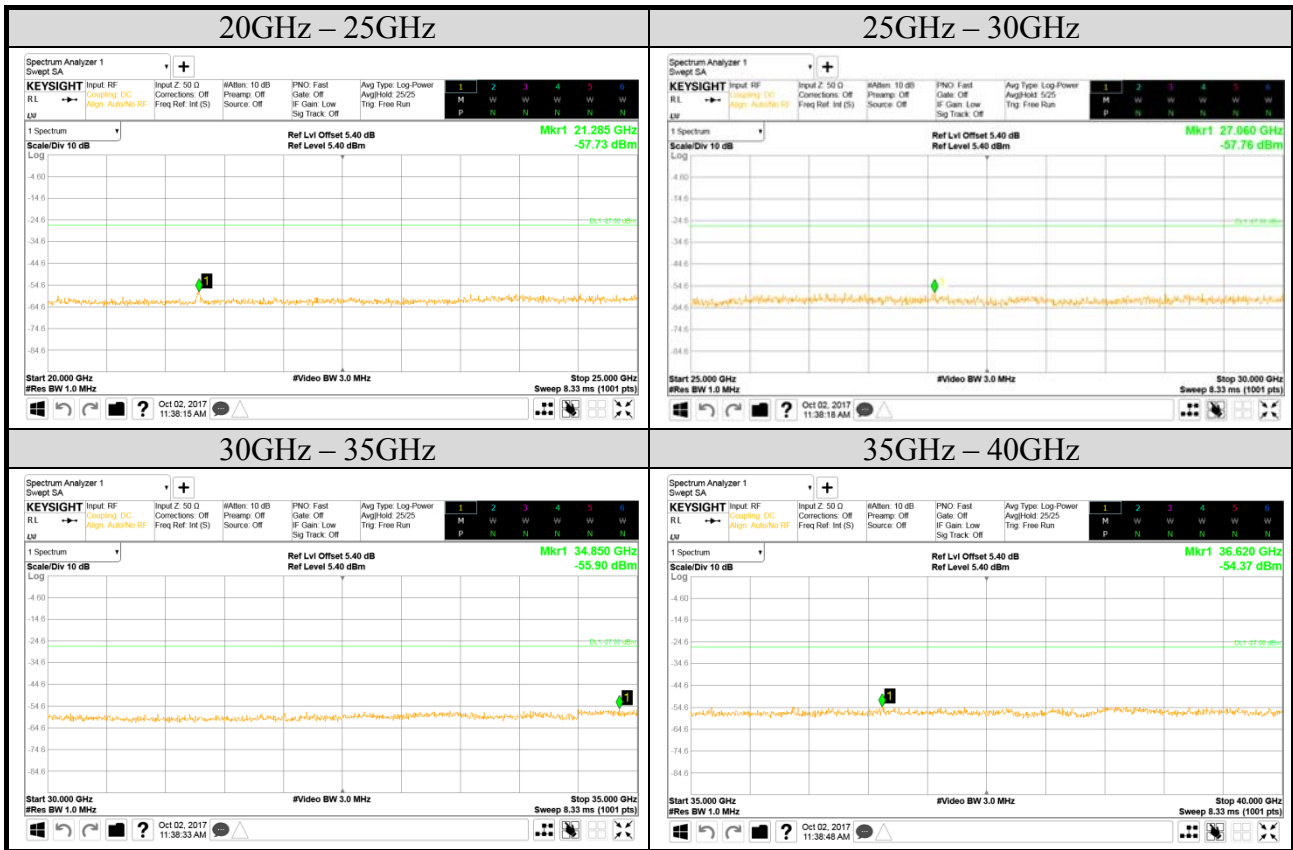


Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	II-2C
		Frequency	TX 5500MHz
Cable Loss	1.6dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	



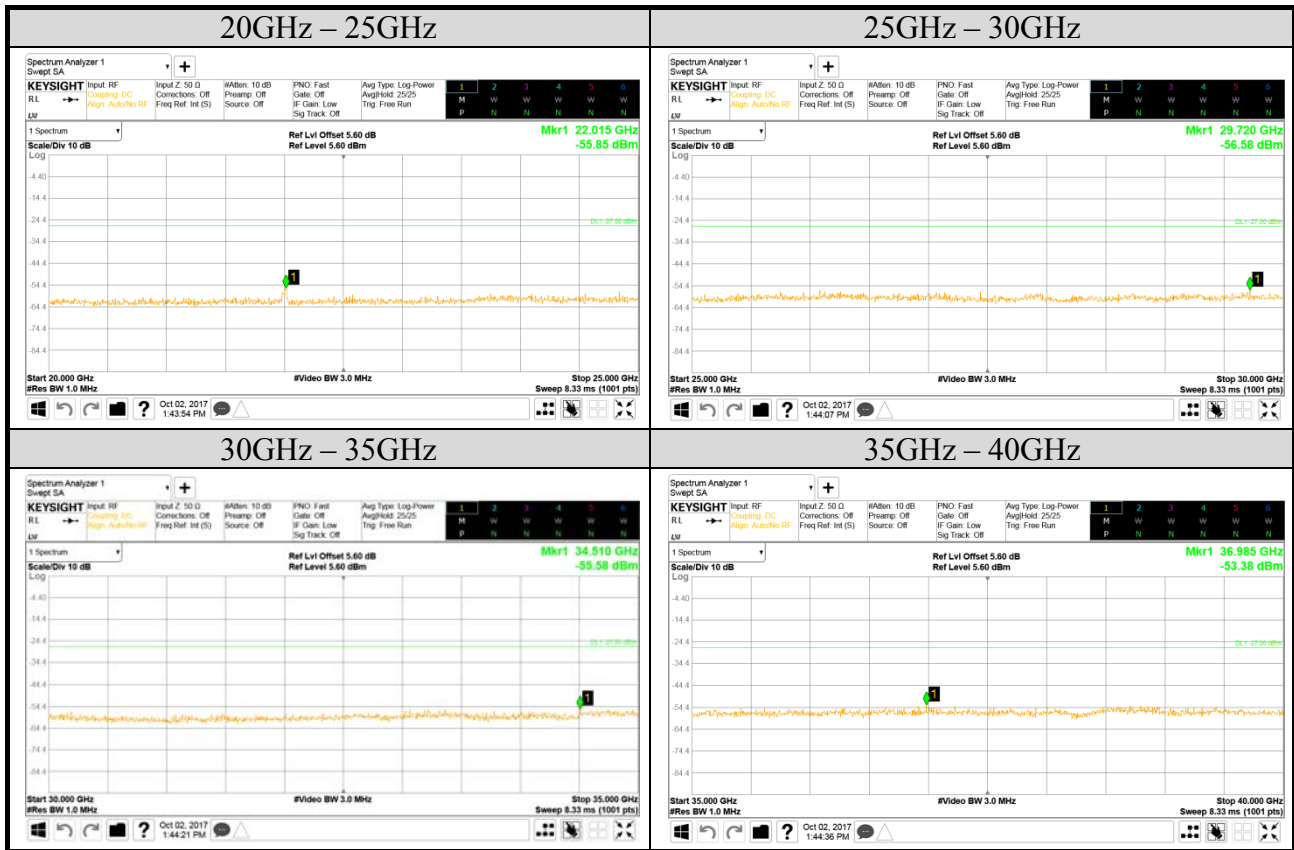


Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	II-2C
		Frequency	TX 5580MHz
Cable Loss	1.6dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

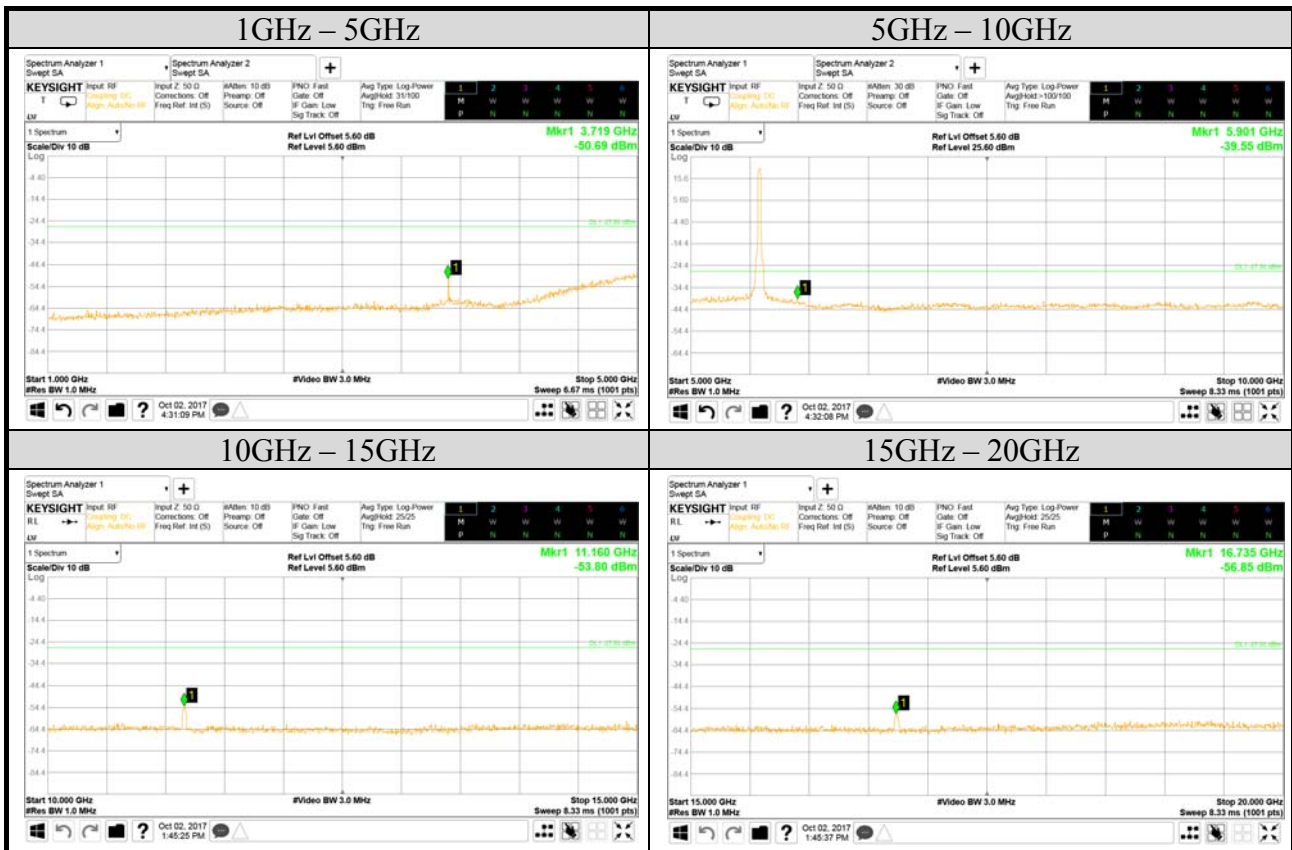







Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	II-2C
		Frequency	TX 5700MHz
Cable Loss	1.6dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

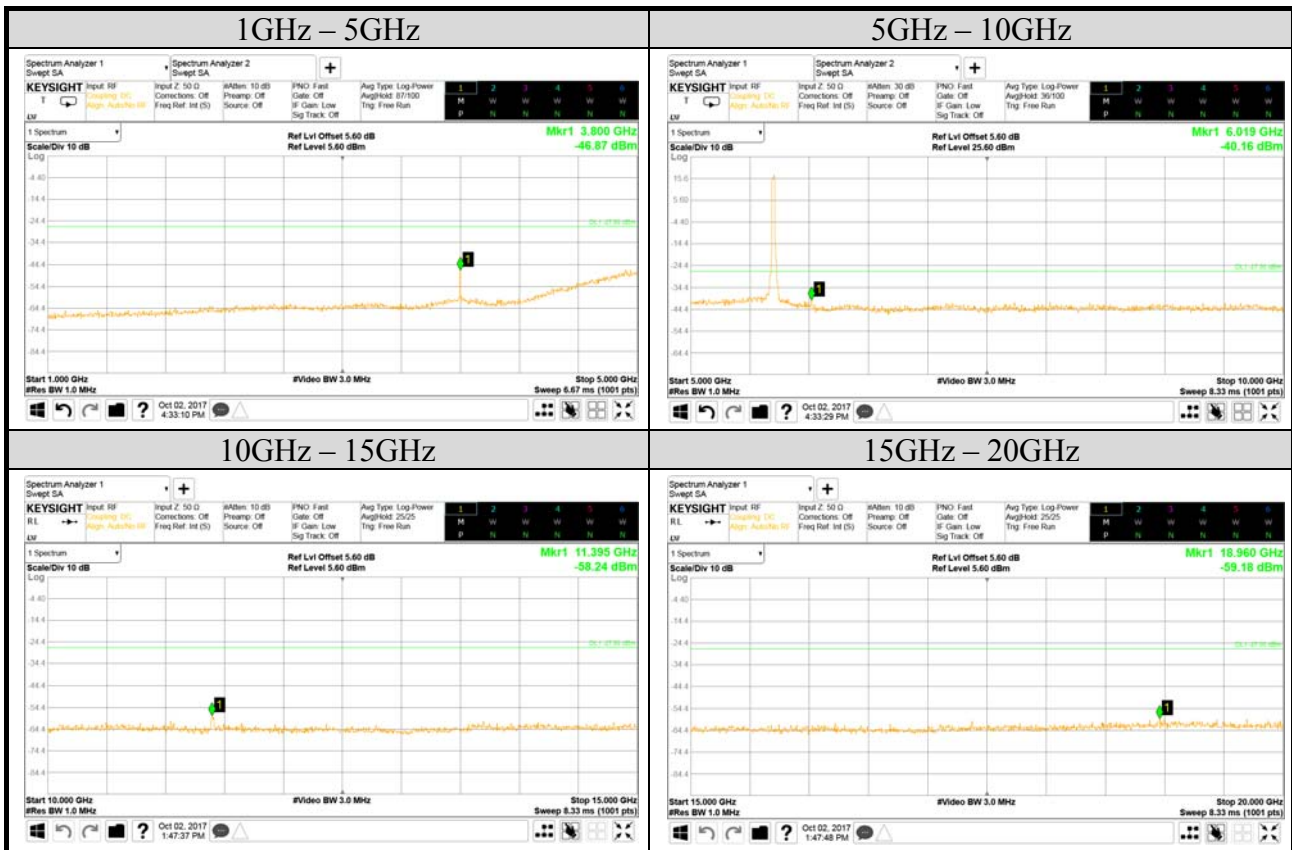



Test Date	2017/10/02~18	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	III
		Frequency	TX 5745MHz
Cable Loss	1.6dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

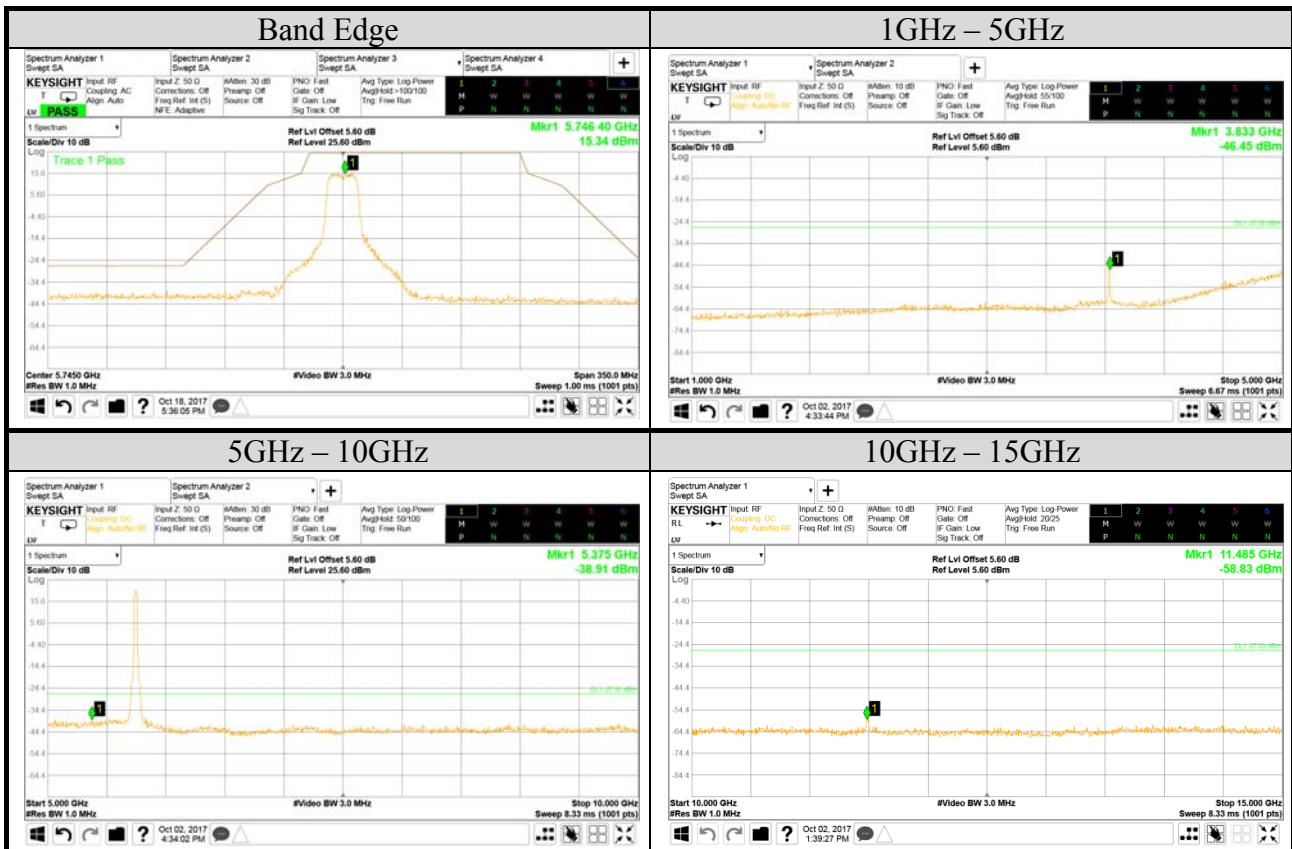


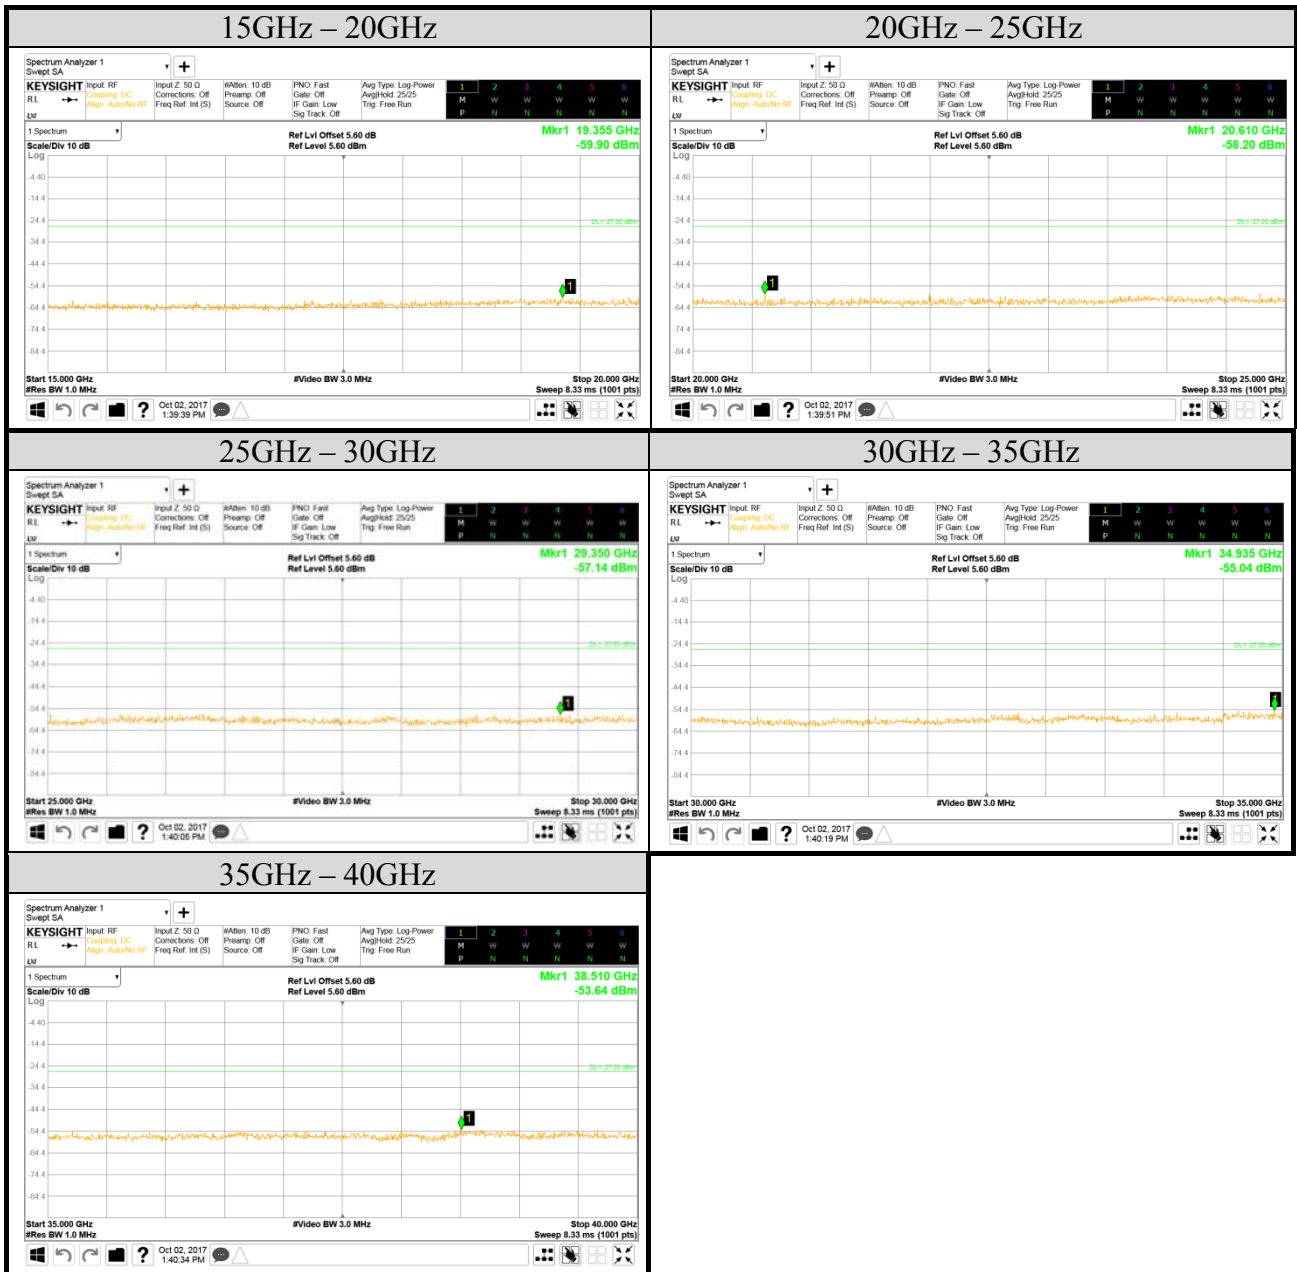


Audix Technology Corp.  
 No. 53-11, Dingfu, Linkou, Dist.,  
 New Taipei City 244, Taiwan

Tel: +886 2 26099301  
 Fax: +886 2 26099303

Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	III
		Frequency	TX 5785MHz
Cable Loss	1.6dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

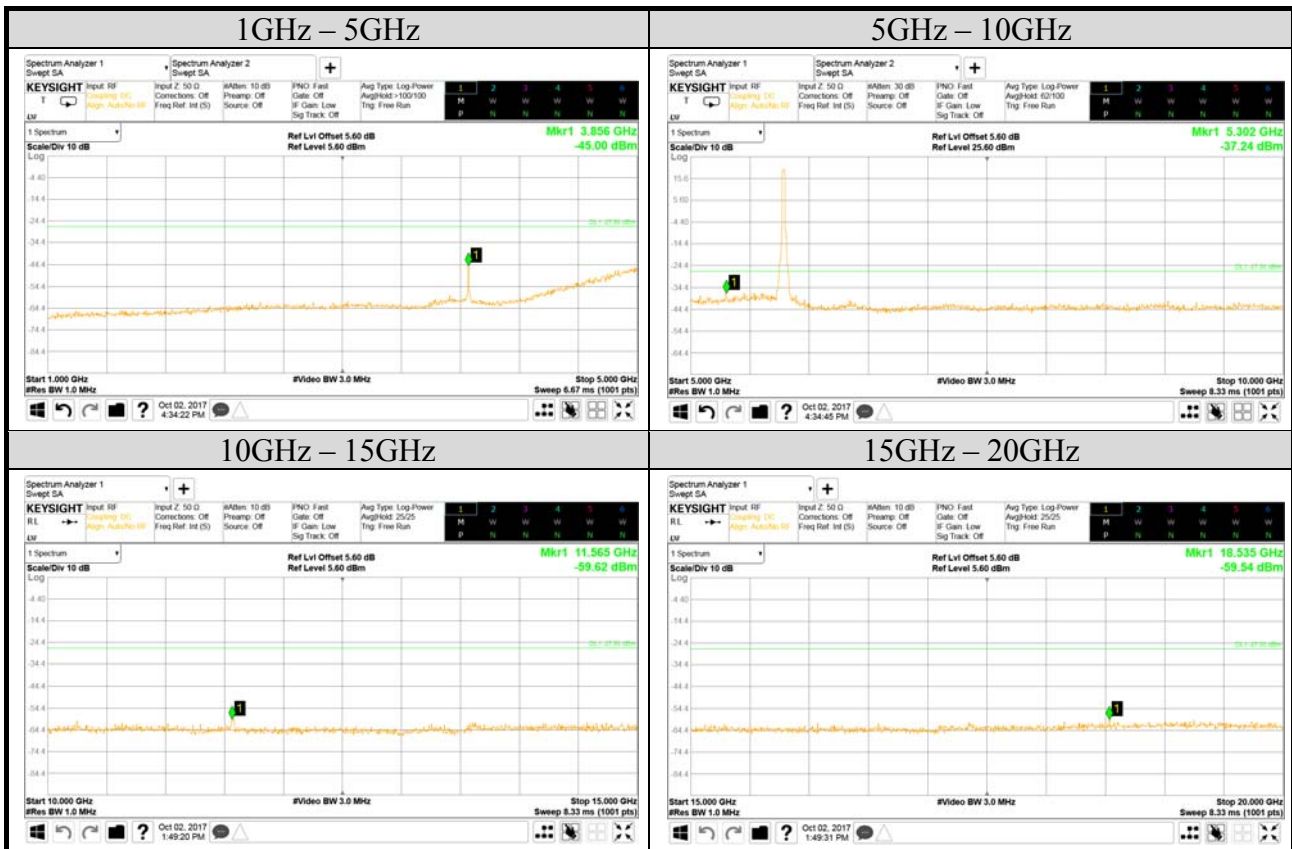


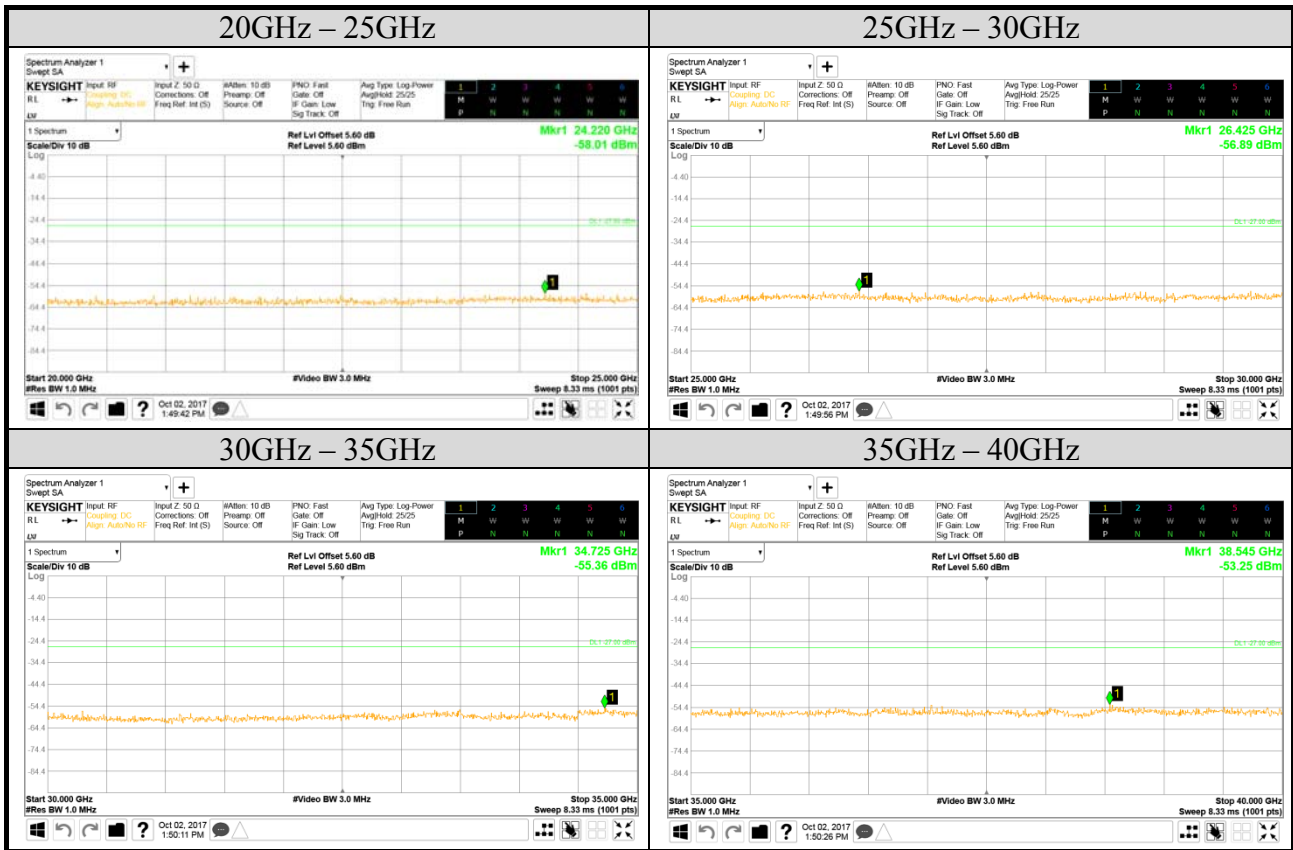


Audix Technology Corp.  
 No. 53-11, Dingfu, Linkou, Dist.,  
 New Taipei City 244, Taiwan

Tel: +886 2 26099301  
 Fax: +886 2 26099303

Test Date	2017/10/02~18	Temp./Hum.	24°C/53%
Mode	802.11n-HT20	UNII Band	III
		Frequency	TX 5825MHz
Cable Loss	1.6dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

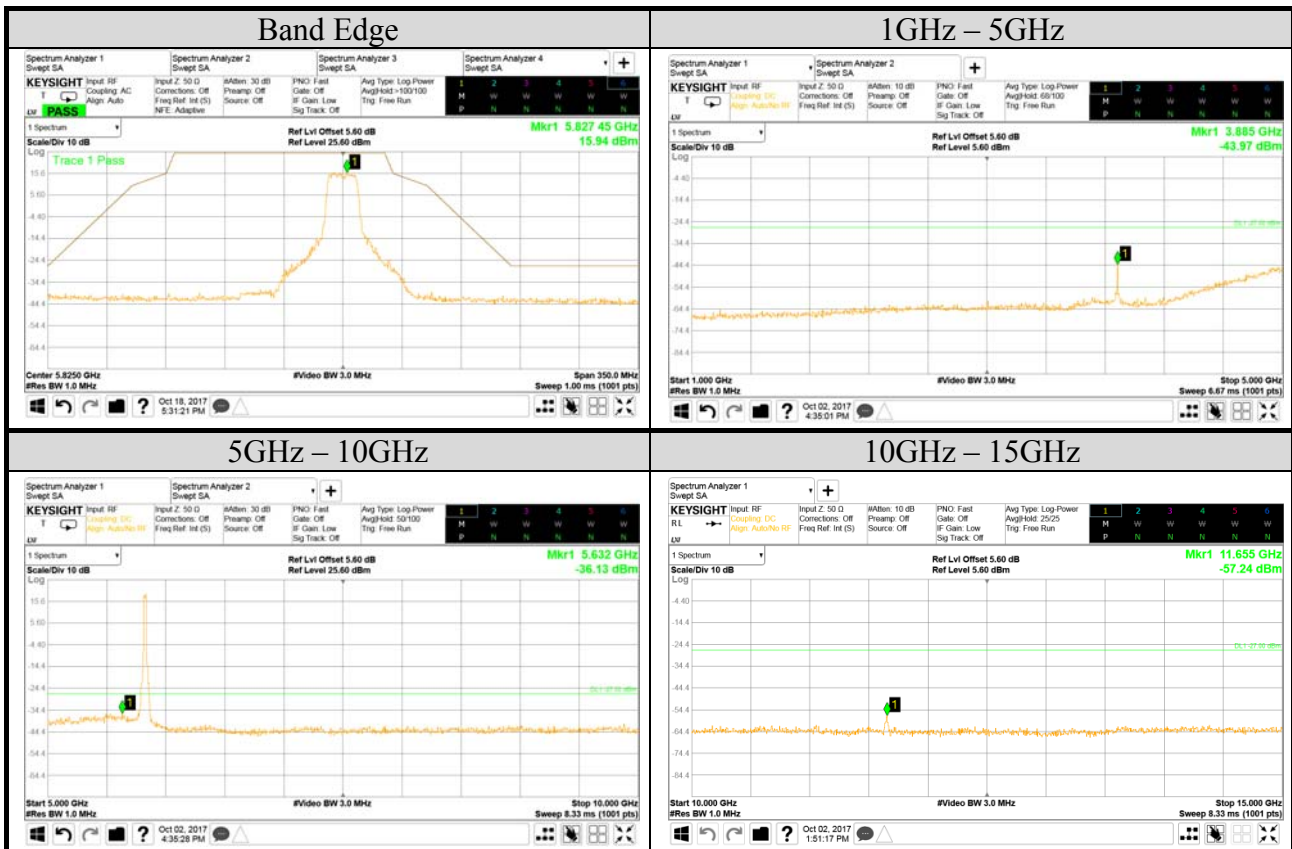


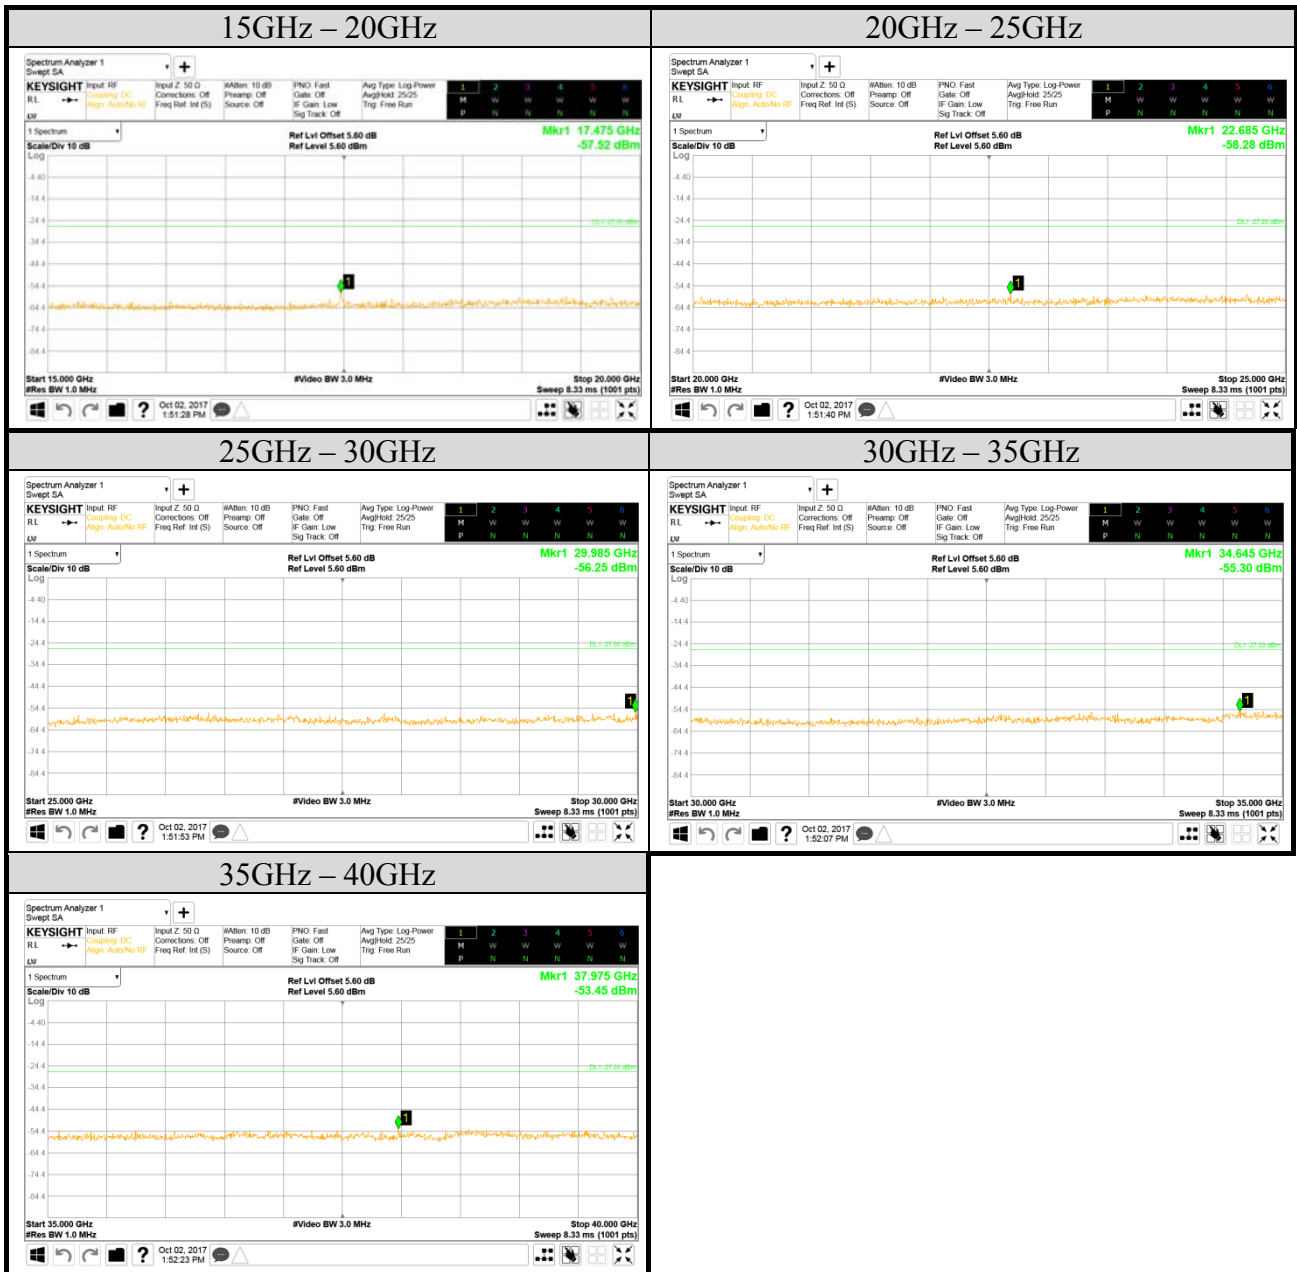




Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT40	UNII Band	I
		Frequency	TX 5190MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	



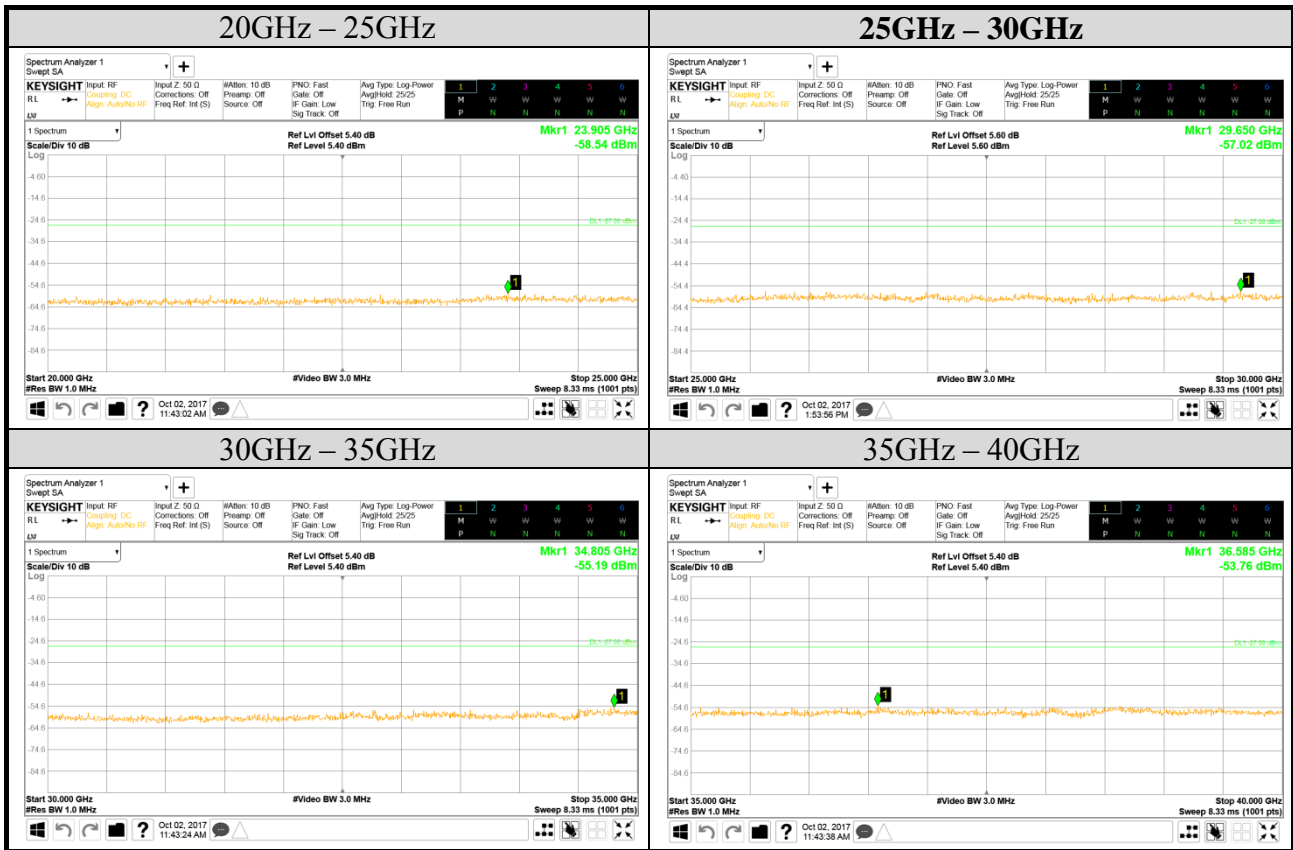



Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT40	UNII Band	I
		Frequency	TX 5230MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

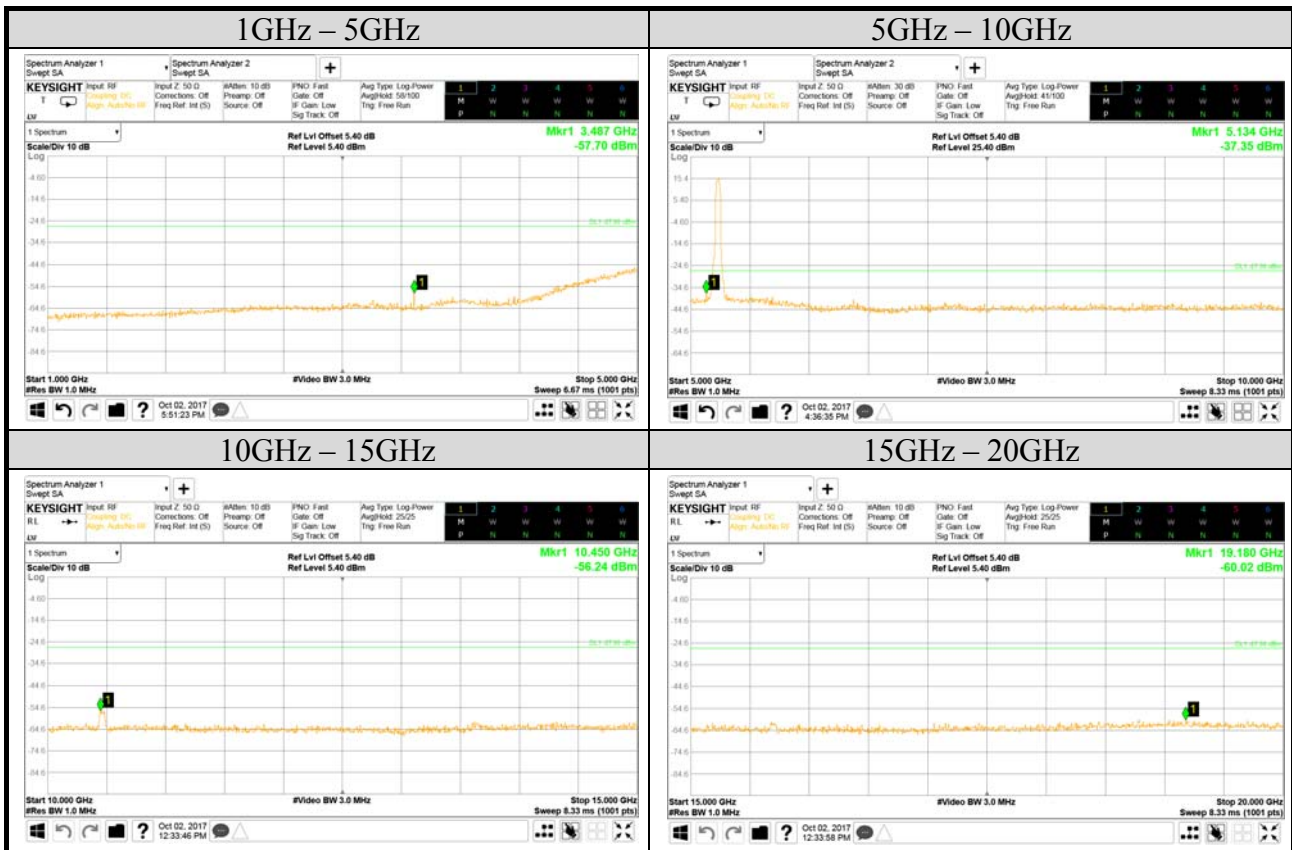




Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT40	UNII Band	II-2A
		Frequency	TX 5270MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

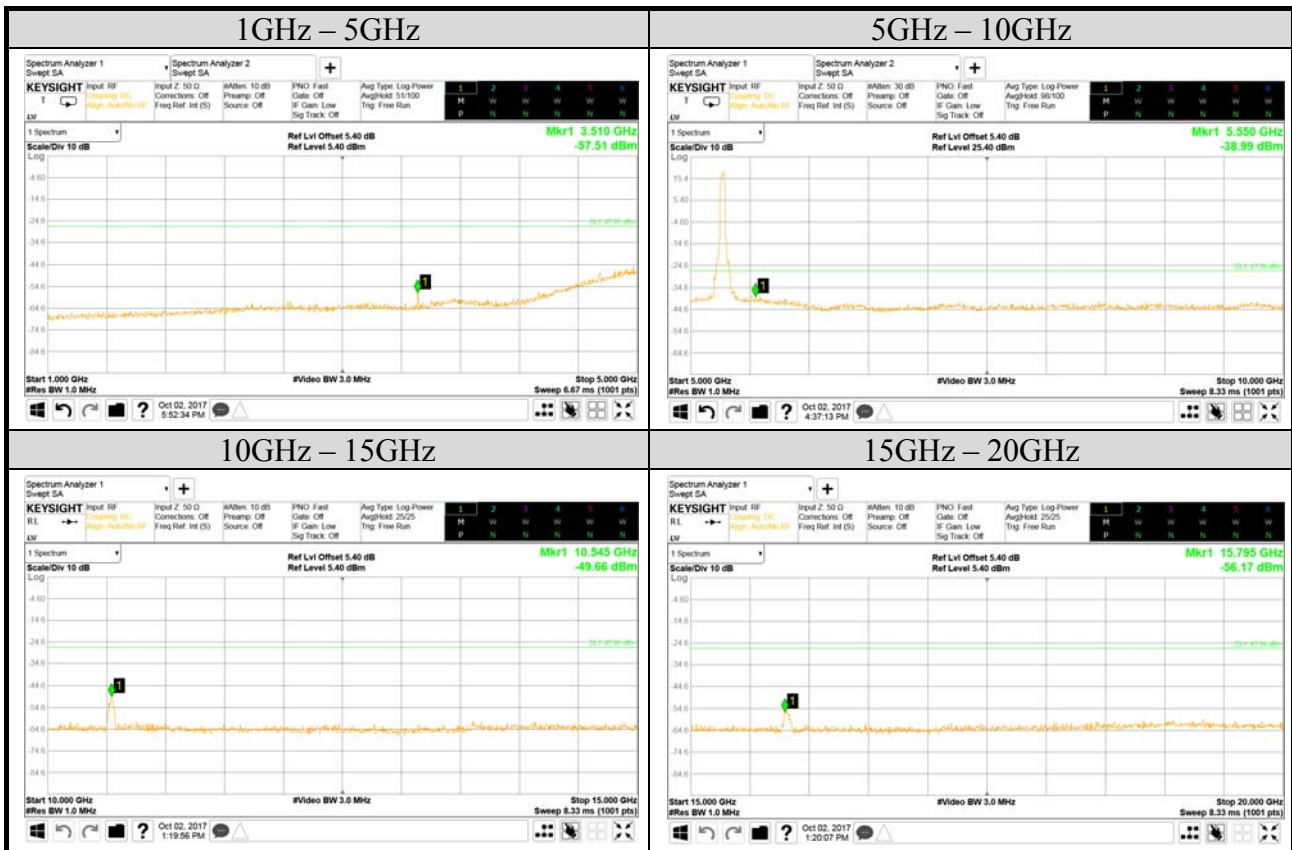

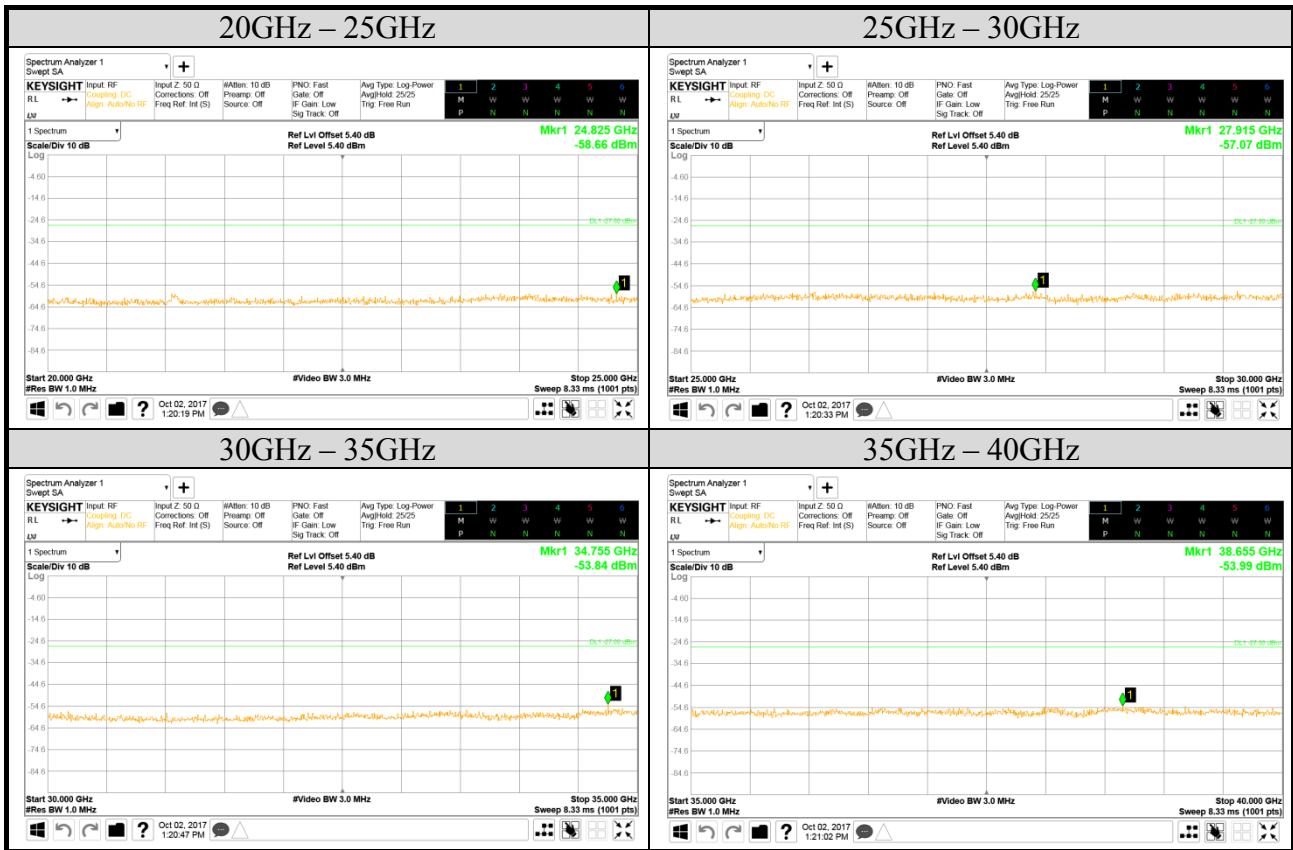

Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT40	UNII Band	II-2A
		Frequency	TX 5310MHz
Cable Loss	1.4dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	

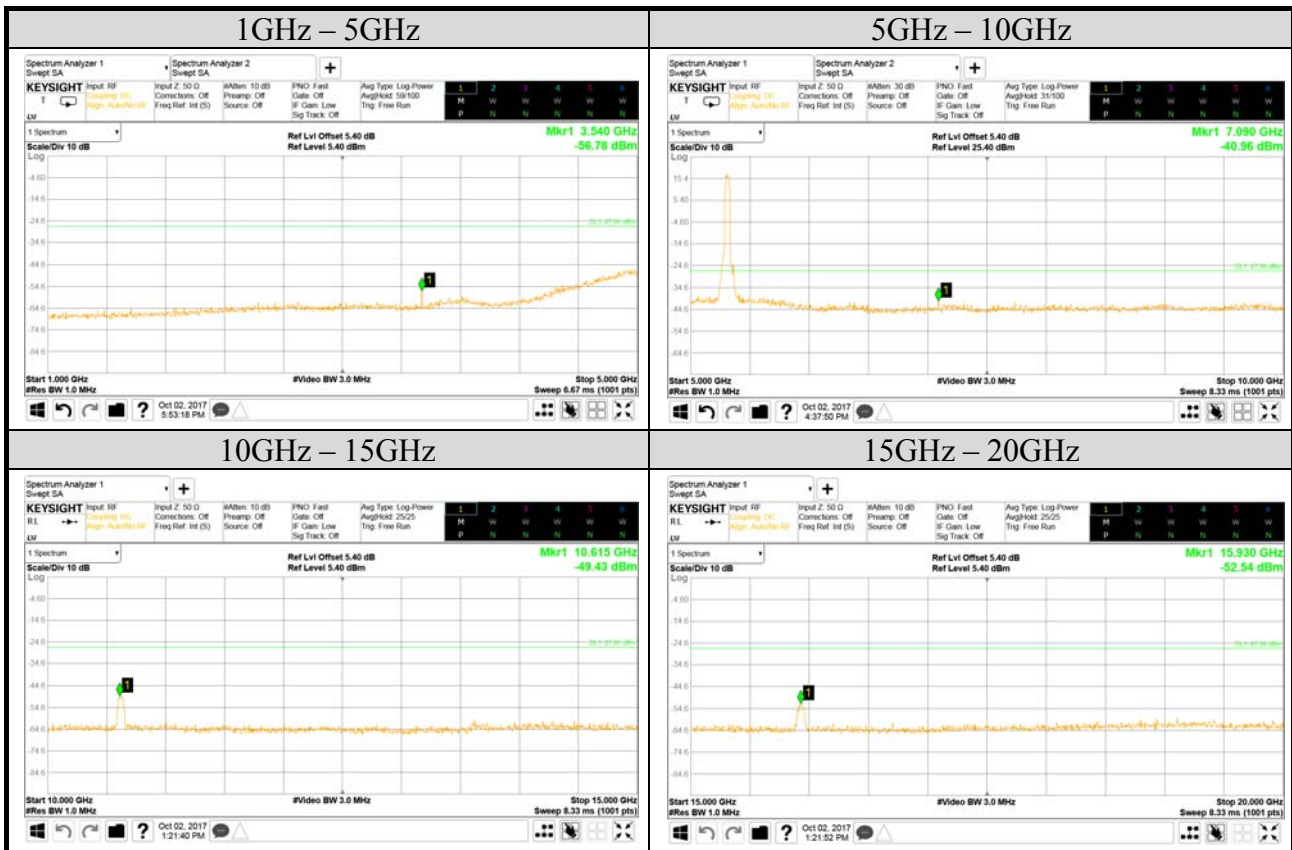





Audix Technology Corp.  
 No. 53-11, Dingfu, Linkou, Dist.,  
 New Taipei City 244, Taiwan

Tel: +886 2 26099301  
 Fax: +886 2 26099303

Test Date	2017/10/02	Temp./Hum.	24°C/53%
Mode	802.11n-HT40	UNII Band	II-2C
		Frequency	TX 5510MHz
Cable Loss	1.6dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		3	



Audix Technology Corp.  
 No. 53-11, Dingfu, Linkou, Dist.,  
 New Taipei City 244, Taiwan

Tel: +886 2 26099301  
 Fax: +886 2 26099303

