

FCC Part 24E

Spurious emissions at antenna terminals


n2 , Normal

| Mode | Value (dBm) | Limit (dBm) | Result |
|---|-------------|-------------|--------|
| n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -24.02 | -13 | Pass |
| n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_19.1GHz | -23.91 | -13 | Pass |
| n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_19.1GHz | -23.85 | -13 | Pass |
| n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.48 | -13 | Pass |
| n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_19.1GHz | -24.13 | -13 | Pass |
| n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_19.1GHz | -23.96 | -13 | Pass |
| n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.93 | -13 | Pass |
| n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_19.1GHz | -23.73 | -13 | Pass |
| n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_19.1GHz | -23.96 | -13 | Pass |
| n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.26 | -13 | Pass |
| n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_19.1GHz | -24.07 | -13 | Pass |
| n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_19.1GHz | -23.54 | -13 | Pass |
| n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.75 | -13 | Pass |
| n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_19.1GHz | -24.31 | -13 | Pass |
| n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_19.1GHz | -23.81 | -13 | Pass |
| n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.91 | -13 | Pass |
| n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_19.1GHz | -23.97 | -13 | Pass |
| n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -24.15 | -13 | Pass |
| n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_19.1GHz | -23.9 | -13 | Pass |

| Mode | Value (dBm) | Limit (dBm) | Result |
|---|--------------------|--------------------|---------------|
| n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_19.1GHz | -23.78 | -13 | Pass |
| n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.64 | -13 | Pass |
| n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_19.1GHz | -24.11 | -13 | Pass |
| n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_19.1GHz | -22.51 | -13 | Pass |
| n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -24.02 | -13 | Pass |
| n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_19.1GHz | -23.29 | -13 | Pass |
| n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_19.1GHz | -23.78 | -13 | Pass |
| n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_19.1GHz | -23.14 | -13 | Pass |
| n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.83 | -13 | Pass |
| n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_19.1GHz | -23.87 | -13 | Pass |
| n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_19.1GHz | -23.59 | -13 | Pass |
| n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.92 | -13 | Pass |
| n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_19.1GHz | -24.02 | -13 | Pass |
| n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_19.1GHz | -24.2 | -13 | Pass |
| n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz | -23.08 | -13 | Pass |
| n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_19.1GHz | -23.68 | -13 | Pass |
| n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_19.1GHz | -24.01 | -13 | Pass |


n2 , Normal

n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

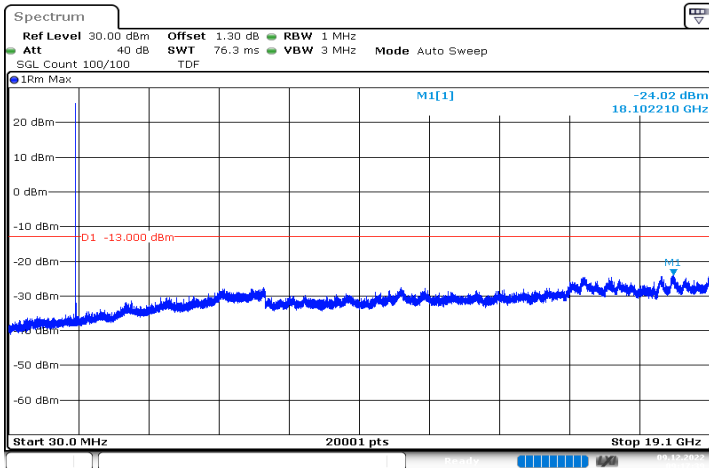


Date: 9.DEC.2022 09:17:39

n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_19.1GHz

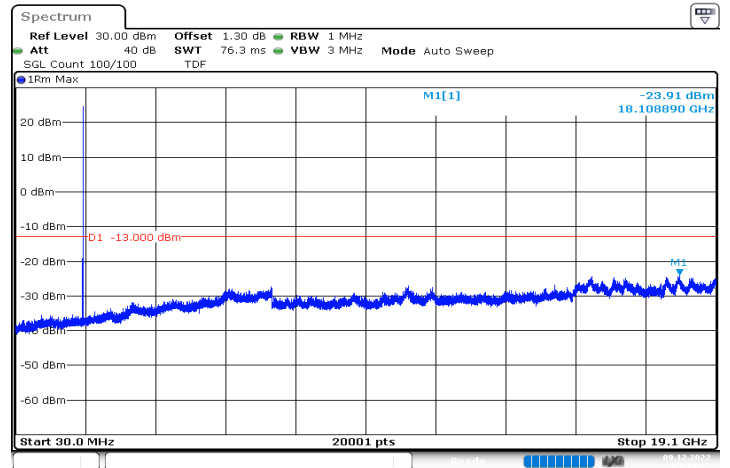


Date: 9.DEC.2022 09:18:22

n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_19.1GHz

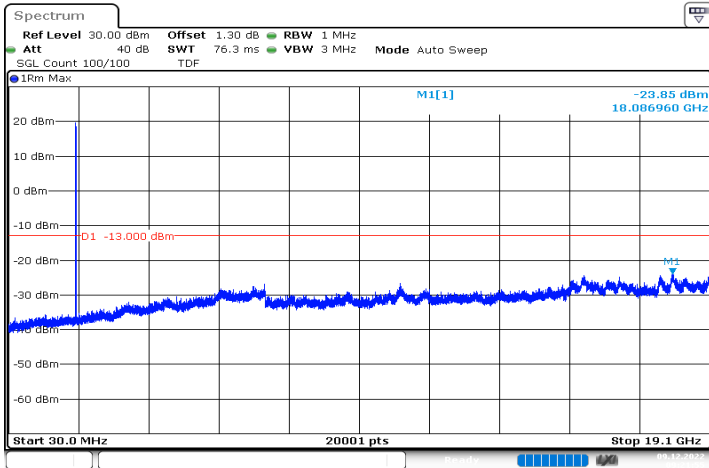


Date: 9.DEC.2022 09:21:55

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

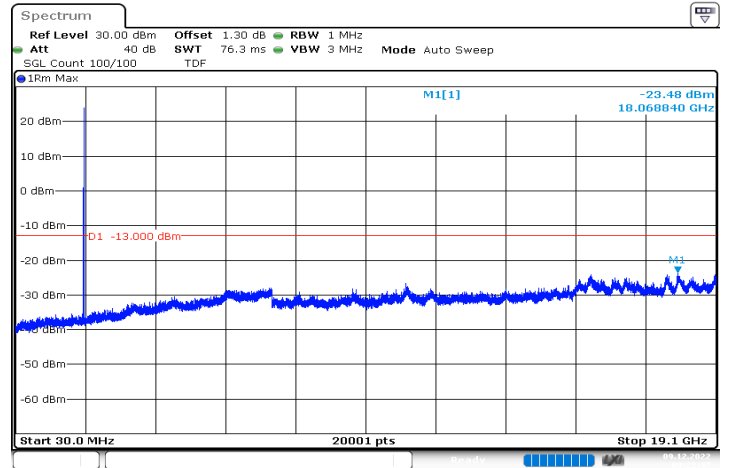


Date: 9.DEC.2022 09:22:47

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_19.1GHz

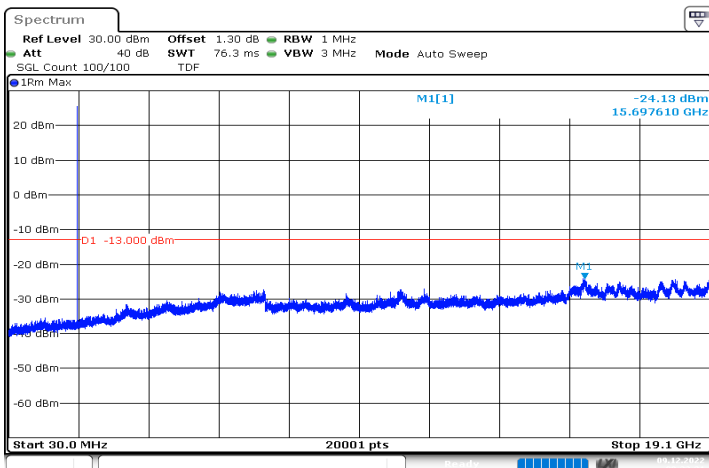


Date: 9.DEC.2022 09:23:31

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_19.1GHz

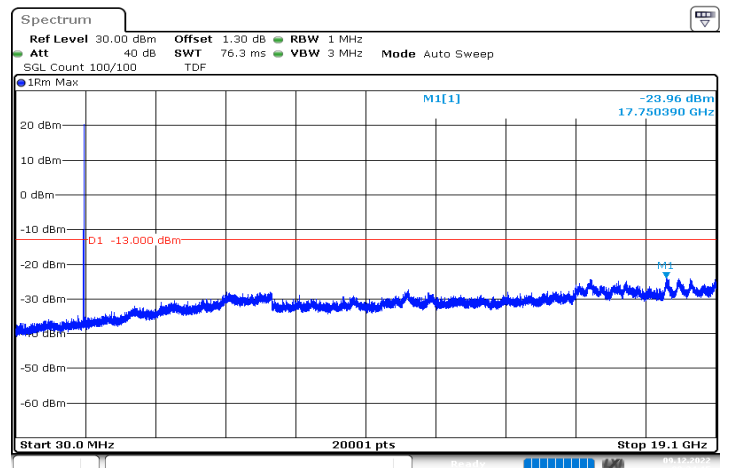


Date: 9.DEC.2022 09:24:15

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

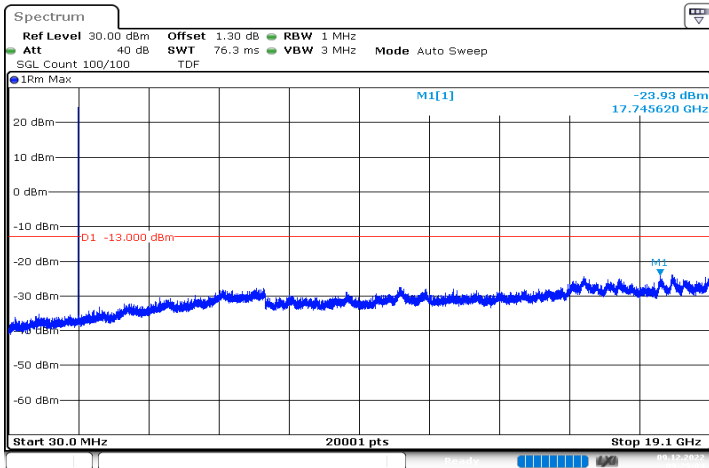


Date: 9.DEC.2022 09:29:04

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_19.1GHz

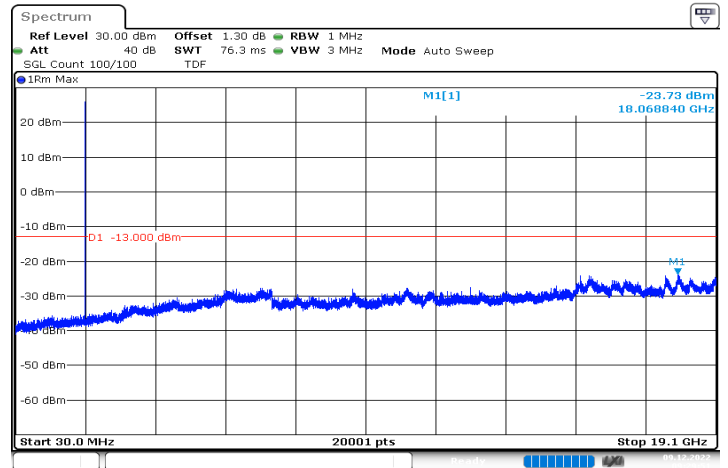


Date: 9.DEC.2022 09:29:51

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_19.1GHz

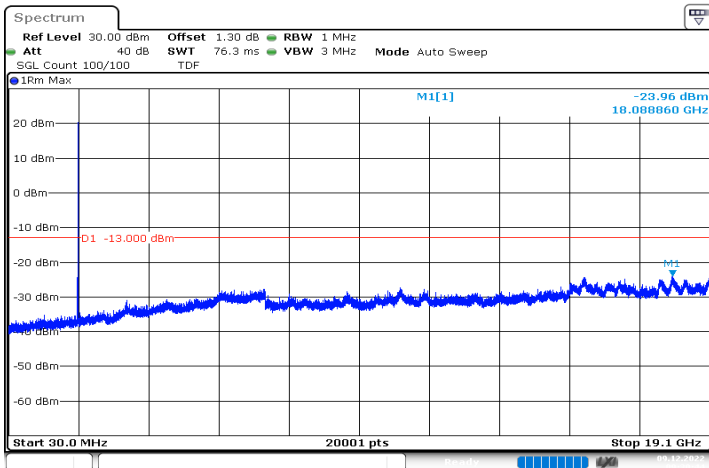


Date: 9.DEC.2022 09:30:44

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

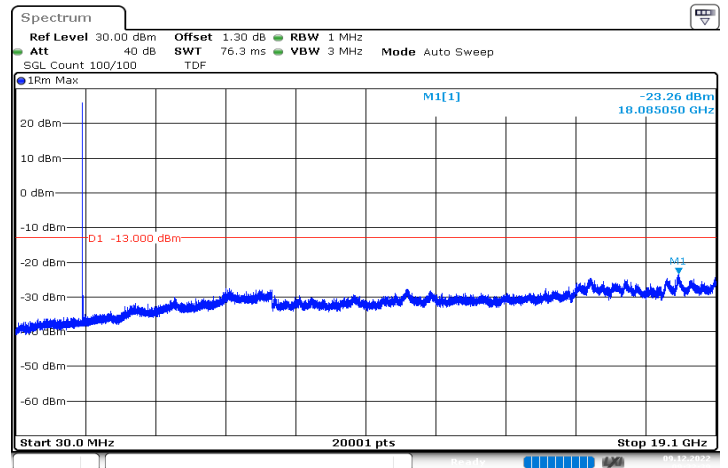


Date: 9.DEC.2022 09:32:39

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_19.1GHz

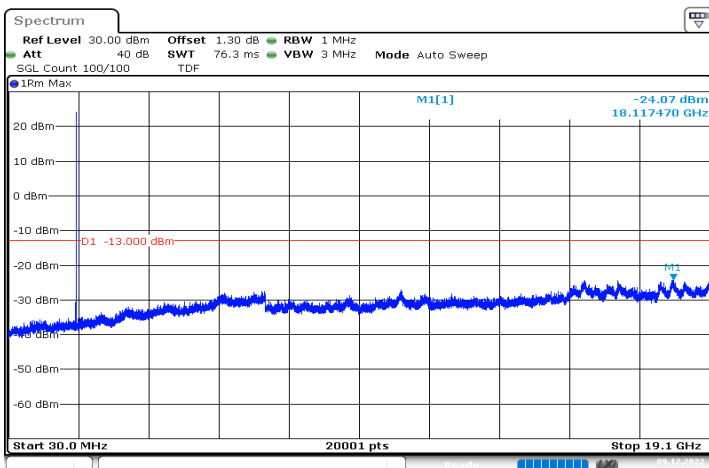


Date: 9.DEC.2022 09:33:24

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_19.1GHz

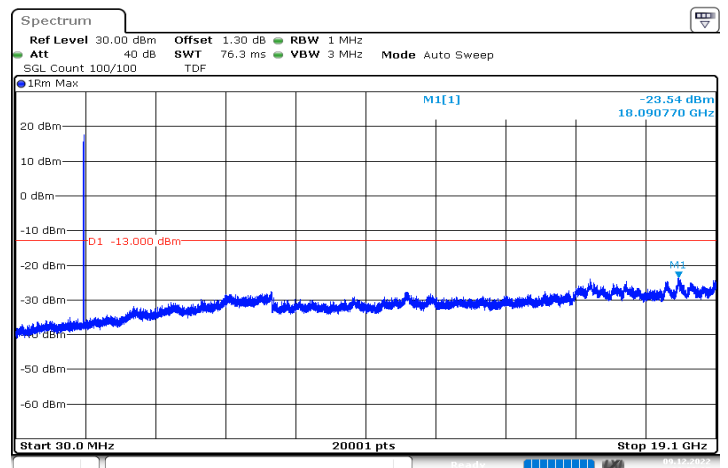


Date: 9.DEC.2022 09:36:35

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

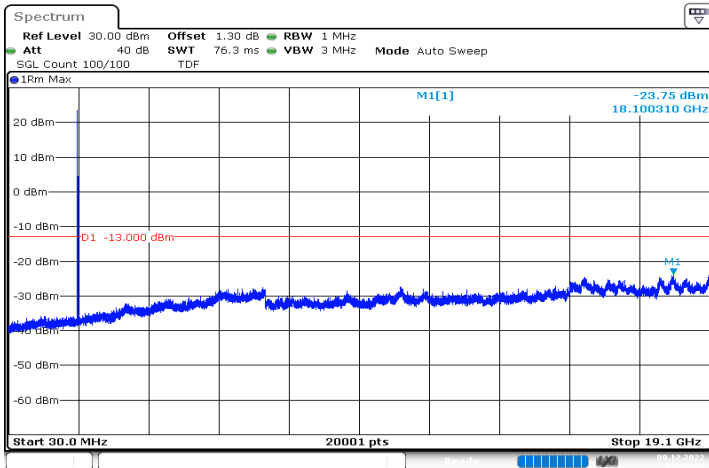


Date: 9.DEC.2022 09:37:27

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_19.1GHz

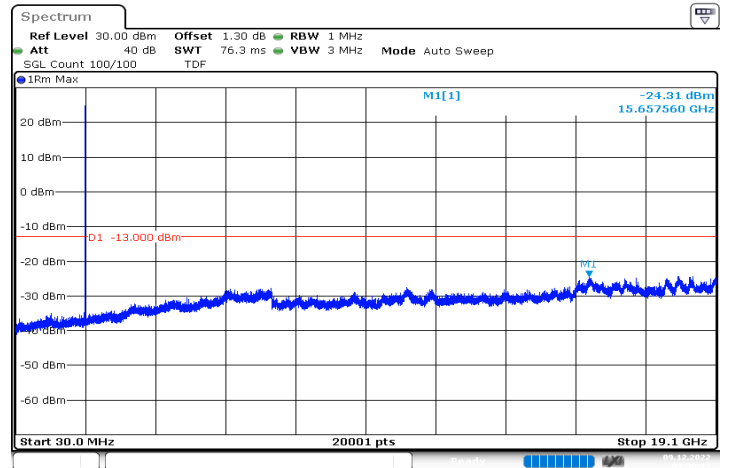


Date: 9.DEC.2022 09:38:12

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_19.1GHz

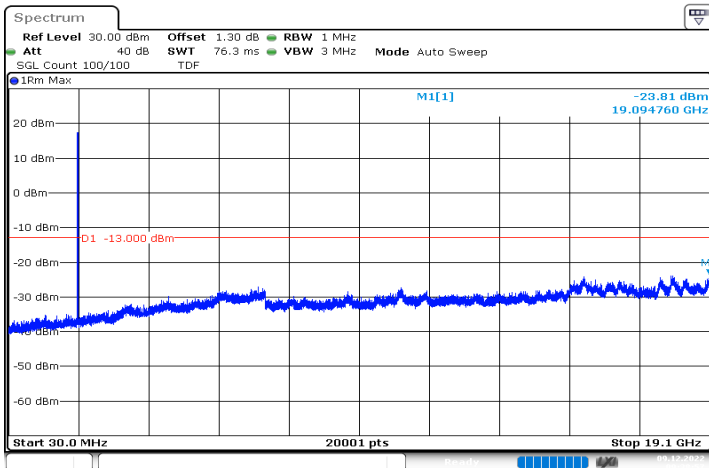


Date: 9.DEC.2022 09:38:57

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

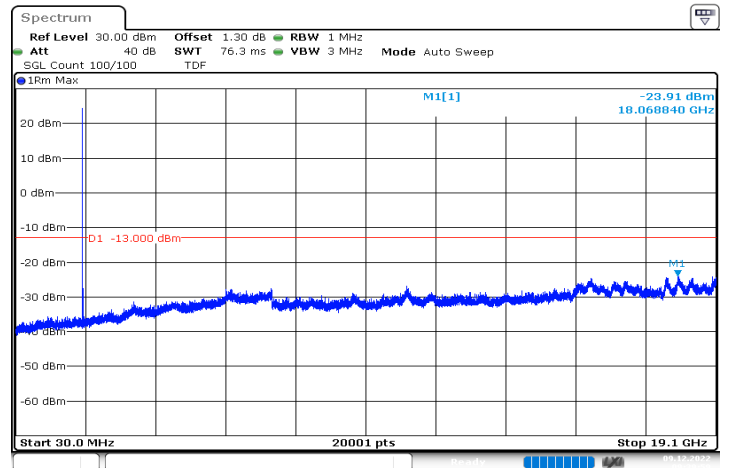


Date: 9.DEC.2022 09:39:59

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_19.1GHz

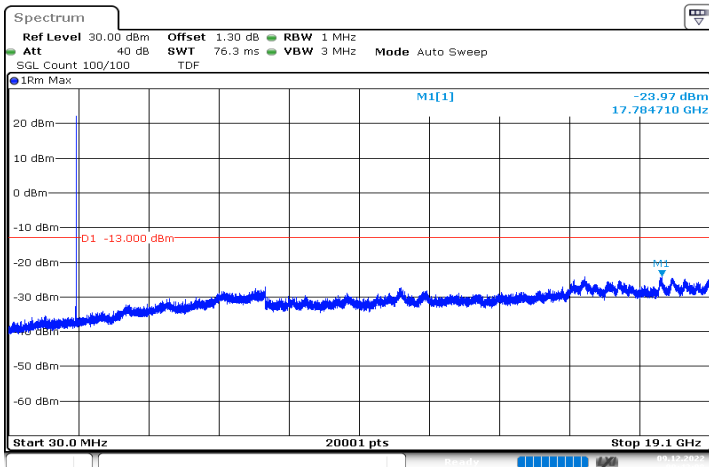


Date: 9.DEC.2022 09:42:08

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

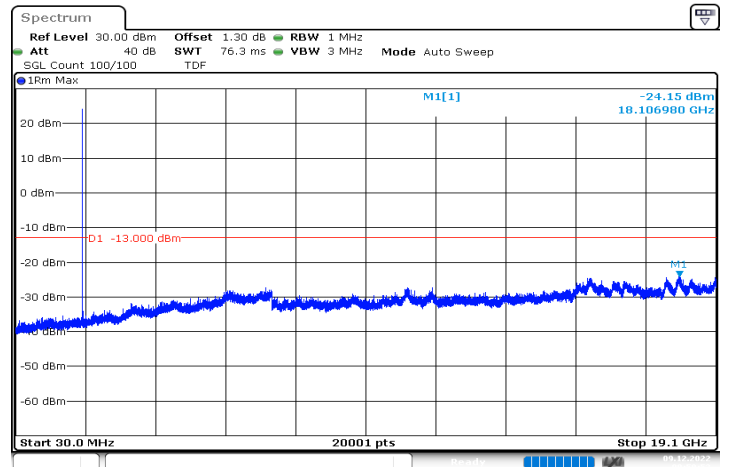


Date: 9.DEC.2022 09:59:52

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_19.1GHz

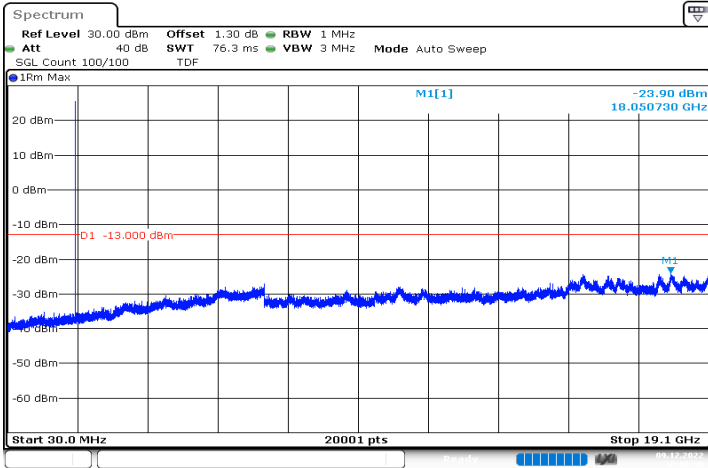


Date: 9.DEC.2022 10:02:00

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_19.1GHz

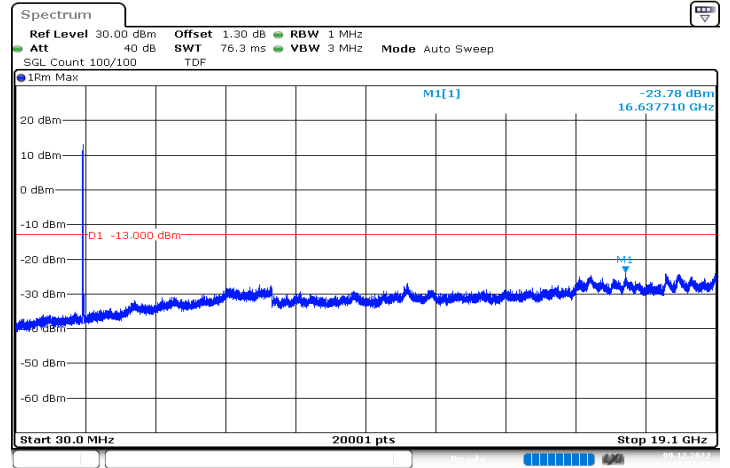


Date: 9.DEC.2022 10:02:50

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

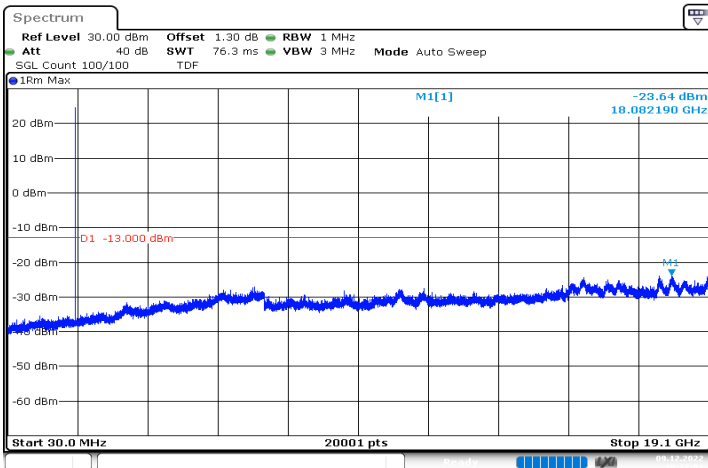


Date: 9.DEC.2022 10:17:01

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_19.1GHz

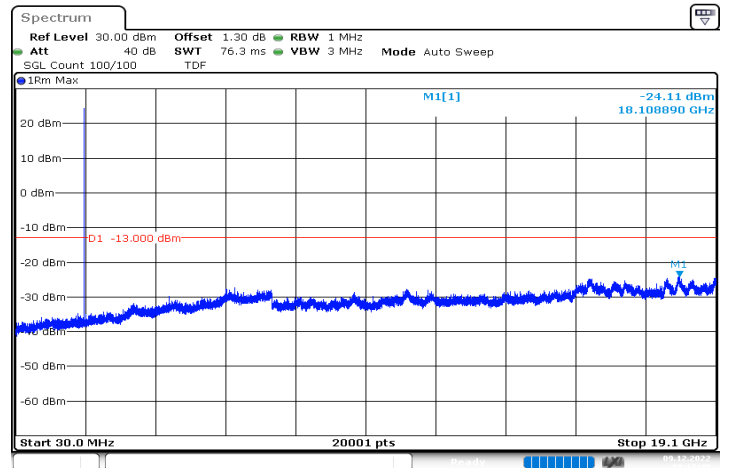


Date: 9.DEC.2022 10:17:40

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_19.1GHz

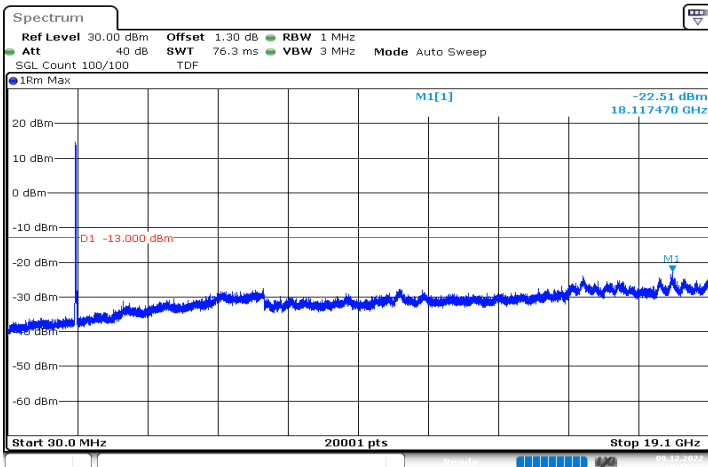


Date: 9.DEC.2022 10:18:29

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

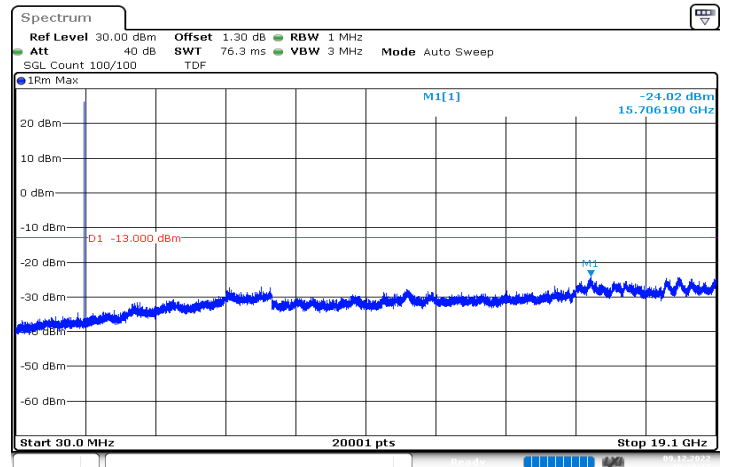


Date: 9.DEC.2022 10:19:17

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_19.1GHz

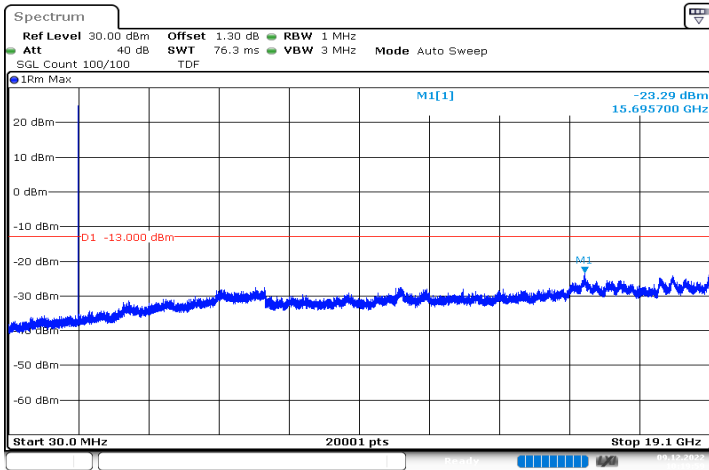


Date: 9.DEC.2022 10:19:59

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_19.1GHz

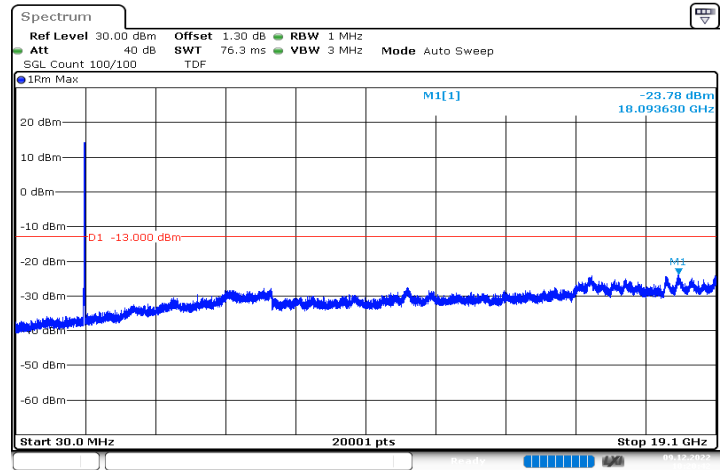


Date: 9.DEC.2022 10:20:42

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_19.1GHz

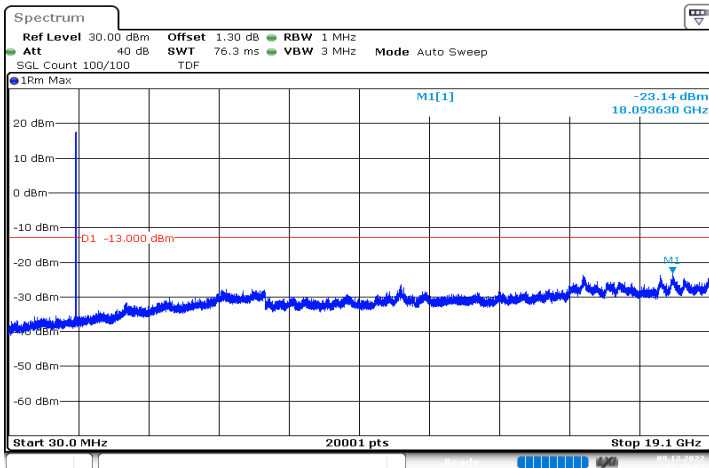


Date: 9.DEC.2022 09:34:08

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

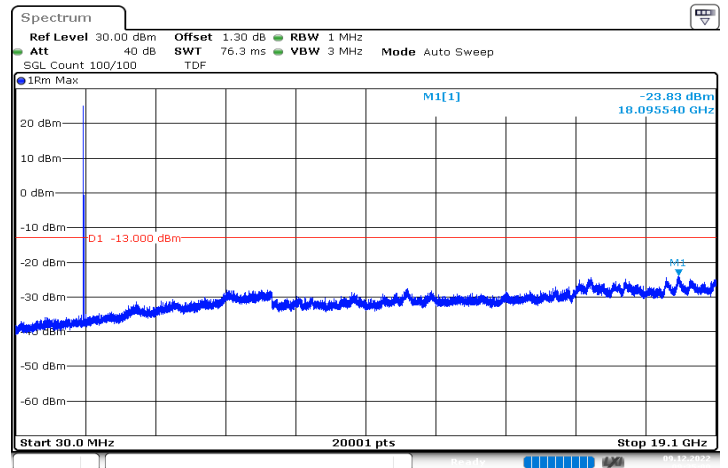


Date: 9.DEC.2022 09:35:00

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_19.1GHz

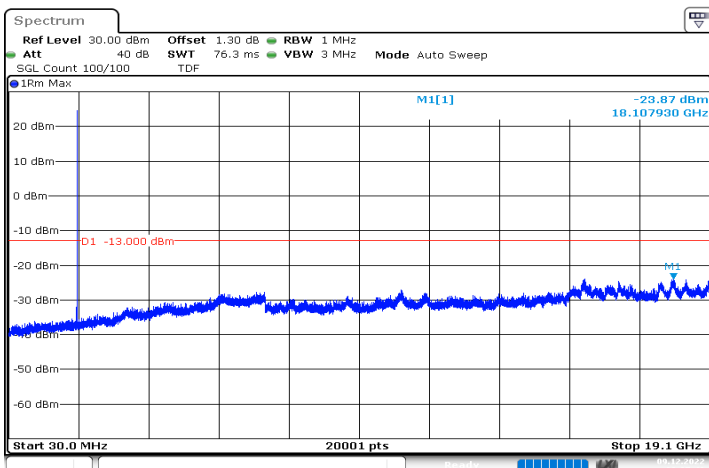


Date: 9.DEC.2022 09:35:46

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_19.1GHz

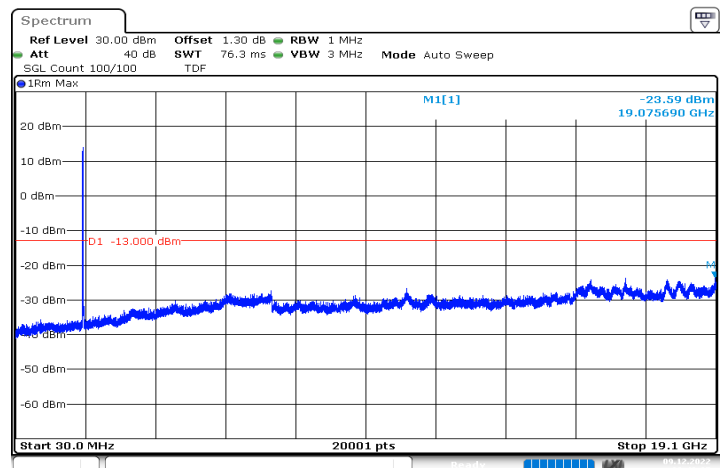


Date: 9.DEC.2022 09:43:37

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

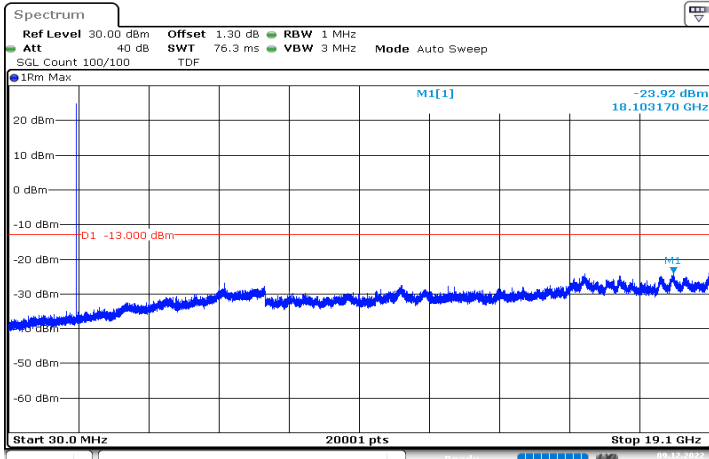


Date: 9.DEC.2022 09:55:13

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_19.1GHz

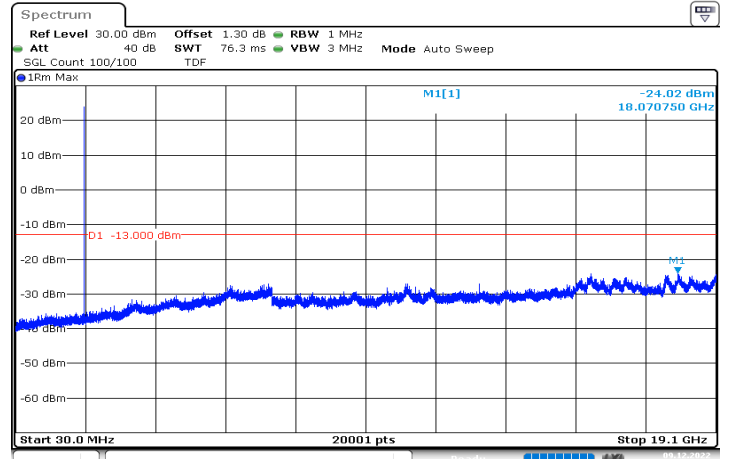


Date: 9.DEC.2022 09:55:57

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_19.1GHz

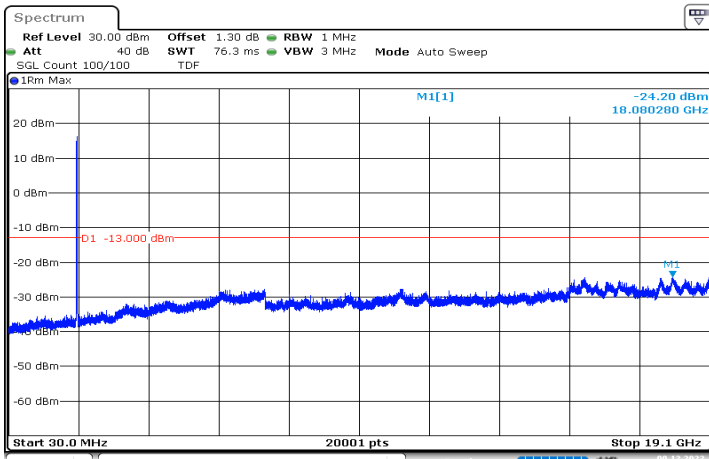


Date: 9.DEC.2022 09:56:40

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

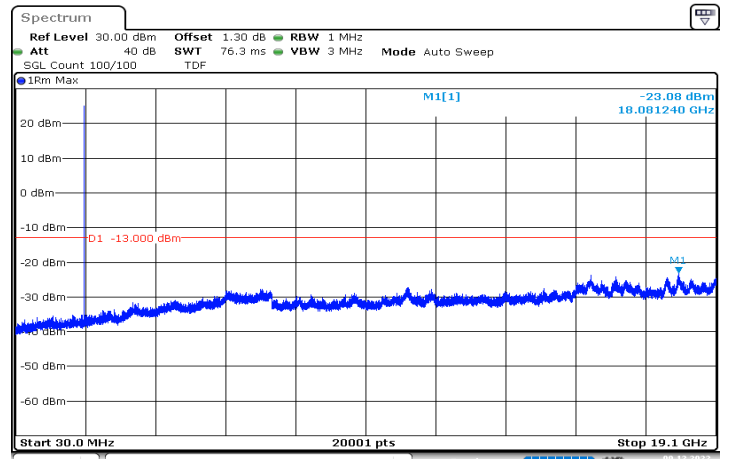


Date: 9.DEC.2022 09:57:30

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_19.1GHz

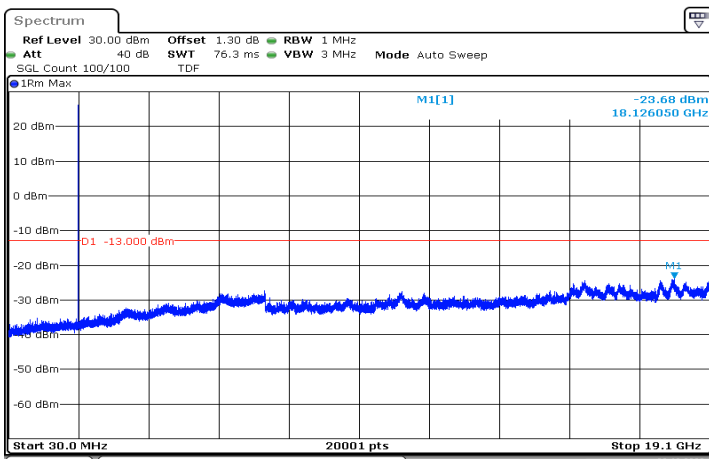

Date: 9.DEC.2022 09:58:12

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_19.1GHz

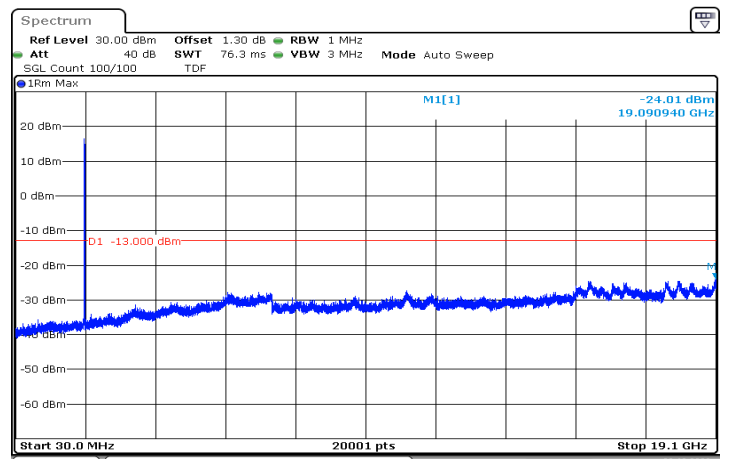

Date: 9.DEC.2022 09:58:55