

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



| | | | |
|------|---------|---------|---|
| Mode | 802.11g | Channel | 2 |
|------|---------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 2389.23 | 34.63 | 15.82 | 50.45 | 54 | -3.55 | AVG |
| | | 2389.42 | 43.64 | 15.82 | 59.46 | 74 | -14.54 | PK |
| | @ | 2417 | 97.23 | 15.84 | 113.07 | N/A | N/A | PK |
| | @ | 2417 | 89.52 | 15.84 | 105.36 | N/A | N/A | AVG |
| | * | 4834 | 35.01 | 2.36 | 37.37 | 74 | -36.63 | PK |
| Vertical | | 2314.75 | 40.91 | 15.85 | 56.76 | 74 | -17.24 | PK |
| | | 2389.8 | 30.8 | 15.82 | 46.62 | 54 | -7.38 | AVG |
| | @ | 2417 | 93.38 | 15.84 | 109.22 | N/A | N/A | PK |
| | @ | 2417 | 85.03 | 15.84 | 100.87 | N/A | N/A | AVG |
| | * | 4834 | 35.35 | 2.36 | 37.71 | 74 | -36.29 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

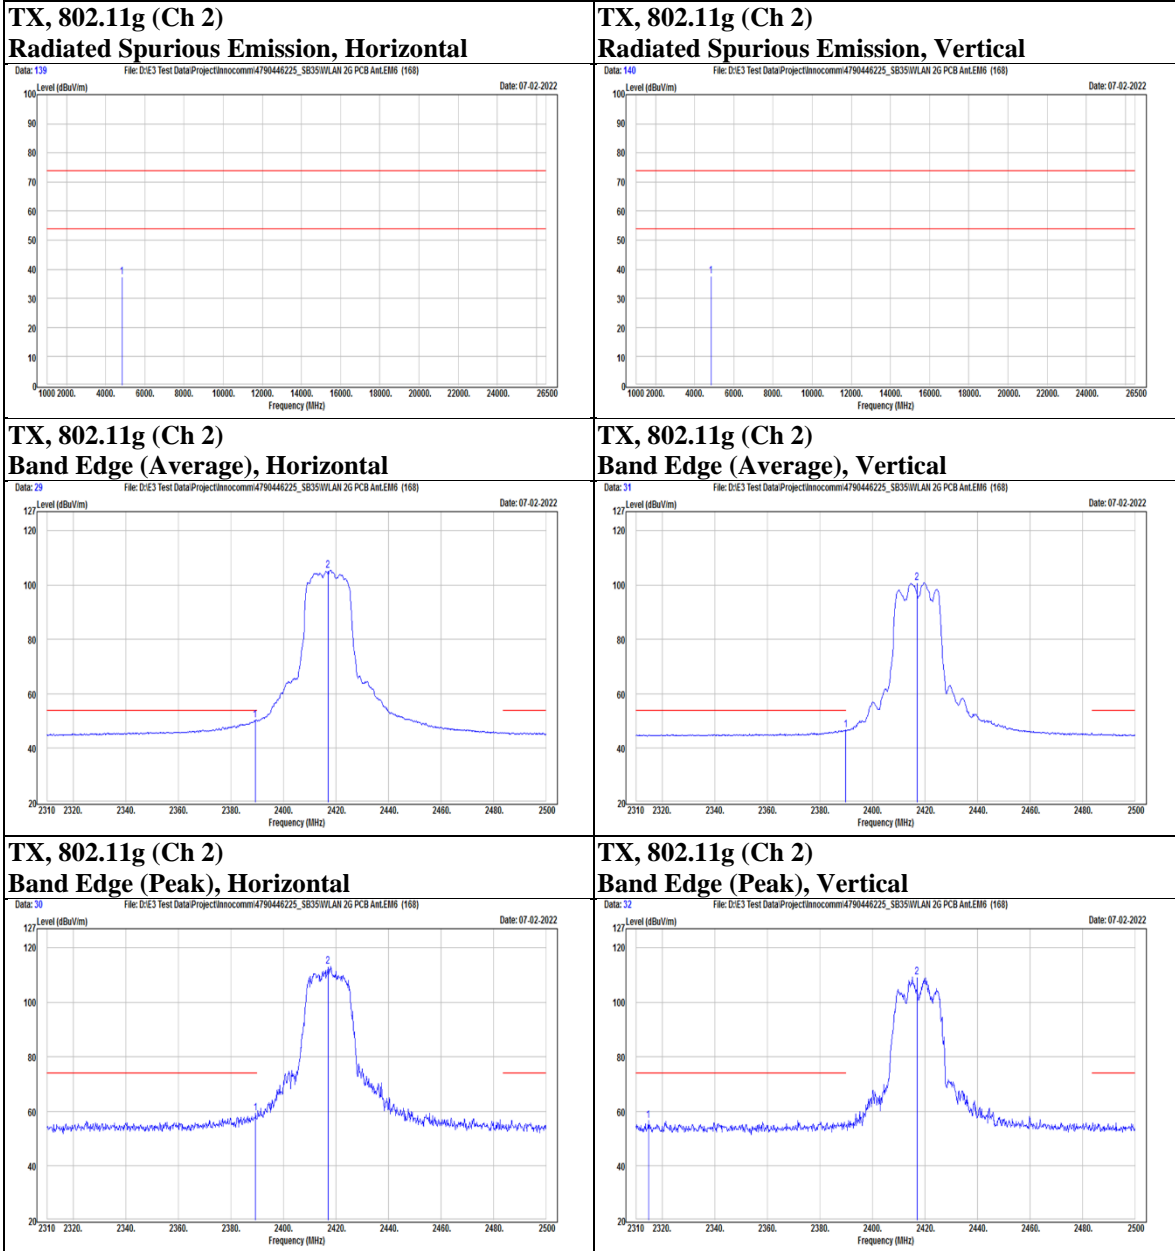

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



| | | | |
|------|---------|---------|---|
| Mode | 802.11g | Channel | 6 |
|------|---------|---------|---|

| Polarization | Notation | Frequency (MHz) | Reading (dBuV) | Correct (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Margin (dB) | Remark |
|--------------|----------|--------------------|-------------------|-------------------|--------------------|-------------------|----------------|--------|
| Horizontal | | 2382.39 | 46.39 | 15.83 | 62.22 | 74 | -11.78 | PK |
| | | 2389.8 | 35.53 | 15.82 | 51.35 | 54 | -2.65 | AVG |
| | @ | 2437 | 101.17 | 15.92 | 117.09 | N/A | N/A | PK |
| | @ | 2437 | 93.47 | 15.92 | 109.39 | N/A | N/A | AVG |
| | | 2483.66 | 34.7 | 15.68 | 50.38 | 54 | -3.62 | AVG |
| | | 2488.79 | 48.04 | 15.64 | 63.68 | 74 | -10.32 | PK |
| | * | 4874 | 35.38 | 2.4 | 37.78 | 74 | -36.22 | PK |
| Vertical | | 2385.62 | 42.66 | 15.83 | 58.49 | 74 | -15.51 | PK |
| | | 2389.42 | 32.04 | 15.82 | 47.86 | 54 | -6.14 | AVG |
| | @ | 2437 | 97.97 | 15.92 | 113.89 | N/A | N/A | PK |
| | @ | 2437 | 89.92 | 15.92 | 105.84 | N/A | N/A | AVG |
| | | 2486.89 | 32.75 | 15.66 | 48.41 | 54 | -5.59 | AVG |
| | | 2488.22 | 42.8 | 15.65 | 58.45 | 74 | -15.55 | PK |
| | * | 4874 | 36.41 | 2.4 | 38.81 | 74 | -35.19 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

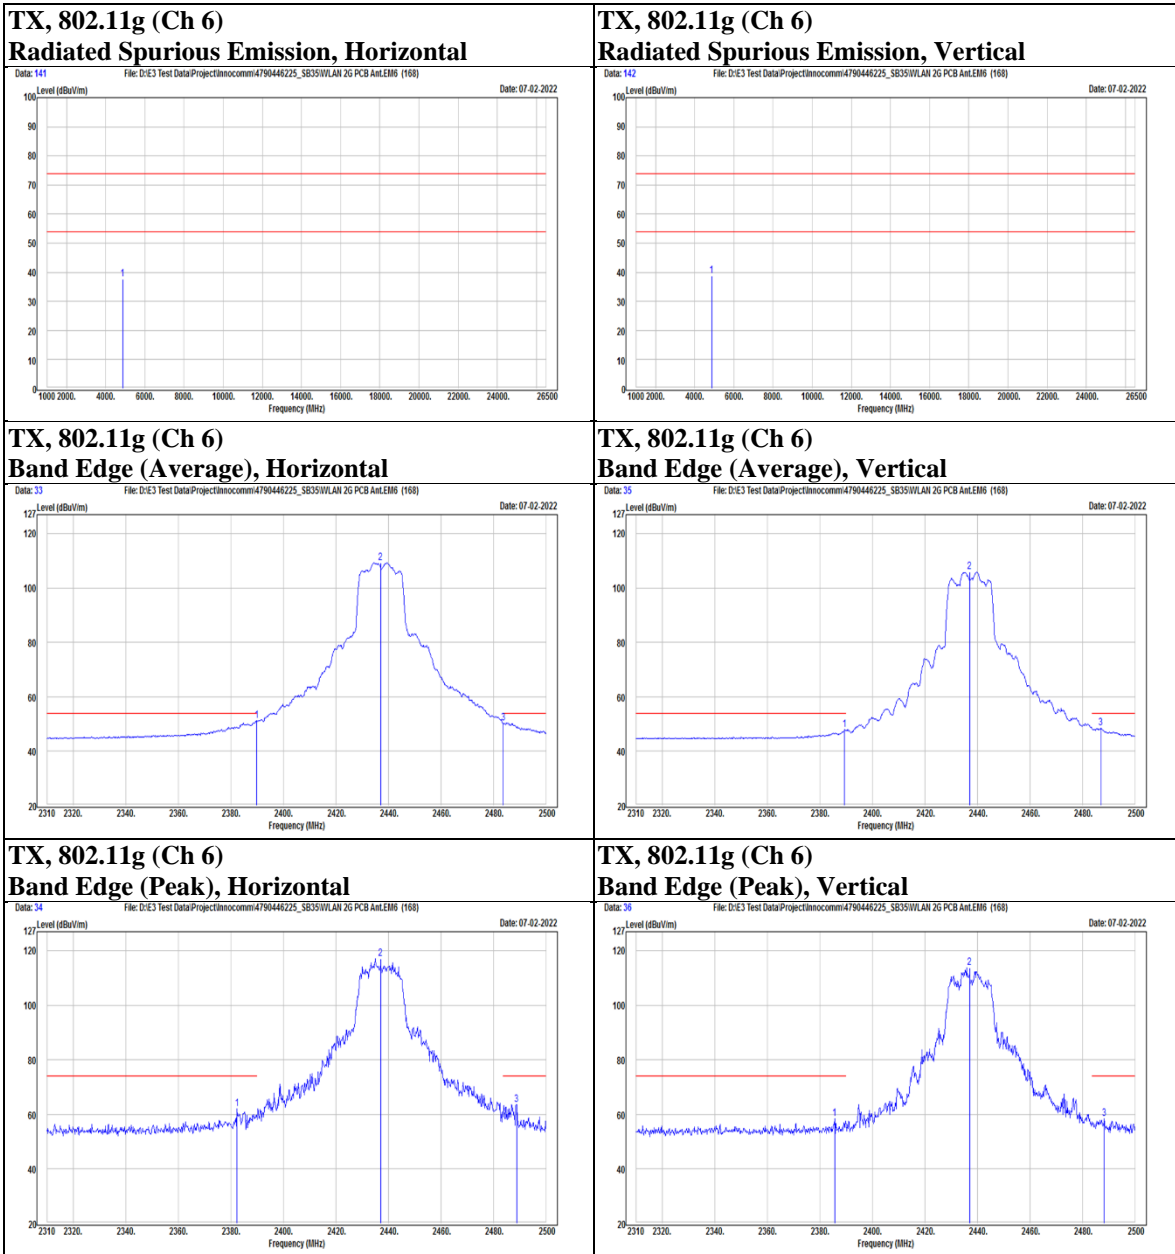



| | | | |
|------|---------|---------|----|
| Mode | 802.11g | Channel | 10 |
|------|---------|---------|----|


| Polarization | Notation | Frequency (MHz) | Reading (dBuV) | Correct (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Margin (dB) | Remark |
|--------------|----------|--------------------|-------------------|-------------------|--------------------|-------------------|----------------|--------|
| Horizontal | @ | 2457 | 95.32 | 15.92 | 111.24 | N/A | N/A | PK |
| | @ | 2457 | 87.74 | 15.92 | 103.66 | N/A | N/A | AVG |
| | | 2483.66 | 33.79 | 15.68 | 49.47 | 54 | -4.53 | AVG |
| | | 2487.84 | 43.52 | 15.65 | 59.17 | 74 | -14.83 | PK |
| | * | 4914 | 35 | 2.42 | 37.42 | 74 | -36.58 | PK |
| Vertical | @ | 2457 | 91.76 | 15.92 | 107.68 | N/A | N/A | PK |
| | @ | 2457 | 83.88 | 15.92 | 99.8 | N/A | N/A | AVG |
| | | 2485.18 | 42.07 | 15.67 | 57.74 | 74 | -16.26 | PK |
| | | 2485.75 | 31.72 | 15.67 | 47.39 | 54 | -6.61 | AVG |
| | * | 4914 | 36.53 | 2.42 | 38.95 | 74 | -35.05 | PK |

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

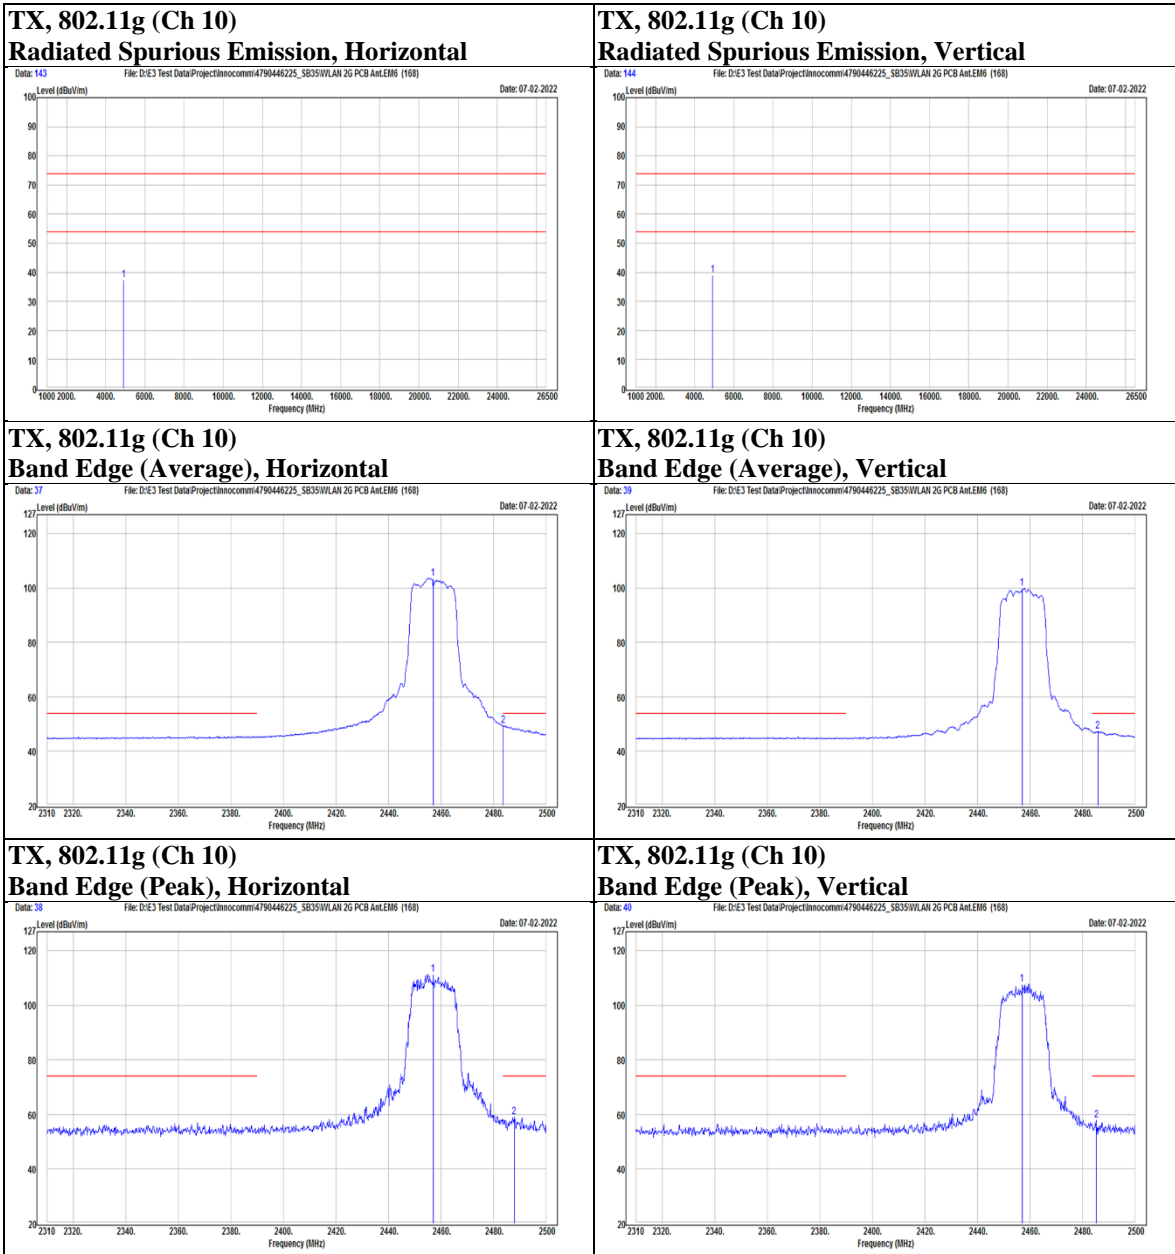



| | | | |
|------|---------|---------|----|
| Mode | 802.11g | Channel | 11 |
|------|---------|---------|----|

| Polarization | Notation | Frequency (MHz) | Reading (dBuV) | Correct (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Margin (dB) | Remark |
|--------------|----------|--------------------|-------------------|-------------------|--------------------|-------------------|----------------|--------|
| Horizontal | @ | 2462 | 93.14 | 15.87 | 109.01 | N/A | N/A | PK |
| | @ | 2462 | 85.8 | 15.87 | 101.67 | N/A | N/A | AVG |
| | | 2483.85 | 41.98 | 15.68 | 57.66 | 74 | -16.34 | PK |
| | | 2485.18 | 31.02 | 15.67 | 46.69 | 54 | -7.31 | AVG |
| | * | 4924 | 34.82 | 2.4 | 37.22 | 74 | -36.78 | PK |
| Vertical | @ | 2462 | 89.34 | 15.87 | 105.21 | N/A | N/A | PK |
| | @ | 2462 | 82.05 | 15.87 | 97.92 | N/A | N/A | AVG |
| | | 2485.37 | 29.91 | 15.67 | 45.58 | 54 | -8.42 | AVG |
| | | 2493.35 | 40.92 | 15.61 | 56.53 | 74 | -17.47 | PK |
| | * | 4924 | 35.5 | 2.4 | 37.9 | 74 | -36.1 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

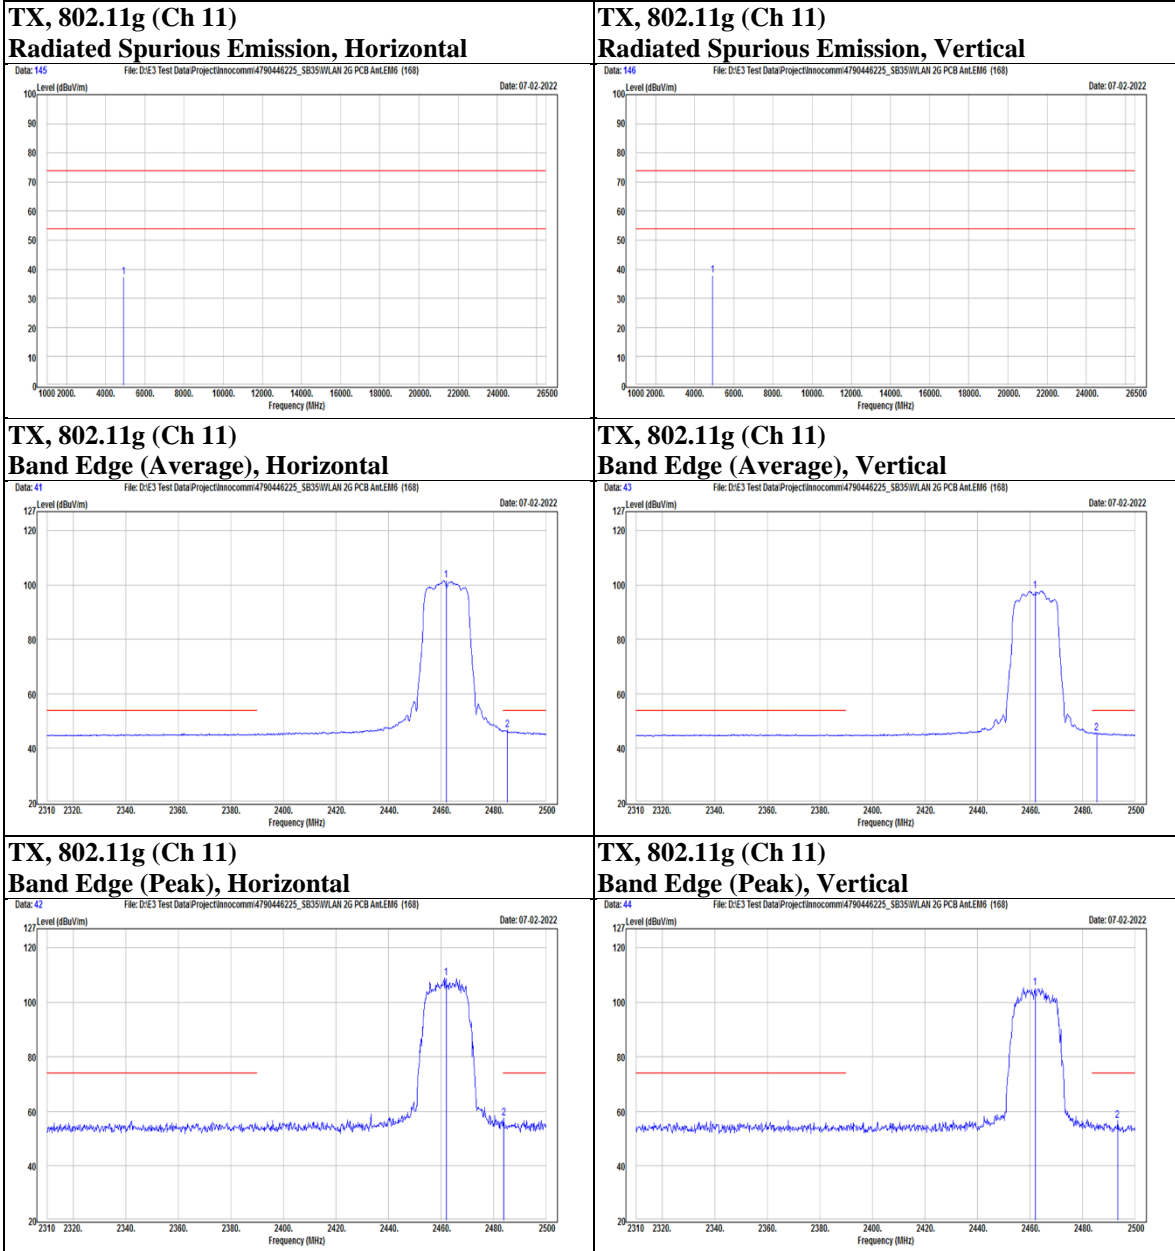



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT20) | Channel | 1 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 2389.04 | 42.33 | 15.81 | 58.14 | 74 | -15.86 | PK |
| | | 2389.99 | 31.61 | 15.82 | 47.43 | 54 | -6.57 | AVG |
| | @ | 2412 | 94.27 | 15.83 | 110.1 | N/A | N/A | PK |
| | @ | 2412 | 86.54 | 15.83 | 102.37 | N/A | N/A | AVG |
| | * | 4824 | 35.58 | 2.35 | 37.93 | 74 | -36.07 | PK |
| Vertical | | 2350.66 | 40.43 | 15.91 | 56.34 | 74 | -17.66 | PK |
| | | 2389.04 | 29.6 | 15.81 | 45.41 | 54 | -8.59 | AVG |
| | @ | 2412 | 89.12 | 15.83 | 104.95 | N/A | N/A | PK |
| | @ | 2412 | 81.23 | 15.83 | 97.06 | N/A | N/A | AVG |
| | * | 4824 | 35.14 | 2.35 | 37.49 | 74 | -36.51 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

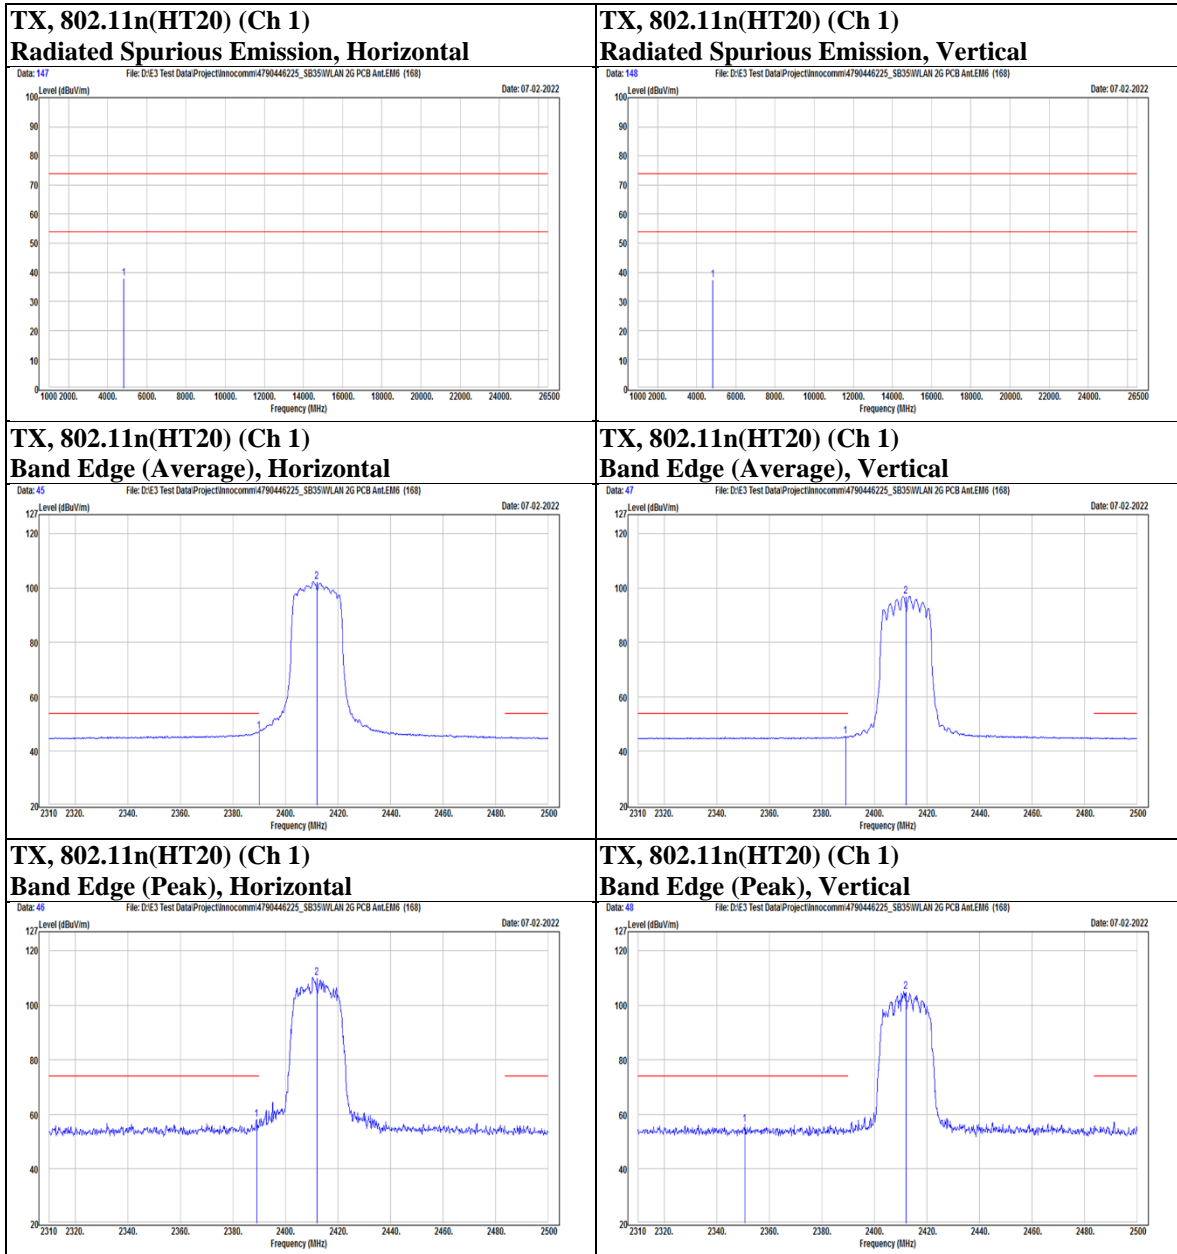



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT20) | Channel | 2 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency (MHz) | Reading (dBuV) | Correct (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Margin (dB) | Remark |
|--------------|----------|--------------------|-------------------|-------------------|--------------------|-------------------|----------------|--------|
| Horizontal | | 2389.8 | 43.87 | 15.82 | 59.69 | 74 | -14.31 | PK |
| | | 2389.99 | 33.48 | 15.82 | 49.3 | 54 | -4.7 | AVG |
| | @ | 2417 | 95.64 | 15.84 | 111.48 | N/A | N/A | PK |
| | @ | 2417 | 87.8 | 15.84 | 103.64 | N/A | N/A | AVG |
| | * | 4834 | 35.54 | 2.36 | 37.9 | 74 | -36.1 | PK |
| Vertical | | 2388.09 | 40.65 | 15.82 | 56.47 | 74 | -17.53 | PK |
| | | 2389.61 | 30.21 | 15.82 | 46.03 | 54 | -7.97 | AVG |
| | @ | 2417 | 90.85 | 15.84 | 106.69 | N/A | N/A | PK |
| | @ | 2417 | 83.61 | 15.84 | 99.45 | N/A | N/A | AVG |
| | * | 4834 | 35.6 | 2.36 | 37.96 | 74 | -36.04 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

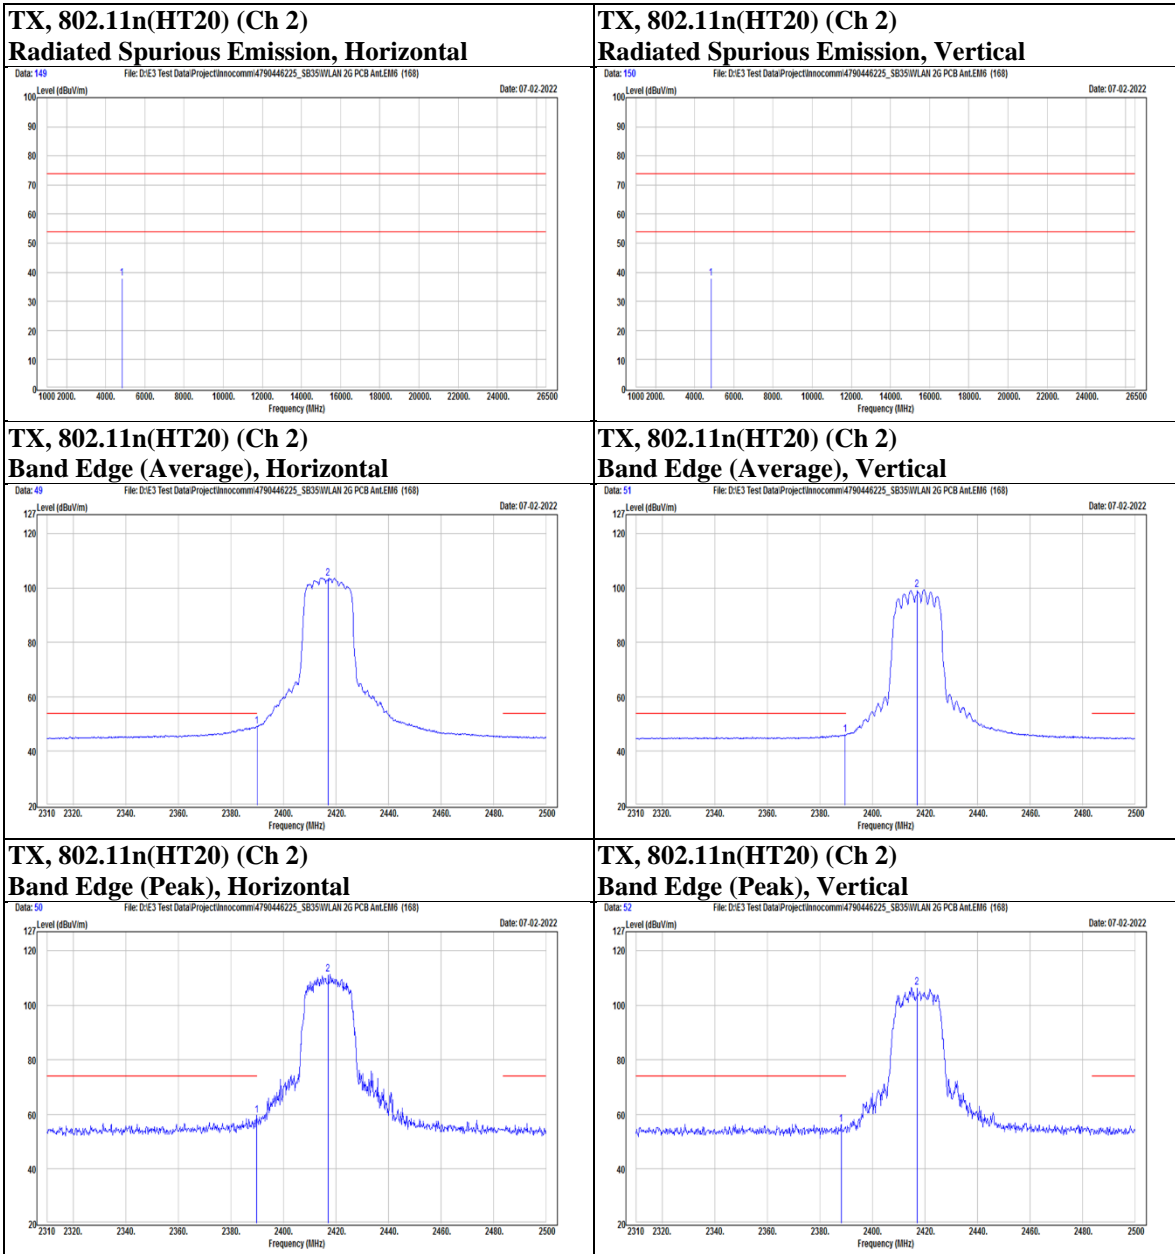

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT20) | Channel | 6 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 2376.5 | 49.7 | 15.84 | 65.54 | 74 | -8.46 | PK |
| | | 2389.99 | 37.53 | 15.82 | 53.35 | 54 | -0.65 | AVG |
| | @ | 2437 | 99.88 | 15.92 | 115.8 | N/A | N/A | PK |
| | @ | 2437 | 93.2 | 15.92 | 109.12 | N/A | N/A | AVG |
| | | 2484.23 | 37.92 | 15.68 | 53.6 | 54 | -0.4 | AVG |
| | | 2484.99 | 51.97 | 15.67 | 67.64 | 74 | -6.36 | PK |
| | * | 4874 | 37.13 | 2.4 | 39.53 | 74 | -34.47 | PK |
| Vertical | | 2388.09 | 45.65 | 15.82 | 61.47 | 74 | -12.53 | PK |
| | | 2389.8 | 33 | 15.82 | 48.82 | 54 | -5.18 | AVG |
| | @ | 2437 | 96.12 | 15.92 | 112.04 | N/A | N/A | PK |
| | @ | 2437 | 89.38 | 15.92 | 105.3 | N/A | N/A | AVG |
| | | 2483.66 | 35.07 | 15.68 | 50.75 | 54 | -3.25 | AVG |
| | | 2486.51 | 48.85 | 15.66 | 64.51 | 74 | -9.49 | PK |
| | * | 4874 | 34.95 | 2.4 | 37.35 | 74 | -36.65 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

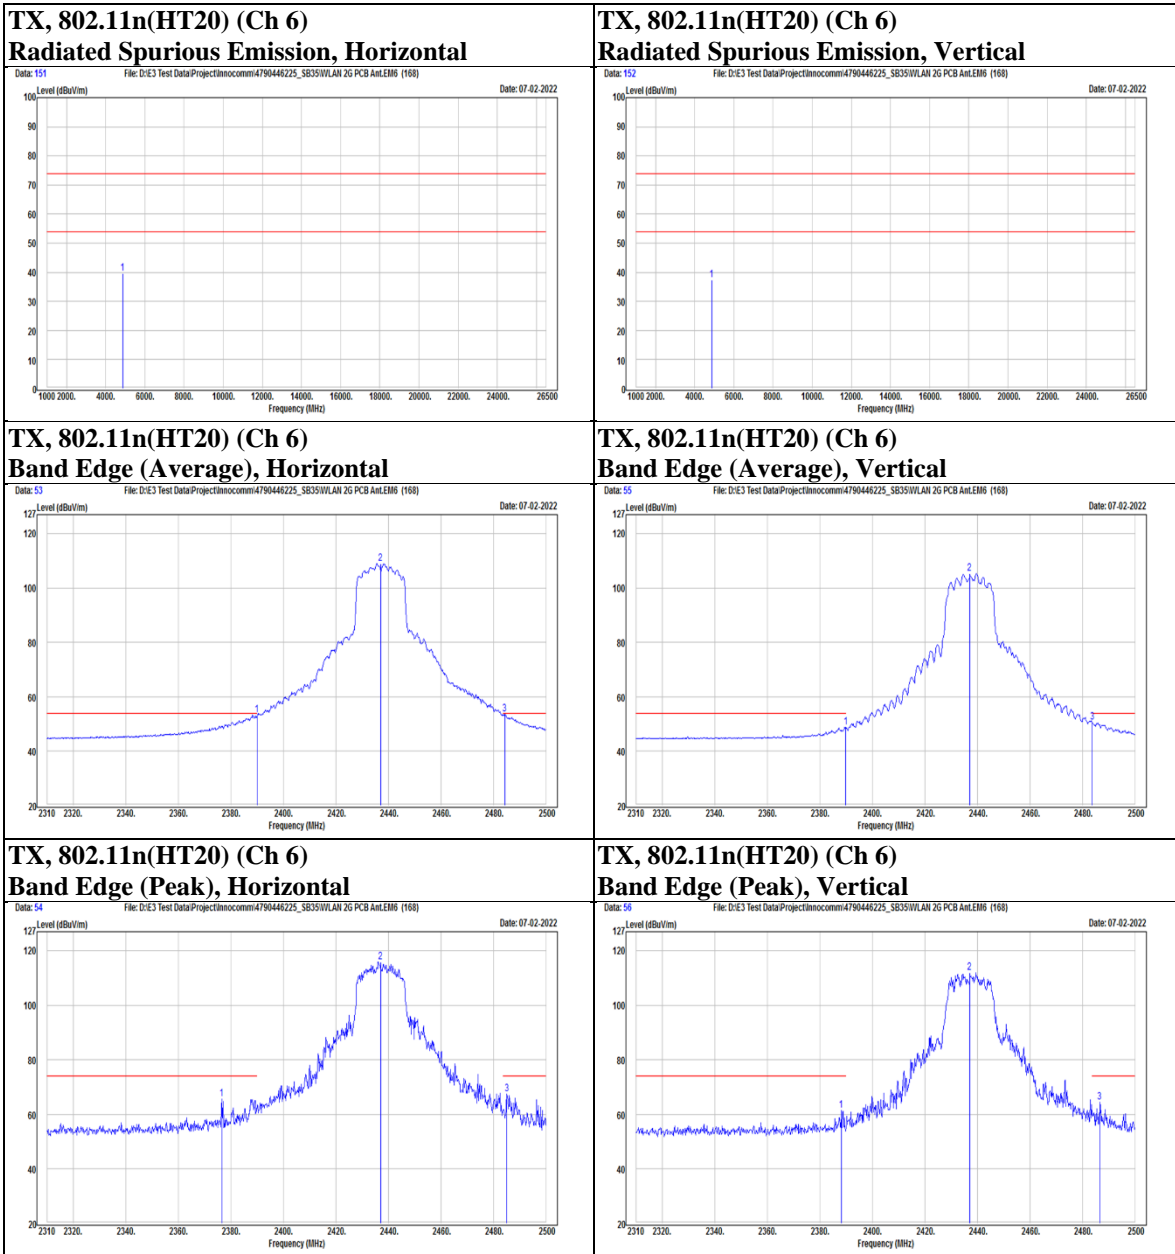



| | | | |
|------|---------------|---------|----|
| Mode | 802.11n(HT20) | Channel | 10 |
|------|---------------|---------|----|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | @ | 2457 | 93.9 | 15.92 | 109.82 | N/A | N/A | PK |
| | @ | 2457 | 86.07 | 15.92 | 101.99 | N/A | N/A | AVG |
| | | 2484.04 | 33.84 | 15.68 | 49.52 | 54 | -4.48 | AVG |
| | | 2484.8 | 43.87 | 15.67 | 59.54 | 74 | -14.46 | PK |
| | * | 4914 | 34.99 | 2.42 | 37.41 | 74 | -36.59 | PK |
| Vertical | @ | 2457 | 89.92 | 15.92 | 105.84 | N/A | N/A | PK |
| | @ | 2457 | 82.43 | 15.92 | 98.35 | N/A | N/A | AVG |
| | | 2484.04 | 31.89 | 15.68 | 47.57 | 54 | -6.43 | AVG |
| | | 2488.6 | 43.51 | 15.64 | 59.15 | 74 | -14.85 | PK |
| | * | 4914 | 35.13 | 2.42 | 37.55 | 74 | -36.45 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

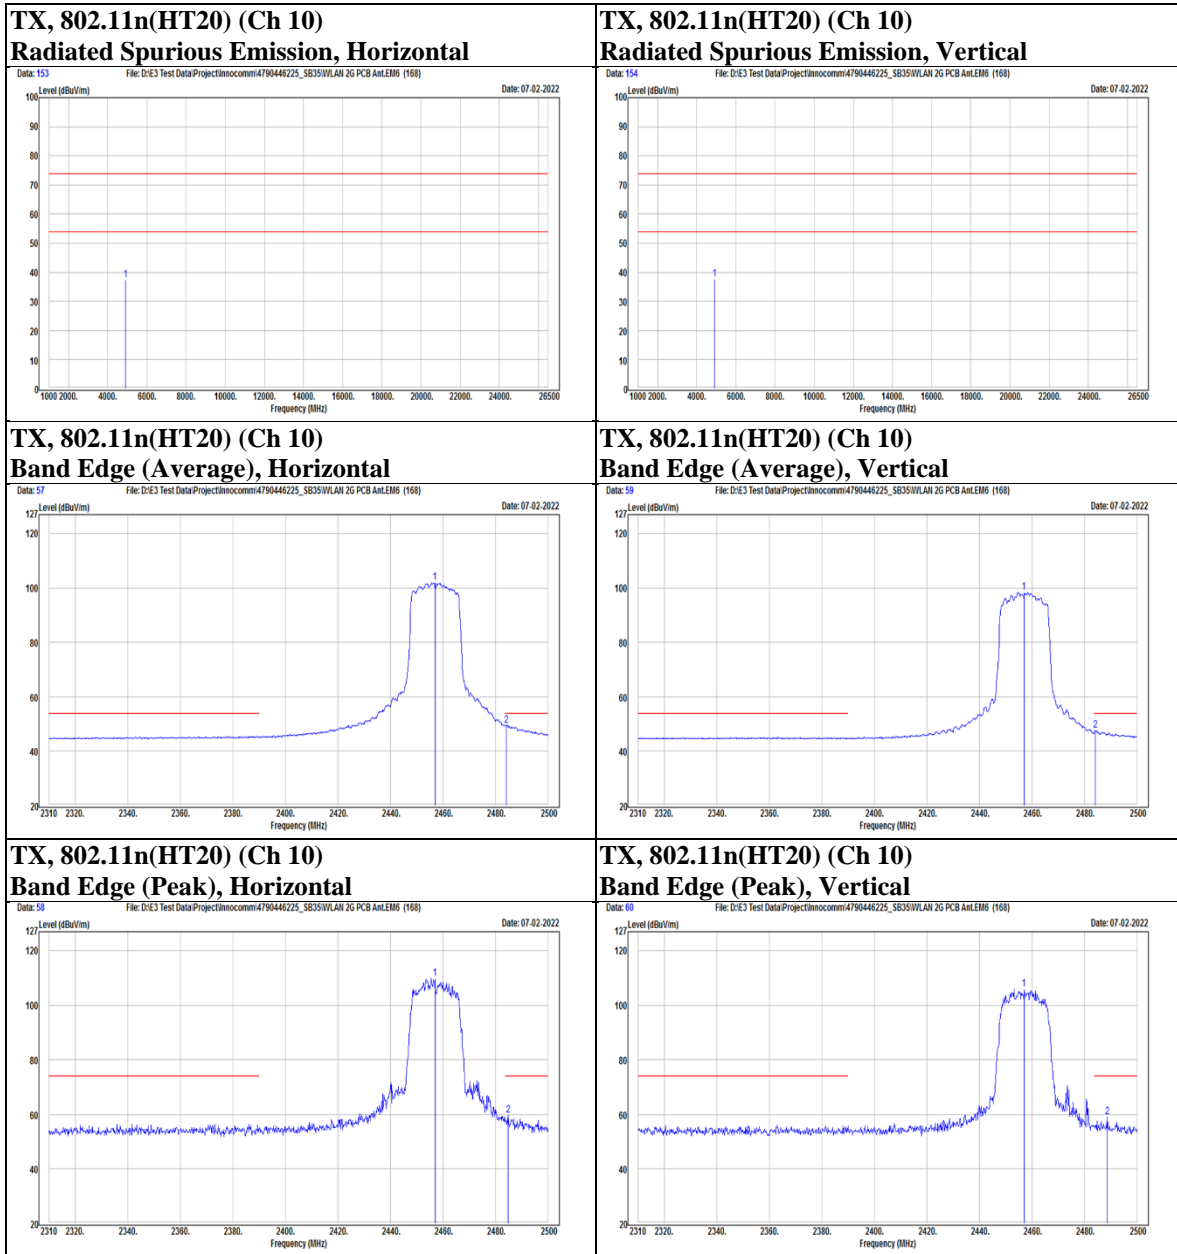



| | | | |
|------|---------------|---------|----|
| Mode | 802.11n(HT20) | Channel | 11 |
|------|---------------|---------|----|


| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | @ | 2462 | 92.16 | 15.87 | 108.03 | N/A | N/A | PK |
| | @ | 2462 | 84.32 | 15.87 | 100.19 | N/A | N/A | AVG |
| | | 2483.66 | 30.84 | 15.68 | 46.52 | 54 | -7.48 | AVG |
| | | 2486.32 | 41.79 | 15.67 | 57.46 | 74 | -16.54 | PK |
| | * | 4924 | 35.02 | 2.4 | 37.42 | 74 | -36.58 | PK |
| Vertical | @ | 2462 | 88.33 | 15.87 | 104.2 | N/A | N/A | PK |
| | @ | 2462 | 80.4 | 15.87 | 96.27 | N/A | N/A | AVG |
| | | 2483.66 | 29.88 | 15.68 | 45.56 | 54 | -8.44 | AVG |
| | | 2490.5 | 40.71 | 15.62 | 56.33 | 74 | -17.67 | PK |
| | * | 4924 | 34.73 | 2.4 | 37.13 | 74 | -36.87 | PK |

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

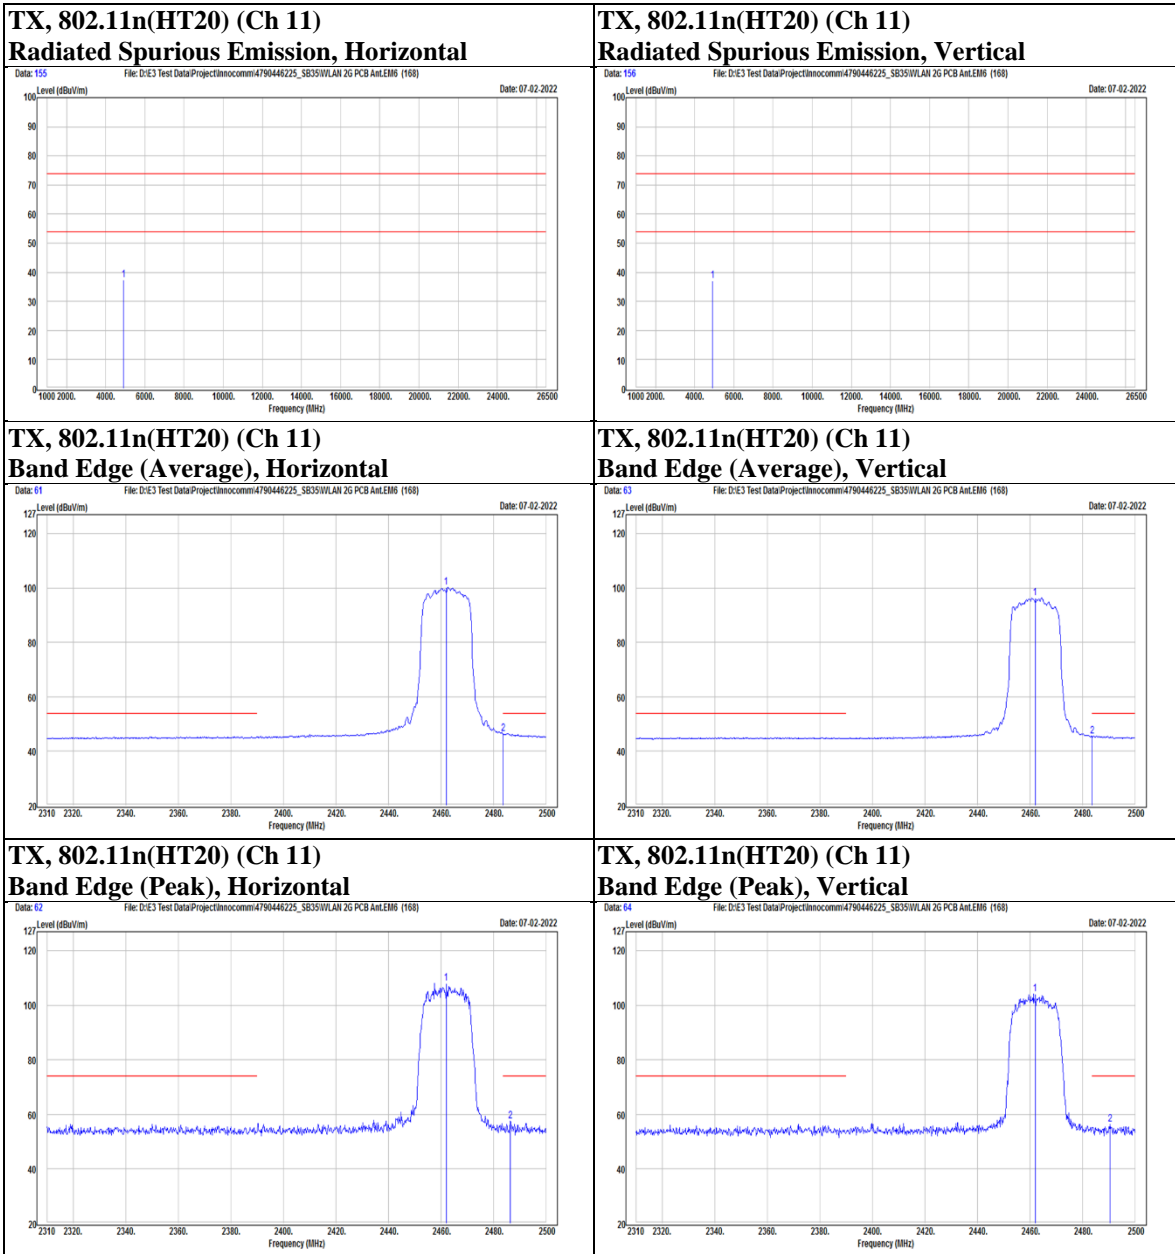



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT40) | Channel | 3 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 2389.61 | 47.54 | 15.82 | 63.36 | 74 | -10.64 | PK |
| | | 2389.61 | 31.63 | 15.82 | 47.45 | 54 | -6.55 | AVG |
| | @ | 2422 | 86.05 | 15.86 | 101.91 | N/A | N/A | PK |
| | @ | 2422 | 79.01 | 15.86 | 94.87 | N/A | N/A | AVG |
| | * | 4844 | 35.2 | 2.38 | 37.58 | 74 | -36.42 | PK |
| Vertical | | 2347.81 | 41.22 | 15.9 | 57.12 | 74 | -16.88 | PK |
| | | 2385.81 | 30.04 | 15.83 | 45.87 | 54 | -8.13 | AVG |
| | @ | 2422 | 83.14 | 15.86 | 99 | N/A | N/A | PK |
| | @ | 2422 | 75.9 | 15.86 | 91.76 | N/A | N/A | AVG |
| | * | 4844 | 35.72 | 2.38 | 38.1 | 74 | -35.9 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

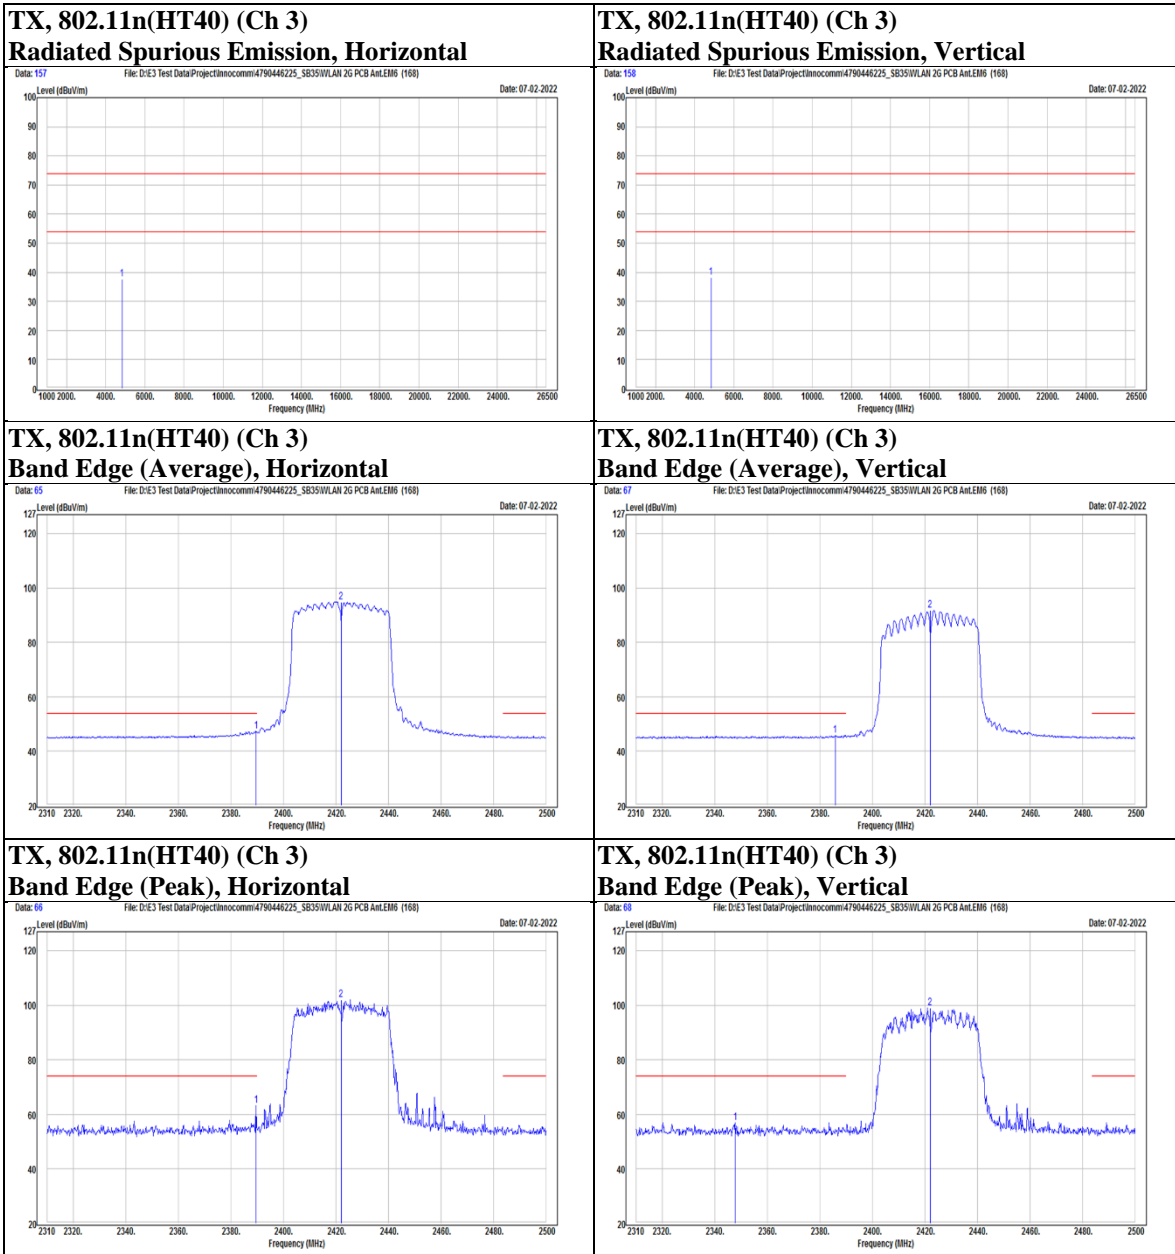

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT40) | Channel | 4 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 2389.23 | 42.99 | 15.82 | 58.81 | 74 | -15.19 | PK |
| | | 2389.23 | 32.19 | 15.82 | 48.01 | 54 | -5.99 | AVG |
| | @ | 2427 | 88.22 | 15.88 | 104.1 | N/A | N/A | PK |
| | @ | 2427 | 81.89 | 15.88 | 97.77 | N/A | N/A | AVG |
| | * | 4854 | 34.95 | 2.38 | 37.33 | 74 | -36.67 | PK |
| Vertical | | 2343.06 | 41.23 | 15.9 | 57.13 | 74 | -16.87 | PK |
| | | 2381.25 | 29.79 | 15.83 | 45.62 | 54 | -8.38 | AVG |
| | @ | 2427 | 85.53 | 15.88 | 101.41 | N/A | N/A | PK |
| | @ | 2427 | 78.61 | 15.88 | 94.49 | N/A | N/A | AVG |
| | * | 4854 | 35.79 | 2.38 | 38.17 | 74 | -35.83 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

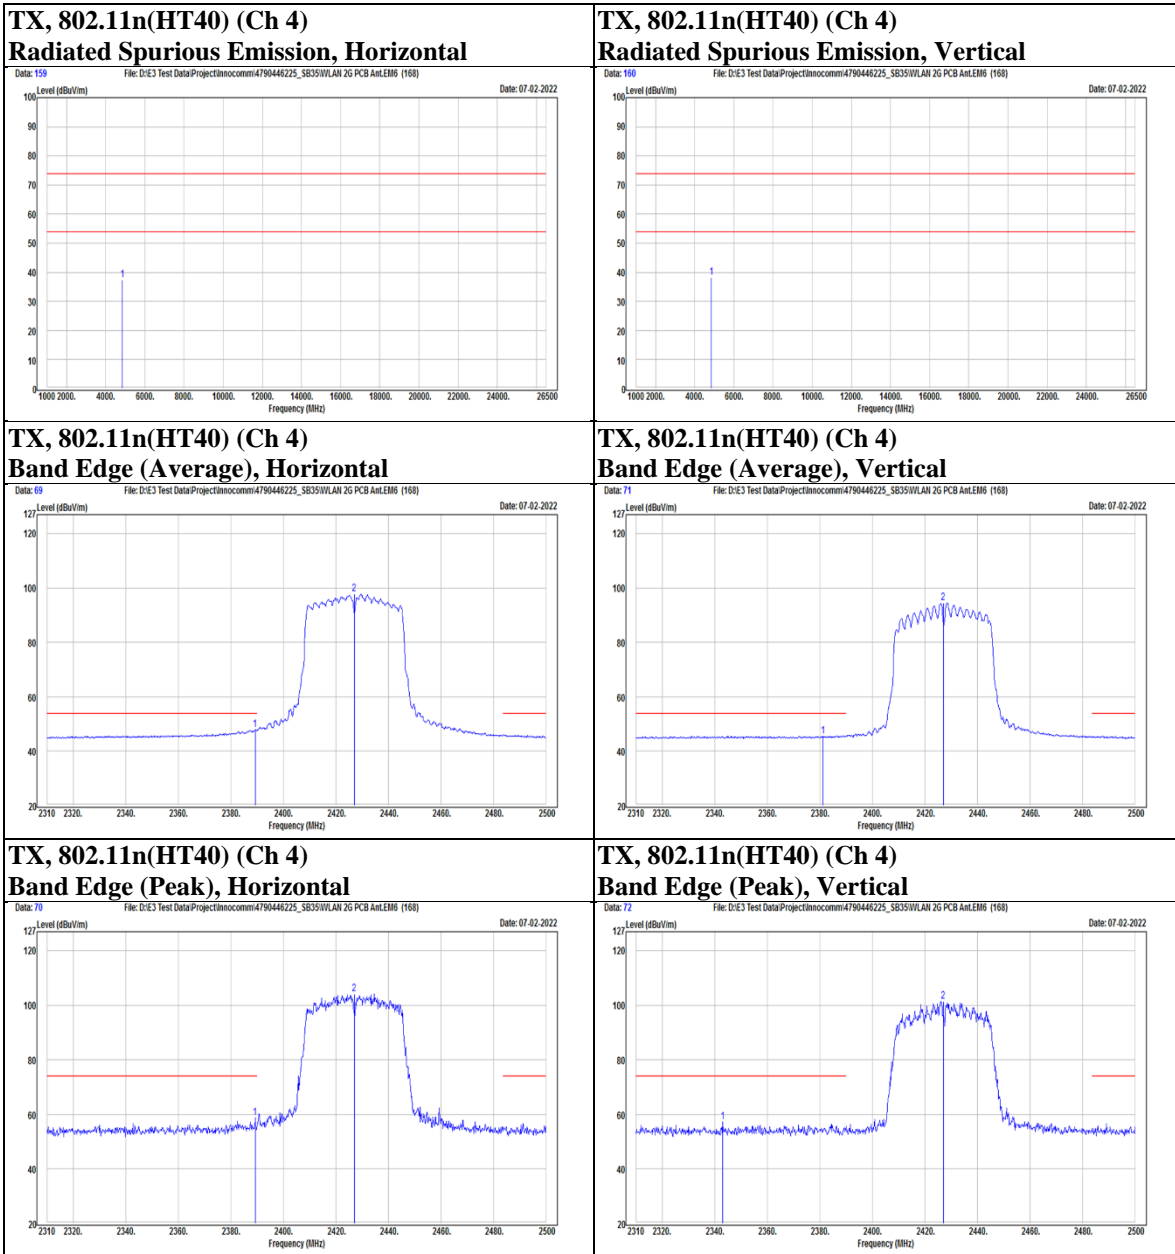

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT40) | Channel | 6 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 2388.85 | 33.38 | 15.81 | 49.19 | 54 | -4.81 | AVG |
| | | 2389.23 | 41.72 | 15.82 | 57.54 | 74 | -16.46 | PK |
| | @ | 2437 | 92.44 | 15.92 | 108.36 | N/A | N/A | PK |
| | @ | 2437 | 85.16 | 15.92 | 101.08 | N/A | N/A | AVG |
| | | 2483.85 | 33.36 | 15.68 | 49.04 | 54 | -4.96 | AVG |
| | | 2490.12 | 42.35 | 15.63 | 57.98 | 74 | -16.02 | PK |
| | * | 4874 | 35.13 | 2.4 | 37.53 | 74 | -36.47 | PK |
| Vertical | | 2354.46 | 40.78 | 15.89 | 56.67 | 74 | -17.33 | PK |
| | | 2388.47 | 30.39 | 15.82 | 46.21 | 54 | -7.79 | AVG |
| | @ | 2437 | 88.69 | 15.92 | 104.61 | N/A | N/A | PK |
| | @ | 2437 | 82.36 | 15.92 | 98.28 | N/A | N/A | AVG |
| | | 2484.23 | 31.39 | 15.68 | 47.07 | 54 | -6.93 | AVG |
| | | 2485.56 | 41.81 | 15.67 | 57.48 | 74 | -16.52 | PK |
| | * | 4874 | 35.2 | 2.4 | 37.6 | 74 | -36.4 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

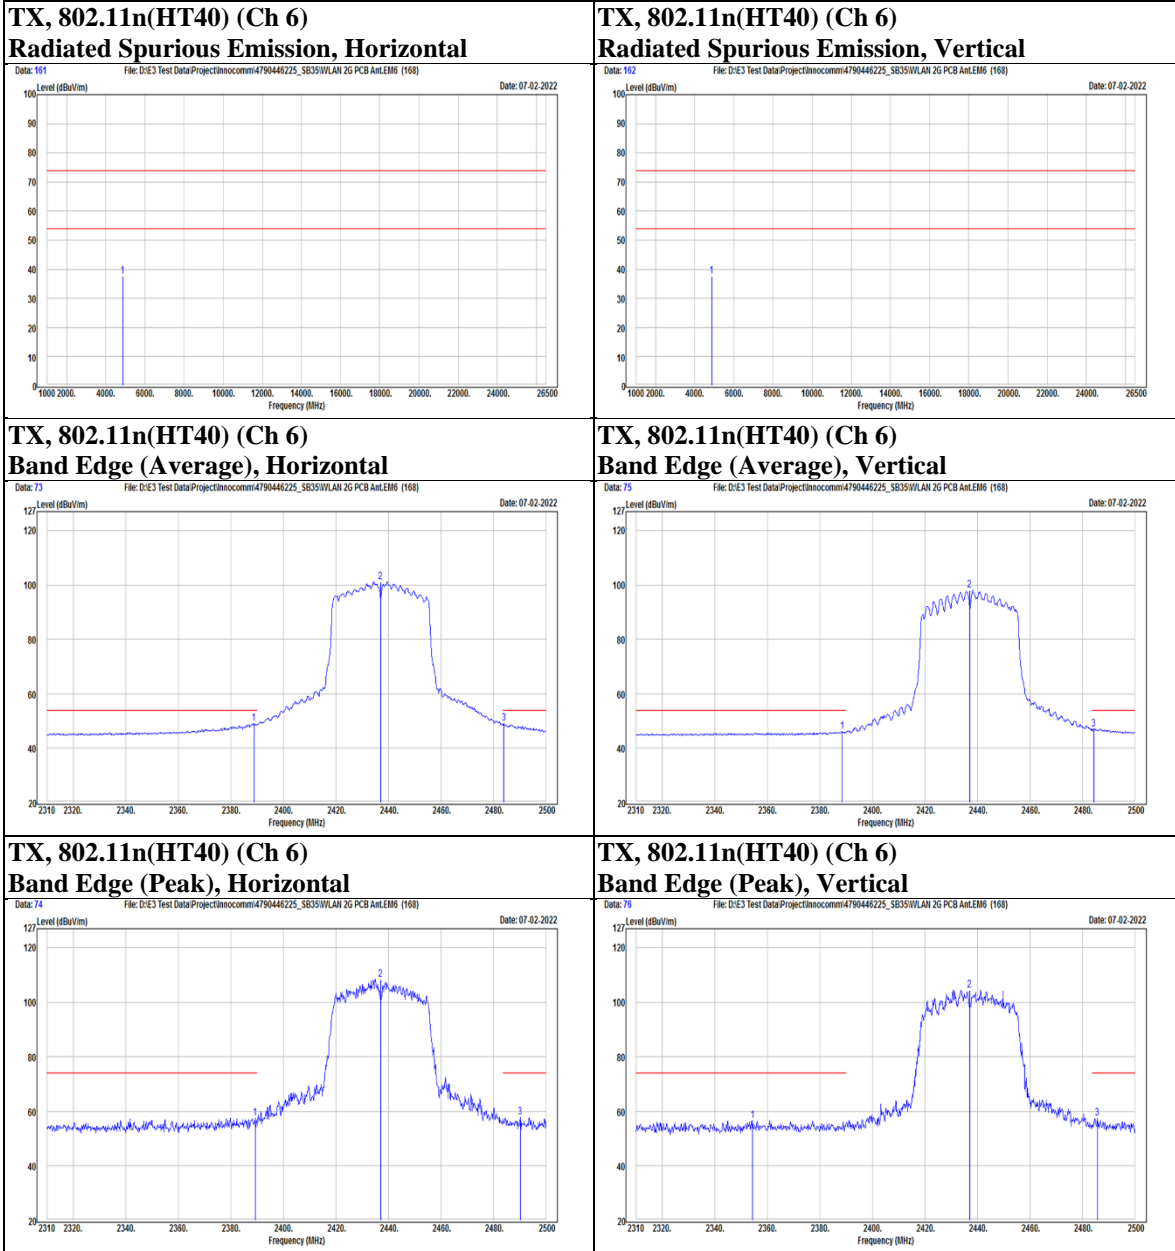



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT40) | Channel | 8 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency (MHz) | Reading (dBuV) | Correct (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Margin (dB) | Remark |
|--------------|----------|--------------------|-------------------|-------------------|--------------------|-------------------|----------------|--------|
| Horizontal | @ | 2447 | 87.39 | 15.96 | 103.35 | N/A | N/A | PK |
| | @ | 2447 | 80.68 | 15.96 | 96.64 | N/A | N/A | AVG |
| | | 2484.23 | 41.75 | 15.68 | 57.43 | 74 | -16.57 | PK |
| | | 2485.18 | 31.13 | 15.67 | 46.8 | 54 | -7.2 | AVG |
| | * | 4894 | 35.93 | 2.42 | 38.35 | 74 | -35.65 | PK |
| Vertical | @ | 2447 | 84.93 | 15.96 | 100.89 | N/A | N/A | PK |
| | @ | 2447 | 78.04 | 15.96 | 94 | N/A | N/A | AVG |
| | | 2483.66 | 30.17 | 15.68 | 45.85 | 54 | -8.15 | AVG |
| | | 2496.01 | 40.95 | 15.58 | 56.53 | 74 | -17.47 | PK |
| | * | 4894 | 34.73 | 2.42 | 37.15 | 74 | -36.85 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

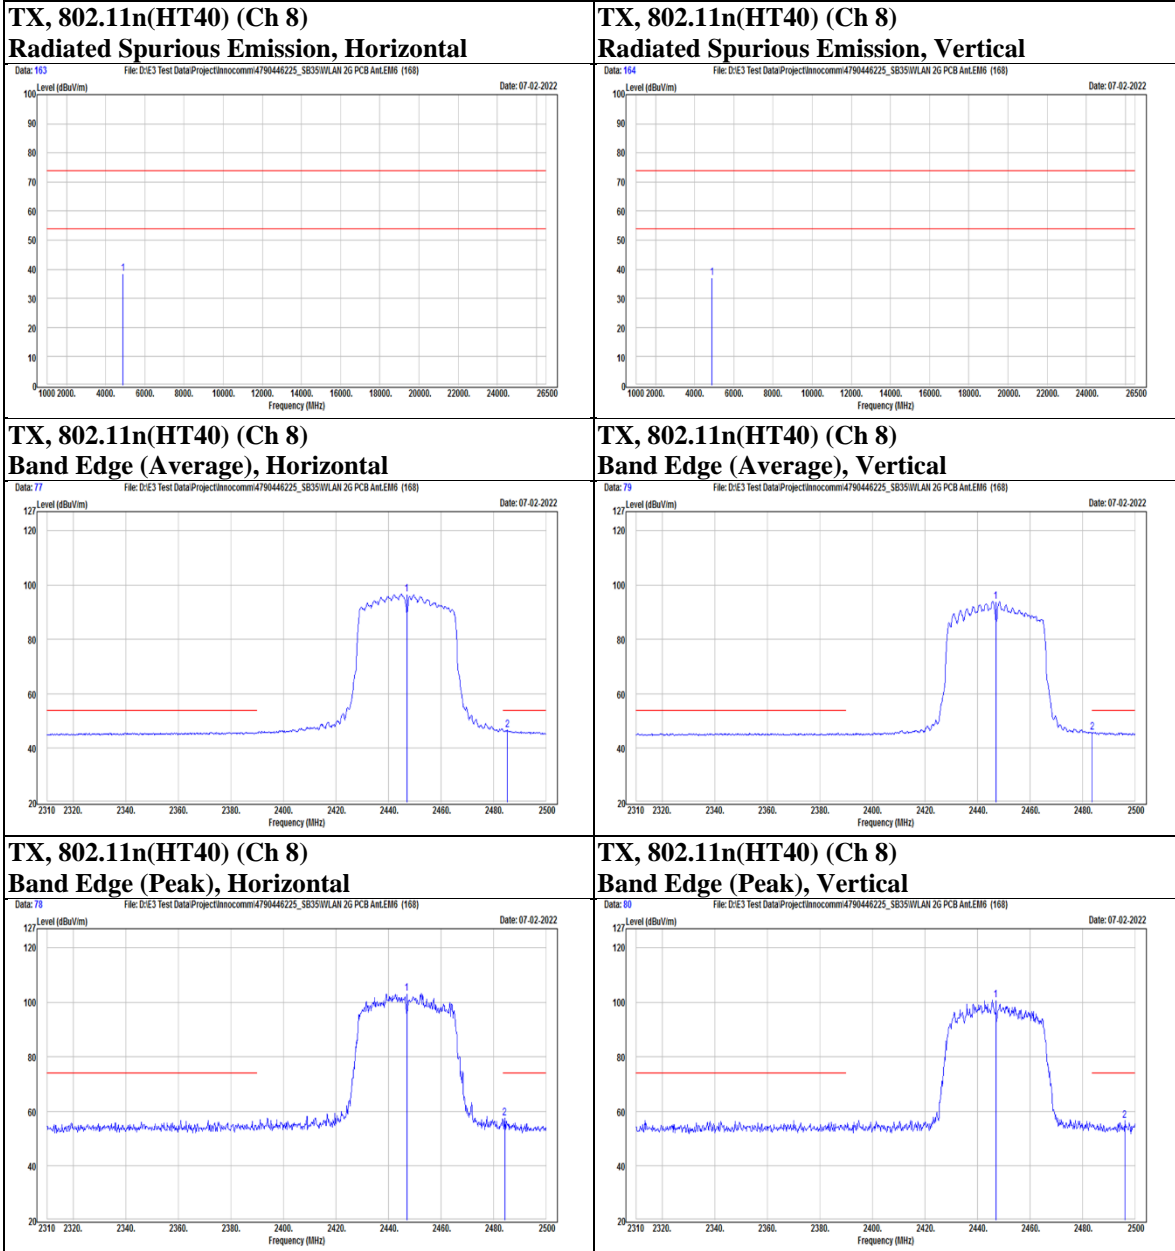



| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT40) | Channel | 9 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | @ | 2452 | 86.49 | 15.96 | 102.45 | N/A | N/A | PK |
| | @ | 2452 | 78.4 | 15.96 | 94.36 | N/A | N/A | AVG |
| | | 2483.66 | 31.17 | 15.68 | 46.85 | 54 | -7.15 | AVG |
| | | 2487.08 | 40.89 | 15.66 | 56.55 | 74 | -17.45 | PK |
| | * | 4904 | 35.27 | 2.42 | 37.69 | 74 | -36.31 | PK |
| Vertical | @ | 2452 | 82.92 | 15.96 | 98.88 | N/A | N/A | PK |
| | @ | 2452 | 74.65 | 15.96 | 90.61 | N/A | N/A | AVG |
| | | 2484.23 | 30.5 | 15.68 | 46.18 | 54 | -7.82 | AVG |
| | | 2487.65 | 44.21 | 15.65 | 59.86 | 74 | -14.14 | PK |
| | * | 4904 | 35.39 | 2.42 | 37.81 | 74 | -36.19 | PK |


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

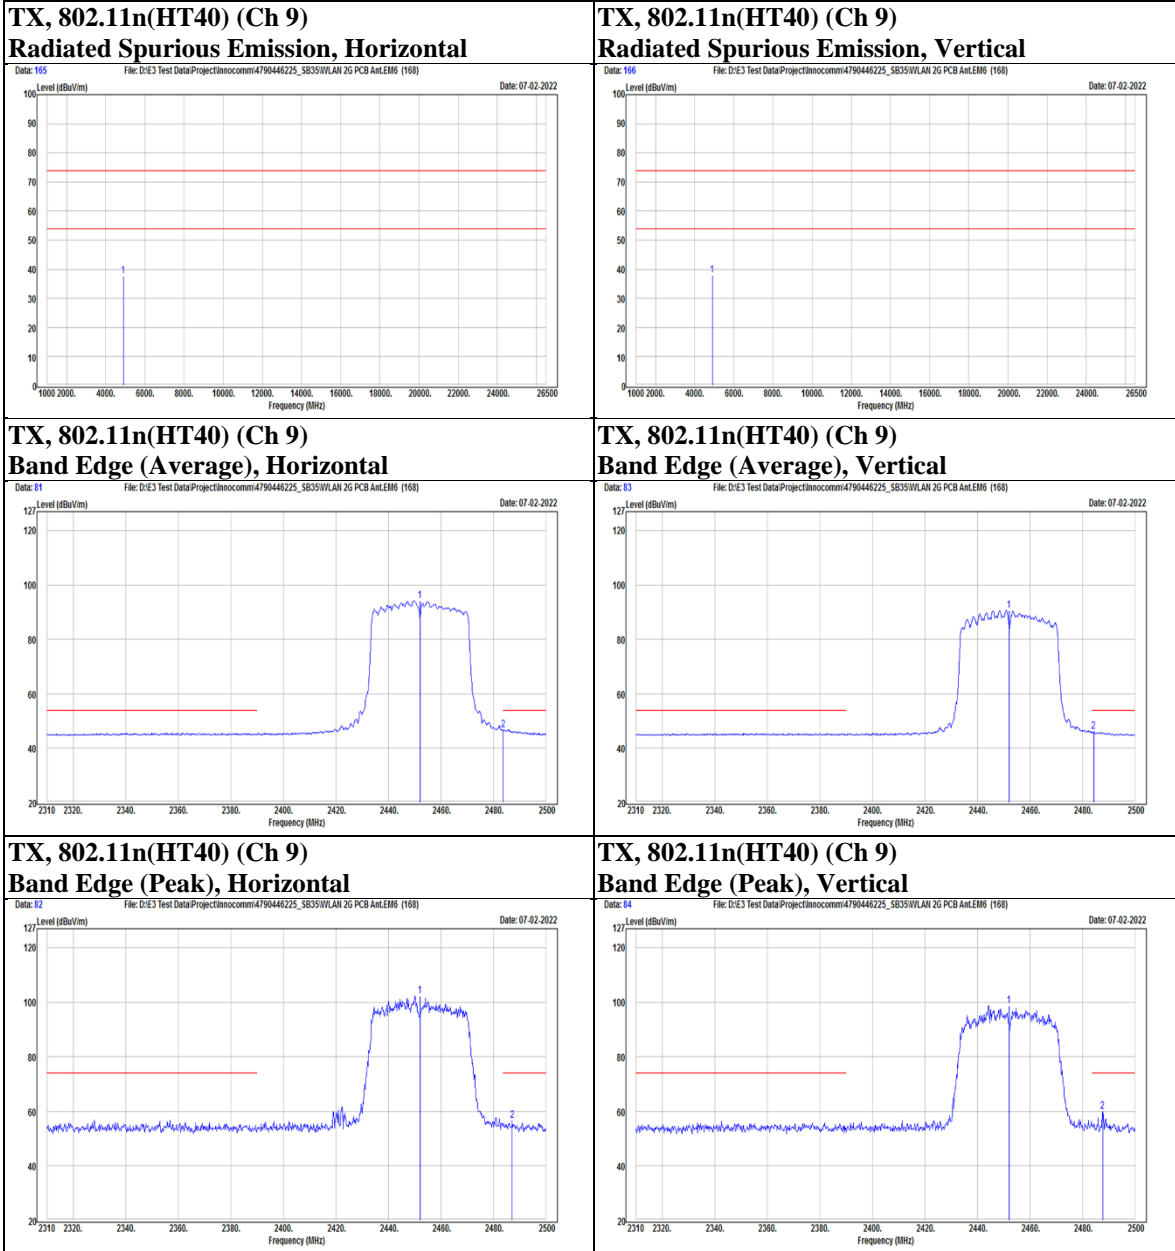




Below 1 GHz

| | | | |
|------|---------------|---------|---|
| Mode | 802.11n(HT20) | Channel | 6 |
|------|---------------|---------|---|

| Polarization | Notation | Frequency | Reading | Correct | Result | Limit | Margin | Remark |
|--------------|----------|-----------|---------|---------|----------|----------|--------|--------|
| | | (MHz) | (dBuV) | (dB/m) | (dBuV/m) | (dBuV/m) | (dB) | |
| Horizontal | | 159.98 | 38.86 | -11.11 | 27.75 | 43.5 | -15.75 | PK |
| | | 267.65 | 39.84 | -11.12 | 28.72 | 46 | -17.28 | PK |
| | | 310.33 | 44.44 | -9.79 | 34.65 | 46 | -11.35 | PK |
| | | 350.1 | 43.09 | -8.64 | 34.45 | 46 | -11.55 | PK |
| | | 397.63 | 38.42 | -7.15 | 31.27 | 46 | -14.73 | PK |
| | | 424.79 | 37.38 | -6.39 | 30.99 | 46 | -15.01 | PK |
| Vertical | | 72.68 | 41.01 | -14.62 | 26.39 | 40 | -13.61 | PK |
| | | 83.35 | 45.01 | -17.18 | 27.83 | 40 | -12.17 | PK |
| | | 159.98 | 37.77 | -11.11 | 26.66 | 43.5 | -16.84 | PK |
| | | 215.27 | 38.94 | -13.33 | 25.61 | 43.5 | -17.89 | PK |
| | | 318.09 | 36.81 | -9.43 | 27.38 | 46 | -18.62 | PK |
| | | 359.8 | 36.96 | -8.3 | 28.66 | 46 | -17.34 | PK |

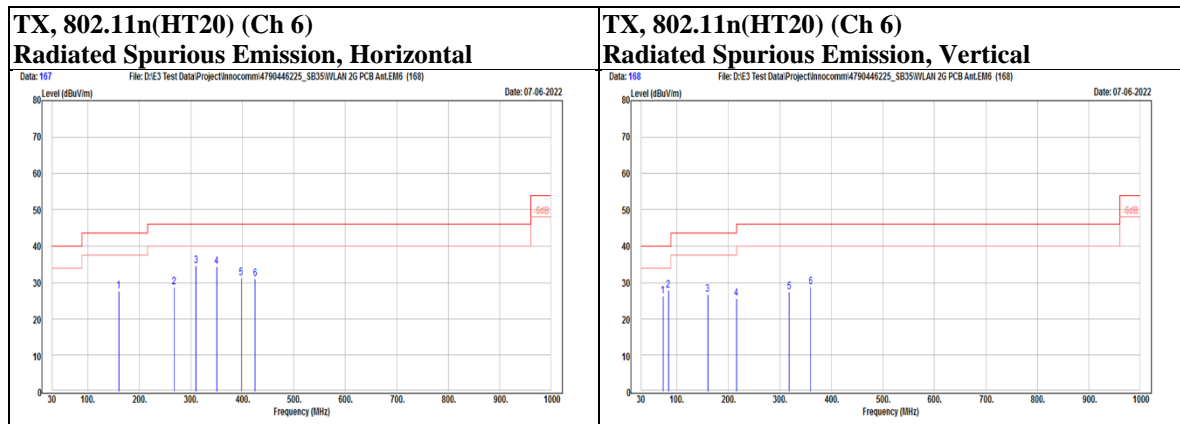

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



9 kHz ~ 30 MHz Data:

For 9 kHz to 30 MHz radiated emission have performed all modes of operation were investigated. The amplitude of spurious emissions attenuated more than 20 dB below the permissible value is not required to be report.

No non-compliance noted:

KDB 414788 D01 OATS and Chamber Correlation Justification

- Base on FCC 15.31 (f) (2): measurements may be performed at a distance closer than that specified in the regulations; however, an attempt should be made to avoid making measurements in the near field.

- OATs and chamber correlation testing had been performed and chamber measured test results is the worst case test result.

Although these tests were performed other than open area test site, adequate comparison measurements were confirmed against 30m open area test site. Therefore sufficient tests were made to demonstrate that the alternative site produces results that correlate with the ones of tests made in an open field based on KDB 414788.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



9.6. AC Power Line Conducted Emission

Requirements

| Frequency (MHz) | Conducted limit (dB μ V) | |
|-----------------|------------------------------|---------|
| | Quasi-peak | Average |
| 0.15 - 0.5 | 66 - 56 | 56 - 46 |
| 0.50 - 5.0 | 56 | 46 |
| 5.0 - 30 | 60 | 50 |

Note:

1. The lower limit shall apply at the transition frequencies.
2. The limit decreases in line with the logarithm of the frequency in the range of 0.15 to 0.50MHz.

Test Procedures

- a. The EUT was placed 0.4 meters from the conducting wall of the shielded room with EUT being connected to the power mains through a line impedance stabilization network (LISN). Other support units were connected to the power mains through another LISN. The two LISNs provide 50 ohm/ 50uH of coupling impedance for the measuring instrument.
- b. Both lines of the power mains connected to the EUT were checked for maximum conducted interference.
- c. The frequency range from 150kHz to 30MHz was searched. Emission levels under (Limit - 20dB) was not recorded.

NOTE:


1. The resolution bandwidth and video bandwidth of test receiver is 9kHz for quasi-peak detection (QP) and average detection (AV) at frequency 0.15MHz-30MHz.
2. All modes of operation were investigated (includes all external accessories) and the worst-case emissions are reported, the other emission levels were low against the limit.
3. Test data of Result value (dB μ V) = Reading value (dB μ V) + Correction Factor (dB).
4. Test data of Margin(dB) = Result value (dB μ V) - Limit value (dB μ V).
5. Test data of Correction Factor (dB) = Insertion loss(dB) + Cable loss(dB).

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan
Telephone :+886-2-7737-3000
Facsimile (FAX) :+886-3-583-7948



Test Setup

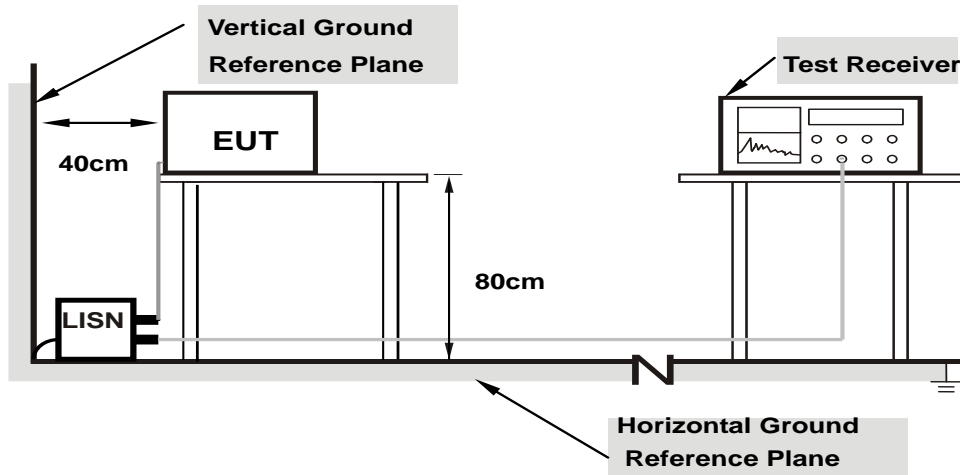

Note: 1.Support units were connected to second LISN.

For the actual test configuration, please refer to the Setup Configurations.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test Data

| | | | |
|------|------------|---------|---|
| Mode | n20_TX2437 | Channel | 6 |
|------|------------|---------|---|

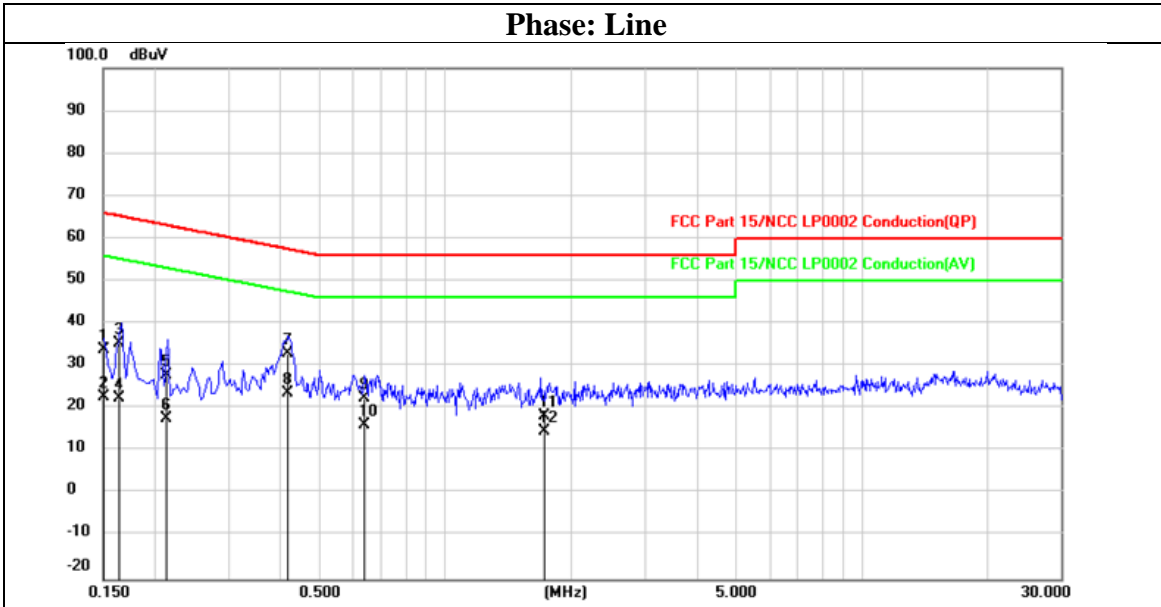

| No. | Frequency (MHz) | Reading (dBuV) | Correct (dB) | Result (dBuV) | Limit (dBuV) | Margin (dB) | Remark |
|-----|-----------------|----------------|--------------|---------------|--------------|-------------|--------|
| 1 | 0.1511 | 14.47 | 19.53 | 34.00 | 65.94 | -31.94 | QP |
| 2 | 0.1511 | 3.12 | 19.53 | 22.65 | 55.94 | -33.29 | AVG |
| 3 | 0.1638 | 15.70 | 19.53 | 35.23 | 65.27 | -30.04 | QP |
| 4 | 0.1638 | 2.82 | 19.53 | 22.35 | 55.27 | -32.92 | AVG |
| 5 | 0.2122 | 8.18 | 19.53 | 27.71 | 63.12 | -35.41 | QP |
| 6 | 0.2122 | -1.94 | 19.53 | 17.59 | 53.12 | -35.53 | AVG |
| 7 | 0.4147 | 13.30 | 19.53 | 32.83 | 57.55 | -24.72 | QP |
| 8 | 0.4147 | 4.04 | 19.53 | 23.57 | 47.55 | -23.98 | AVG |
| 9 | 0.6320 | 2.96 | 19.54 | 22.50 | 56.00 | -33.50 | QP |
| 10 | 0.6320 | -3.32 | 19.54 | 16.22 | 46.00 | -29.78 | AVG |
| 11 | 1.7390 | -1.21 | 19.57 | 18.36 | 56.00 | -37.64 | QP |
| 12 | 1.7390 | -5.04 | 19.57 | 14.53 | 46.00 | -31.47 | AVG |

Underwriters Laboratories Taiwan Co., Ltd.


Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



| | | | |
|------|------------|---------|---|
| Mode | n20_TX2437 | Channel | 6 |
|------|------------|---------|---|

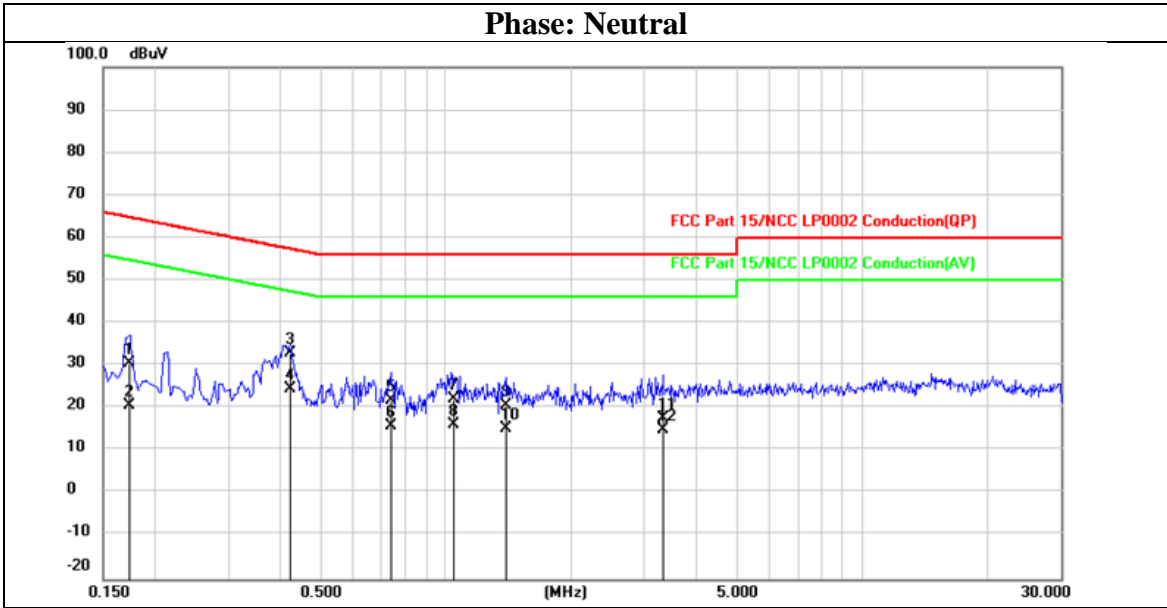

| No. | Frequency (MHz) | Reading (dBuV) | Correct (dB) | Result (dBuV) | Limit (dBuV) | Margin (dB) | Remark |
|-----|-----------------|----------------|--------------|---------------|--------------|-------------|--------|
| 1 | 0.1729 | 11.16 | 19.53 | 30.69 | 64.82 | -34.13 | QP |
| 2 | 0.1729 | 1.04 | 19.53 | 20.57 | 54.82 | -34.25 | AVG |
| 3 | 0.4221 | 13.55 | 19.53 | 33.08 | 57.41 | -24.33 | QP |
| 4 | 0.4221 | 4.98 | 19.53 | 24.51 | 47.41 | -22.90 | AVG |
| 5 | 0.7393 | 2.33 | 19.54 | 21.87 | 56.00 | -34.13 | QP |
| 6 | 0.7393 | -3.58 | 19.54 | 15.96 | 46.00 | -30.04 | AVG |
| 7 | 1.0447 | 2.72 | 19.54 | 22.26 | 56.00 | -33.74 | QP |
| 8 | 1.0447 | -3.44 | 19.54 | 16.10 | 46.00 | -29.90 | AVG |
| 9 | 1.3965 | 1.03 | 19.54 | 20.57 | 56.00 | -35.43 | QP |
| 10 | 1.3965 | -4.21 | 19.54 | 15.33 | 46.00 | -30.67 | AVG |
| 11 | 3.3388 | -2.01 | 19.59 | 17.58 | 56.00 | -38.42 | QP |
| 12 | 3.3388 | -4.76 | 19.59 | 14.83 | 46.00 | -31.17 | AVG |

END OF REPORT

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0