



Test report No. : 4790446225-US-R1-V0
Page : 181 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	100
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5431.85	40.07	19.43	59.5	74	-14.5	PK
		5431.85	29.88	19.43	49.31	54	-4.69	AVG
		5469.3	41.8	19.62	61.42	68.2	-6.78	PK
	@	5500	93.05	19.77	112.82	N/A	N/A	PK
	@	5500	86.45	19.77	106.22	N/A	N/A	AVG
	*	11000	28.6	18.41	47.01	74	-26.99	PK
Vertical		5447.95	40.53	19.5	60.03	74	-13.97	PK
		5447.95	28.66	19.5	48.16	54	-5.84	AVG
		5461.6	40.48	19.58	60.06	68.2	-8.14	PK
	@	5500	86.16	19.77	105.93	N/A	N/A	PK
	@	5500	79.15	19.77	98.92	N/A	N/A	AVG
	*	11000	31.88	18.41	50.29	74	-23.71	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

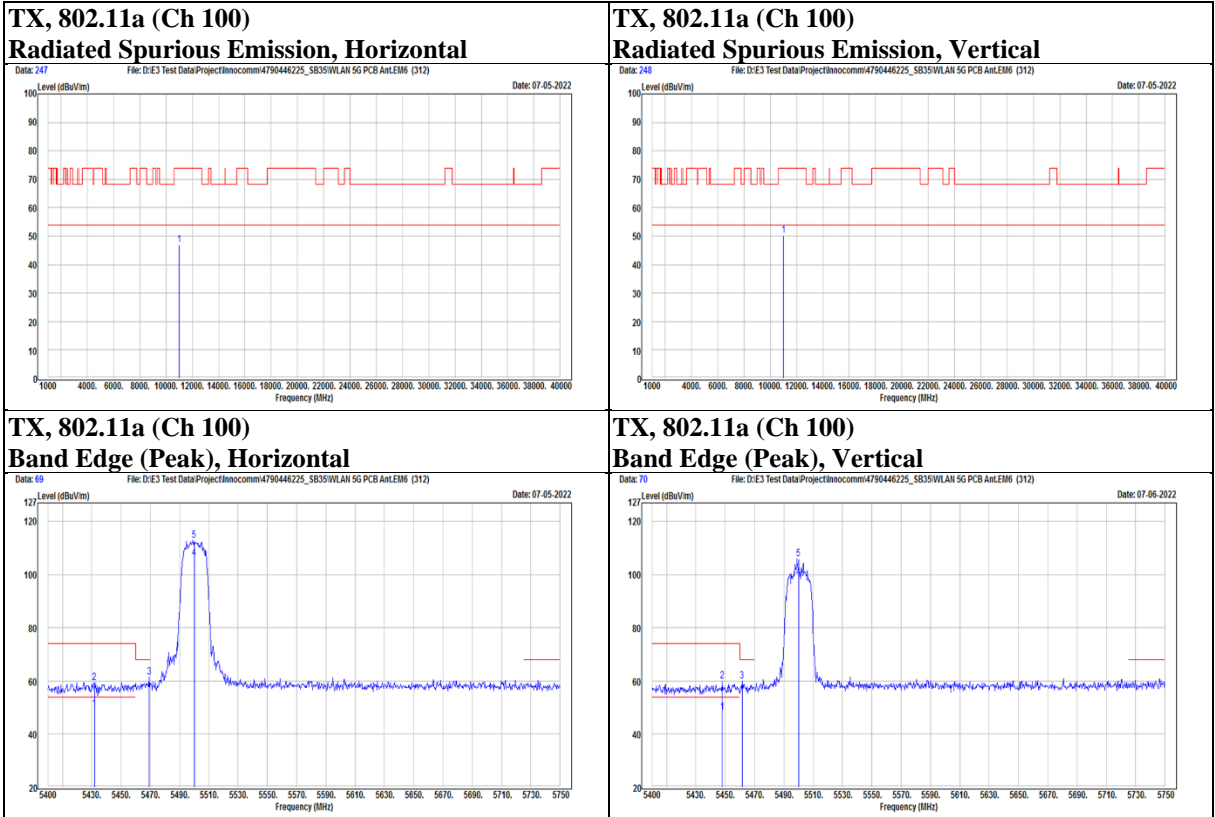

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790446225-US-R1-V0
Page : 183 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	116
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5431.15	40.52	19.42	59.94	74	-14.06	PK
		5431.15	29.19	19.42	48.61	54	-5.39	AVG
		5467.55	39.79	19.61	59.4	68.2	-8.8	PK
	@	5580	95.15	19.76	114.91	N/A	N/A	PK
	@	5580	86.1	19.76	105.86	N/A	N/A	AVG
		5746.5	40.42	20.16	60.58	68.2	-7.62	PK
	*	11160	33.49	18.47	51.96	74	-22.04	PK
Vertical		5435.7	40.18	19.45	59.63	74	-14.37	PK
		5435.7	28.66	19.45	48.11	54	-5.89	AVG
		5466.5	39.16	19.61	58.77	68.2	-9.43	PK
	@	5580	83.01	19.76	102.77	N/A	N/A	PK
	@	5580	76.5	19.76	96.26	N/A	N/A	AVG
		5733.9	40.53	20.05	60.58	68.2	-7.62	PK
		11160	39.68	18.47	58.15	74	-15.85	PK
		11160	35.38	18.47	53.85	54	-0.15	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

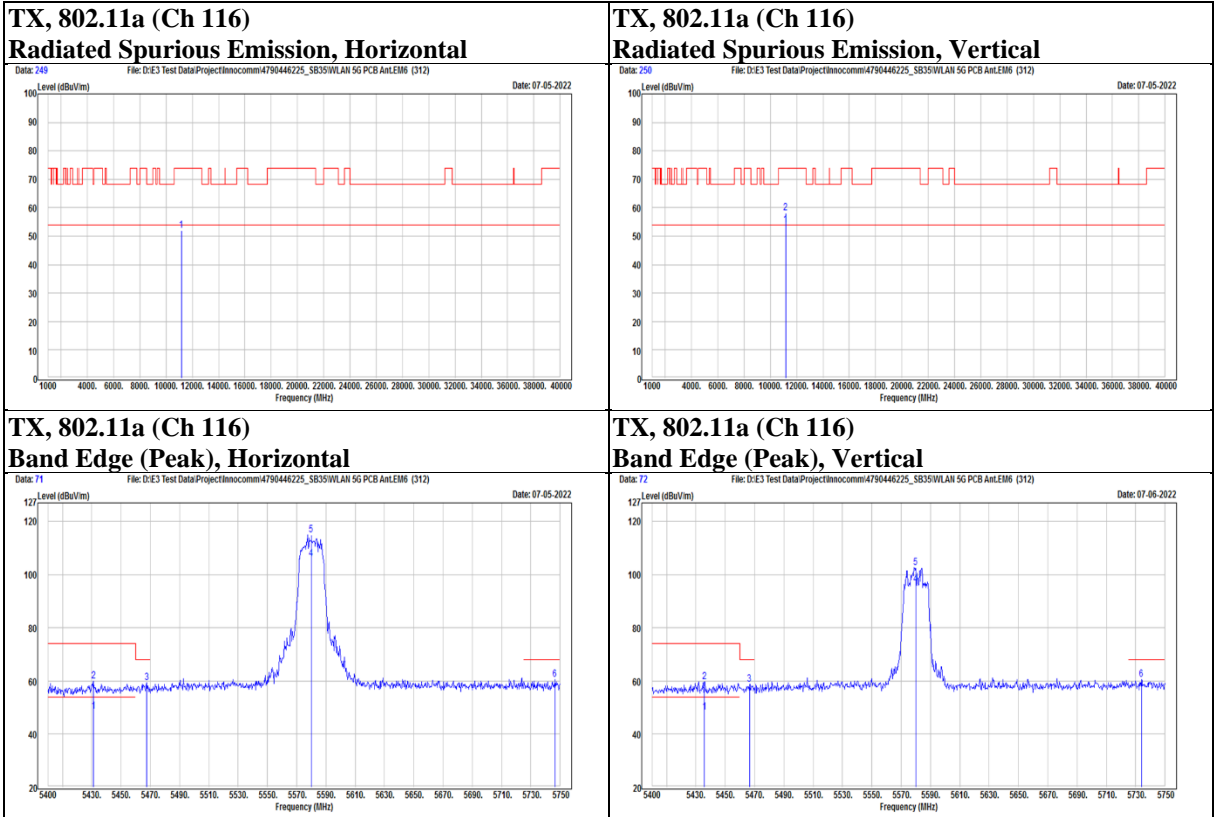

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790446225-US-R1-V0

Page : 185 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11a	Channel	140
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	89.63	19.73	109.36	N/A	N/A	PK
	@	5700	82.1	19.73	101.83	N/A	N/A	AVG
	*	5740.55	40.21	20.1	60.31	68.2	-7.89	PK
Vertical	*	11400	28.2	18.85	47.05	74	-26.95	PK
	@	5700	83.21	19.73	102.94	N/A	N/A	PK
	@	5700	75.6	19.73	95.33	N/A	N/A	AVG
	*	5736.7	40.87	20.07	60.94	68.2	-7.26	PK
	*	11400	29.09	18.85	47.94	74	-26.06	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

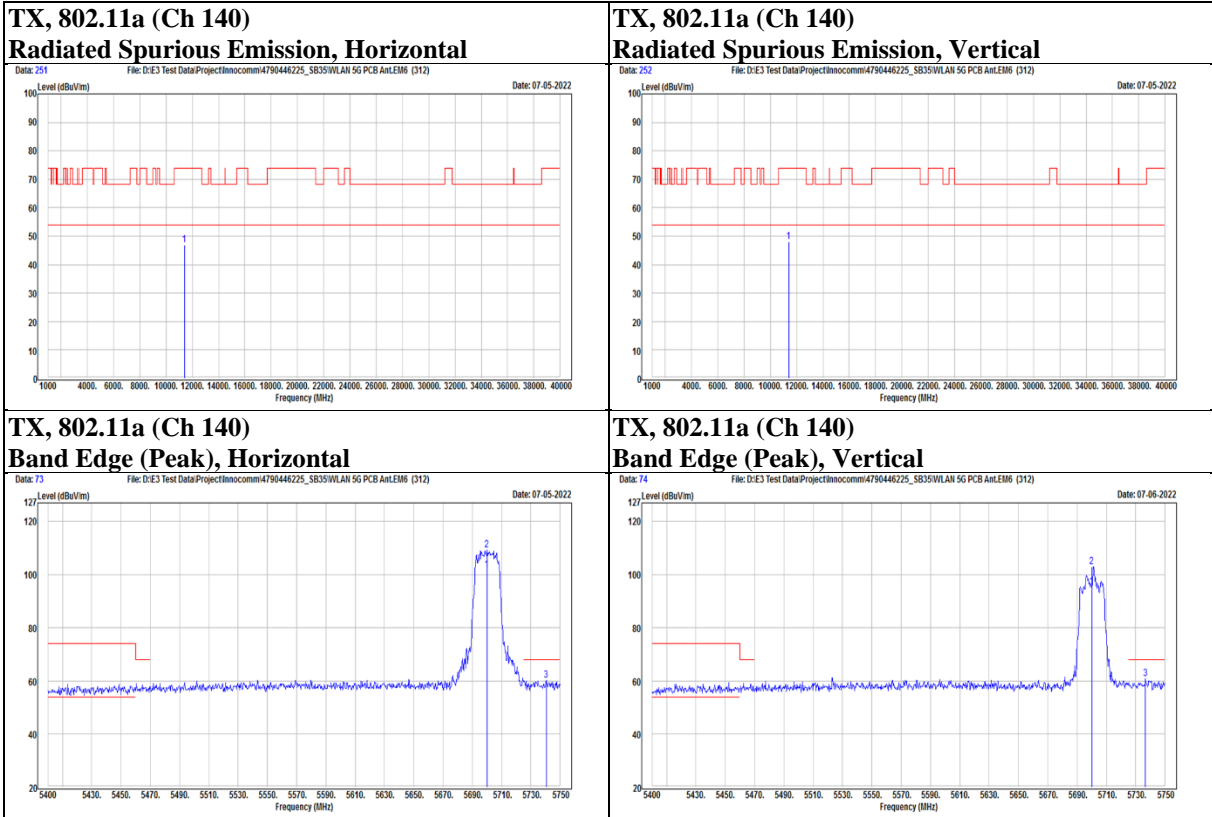

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790446225-US-R1-V0
Page : 187 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5607.5	39.72	19.7	59.42	68.2	-8.78	PK
		5674.5	40.21	19.7	59.91	86.37	-26.46	PK
	@	5745	88.93	20.15	109.08	N/A	N/A	PK
	*	11490	28.96	19.33	48.29	74	-25.71	PK
Vertical		5602.5	41.48	19.71	61.19	68.2	-7.01	PK
		5689	42.42	19.71	62.13	97.09	-34.96	PK
	@	5745	78.1	20.15	98.25	N/A	N/A	PK
		11490	35.35	19.33	54.68	74	-19.32	PK
		11490	30.88	19.33	50.21	54	-3.79	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

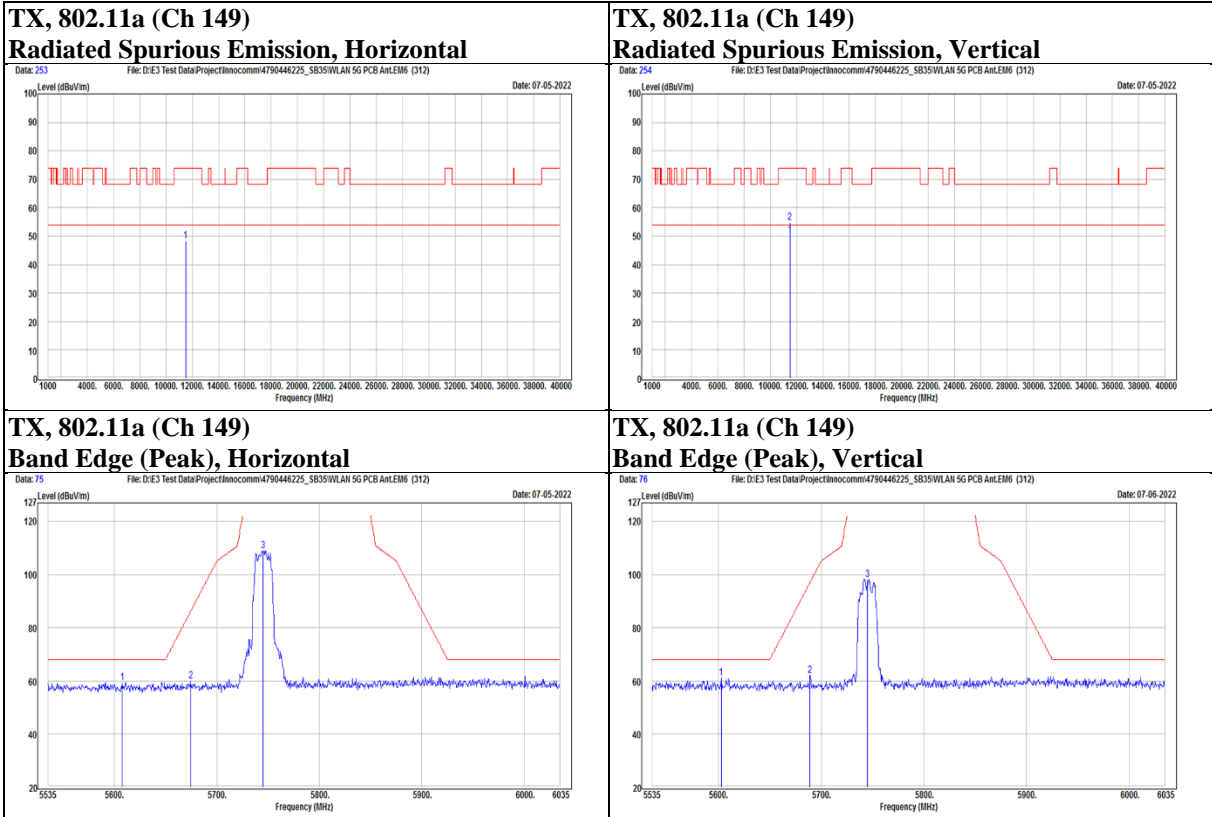

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790446225-US-R1-V0
Page : 189 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5631.5	40.61	19.68	60.29	68.2	-7.91	PK
		5659	41.05	19.68	60.73	74.88	-14.15	PK
	@	5785	90.36	20.45	110.81	N/A	N/A	PK
		5888.5	41.4	20.9	62.3	95.18	-32.88	PK
		5983	40.79	20.98	61.77	68.2	-6.43	PK
	*	11570	27.98	19.07	47.05	74	-26.95	PK
Vertical		5560.5	41.92	19.81	61.73	68.2	-6.47	PK
		5698	40.52	19.72	60.24	103.73	-43.49	PK
	@	5785	80.58	20.45	101.03	N/A	N/A	PK
		5913	40.75	20.96	61.71	77.05	-15.34	PK
		5952	40.85	20.95	61.8	68.2	-6.4	PK
	*	11570	33.44	19.07	52.51	74	-21.49	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

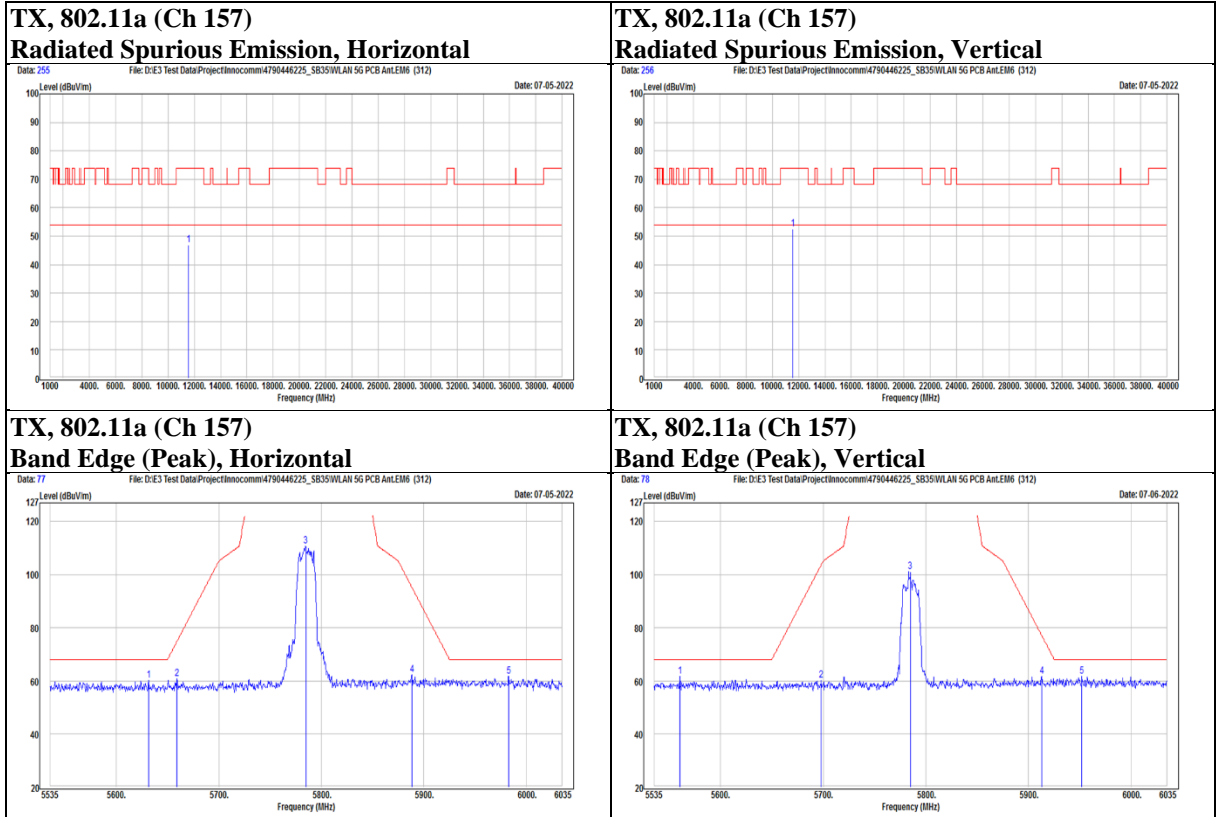

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790446225-US-R1-V0
Page : 191 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	89.33	20.58	109.91	N/A	N/A	PK
		5908	41.52	20.97	62.49	80.74	-18.25	PK
		5925.5	40.97	20.96	61.93	68.2	-6.27	PK
	*	11650	27.11	18.83	45.94	74	-28.06	PK
Vertical	@	5825	79.66	20.58	100.24	N/A	N/A	PK
		5902	40.11	20.98	61.09	85.18	-24.09	PK
		5979.5	40.88	20.97	61.85	68.2	-6.35	PK
	*	11650	30.93	18.83	49.76	74	-24.24	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

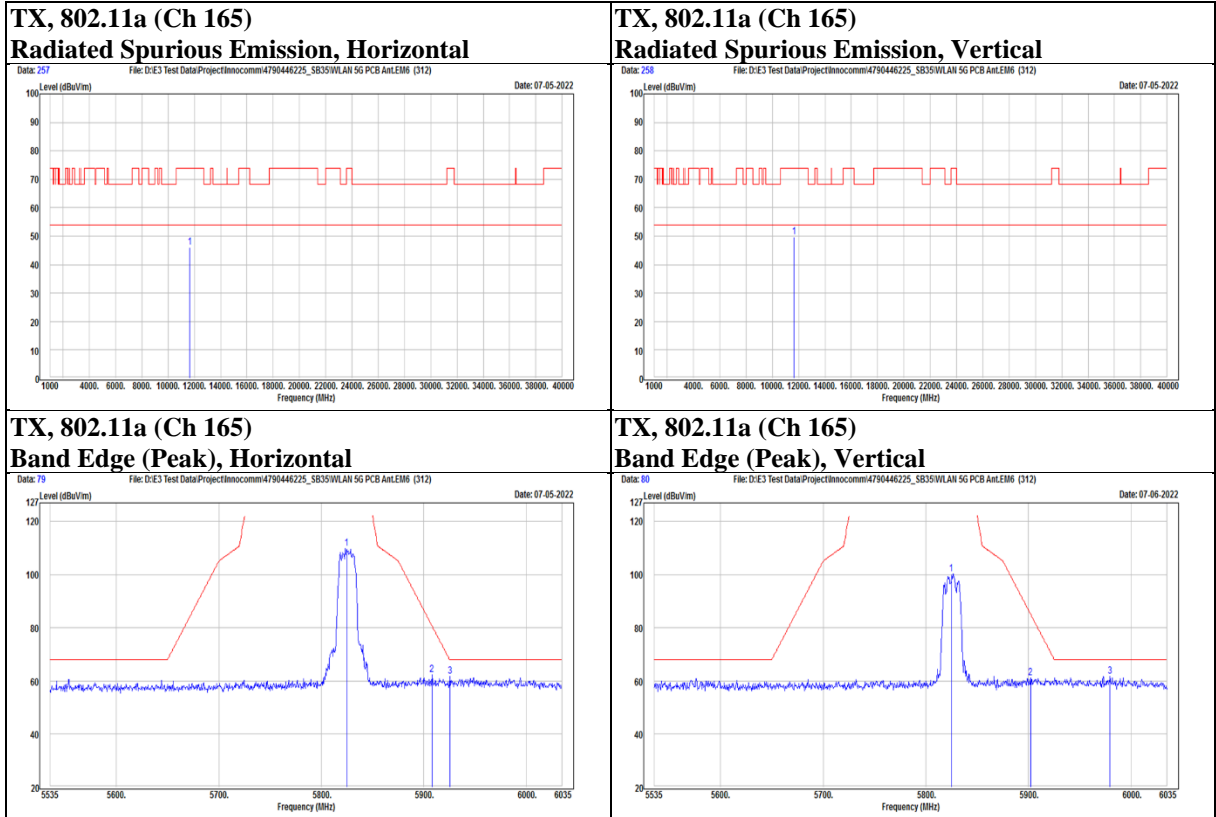



Test report No. : 4790446225-US-R1-V0
Page : 193 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5103.95	42.17	19.44	61.61	74	-12.39	PK
		5146.65	31.96	19.41	51.37	54	-2.63	AVG
	@	5180	93.4	19.31	112.71	N/A	N/A	PK
	@	5180	86.15	19.31	105.46	N/A	N/A	AVG
	*	10360	29.19	17.51	46.7	68.2	-21.5	PK
Vertical		5098.35	43.22	19.43	62.65	74	-11.35	PK
		5108.15	30.62	19.43	50.05	54	-3.95	AVG
	@	5180	81.8	19.31	101.11	N/A	N/A	PK
	@	5180	74.59	19.31	93.9	N/A	N/A	AVG
	*	10360	33.82	17.51	51.33	68.2	-16.87	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

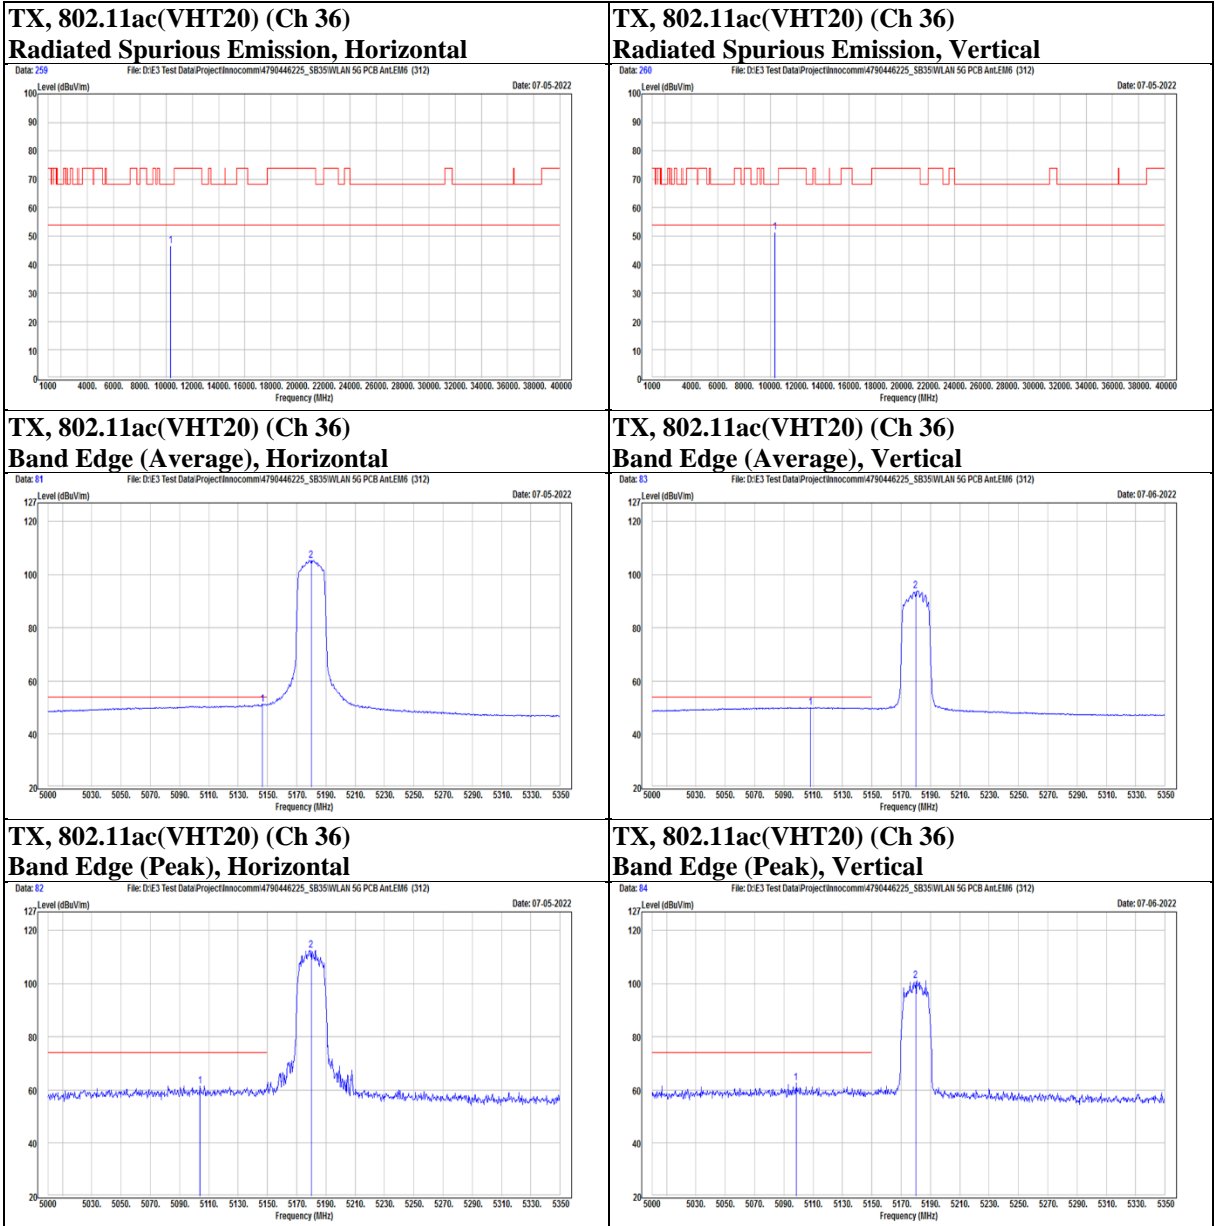



Test report No. : 4790446225-US-R1-V0
Page : 195 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5112.35	42	19.44	61.44	74	-12.56	PK
		5148.75	31.61	19.4	51.01	54	-2.99	AVG
	@	5220	96.83	19.12	115.95	N/A	N/A	PK
	@	5220	89.16	19.12	108.28	N/A	N/A	AVG
	*	10440	30.26	17.81	48.07	68.2	-20.13	PK
Vertical		5086.45	41.79	19.35	61.14	74	-12.86	PK
		5099.4	30.76	19.44	50.2	54	-3.8	AVG
	@	5220	85.05	19.12	104.17	N/A	N/A	PK
	@	5220	76.67	19.12	95.79	N/A	N/A	AVG
	*	10440	37.49	17.81	55.3	68.2	-12.9	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

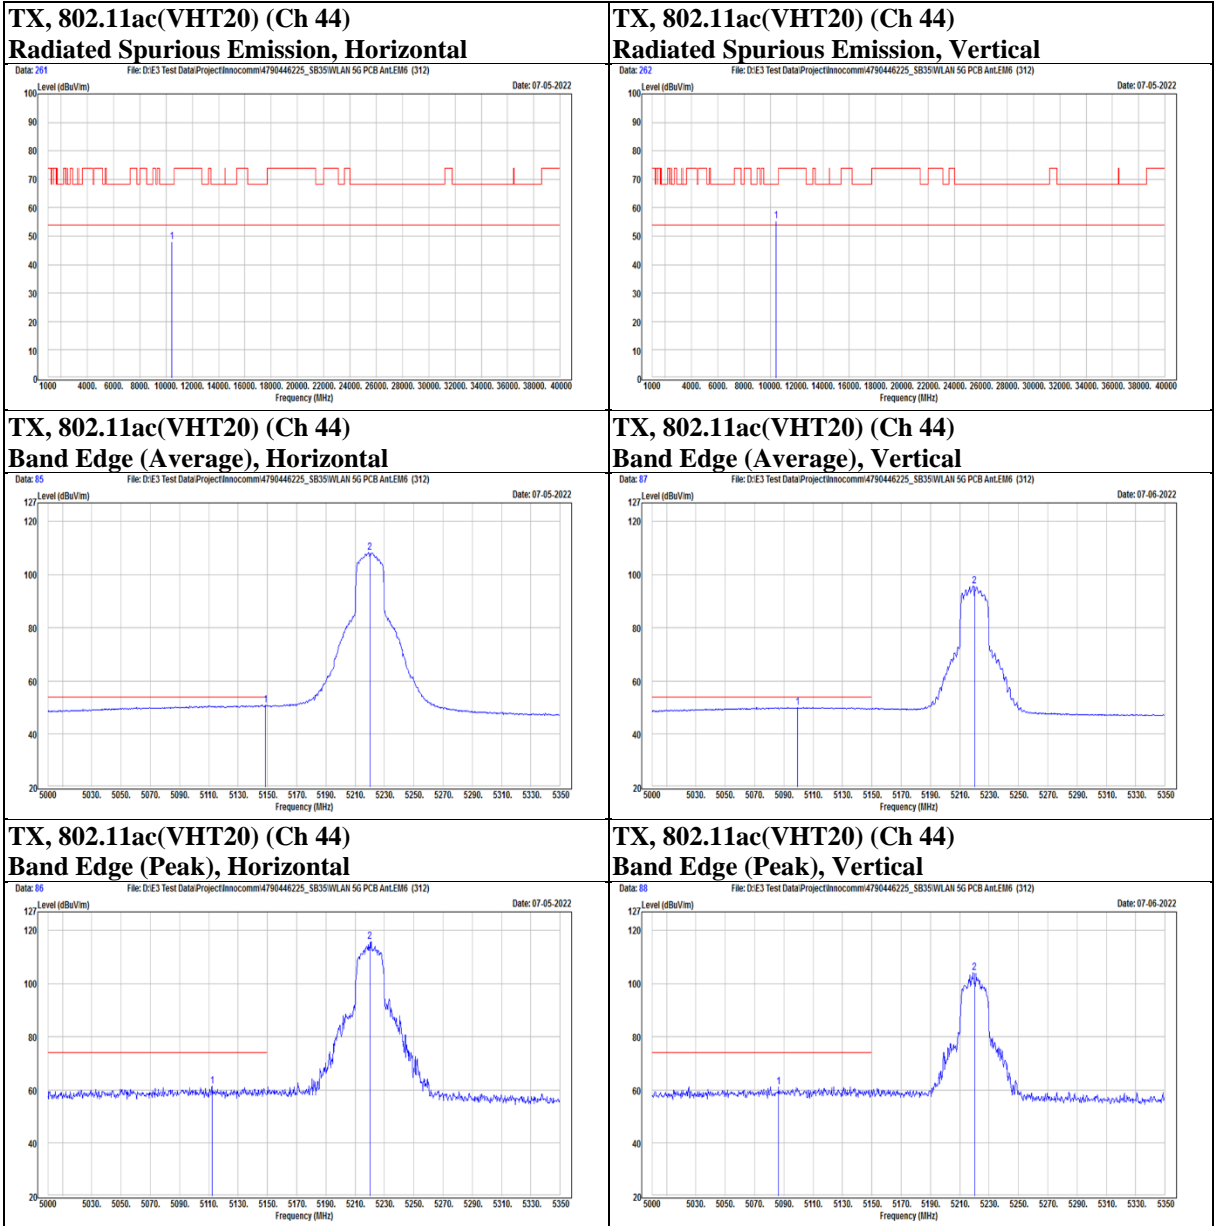



Test report No. : 4790446225-US-R1-V0
Page : 197 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5127.75	31.03	19.41	50.44	54	-3.56	AVG
		5139.3	41.81	19.41	61.22	74	-12.78	PK
	@	5240	96.5	18.97	115.47	N/A	N/A	PK
	@	5240	89.49	18.97	108.46	N/A	N/A	AVG
	*	10480	31.15	17.92	49.07	68.2	-19.13	PK
Vertical		5081.55	30.81	19.32	50.13	54	-3.87	AVG
		5127.4	42.98	19.42	62.4	74	-11.6	PK
	@	5240	82.83	18.97	101.8	N/A	N/A	PK
	@	5240	76.86	18.97	95.83	N/A	N/A	AVG
	*	10480	39.1	17.92	57.02	68.2	-11.18	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

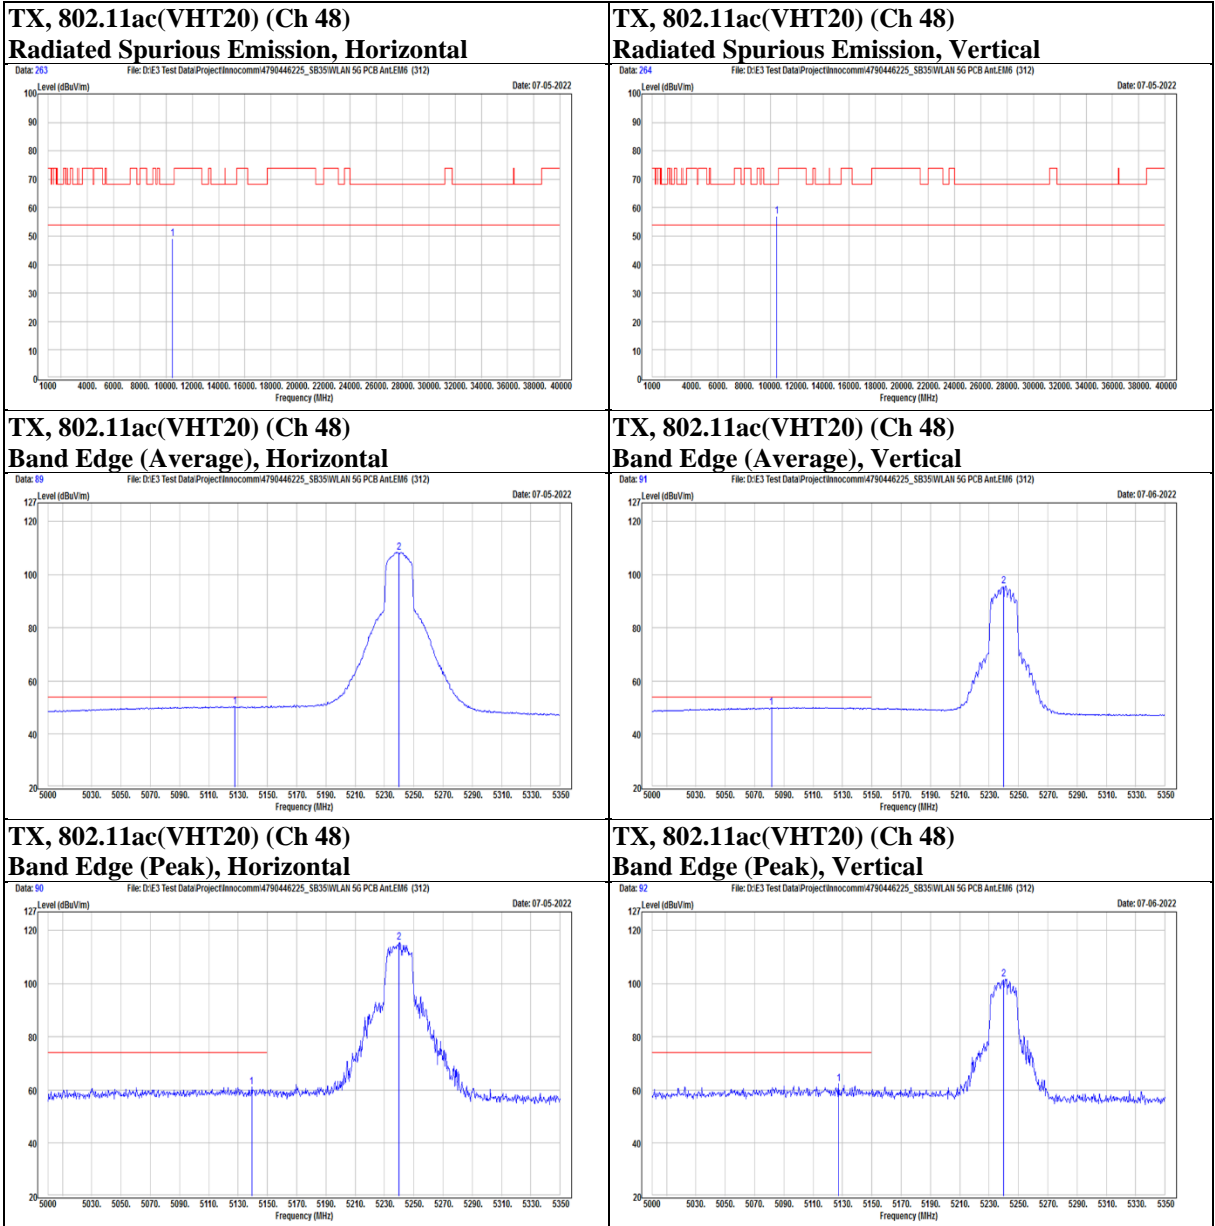



Test report No. : 4790446225-US-R1-V0
Page : 199 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	95.68	18.88	114.56	N/A	N/A	PK
	@	5260	89.1	18.88	107.98	N/A	N/A	AVG
		5442.9	39.83	19.49	59.32	74	-14.68	PK
		5459.4	28.51	19.57	48.08	54	-5.92	AVG
	*	10520	32.1	17.99	50.09	68.2	-18.11	PK
Vertical	@	5260	82.92	18.88	101.8	N/A	N/A	PK
	@	5260	75.62	18.88	94.5	N/A	N/A	AVG
		5394	40.16	19.24	59.4	74	-14.6	PK
		5453.4	28.67	19.53	48.2	54	-5.8	AVG
	*	10520	39.15	17.99	57.14	68.2	-11.06	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

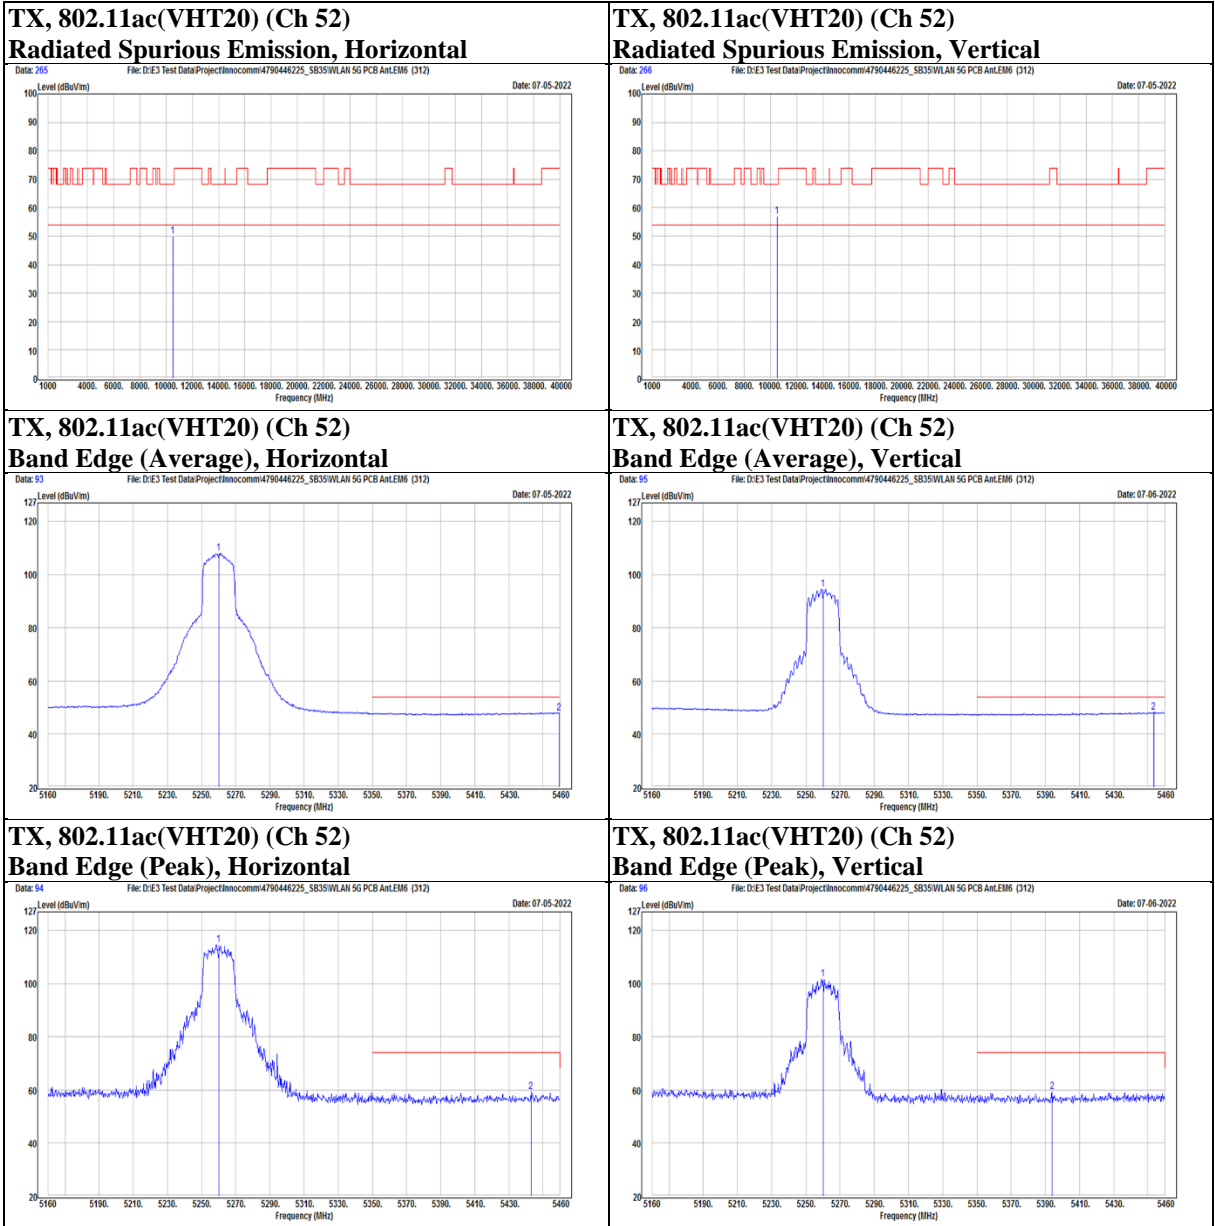



Test report No. : 4790446225-US-R1-V0

Page : 201 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	96.09	18.77	114.86	N/A	N/A	PK
	@	5300	86.66	18.77	105.43	N/A	N/A	AVG
		5359.8	29.17	19.07	48.24	54	-5.76	AVG
		5427	39.34	19.4	58.74	74	-15.26	PK
	*	10600	29.95	18.04	47.99	68.2	-20.21	PK
Vertical	@	5300	82.52	18.77	101.29	N/A	N/A	PK
	@	5300	74.28	18.77	93.05	N/A	N/A	AVG
		5441.1	39.57	19.47	59.04	74	-14.96	PK
		5453.1	28.63	19.53	48.16	54	-5.84	AVG
	*	10600	36.66	18.04	54.7	68.2	-13.5	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

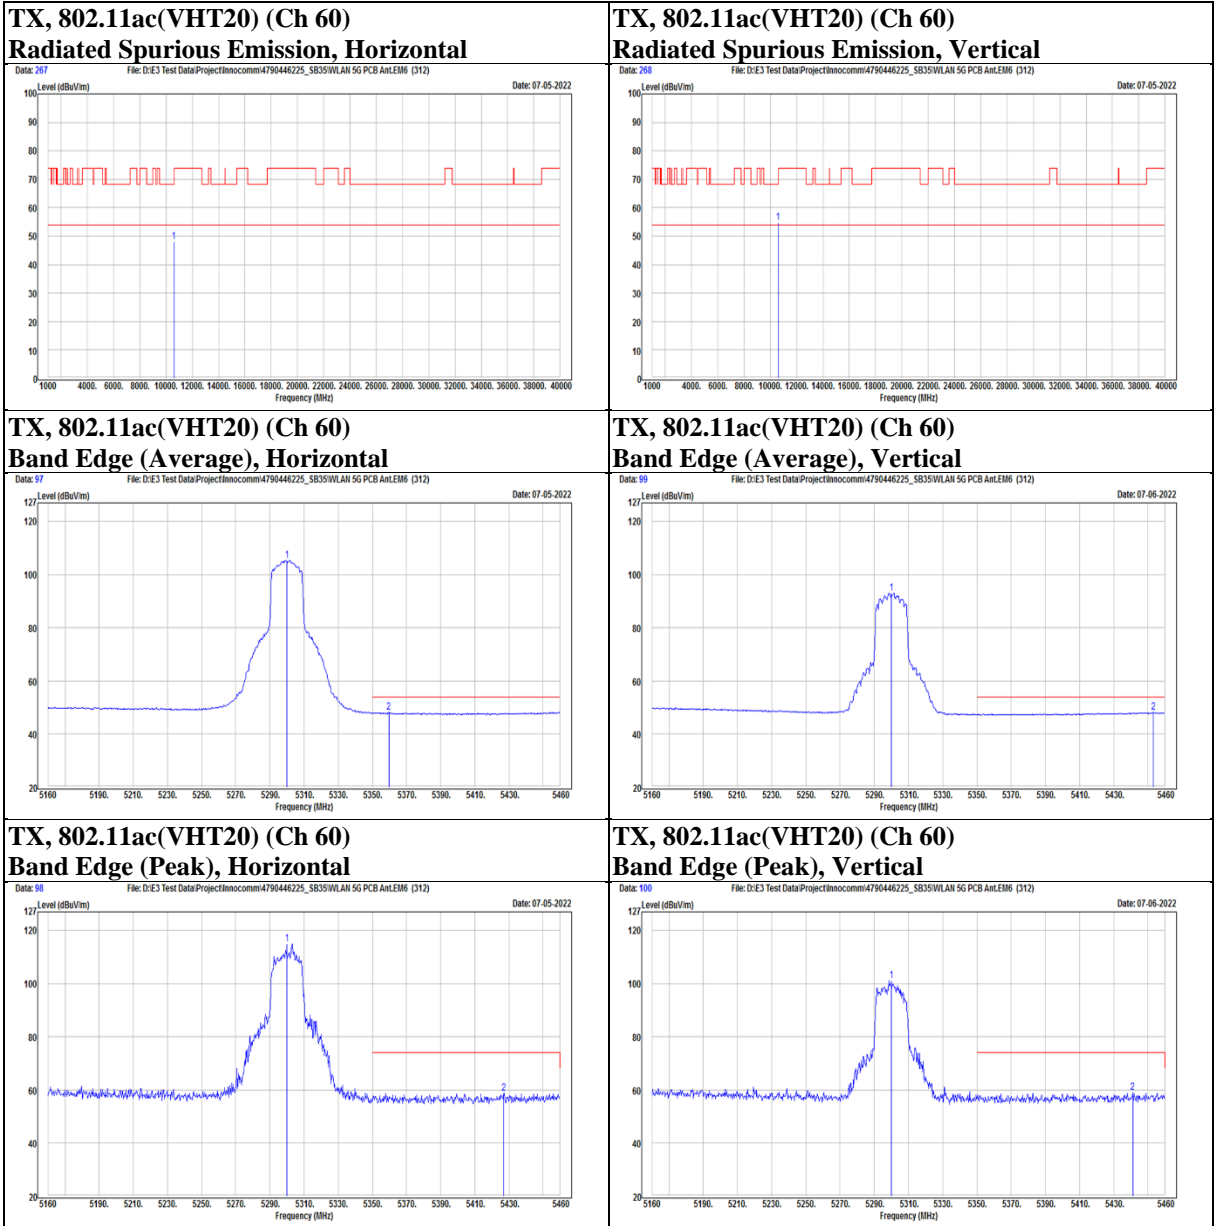



Test report No. : 4790446225-US-R1-V0
Page : 203 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	94.25	18.86	113.11	N/A	N/A	PK
	@	5320	86.29	18.86	105.15	N/A	N/A	AVG
		5350.5	31.44	19.01	50.45	54	-3.55	AVG
		5353.2	43.28	19.03	62.31	74	-11.69	PK
	*	10640	31.18	18.03	49.21	74	-24.79	PK
Vertical	@	5320	81.09	18.86	99.95	N/A	N/A	PK
	@	5320	75.55	18.86	94.41	N/A	N/A	AVG
		5372.1	40.52	19.13	59.65	74	-14.35	PK
		5456.1	28.68	19.54	48.22	54	-5.78	AVG
		10640	40.54	18.03	58.57	74	-15.43	PK
		10640	35.91	18.03	53.94	54	-0.06	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

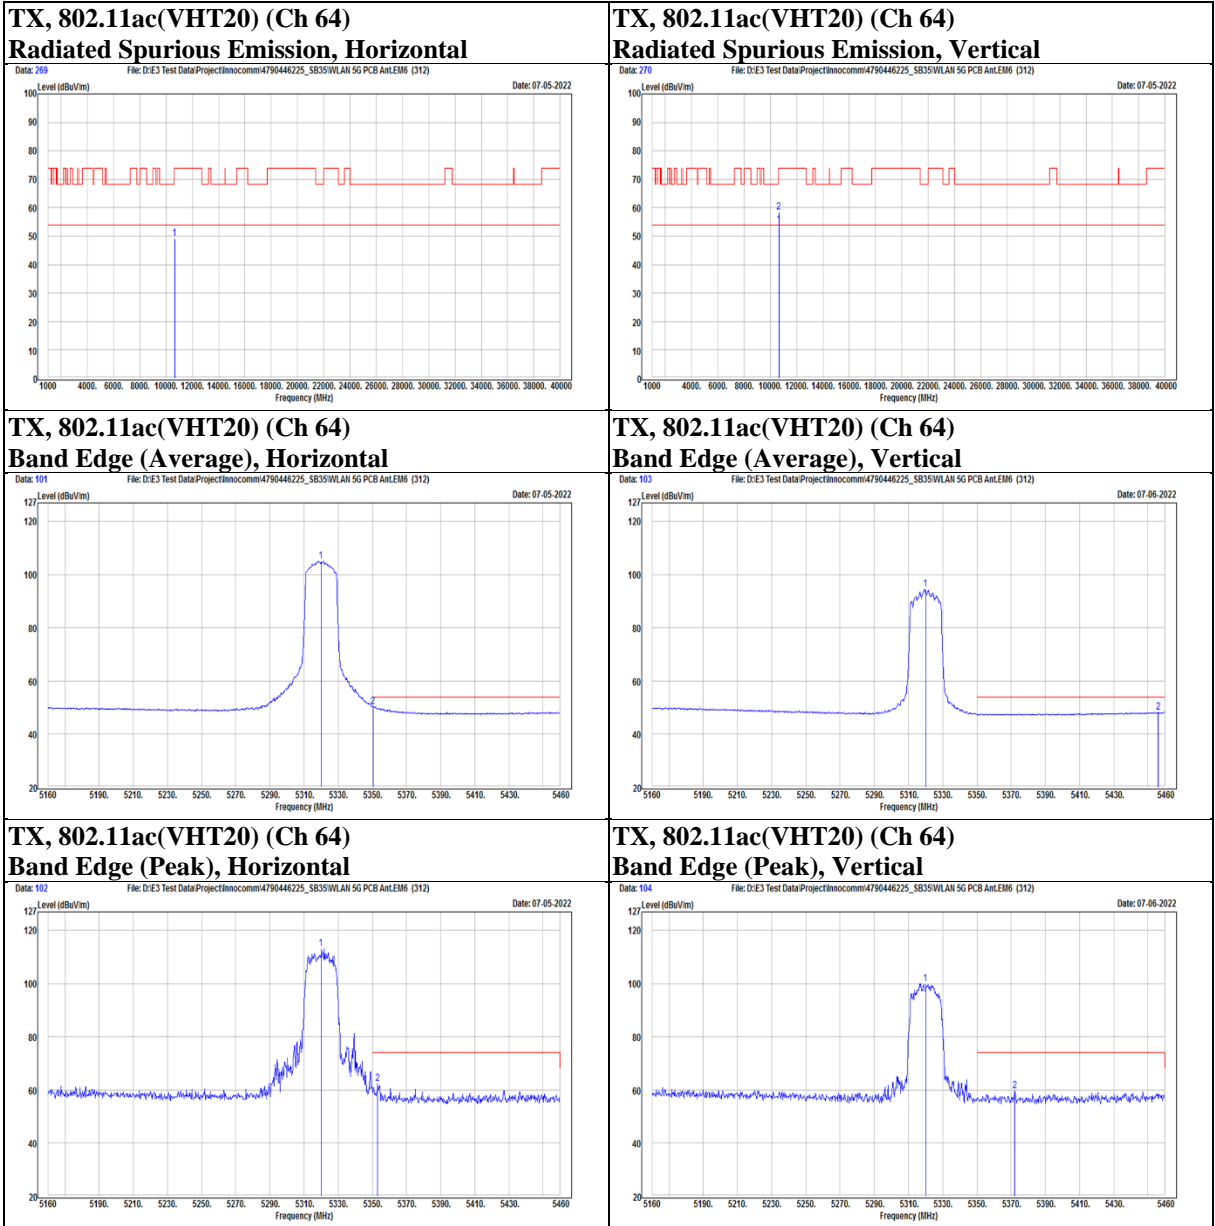



Test report No. : 4790446225-US-R1-V0
Page : 205 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5452.15	40.28	19.53	59.81	74	-14.19	PK
		5452.15	30	19.53	49.53	54	-4.47	AVG
		5470	44.06	19.62	63.68	68.2	-4.52	PK
	@	5500	93.52	19.77	113.29	N/A	N/A	PK
	@	5500	85.75	19.77	105.52	N/A	N/A	AVG
	*	11000	28.2	18.41	46.61	74	-27.39	PK
Vertical		5453.2	40.16	19.53	59.69	74	-14.31	PK
		5453.2	28.71	19.53	48.24	54	-5.76	AVG
		5465.1	38.84	19.59	58.43	68.2	-9.77	PK
	@	5500	85.54	19.77	105.31	N/A	N/A	PK
	@	5500	78.37	19.77	98.14	N/A	N/A	AVG
	*	11000	32.34	18.41	50.75	74	-23.25	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

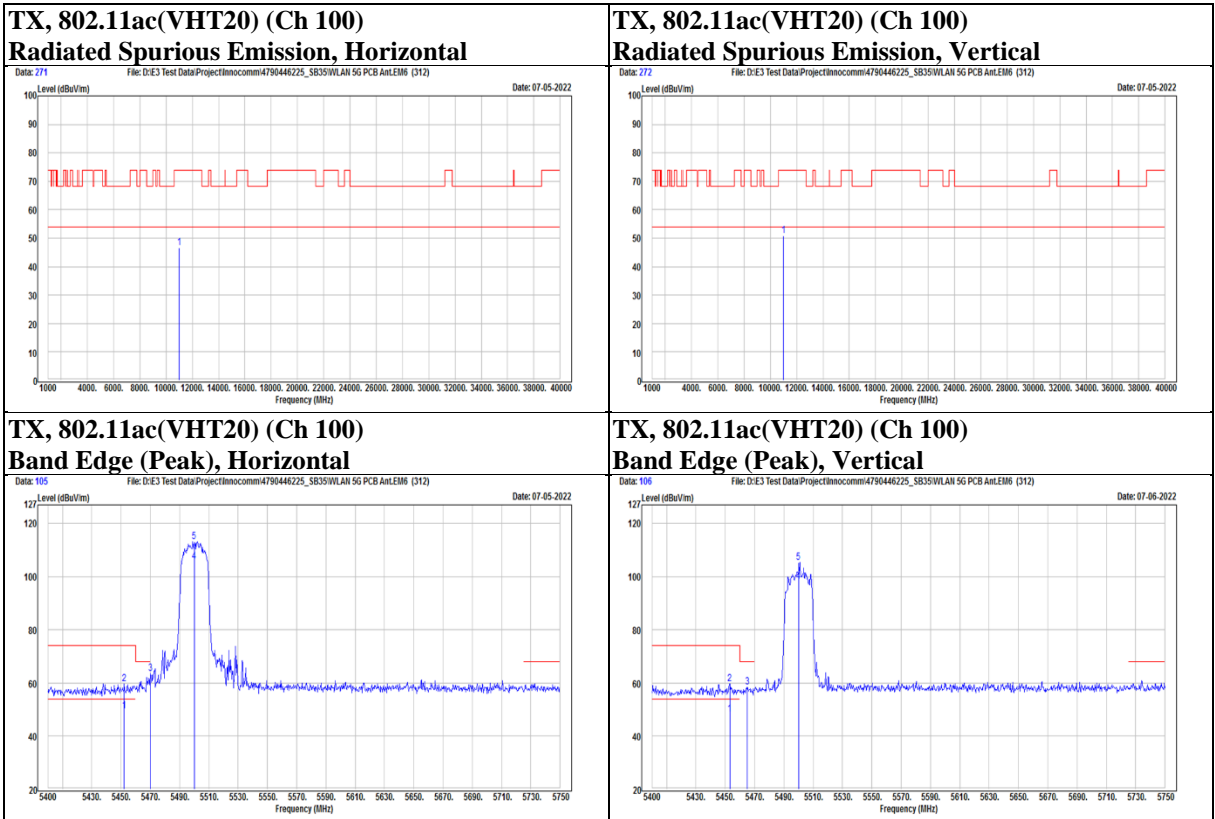



Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5419.25	40.36	19.36	59.72	74	-14.28	PK
		5419.25	29.09	19.36	48.45	54	-5.55	AVG
		5469.3	39.33	19.62	58.95	68.2	-9.25	PK
	@	5580	94.65	19.76	114.41	N/A	N/A	PK
	@	5580	85.67	19.76	105.43	N/A	N/A	AVG
		5737.75	39.74	20.08	59.82	68.2	-8.38	PK
	*	11160	31.96	18.47	50.43	74	-23.57	PK
Vertical		5431.5	40.63	19.43	60.06	74	-13.94	PK
		5431.5	28.8	19.43	48.23	54	-5.77	AVG
		5462.3	38.49	19.58	58.07	68.2	-10.13	PK
	@	5580	82.4	19.76	102.16	N/A	N/A	PK
	@	5580	77.07	19.76	96.83	N/A	N/A	AVG
		5736.35	40.83	20.07	60.9	68.2	-7.3	PK
		11160	36.6	18.47	55.07	74	-18.93	PK
		11160	32.4	18.47	50.87	54	-3.13	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

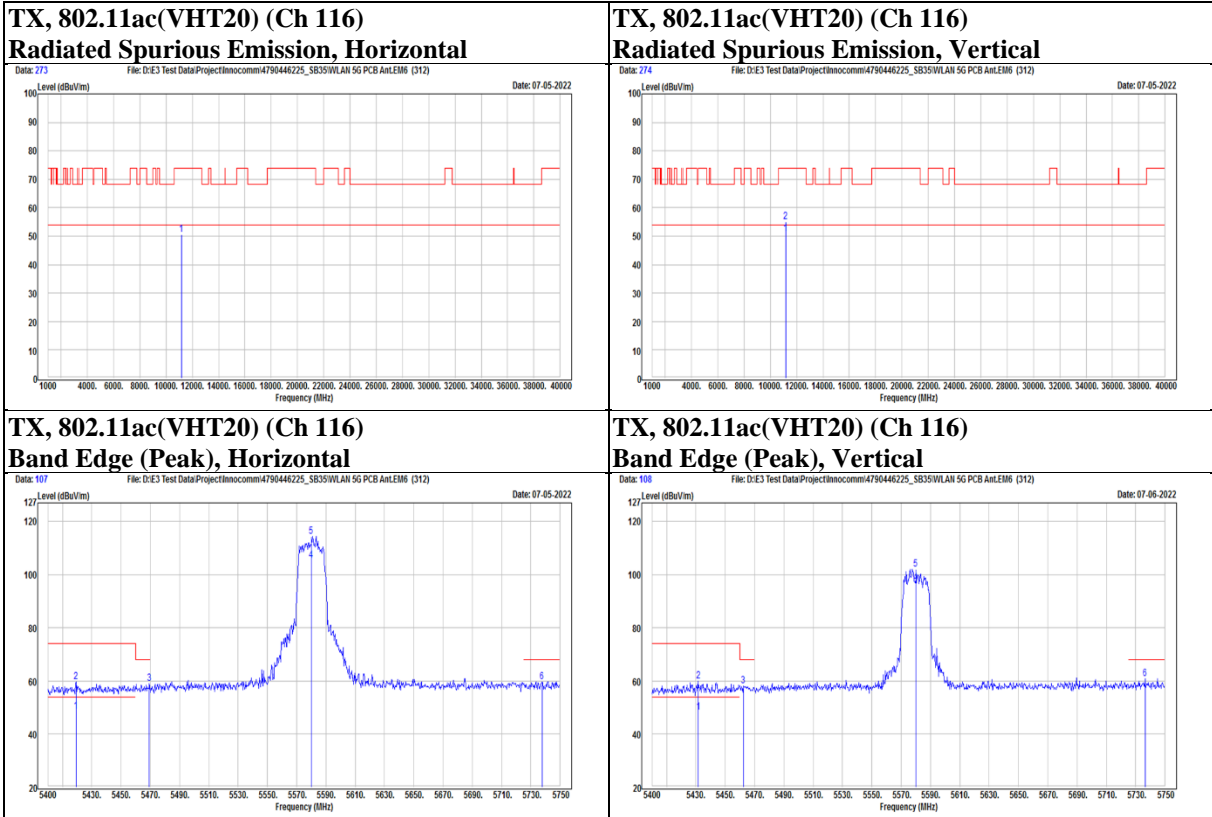



Test report No. : 4790446225-US-R1-V0

Page : 209 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	90.61	19.73	110.34	N/A	N/A	PK
	@	5700	81.16	19.73	100.89	N/A	N/A	AVG
		5725.15	40.85	19.96	60.81	68.2	-7.39	PK
	*	11400	29.26	18.85	48.11	74	-25.89	PK
Vertical	@	5700	81.39	19.73	101.12	N/A	N/A	PK
	@	5700	74.69	19.73	94.42	N/A	N/A	AVG
		5734.95	41.35	20.06	61.41	68.2	-6.79	PK
		11400	35.58	18.85	54.43	74	-19.57	PK
		11400	31.17	18.85	50.02	54	-3.98	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

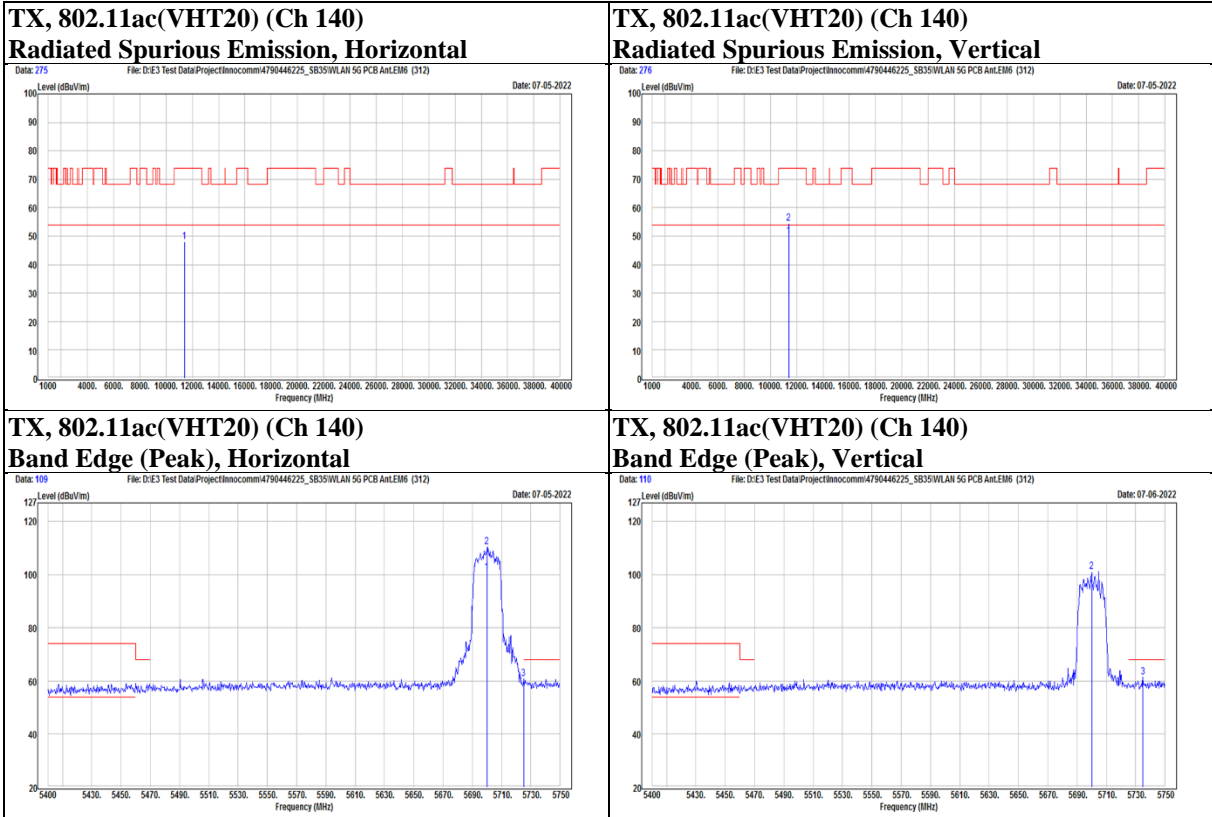



Test report No. : 4790446225-US-R1-V0

Page : 211 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5599.5	40.26	19.7	59.96	68.2	-8.24	PK
		5683	39.99	19.7	59.69	92.66	-32.97	PK
	@	5745	87.28	20.15	107.43	N/A	N/A	PK
	*	11490	28.92	19.33	48.25	74	-25.75	PK
Vertical		5607.5	41.07	19.7	60.77	68.2	-7.43	PK
		5687	41.02	19.71	60.73	95.61	-34.88	PK
	@	5745	79.34	20.15	99.49	N/A	N/A	PK
	*	11490	34.52	19.33	53.85	74	-20.15	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

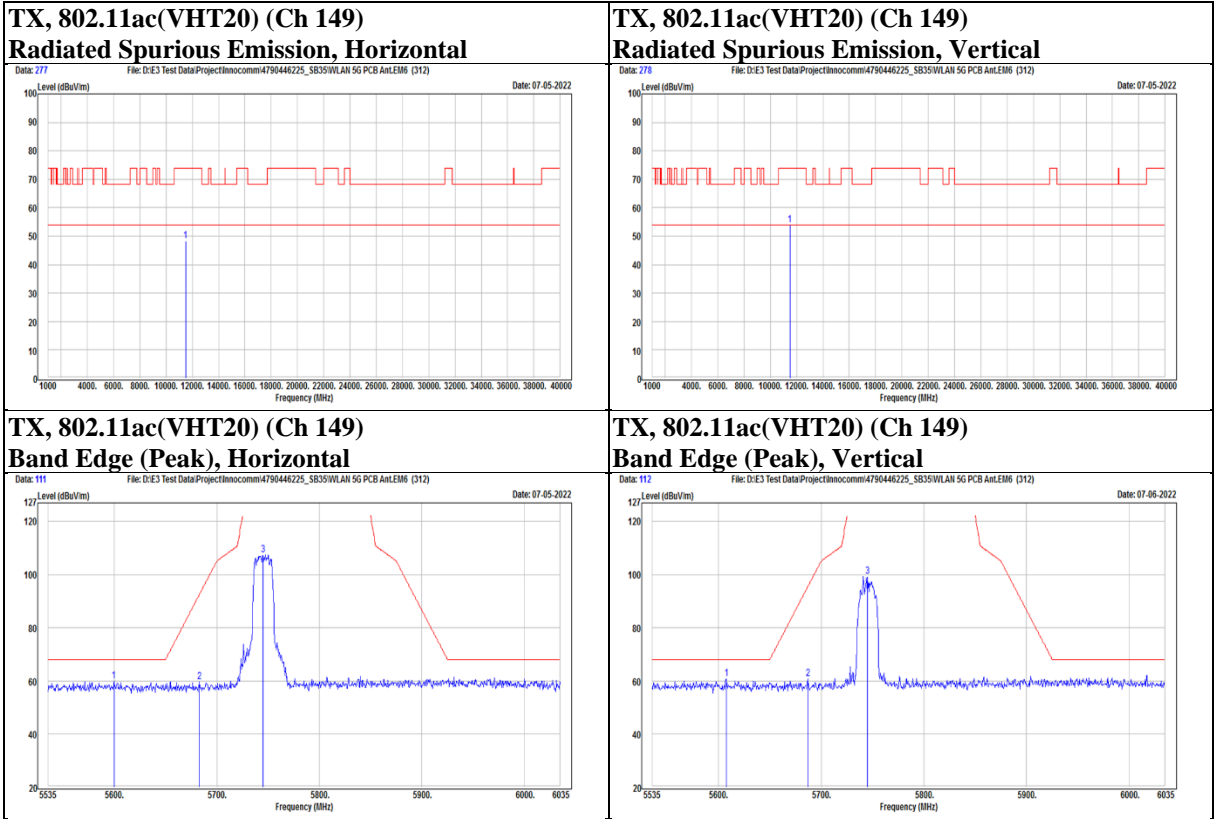



Test report No. : 4790446225-US-R1-V0
Page : 213 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5543	40.37	19.82	60.19	68.2	-8.01	PK
		5689.5	40.22	19.71	59.93	97.46	-37.53	PK
	@	5785	87.97	20.45	108.42	N/A	N/A	PK
		5902.5	41.42	20.97	62.39	84.81	-22.42	PK
		5977	39.89	20.97	60.86	68.2	-7.34	PK
	*	11570	27.14	19.07	46.21	74	-27.79	PK
Vertical		5576.5	41.27	19.76	61.03	68.2	-7.17	PK
		5683.5	40.5	19.7	60.2	93.03	-32.83	PK
	@	5785	79.67	20.45	100.12	N/A	N/A	PK
		5922.5	40.65	20.97	61.62	70.04	-8.42	PK
		5935.5	41.16	20.95	62.11	68.2	-6.09	PK
	*	11570	31.55	19.07	50.62	74	-23.38	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

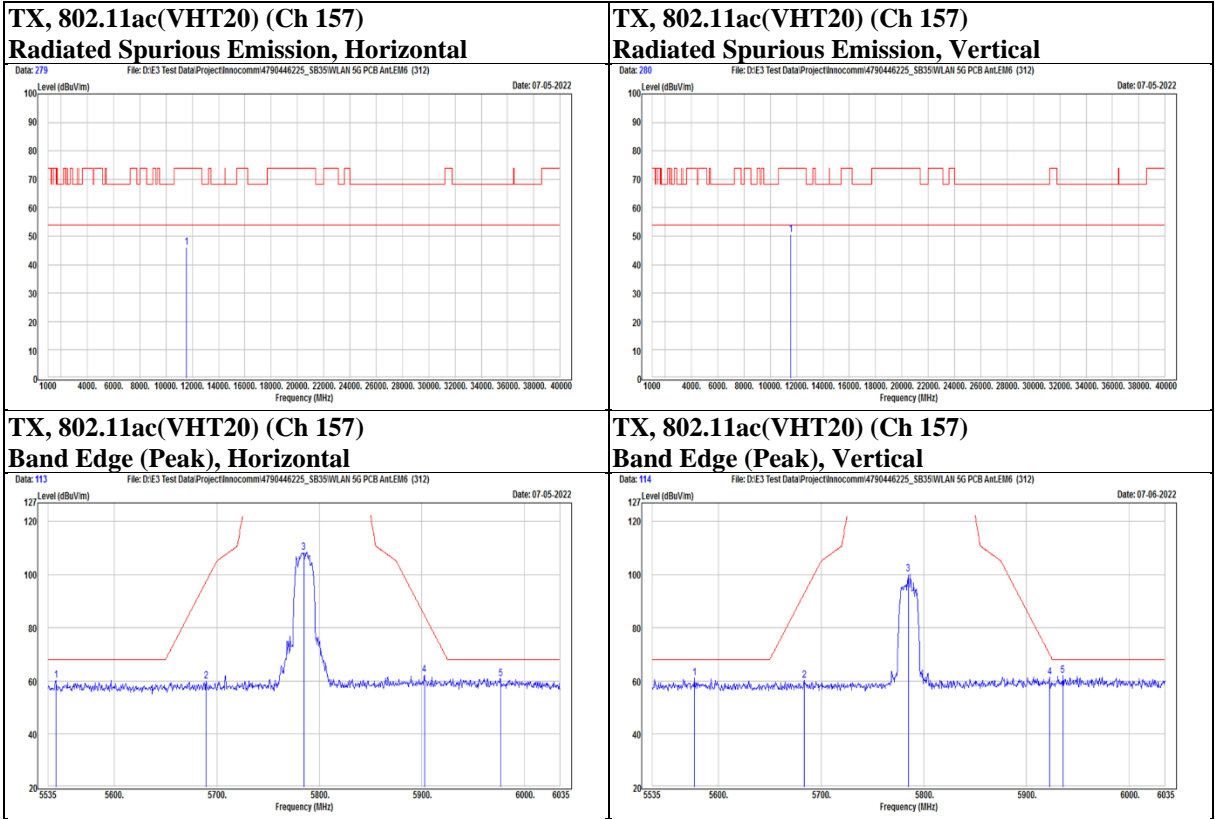



Test report No. : 4790446225-US-R1-V0
Page : 215 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	88.72	20.58	109.3	N/A	N/A	PK
		5922	40.79	20.96	61.75	70.41	-8.66	PK
		5972	40.35	20.96	61.31	68.2	-6.89	PK
	*	11650	26.87	18.83	45.7	74	-28.3	PK
Vertical	@	5825	78.88	20.58	99.46	N/A	N/A	PK
		5919	40.42	20.96	61.38	72.62	-11.24	PK
		6026	40.64	20.98	61.62	68.2	-6.58	PK
	*	11650	30.84	18.83	49.67	74	-24.33	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

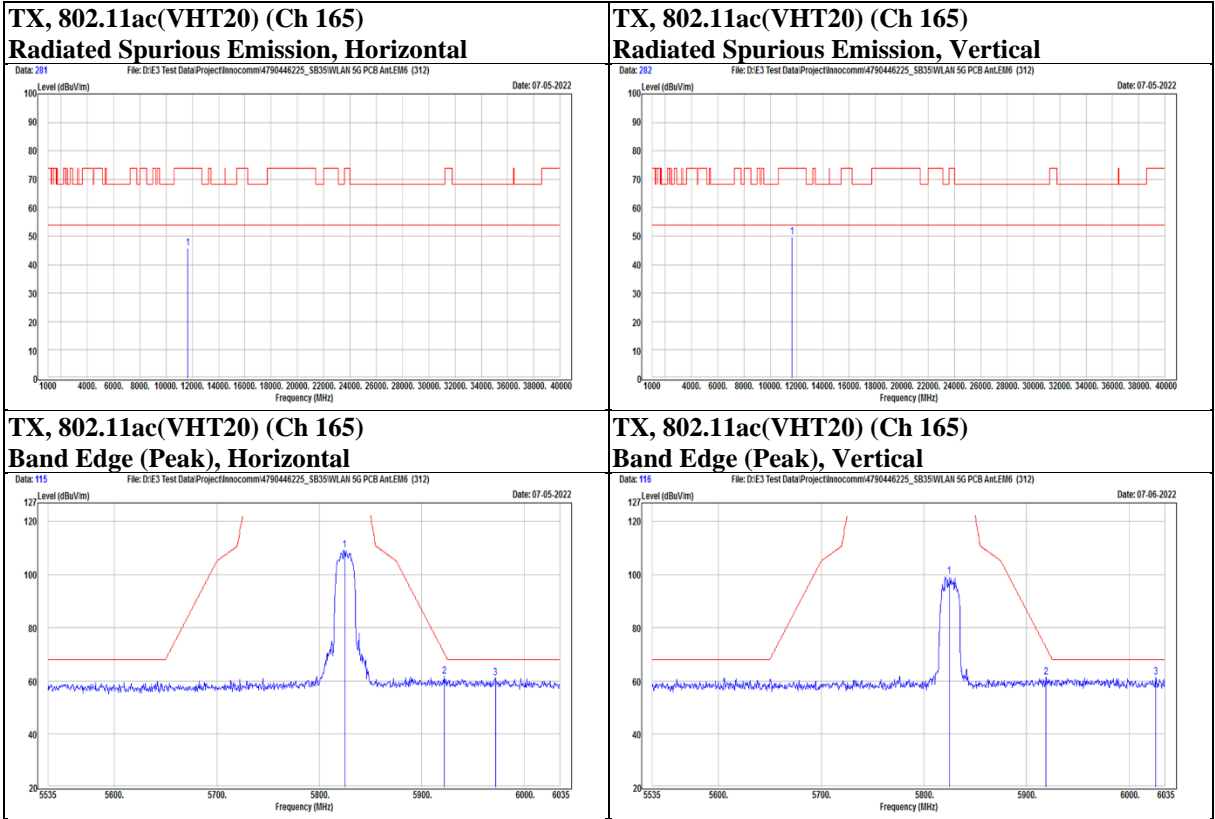

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790446225-US-R1-V0
Page : 217 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5132.3	42.46	19.42	61.88	74	-12.12	PK
		5149.45	32.86	19.4	52.26	54	-1.74	AVG
	@	5190	89.78	19.29	109.07	N/A	N/A	PK
	@	5190	82.05	19.29	101.34	N/A	N/A	AVG
Vertical	*	10380	27.6	17.61	45.21	68.2	-22.99	PK
		5053.55	42.36	19.12	61.48	74	-12.52	PK
		5120.05	31.17	19.43	50.6	54	-3.4	AVG
	@	5190	77.3	19.29	96.59	N/A	N/A	PK
	@	5190	71.45	19.29	90.74	N/A	N/A	AVG
	*	10380	28.52	17.61	46.13	68.2	-22.07	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT40) (Ch 38)
Radiated Spurious Emission, Horizontal

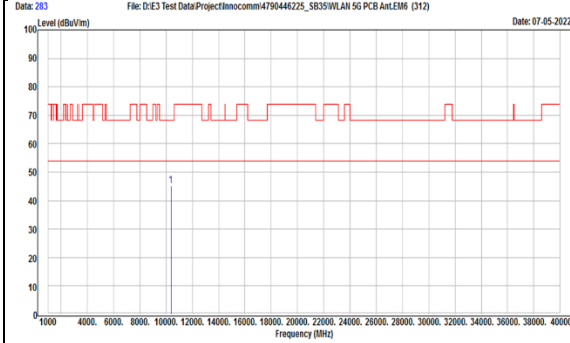


TX, 802.11ac(VHT40) (Ch 38)
Radiated Spurious Emission, Vertical

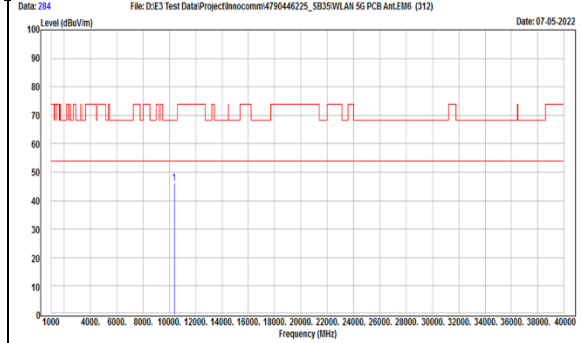


TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Average), Horizontal

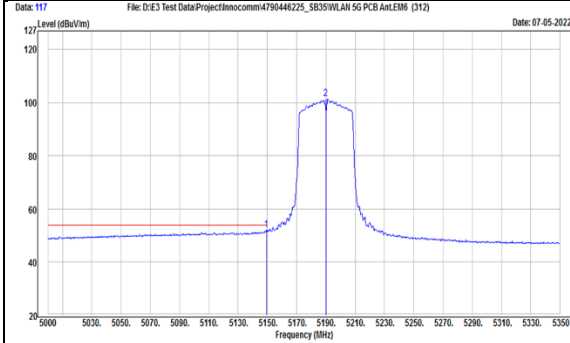


TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Average), Vertical

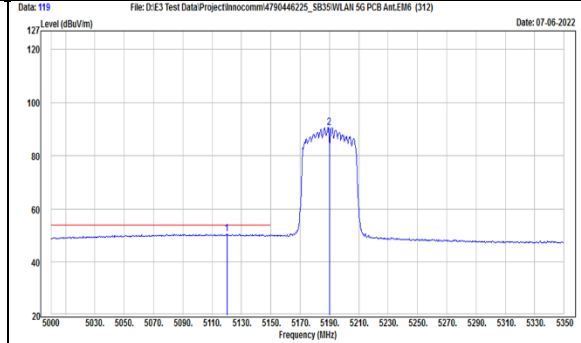

TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Peak), Horizontal

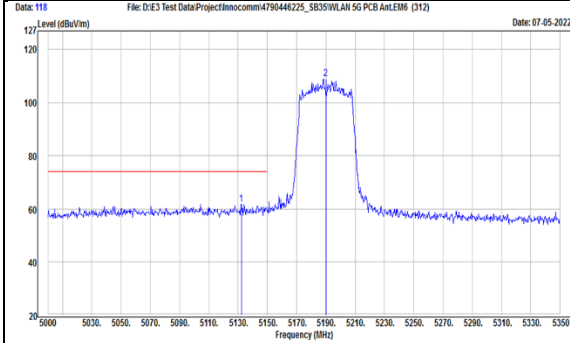

TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Peak), Vertical

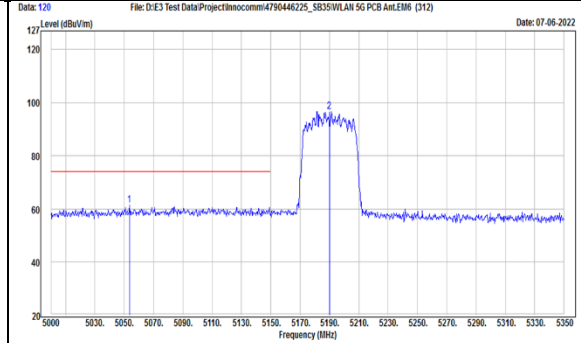



Test report No. : 4790446225-US-R1-V0
Page : 219 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5147	43.1	19.41	62.51	74	-11.49	PK
		5147.35	32.22	19.41	51.63	54	-2.37	AVG
		5228.9	94.64	19.06	113.7	N/A	N/A	PK
		5228.9	86	19.06	105.06	N/A	N/A	AVG
	*	10460	30.25	17.87	48.12	68.2	-20.08	PK
Vertical		5028.35	42.57	18.89	61.46	74	-12.54	PK
		5133	31.17	19.41	50.58	54	-3.42	AVG
	@	5230	81.07	19.05	100.12	N/A	N/A	PK
	@	5230	73.42	19.05	92.47	N/A	N/A	AVG
	*	10460	33.59	17.87	51.46	68.2	-16.74	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0