






TX, 802.11ac(VHT40) (Ch 46)
Radiated Spurious Emission, Horizontal

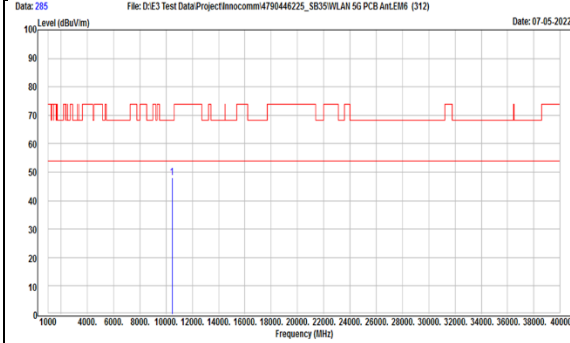


TX, 802.11ac(VHT40) (Ch 46)
Radiated Spurious Emission, Vertical

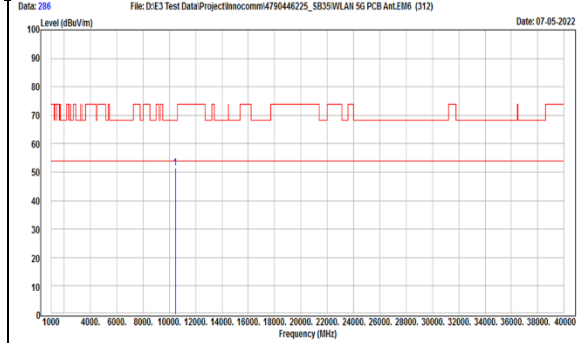


TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Average), Horizontal

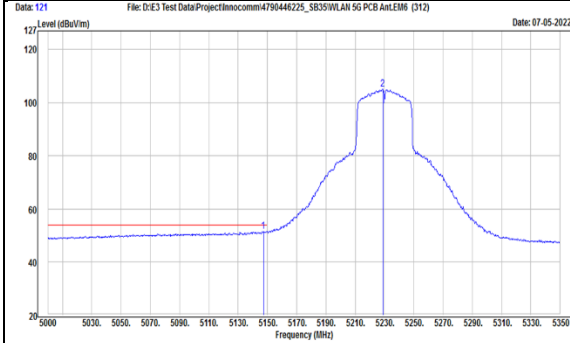


TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Average), Vertical

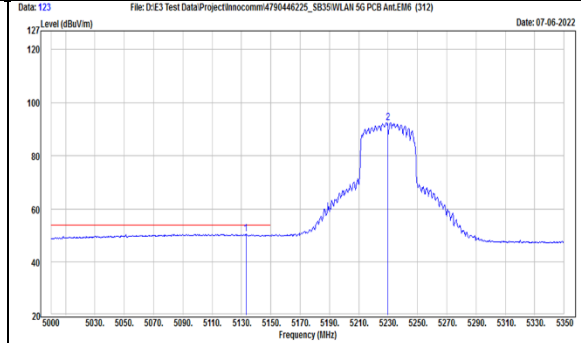

TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Peak), Horizontal

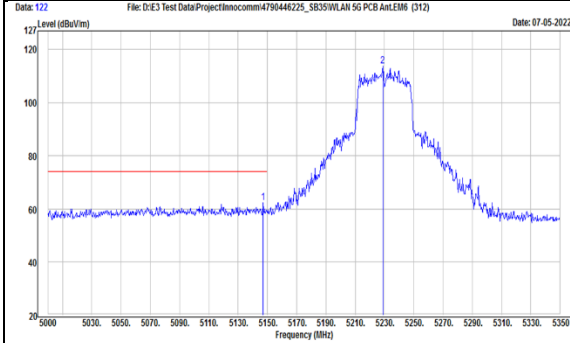

TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Peak), Vertical

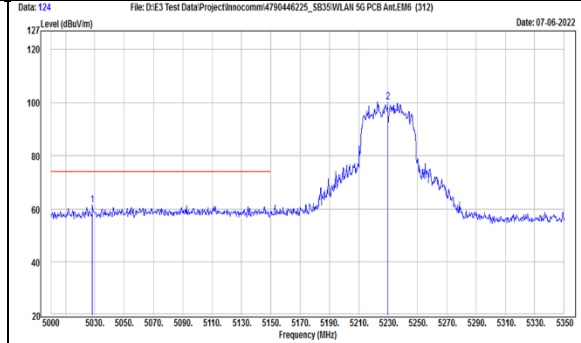



Test report No. : 4790446225-US-R1-V0
Page : 221 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	94.01	18.85	112.86	N/A	N/A	PK
	@	5270	87.33	18.85	106.18	N/A	N/A	AVG
		5351.1	42.2	19.01	61.21	74	-12.79	PK
		5351.1	32.83	19.01	51.84	54	-2.16	AVG
	*	10540	29.81	18.01	47.82	68.2	-20.38	PK
Vertical	@	5270	81.56	18.85	100.41	N/A	N/A	PK
	@	5270	75.79	18.85	94.64	N/A	N/A	AVG
		5372.7	40.86	19.13	59.99	74	-14.01	PK
		5459.7	29.04	19.57	48.61	54	-5.39	AVG
	*	10540	38.16	18.01	56.17	68.2	-12.03	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

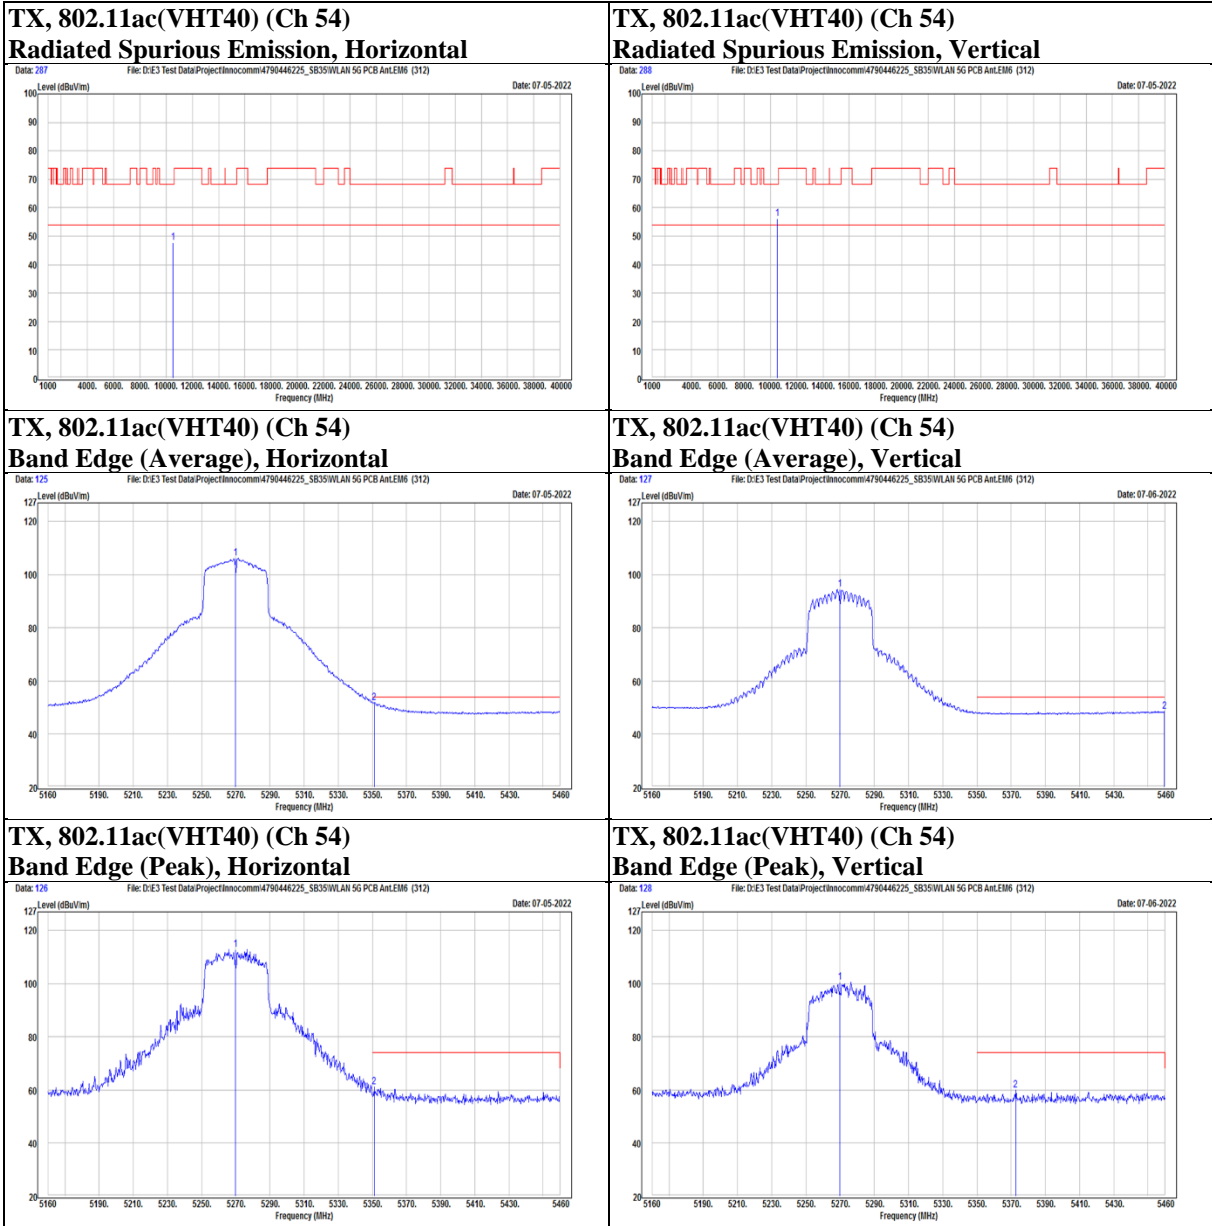



Test report No. : 4790446225-US-R1-V0

Page : 223 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	62
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	89.85	18.81	108.66	N/A	N/A	PK
	@	5310	82.92	18.81	101.73	N/A	N/A	AVG
		5350.2	32.55	19.01	51.56	54	-2.44	AVG
		5351.1	46.34	19.01	65.35	74	-8.65	PK
	*	10620	27.86	18.04	45.9	74	-28.1	PK
Vertical	@	5310	80.12	18.81	98.93	N/A	N/A	PK
	@	5310	72.06	18.81	90.87	N/A	N/A	AVG
		5419.2	39.59	19.36	58.95	74	-15.05	PK
		5457.6	29.02	19.55	48.57	54	-5.43	AVG
	*	10620	32.32	18.04	50.36	74	-23.64	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

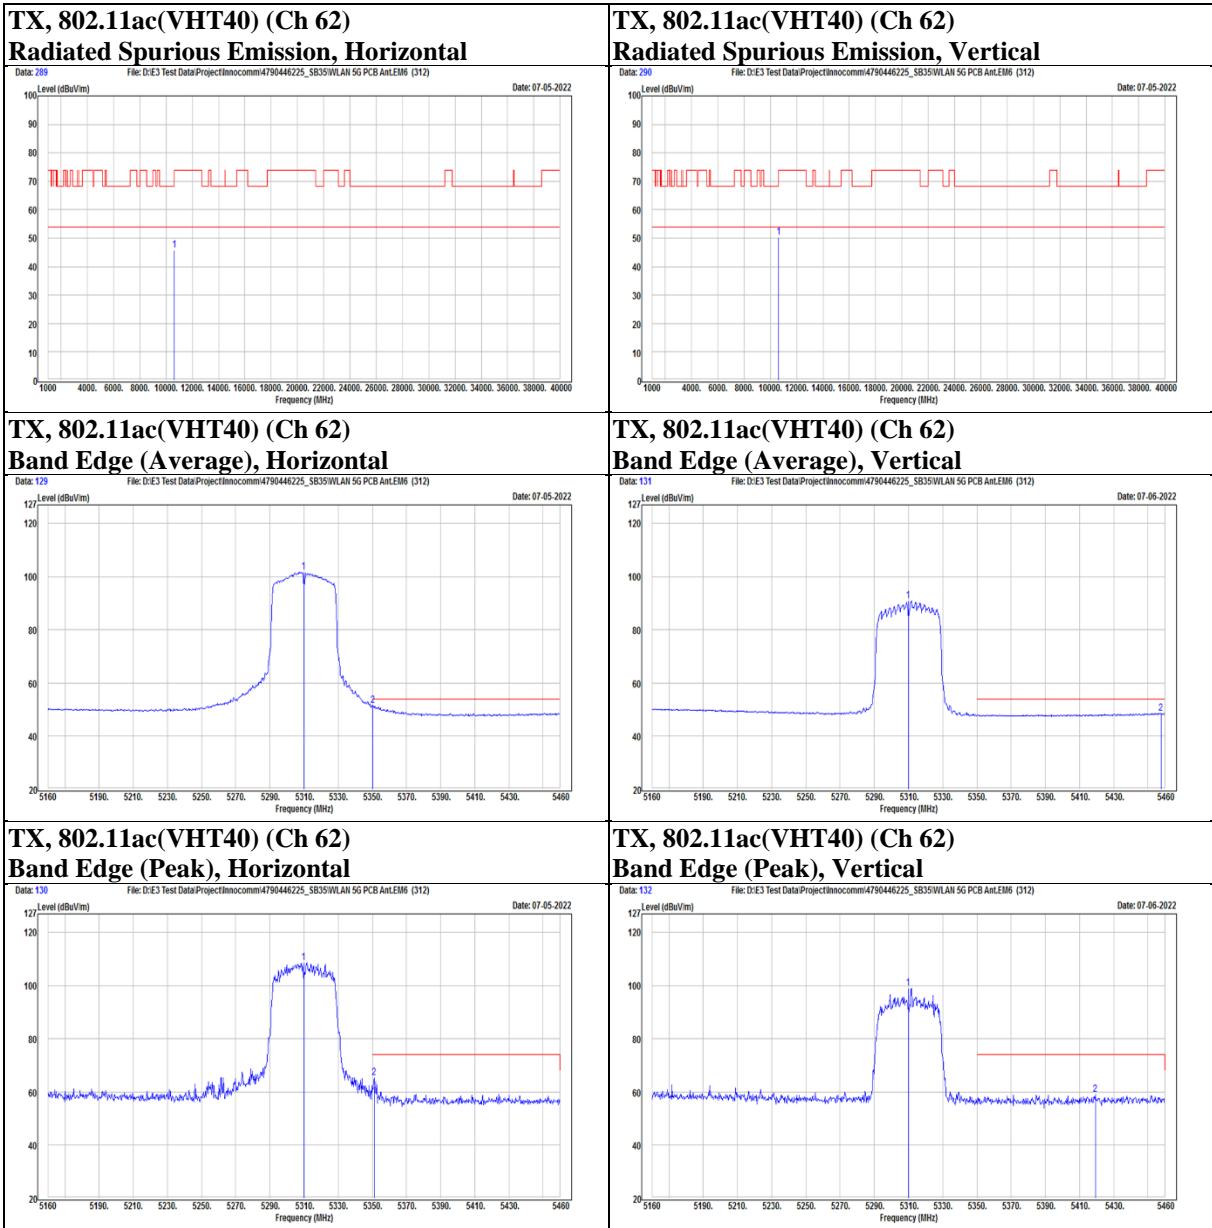



Test report No. : 4790446225-US-R1-V0
Page : 225 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5458.1	41.09	19.56	60.65	74	-13.35	PK
		5458.1	30.56	19.56	50.12	54	-3.88	AVG
		5467.2	43.07	19.61	62.68	68.2	-5.52	PK
	@	5510	90.62	19.78	110.4	N/A	N/A	PK
	@	5510	81.6	19.78	101.38	N/A	N/A	AVG
	*	11020	27.26	18.42	45.68	74	-28.32	PK
Vertical		5416.1	39.82	19.34	59.16	74	-14.84	PK
		5416.1	29.31	19.34	48.65	54	-5.35	AVG
		5467.9	40.87	19.61	60.48	68.2	-7.72	PK
	@	5510	81.14	19.78	100.92	N/A	N/A	PK
	@	5510	74.07	19.78	93.85	N/A	N/A	AVG
	*	11020	29.77	18.42	48.19	74	-25.81	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

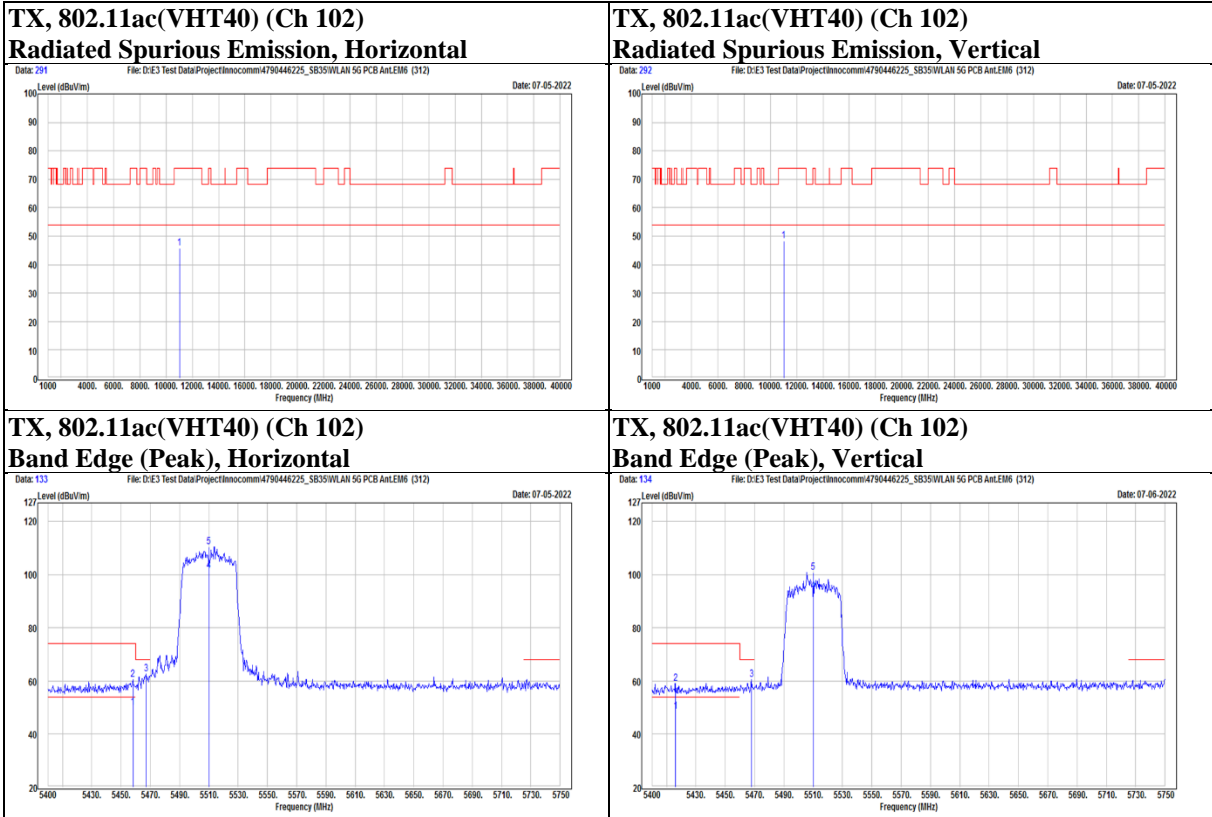



Test report No. : 4790446225-US-R1-V0
Page : 227 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	110
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5451.1	39.99	19.52	59.51	74	-14.49	PK
		5451.1	29.35	19.52	48.87	54	-5.13	AVG
		5462.3	40.13	19.58	59.71	68.2	-8.49	PK
	@	5550	91.88	19.83	111.71	N/A	N/A	PK
	@	5550	84.03	19.83	103.86	N/A	N/A	AVG
		5730.05	40.22	20.01	60.23	68.2	-7.97	PK
	*	11100	29.52	18.45	47.97	74	-26.03	PK
Vertical		5448.3	40.72	19.5	60.22	74	-13.78	PK
		5448.3	29.08	19.5	48.58	54	-5.42	AVG
		5466.15	38.68	19.6	58.28	68.2	-9.92	PK
	@	5550	82.67	19.83	102.5	N/A	N/A	PK
	@	5550	75.93	19.83	95.76	N/A	N/A	AVG
		5737.75	40.35	20.08	60.43	68.2	-7.77	PK
	*	11100	32.04	18.45	50.49	74	-23.51	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

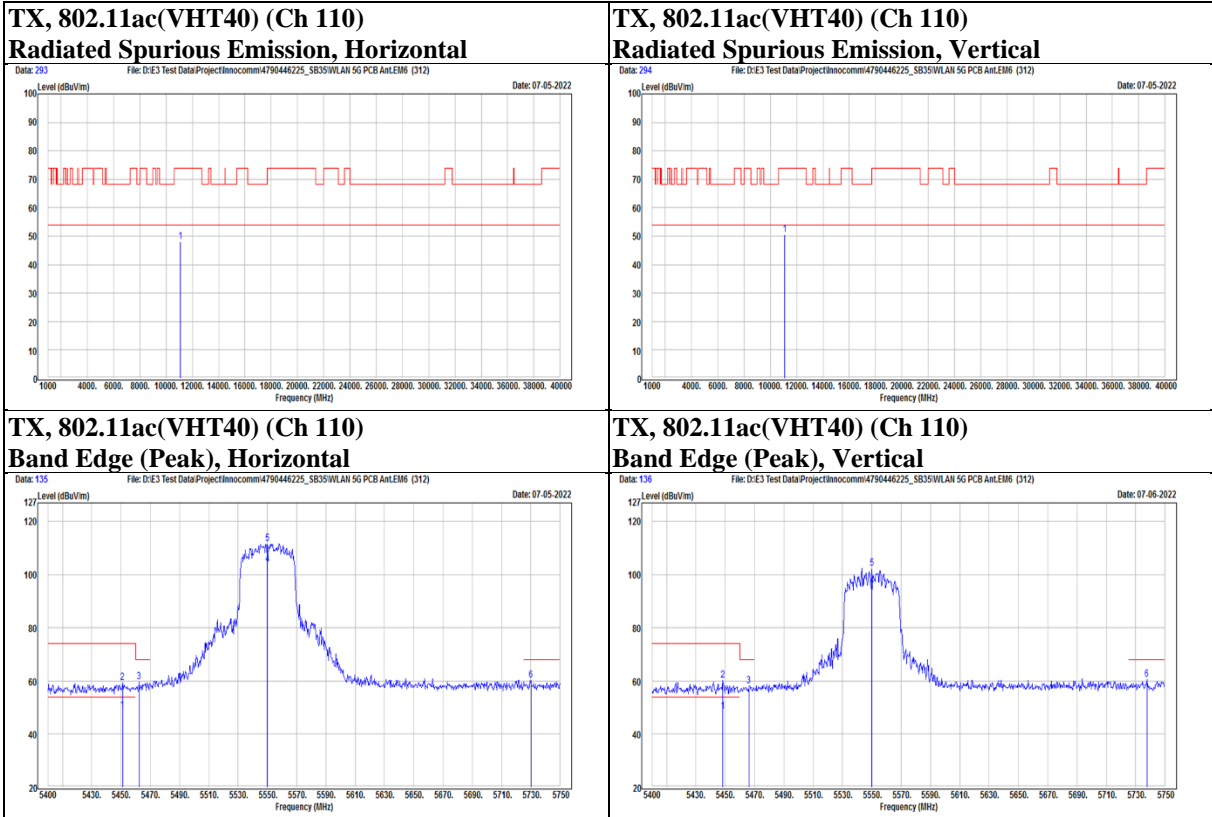



Test report No. : 4790446225-US-R1-V0
Page : 229 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	134
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5670	91.9	19.69	111.59	N/A	N/A	PK
	@	5670	83.74	19.69	103.43	N/A	N/A	AVG
		5725	46.6	19.96	66.56	68.2	-1.64	PK
	*	11340	30.97	18.58	49.55	74	-24.45	PK
Vertical	@	5670	81.99	19.69	101.68	N/A	N/A	PK
	@	5670	76.98	19.69	96.67	N/A	N/A	AVG
		5725	41.06	19.96	61.02	68.2	-7.18	PK
		11340	38.85	18.58	57.43	74	-16.57	PK
		11340	34.62	18.58	53.2	54	-0.8	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

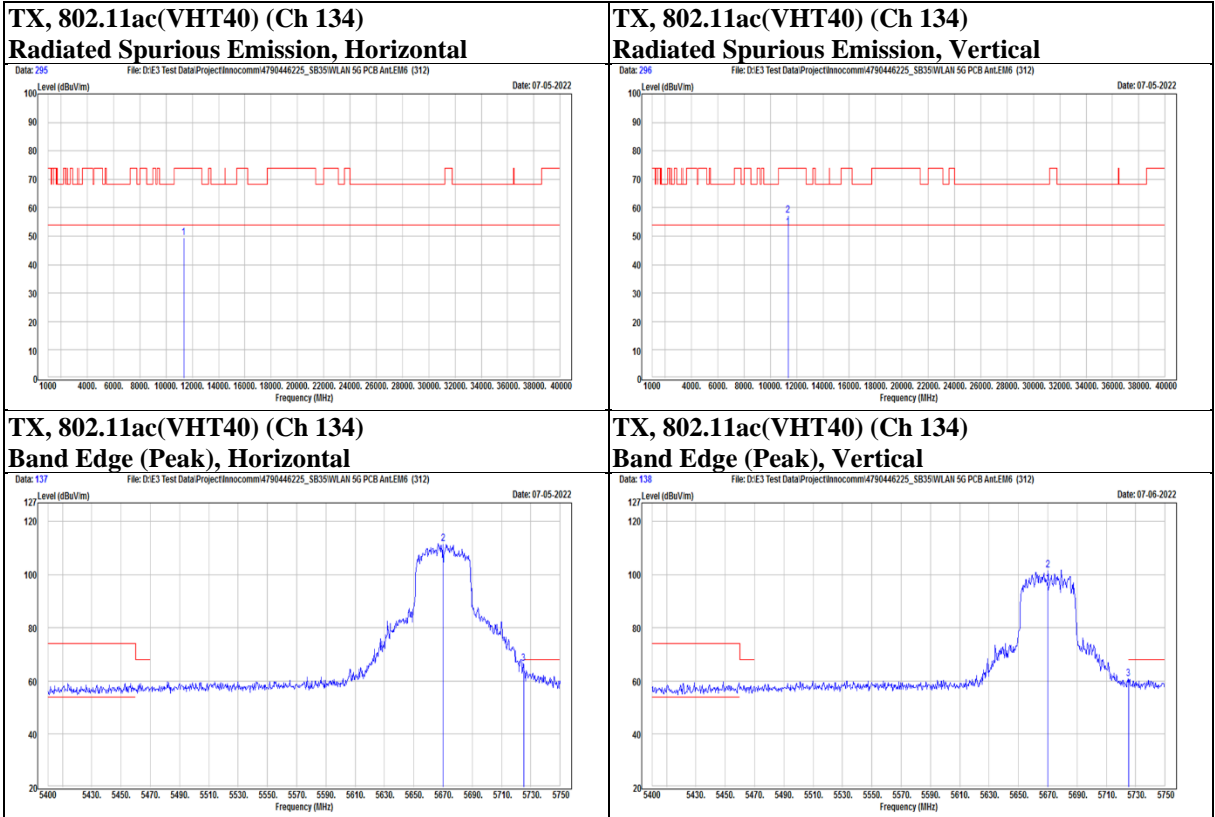



Test report No. : 4790446225-US-R1-V0

Page : 231 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	151
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5629.5	39.94	19.68	59.62	68.2	-8.58	PK
		5663	40.23	19.68	59.91	77.85	-17.94	PK
	@	5755	87.91	20.22	108.13	N/A	N/A	PK
	*	11510	28.06	19.34	47.4	74	-26.6	PK
Vertical		5584.5	40.39	19.74	60.13	68.2	-8.07	PK
		5654.5	40.53	19.67	60.2	71.54	-11.34	PK
	@	5755	75.9	20.22	96.12	N/A	N/A	PK
	*	11510	32.81	19.34	52.15	74	-21.85	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

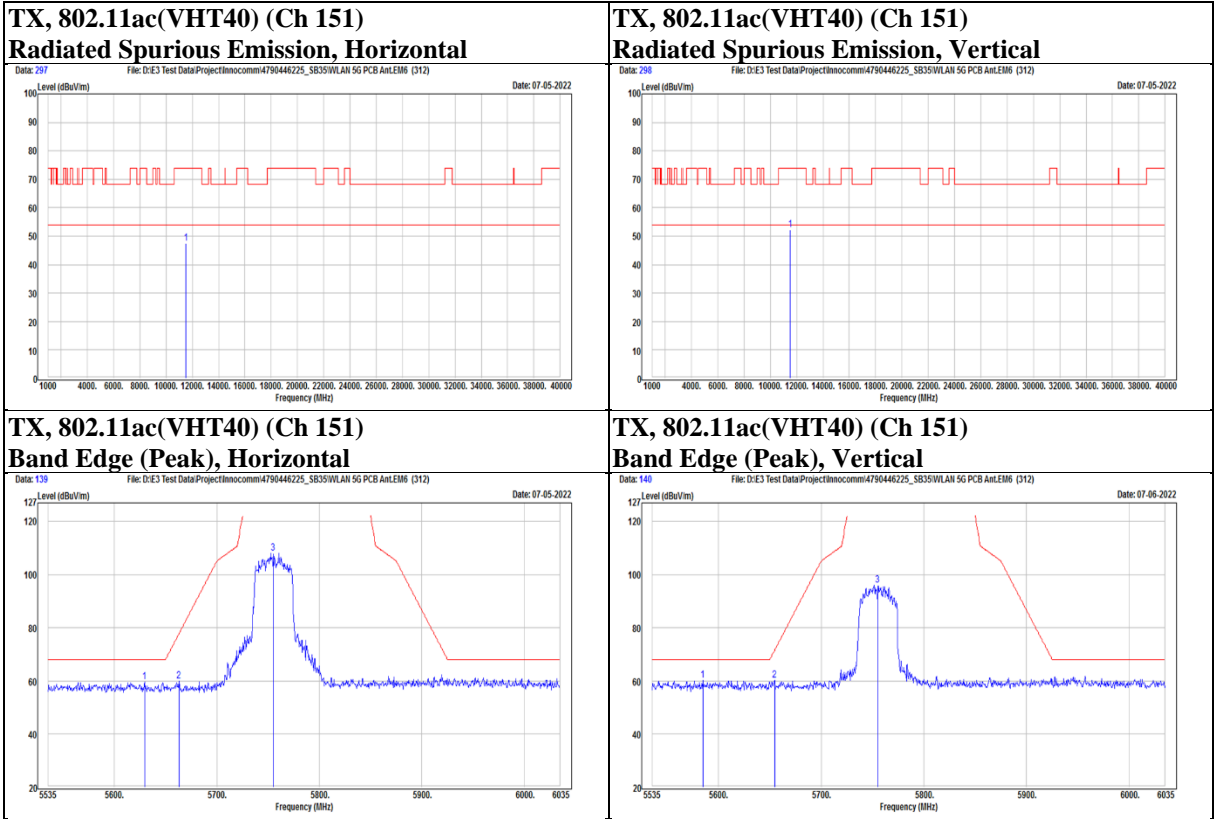

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0

Page : 233 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	159
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5795	87.47	20.52	107.99	N/A	N/A	PK
		5923.5	41.1	20.96	62.06	69.31	-7.25	PK
		5986	40.41	20.98	61.39	68.2	-6.81	PK
	*	11590	28.22	18.99	47.21	74	-26.79	PK
Vertical	@	5795	78.11	20.52	98.63	N/A	N/A	PK
		5909	40.84	20.97	61.81	80.01	-18.2	PK
		5955.5	40.99	20.95	61.94	68.2	-6.26	PK
	*	11590	30.22	18.99	49.21	74	-24.79	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

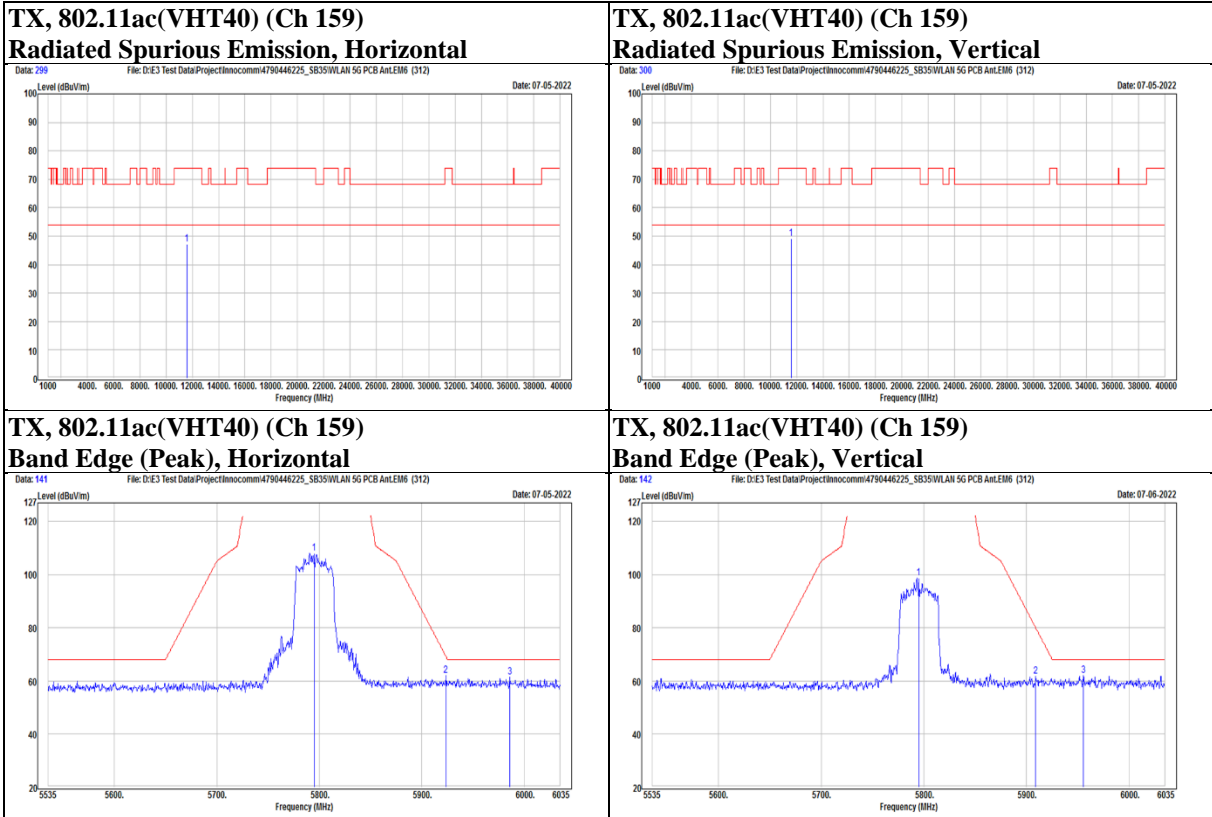



Test report No. : 4790446225-US-R1-V0
Page : 235 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	42
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5132.3	42.08	19.42	61.5	74	-12.5	PK
		5149.8	33	19.4	52.4	54	-1.6	AVG
		5211.75	75.54	19.18	94.72	N/A	N/A	AVG
		5212.1	83.4	19.17	102.57	N/A	N/A	PK
	*	10420	28.09	17.76	45.85	68.2	-22.35	PK
Vertical		5101.5	41.72	19.44	61.16	74	-12.84	PK
		5107.8	32.01	19.43	51.44	54	-2.56	AVG
	@	5210	71.36	19.18	90.54	N/A	N/A	PK
	@	5210	64.88	19.18	84.06	N/A	N/A	AVG
	*	10420	27.47	17.76	45.23	68.2	-22.97	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

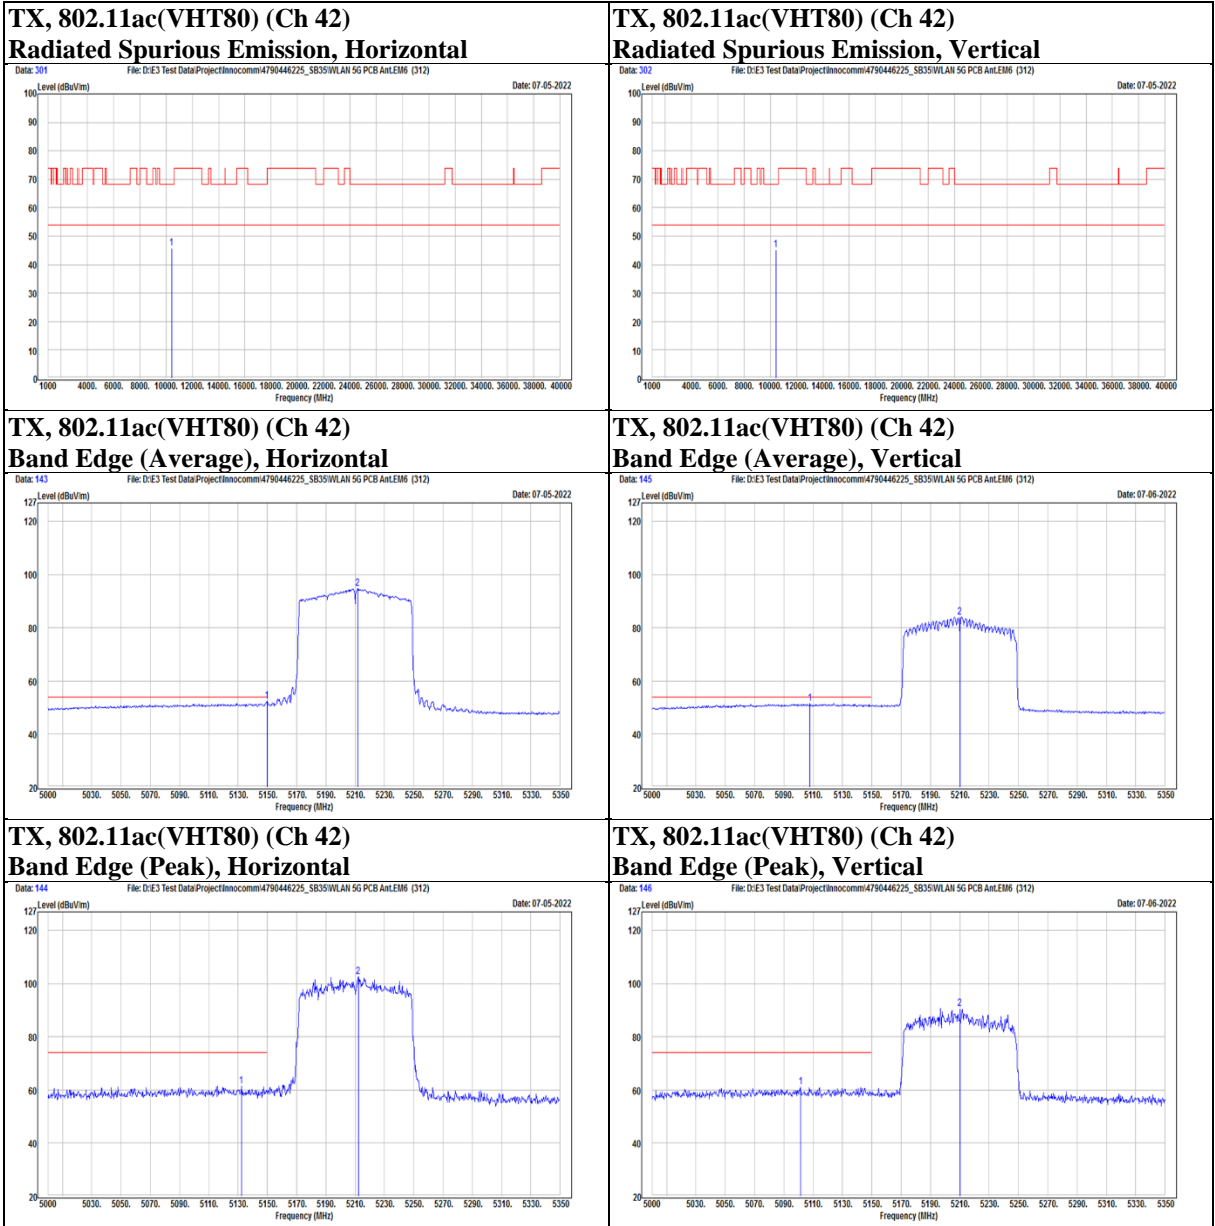



Test report No. : 4790446225-US-R1-V0
Page : 237 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	58
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5290	85.11	18.79	103.9	N/A	N/A	PK
	@	5290	76.37	18.79	95.16	N/A	N/A	AVG
		5350.2	31.89	19.01	50.9	54	-3.1	AVG
		5360.7	41.7	19.07	60.77	74	-13.23	PK
	*	10580	28.2	18.04	46.24	68.2	-21.96	PK
Vertical	@	5290	71.28	18.79	90.07	N/A	N/A	PK
	@	5290	65.72	18.79	84.51	N/A	N/A	AVG
		5430.9	39.9	19.42	59.32	74	-14.68	PK
		5444.7	29.97	19.5	49.47	54	-4.53	AVG
	*	10580	27.91	18.04	45.95	68.2	-22.25	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

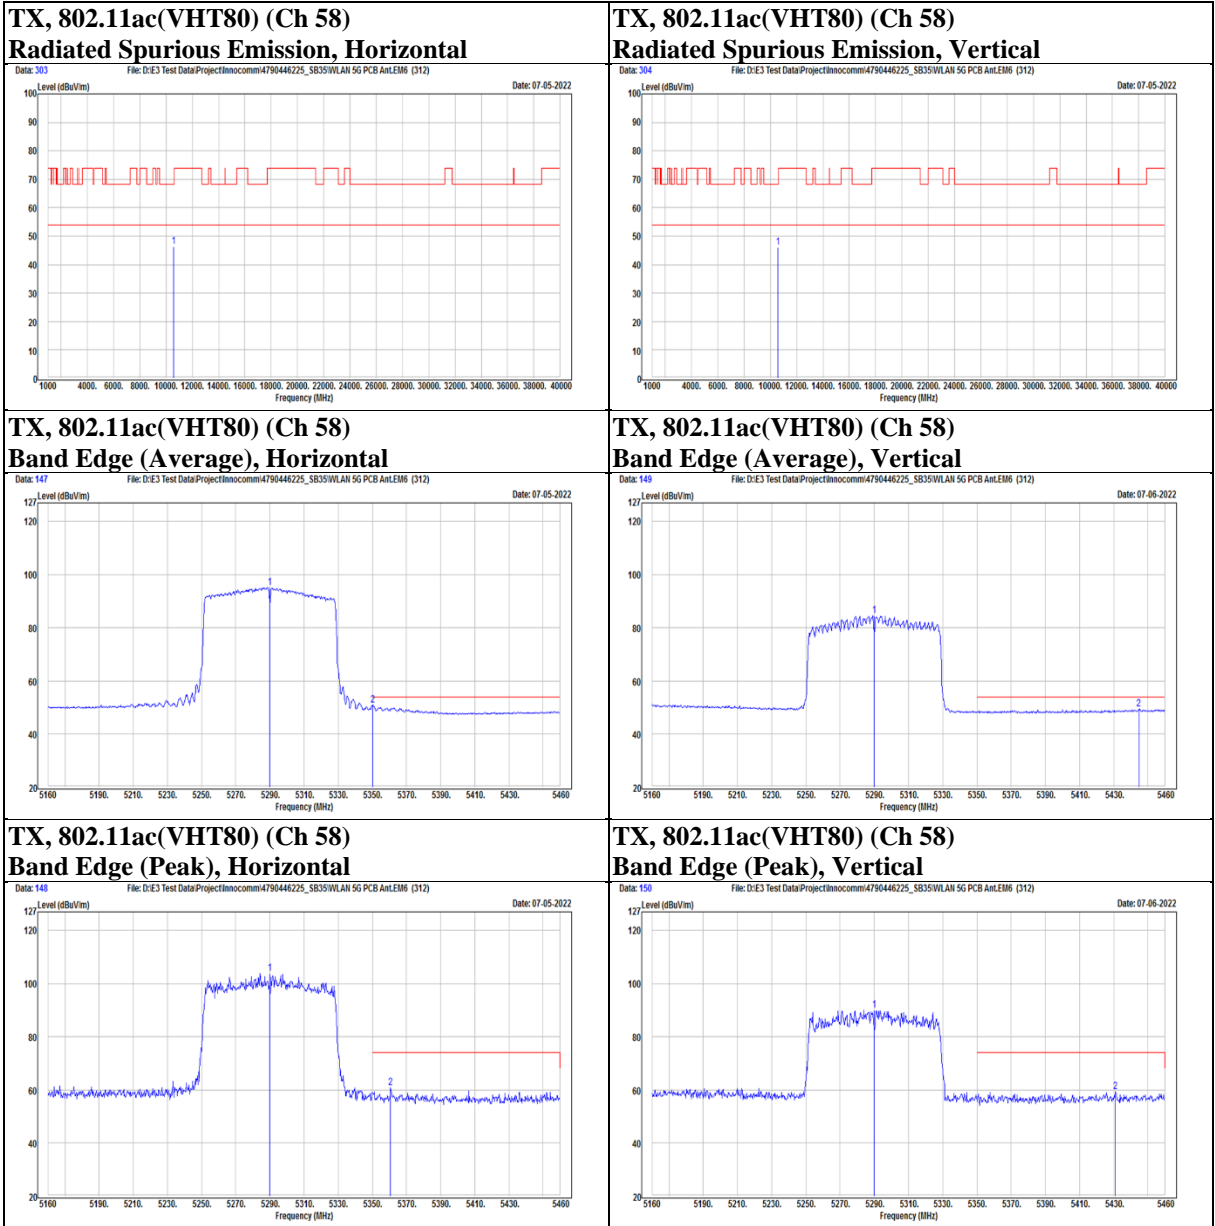



Test report No. : 4790446225-US-R1-V0
Page : 239 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	106
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5444.8	45.86	19.5	65.36	74	-8.64	PK
		5457.05	34.44	19.55	53.99	54	-0.01	AVG
		5469.3	44.77	19.62	64.39	68.2	-3.81	PK
	@	5530	85.83	19.81	105.64	N/A	N/A	PK
	@	5530	76.4	19.81	96.21	N/A	N/A	AVG
	*	11060	27.16	18.44	45.6	74	-28.4	PK
Vertical		5401.4	40.51	19.28	59.79	74	-14.21	PK
		5401.4	30.86	19.28	50.14	54	-3.86	AVG
		5466.15	39.65	19.6	59.25	68.2	-8.95	PK
	@	5530	75.67	19.81	95.48	N/A	N/A	PK
	@	5530	69.75	19.81	89.56	N/A	N/A	AVG
	*	11060	28.3	18.44	46.74	74	-27.26	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

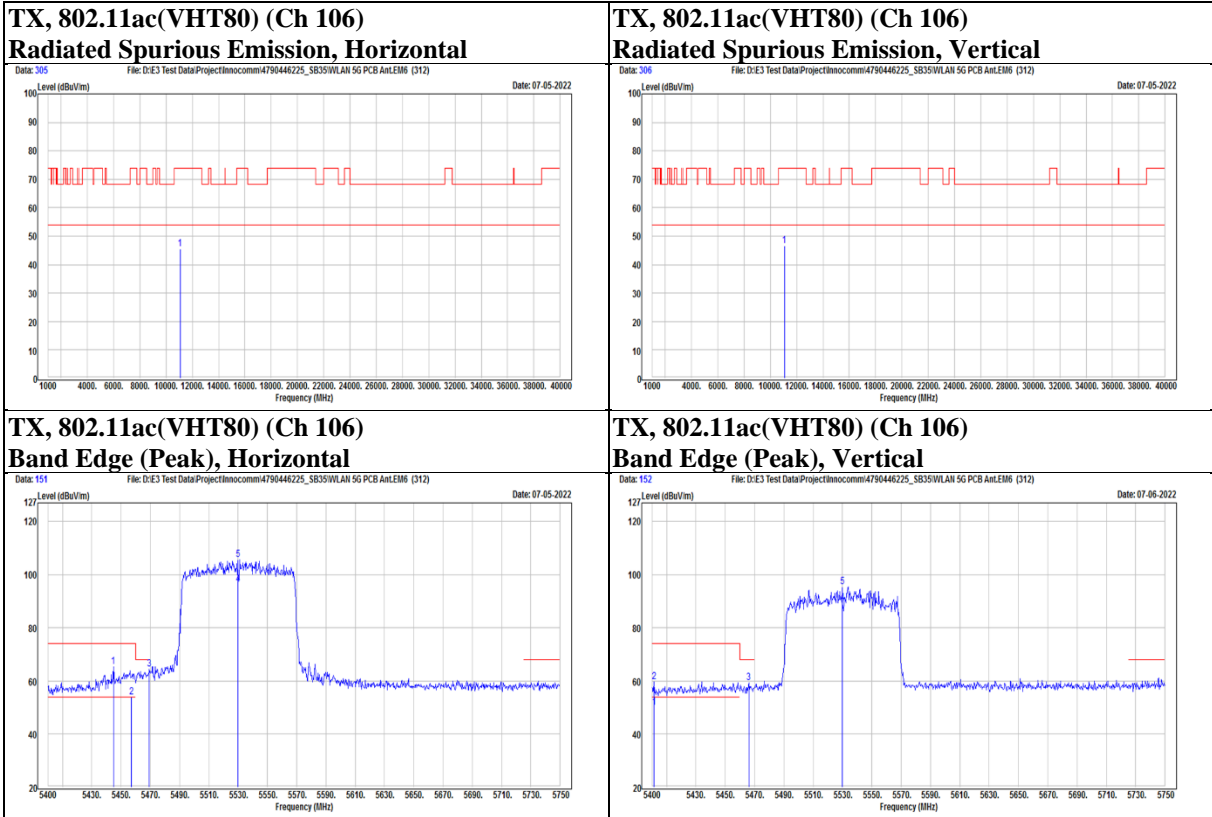



Test report No. : 4790446225-US-R1-V0

Page : 241 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	122
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5454.95	41.7	19.54	61.24	74	-12.76	PK
		5454.95	30.06	19.54	49.6	54	-4.4	AVG
		5466.15	40.25	19.6	59.85	68.2	-8.35	PK
	@	5610	90.27	19.69	109.96	N/A	N/A	PK
	@	5610	80.66	19.69	100.35	N/A	N/A	AVG
		5743	43.66	20.13	63.79	68.2	-4.41	PK
	*	11220	29.76	18.47	48.23	74	-25.77	PK
Vertical		5439.9	39.74	19.47	59.21	74	-14.79	PK
		5439.9	30.07	19.47	49.54	54	-4.46	AVG
		5463.35	39.9	19.58	59.48	68.2	-8.72	PK
	@	5610	80.05	19.69	99.74	N/A	N/A	PK
	@	5610	74.07	19.69	93.76	N/A	N/A	AVG
		5743	40.52	20.13	60.65	68.2	-7.55	PK
	*	11220	35.04	18.47	53.51	74	-20.49	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

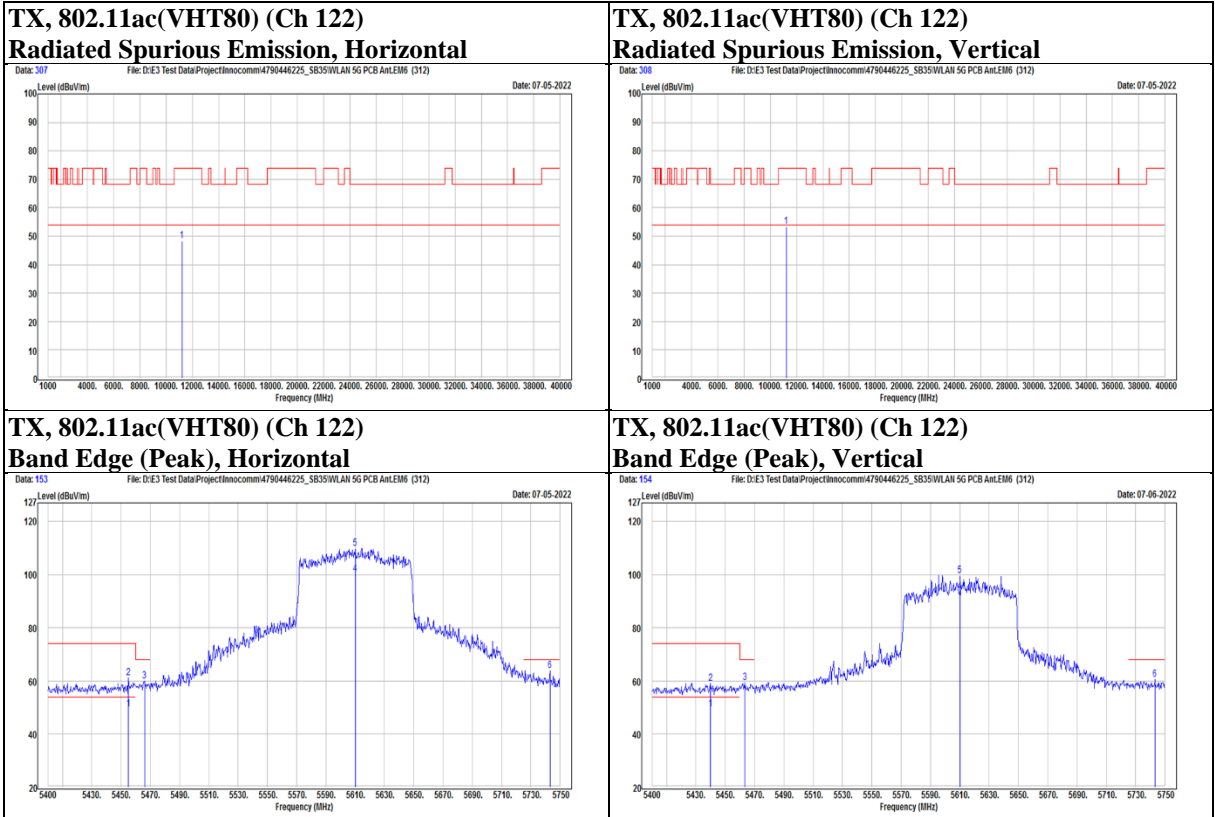



Test report No. : 4790446225-US-R1-V0
Page : 243 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	155
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5586.5	41.09	19.74	60.83	68.2	-7.37	PK
		5693	53.79	19.72	73.51	100.04	-26.53	PK
	@	5775	86.32	20.37	106.69	N/A	N/A	PK
		5875.5	43.87	20.8	64.67	104.83	-40.16	PK
		5951	40.33	20.94	61.27	68.2	-6.93	PK
	*	11550	29.3	19.16	48.46	74	-25.54	PK
Vertical		5634.5	41.84	19.67	61.51	68.2	-6.69	PK
		5688	44.45	19.71	64.16	96.35	-32.19	PK
	@	5775	75.08	20.37	95.45	N/A	N/A	PK
		5910.5	41.01	20.97	61.98	78.9	-16.92	PK
		6028.5	40.62	20.98	61.6	68.2	-6.6	PK
	*	11550	32.56	19.16	51.72	74	-22.28	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

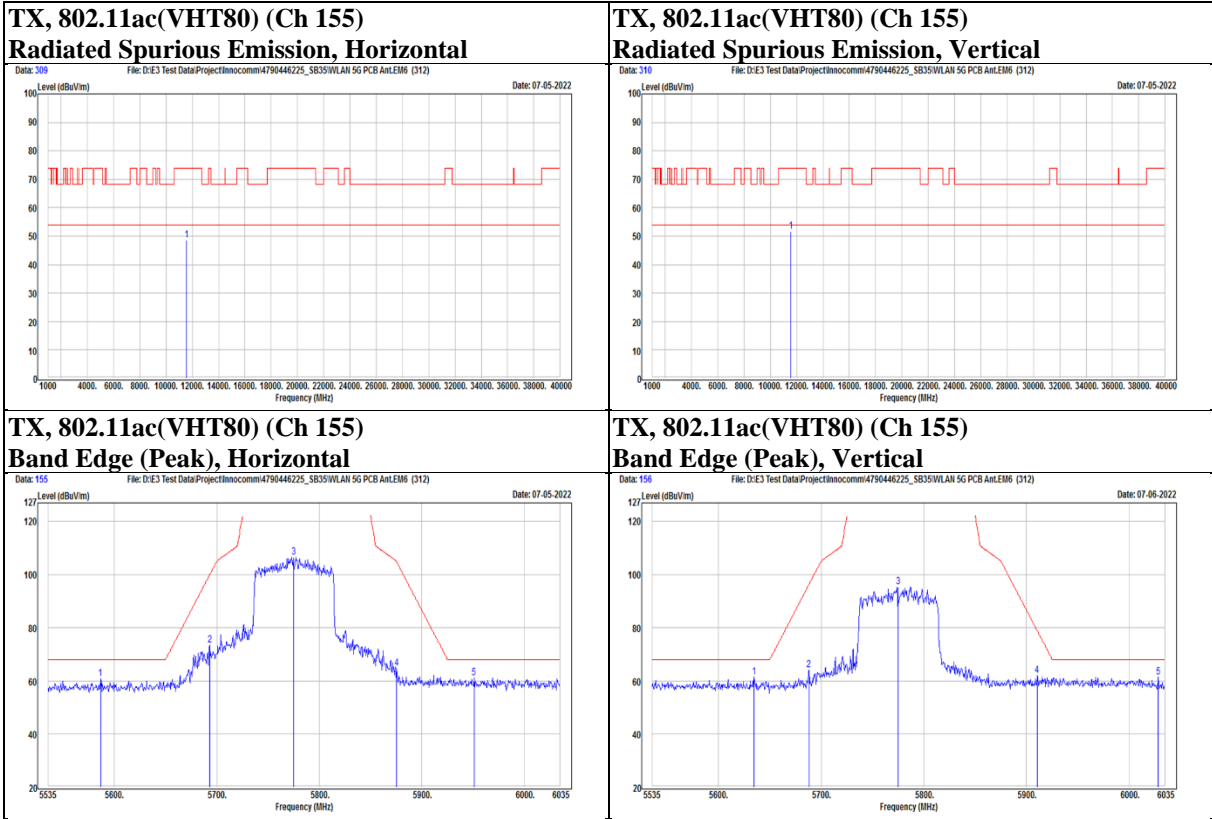




Below 1 GHz

Mode	802.11ac(VHT80)	Channel	122
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		83.35	40.82	-17.18	23.64	40	-16.36	PK
		167.74	38.82	-11.22	27.6	43.5	-15.9	PK
		231.76	39.19	-12.5	26.69	46	-19.31	PK
		323.91	42.48	-9.23	33.25	46	-12.75	PK
		344.28	43.27	-8.69	34.58	46	-11.42	PK
Vertical		427.7	37.49	-6.32	31.17	46	-14.83	PK
		72.68	41.66	-14.62	27.04	40	-12.96	PK
		84.32	46.06	-17.33	28.73	40	-11.27	PK
		159.98	38.02	-11.11	26.91	43.5	-16.59	PK
		330.7	38.65	-9.04	29.61	46	-16.39	PK
		385.02	37.83	-7.43	30.4	46	-15.6	PK
	584.84	38.37	-2.69	35.68	46	-10.32	PK	

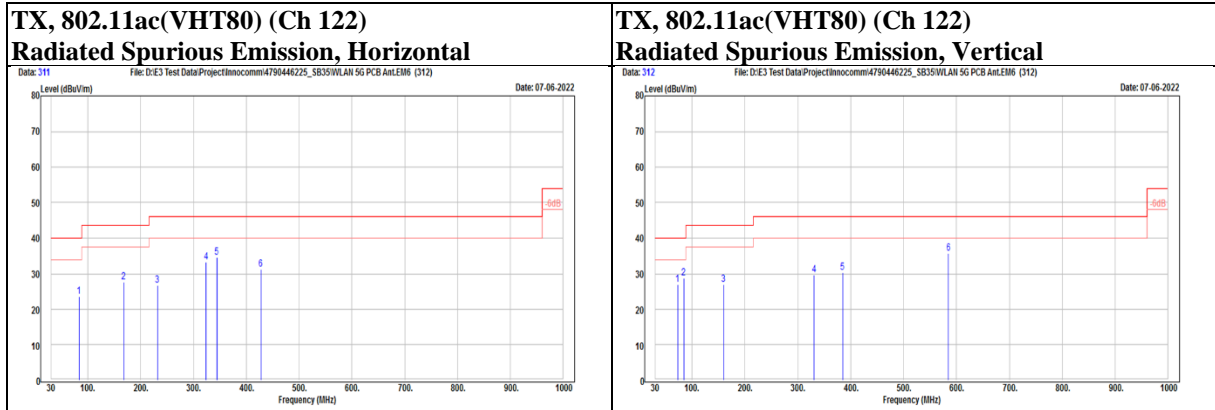

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



9 kHz ~ 30 MHz Data:

For 9 kHz to 30 MHz radiated emission have performed all modes of operation were investigated. The amplitude of spurious emissions attenuated more than 20 dB below the permissible value is not required to be report.

No non-compliance noted:

KDB 414788 D01 OATS and Chamber Correlation Justification

- Base on FCC 15.31 (f) (2): measurements may be performed at a distance closer than that specified in the regulations; however, an attempt should be made to avoid making measurements in the near field.

- OATs and chamber correlation testing had been performed and chamber measured test results is the worst case test result.

Although these tests were performed other than open area test site, adequate comparison measurements were confirmed against 30m open area test site. Therefore sufficient tests were made to demonstrate that the alternative site produces results that correlate with the ones of tests made in an open field based on KDB 414788.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



9.8. AC Power Line Conducted Emission

Requirements

Frequency (MHz)	Conducted limit (dB μ V)	
	Quasi-peak	Average
0.15 - 0.5	66 - 56	56 - 46
0.50 - 5.0	56	46
5.0 - 30	60	50

Note:

1. The lower limit shall apply at the transition frequencies.
2. The limit decreases in line with the logarithm of the frequency in the range of 0.15 to 0.50MHz.

Test Procedures

- a. The EUT was placed 0.4 meters from the conducting wall of the shielded room with EUT being connected to the power mains through a line impedance stabilization network (LISN). Other support units were connected to the power mains through another LISN. The two LISNs provide 50 ohm/ 50uH of coupling impedance for the measuring instrument.
- b. Both lines of the power mains connected to the EUT were checked for maximum conducted interference.
- c. The frequency range from 150kHz to 30MHz was searched. Emission levels under (Limit - 20dB) was not recorded.

NOTE:

1. The resolution bandwidth and video bandwidth of test receiver is 9kHz for quasi-peak detection (QP) and average detection (AV) at frequency 0.15MHz-30MHz.
2. All modes of operation were investigated (includes all external accessories) and the worst-case emissions are reported, the other emission levels were low against the limit.
3. Test data of Result value (dBuV) = Reading value (dBuV) + Correction Factor (dB).
4. Test data of Margin(dB) = Result value (dBuV) - Limit value (dBuV).
5. Test data of Correction Factor (dB) = Insertion loss(dB) + Cable loss(dB).

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test Setup

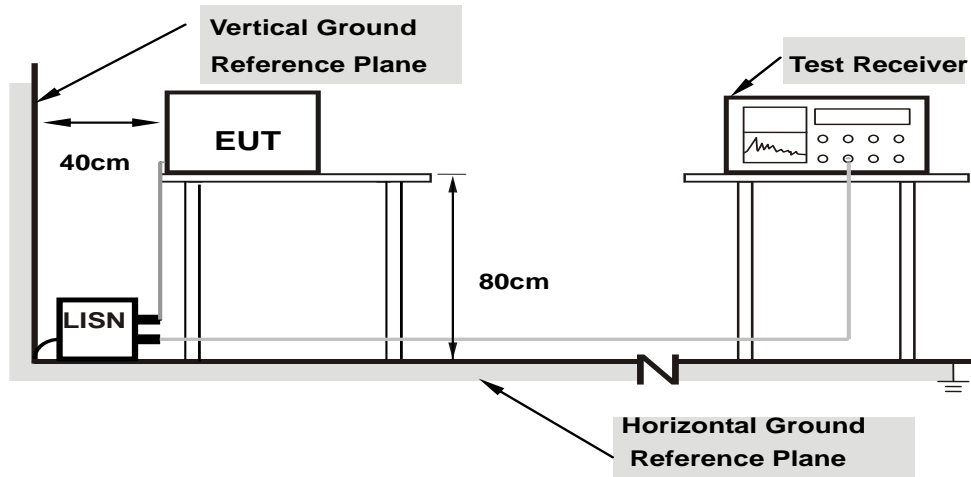

Note: 1.Support units were connected to second LISN.

For the actual test configuration, please refer to the Setup Configurations.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test Data

Mode	ac80_TX5610	Channel	122
------	-------------	---------	-----

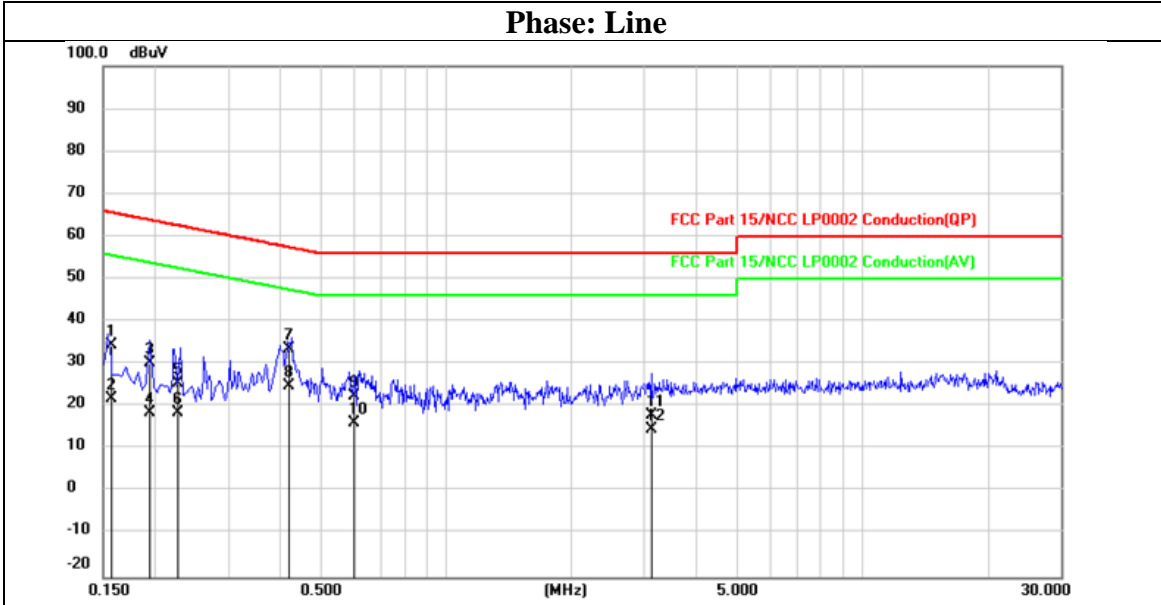

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1567	14.81	19.53	34.34	65.64	-31.30	QP
2	0.1567	2.41	19.53	21.94	55.64	-33.70	AVG
3	0.1939	10.64	19.53	30.17	63.87	-33.70	QP
4	0.1939	-1.02	19.53	18.51	53.87	-35.36	AVG
5	0.2263	5.95	19.53	25.48	62.58	-37.10	QP
6	0.2263	-1.12	19.53	18.41	52.58	-34.17	AVG
7	0.4216	13.93	19.53	33.46	57.42	-23.96	QP
8	0.4216	5.35	19.53	24.88	47.42	-22.54	AVG
9	0.6021	2.85	19.54	22.39	56.00	-33.61	QP
10	0.6021	-3.37	19.54	16.17	46.00	-29.83	AVG
11	3.1185	-1.70	19.60	17.90	56.00	-38.10	QP
12	3.1185	-4.89	19.60	14.71	46.00	-31.29	AVG

Underwriters Laboratories Taiwan Co., Ltd.


Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Mode	ac80_TX5610	Channel	122
------	-------------	---------	-----

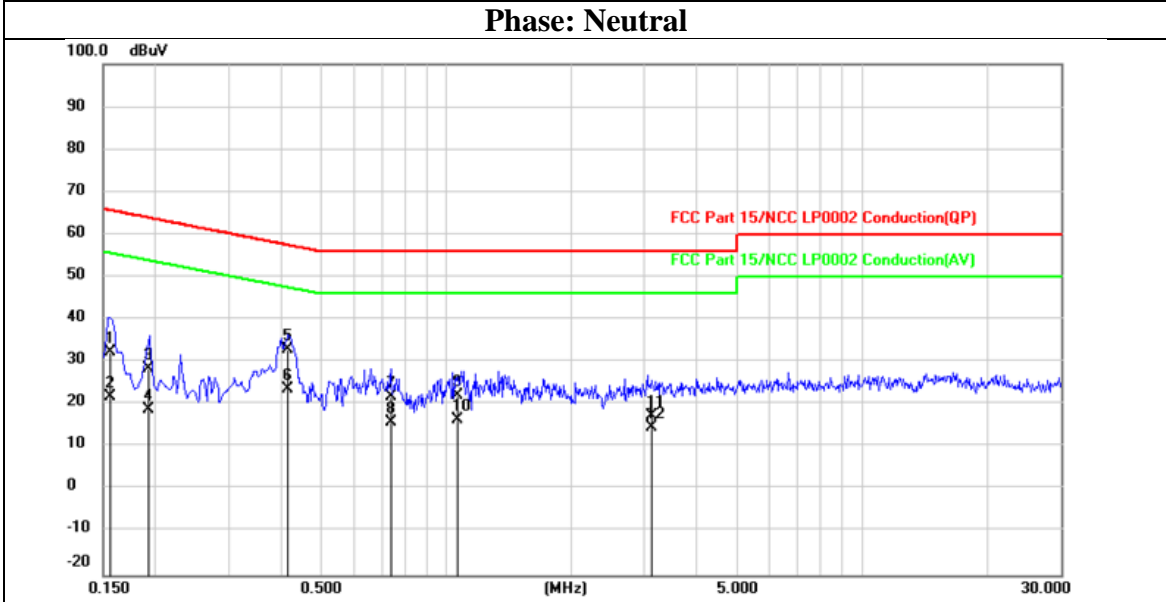

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1556	12.85	19.53	32.38	65.70	-33.32	QP
2	0.1556	2.34	19.53	21.87	55.70	-33.83	AVG
3	0.1923	8.90	19.53	28.43	63.94	-35.51	QP
4	0.1923	-0.80	19.53	18.73	53.94	-35.21	AVG
5	0.4143	13.47	19.53	33.00	57.56	-24.56	QP
6	0.4143	4.06	19.53	23.59	47.56	-23.97	AVG
7	0.7356	2.19	19.54	21.73	56.00	-34.27	QP
8	0.7356	-3.64	19.54	15.90	46.00	-30.10	AVG
9	1.0680	2.47	19.54	22.01	56.00	-33.99	QP
10	1.0680	-2.98	19.54	16.56	46.00	-29.44	AVG
11	3.1225	-2.11	19.59	17.48	56.00	-38.52	QP
12	3.1225	-5.07	19.59	14.52	46.00	-31.48	AVG

END OF REPORT

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0