




OBW NVNT a 5180MHz Ant3

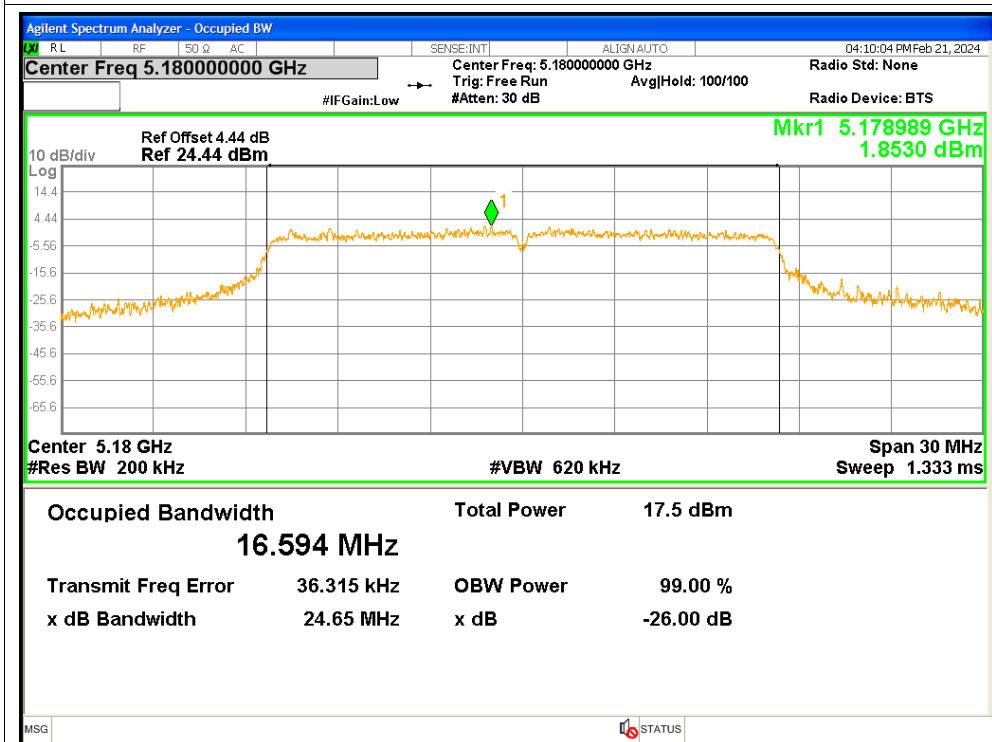


OBW NVNT a 5200MHz Ant3

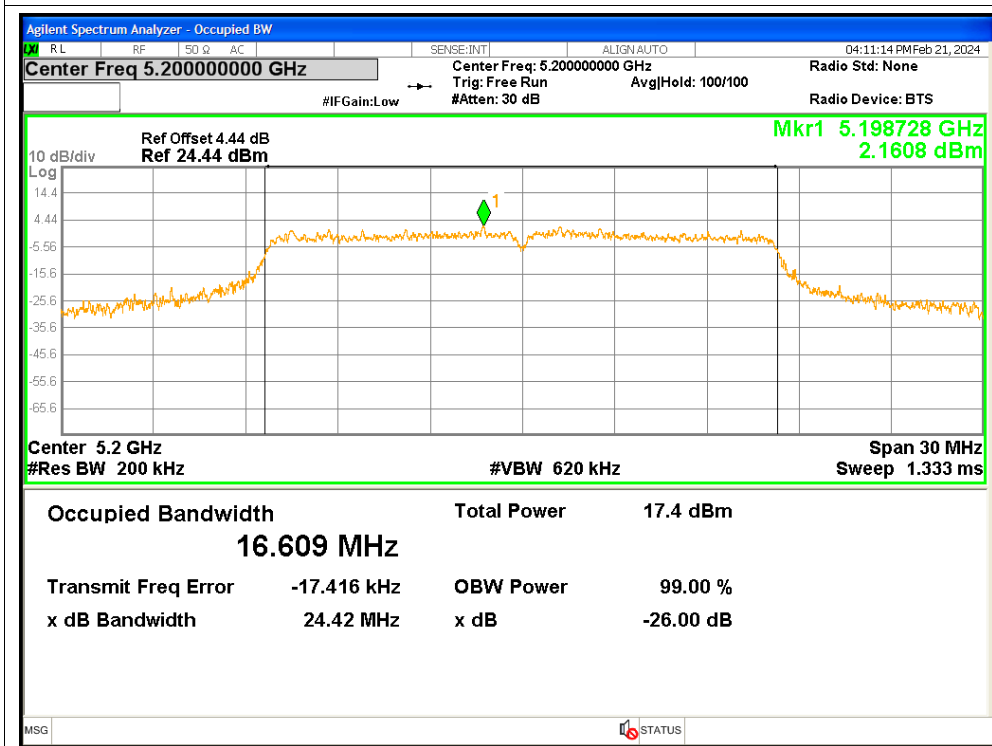


OBW NVNT a 5240MHz Ant3

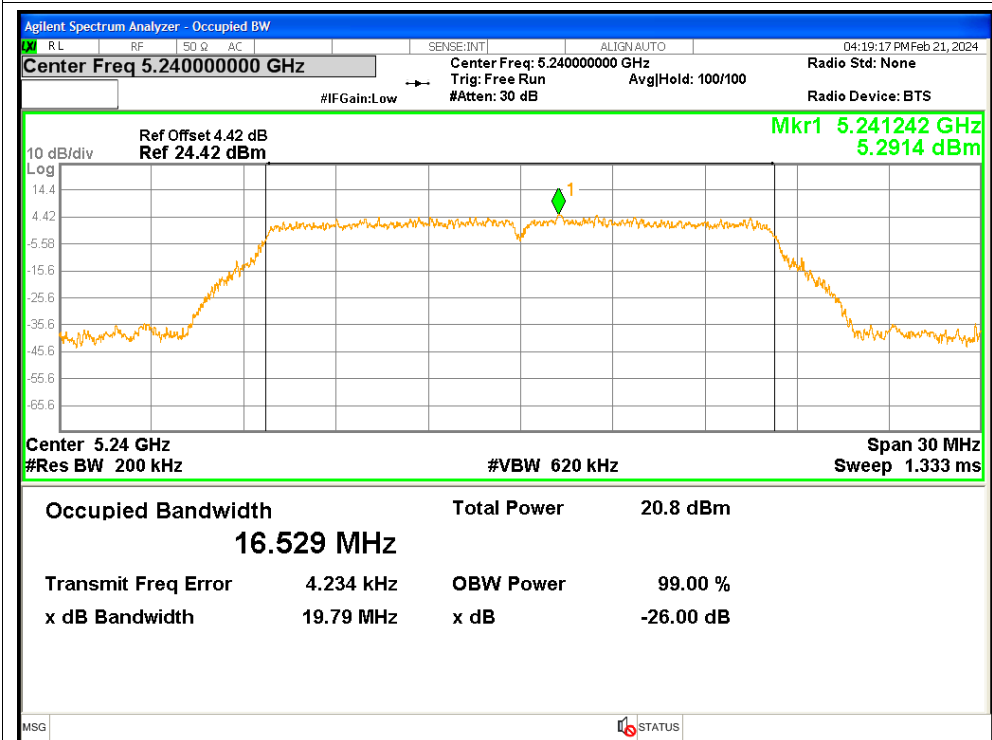


OBW NVNT ac160 5250MHz Ant1

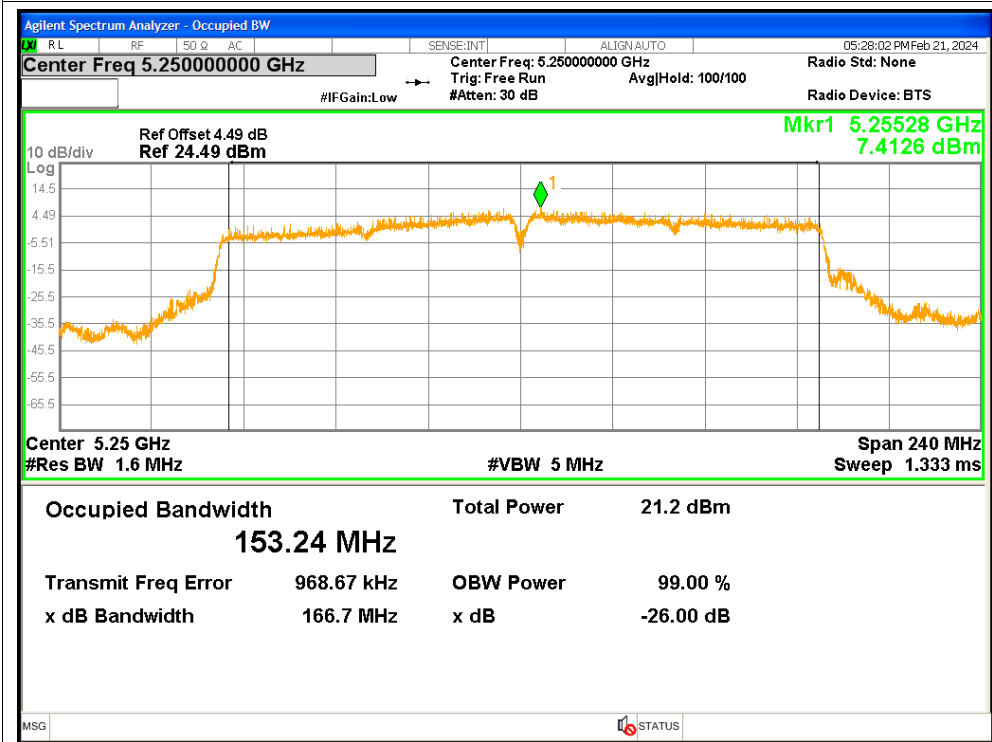


OBW NVNT ac160 5250MHz Ant2

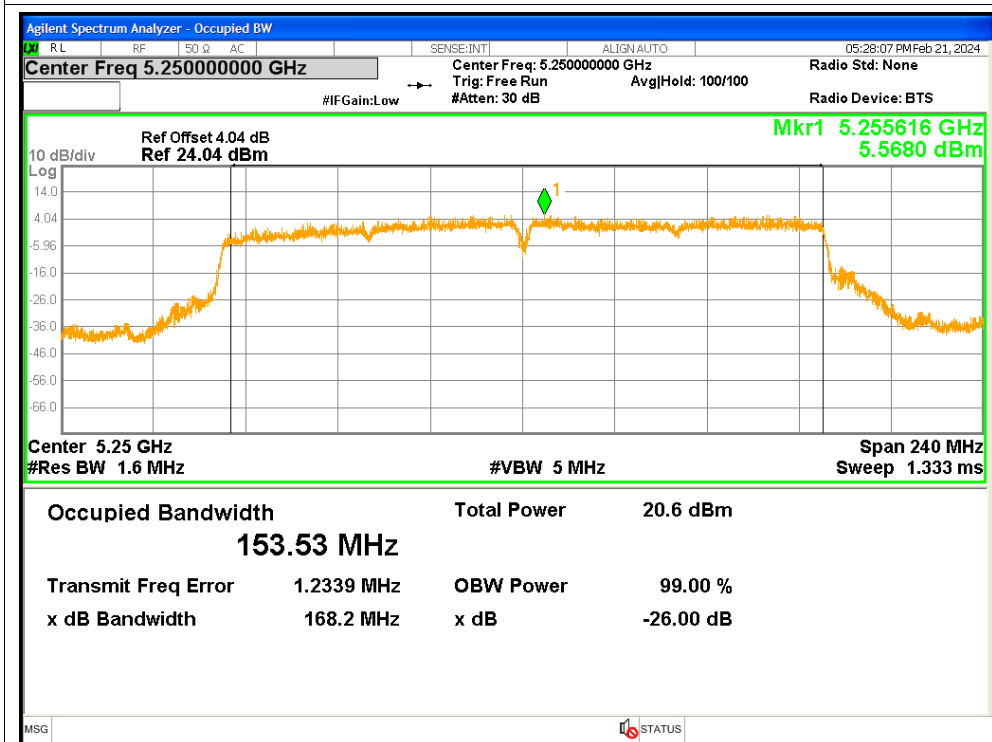


OBW NVNT ac160 5250MHz Ant3

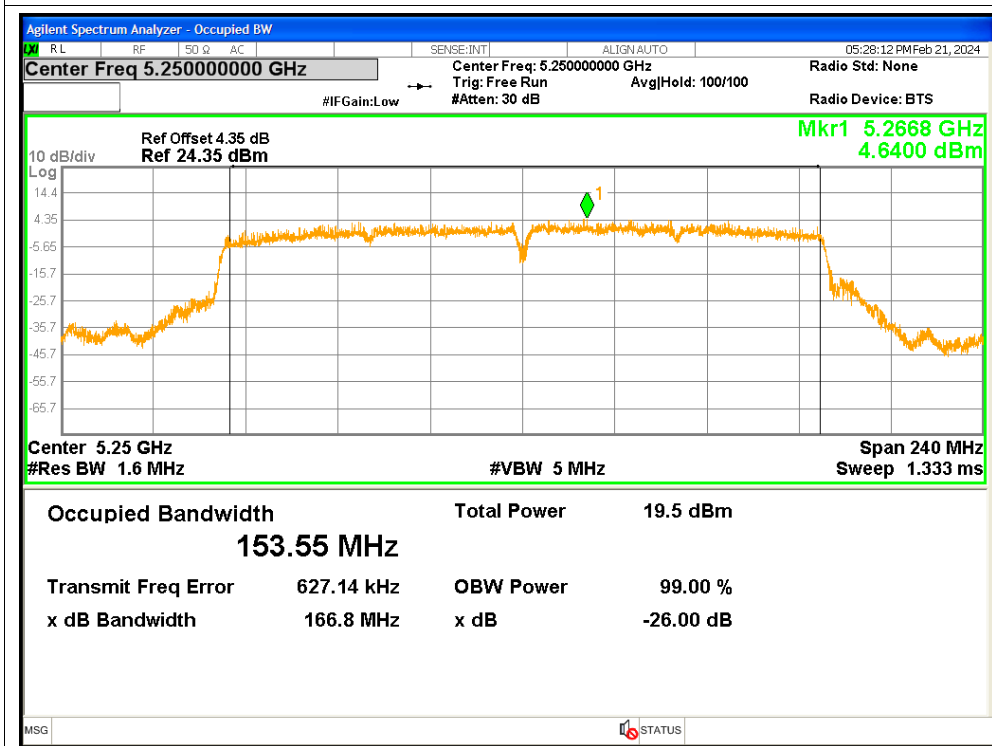


OBW NVNT ac20 5180MHz Ant1

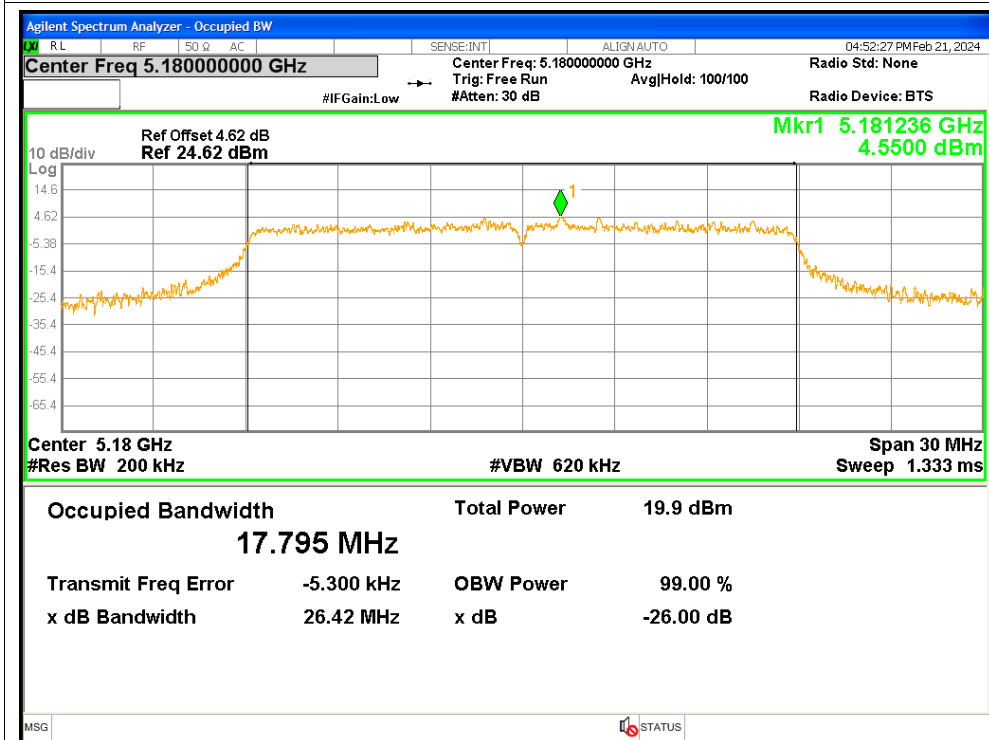


OBW NVNT ac20 5180MHz Ant2

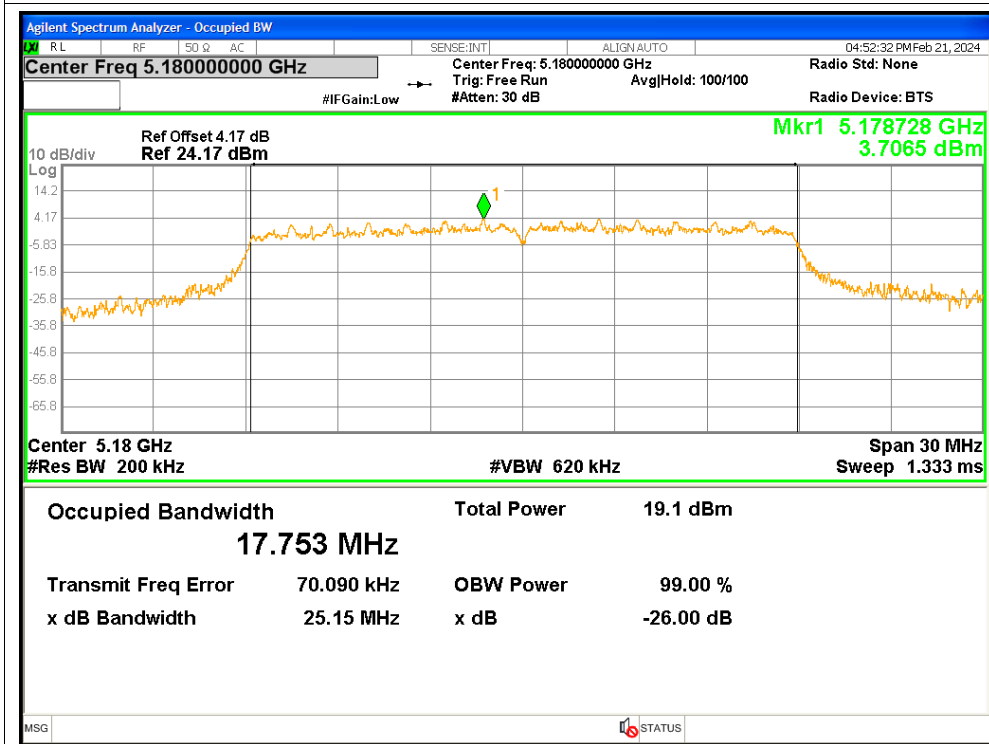


OBW NVNT ac20 5180MHz Ant3

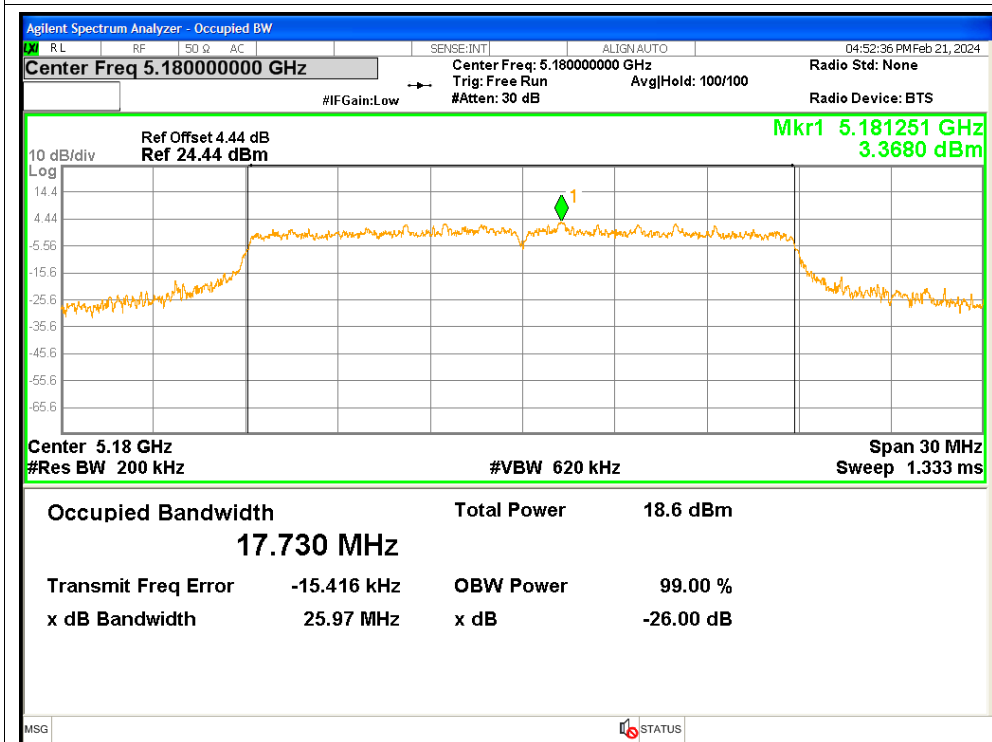


OBW NVNT ac20 5200MHz Ant1

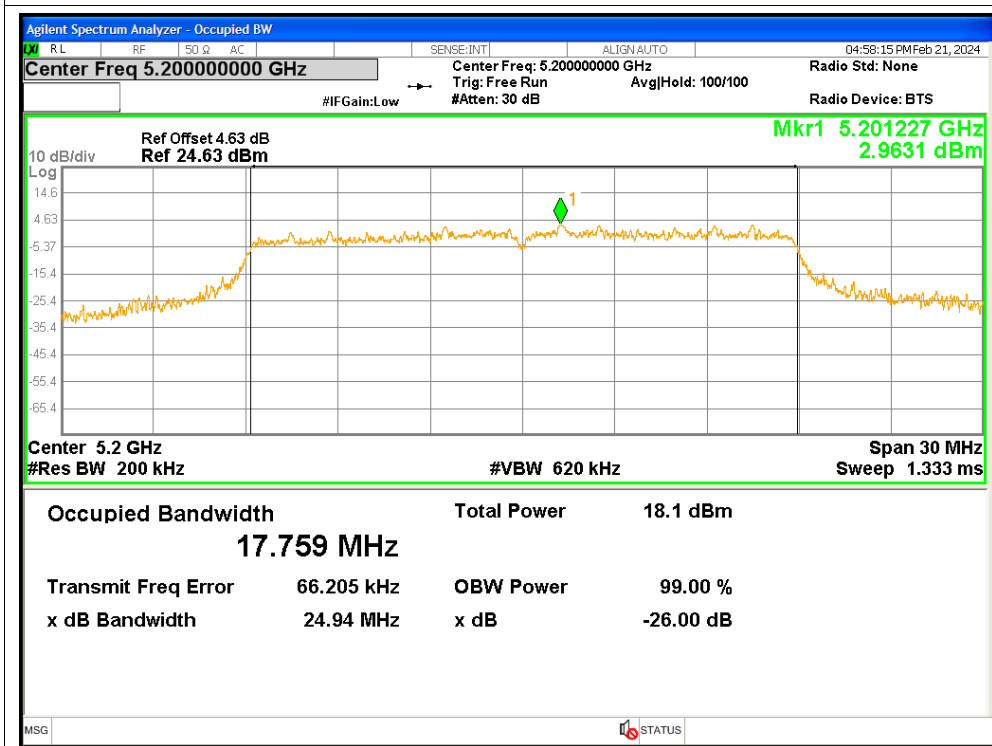


OBW NVNT ac20 5200MHz Ant2

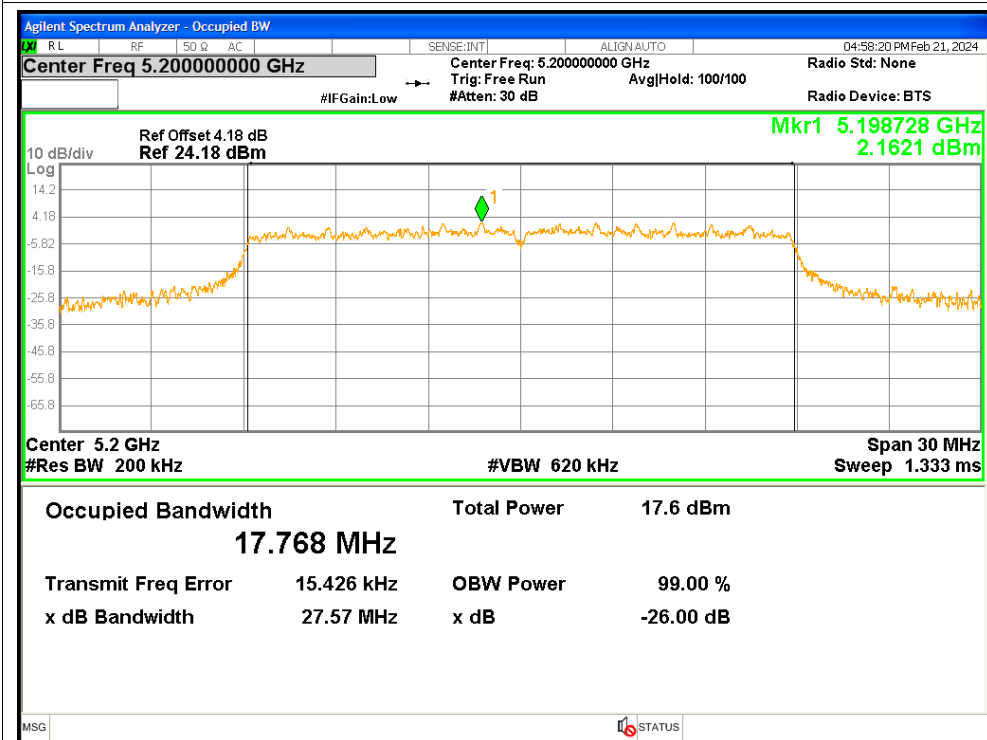


OBW NVNT ac20 5200MHz Ant3

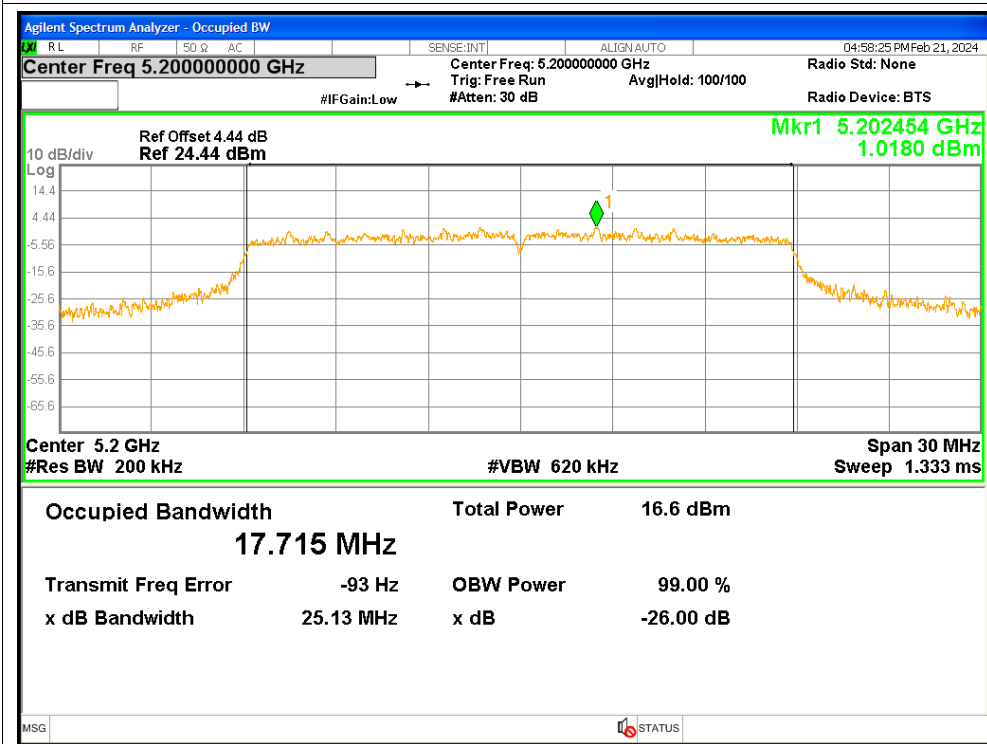


OBW NVNT ac20 5240MHz Ant1

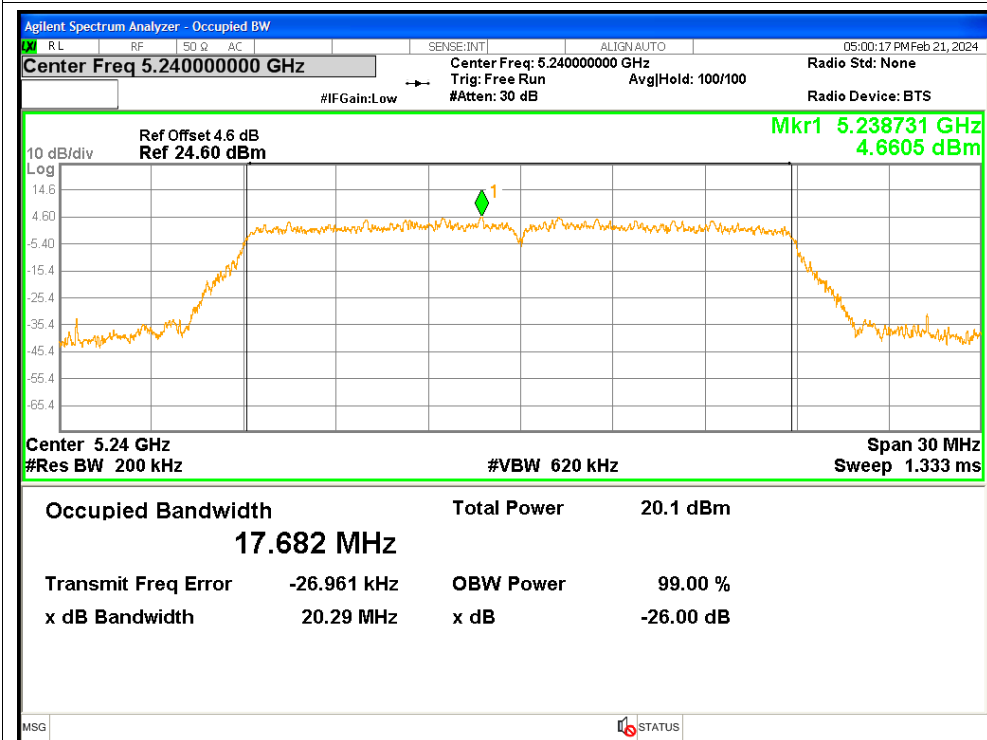


OBW NVNT ac20 5240MHz Ant2

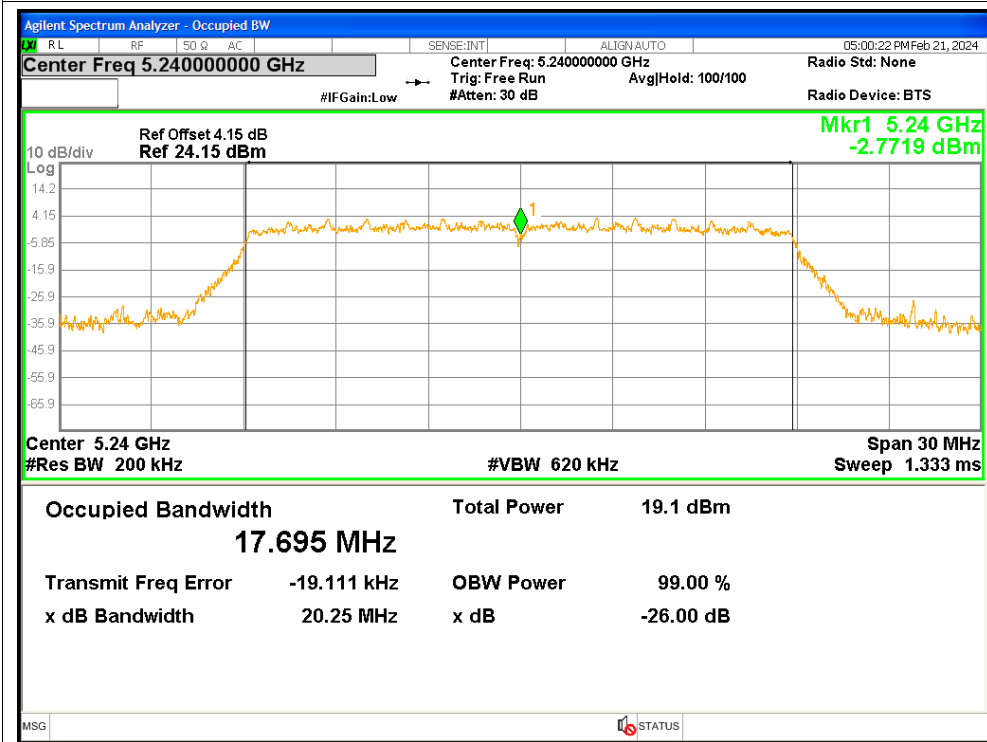


OBW NVNT ac20 5240MHz Ant3

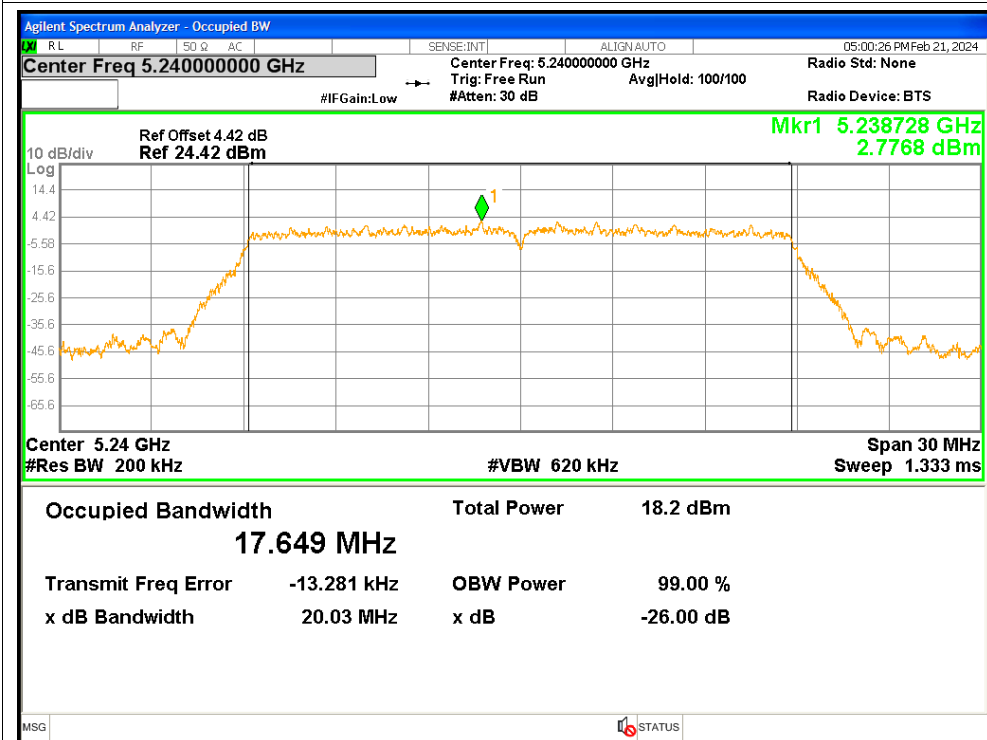


OBW NVNT ac40 5190MHz Ant1

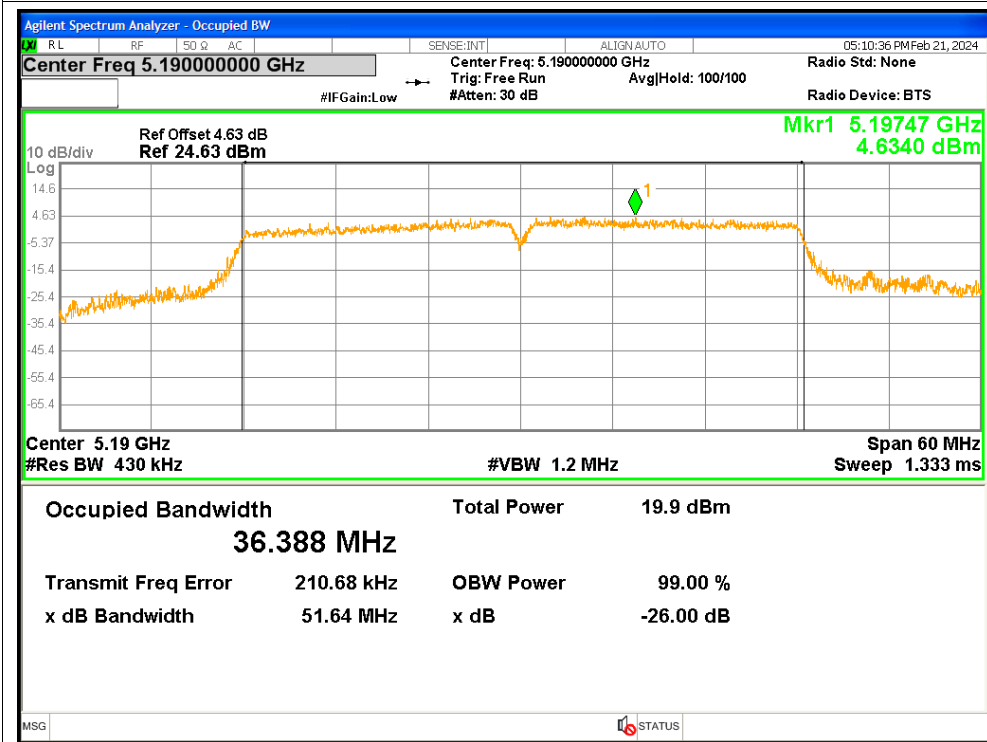


OBW NVNT ac40 5190MHz Ant2

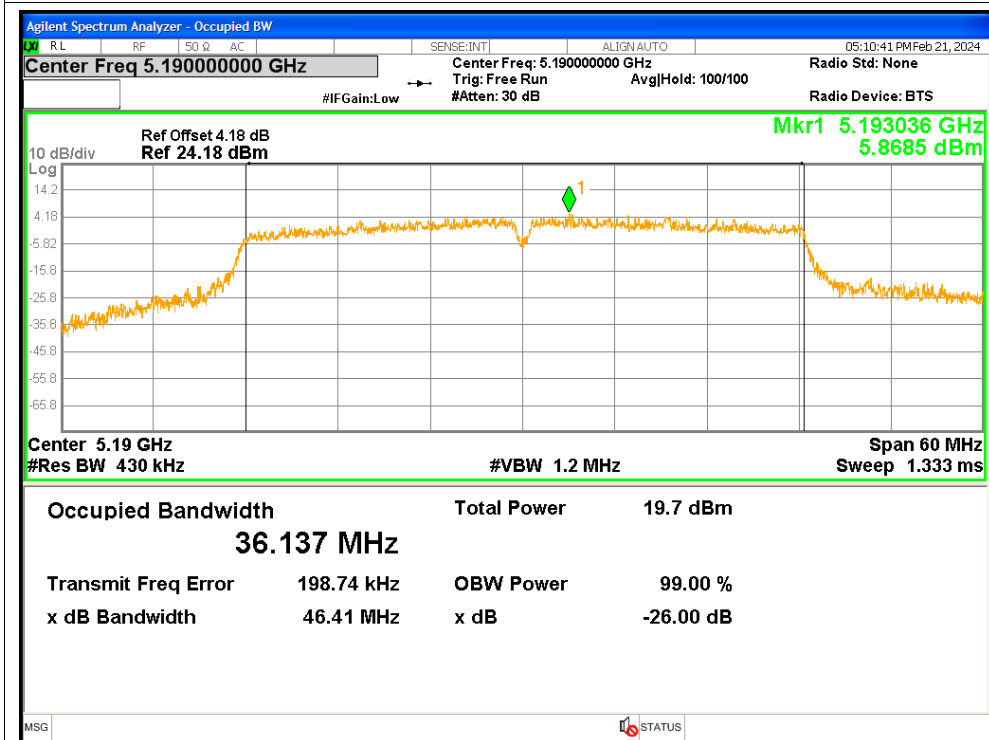


OBW NVNT ac40 5190MHz Ant3

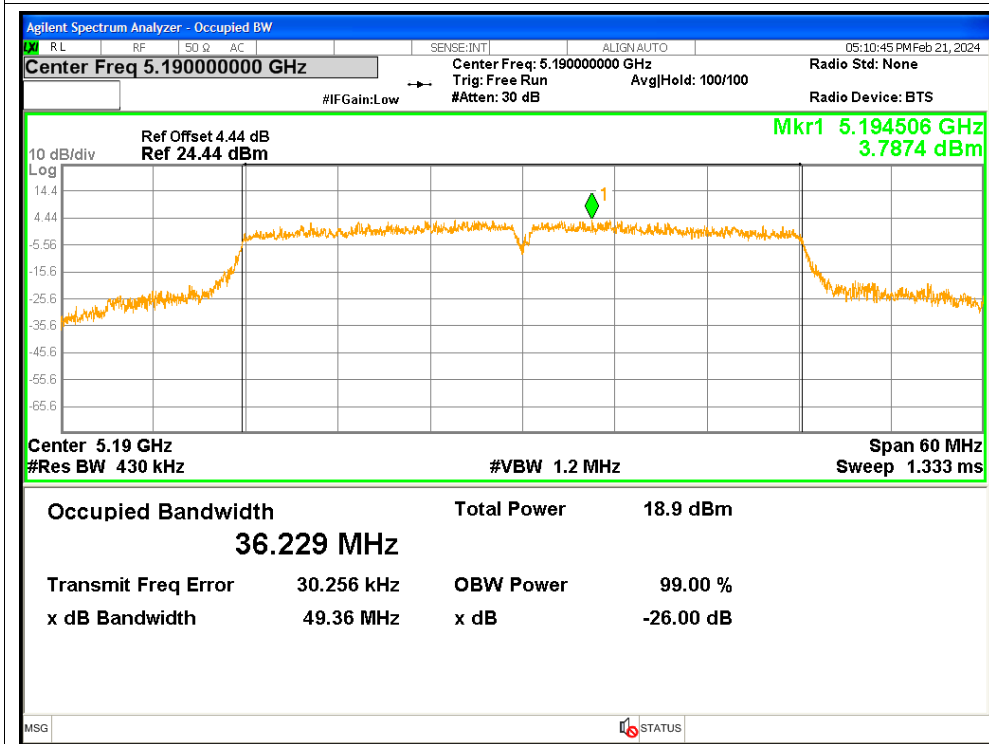


OBW NVNT ac40 5230MHz Ant1

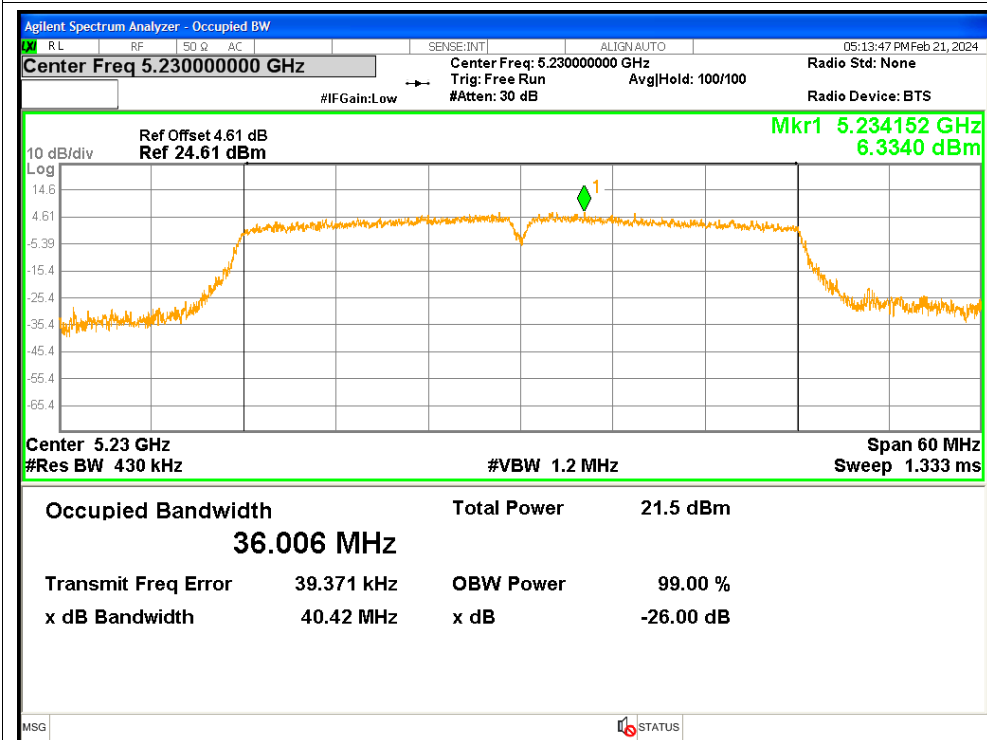


OBW NVNT ac40 5230MHz Ant2

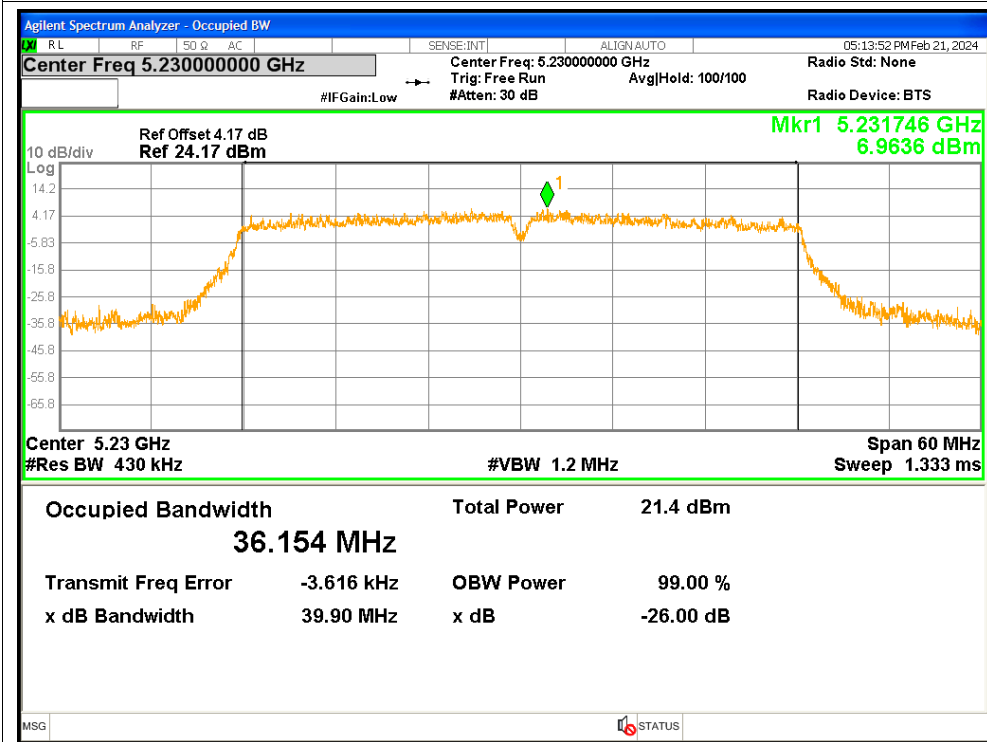


OBW NVNT ac40 5230MHz Ant3

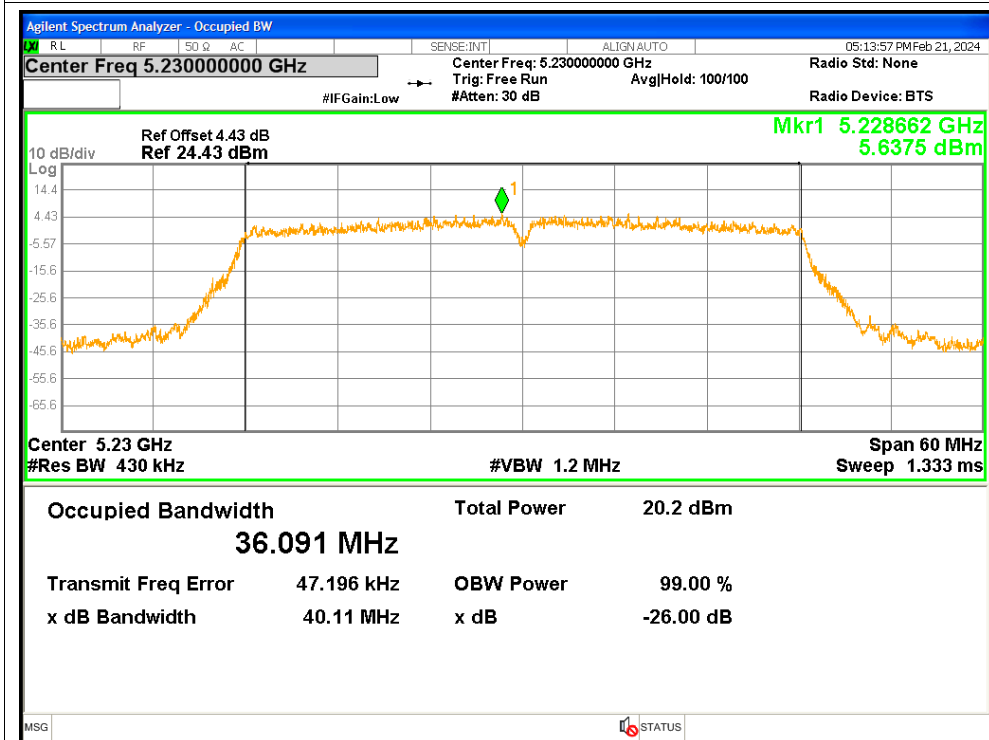


OBW NVNT ac80 5210MHz Ant1

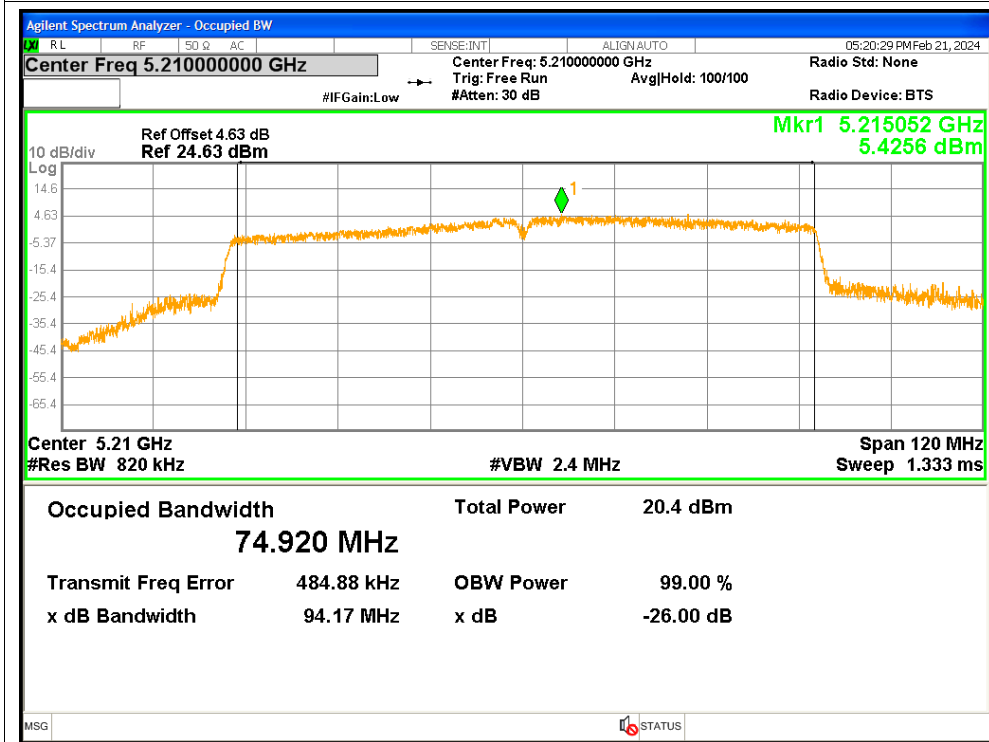


OBW NVNT ac80 5210MHz Ant2

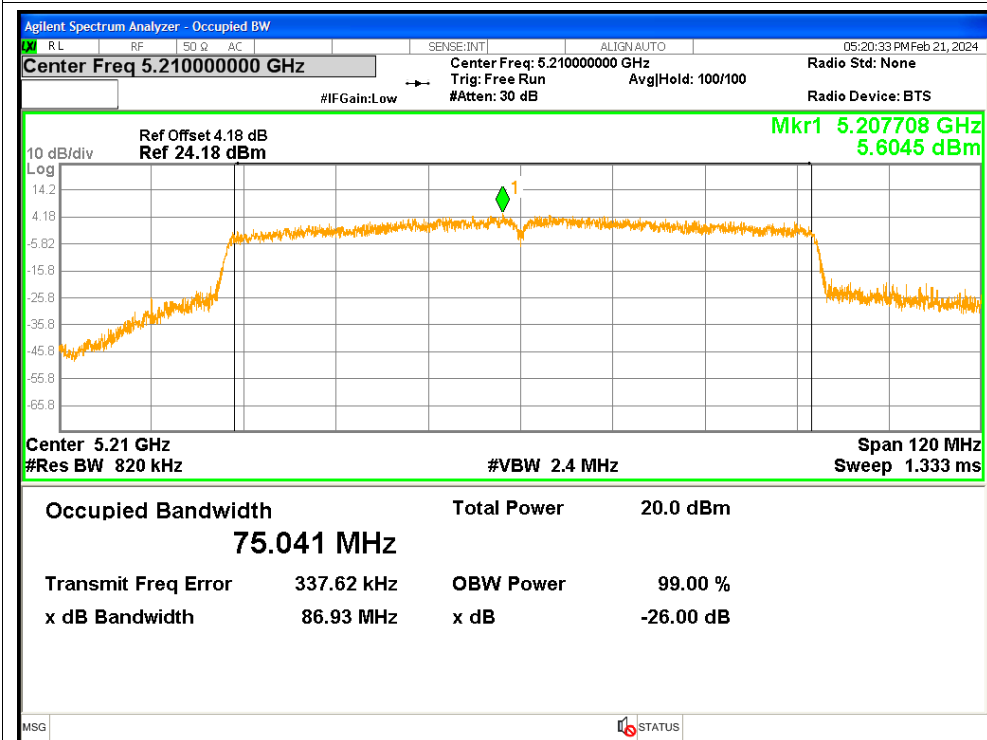


OBW NVNT ac80 5210MHz Ant3

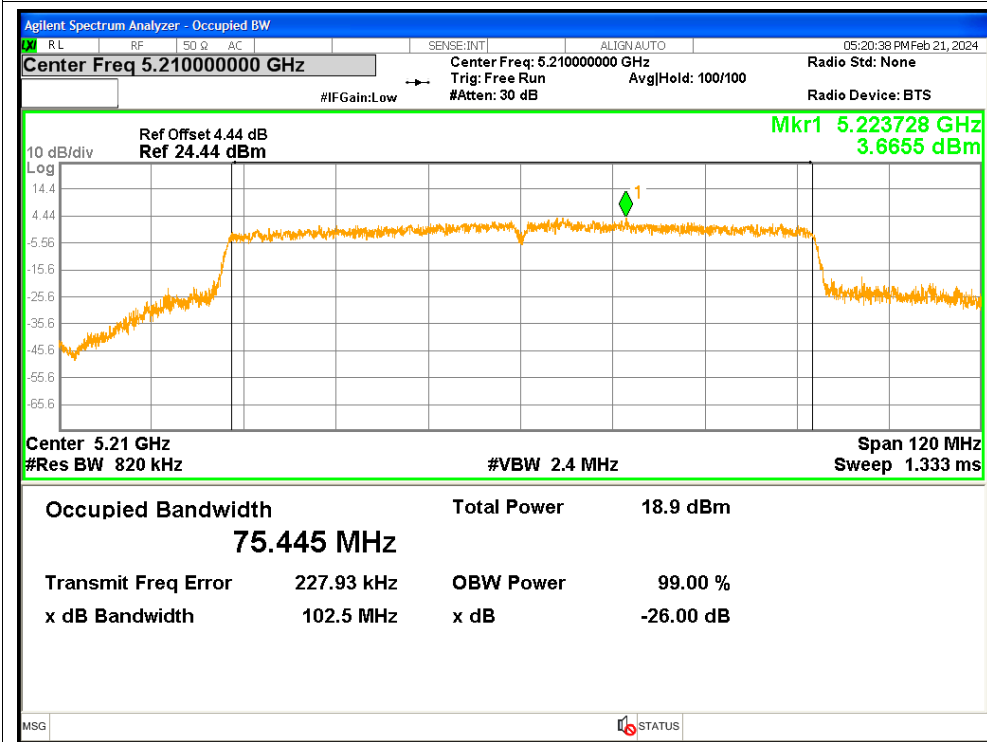


OBW NVNT ax160 5250MHz Ant1

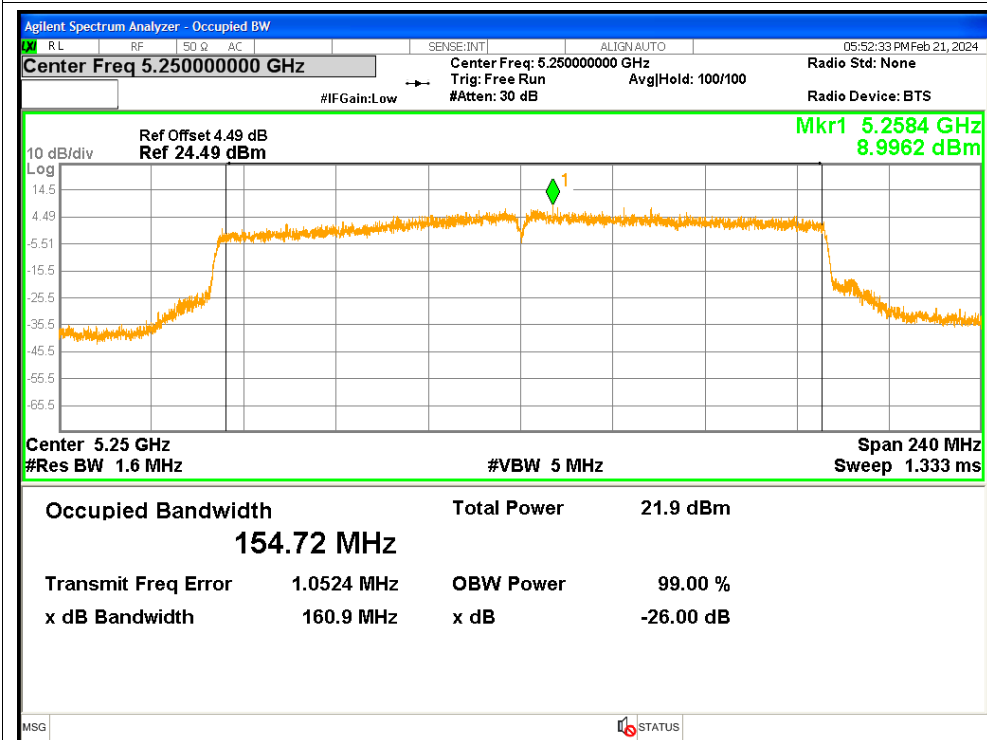


OBW NVNT ax160 5250MHz Ant2

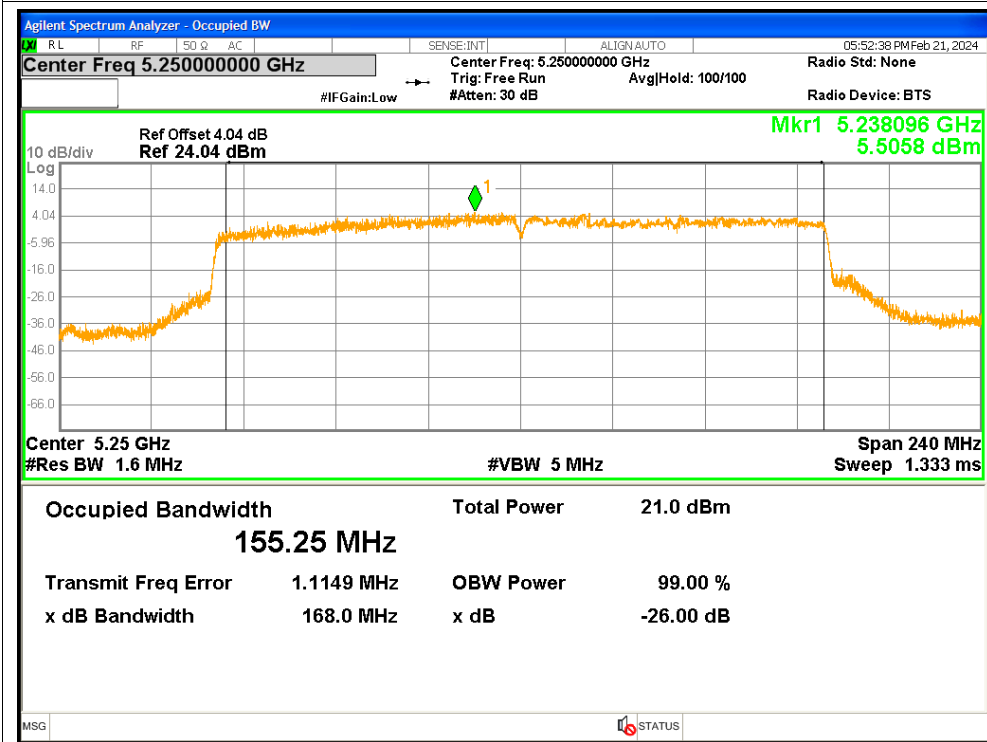


OBW NVNT ax160 5250MHz Ant3

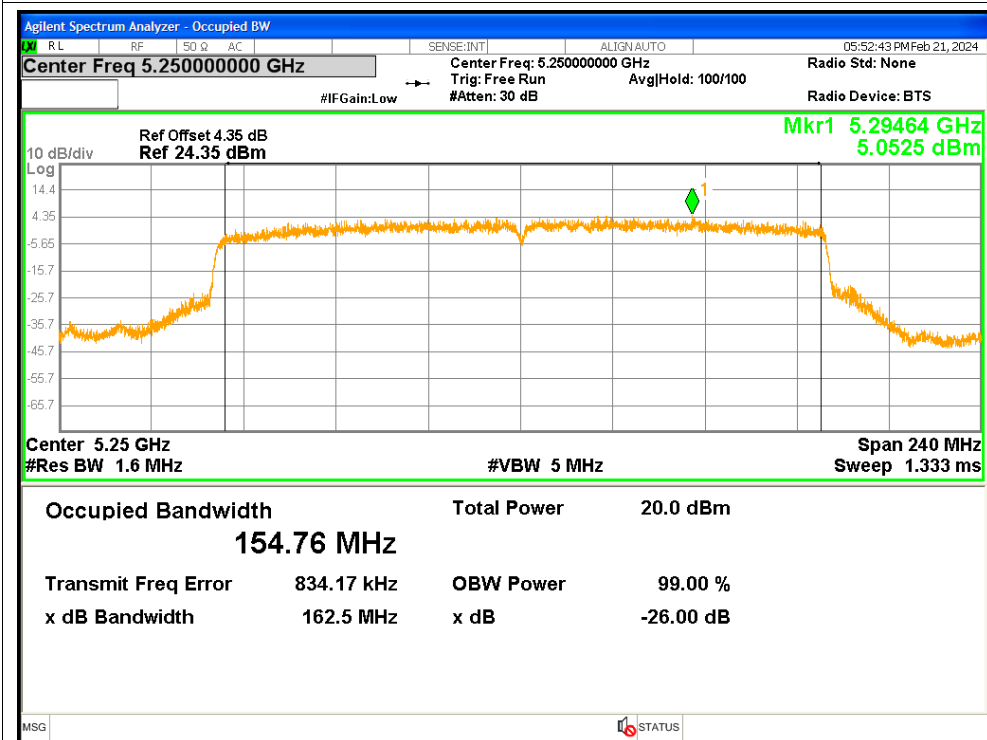


OBW NVNT ax20 5180MHz Ant1

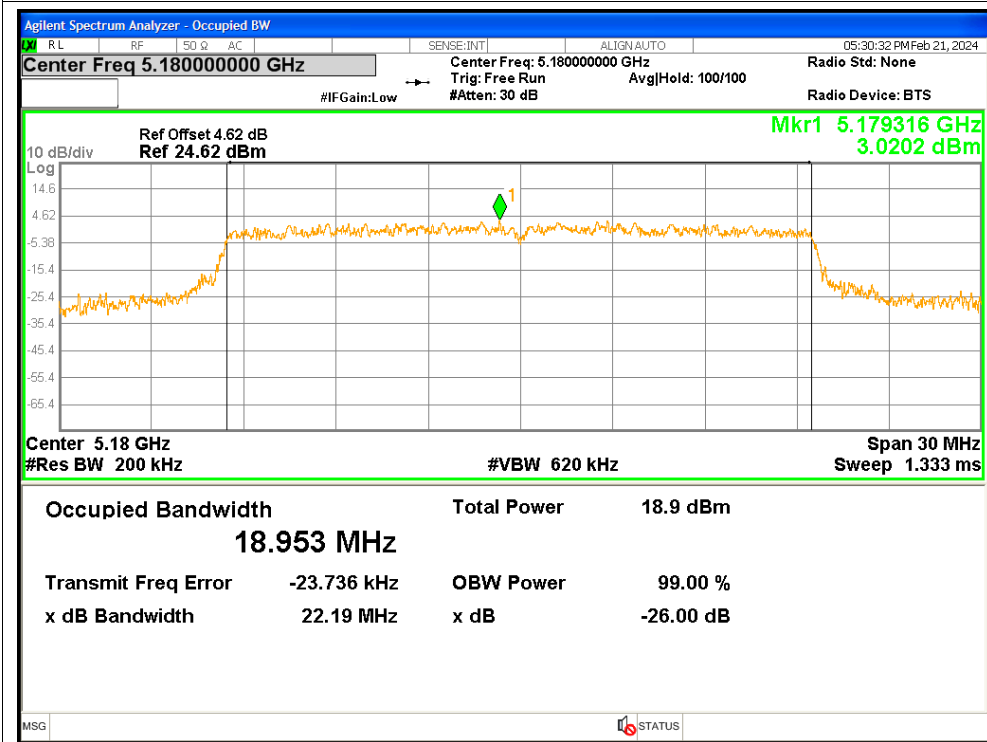


OBW NVNT ax20 5180MHz Ant2

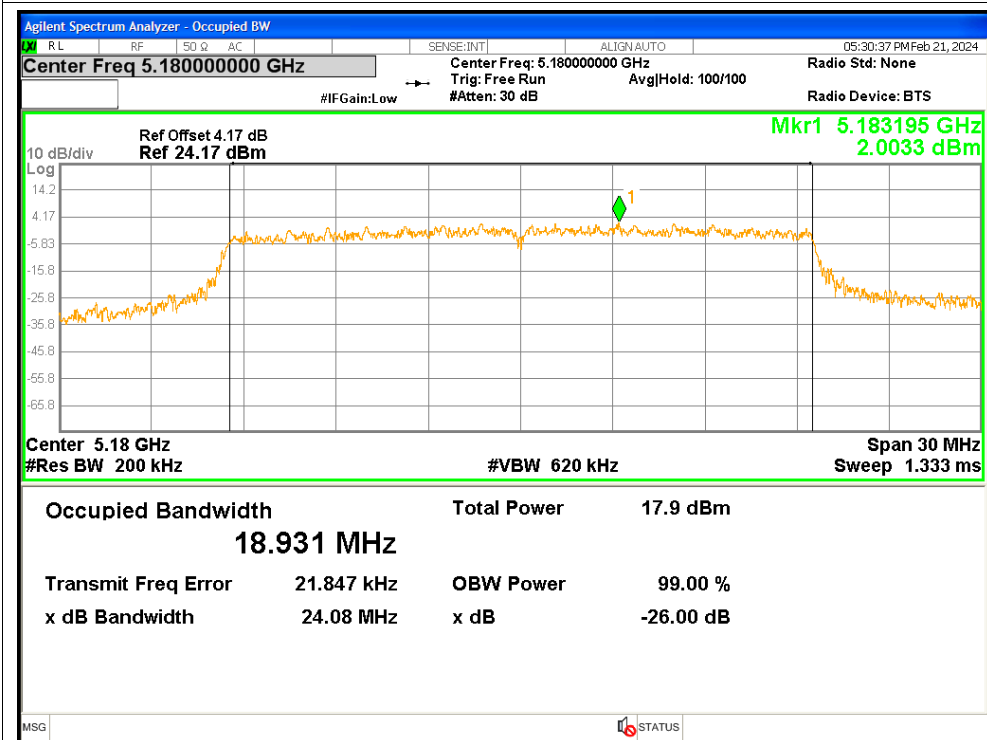


OBW NVNT ax20 5180MHz Ant3

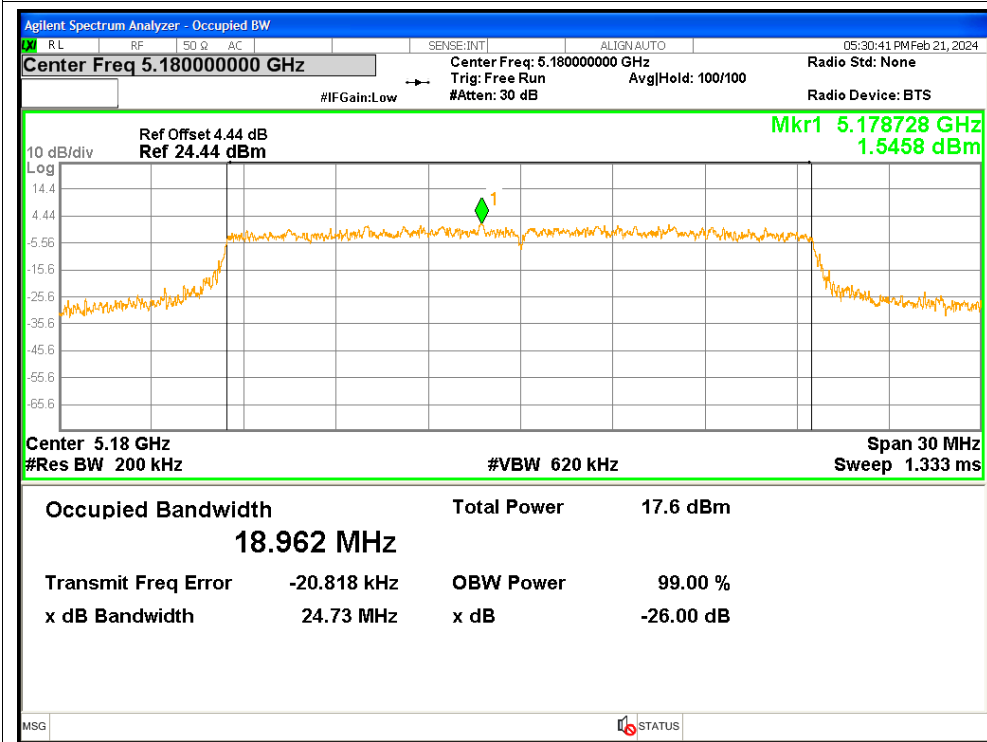


OBW NVNT ax20 5200MHz Ant1

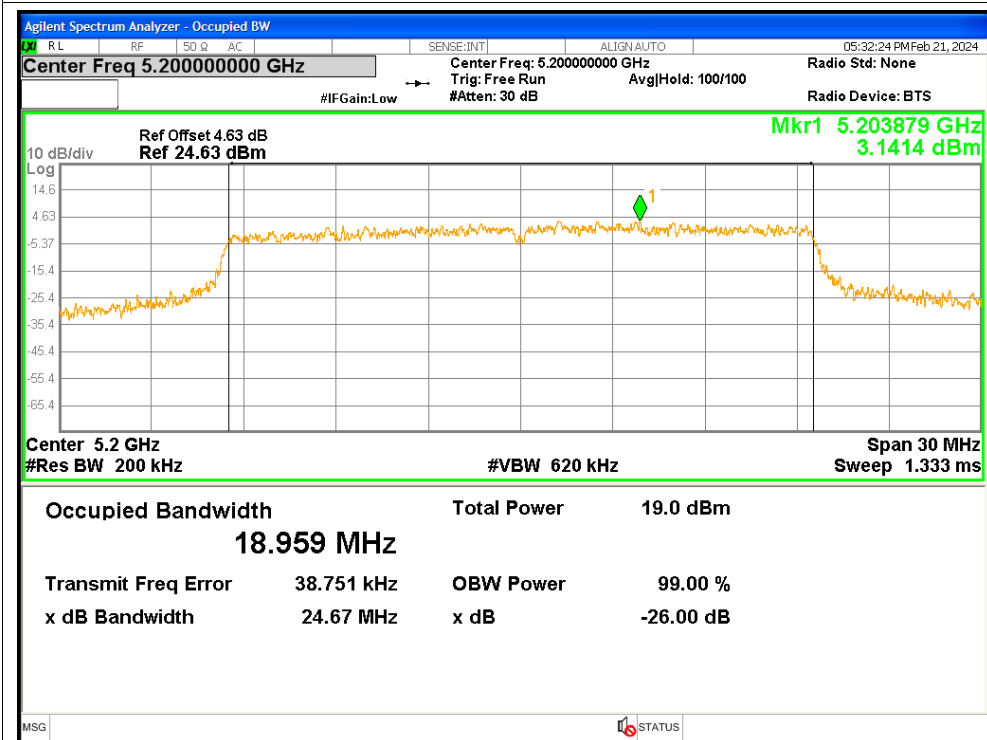


OBW NVNT ax20 5200MHz Ant2

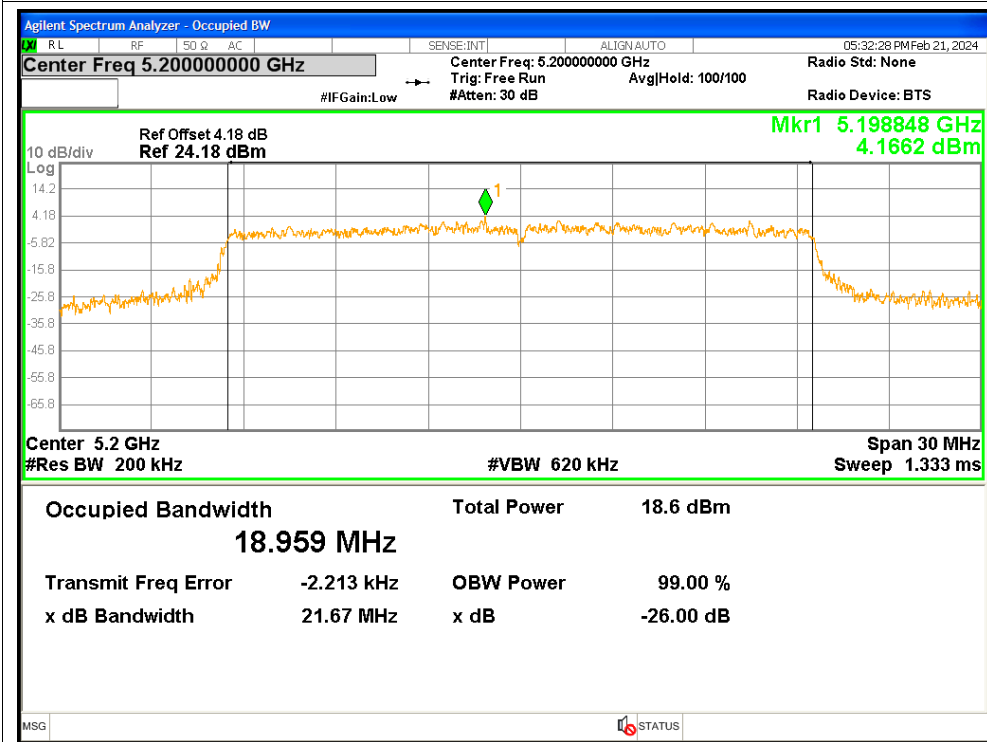


OBW NVNT ax20 5200MHz Ant3

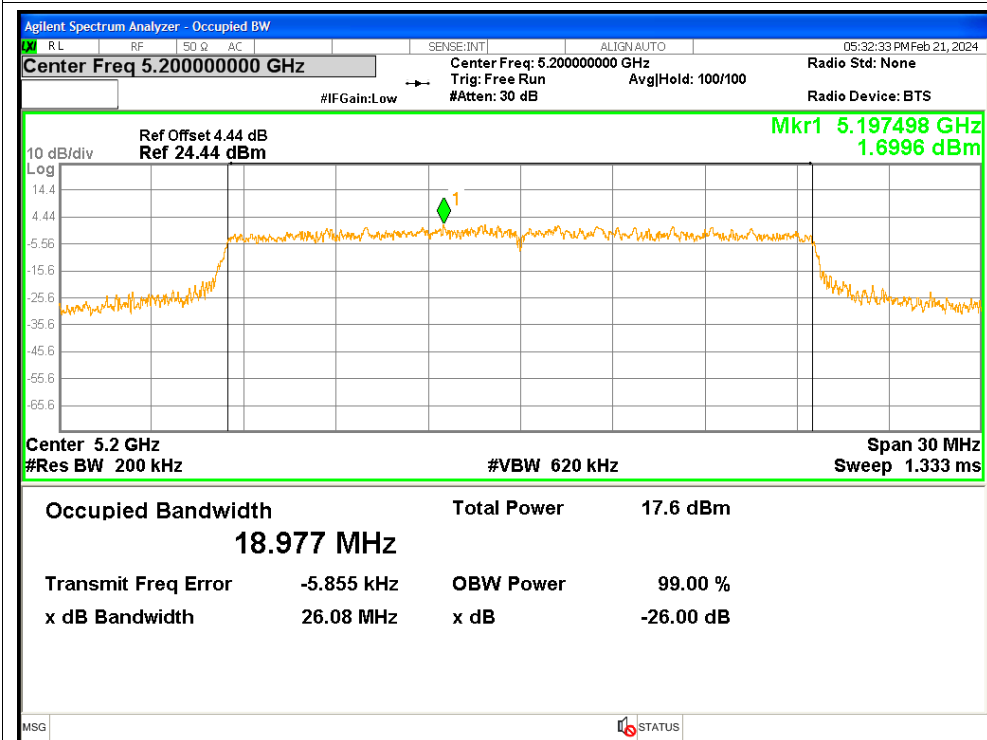


OBW NVNT ax20 5240MHz Ant1

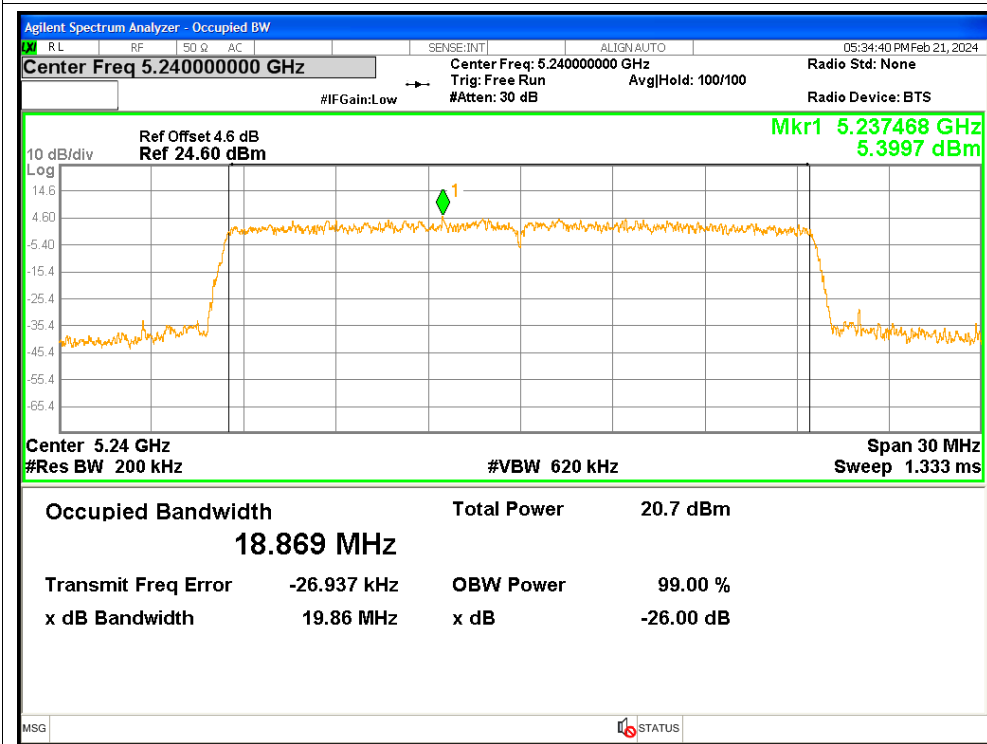


OBW NVNT ax20 5240MHz Ant2

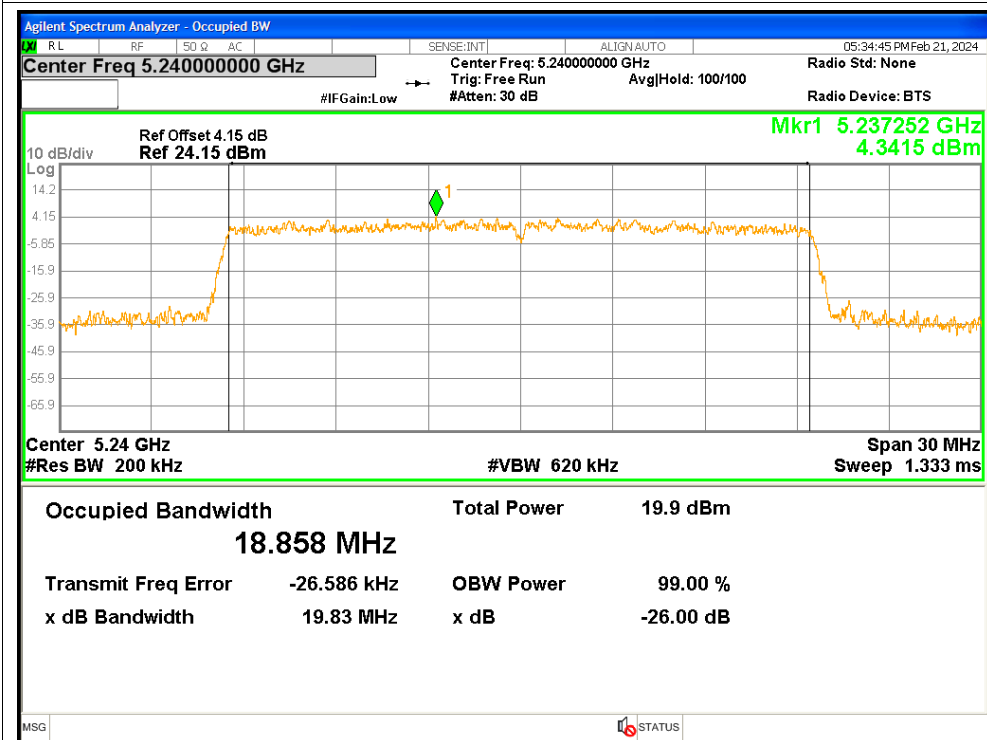


OBW NVNT ax20 5240MHz Ant3

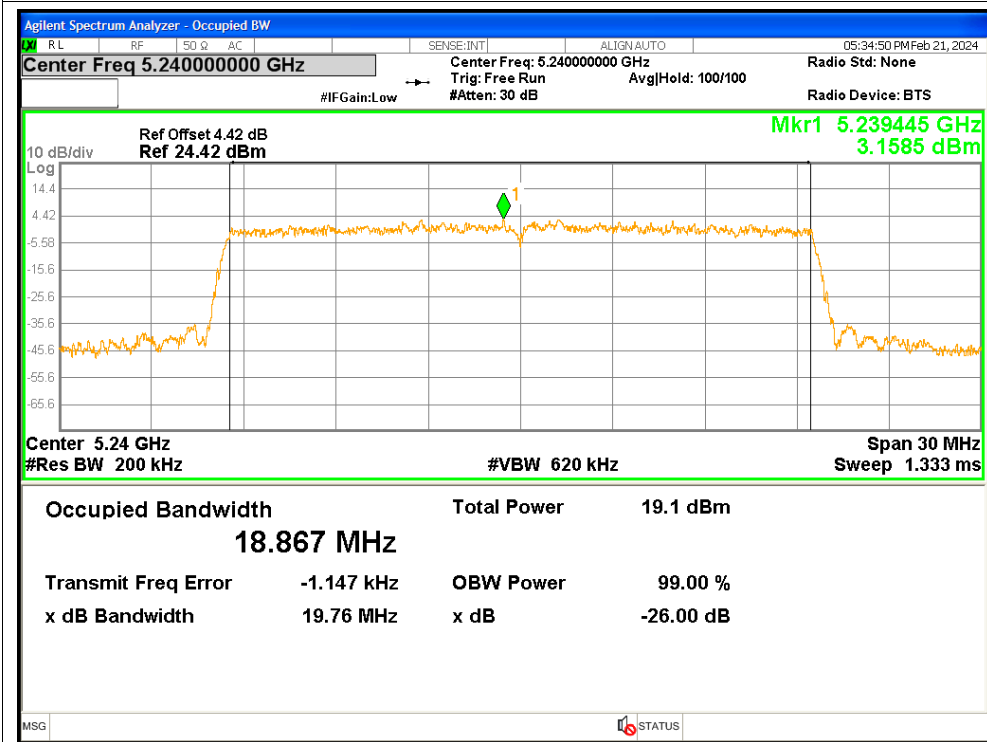


OBW NVNT ax40 5190MHz Ant1

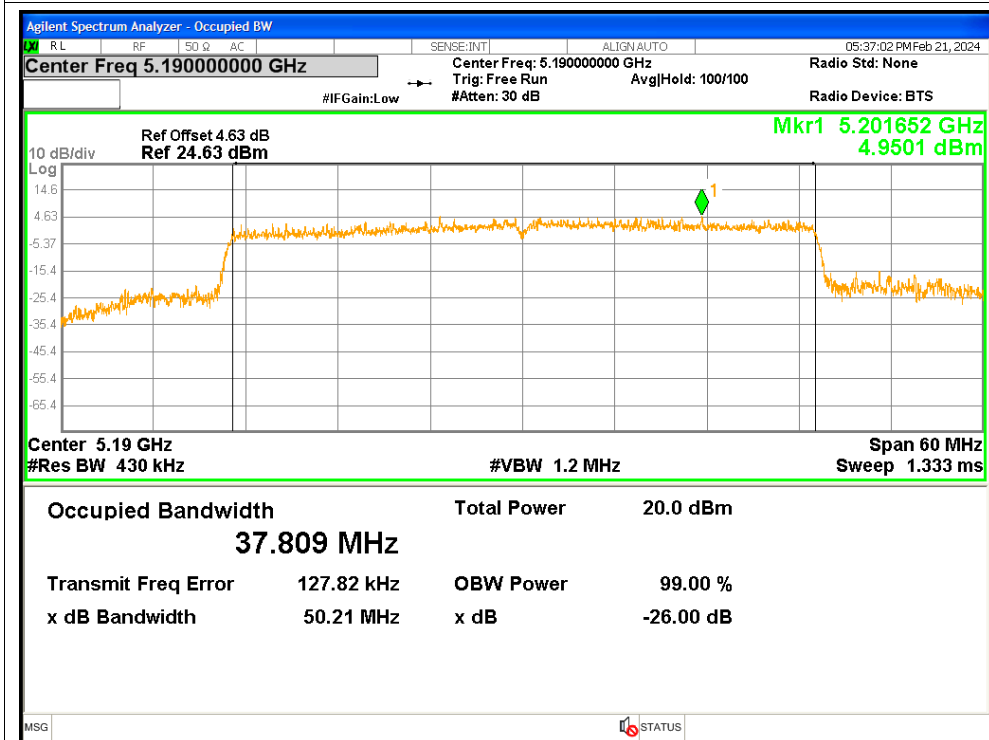


OBW NVNT ax40 5190MHz Ant2

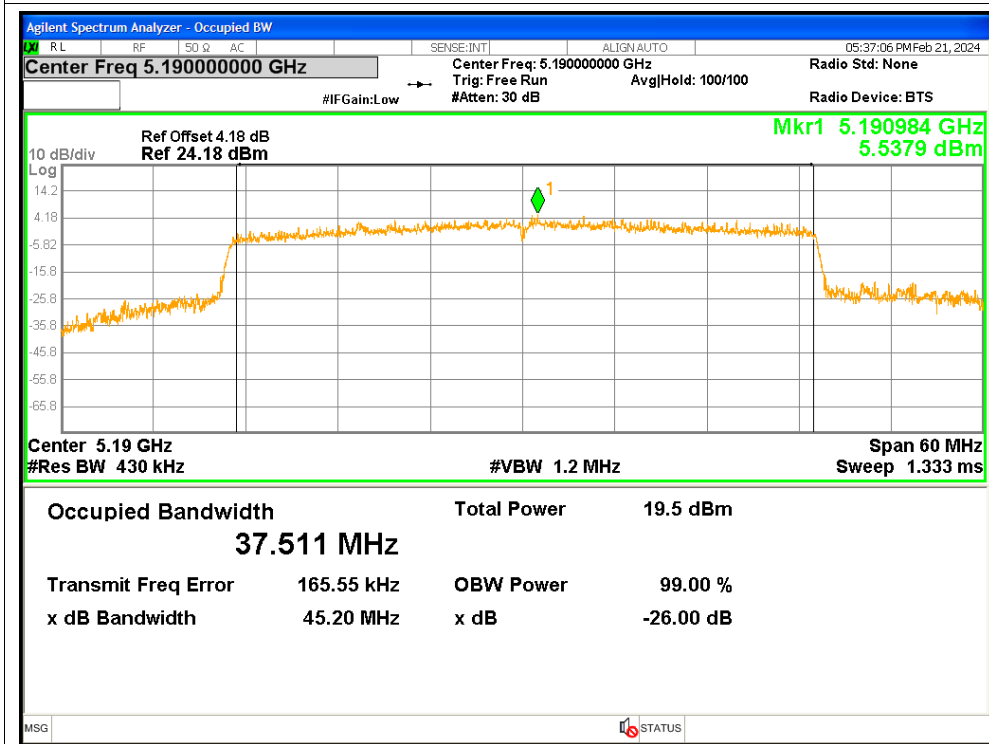


OBW NVNT ax40 5190MHz Ant3

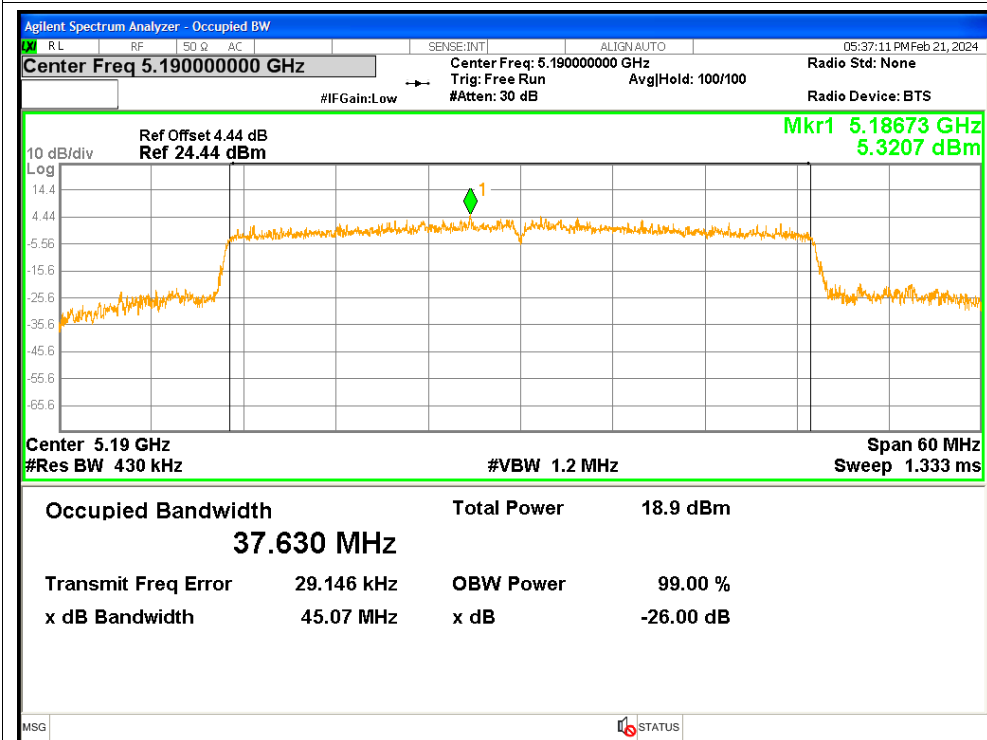


OBW NVNT ax40 5230MHz Ant1

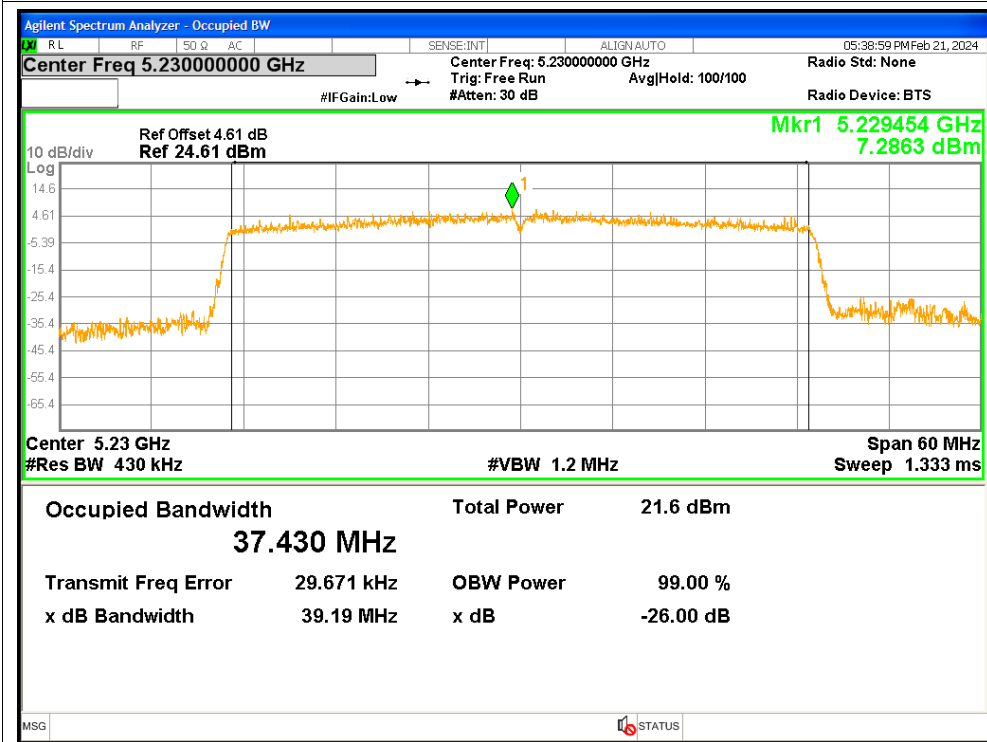


OBW NVNT ax40 5230MHz Ant2

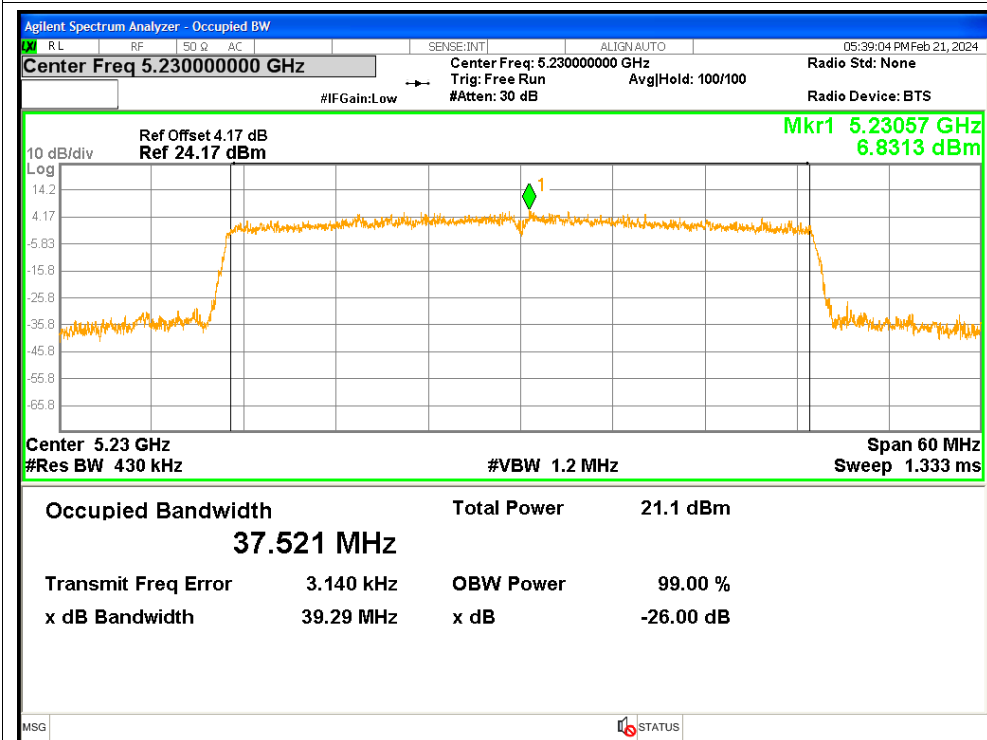


OBW NVNT ax40 5230MHz Ant3

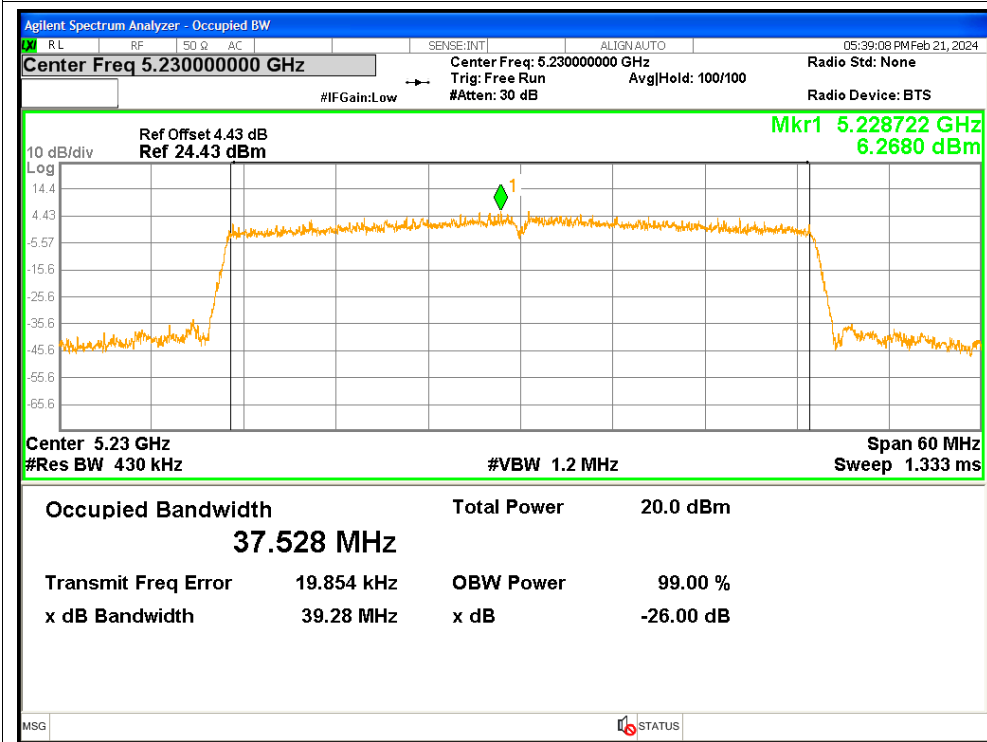


OBW NVNT ax80 5210MHz Ant1

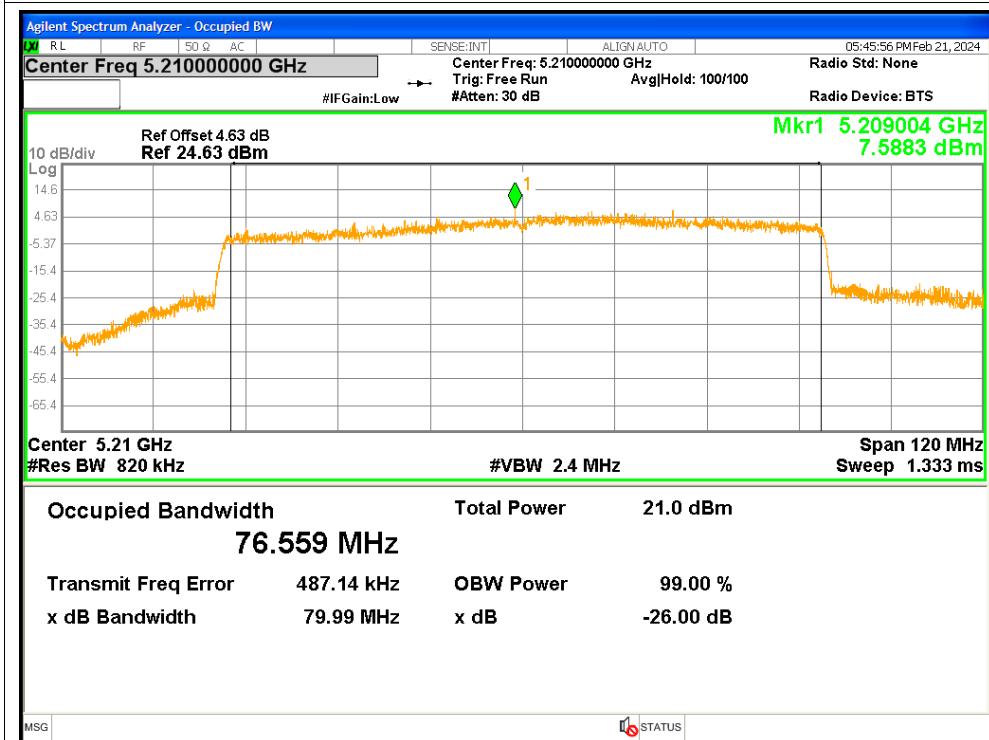


OBW NVNT ax80 5210MHz Ant2

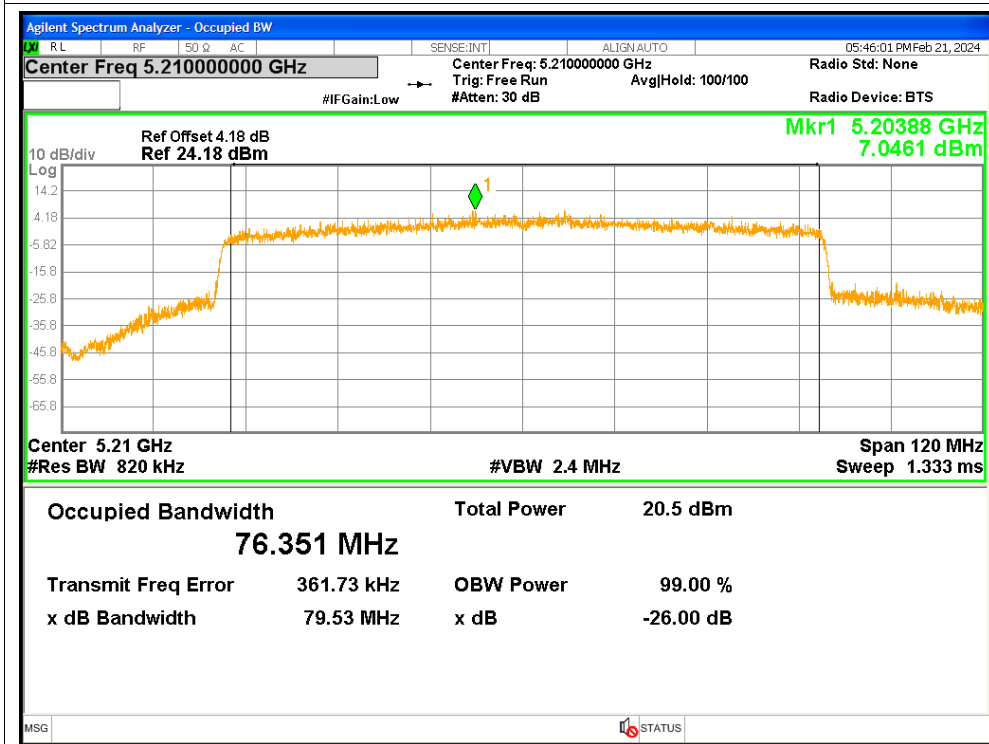


OBW NVNT ax80 5210MHz Ant3

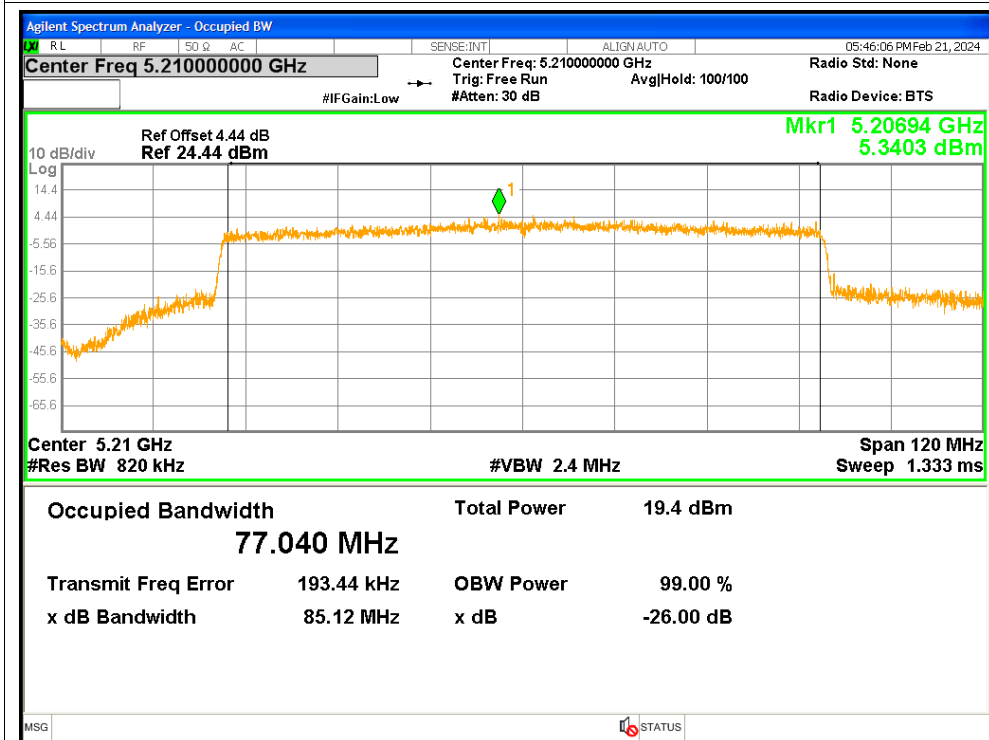


OBW NVNT n20 5180MHz Ant1

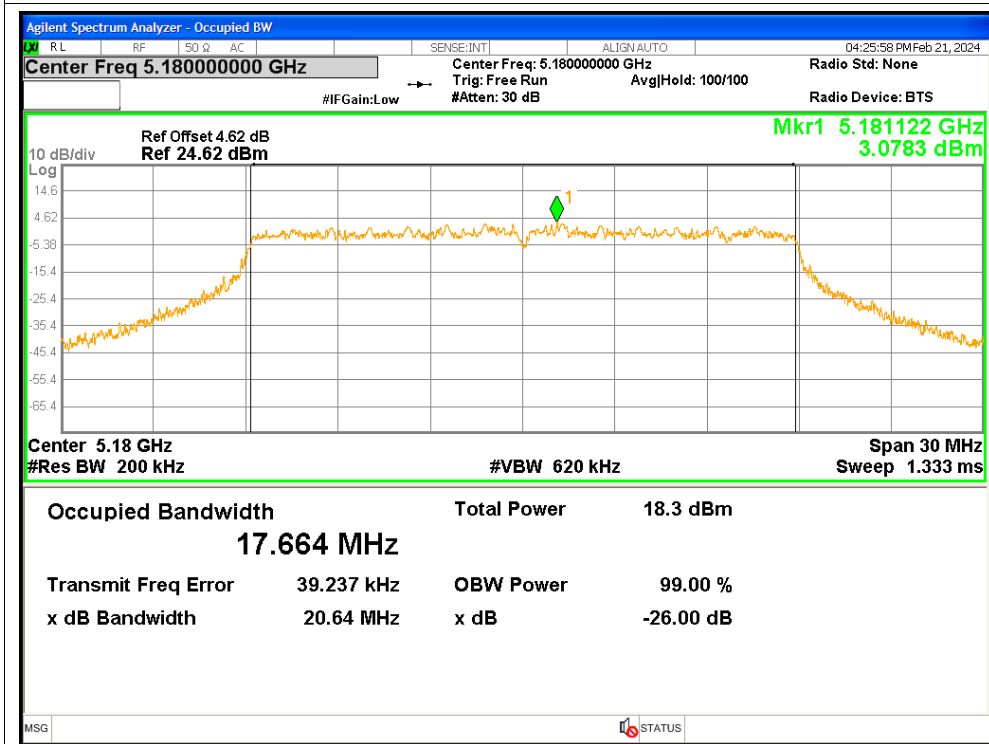


OBW NVNT n20 5180MHz Ant2

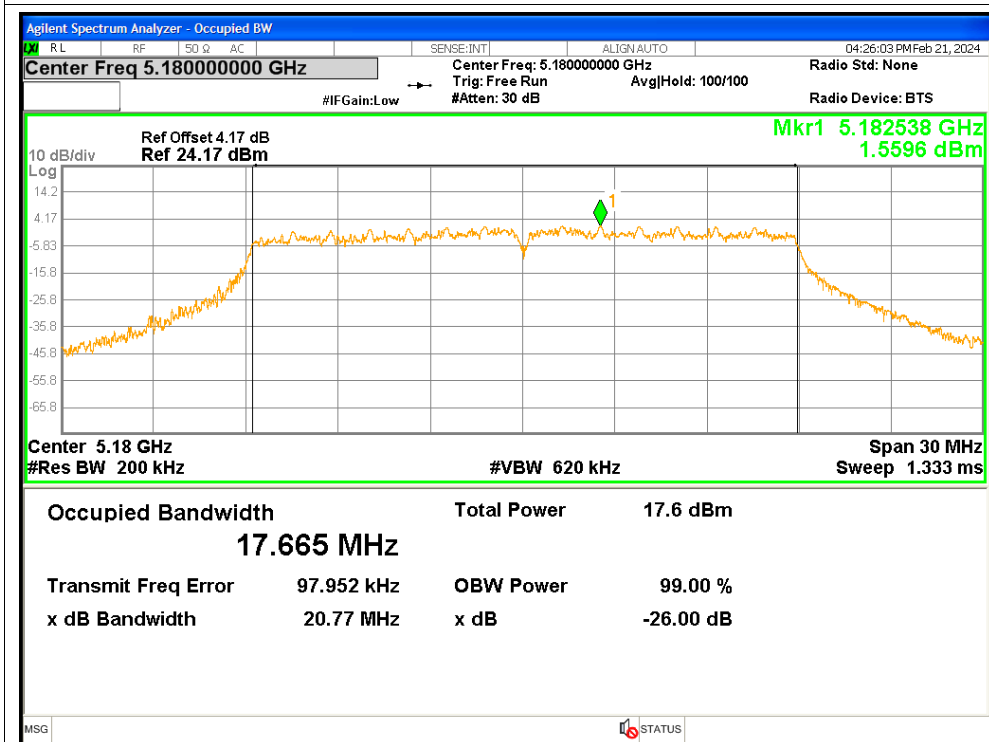


OBW NVNT n20 5180MHz Ant3

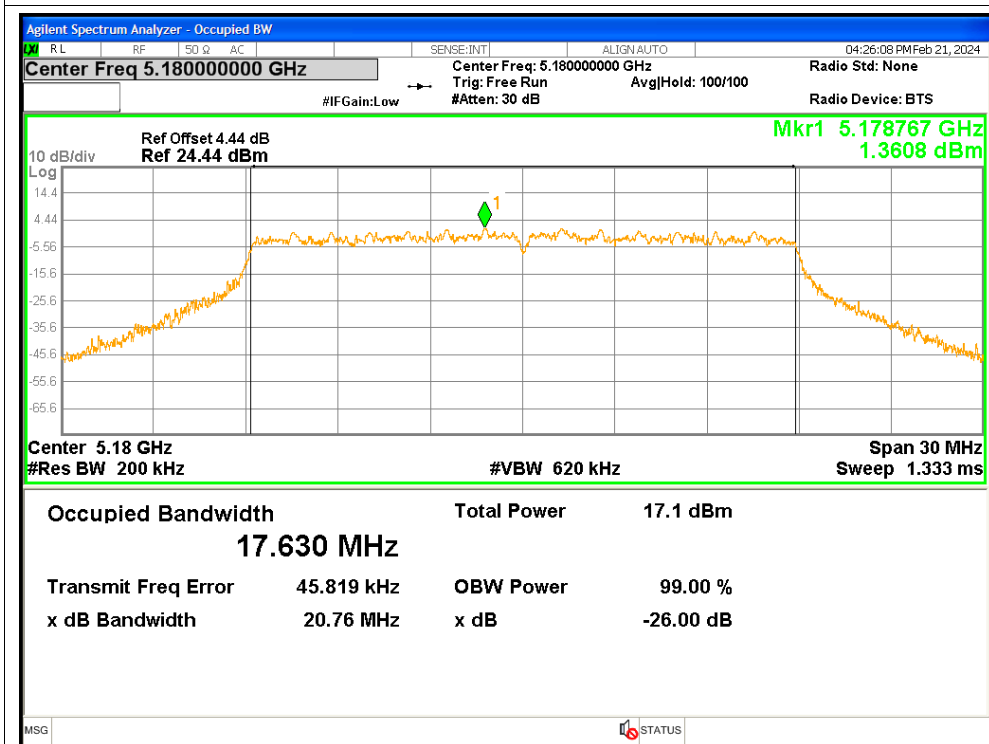


OBW NVNT n20 5200MHz Ant1

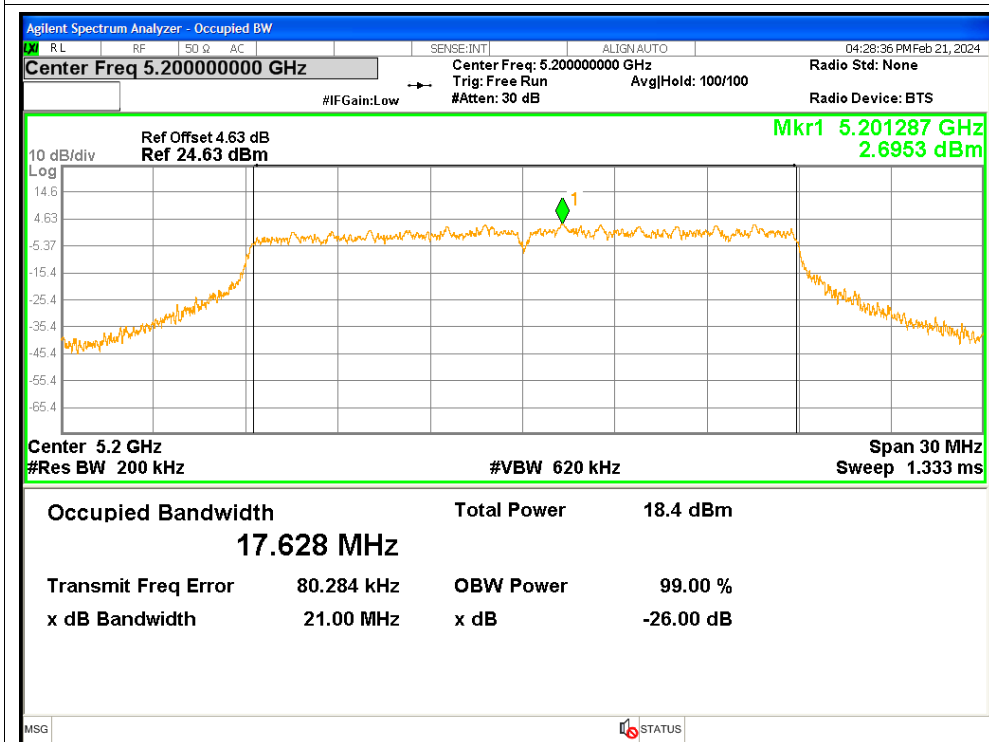


OBW NVNT n20 5200MHz Ant2

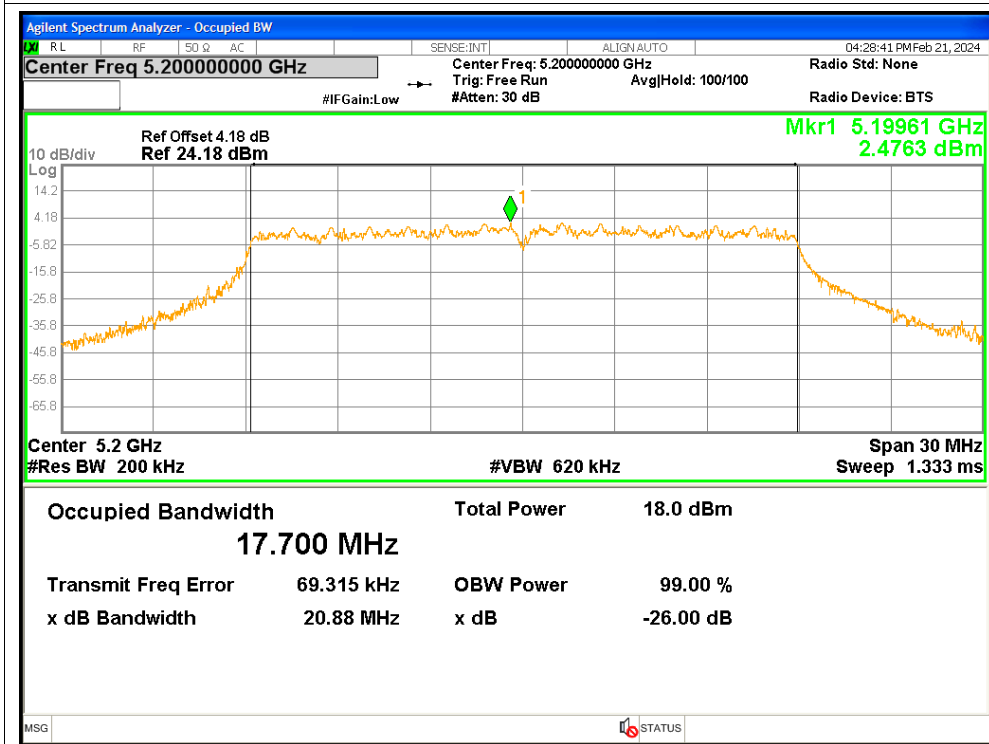


OBW NVNT n20 5200MHz Ant3

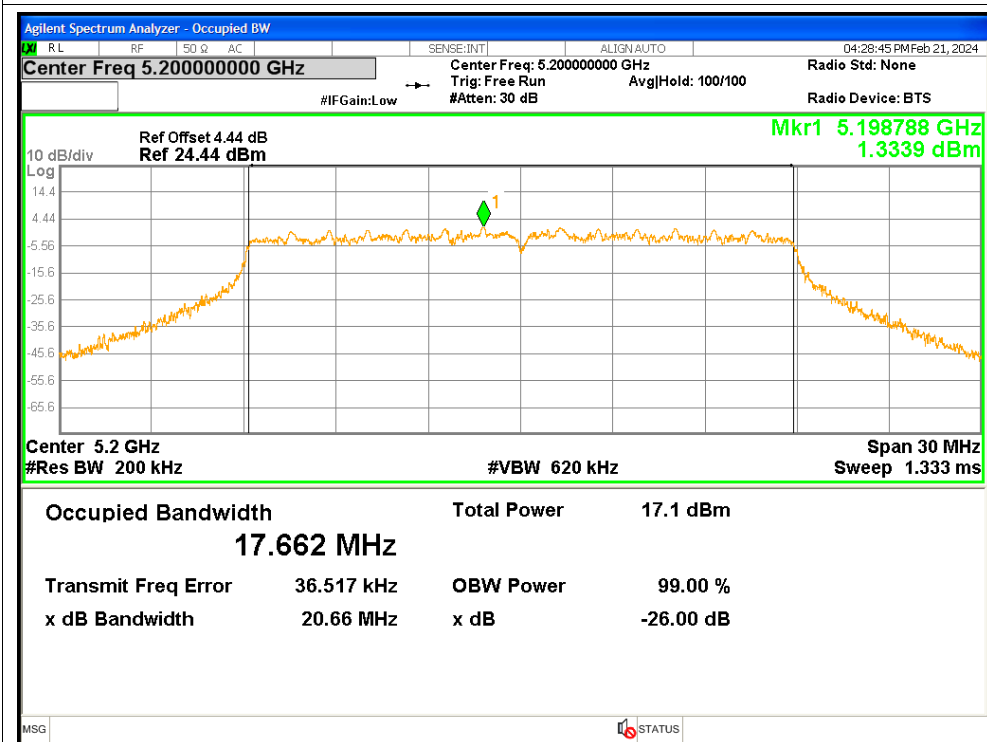


OBW NVNT n20 5240MHz Ant1

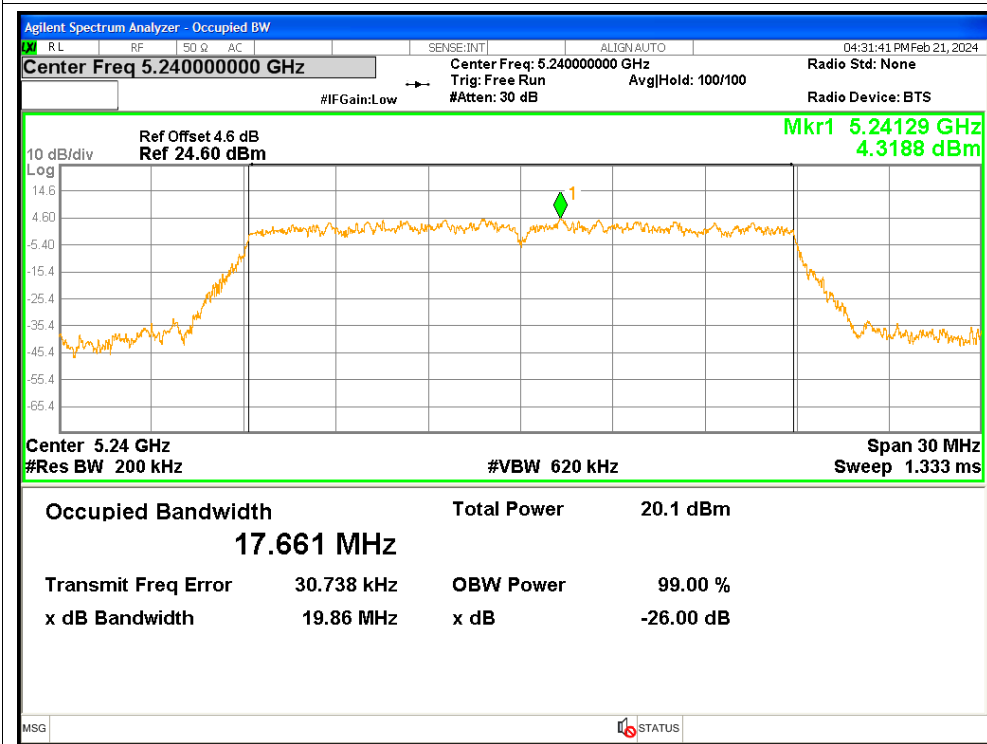


OBW NVNT n20 5240MHz Ant2

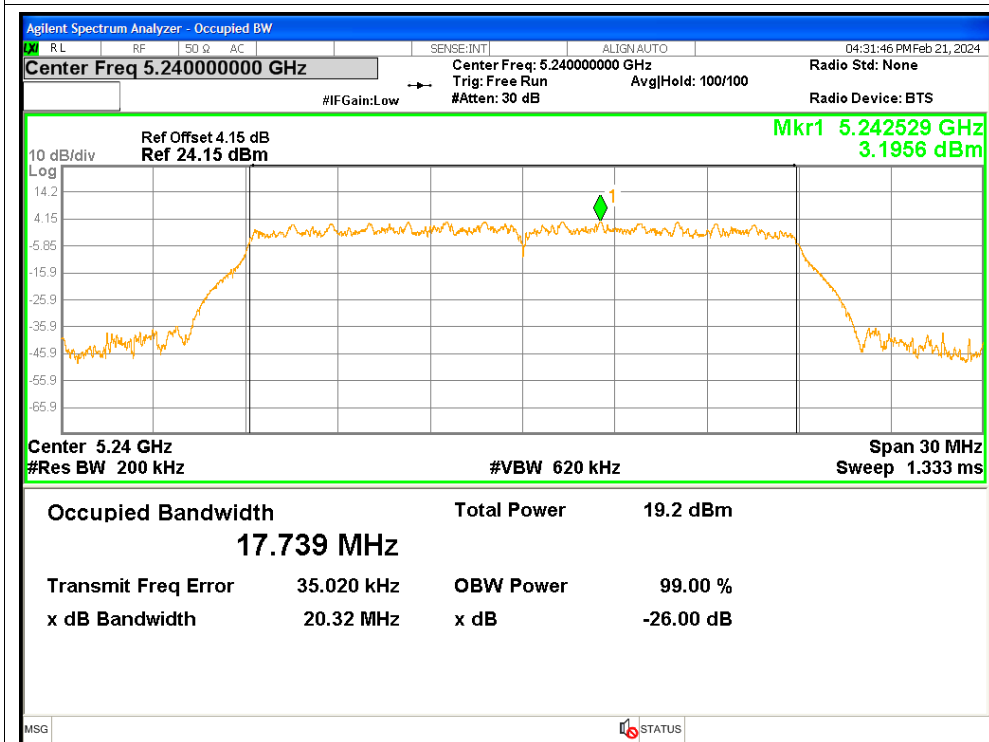


OBW NVNT n20 5240MHz Ant3

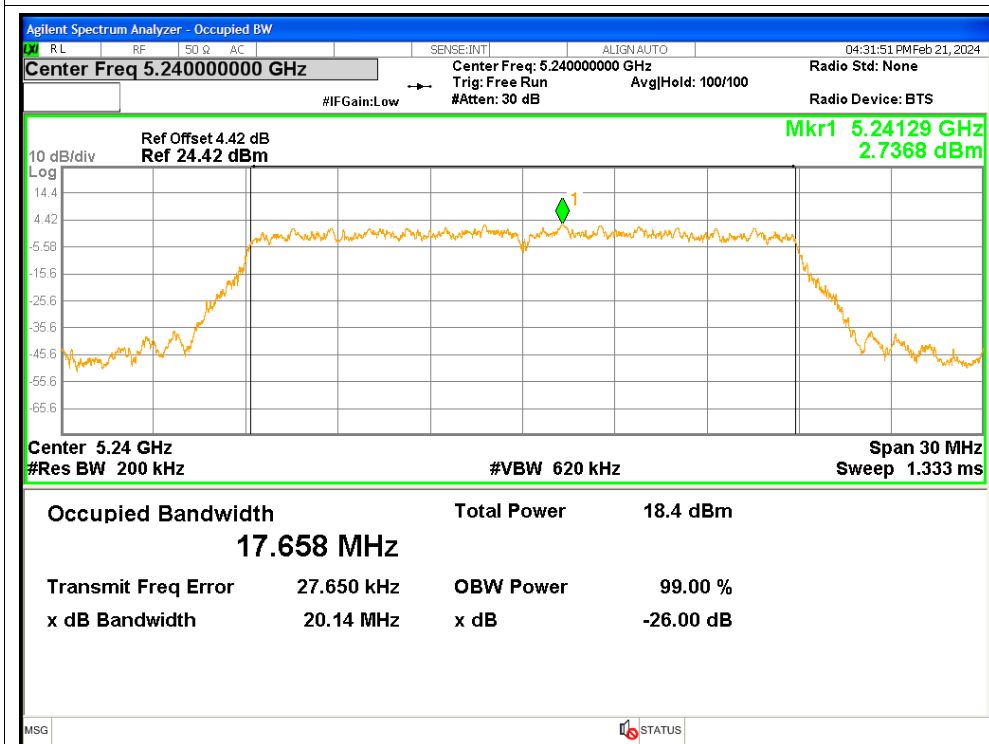


OBW NVNT n40 5190MHz Ant1

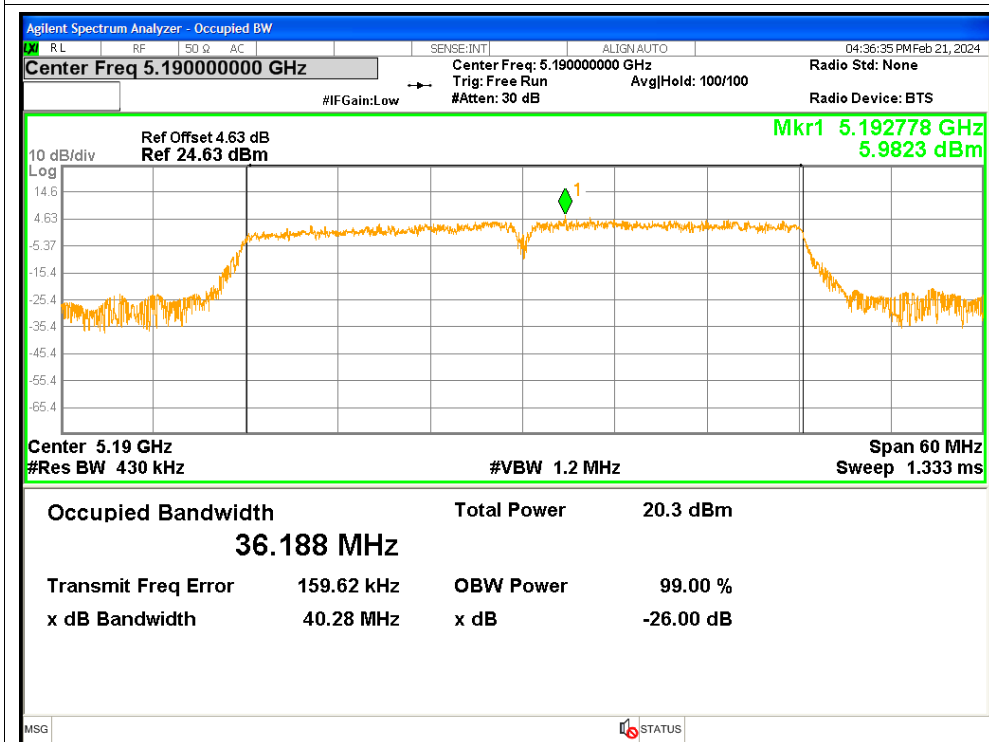


OBW NVNT n40 5190MHz Ant2

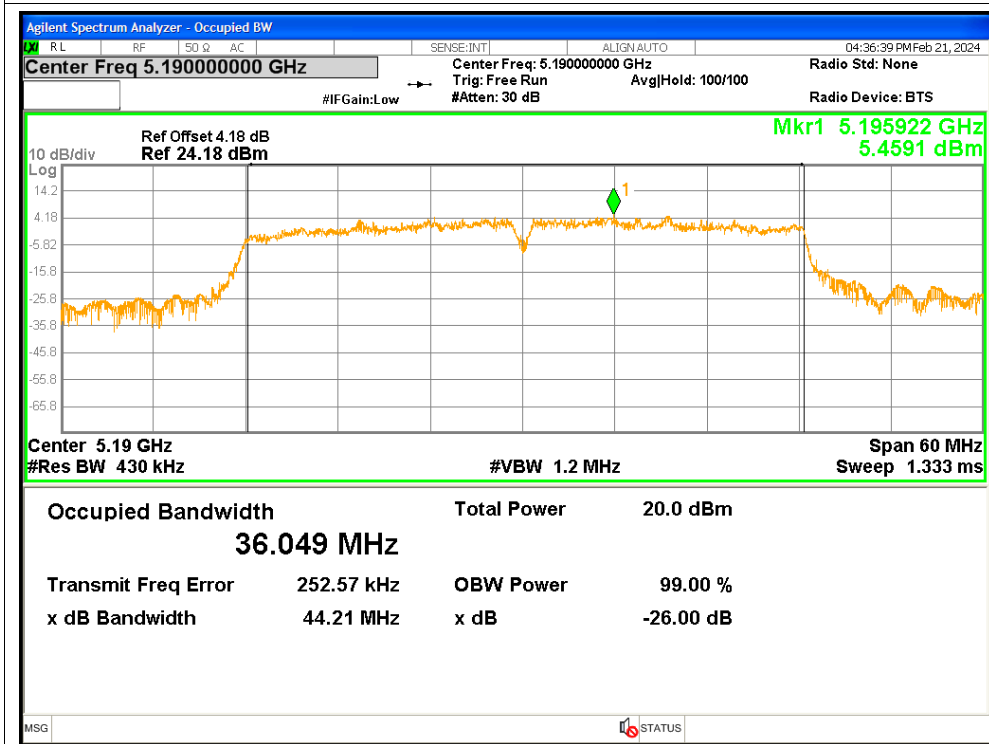


OBW NVNT n40 5190MHz Ant3

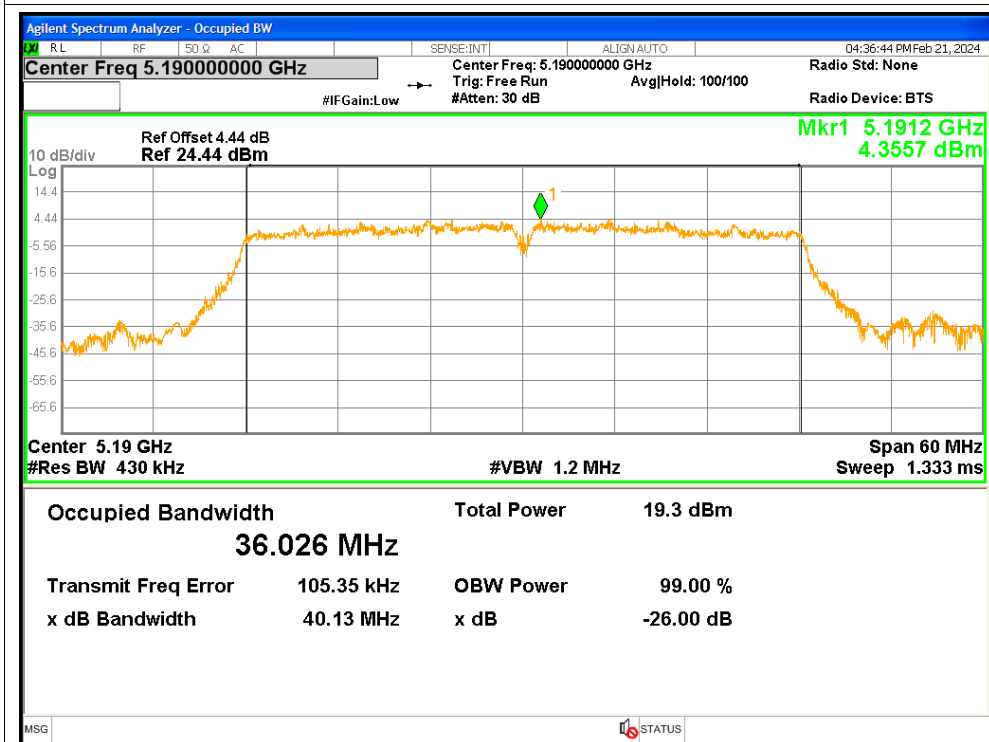


OBW NVNT n40 5230MHz Ant1

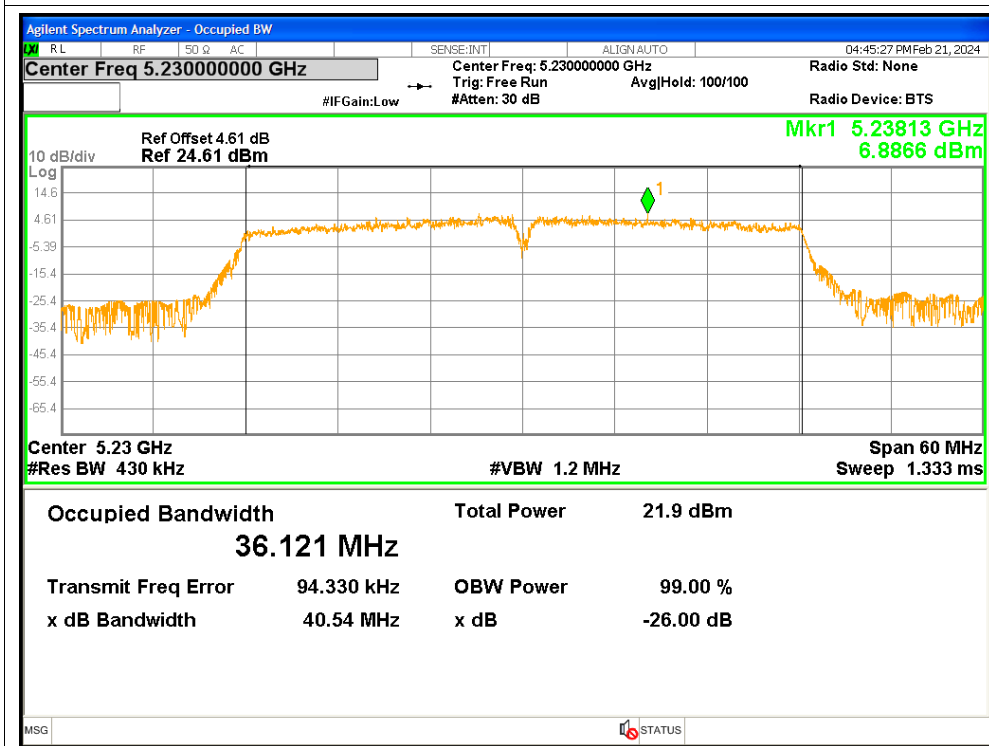

OBW NVNT n40 5230MHz Ant2

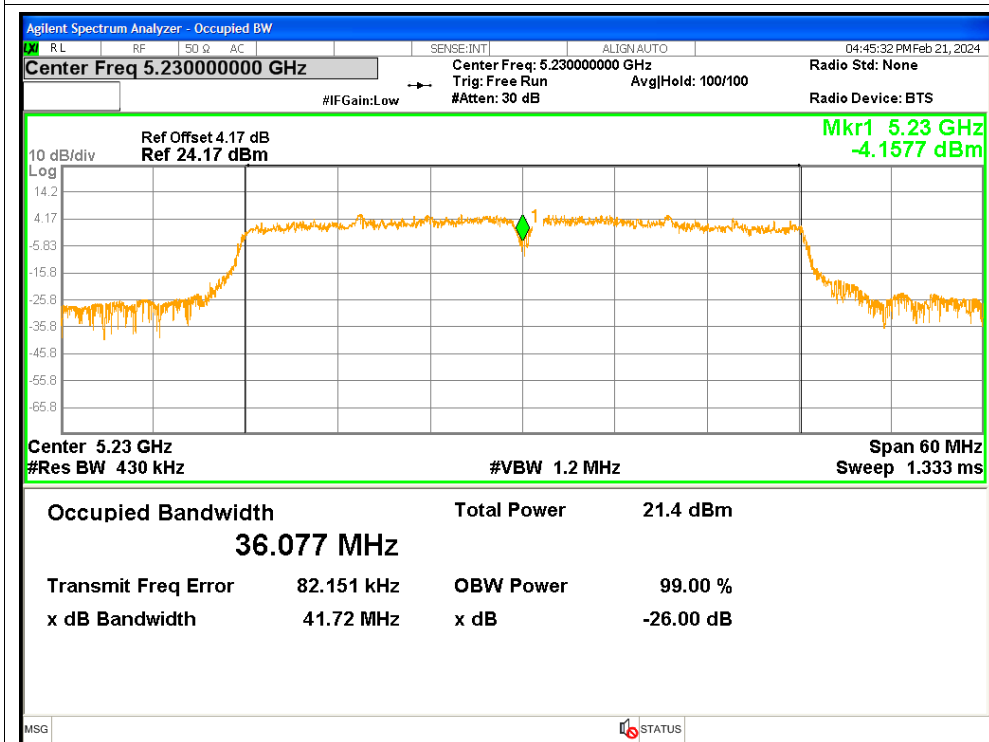

OBW NVNT n40 5230MHz Ant3

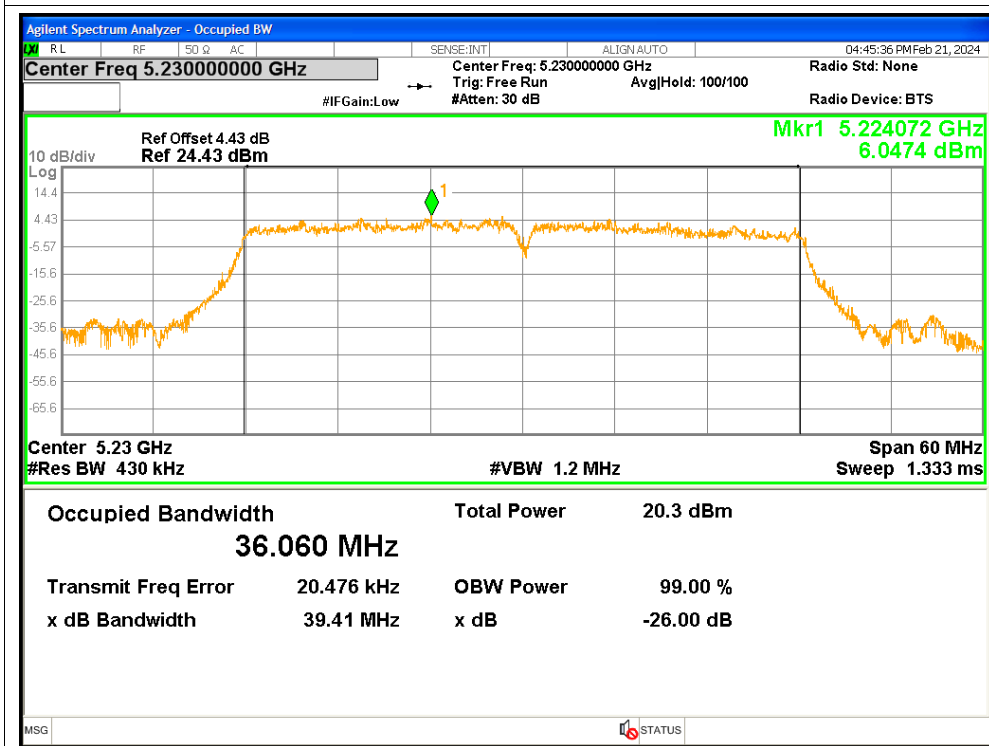

5. Maximum Power Spectral Density Level


Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	4.555	0.17	4.725	<=11	Pass
NVNT	a	5200	Ant1	4.629	0.17	4.799	<=11	Pass
NVNT	a	5240	Ant1	6.688	0.17	6.858	<=11	Pass
NVNT	a	5180	Ant2	3.844	0.17	4.014	<=11	Pass
NVNT	a	5200	Ant2	4.409	0.17	4.579	<=11	Pass
NVNT	a	5240	Ant2	5.953	0.17	6.123	<=11	Pass
NVNT	a	5180	Ant3	3.541	0.17	3.711	<=11	Pass
NVNT	a	5200	Ant3	3.333	0.17	3.503	<=11	Pass
NVNT	a	5240	Ant3	4.937	0.17	5.107	<=11	Pass
NVNT	ac160	5250	Ant1	-4.29	1.72	-2.57	<=11	Pass
NVNT	ac160	5250	Ant2	-6.175	1.72	-4.455	<=11	Pass
NVNT	ac160	5250	Ant3	-7.371	1.72	-5.651	<=11	Pass
NVNT	ac160	5250	Sum	-0.986	1.72	0.734	<=9.38	Pass
NVNT	ac20	5180	Ant1	1.304	0.48	1.784	<=11	Pass
NVNT	ac20	5180	Ant2	0.176	0.48	0.656	<=11	Pass
NVNT	ac20	5180	Ant3	-1.797	0.48	-1.317	<=11	Pass
NVNT	ac20	5180	Sum	4.847	0.48	5.327	<=9.38	Pass
NVNT	ac20	5200	Ant1	1.608	0.48	2.088	<=11	Pass
NVNT	ac20	5200	Ant2	0.861	0.48	1.341	<=11	Pass
NVNT	ac20	5200	Ant3	-1.786	0.48	-1.306	<=11	Pass
NVNT	ac20	5200	Sum	5.225	0.48	5.705	<=9.38	Pass
NVNT	ac20	5240	Ant1	2.873	0.48	3.353	<=11	Pass
NVNT	ac20	5240	Ant2	1.892	0.48	2.372	<=11	Pass
NVNT	ac20	5240	Ant3	-0.196	0.48	0.284	<=11	Pass
NVNT	ac20	5240	Sum	6.473	0.48	6.953	<=9.38	Pass
NVNT	ac40	5190	Ant1	-0.21	0.84	0.63	<=11	Pass
NVNT	ac40	5190	Ant2	-0.417	0.84	0.423	<=11	Pass
NVNT	ac40	5190	Ant3	-1.436	0.84	-0.596	<=11	Pass
NVNT	ac40	5190	Sum	4.116	0.84	4.956	<=9.38	Pass
NVNT	ac40	5230	Ant1	1.519	0.84	2.359	<=11	Pass
NVNT	ac40	5230	Ant2	1.215	0.84	2.055	<=11	Pass
NVNT	ac40	5230	Ant3	0.486	0.84	1.326	<=11	Pass
NVNT	ac40	5230	Sum	5.866	0.84	6.706	<=9.38	Pass
NVNT	ac80	5210	Ant1	-2.13	1.38	-0.75	<=11	Pass
NVNT	ac80	5210	Ant2	-2.748	1.38	-1.368	<=11	Pass
NVNT	ac80	5210	Ant3	-4.463	1.38	-3.083	<=11	Pass
NVNT	ac80	5210	Sum	1.765	1.38	3.145	<=9.38	Pass
NVNT	ax160	5250	Ant1	3.067	1.25	4.317	<=11	Pass
NVNT	ax160	5250	Ant2	-5.477	1.25	-4.227	<=11	Pass

NVNT	ax160	5250	Ant3	-6.73	1.25	-5.48	<=11	Pass
NVNT	ax160	5250	Sum	4.017	1.25	5.267	<=9.38	Pass
NVNT	ax20	5180	Ant1	0.94	0.53	1.47	<=11	Pass
NVNT	ax20	5180	Ant2	0.21	0.53	0.74	<=11	Pass
NVNT	ax20	5180	Ant3	-1.652	0.53	-1.122	<=11	Pass
NVNT	ax20	5180	Sum	4.735	0.53	5.265	<=9.38	Pass
NVNT	ax20	5200	Ant1	1.368	0.53	1.898	<=11	Pass
NVNT	ax20	5200	Ant2	0.884	0.53	1.414	<=11	Pass
NVNT	ax20	5200	Ant3	-1.952	0.53	-1.422	<=11	Pass
NVNT	ax20	5200	Sum	5.097	0.53	5.627	<=9.38	Pass
NVNT	ax20	5240	Ant1	2.624	0.53	3.154	<=11	Pass
NVNT	ax20	5240	Ant2	2.06	0.53	2.59	<=11	Pass
NVNT	ax20	5240	Ant3	-0.17	0.53	0.36	<=11	Pass
NVNT	ax20	5240	Sum	6.433	0.53	6.963	<=9.38	Pass
NVNT	ax40	5190	Ant1	0.031	0.81	0.841	<=11	Pass
NVNT	ax40	5190	Ant2	-0.136	0.81	0.674	<=11	Pass
NVNT	ax40	5190	Ant3	-1.146	0.81	-0.336	<=11	Pass
NVNT	ax40	5190	Sum	4.384	0.81	5.194	<=9.38	Pass
NVNT	ax40	5230	Ant1	1.802	0.82	2.622	<=11	Pass
NVNT	ax40	5230	Ant2	1.237	0.82	2.057	<=11	Pass
NVNT	ax40	5230	Ant3	-0.002	0.82	0.818	<=11	Pass
NVNT	ax40	5230	Sum	5.847	0.82	6.667	<=9.38	Pass
NVNT	ax80	5210	Ant1	-1.64	1.14	-0.5	<=11	Pass
NVNT	ax80	5210	Ant2	-2.201	1.14	-1.061	<=11	Pass
NVNT	ax80	5210	Ant3	-4.105	1.14	-2.965	<=11	Pass
NVNT	ax80	5210	Sum	2.244	1.14	3.384	<=9.38	Pass
NVNT	n20	5180	Ant1	1.356	0.18	1.536	<=11	Pass
NVNT	n20	5180	Ant2	0.222	0.18	0.402	<=11	Pass
NVNT	n20	5180	Ant3	-0.317	0.18	-0.137	<=11	Pass
NVNT	n20	5180	Sum	5.249	0.18	5.429	<=9.38	Pass
NVNT	n20	5200	Ant1	1.141	0.18	1.321	<=11	Pass
NVNT	n20	5200	Ant2	0.944	0.18	1.124	<=11	Pass
NVNT	n20	5200	Ant3	-0.299	0.18	-0.119	<=11	Pass
NVNT	n20	5200	Sum	5.412	0.18	5.592	<=9.38	Pass
NVNT	n20	5240	Ant1	2.641	0.19	2.831	<=11	Pass
NVNT	n20	5240	Ant2	1.8	0.19	1.99	<=11	Pass
NVNT	n20	5240	Ant3	0.974	0.19	1.164	<=11	Pass
NVNT	n20	5240	Sum	6.629	0.19	6.819	<=9.38	Pass
NVNT	n40	5190	Ant1	0.076	0.36	0.436	<=11	Pass
NVNT	n40	5190	Ant2	-0.108	0.36	0.252	<=11	Pass
NVNT	n40	5190	Ant3	-1.037	0.36	-0.677	<=11	Pass
NVNT	n40	5190	Sum	4.442	0.36	4.802	<=9.38	Pass
NVNT	n40	5230	Ant1	2.214	0.36	2.574	<=11	Pass
NVNT	n40	5230	Ant2	1.438	0.36	1.798	<=11	Pass


NVNT	n40	5230	Ant3	0.27	0.36	0.63	<=11	Pass
NVNT	n40	5230	Sum	6.151	0.36	6.511	<=9.38	Pass

Test Graphs


PSD NVNT a 5180MHz Ant1

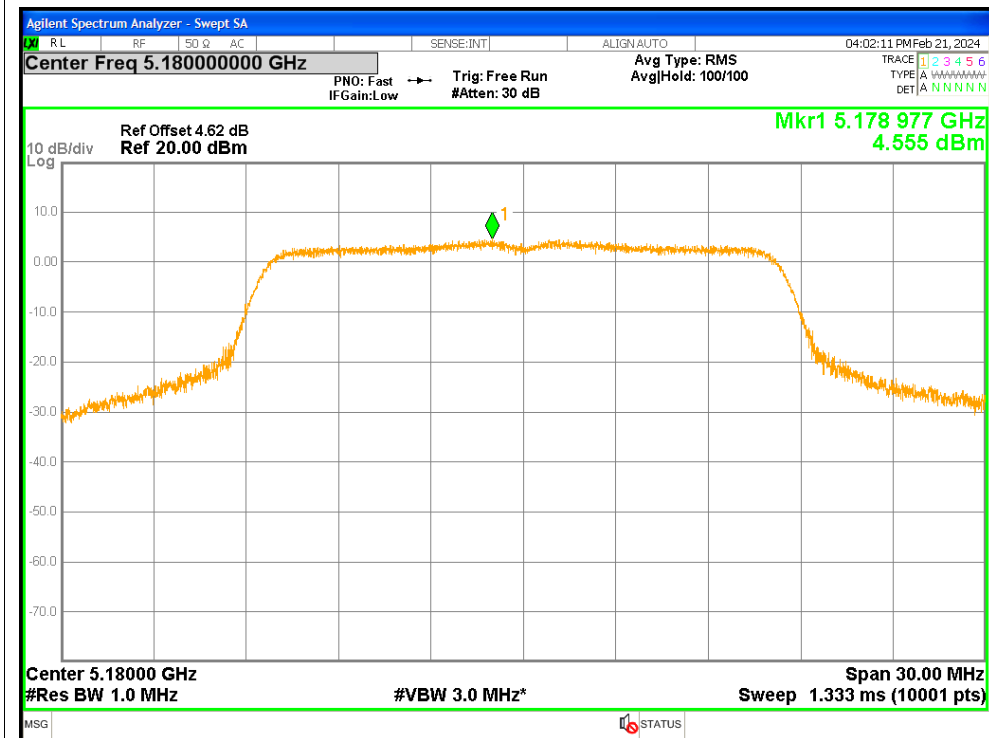


PSD NVNT a 5200MHz Ant1

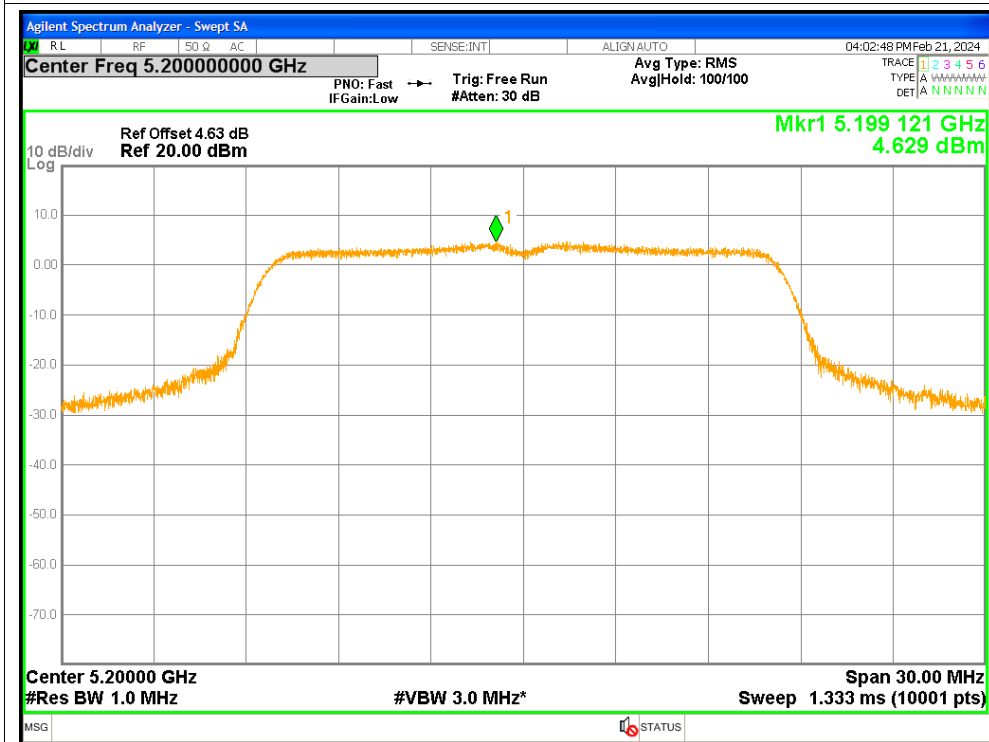


PSD NVNT a 5240MHz Ant1

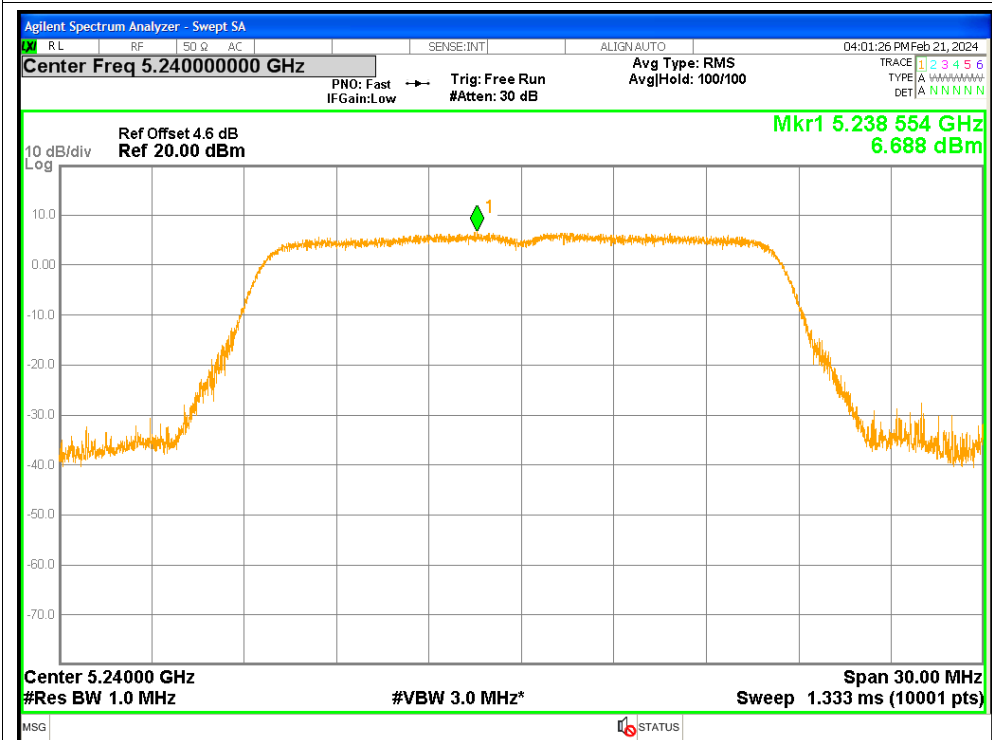


PSD NVNT a 5180MHz Ant2

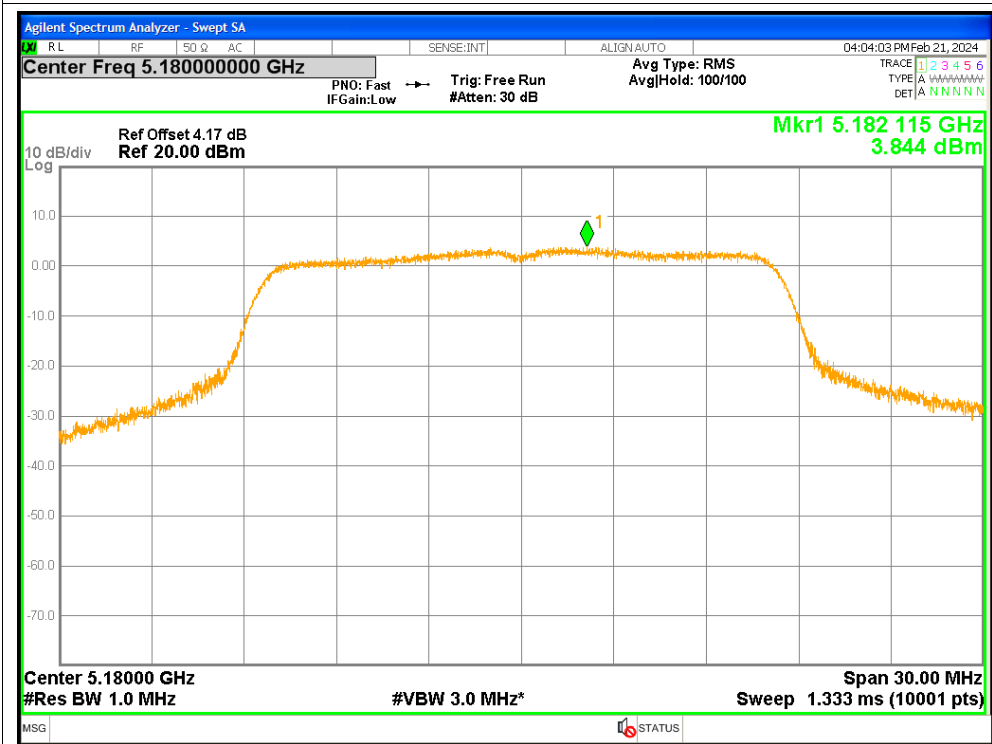


PSD NVNT a 5200MHz Ant2

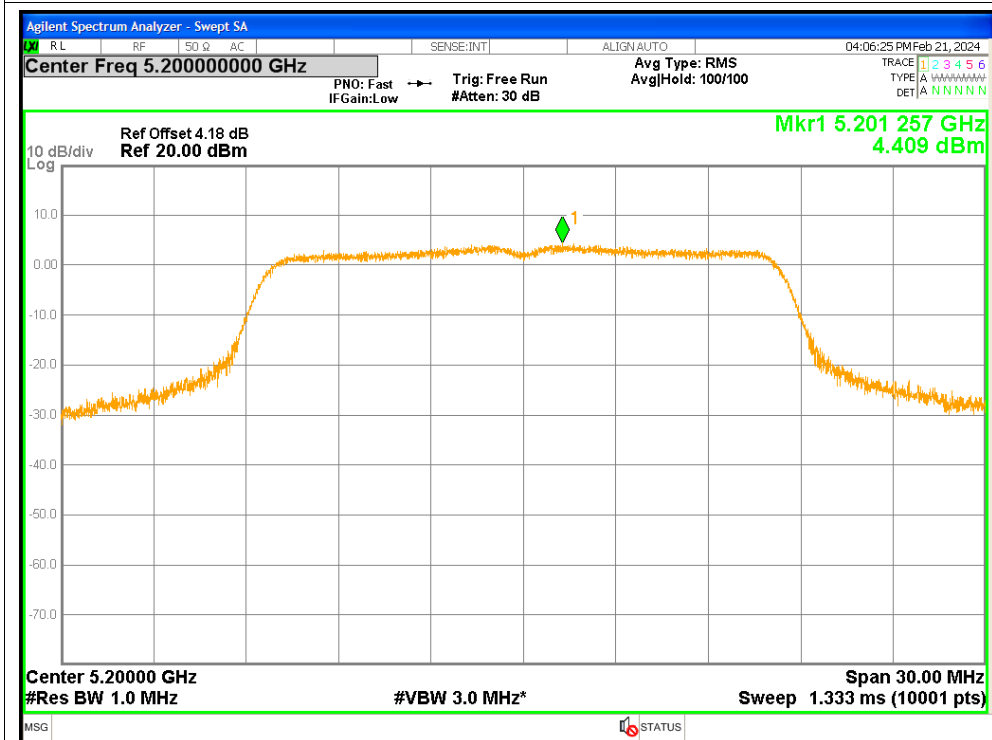


PSD NVNT a 5240MHz Ant2

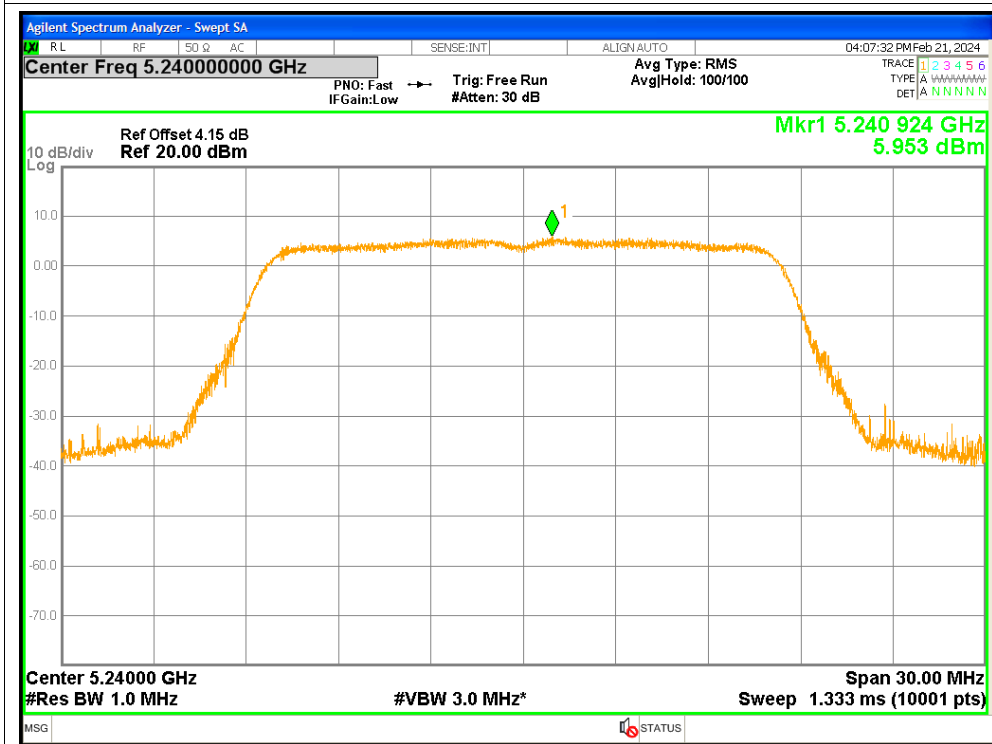


PSD NVNT a 5180MHz Ant3

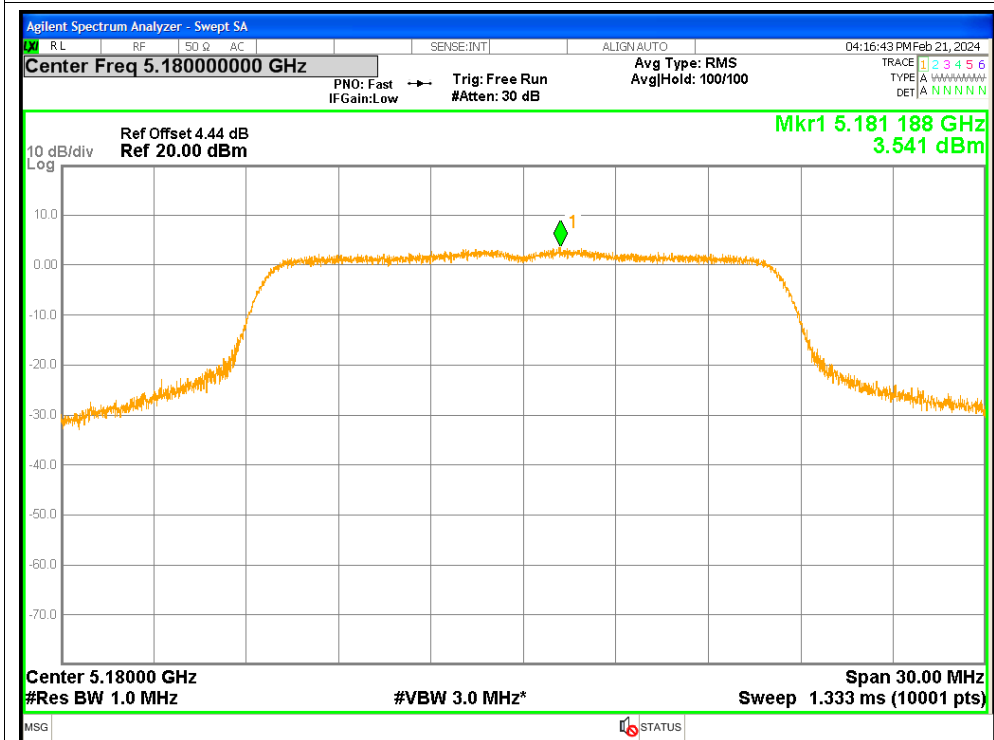


PSD NVNT a 5200MHz Ant3

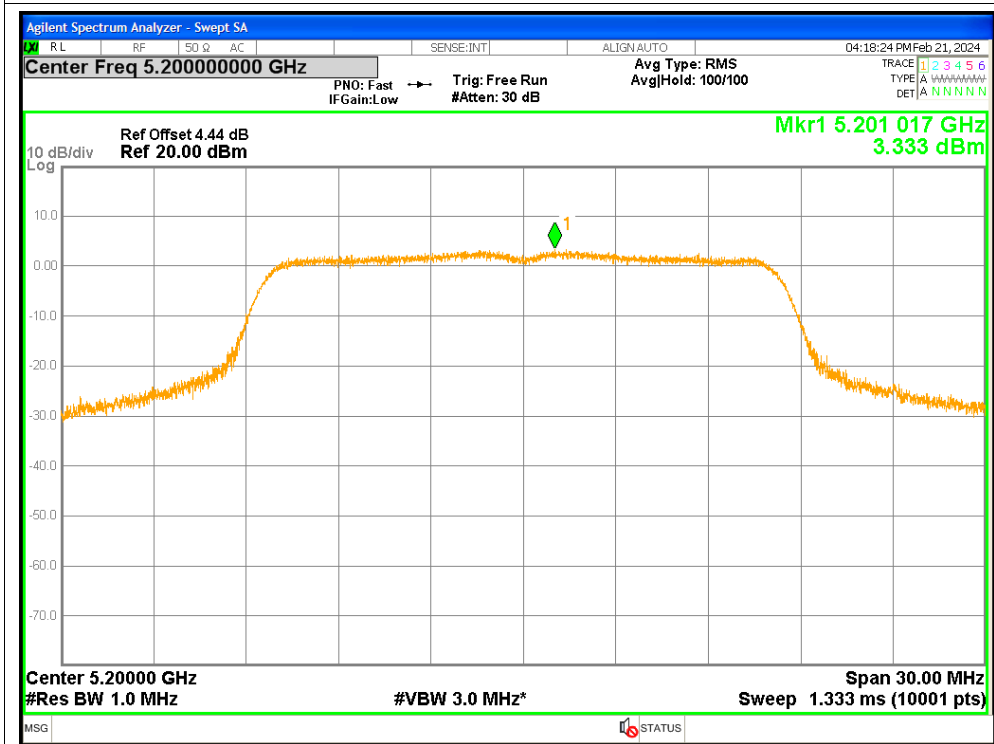


PSD NVNT a 5240MHz Ant3

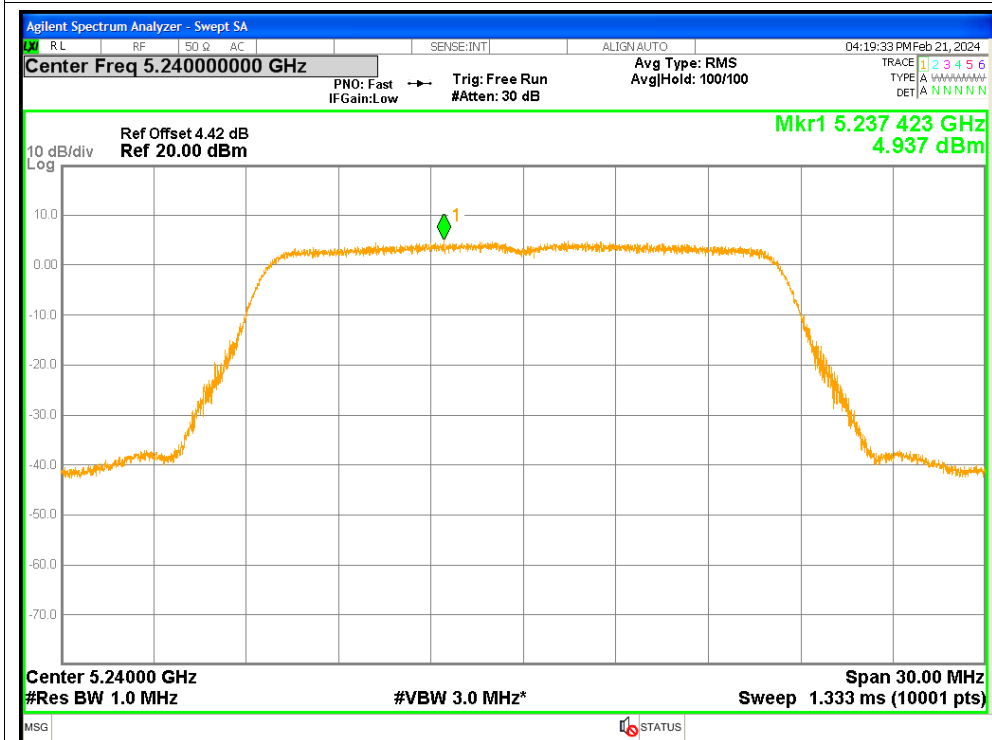


PSD NVNT ac160 5250MHz Ant1


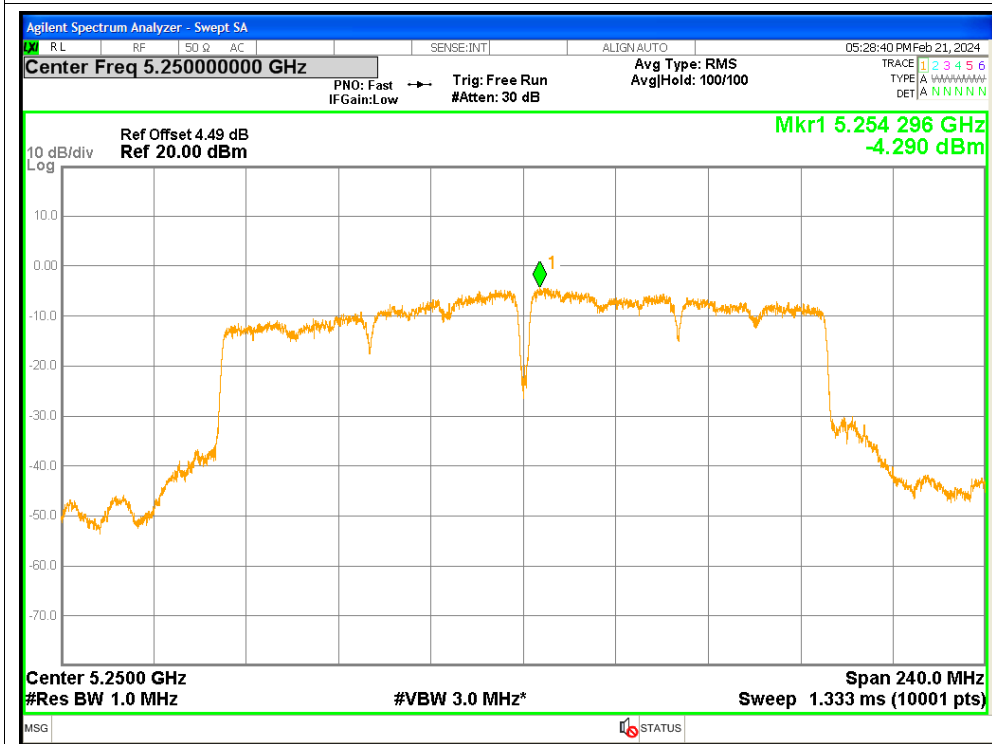


PSD NVNT ac160 5250MHz Ant2

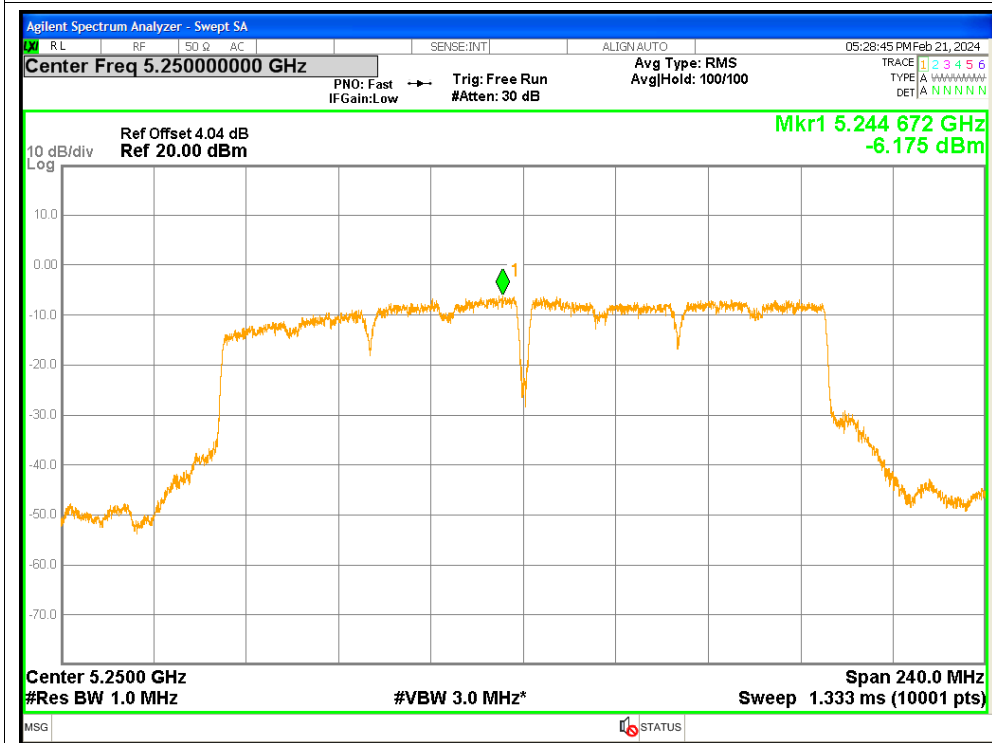


PSD NVNT ac160 5250MHz Ant3

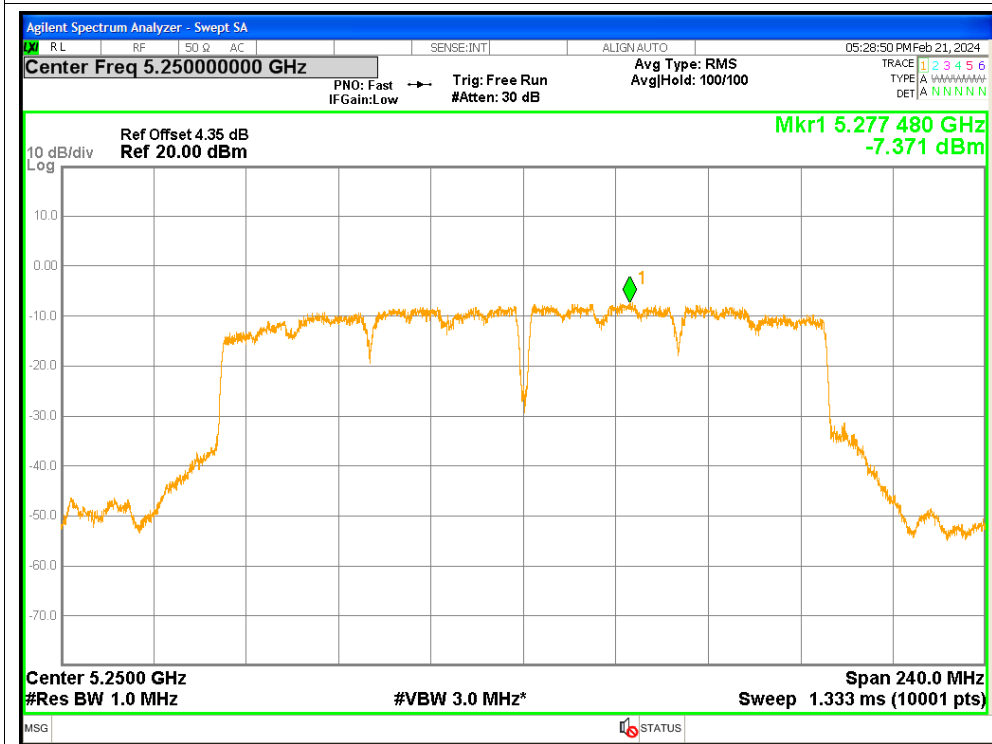


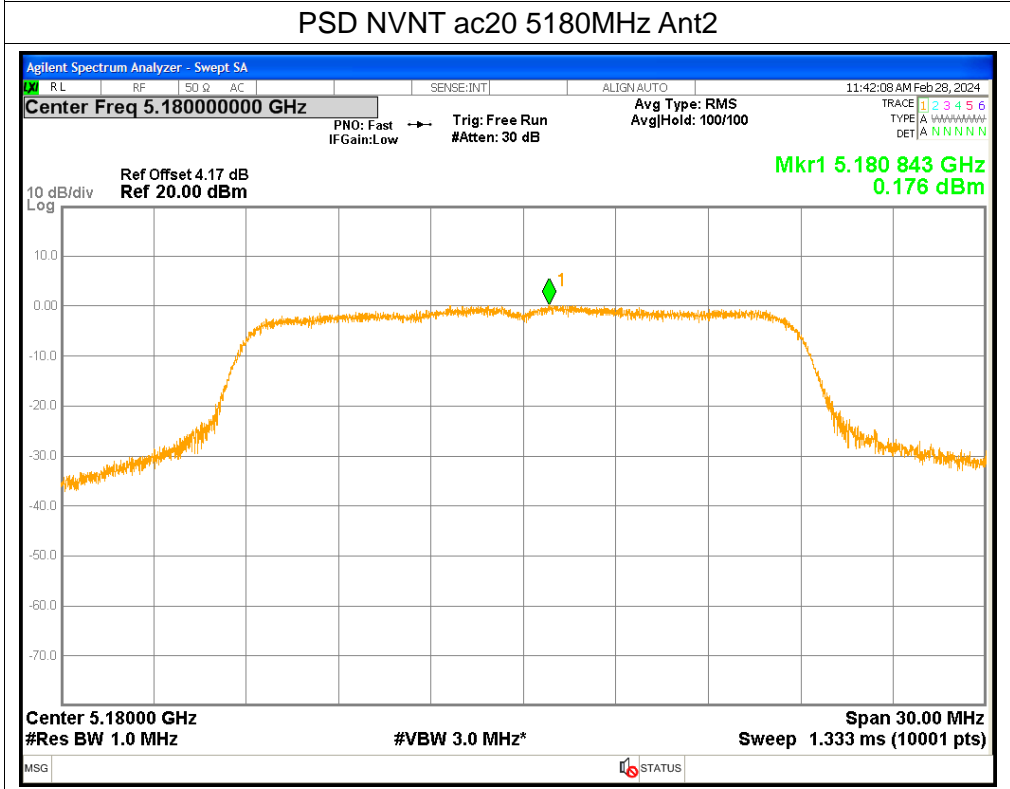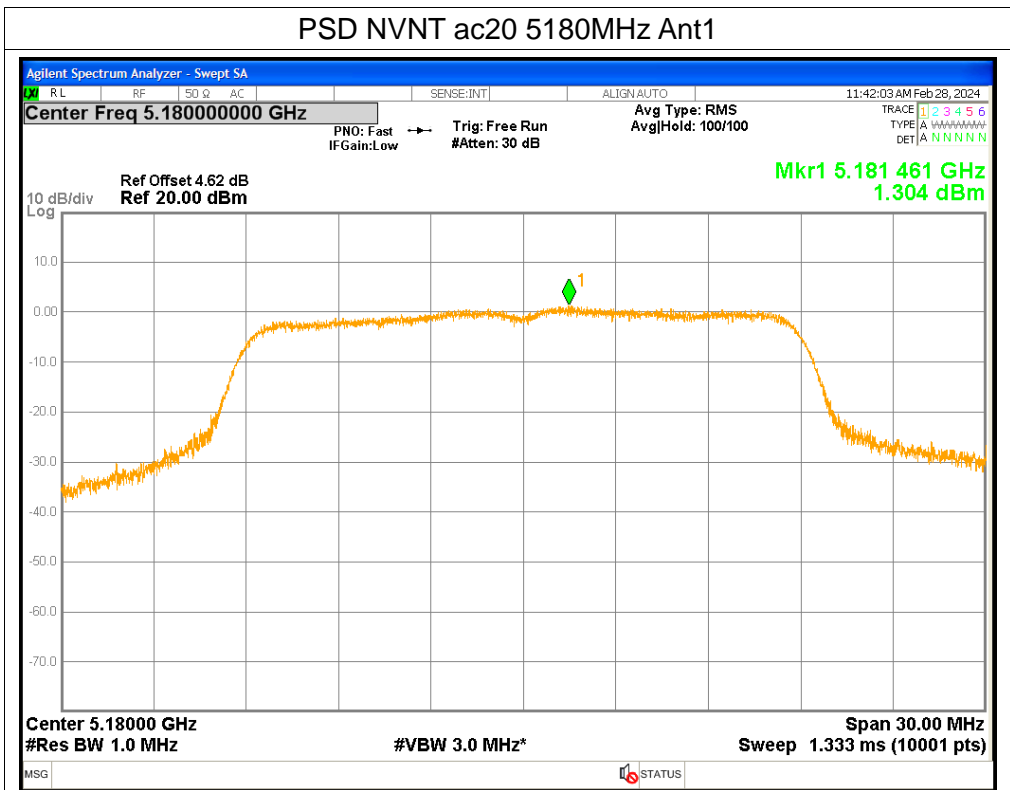


PSD NVNT ac20 5180MHz Ant3

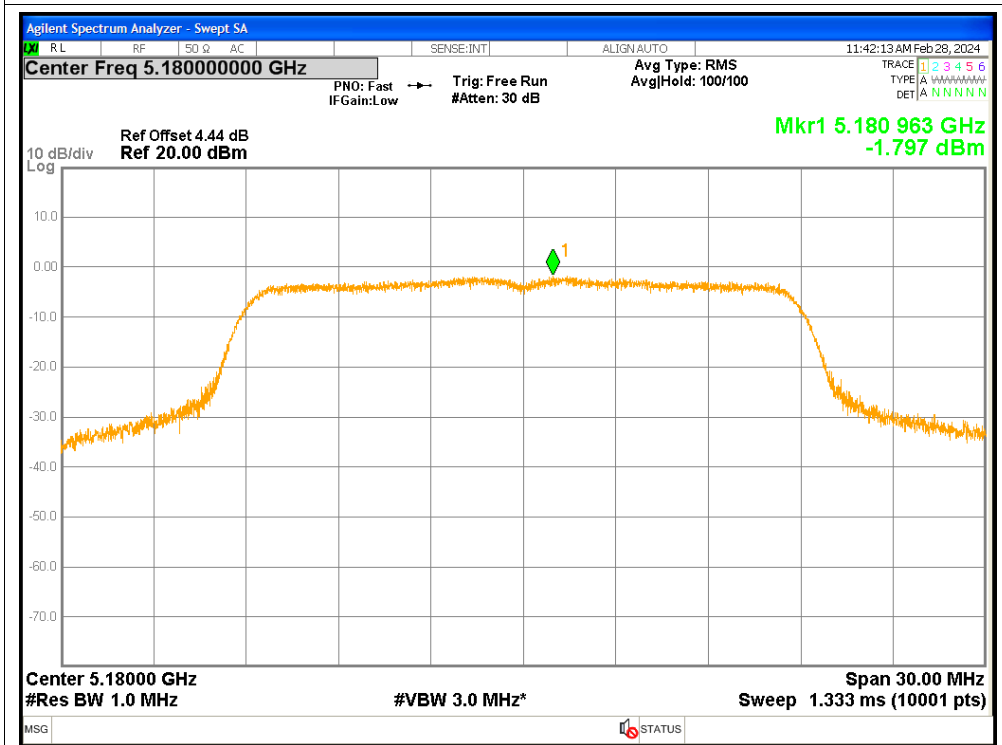


PSD NVNT ac20 5200MHz Ant1

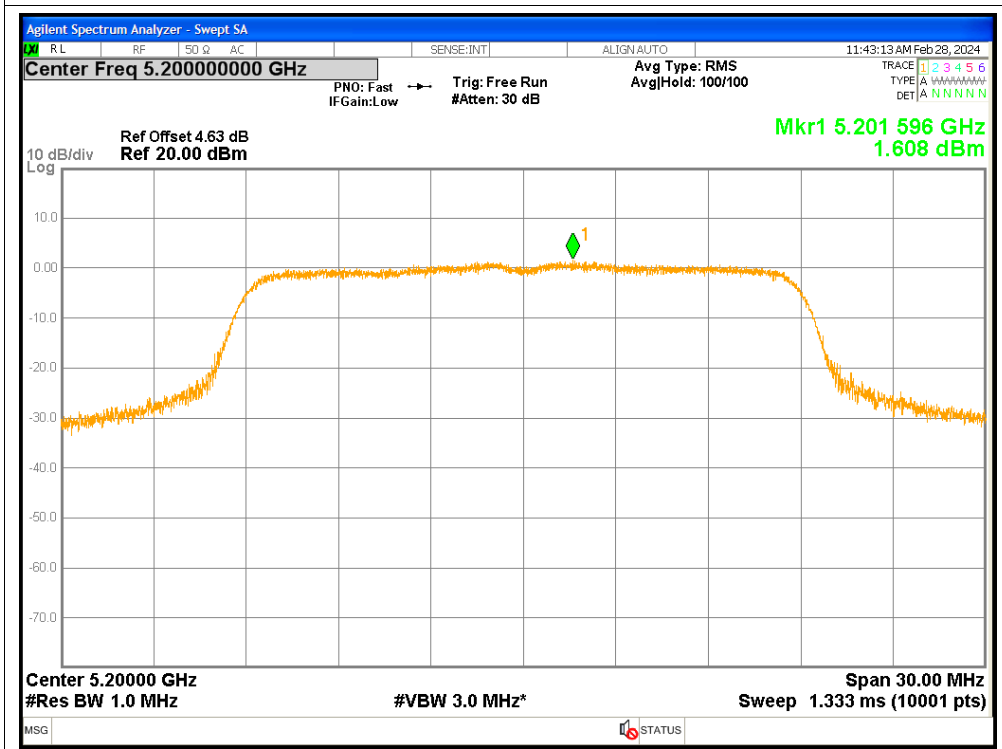


PSD NVNT ac20 5200MHz Ant2

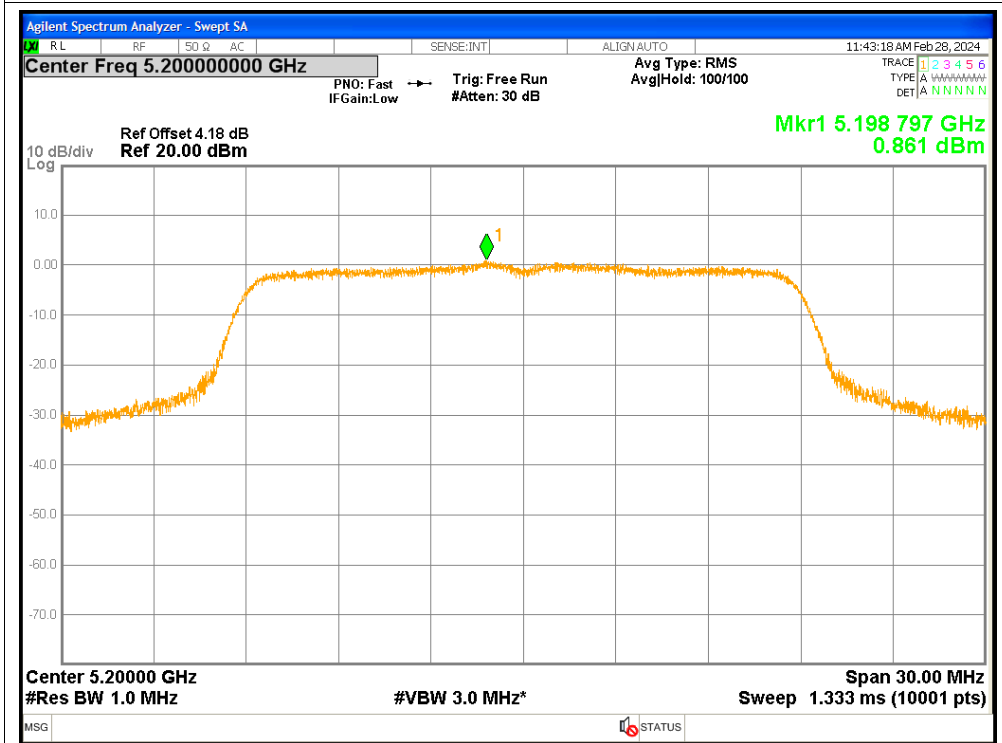


PSD NVNT ac20 5200MHz Ant3


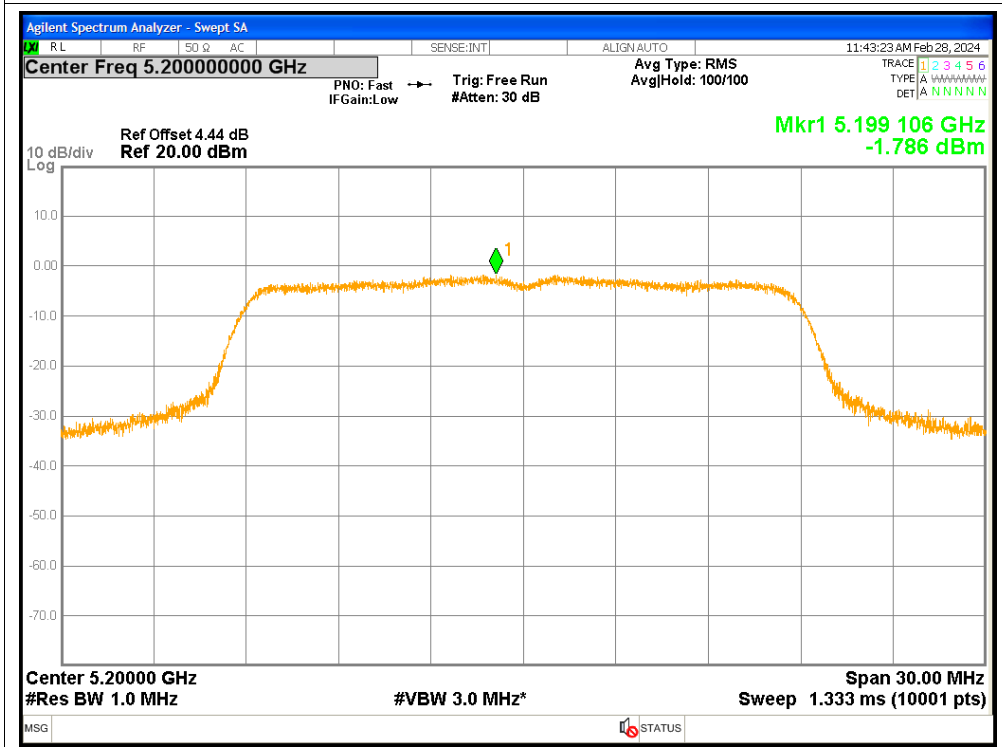




PSD NVNT ac20 5240MHz Ant1


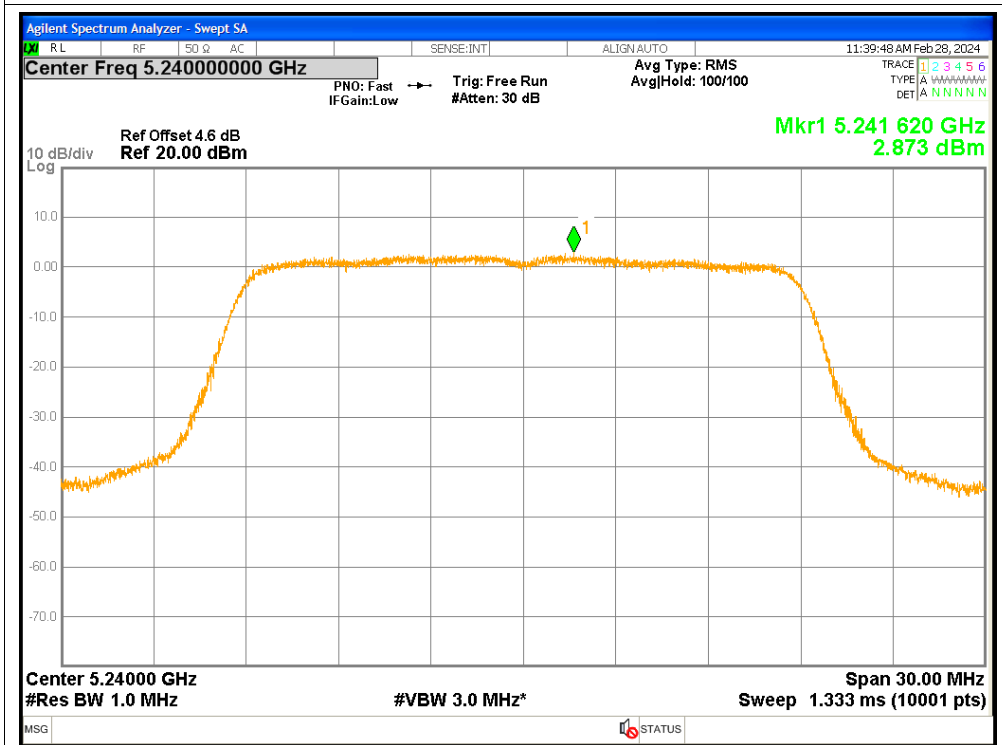




PSD NVNT ac20 5240MHz Ant2

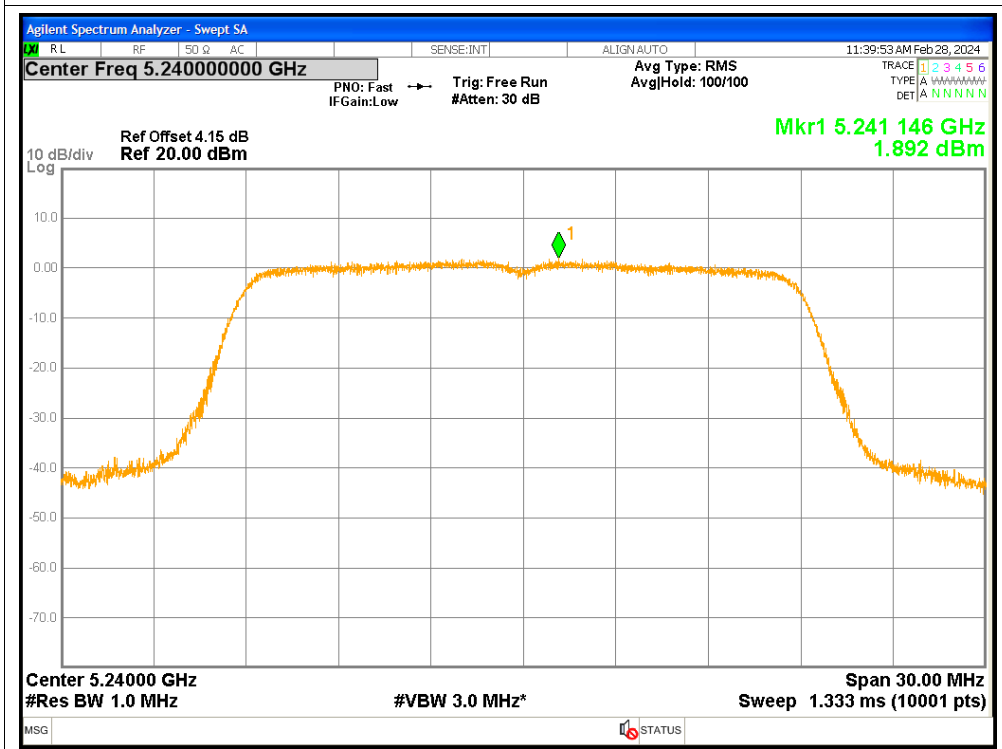

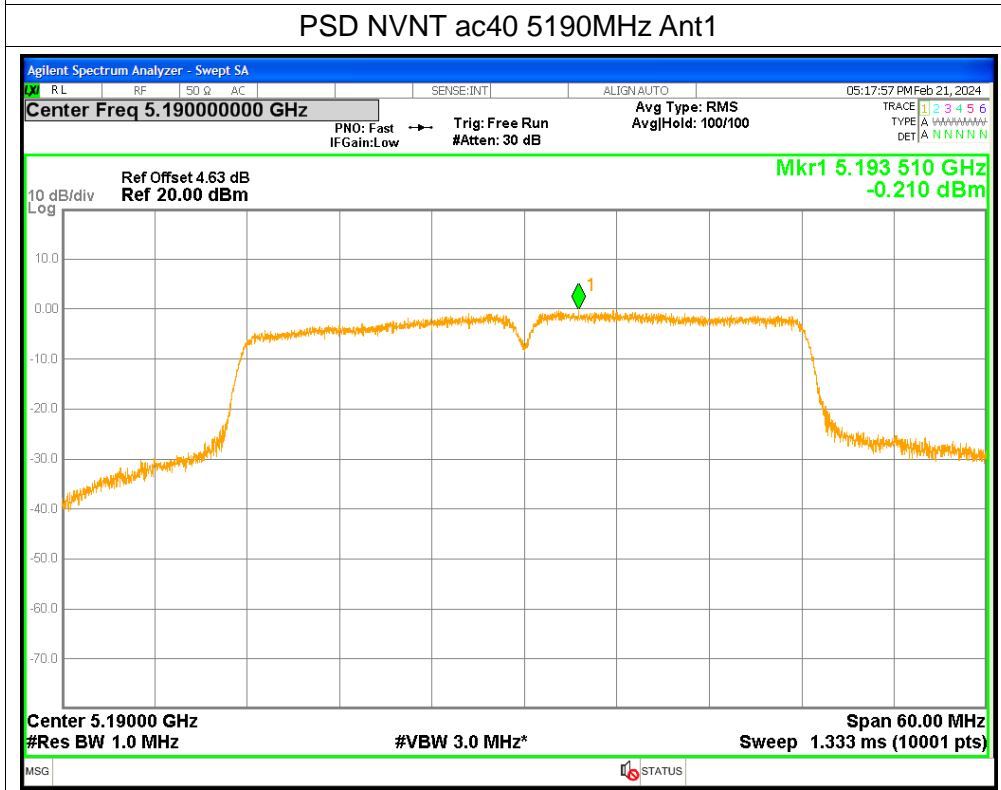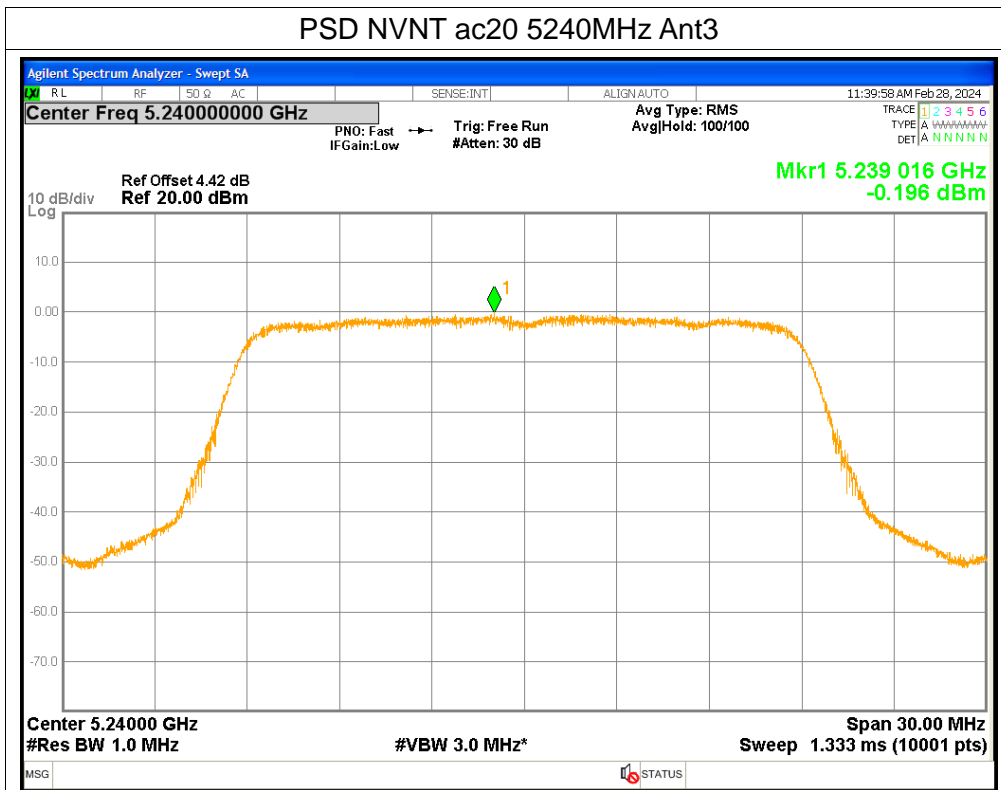


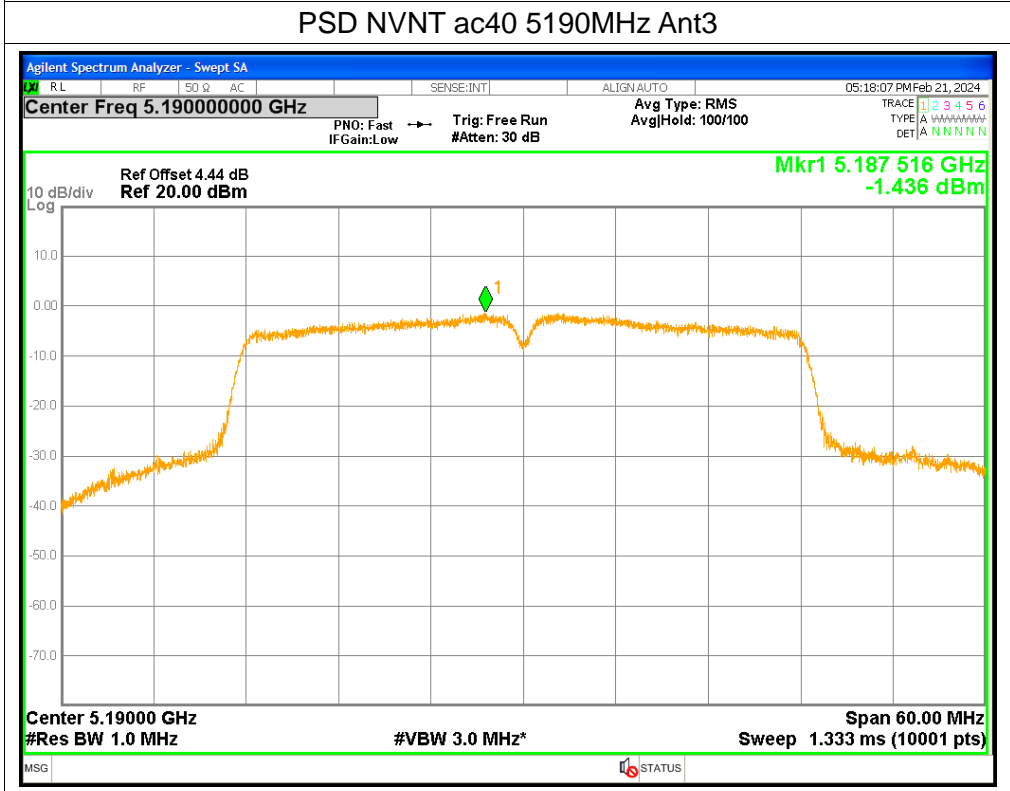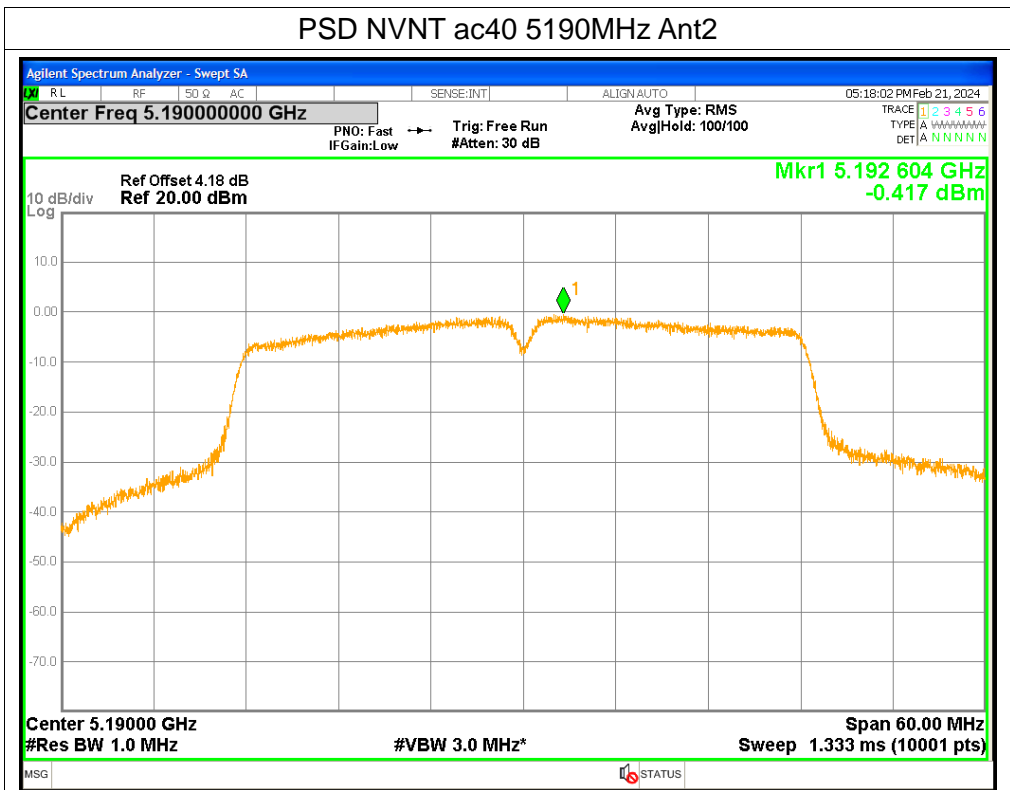

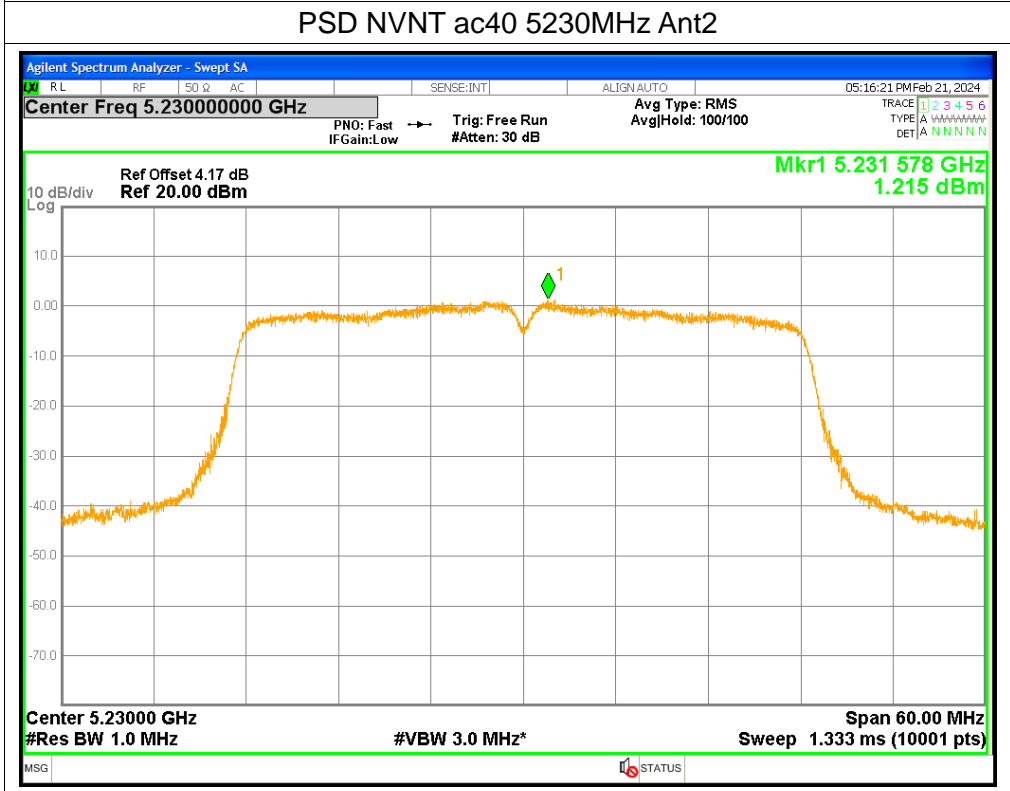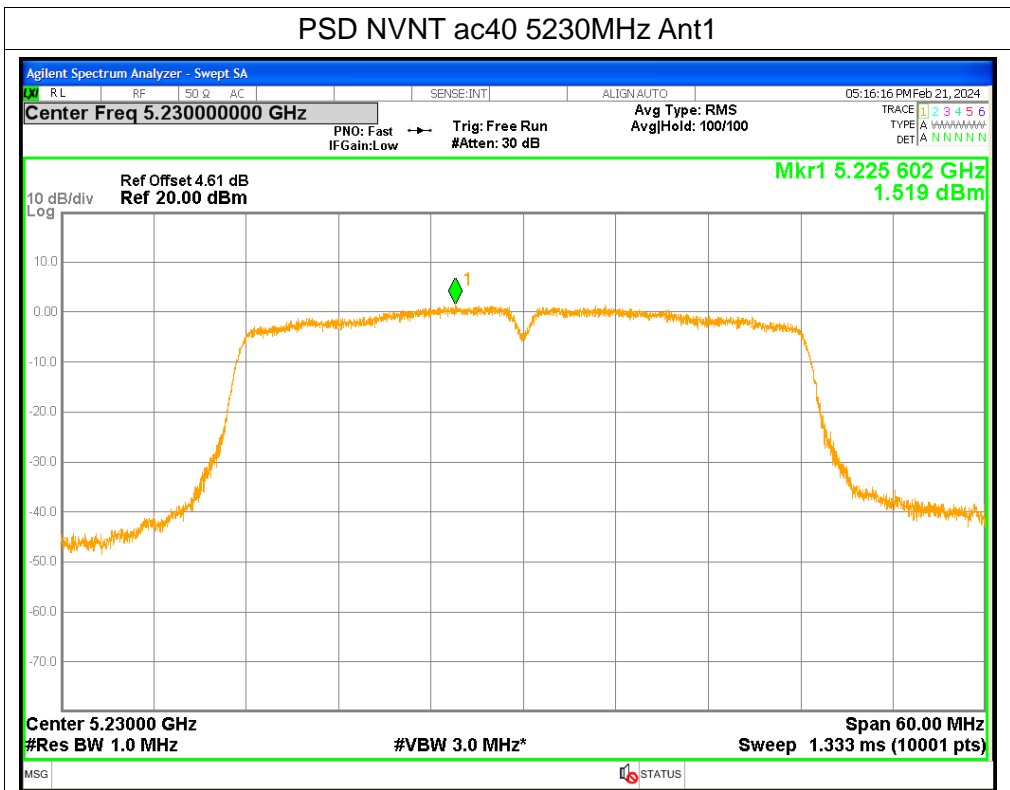


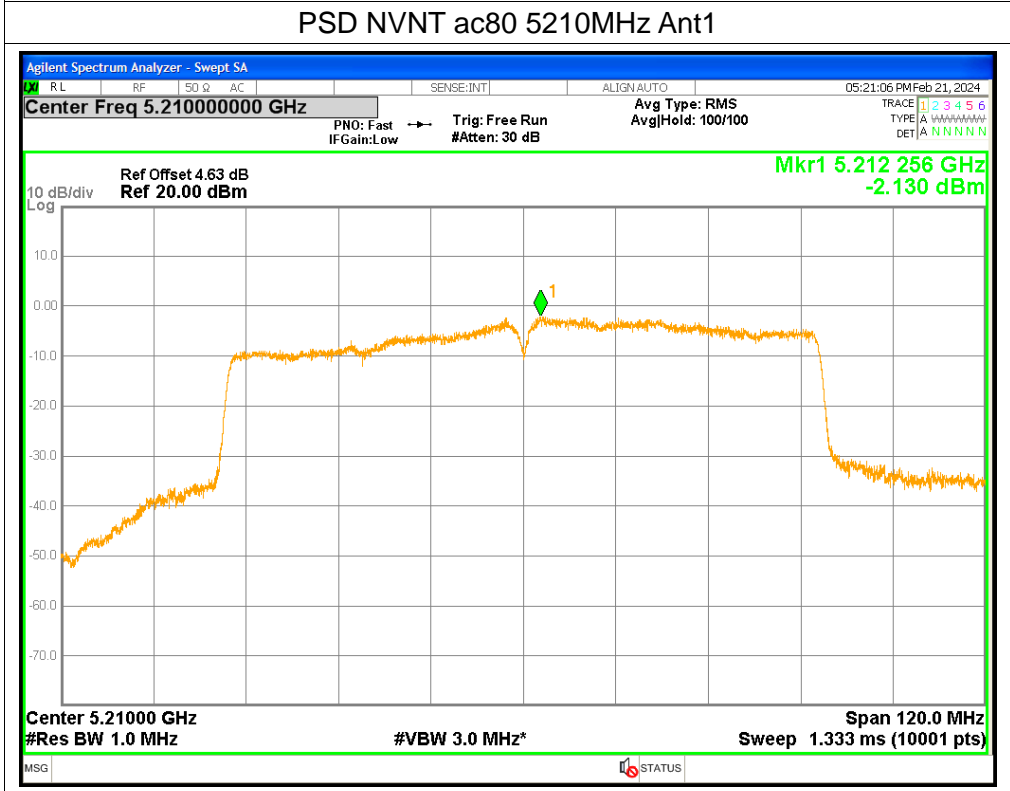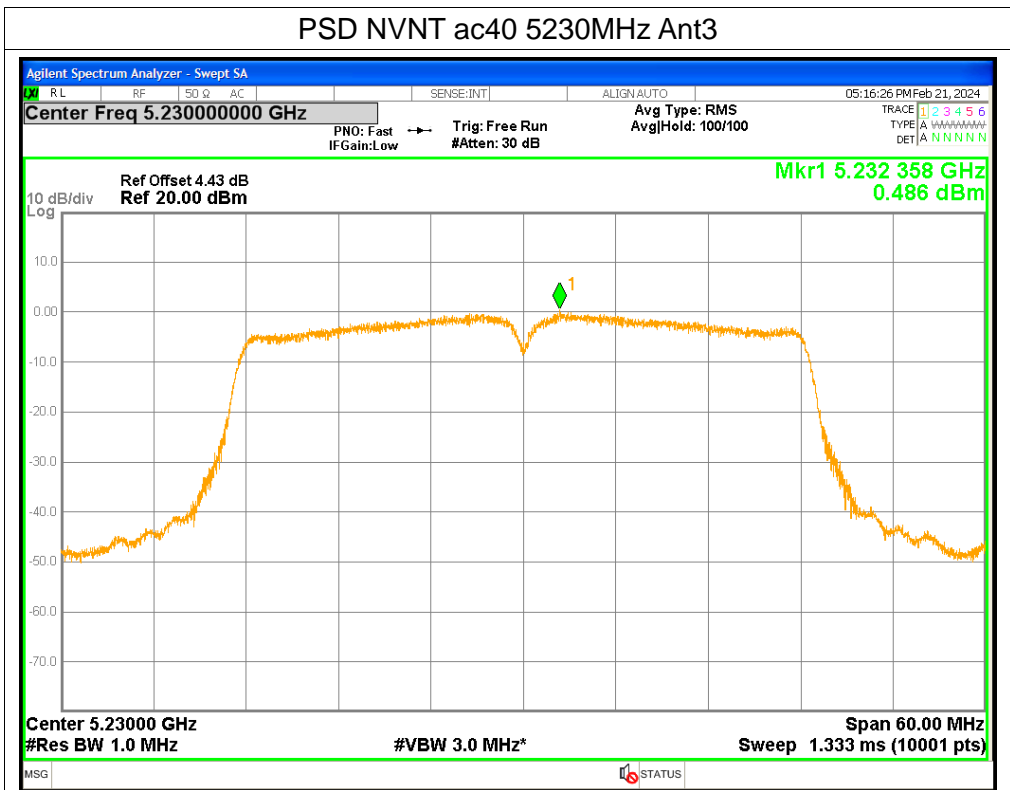


PSD NVNT ac80 5210MHz Ant2

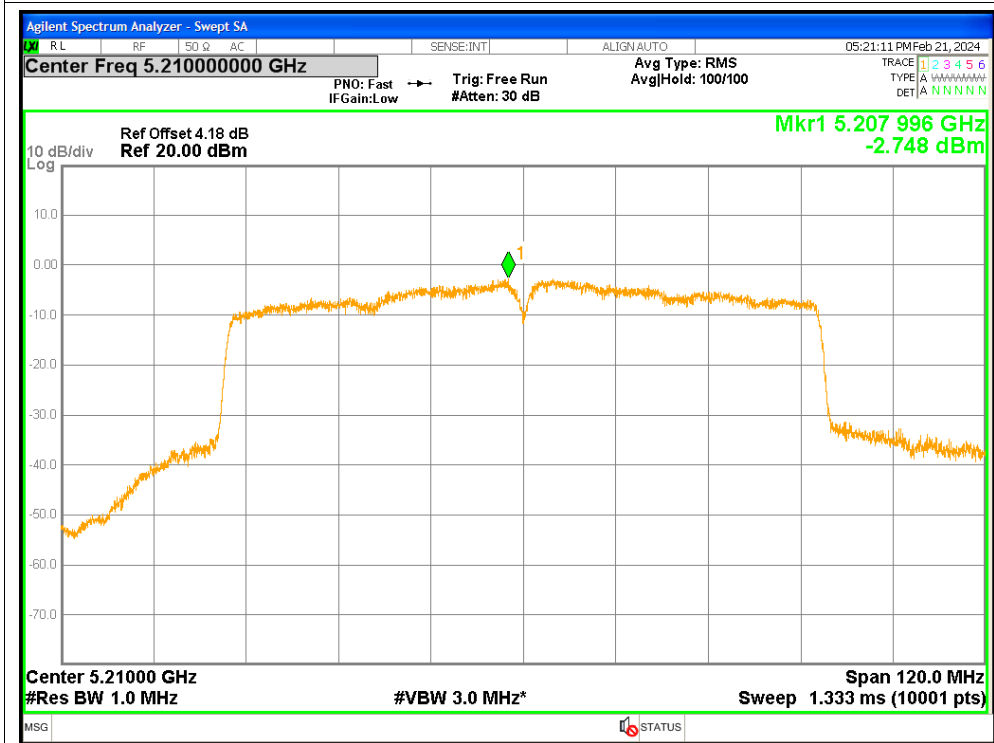


PSD NVNT ac80 5210MHz Ant3

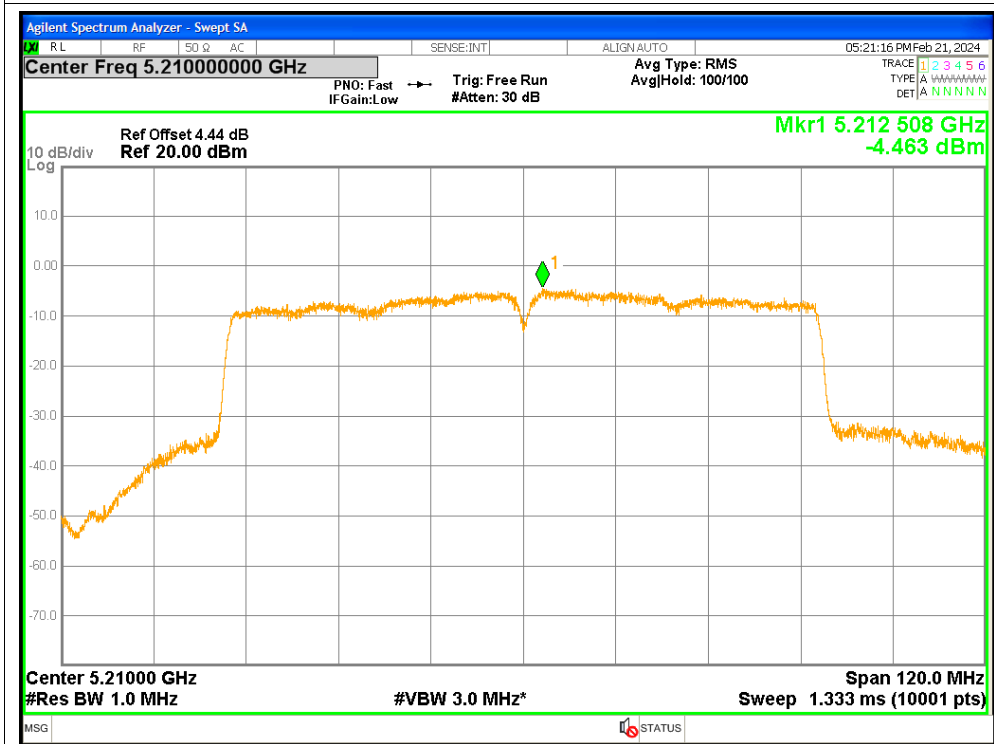


PSD NVNT ax160 5250MHz Ant1

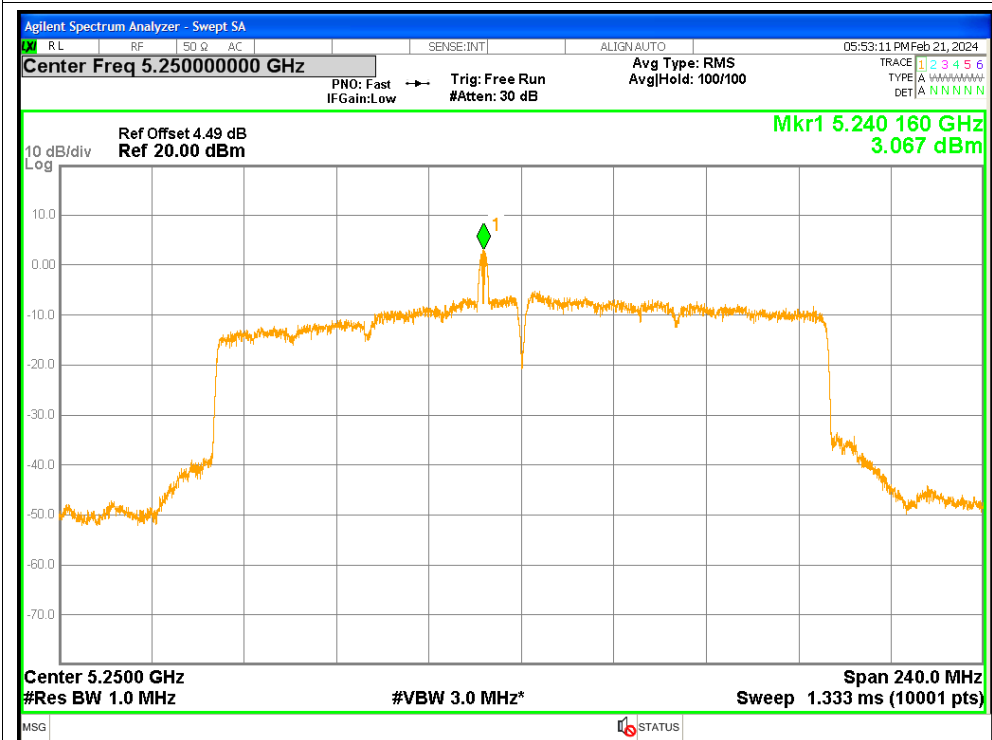


PSD NVNT ax160 5250MHz Ant2

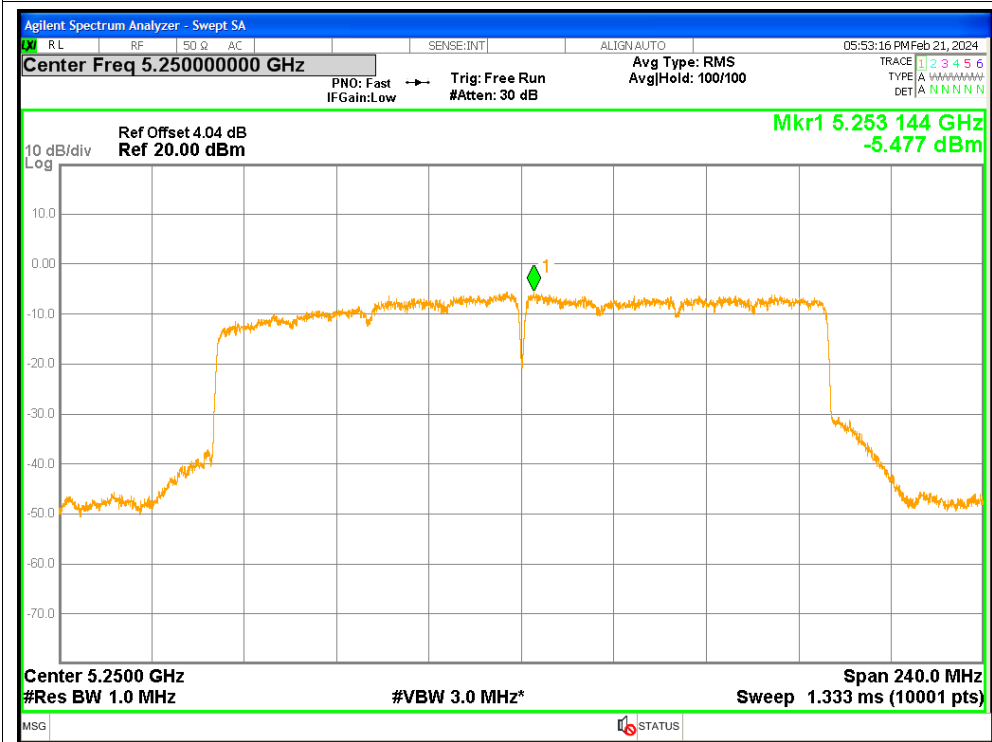


PSD NVNT ax160 5250MHz Ant3

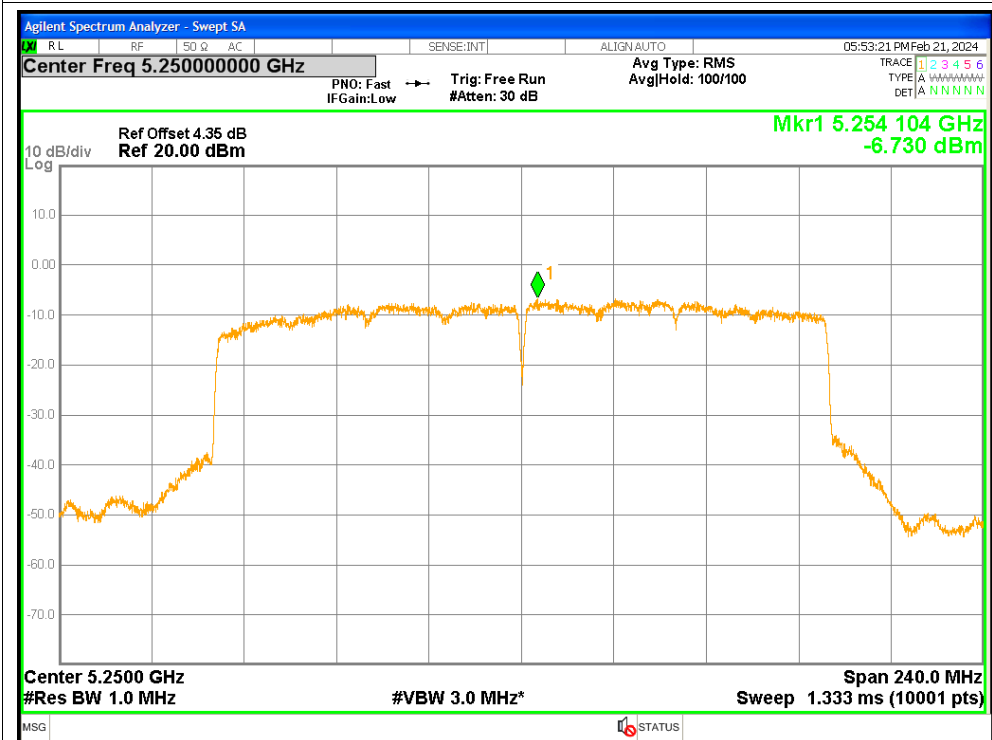


PSD NVNT ax20 5180MHz Ant1

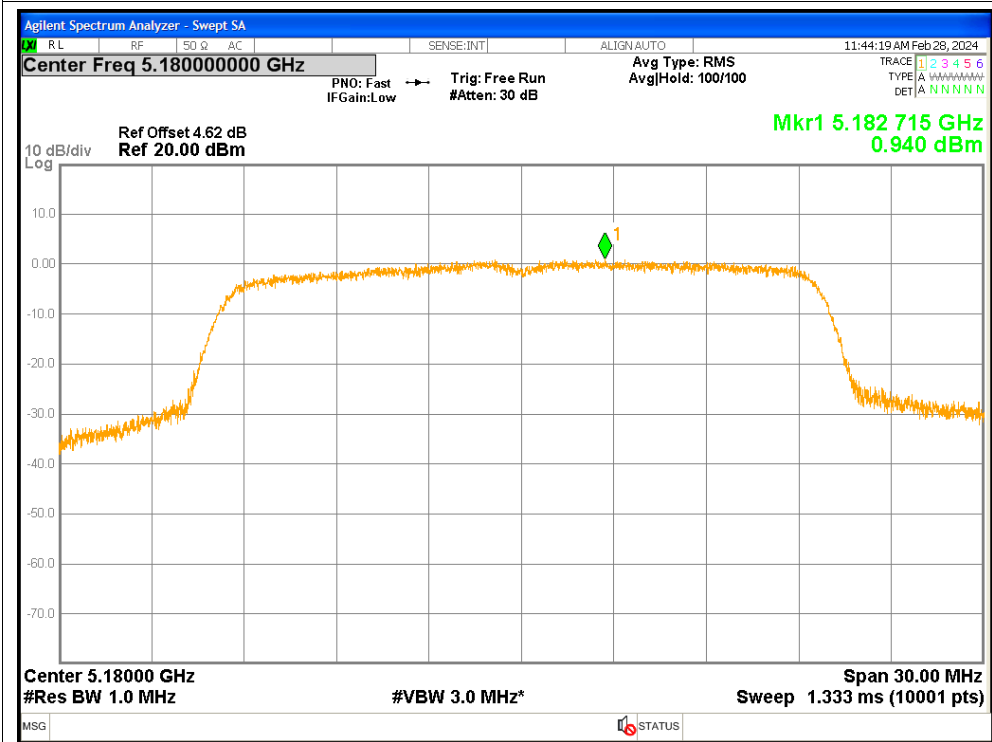


PSD NVNT ax20 5180MHz Ant2

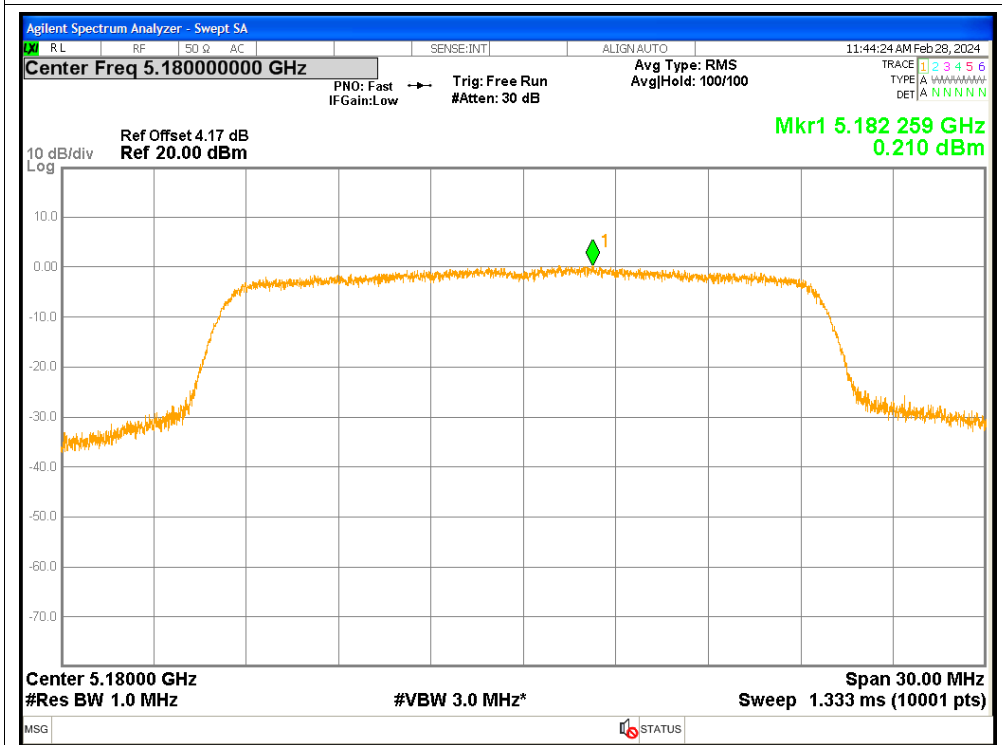


PSD NVNT ax20 5180MHz Ant3

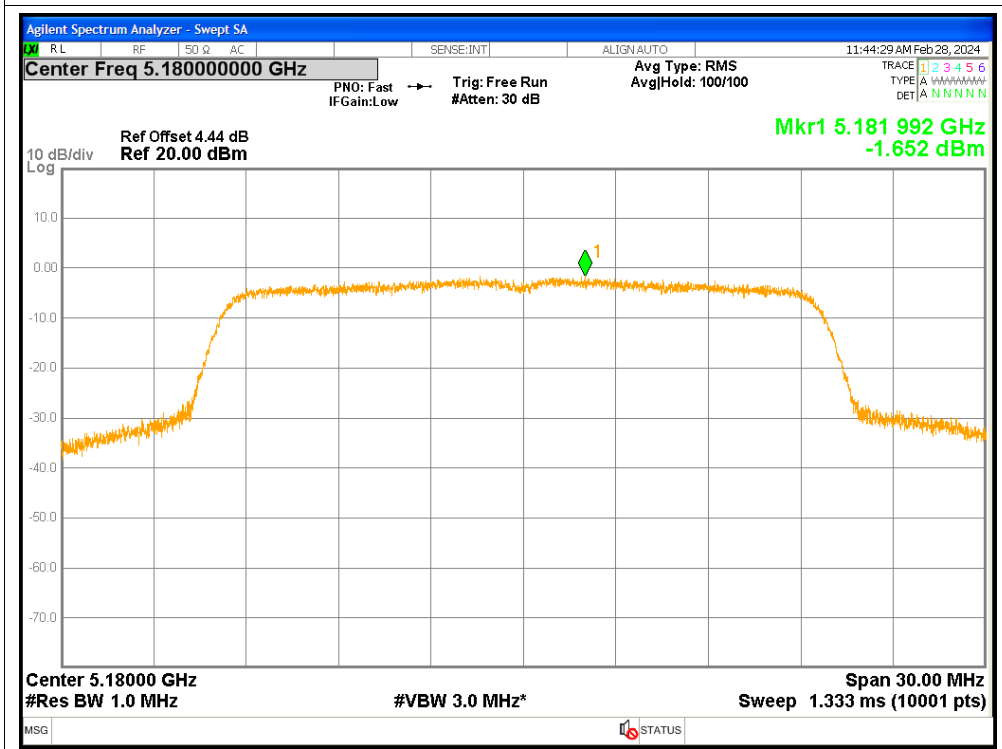


PSD NVNT ax20 5200MHz Ant1

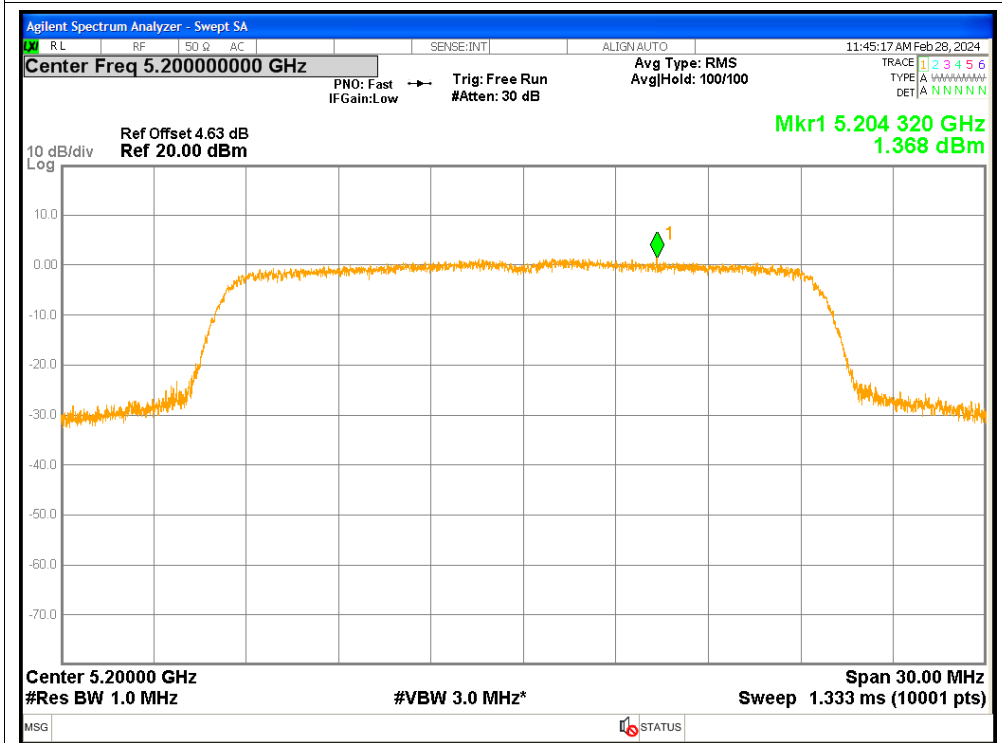


PSD NVNT ax20 5200MHz Ant2

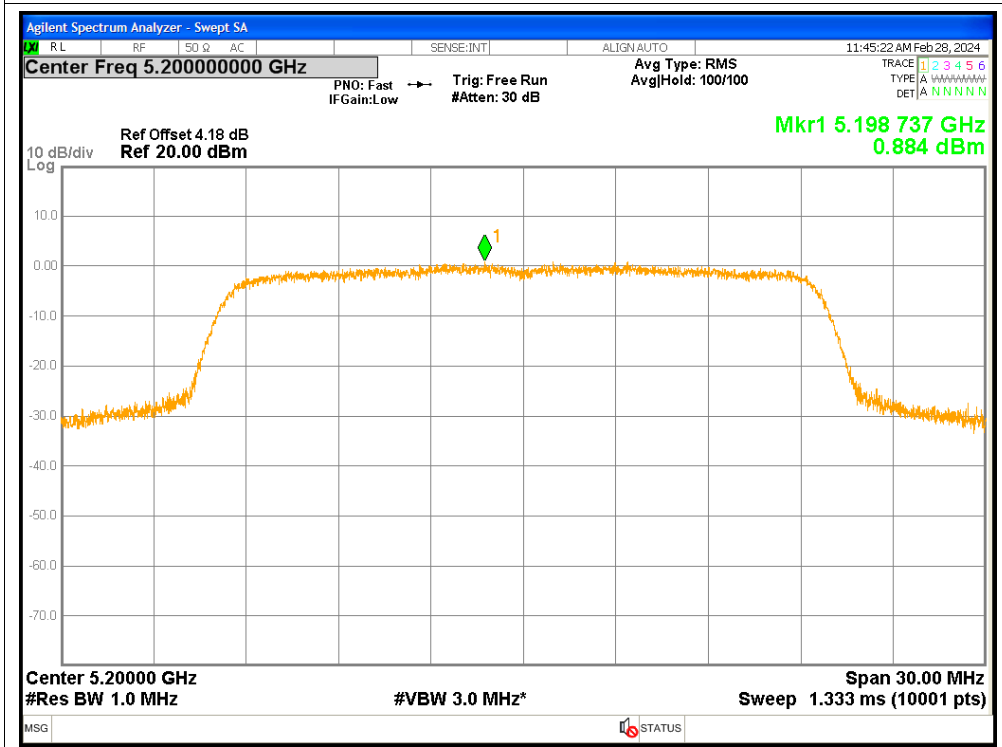


PSD NVNT ax20 5200MHz Ant3

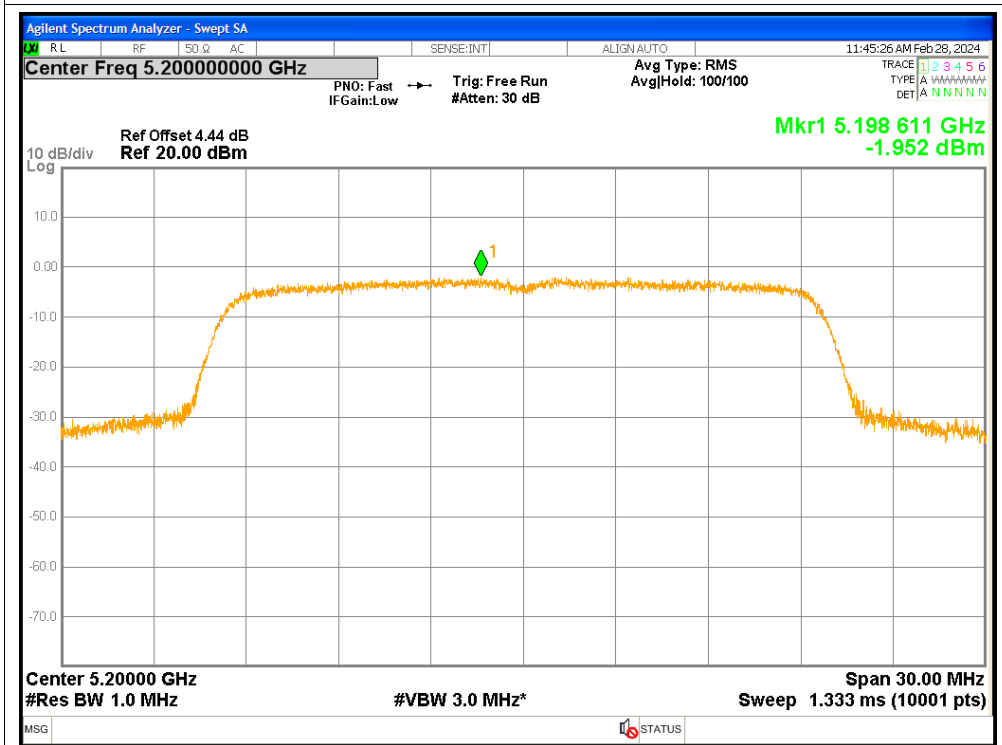


PSD NVNT ax20 5240MHz Ant1

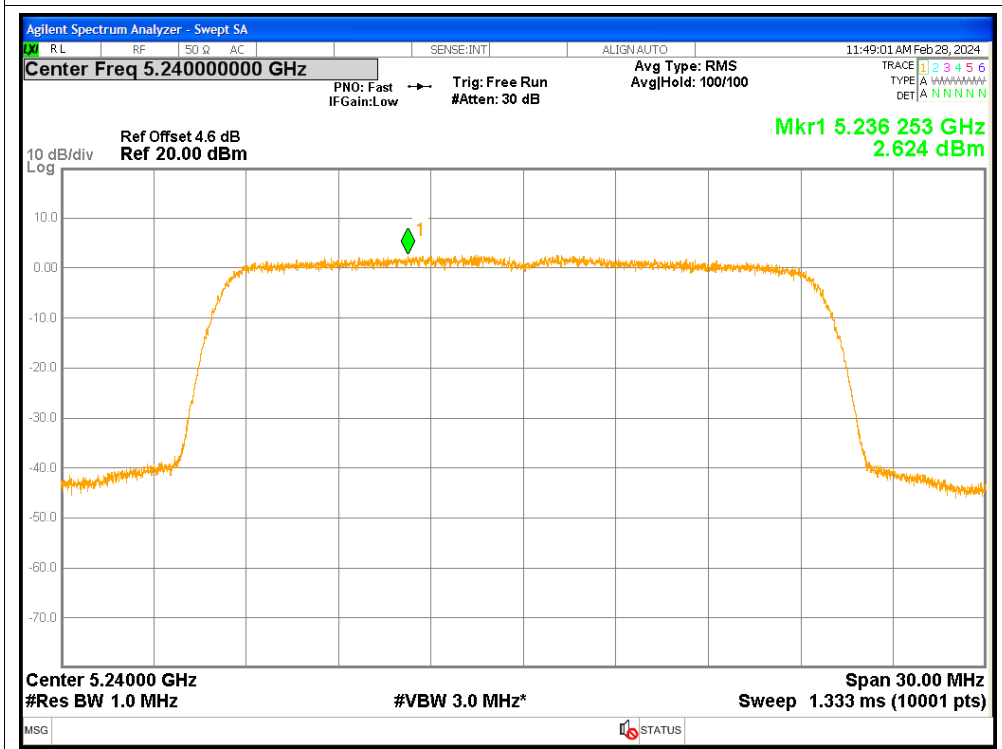


PSD NVNT ax20 5240MHz Ant2

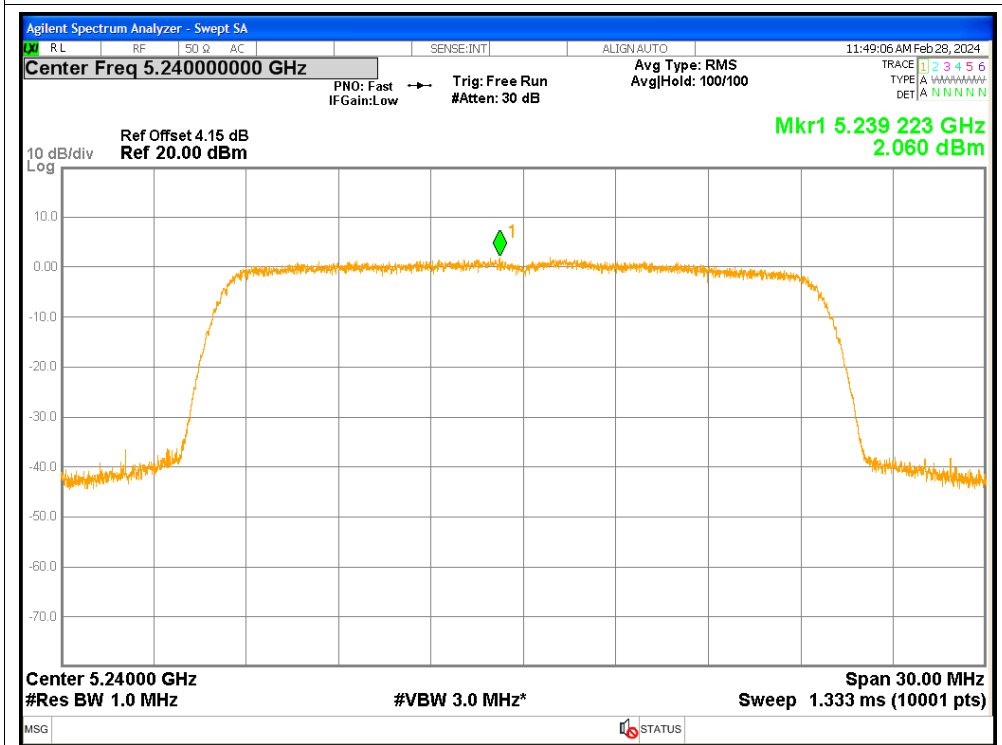


PSD NVNT ax20 5240MHz Ant3

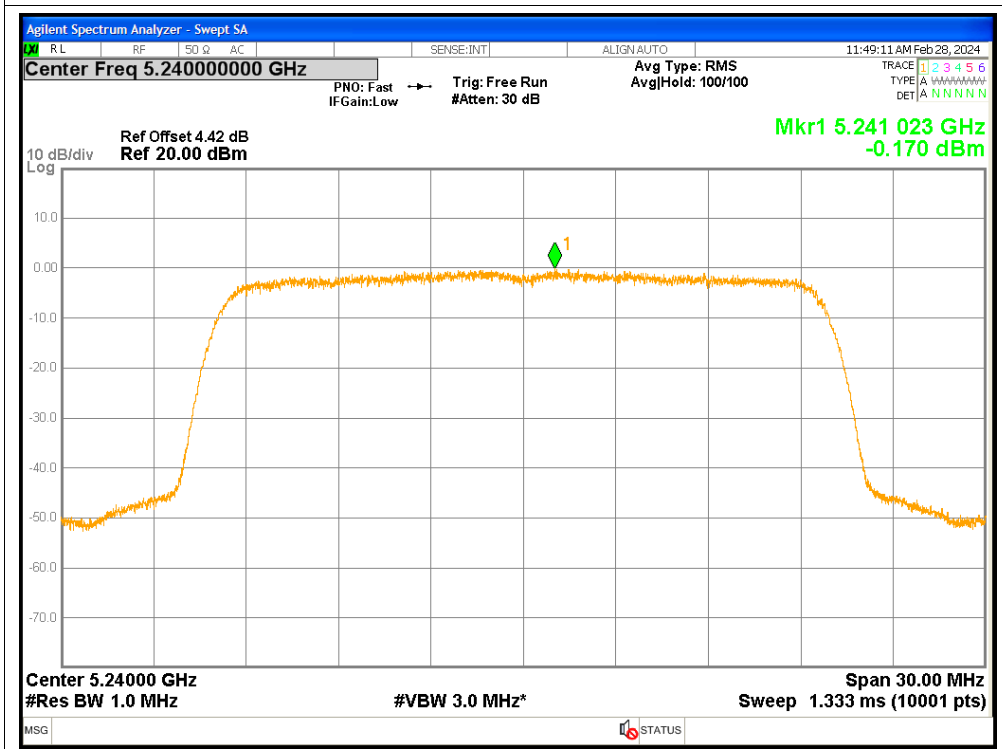


PSD NVNT ax40 5190MHz Ant1

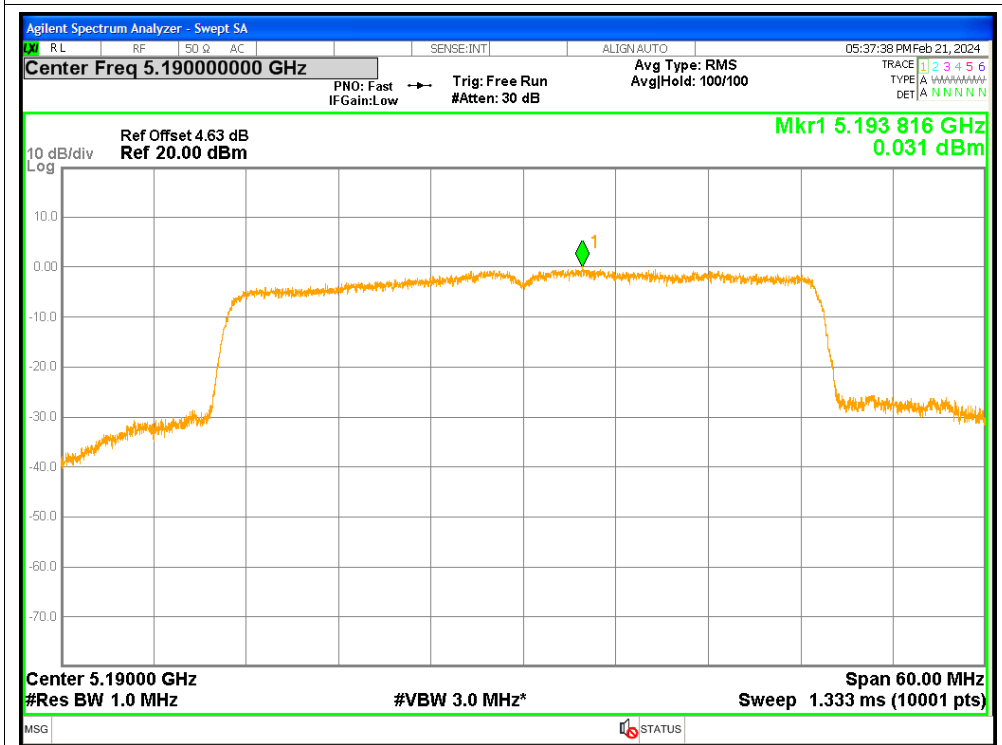


PSD NVNT ax40 5190MHz Ant2


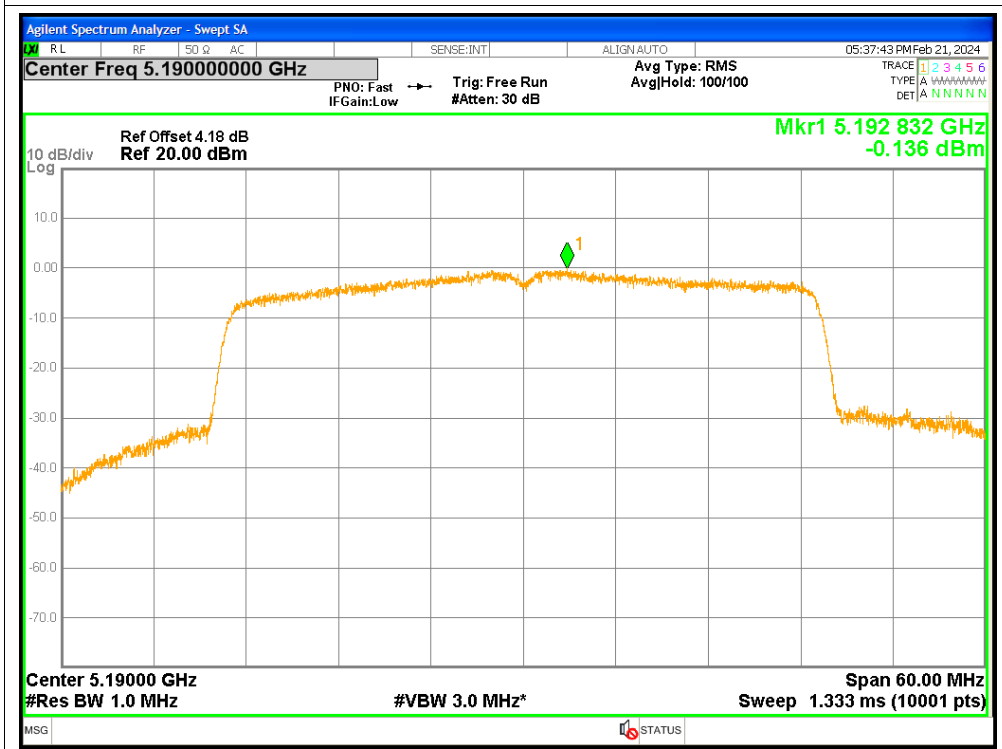




PSD NVNT ax40 5190MHz Ant3

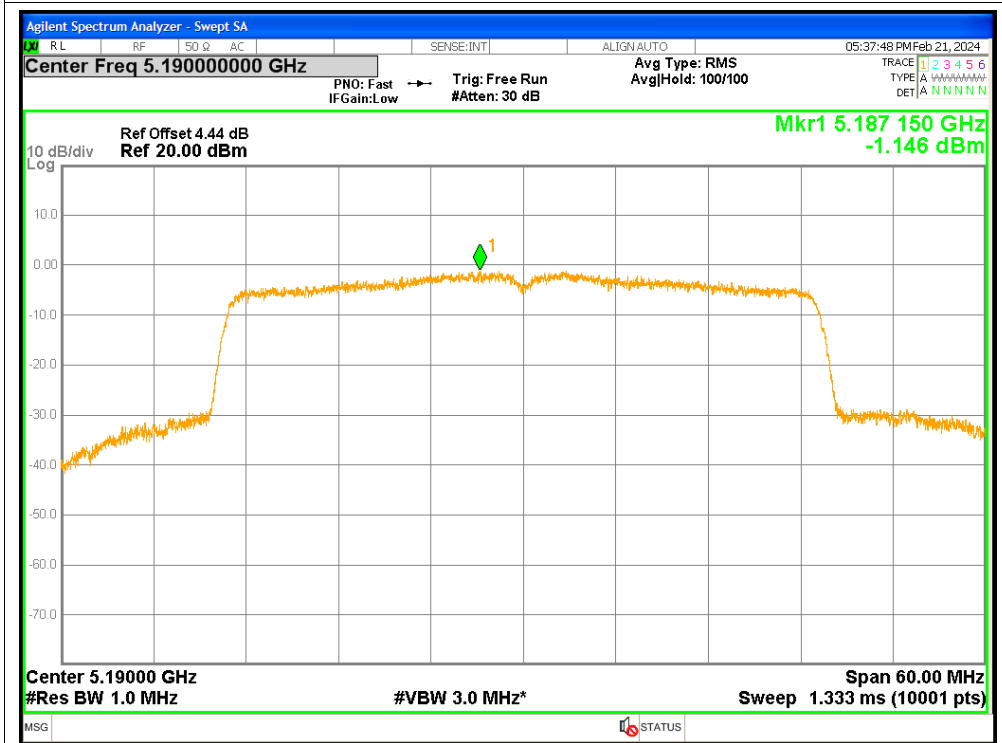


PSD NVNT ax40 5230MHz Ant1

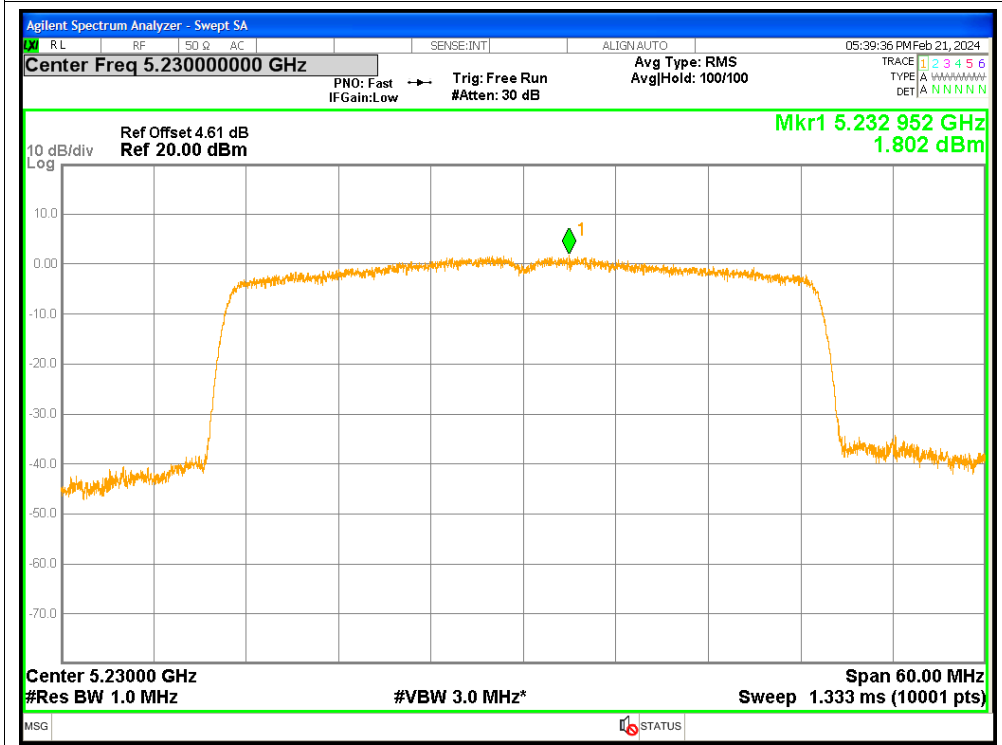

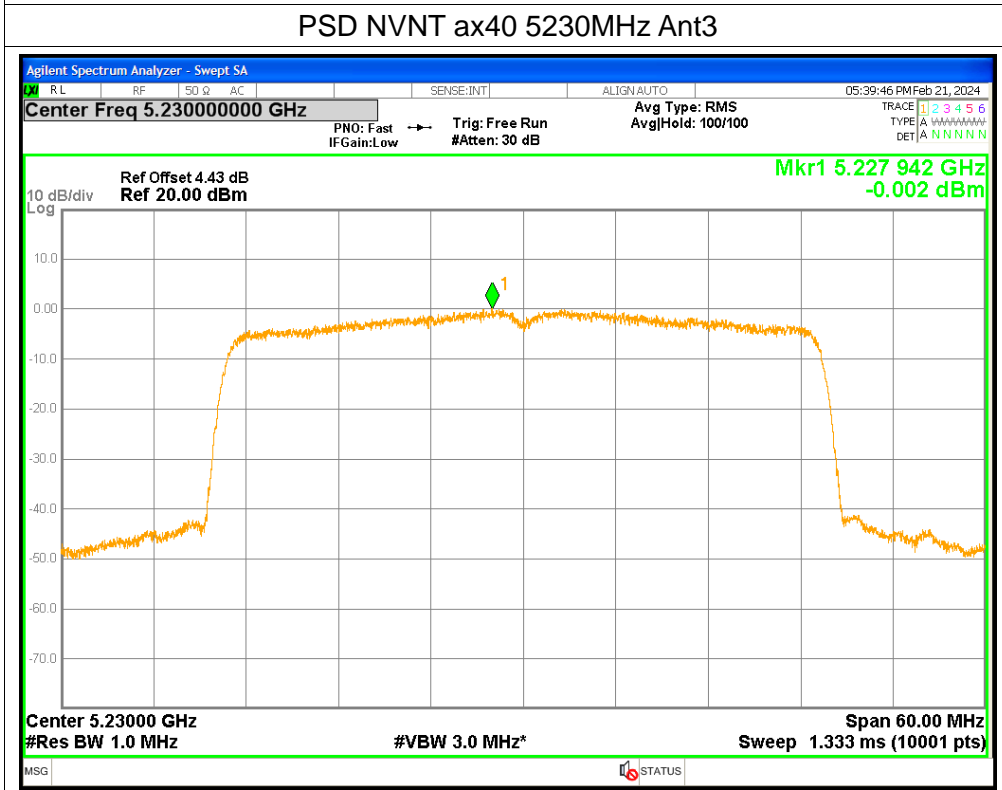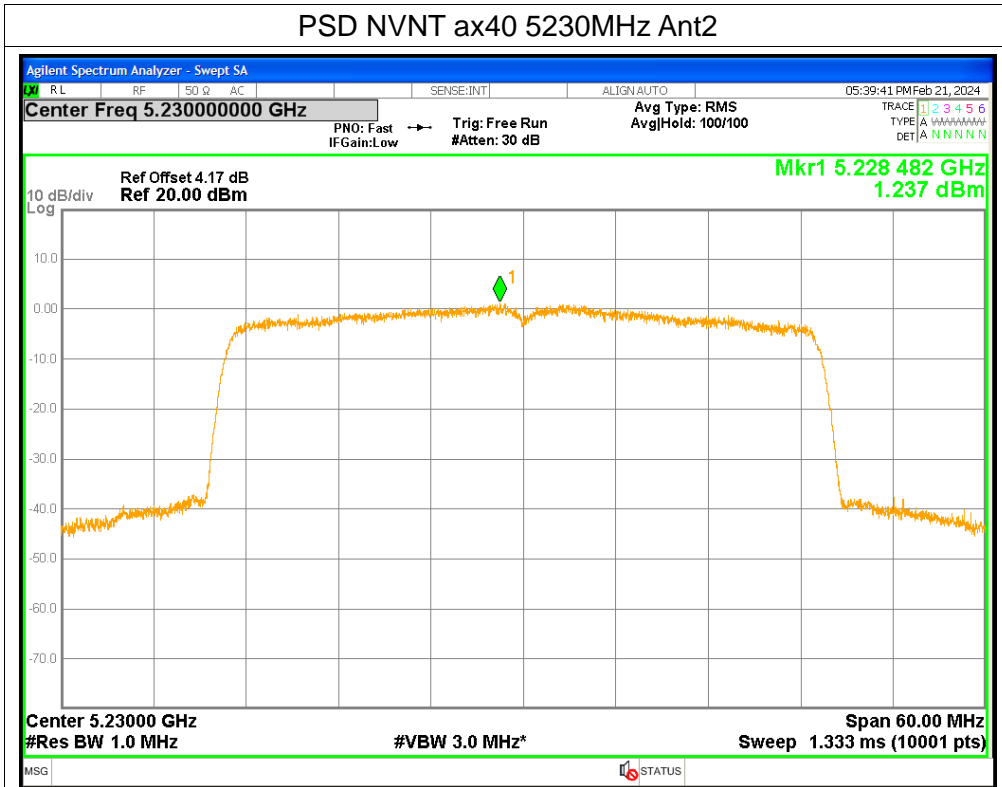


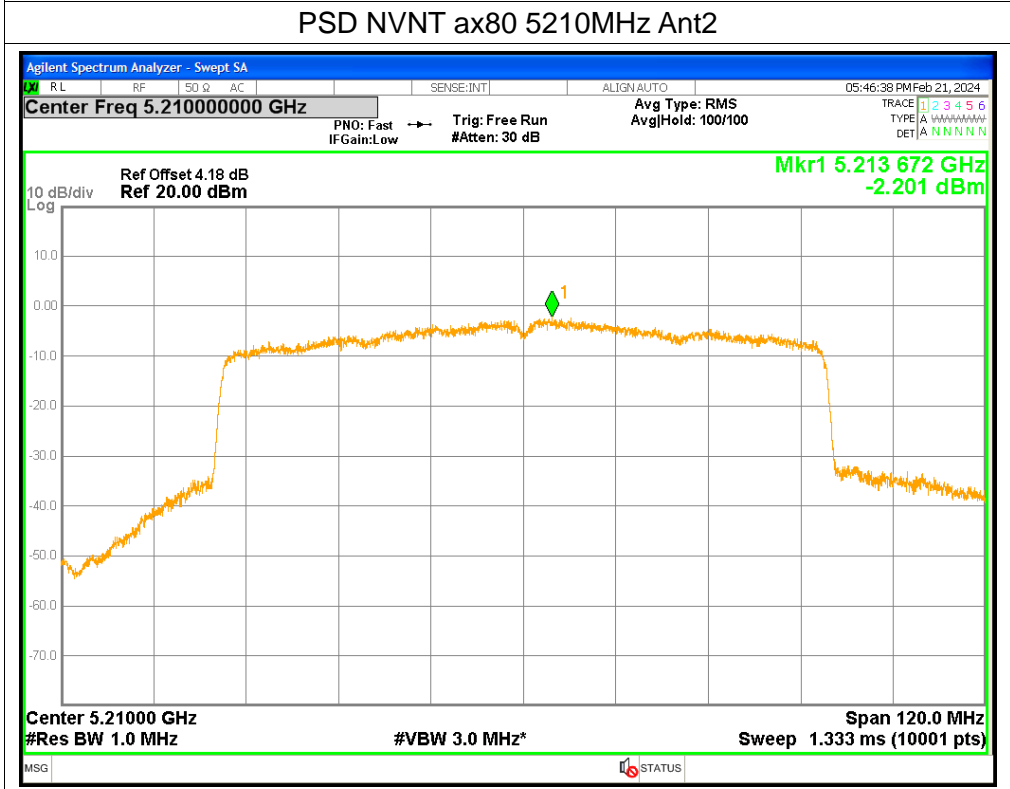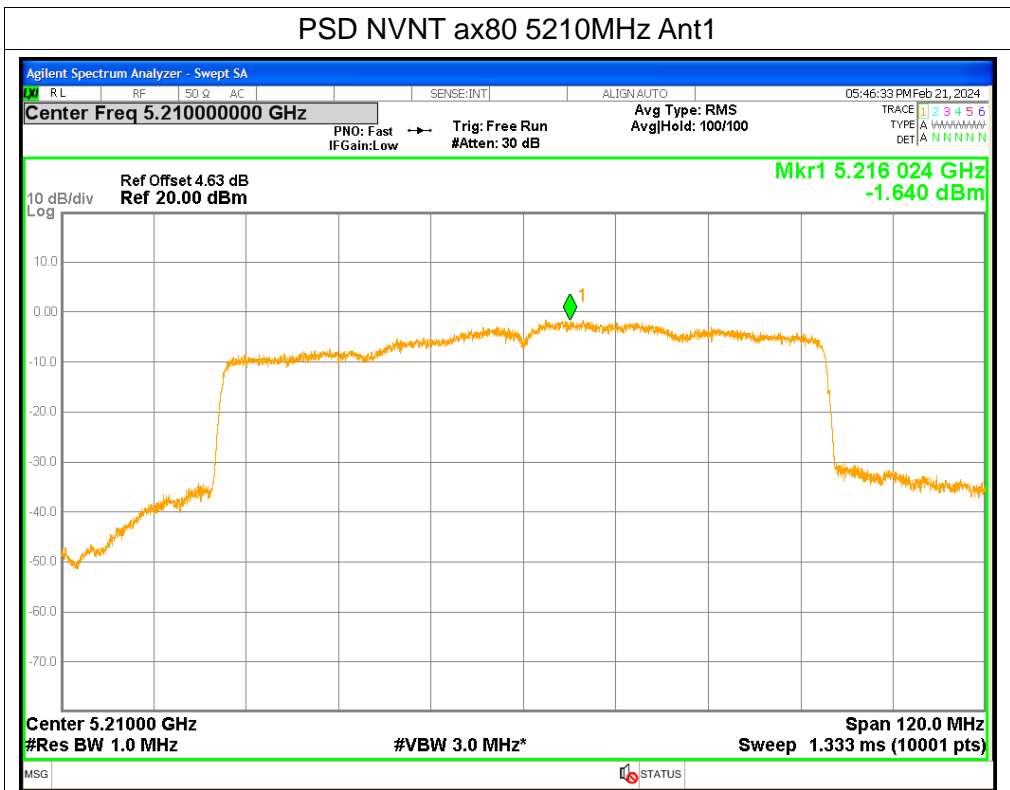


PSD NVNT ax80 5210MHz Ant3

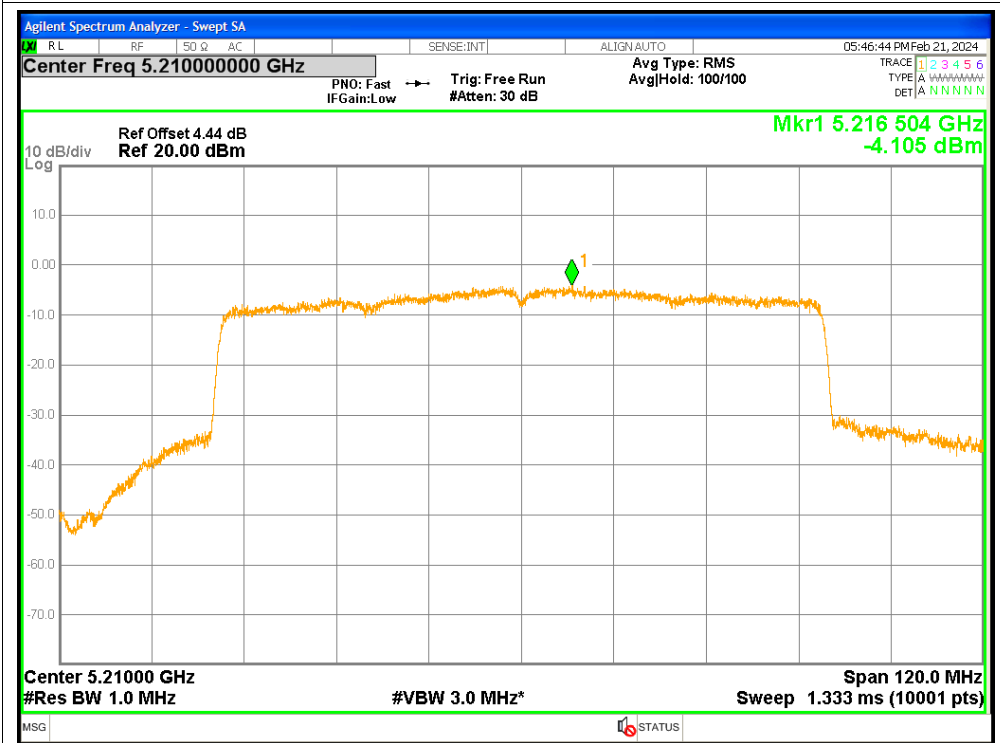


PSD NVNT n20 5180MHz Ant1


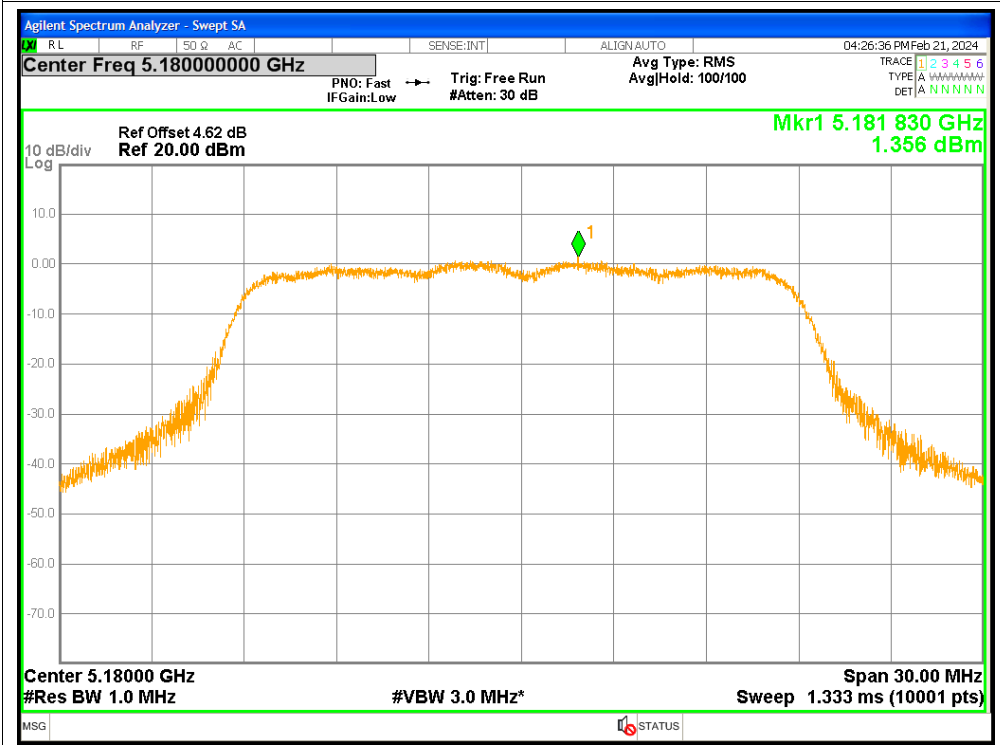


PSD NVNT n20 5180MHz Ant2

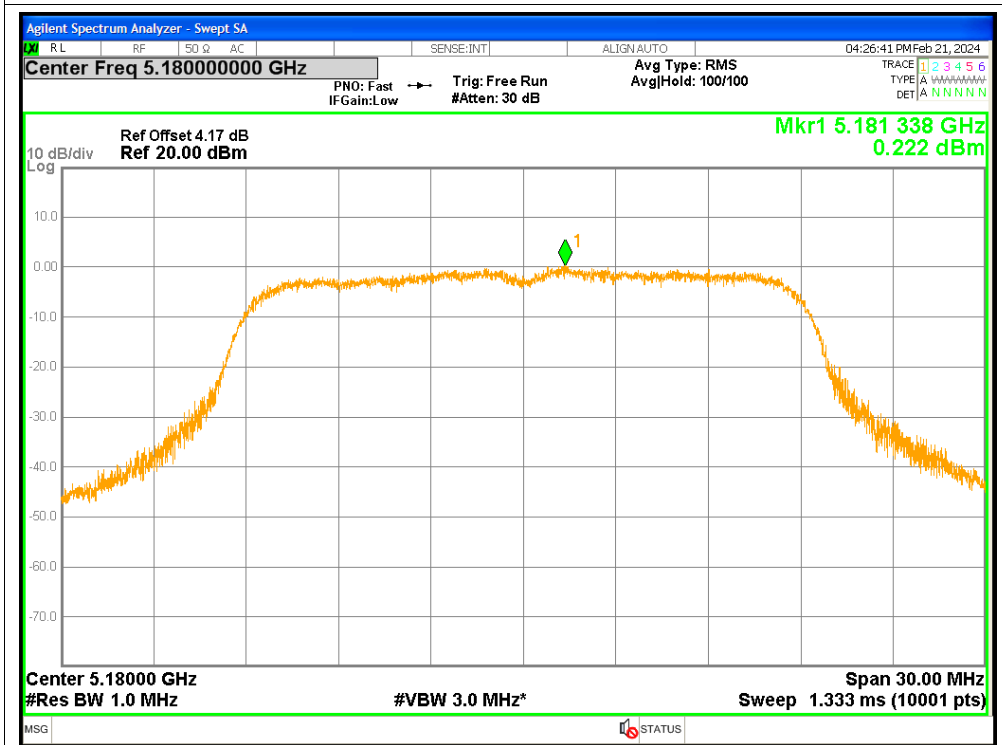


PSD NVNT n20 5180MHz Ant3

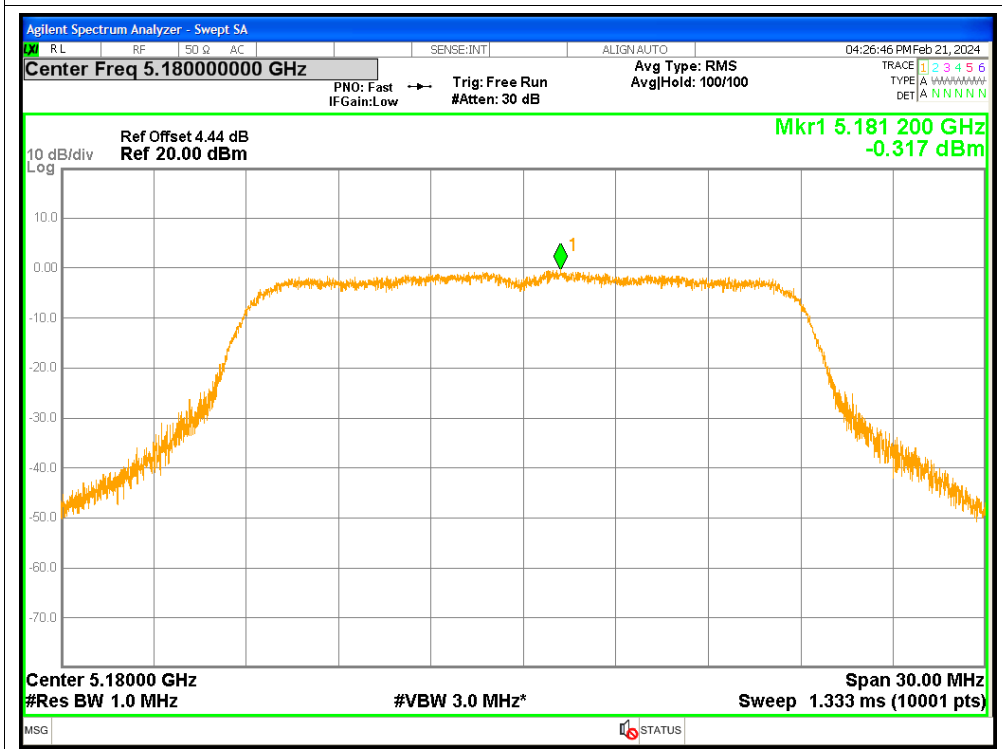


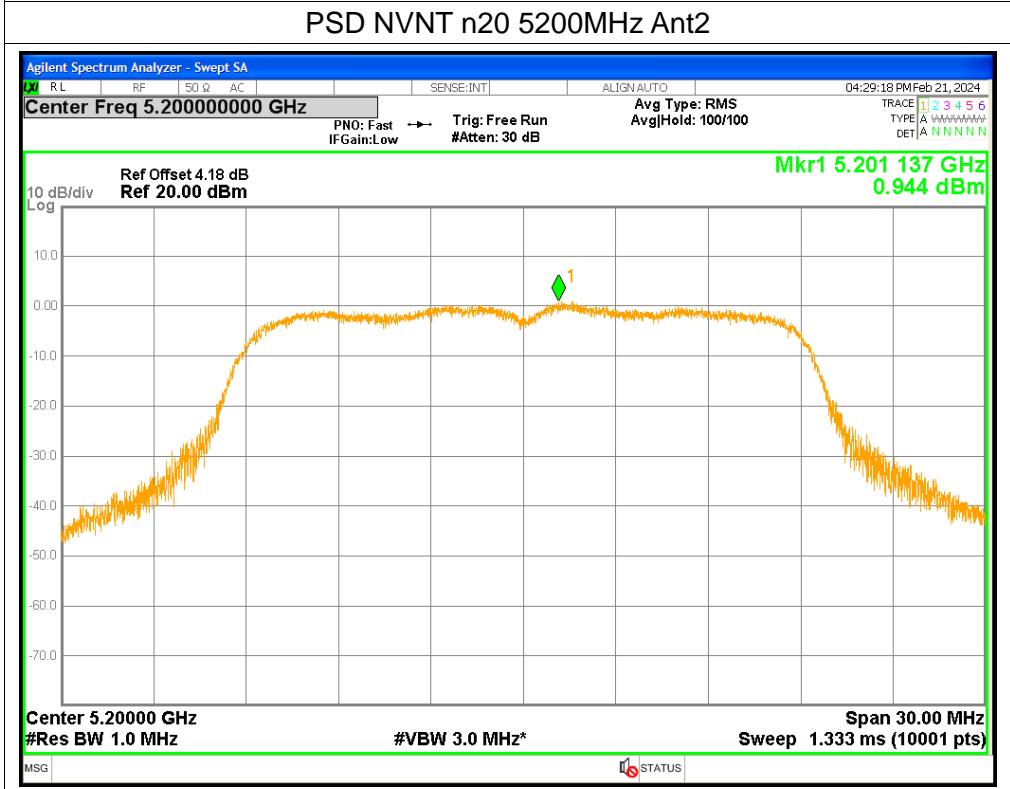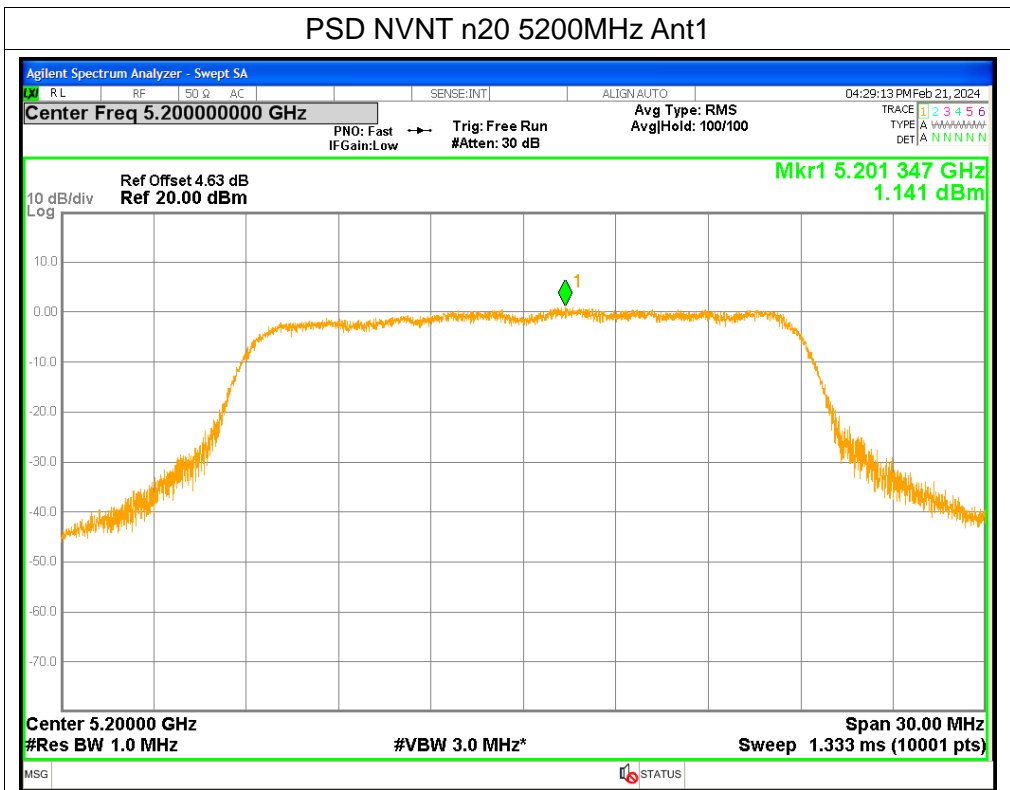


PSD NVNT n20 5200MHz Ant3

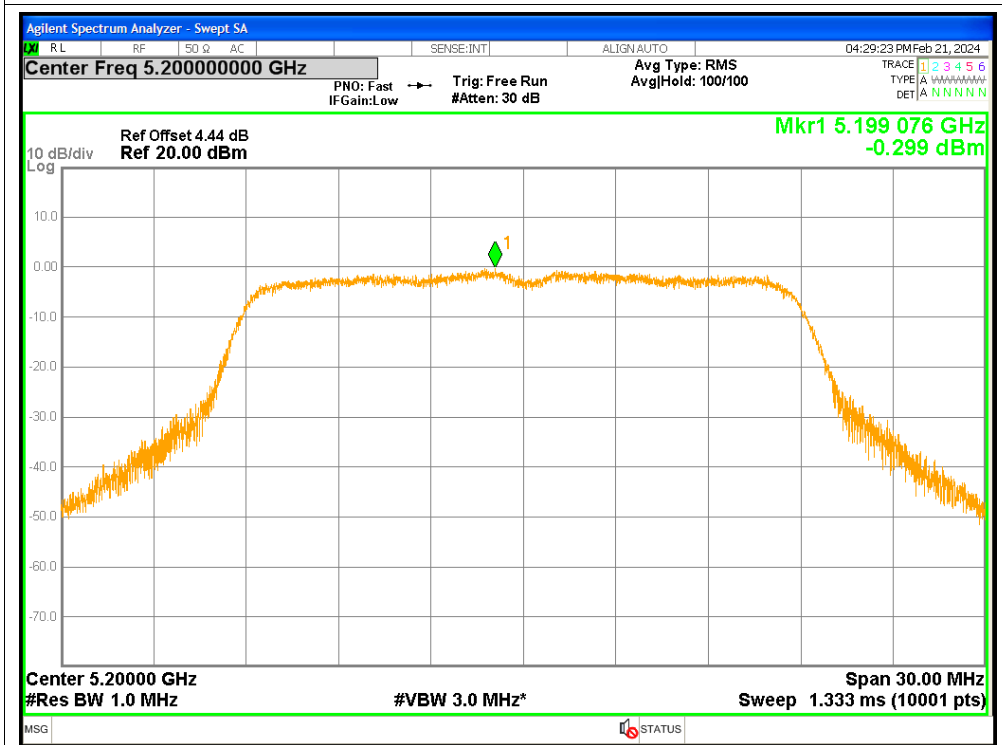


PSD NVNT n20 5240MHz Ant1

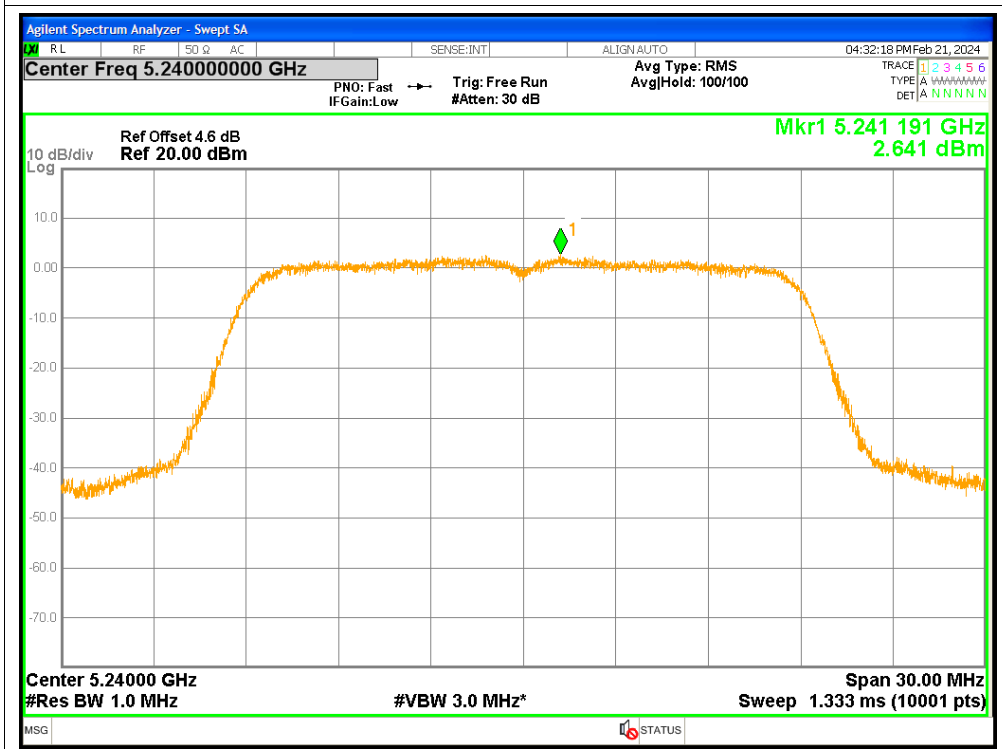


PSD NVNT n20 5240MHz Ant2

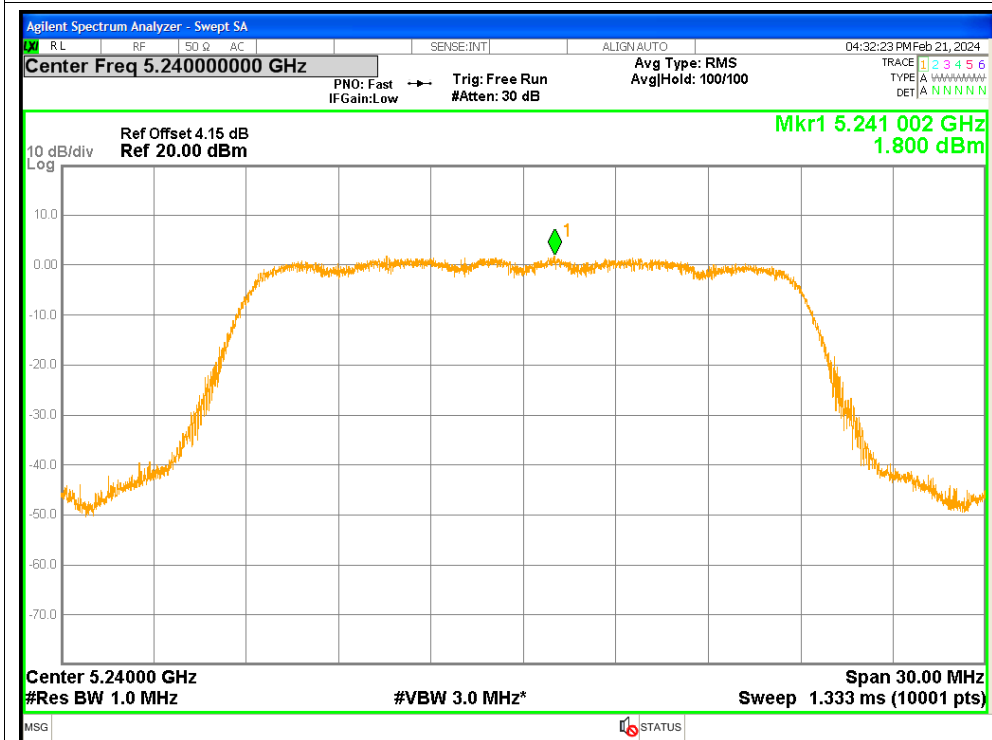


PSD NVNT n20 5240MHz Ant3

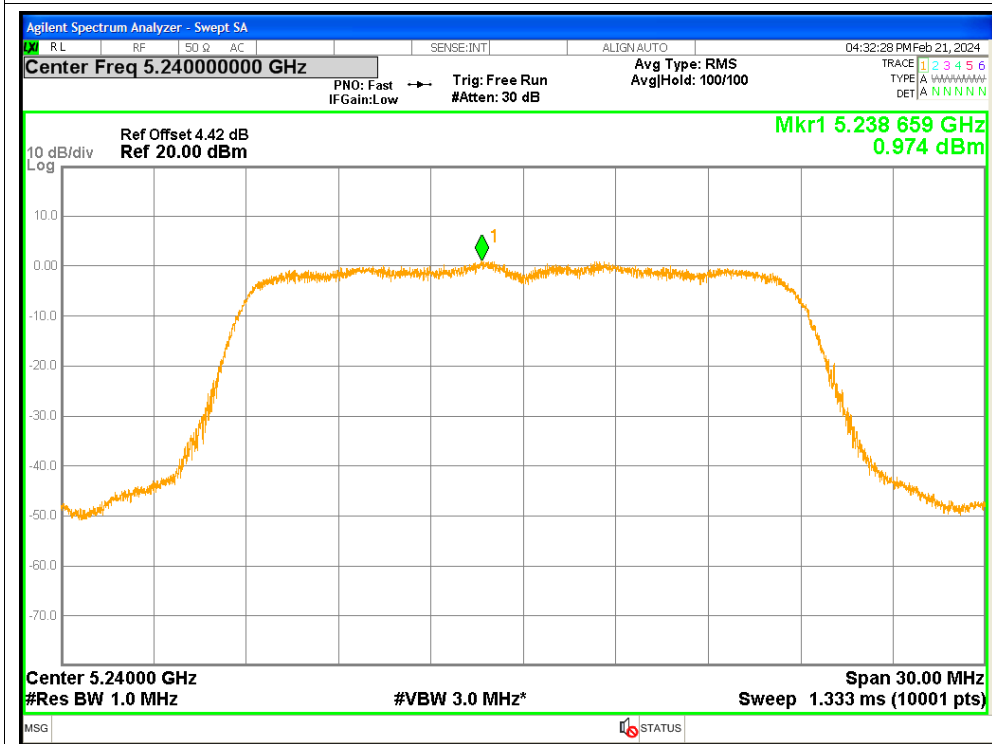


PSD NVNT n40 5190MHz Ant1

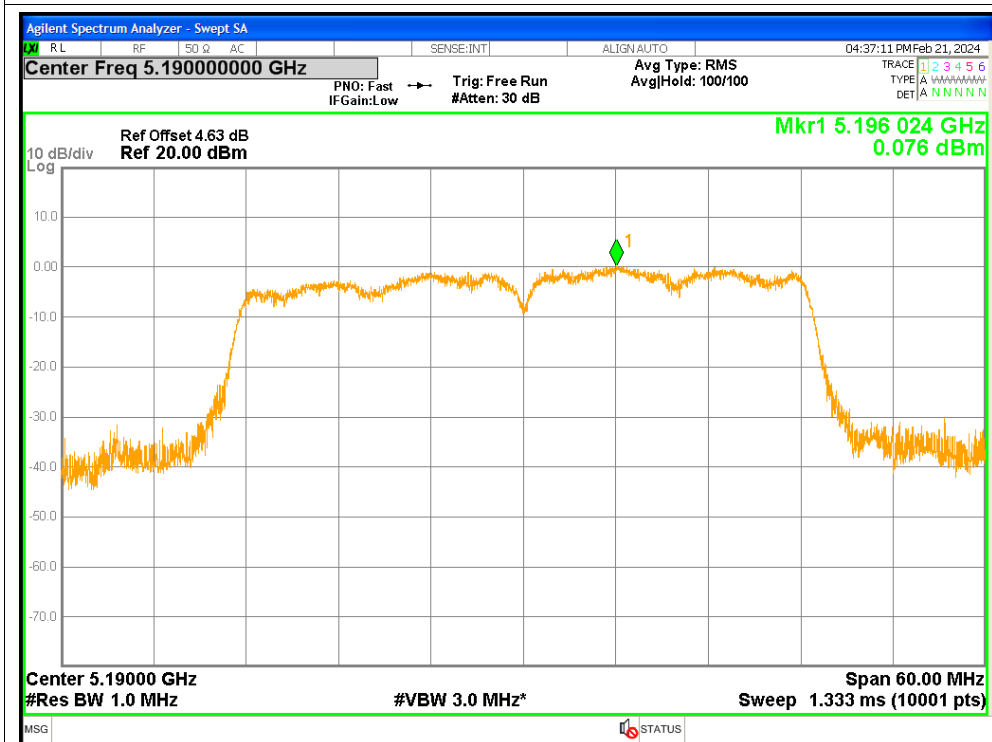


PSD NVNT n40 5190MHz Ant2

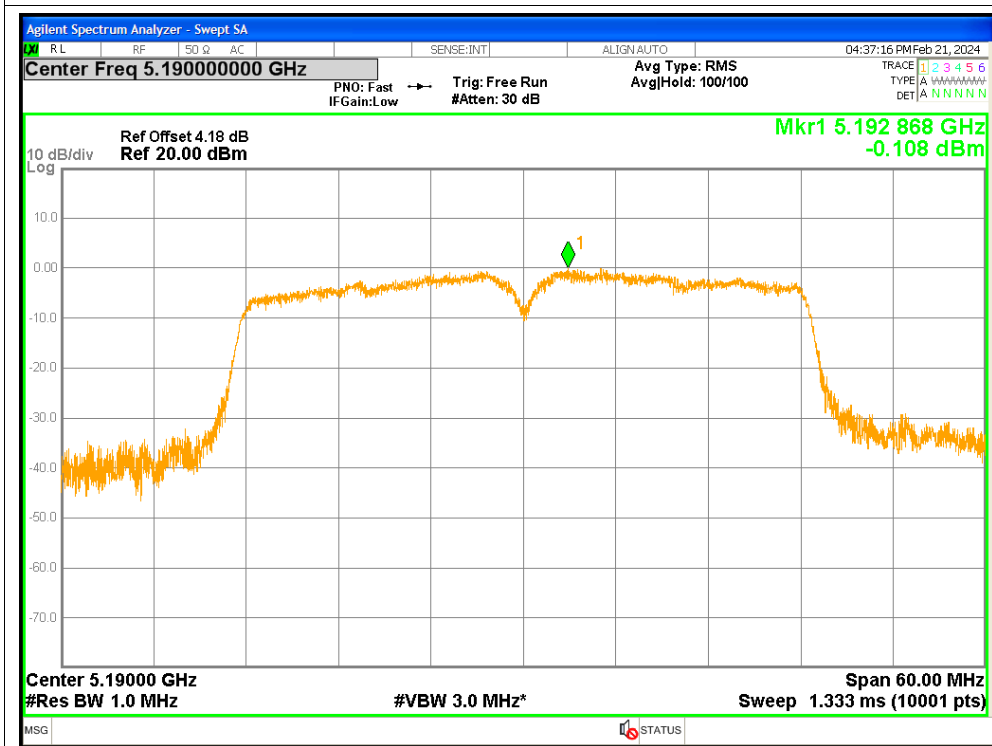


PSD NVNT n40 5190MHz Ant3

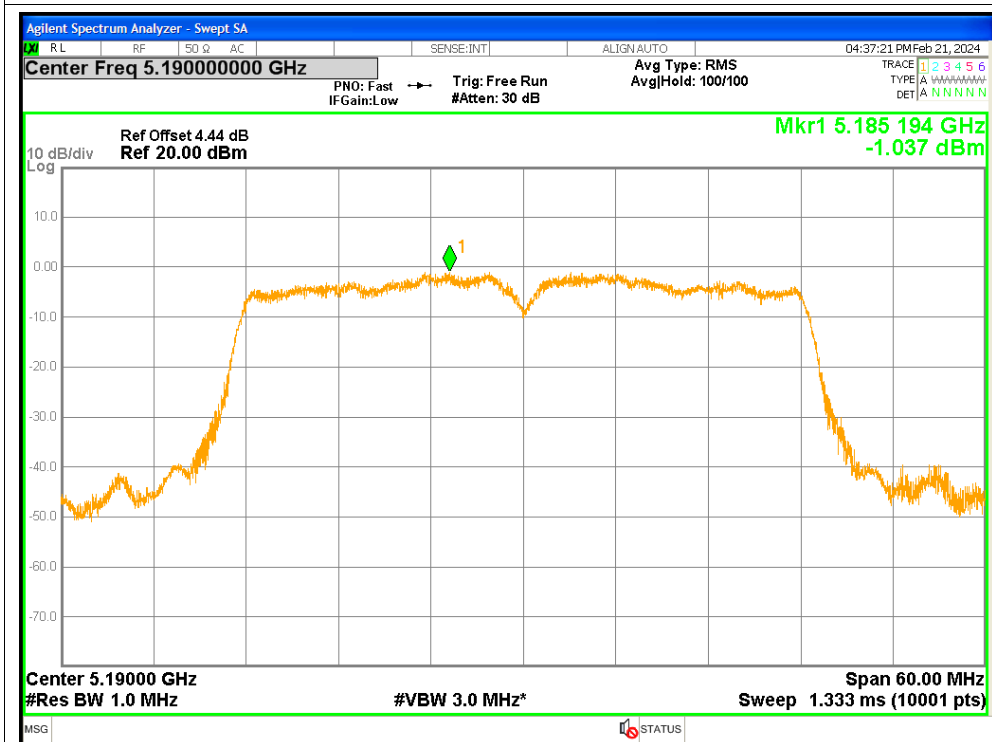

PSD NVNT n40 5230MHz Ant1

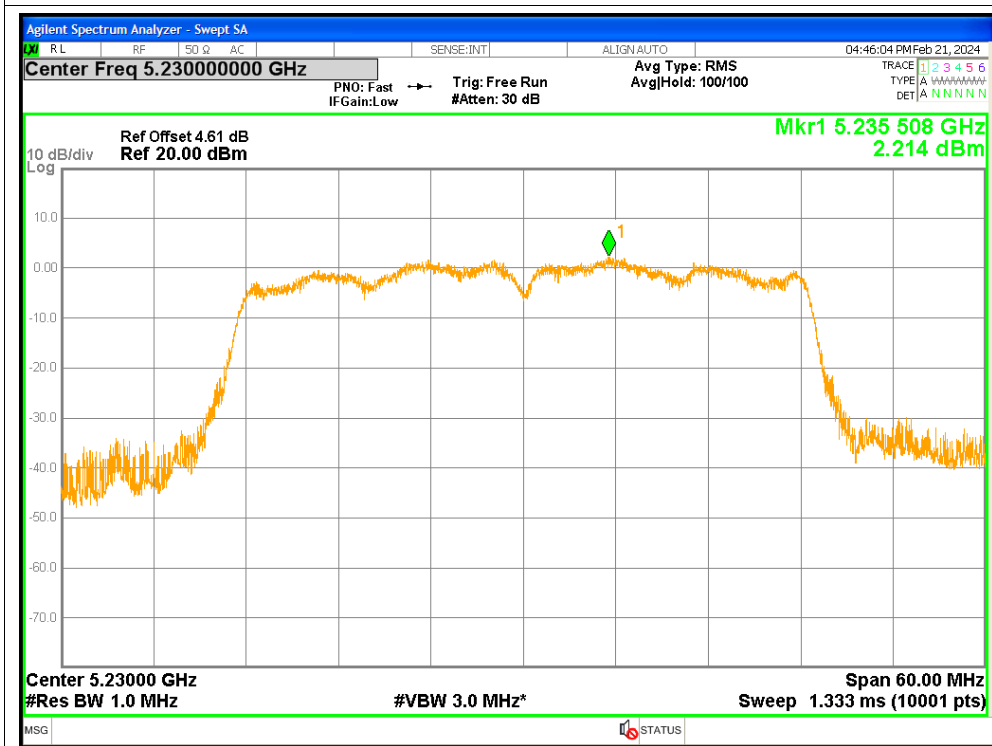

PSD NVNT n40 5230MHz Ant2

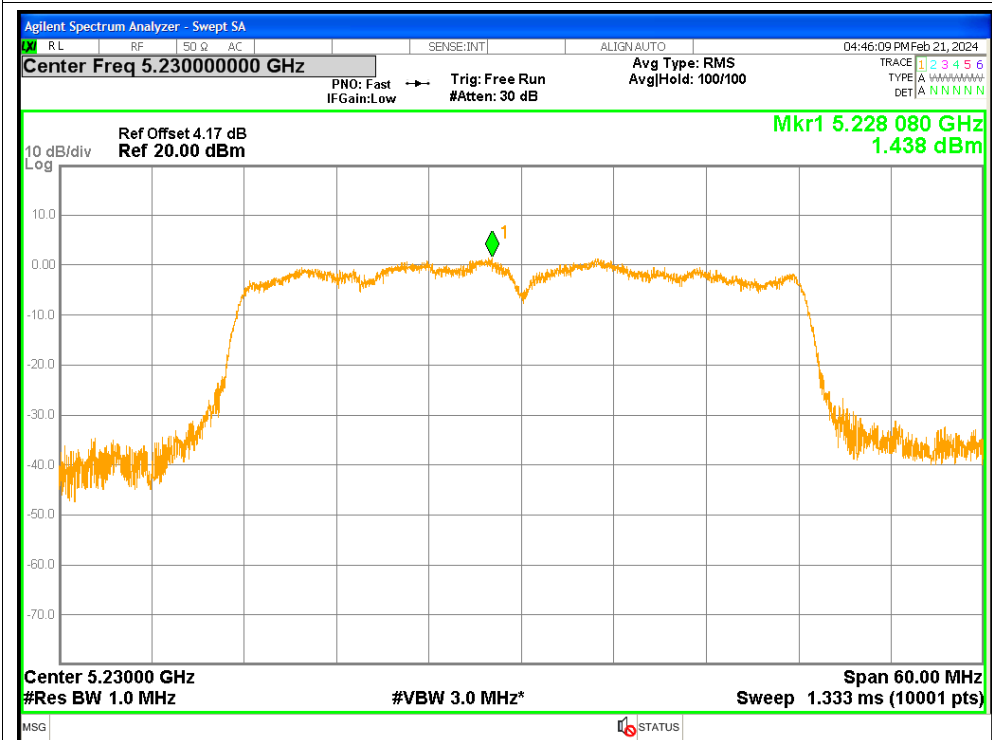

PSD NVNT n40 5230MHz Ant3

