


## 1. Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant1	96.18	0.17	0.72
NVNT	a	5580	Ant1	96.18	0.17	0.72
NVNT	a	5700	Ant1	96.18	0.17	0.72
NVNT	a	5500	Ant2	96.18	0.17	0.72
NVNT	a	5580	Ant2	96.21	0.17	0.72
NVNT	a	5700	Ant2	96.18	0.17	0.72
NVNT	a	5500	Ant3	96.15	0.17	0.72
NVNT	a	5580	Ant3	96.15	0.17	0.72
NVNT	a	5700	Ant3	96.15	0.17	0.72
NVNT	ac160	5570	Sum	67.2	1.73	9.86
NVNT	ac20	5500	Sum	89.56	0.48	2.08
NVNT	ac20	5580	Sum	89.48	0.48	2.08
NVNT	ac20	5700	Sum	89.57	0.48	2.08
NVNT	ac40	5510	Sum	82.49	0.84	3.82
NVNT	ac40	5550	Sum	82.49	0.84	3.82
NVNT	ac40	5670	Sum	82.49	0.84	3.82
NVNT	ac80	5530	Sum	72.91	1.37	6.69
NVNT	ac80	5610	Sum	72.91	1.37	6.69
NVNT	ax160	5570	Sum	75	1.25	6.73
NVNT	ax20	5500	Sum	88.58	0.53	2.32
NVNT	ax20	5580	Sum	88.48	0.53	2.33
NVNT	ax20	5700	Sum	88.37	0.54	2.33
NVNT	ax40	5510	Sum	88.47	0.53	2.35
NVNT	ax40	5550	Sum	88.38	0.54	2.35
NVNT	ax40	5670	Sum	88.47	0.53	2.35
NVNT	ax80	5530	Sum	76.97	1.14	5.39
NVNT	ax80	5610	Sum	76.81	1.15	5.39
NVNT	n20	5500	Sum	95.89	0.18	0.77
NVNT	n20	5580	Sum	95.89	0.18	0.77
NVNT	n20	5700	Sum	95.89	0.18	0.77
NVNT	n40	5510	Sum	92.06	0.36	1.54
NVNT	n40	5550	Sum	92.06	0.36	1.54
NVNT	n40	5670	Sum	92.06	0.36	1.54




### Duty Cycle NVNT a 5700MHz Ant1

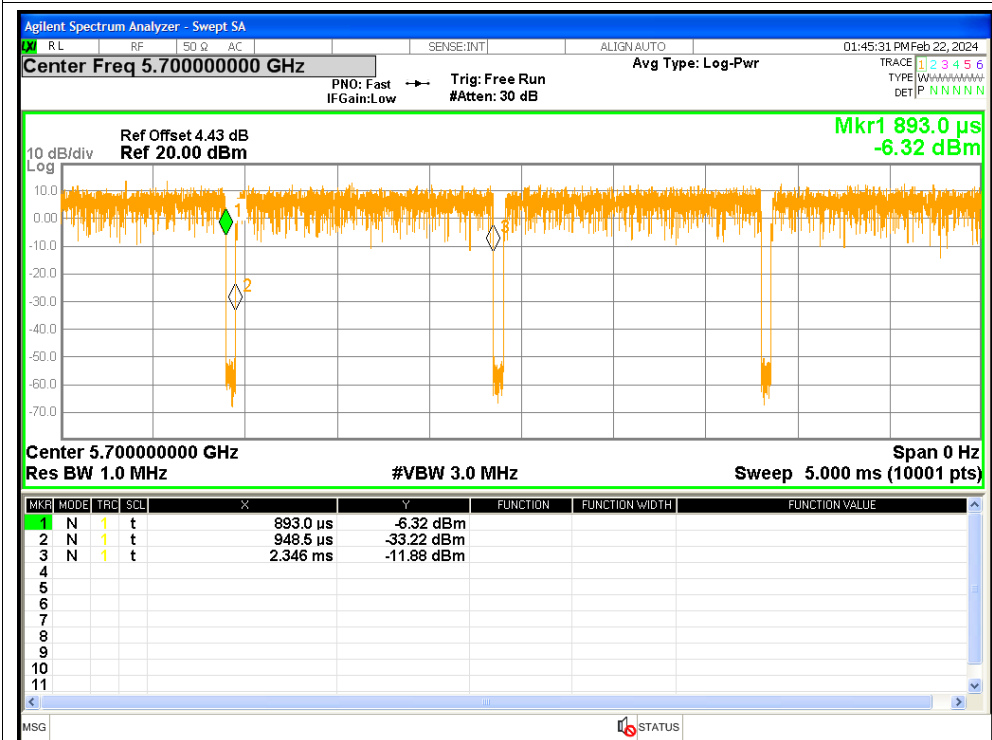


### Duty Cycle NVNT a 5500MHz Ant2

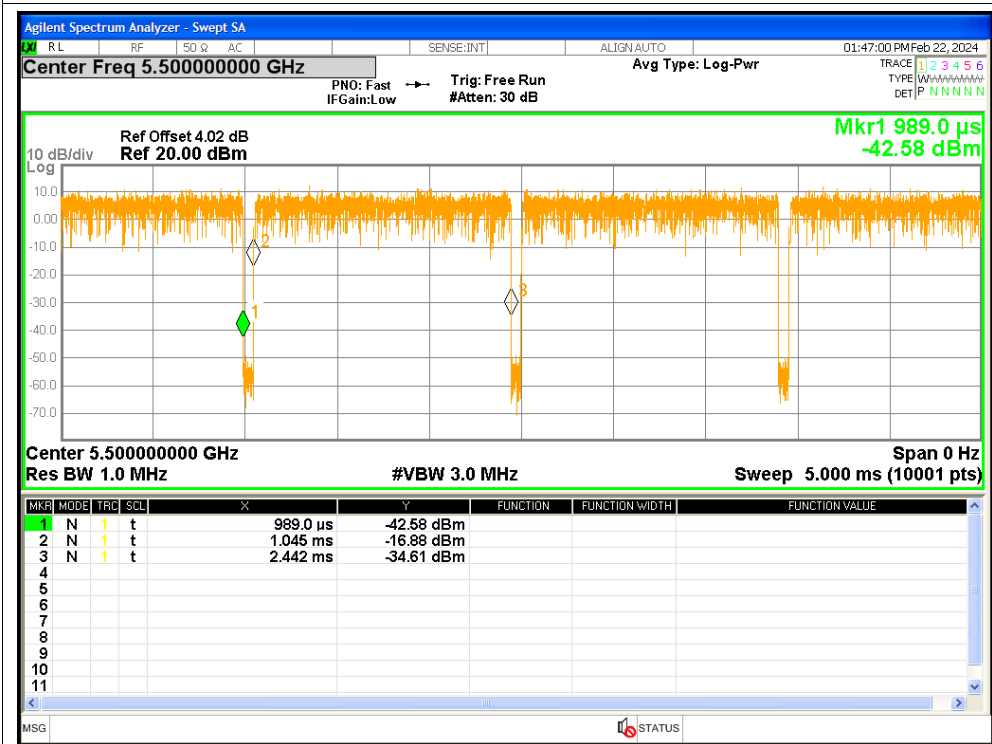

### Duty Cycle NVNT a 5580MHz Ant2

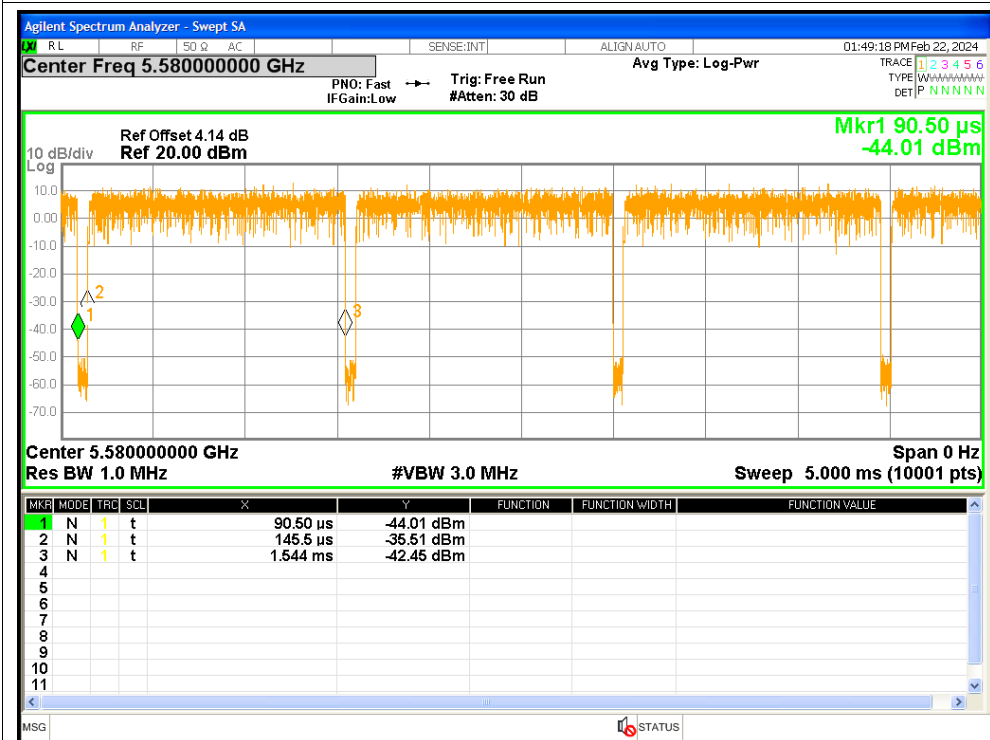


### Duty Cycle NVNT a 5700MHz Ant2

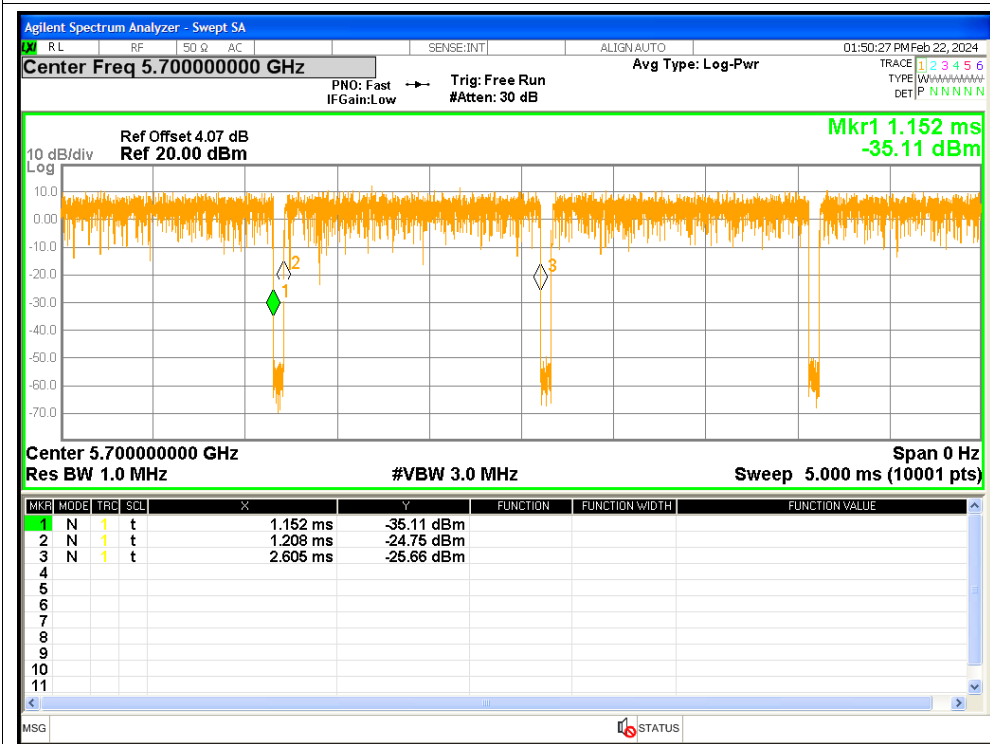





### Duty Cycle NVNT a 5700MHz Ant3

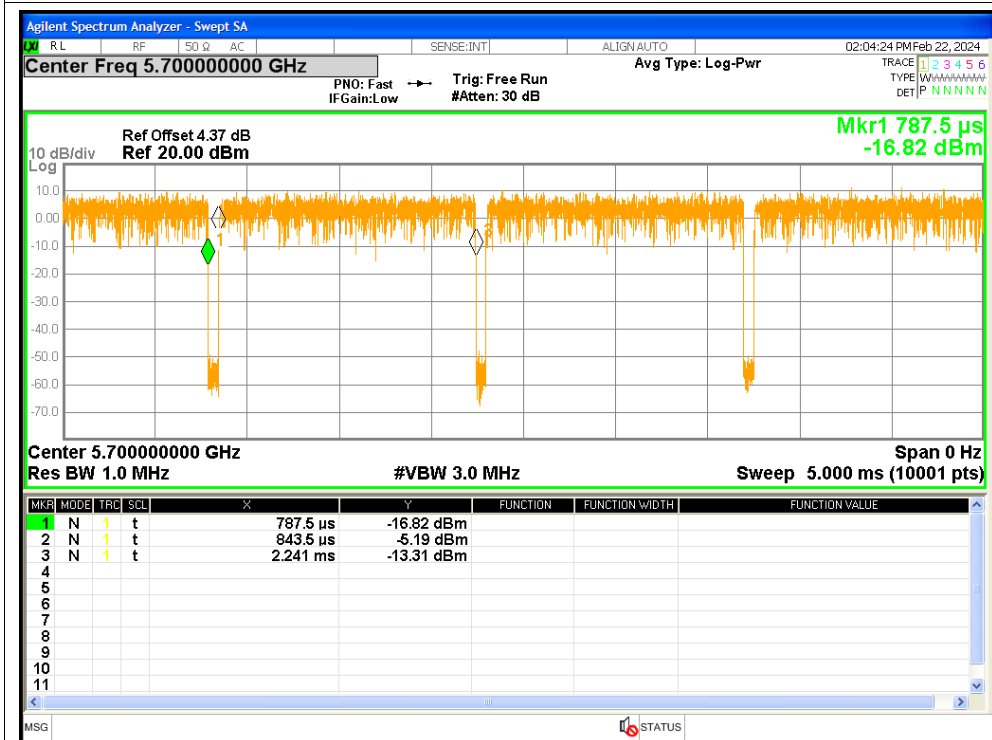


### Duty Cycle NVNT ac160 5570MHz Sum

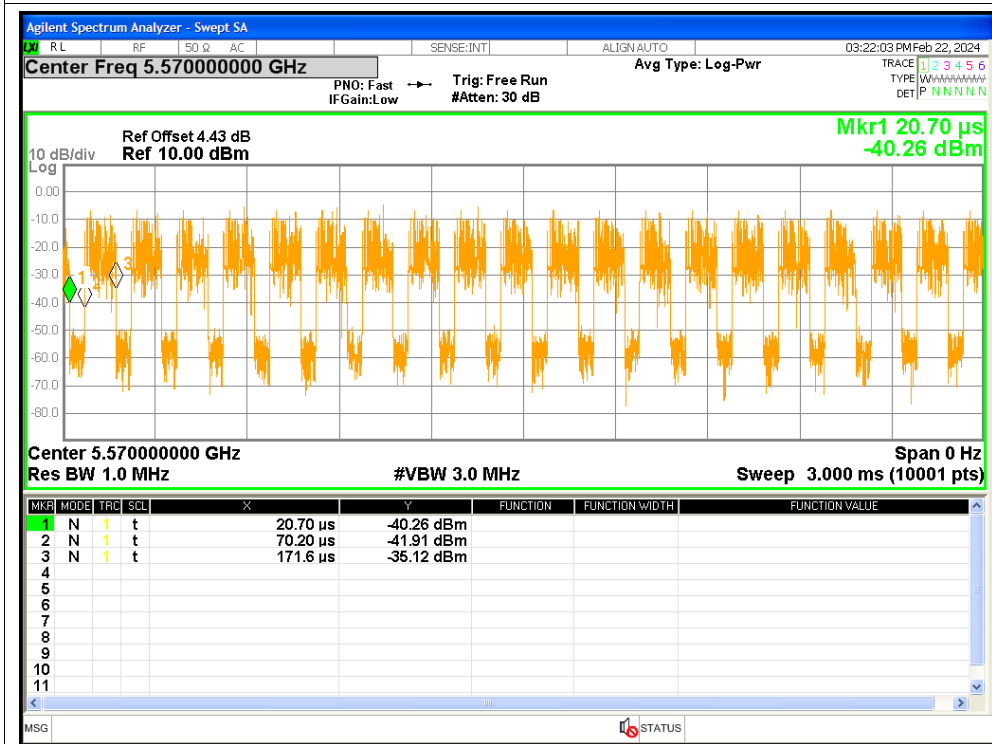


### Duty Cycle NVNT ac20 5500MHz Sum

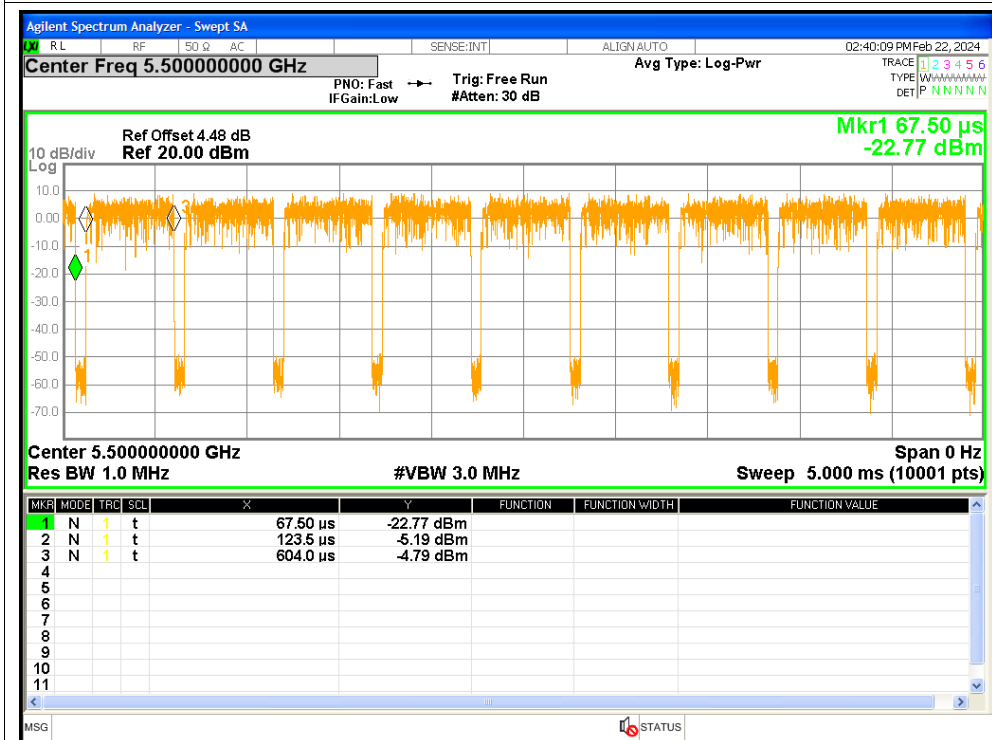


### Duty Cycle NVNT ac20 5580MHz Sum

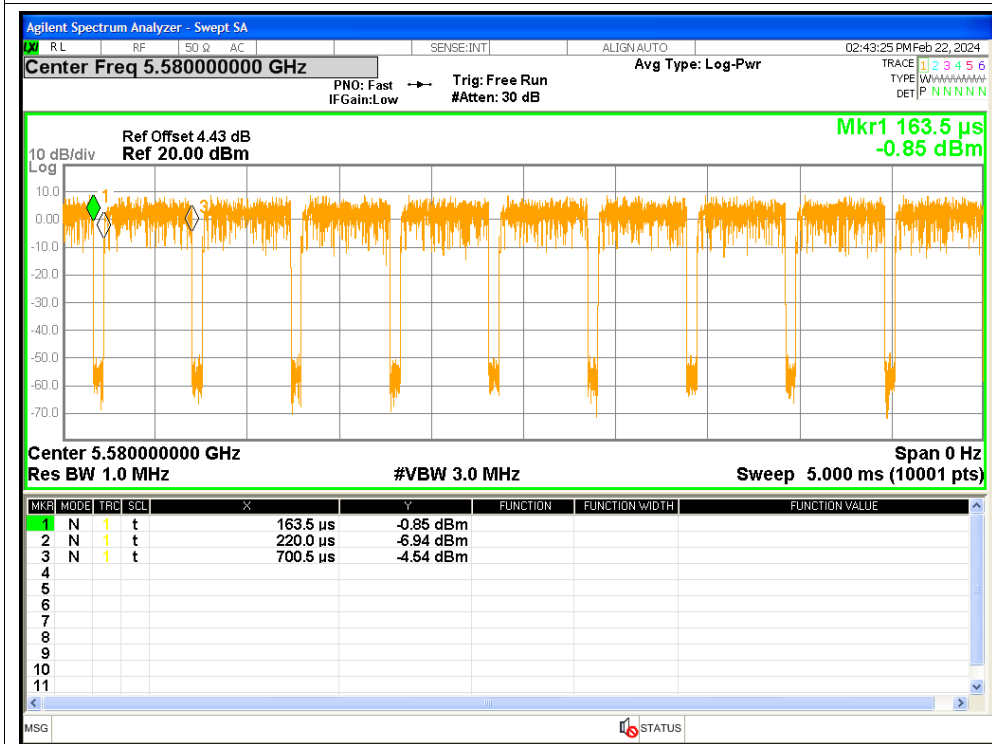

### Duty Cycle NVNT ac20 5700MHz Sum

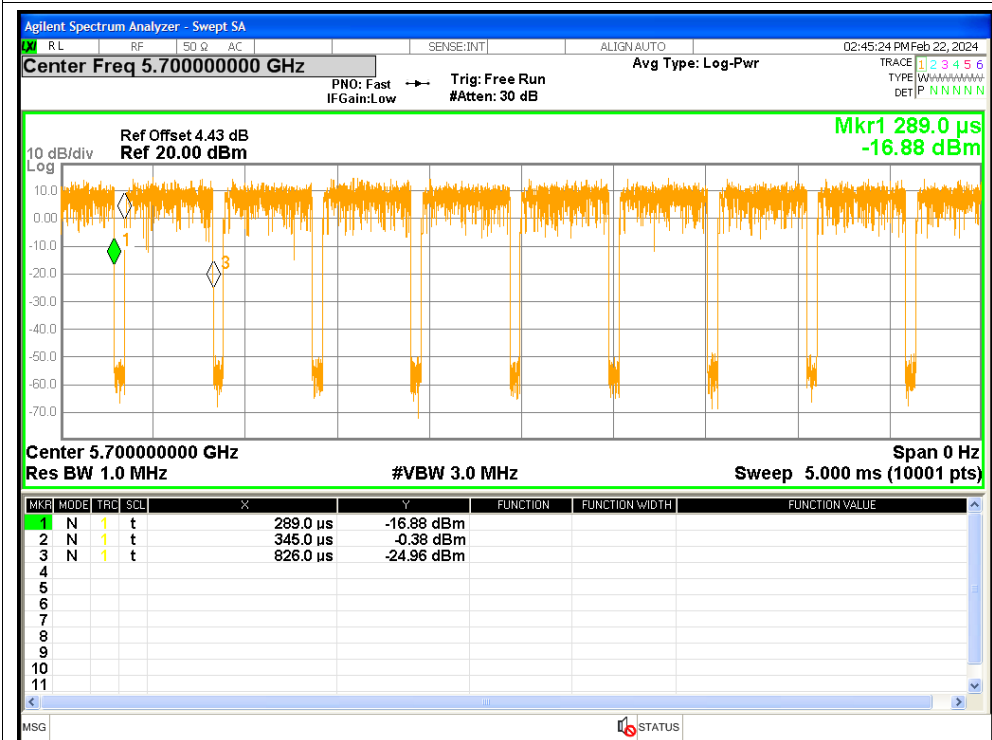


### Duty Cycle NVNT ac40 5510MHz Sum

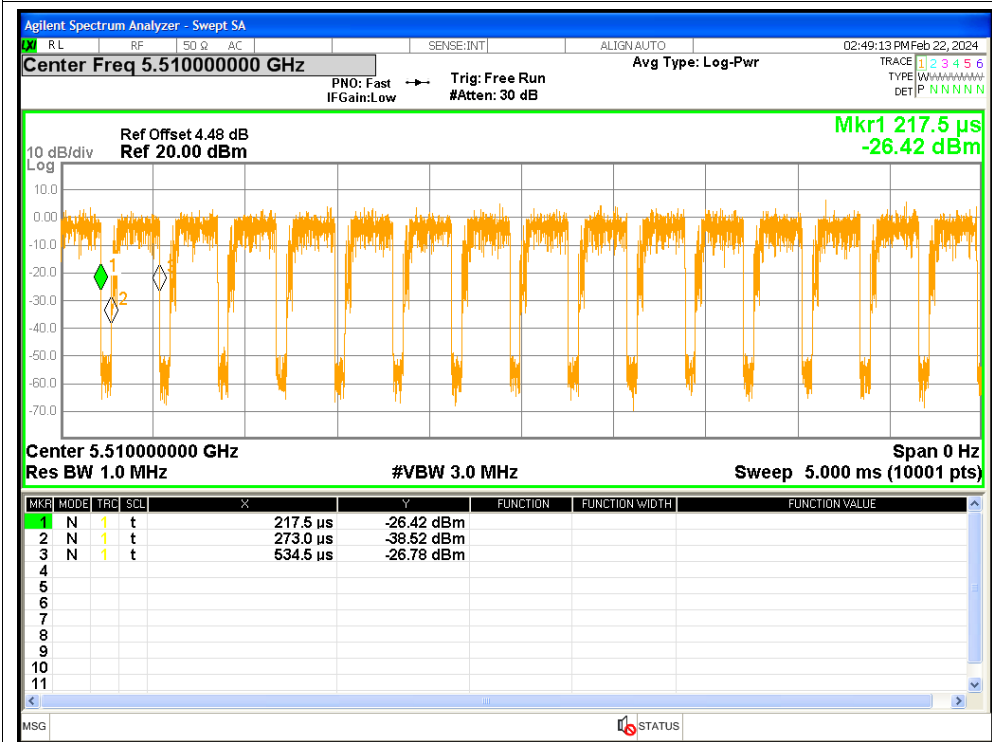







### Duty Cycle NVNT ac80 5530MHz Sum

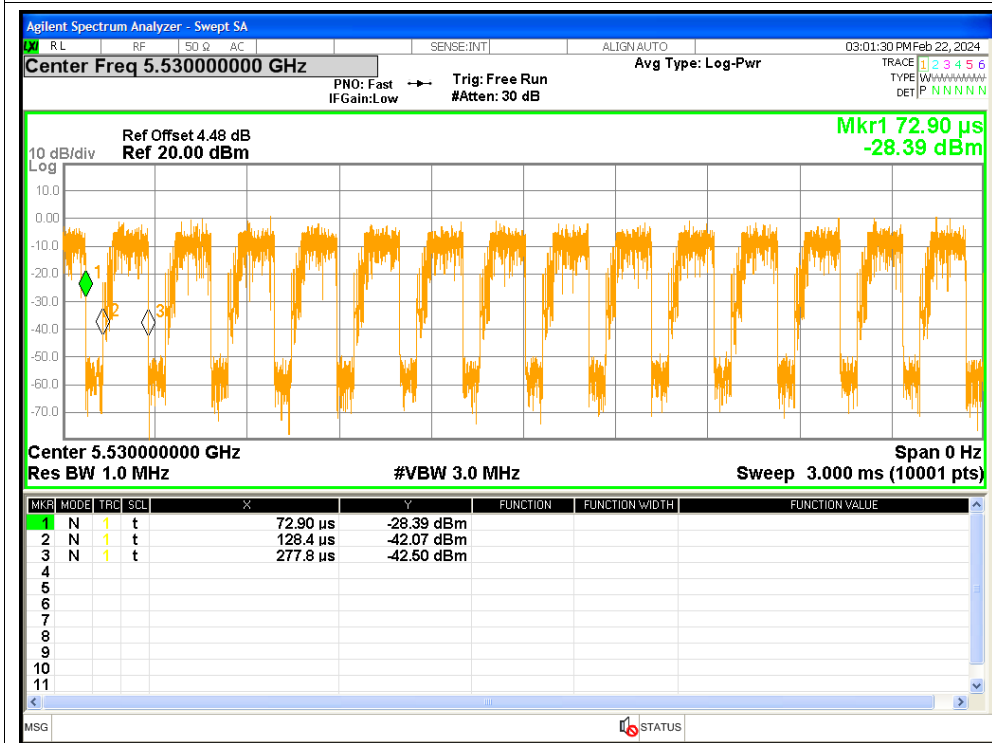


### Duty Cycle NVNT ac80 5610MHz Sum

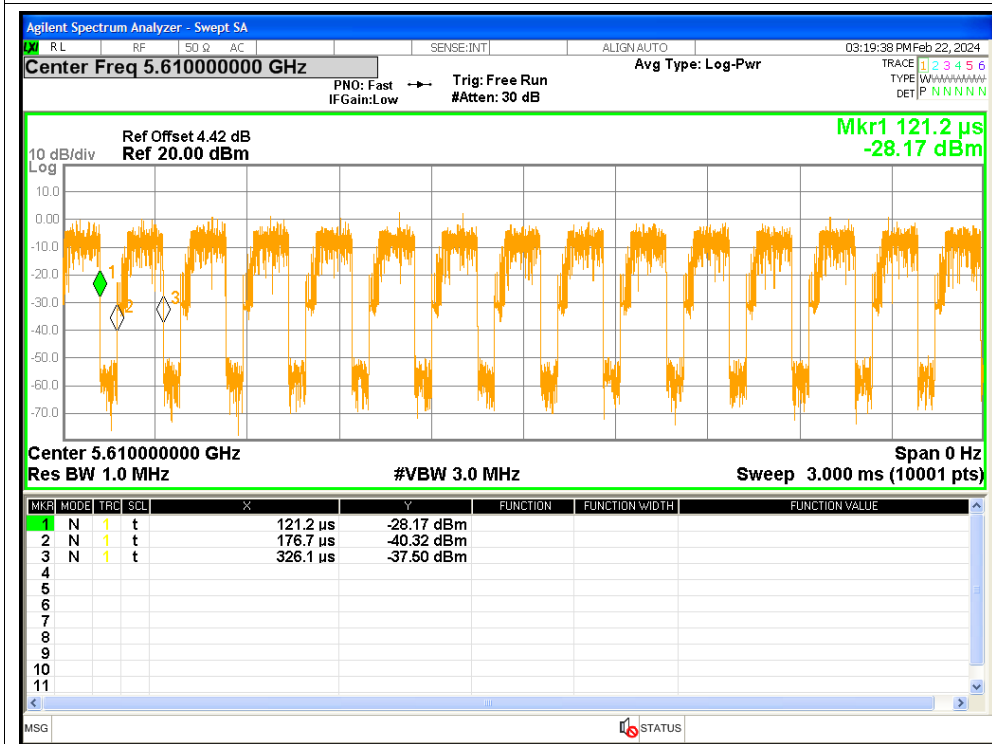


### Duty Cycle NVNT ax160 5570MHz Sum

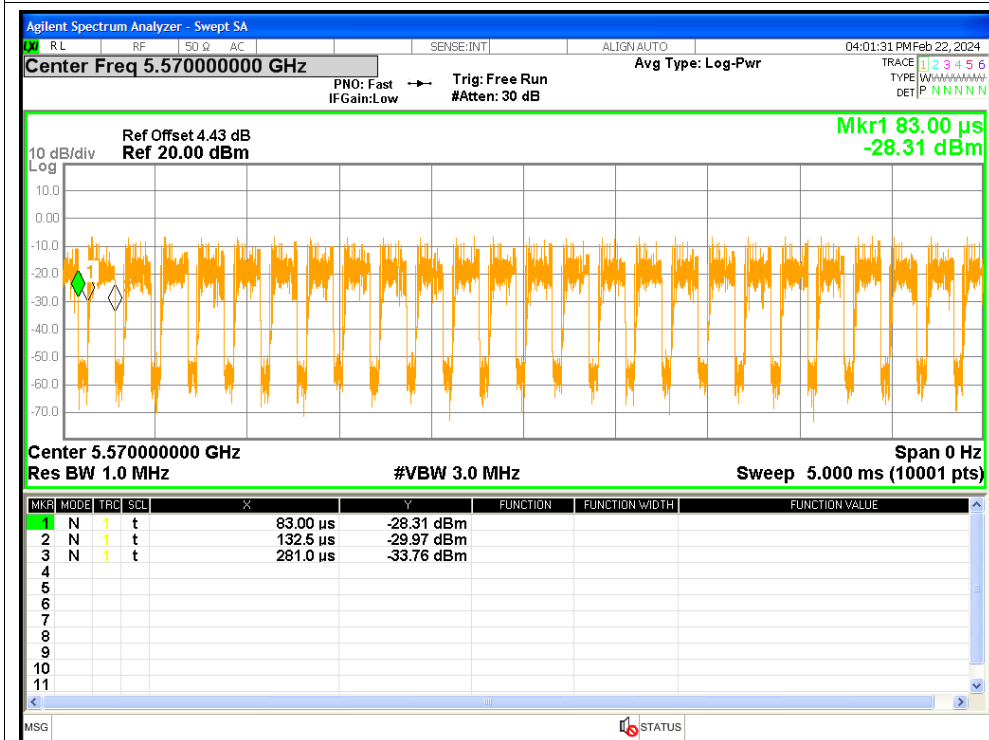


### Duty Cycle NVNT ax20 5500MHz Sum

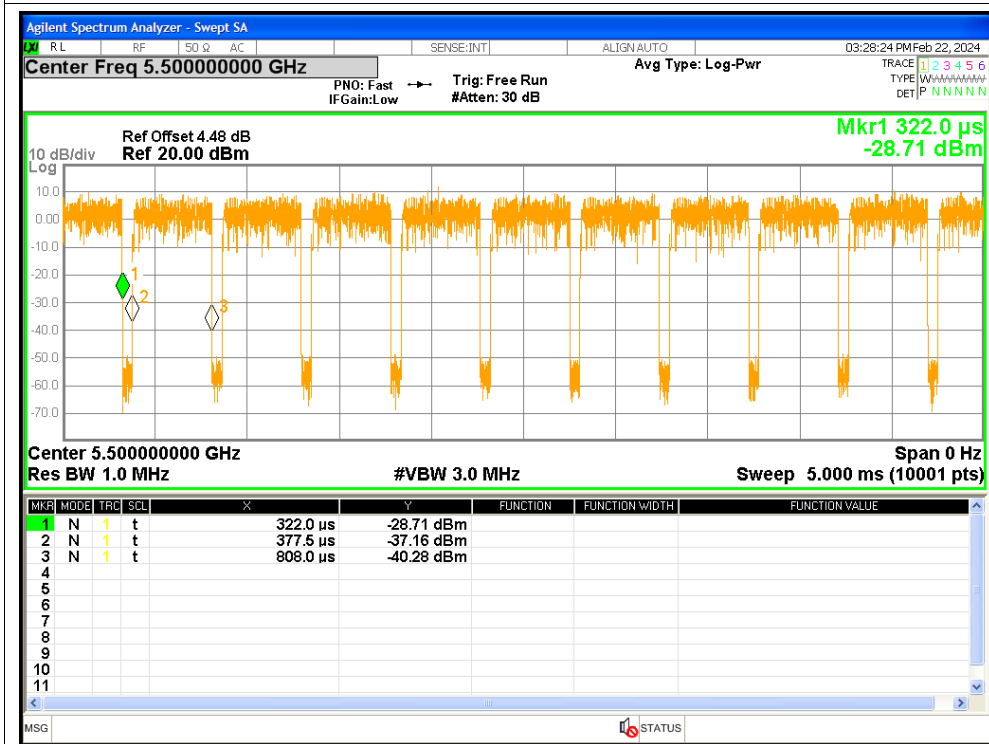


### Duty Cycle NVNT ax20 5580MHz Sum

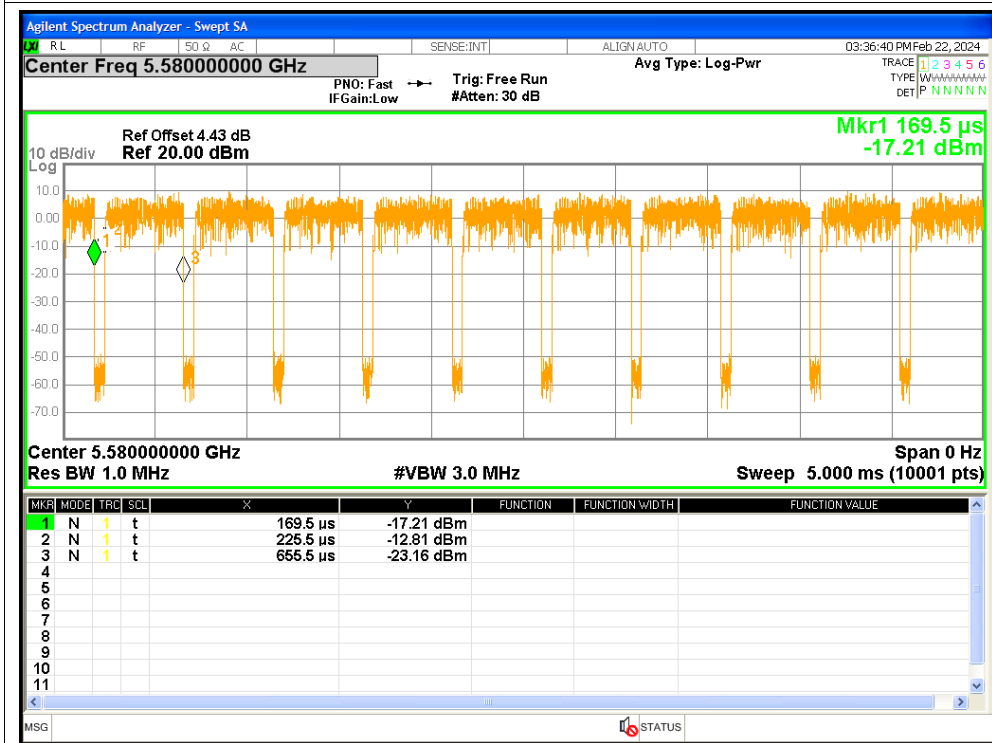


### Duty Cycle NVNT ax20 5700MHz Sum

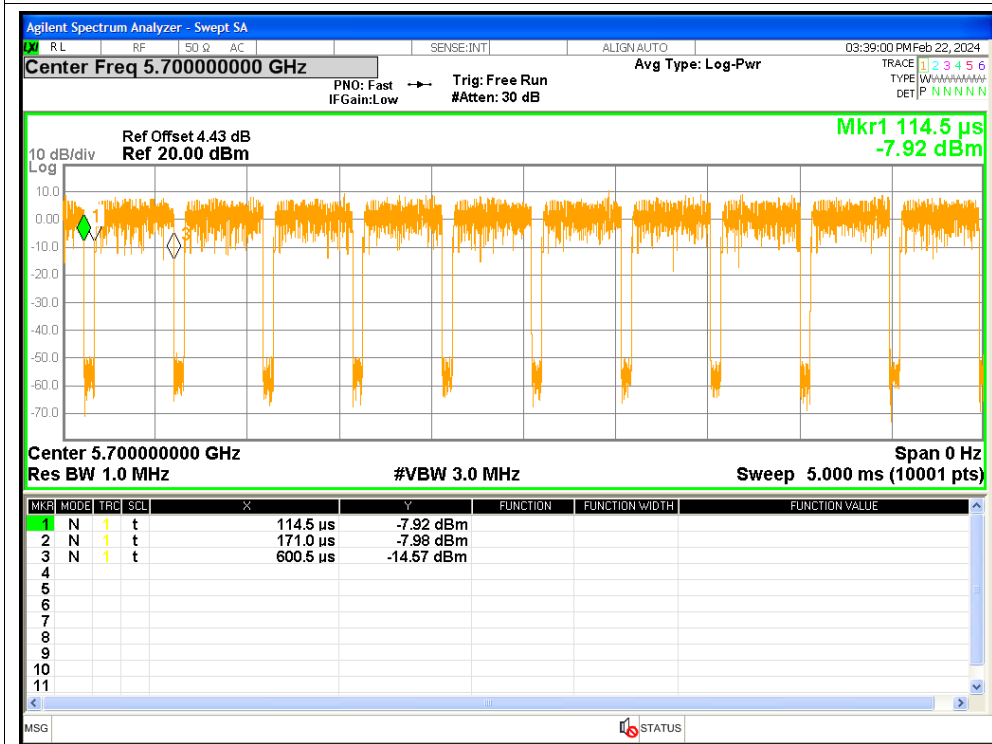


### Duty Cycle NVNT ax40 5510MHz Sum

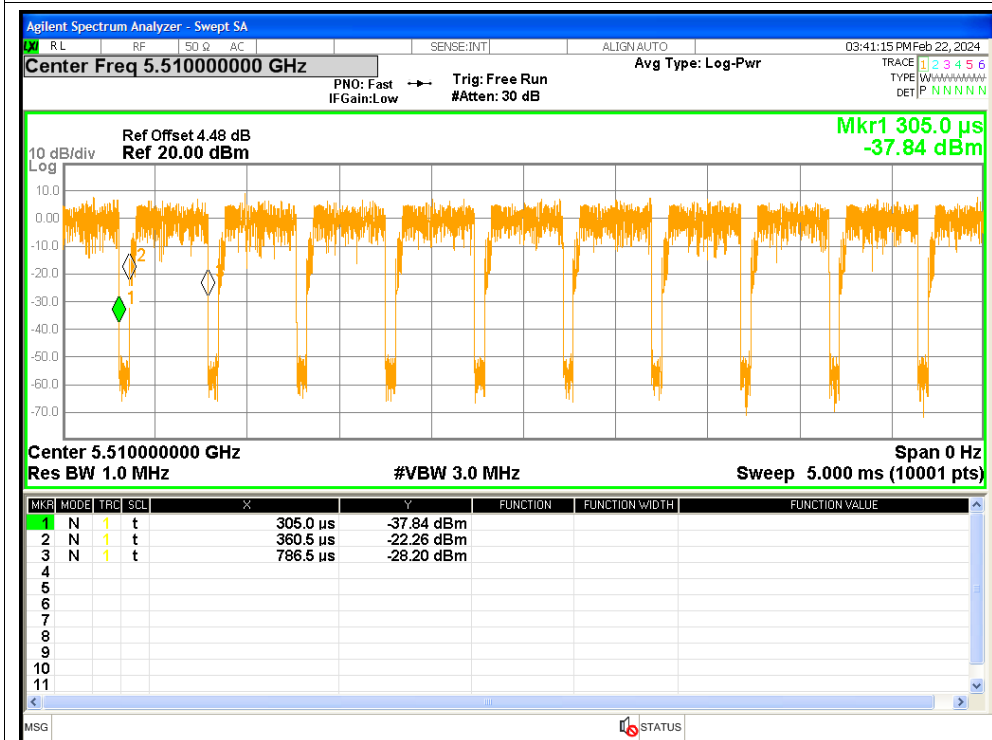


### Duty Cycle NVNT ax40 5550MHz Sum

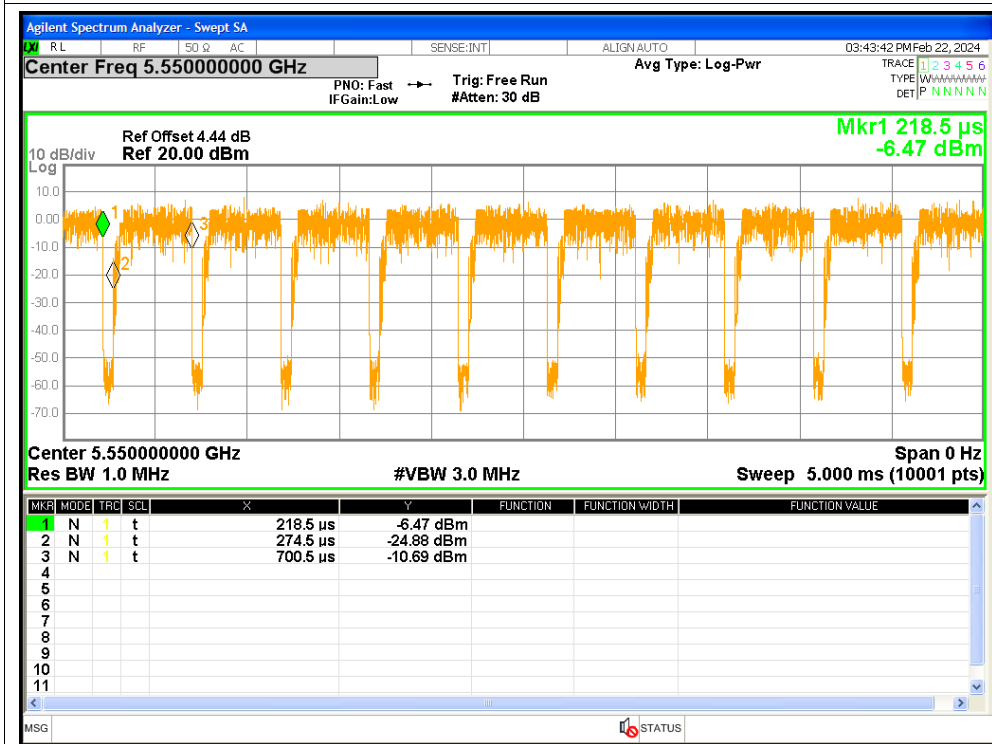


### Duty Cycle NVNT ax40 5670MHz Sum

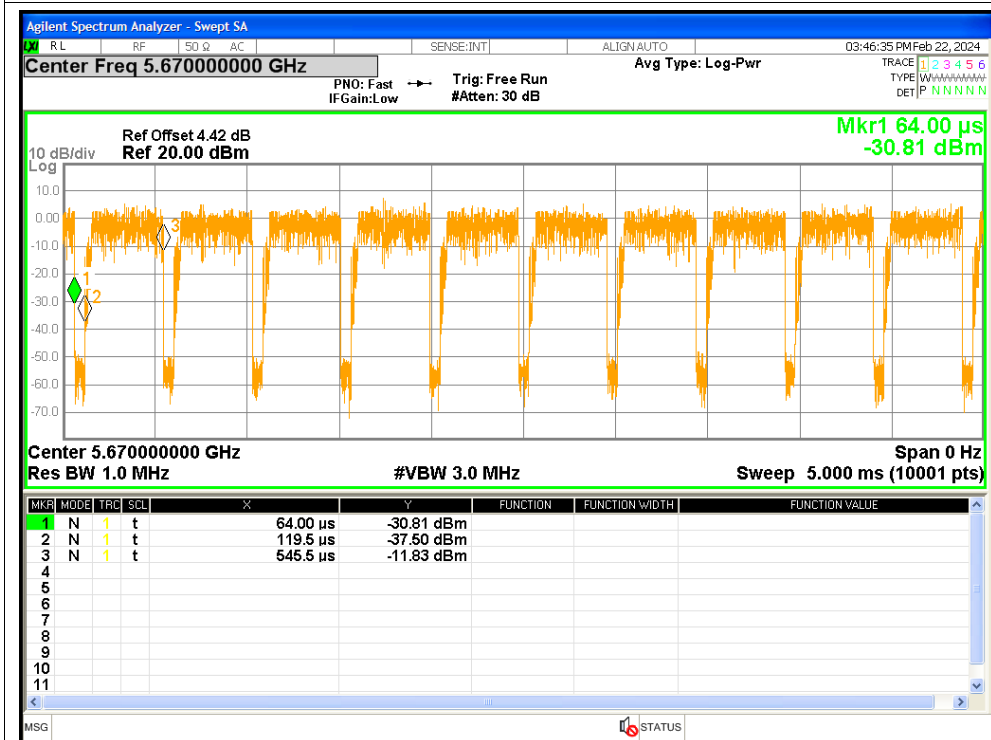


### Duty Cycle NVNT ax80 5530MHz Sum

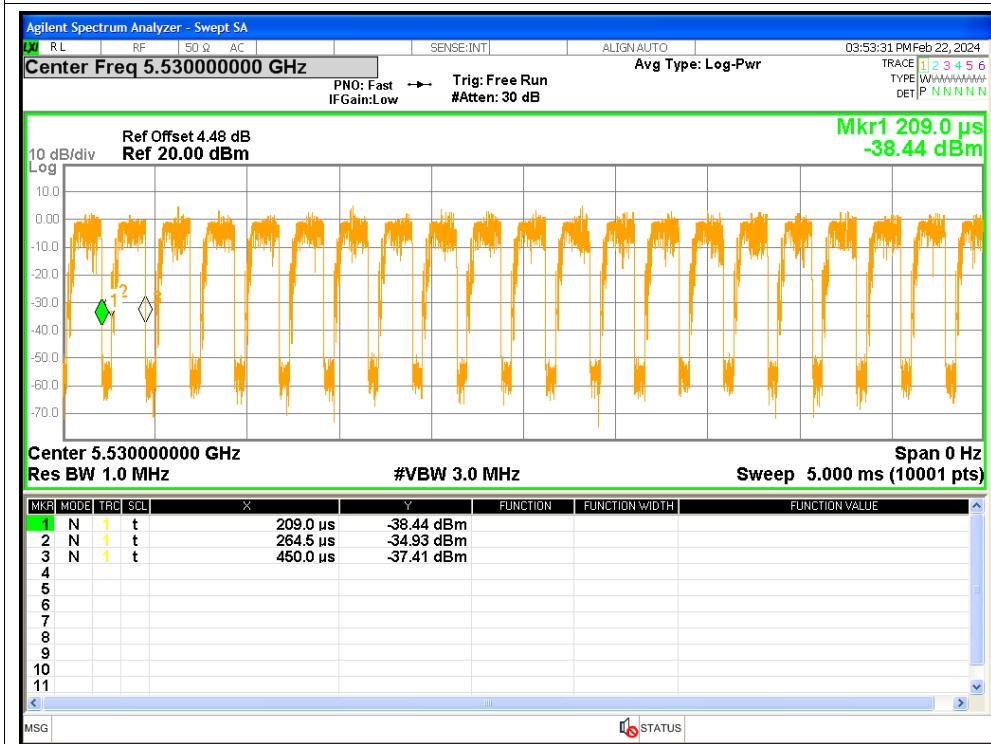


### Duty Cycle NVNT ax80 5610MHz Sum

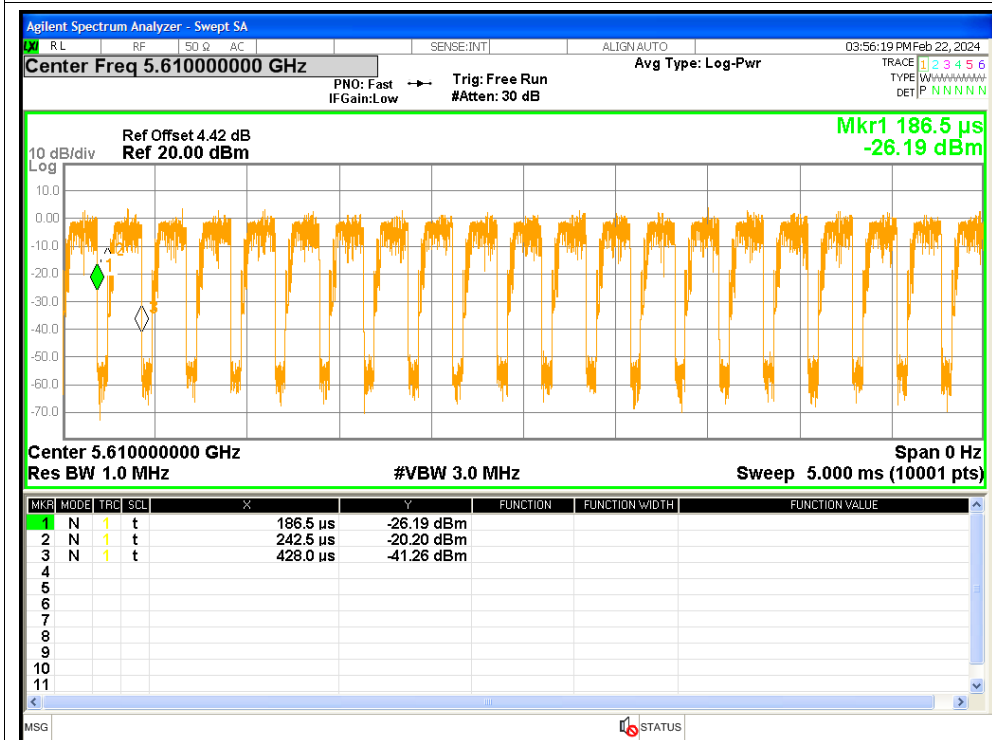


### Duty Cycle NVNT n20 5500MHz Sum

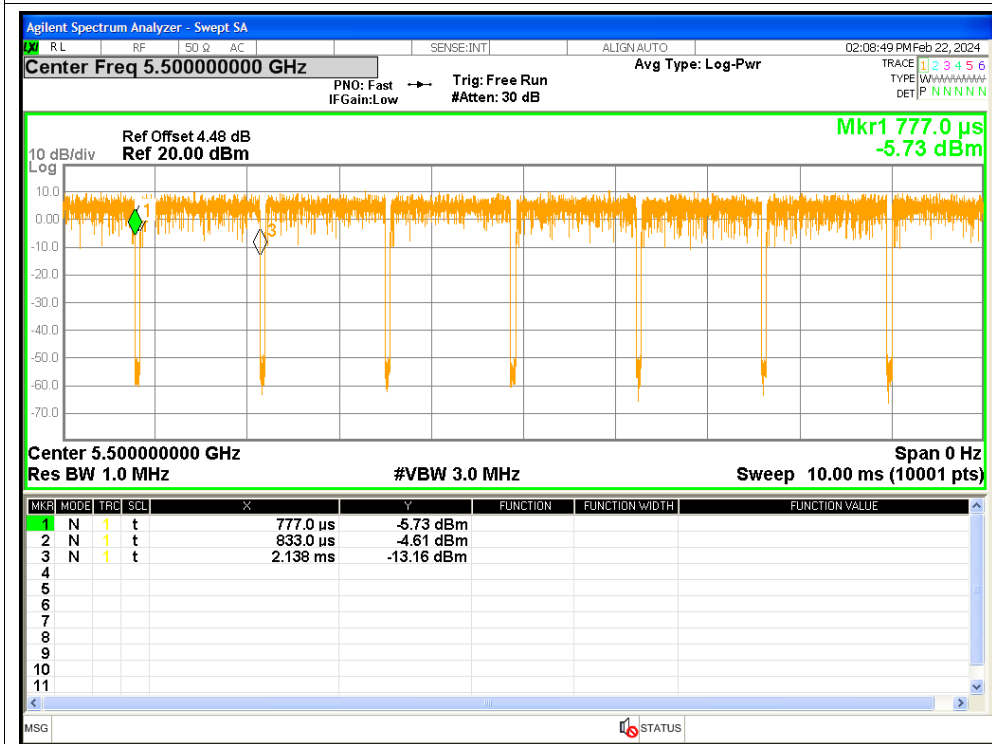

### Duty Cycle NVNT n20 5580MHz Sum

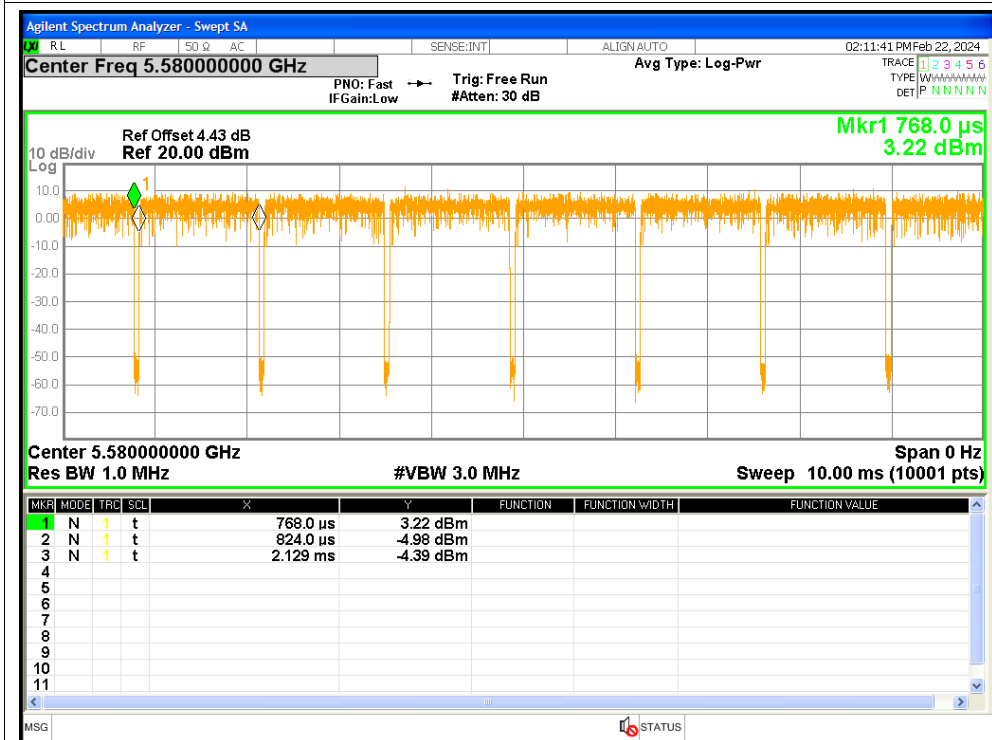

### Duty Cycle NVNT n20 5700MHz Sum

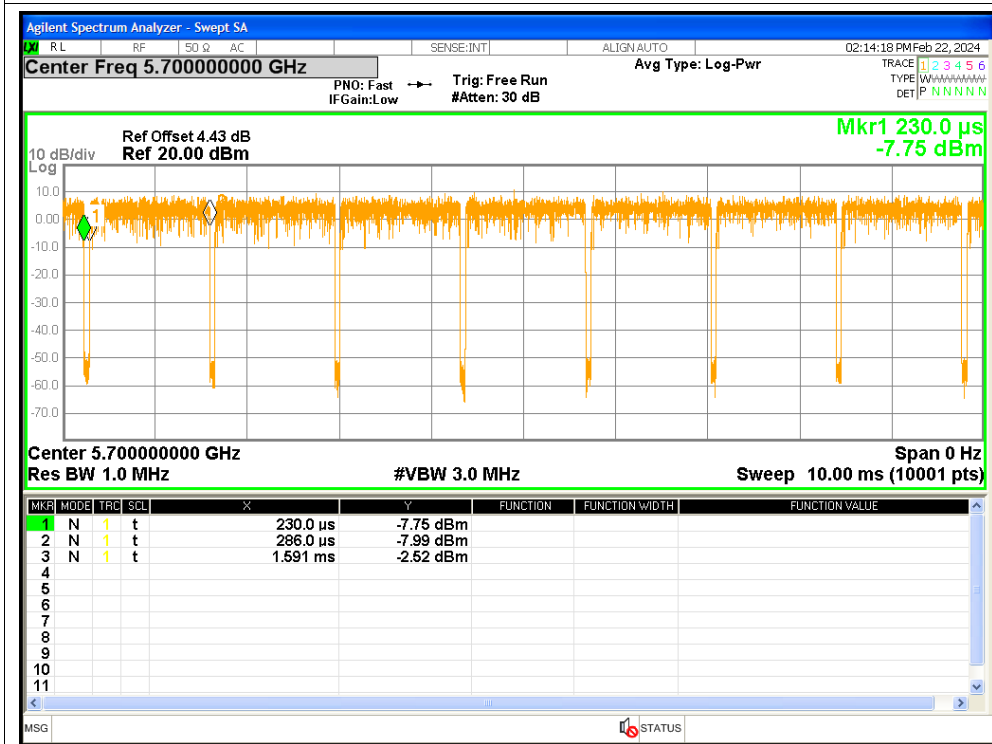







## 2. Maximum Conducted Output Power


Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5500	Ant1	17.46	0.17	17.63	<=24	Pass
NVNT	a	5580	Ant1	16.76	0.17	16.93	<=24	Pass
NVNT	a	5700	Ant1	16.73	0.17	16.9	<=24	Pass
NVNT	a	5500	Ant2	15.8	0.17	15.97	<=24	Pass
NVNT	a	5580	Ant2	15.97	0.17	16.14	<=24	Pass
NVNT	a	5700	Ant2	14.88	0.17	15.05	<=24	Pass
NVNT	a	5500	Ant3	15.42	0.17	15.59	<=24	Pass
NVNT	a	5580	Ant3	14.58	0.17	14.75	<=24	Pass
NVNT	a	5700	Ant3	14.16	0.17	14.33	<=24	Pass
NVNT	ac160	5570	Ant1	11.34	1.73	13.07	<=24	Pass
NVNT	ac160	5570	Ant2	10.21	1.73	11.94	<=24	Pass
NVNT	ac160	5570	Ant3	10.02	1.73	11.75	<=24	Pass
NVNT	ac160	5570	Sum	15.33	1.73	17.06	<=22.67	Pass
NVNT	ac20	5500	Ant1	13.35	0.48	13.83	<=24	Pass
NVNT	ac20	5500	Ant2	11.93	0.48	12.41	<=24	Pass
NVNT	ac20	5500	Ant3	11.46	0.48	11.94	<=24	Pass
NVNT	ac20	5500	Sum	17.09	0.48	17.57	<=22.67	Pass
NVNT	ac20	5580	Ant1	12.87	0.48	13.35	<=24	Pass
NVNT	ac20	5580	Ant2	12.07	0.48	12.55	<=24	Pass
NVNT	ac20	5580	Ant3	10.72	0.48	11.2	<=24	Pass
NVNT	ac20	5580	Sum	16.75	0.48	17.23	<=22.67	Pass
NVNT	ac20	5700	Ant1	12.67	0.48	13.15	<=24	Pass
NVNT	ac20	5700	Ant2	10.86	0.48	11.34	<=24	Pass
NVNT	ac20	5700	Ant3	10.3	0.48	10.78	<=24	Pass
NVNT	ac20	5700	Sum	16.17	0.48	16.65	<=22.67	Pass
NVNT	ac40	5510	Ant1	13.04	0.84	13.88	<=24	Pass
NVNT	ac40	5510	Ant2	11.69	0.84	12.53	<=24	Pass
NVNT	ac40	5510	Ant3	11.34	0.84	12.18	<=24	Pass
NVNT	ac40	5510	Sum	16.86	0.84	17.7	<=22.67	Pass
NVNT	ac40	5550	Ant1	12.84	0.84	13.68	<=24	Pass
NVNT	ac40	5550	Ant2	11.62	0.84	12.46	<=24	Pass
NVNT	ac40	5550	Ant3	11.31	0.84	12.15	<=24	Pass
NVNT	ac40	5550	Sum	16.75	0.84	17.59	<=22.67	Pass
NVNT	ac40	5670	Ant1	11.31	0.84	12.15	<=24	Pass
NVNT	ac40	5670	Ant2	10.79	0.84	11.63	<=24	Pass
NVNT	ac40	5670	Ant3	9.67	0.84	10.51	<=24	Pass
NVNT	ac40	5670	Sum	15.41	0.84	16.25	<=22.67	Pass
NVNT	ac80	5530	Ant1	12.3	1.37	13.67	<=24	Pass
NVNT	ac80	5530	Ant2	10.99	1.37	12.36	<=24	Pass

NVNT	ac80	5530	Ant3	10.58	1.37	11.95	<=24	Pass
NVNT	ac80	5530	Sum	16.12	1.37	17.49	<=22.67	Pass
NVNT	ac80	5610	Ant1	12.17	1.37	13.54	<=24	Pass
NVNT	ac80	5610	Ant2	11.29	1.37	12.66	<=24	Pass
NVNT	ac80	5610	Ant3	9.72	1.37	11.09	<=24	Pass
NVNT	ac80	5610	Sum	15.95	1.37	17.32	<=22.67	Pass
NVNT	ax160	5570	Ant1	11.98	1.25	13.23	<=24	Pass
NVNT	ax160	5570	Ant2	11.17	1.25	12.42	<=24	Pass
NVNT	ax160	5570	Ant3	10.96	1.25	12.21	<=24	Pass
NVNT	ax160	5570	Sum	16.16	1.25	17.41	<=22.67	Pass
NVNT	ax20	5500	Ant1	13.59	0.53	14.12	<=24	Pass
NVNT	ax20	5500	Ant2	12.1	0.53	12.63	<=24	Pass
NVNT	ax20	5500	Ant3	11.62	0.53	12.15	<=24	Pass
NVNT	ax20	5500	Sum	17.29	0.53	17.82	<=22.67	Pass
NVNT	ax20	5580	Ant1	12.92	0.53	13.45	<=24	Pass
NVNT	ax20	5580	Ant2	12.17	0.53	12.7	<=24	Pass
NVNT	ax20	5580	Ant3	10.83	0.53	11.36	<=24	Pass
NVNT	ax20	5580	Sum	16.83	0.53	17.36	<=22.67	Pass
NVNT	ax20	5700	Ant1	12.61	0.54	13.15	<=24	Pass
NVNT	ax20	5700	Ant2	11.02	0.54	11.56	<=24	Pass
NVNT	ax20	5700	Ant3	10.39	0.54	10.93	<=24	Pass
NVNT	ax20	5700	Sum	16.21	0.54	16.75	<=22.67	Pass
NVNT	ax40	5510	Ant1	13.78	0.53	14.31	<=24	Pass
NVNT	ax40	5510	Ant2	12.37	0.53	12.9	<=24	Pass
NVNT	ax40	5510	Ant3	11.91	0.53	12.44	<=24	Pass
NVNT	ax40	5510	Sum	17.53	0.53	18.06	<=22.67	Pass
NVNT	ax40	5550	Ant1	13.42	0.54	13.96	<=24	Pass
NVNT	ax40	5550	Ant2	12.35	0.54	12.89	<=24	Pass
NVNT	ax40	5550	Ant3	12	0.54	12.54	<=24	Pass
NVNT	ax40	5550	Sum	17.4	0.54	17.94	<=22.67	Pass
NVNT	ax40	5670	Ant1	11.79	0.53	12.32	<=24	Pass
NVNT	ax40	5670	Ant2	11.5	0.53	12.03	<=24	Pass
NVNT	ax40	5670	Ant3	10.21	0.53	10.74	<=24	Pass
NVNT	ax40	5670	Sum	15.99	0.53	16.52	<=22.67	Pass
NVNT	ax80	5530	Ant1	12.78	1.14	13.92	<=24	Pass
NVNT	ax80	5530	Ant2	11.45	1.14	12.59	<=24	Pass
NVNT	ax80	5530	Ant3	11.17	1.14	12.31	<=24	Pass
NVNT	ax80	5530	Sum	16.63	1.14	17.77	<=22.67	Pass
NVNT	ax80	5610	Ant1	12.52	1.15	13.67	<=24	Pass
NVNT	ax80	5610	Ant2	11.95	1.15	13.1	<=24	Pass
NVNT	ax80	5610	Ant3	10.33	1.15	11.48	<=24	Pass
NVNT	ax80	5610	Sum	16.47	1.15	17.62	<=22.67	Pass
NVNT	n20	5500	Ant1	13.48	0.18	13.66	<=24	Pass
NVNT	n20	5500	Ant2	11.84	0.18	12.02	<=24	Pass


NVNT	n20	5500	Ant3	11.34	0.18	11.52	<=24	Pass
NVNT	n20	5500	Sum	17.09	0.18	17.27	<=22.67	Pass
NVNT	n20	5580	Ant1	12.7	0.18	12.88	<=24	Pass
NVNT	n20	5580	Ant2	11.57	0.18	11.75	<=24	Pass
NVNT	n20	5580	Ant3	10.36	0.18	10.54	<=24	Pass
NVNT	n20	5580	Sum	16.42	0.18	16.6	<=22.67	Pass
NVNT	n20	5700	Ant1	12.53	0.18	12.71	<=24	Pass
NVNT	n20	5700	Ant2	10.79	0.18	10.97	<=24	Pass
NVNT	n20	5700	Ant3	10.18	0.18	10.36	<=24	Pass
NVNT	n20	5700	Sum	16.06	0.18	16.24	<=22.67	Pass
NVNT	n40	5510	Ant1	12.77	0.36	13.13	<=24	Pass
NVNT	n40	5510	Ant2	11.17	0.36	11.53	<=24	Pass
NVNT	n40	5510	Ant3	10.81	0.36	11.17	<=24	Pass
NVNT	n40	5510	Sum	16.44	0.36	16.8	<=22.67	Pass
NVNT	n40	5550	Ant1	12.29	0.36	12.65	<=24	Pass
NVNT	n40	5550	Ant2	11.17	0.36	11.53	<=24	Pass
NVNT	n40	5550	Ant3	10.77	0.36	11.13	<=24	Pass
NVNT	n40	5550	Sum	16.23	0.36	16.59	<=22.67	Pass
NVNT	n40	5670	Ant1	10.97	0.36	11.33	<=24	Pass
NVNT	n40	5670	Ant2	10.47	0.36	10.83	<=24	Pass
NVNT	n40	5670	Ant3	9.28	0.36	9.64	<=24	Pass
NVNT	n40	5670	Sum	15.07	0.36	15.43	<=22.67	Pass

### Test Graphs


#### Power NVNT a 5500MHz Ant1

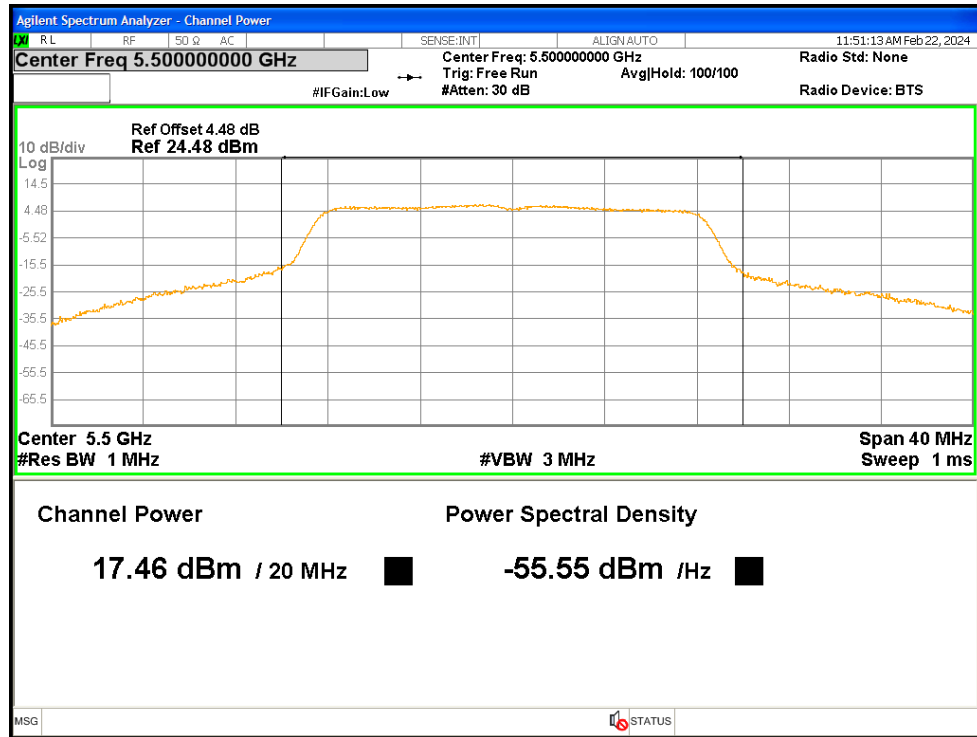


#### Power NVNT a 5580MHz Ant1

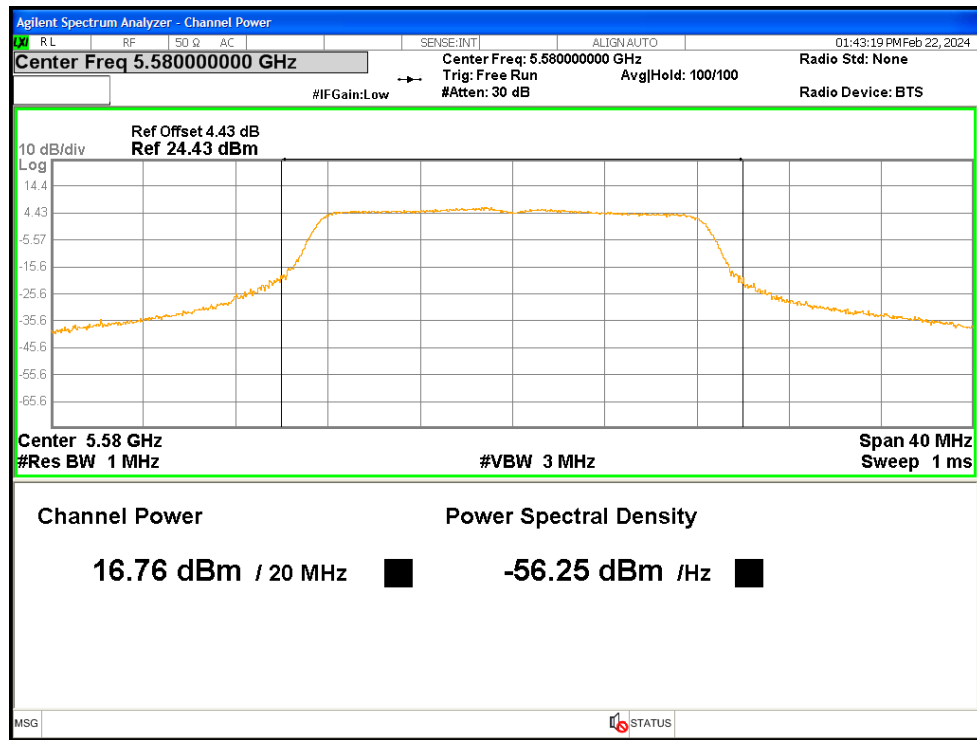


### Power NVNT a 5700MHz Ant1

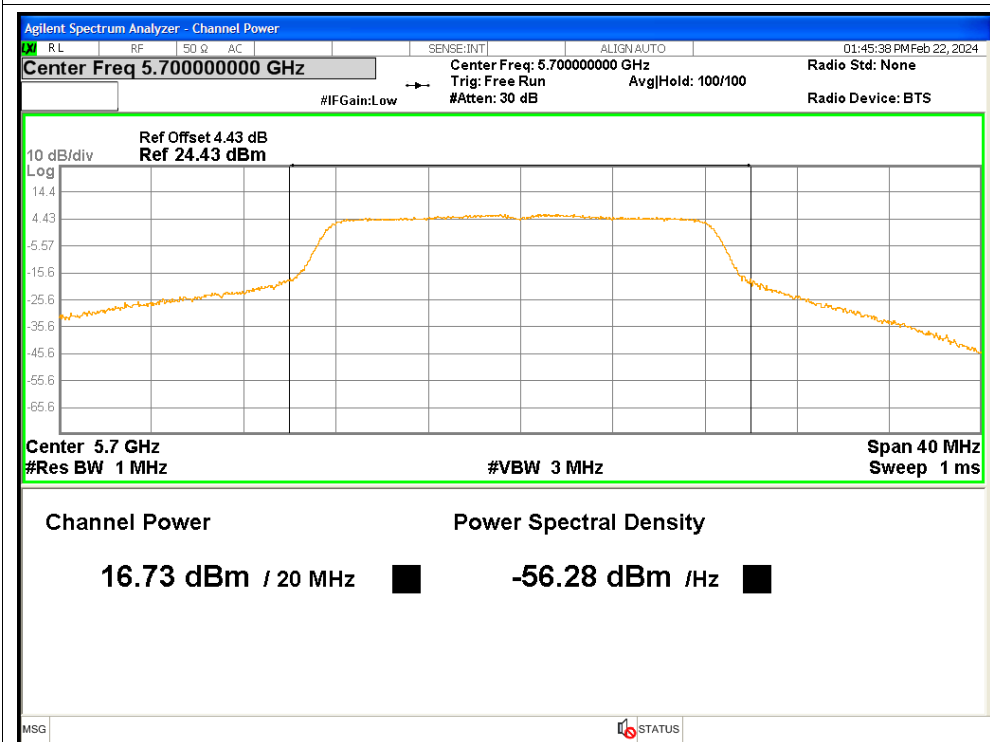


### Power NVNT a 5500MHz Ant2

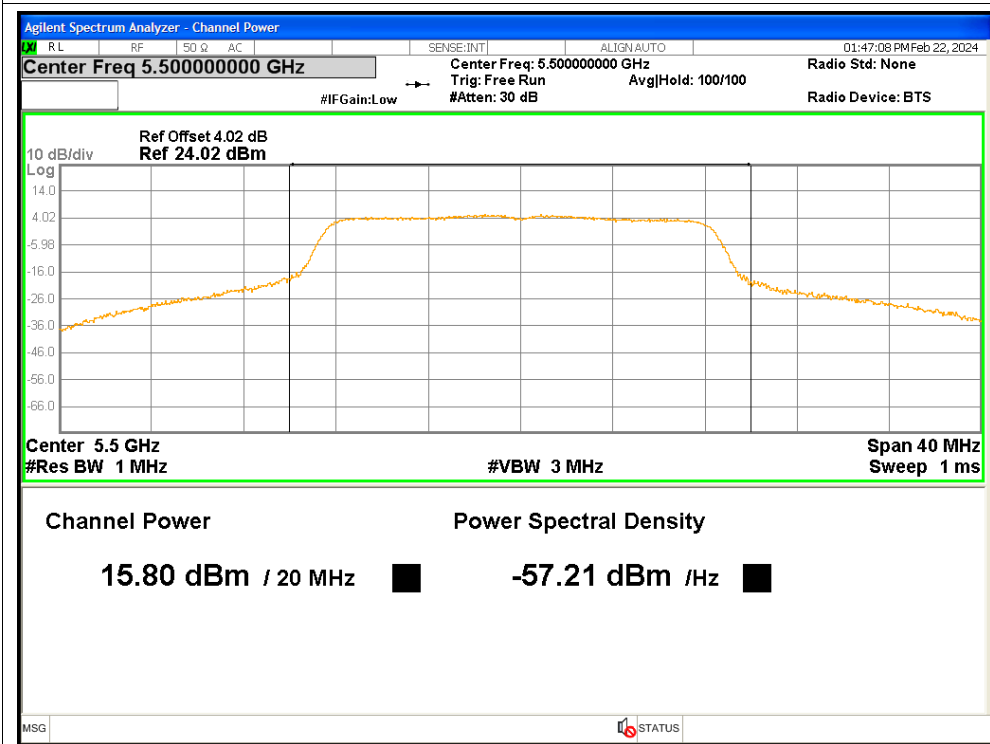

### Power NVNT a 5580MHz Ant2

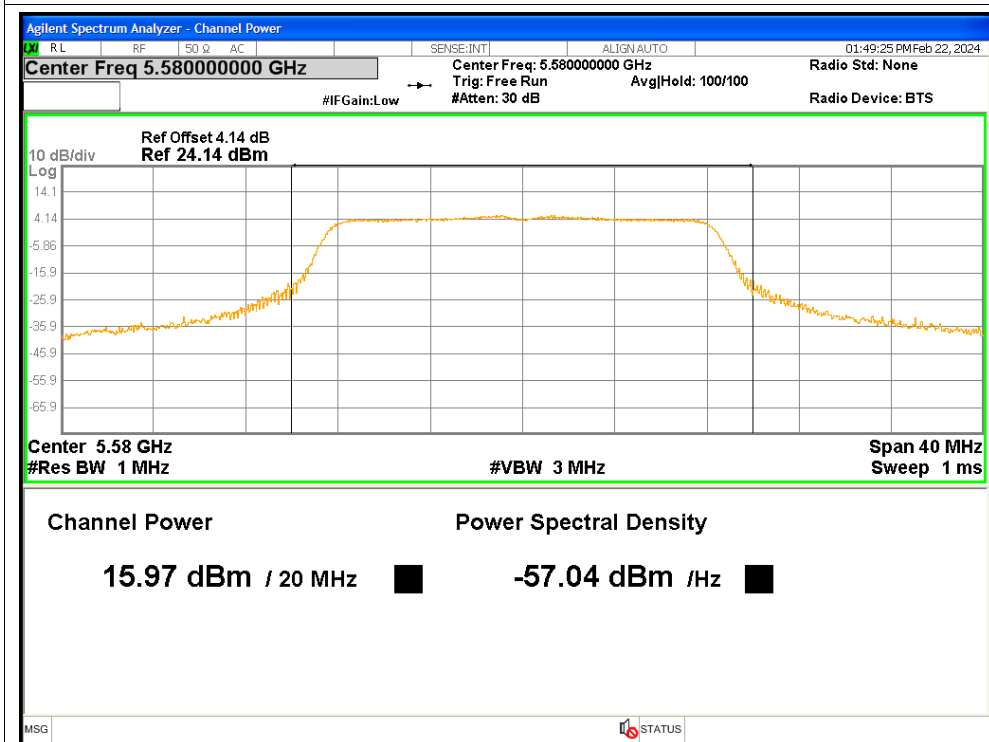


### Power NVNT a 5700MHz Ant2

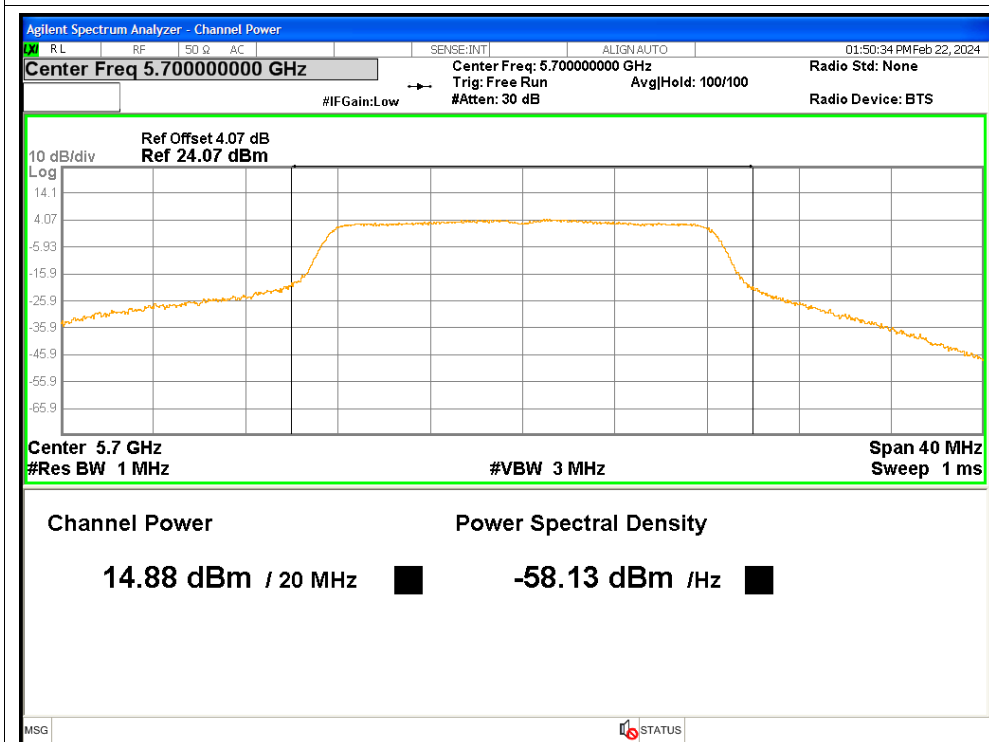





### Power NVNT a 5500MHz Ant3

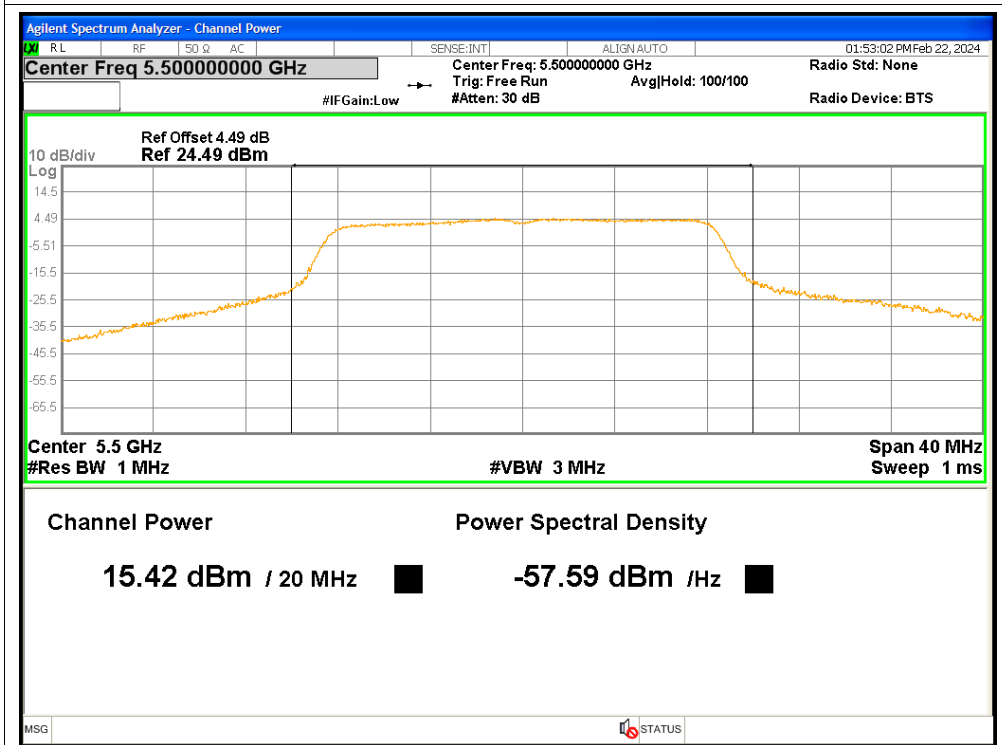


### Power NVNT a 5580MHz Ant3

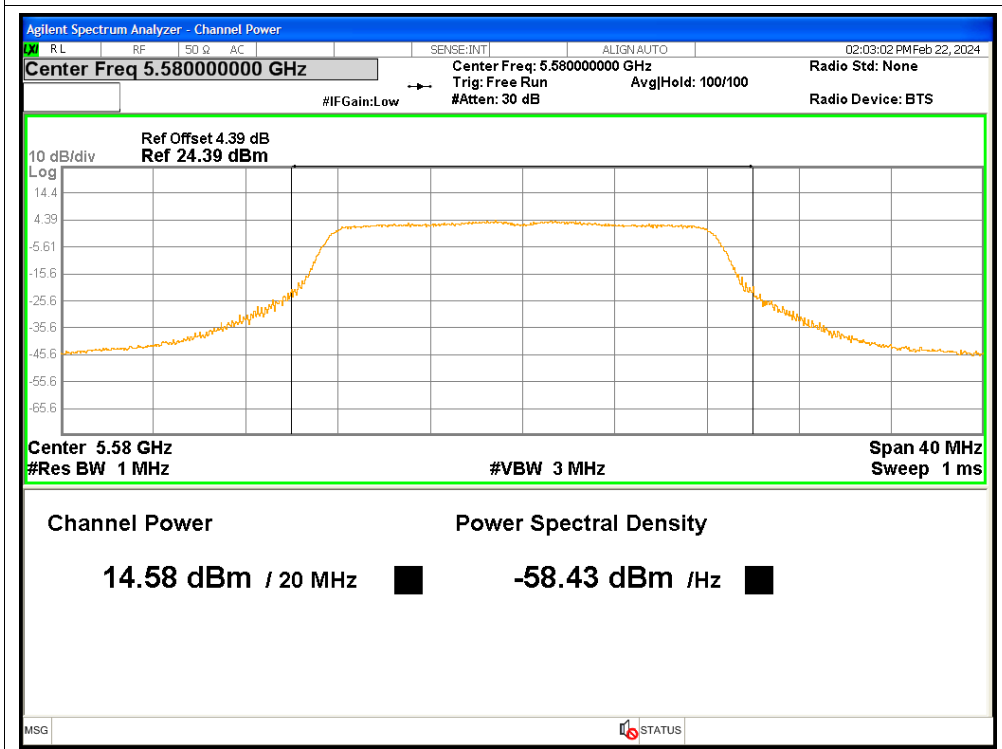


### Power NVNT a 5700MHz Ant3

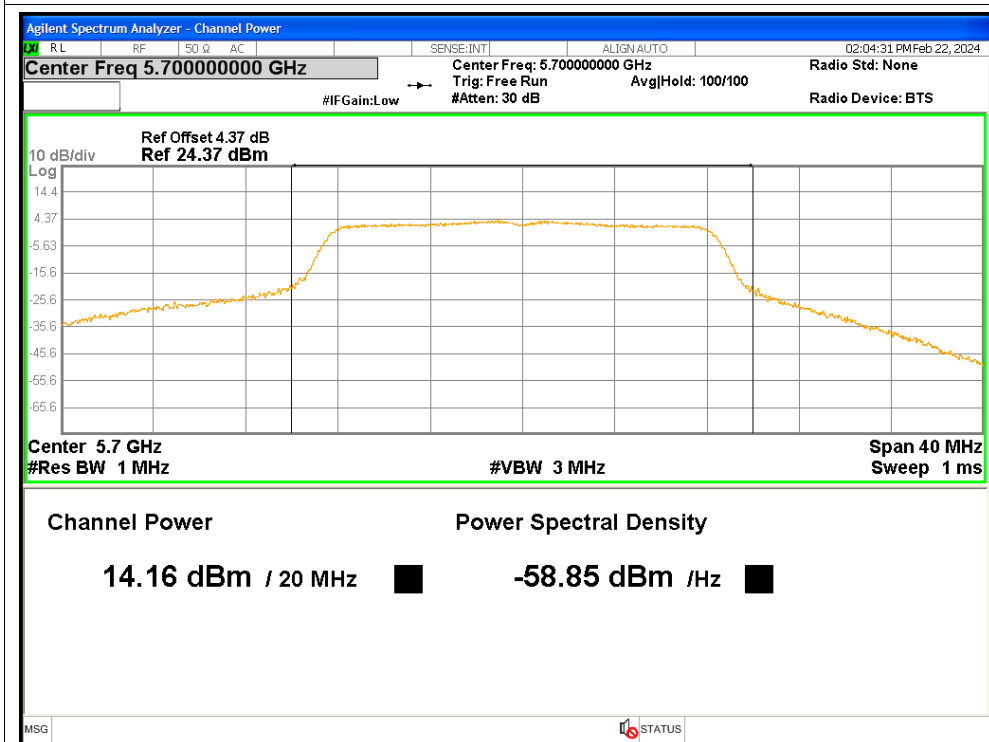


### Power NVNT ac160 5570MHz Ant1

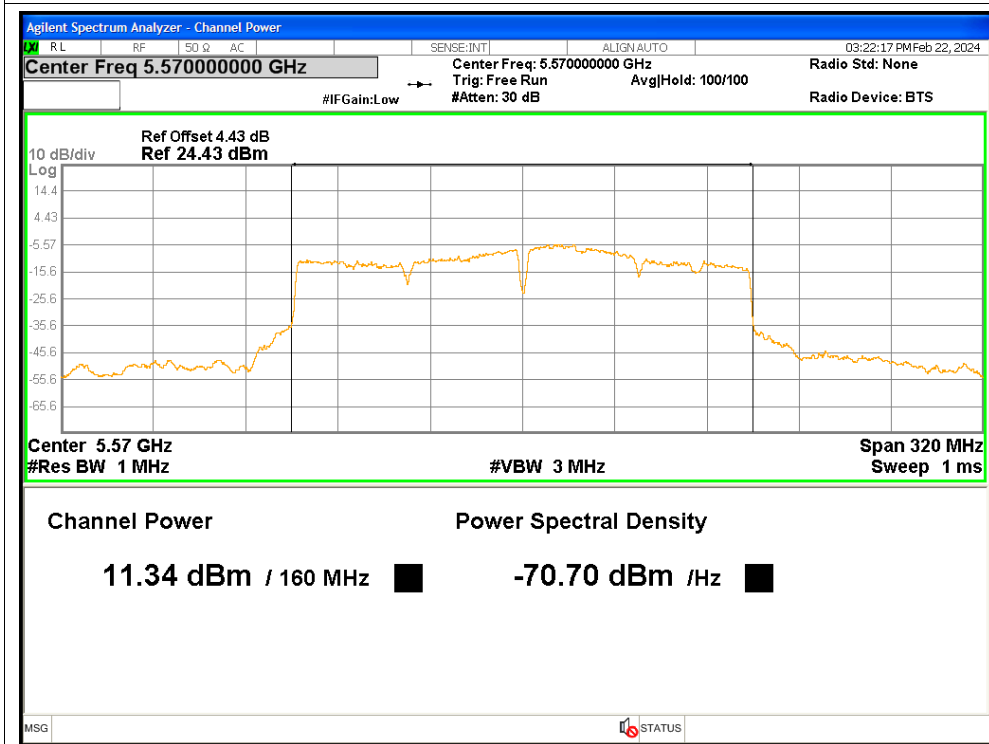


### Power NVNT ac160 5570MHz Ant2

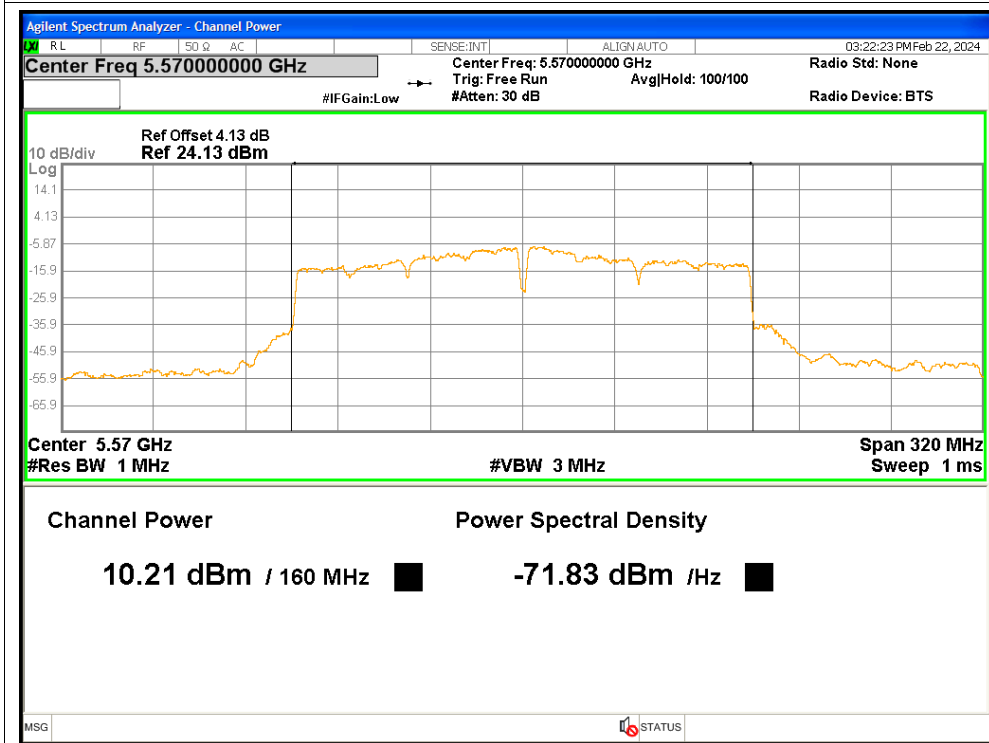


### Power NVNT ac160 5570MHz Ant3

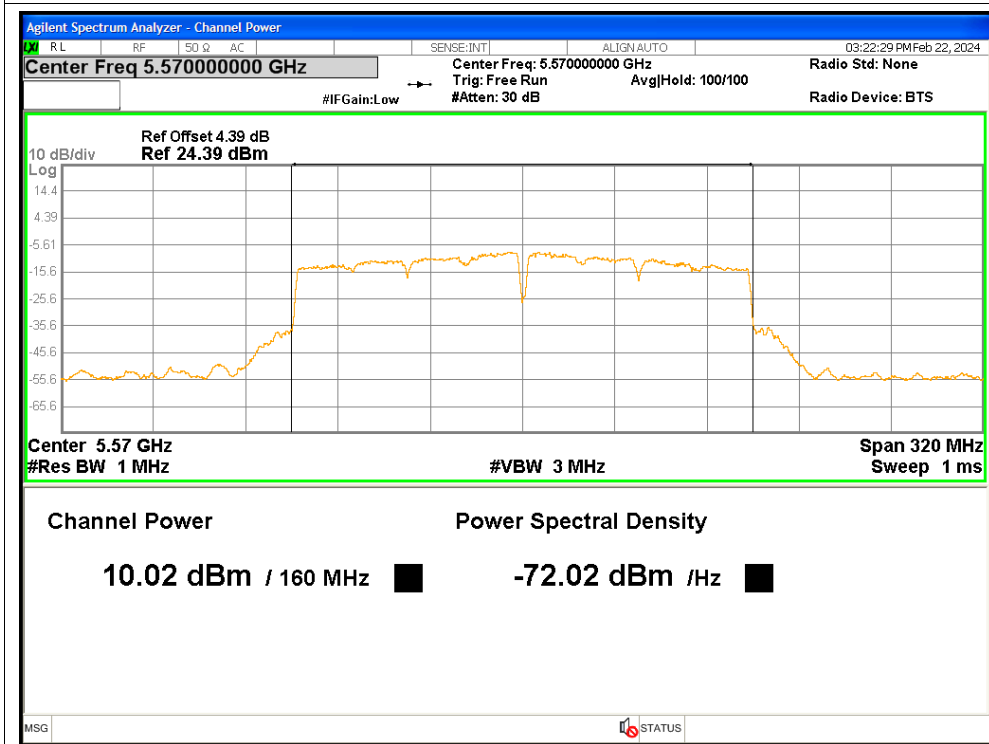


Power NVNT ac20 5500MHz Ant1

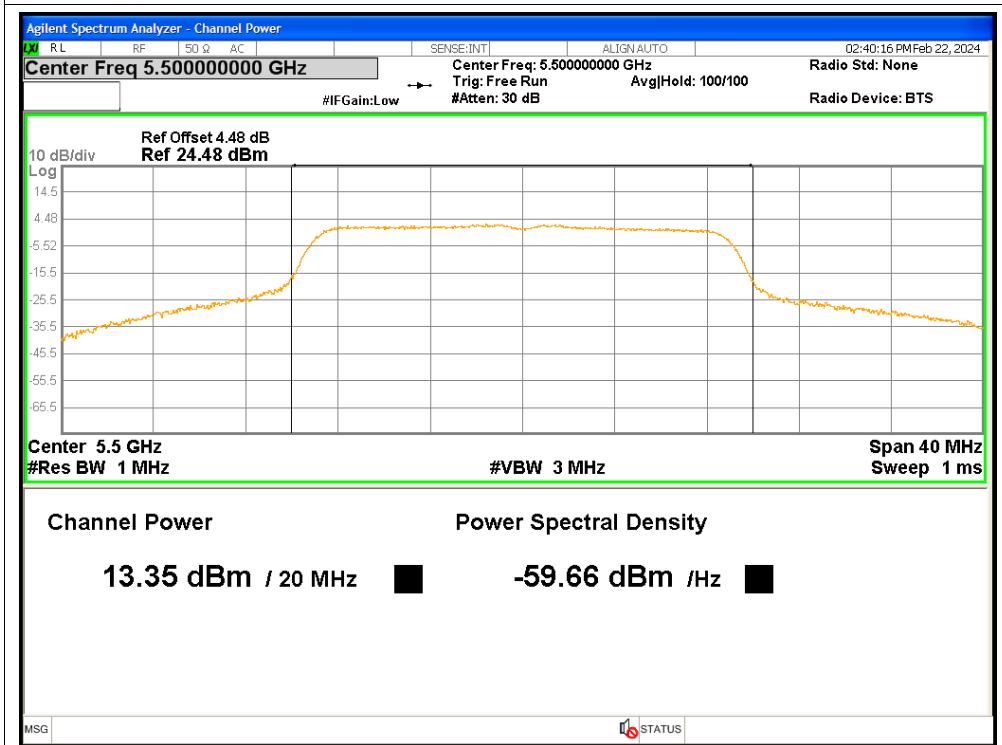


Power NVNT ac20 5500MHz Ant2

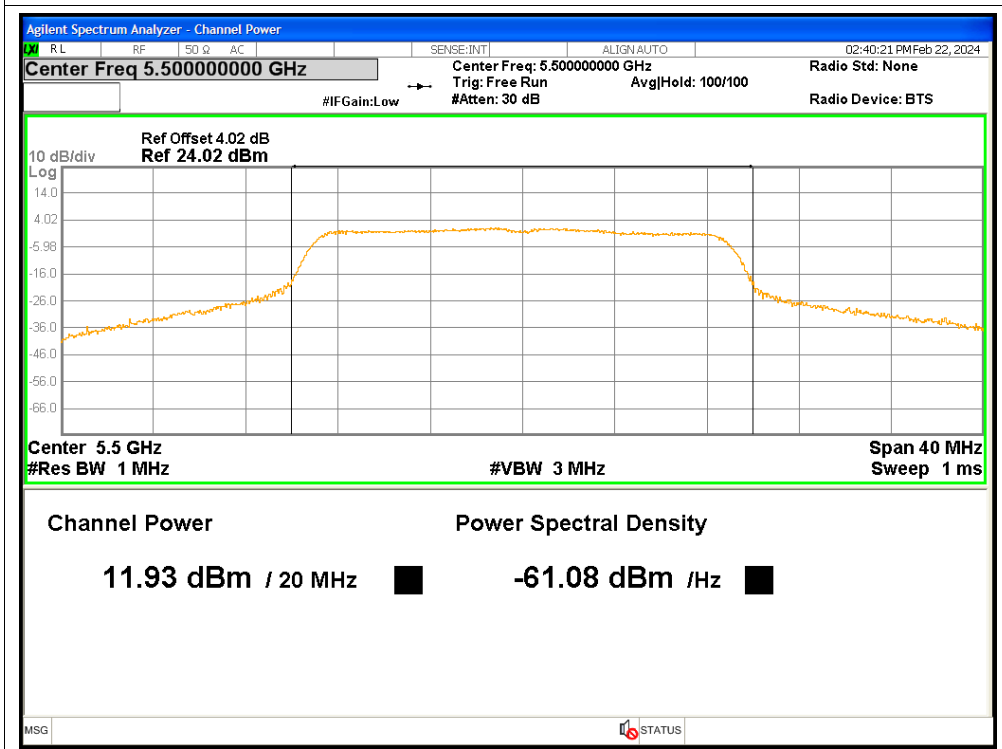


Power NVNT ac20 5500MHz Ant3

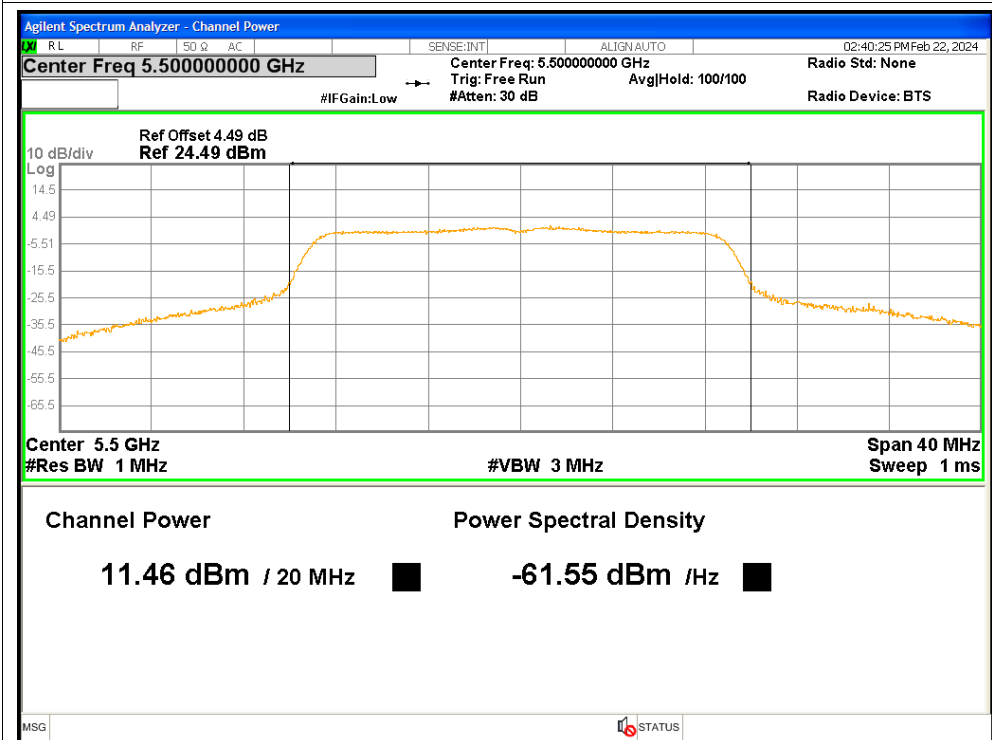


Power NVNT ac20 5580MHz Ant1

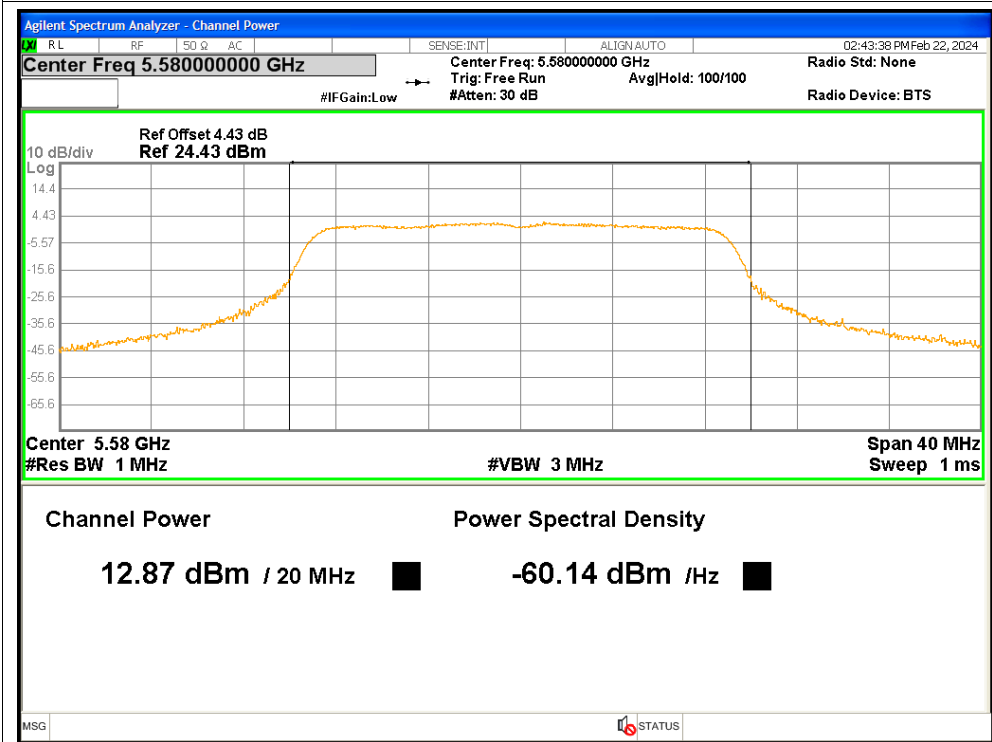


Power NVNT ac20 5580MHz Ant2

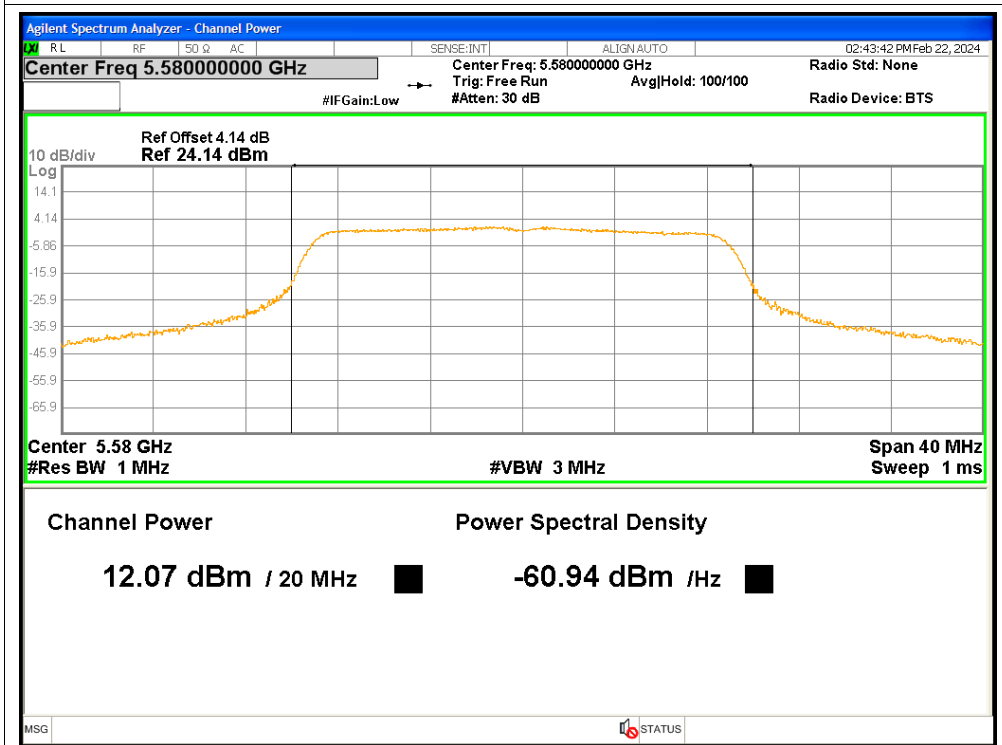


Power NVNT ac20 5580MHz Ant3

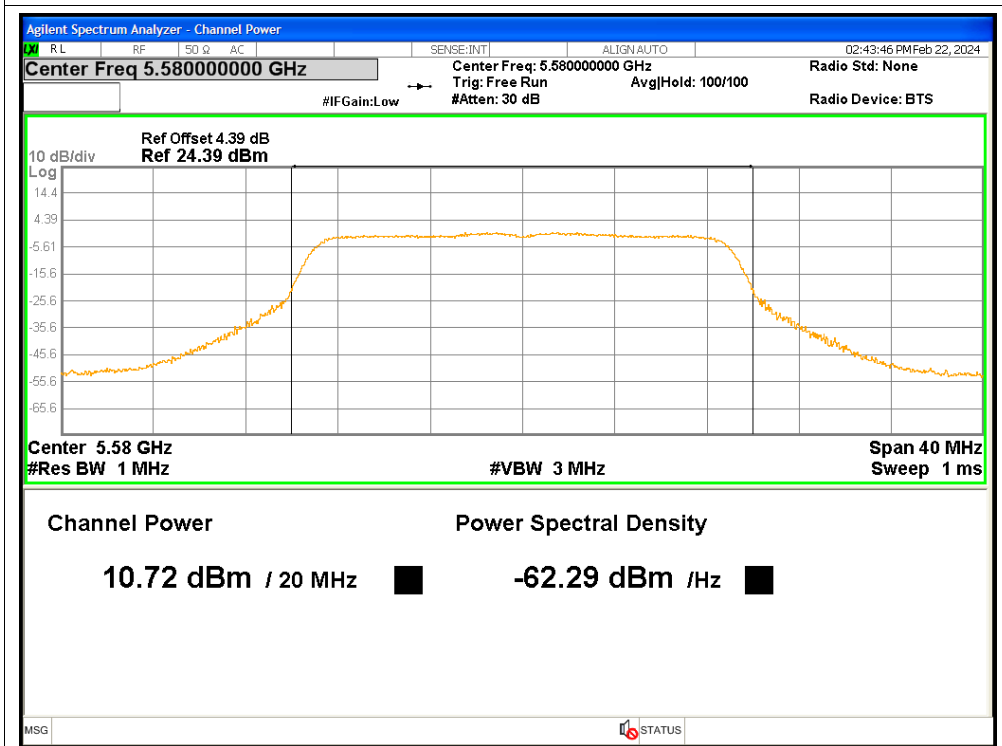


Power NVNT ac20 5700MHz Ant1

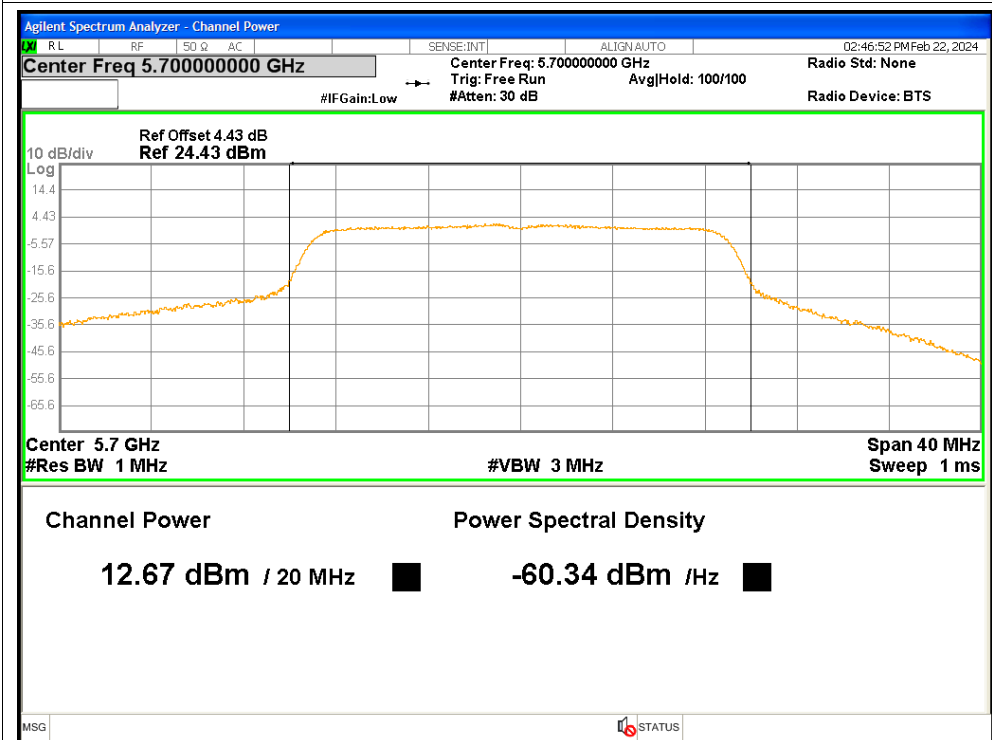


Power NVNT ac20 5700MHz Ant2

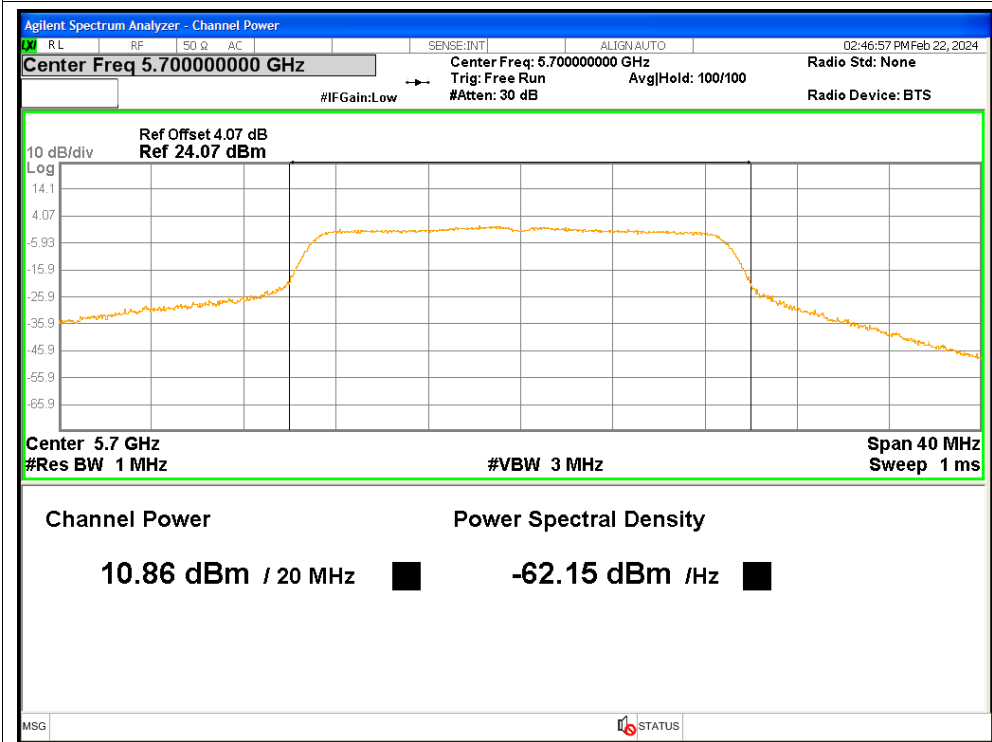

Power NVNT ac20 5700MHz Ant3

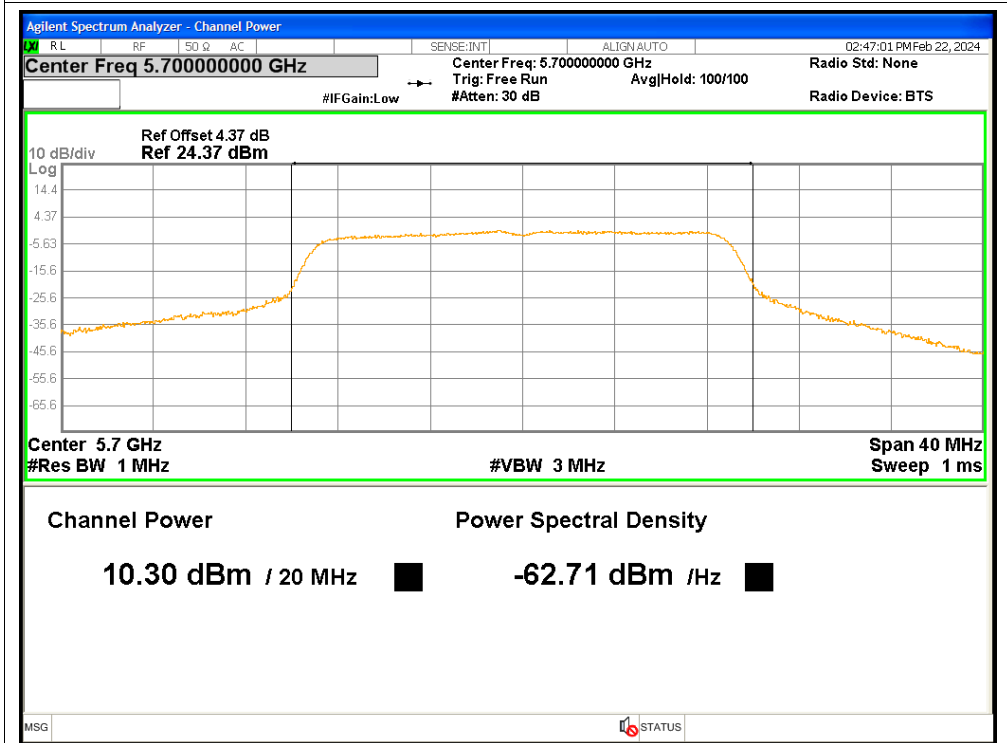


Power NVNT ac40 5510MHz Ant1

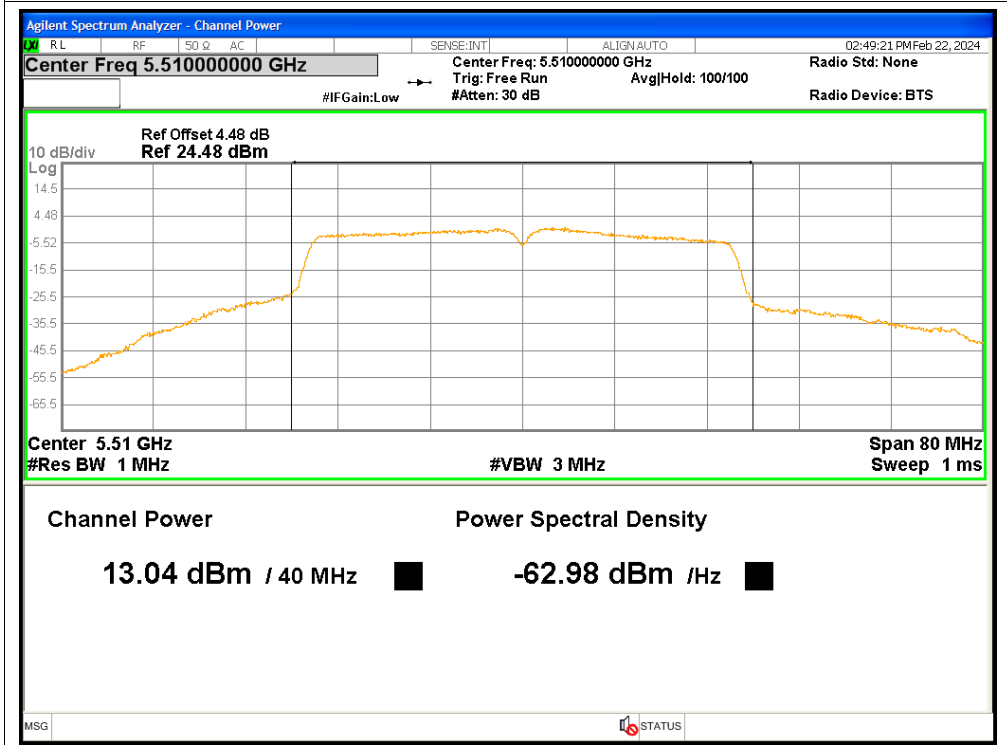





Power NVNT ac40 5510MHz Ant2

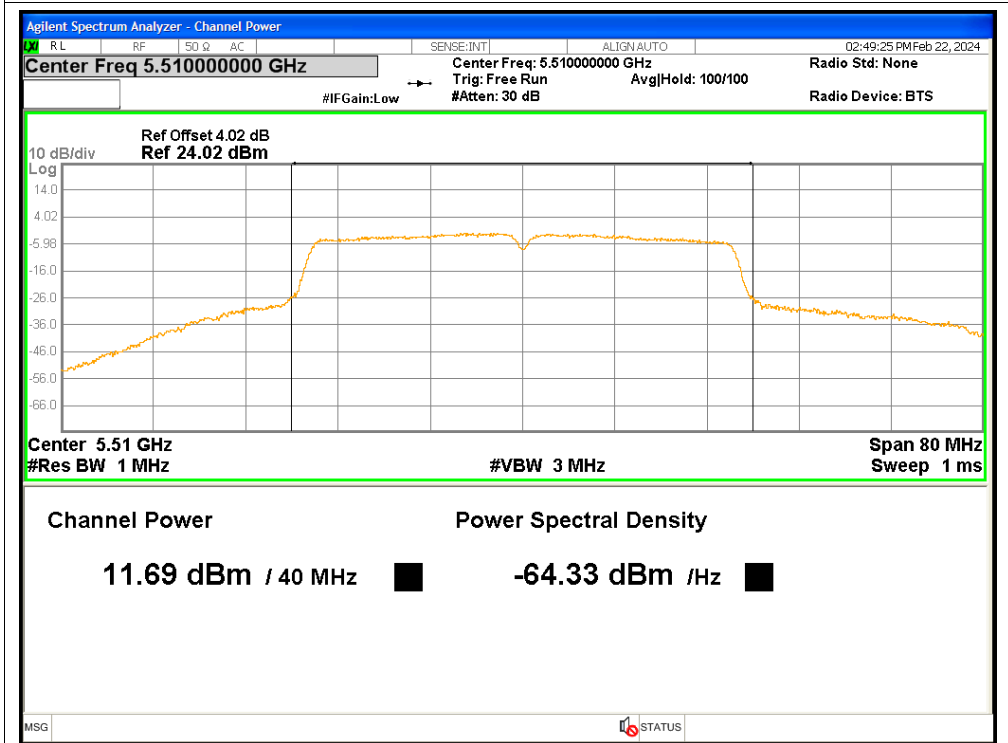


Power NVNT ac40 5510MHz Ant3

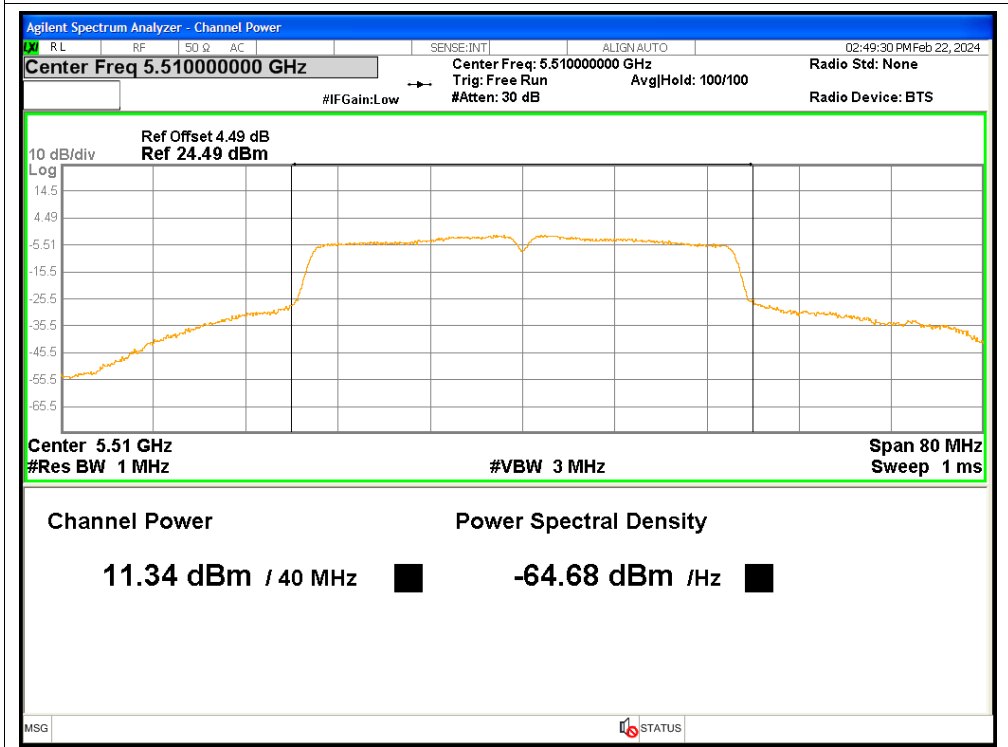


### Power NVNT ac40 5550MHz Ant1

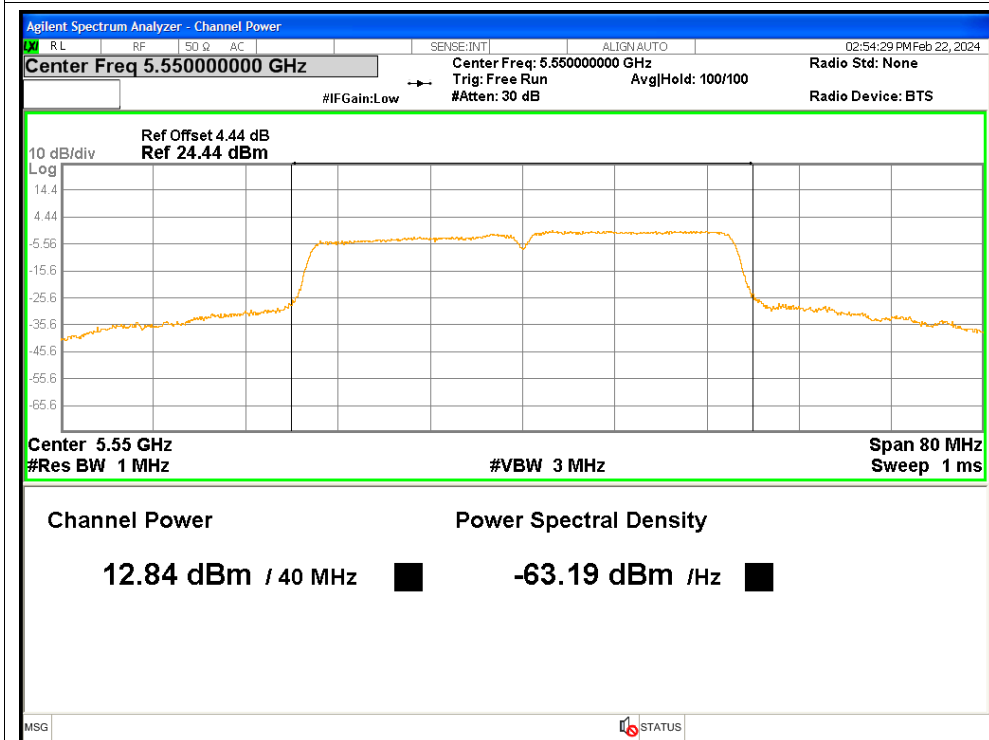


### Power NVNT ac40 5550MHz Ant2

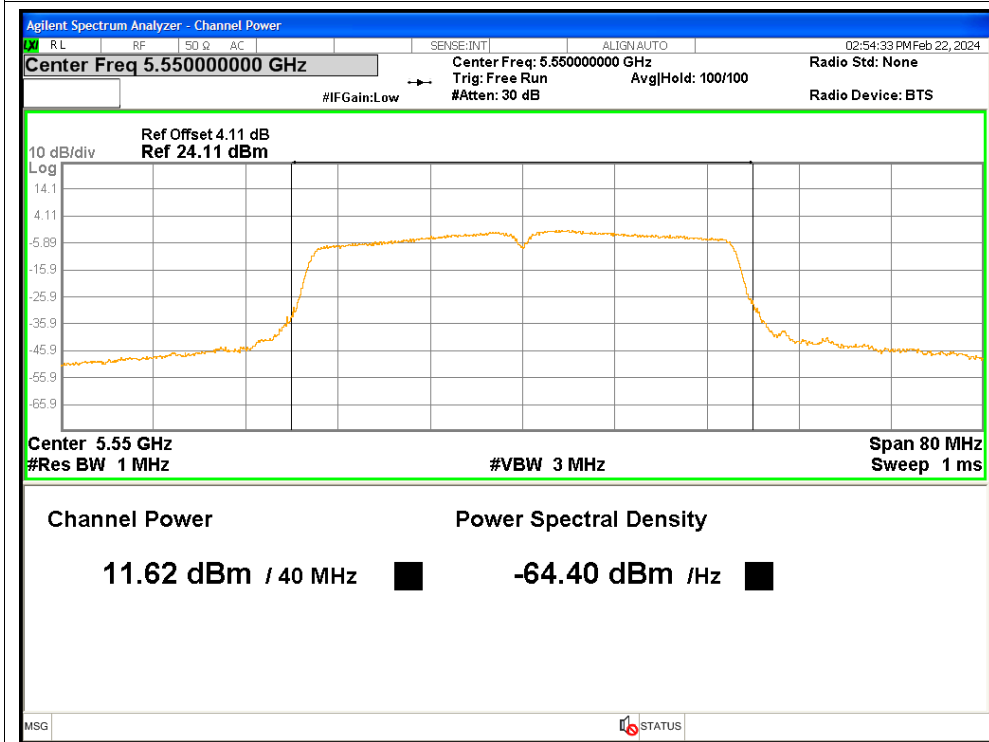


Power NVNT ac40 5550MHz Ant3

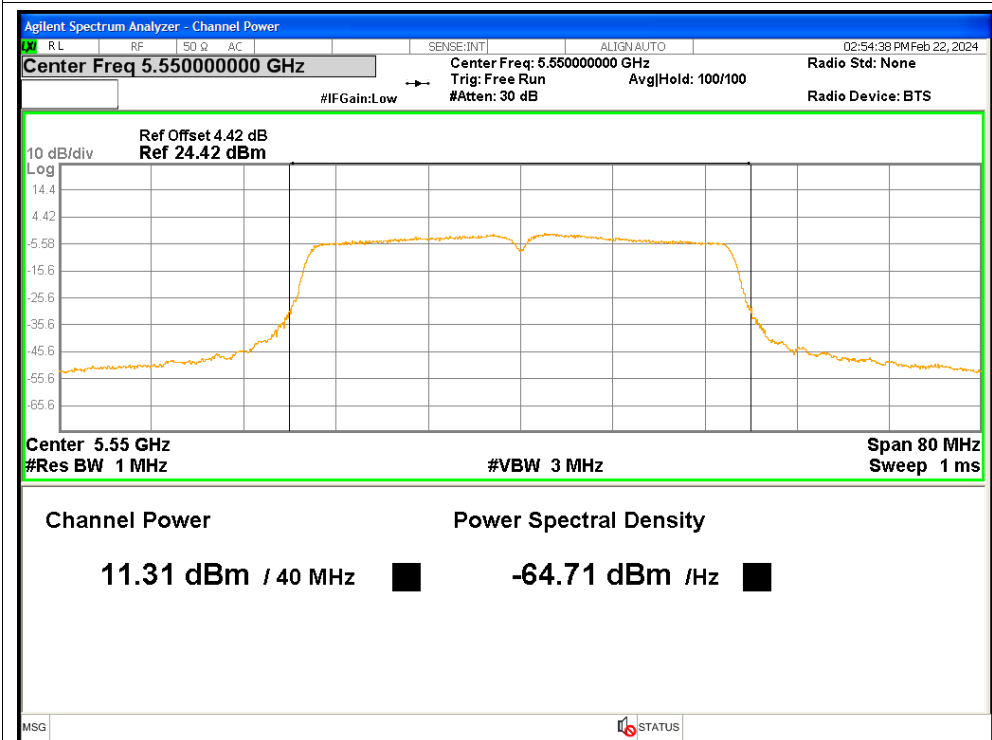


Power NVNT ac40 5670MHz Ant1

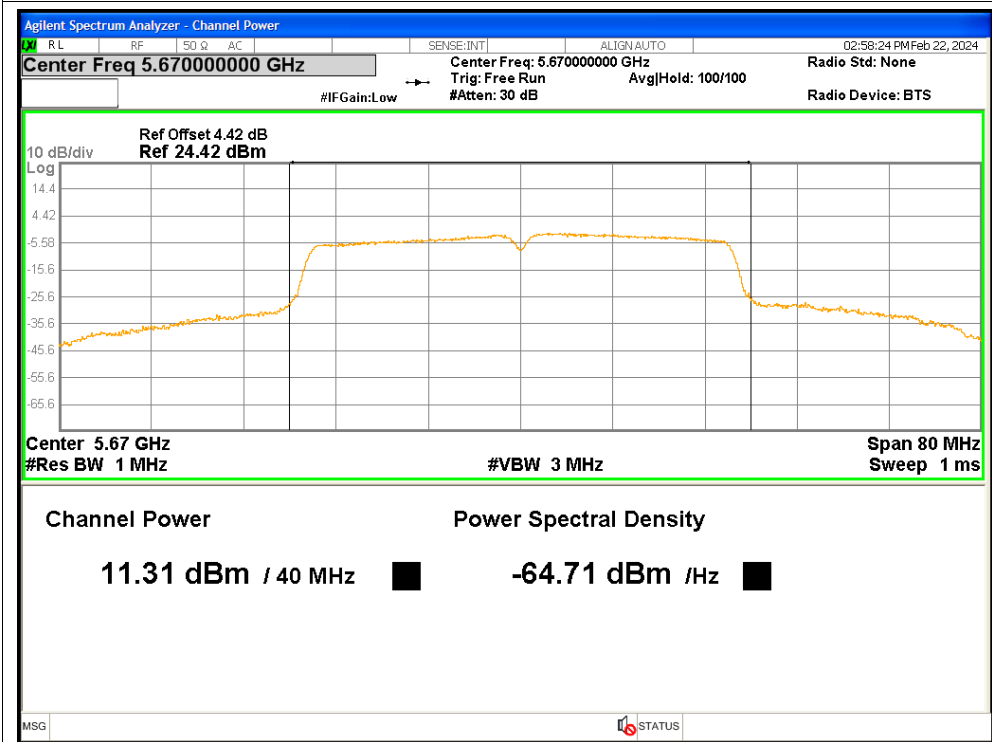


Power NVNT ac40 5670MHz Ant2

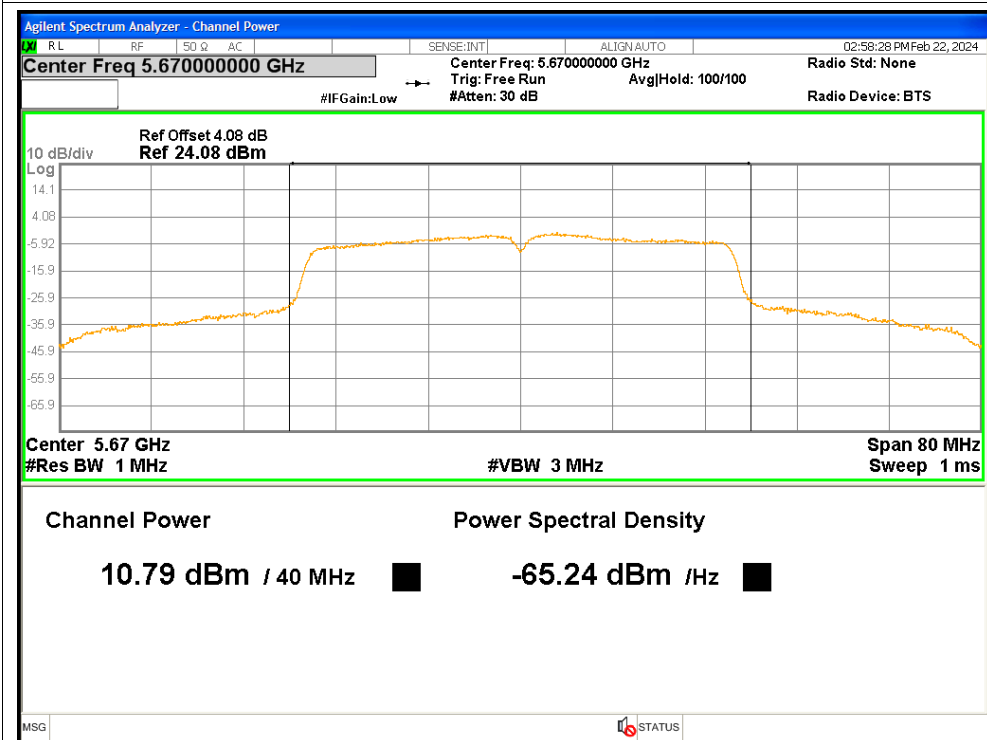


Power NVNT ac40 5670MHz Ant3

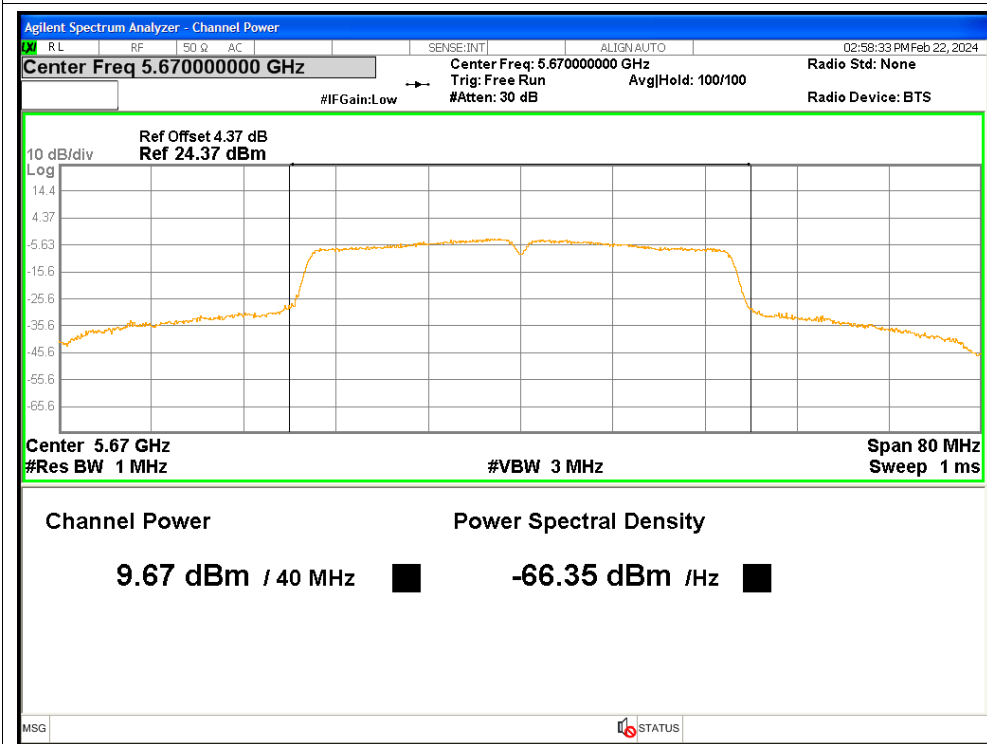


Power NVNT ac80 5530MHz Ant1

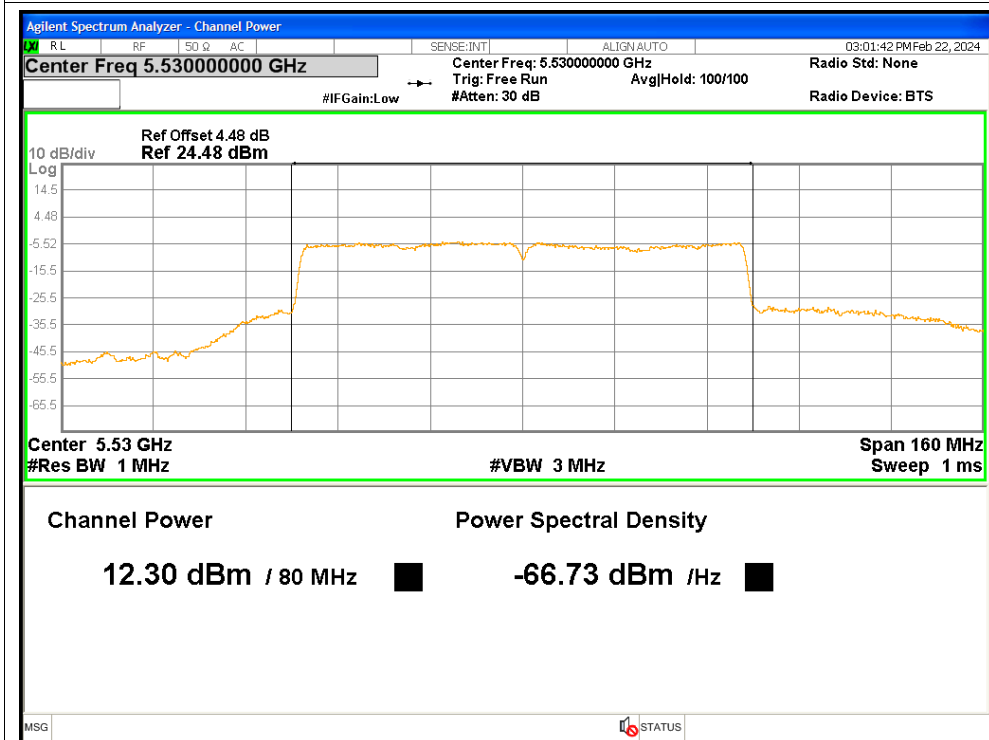


Power NVNT ac80 5530MHz Ant2

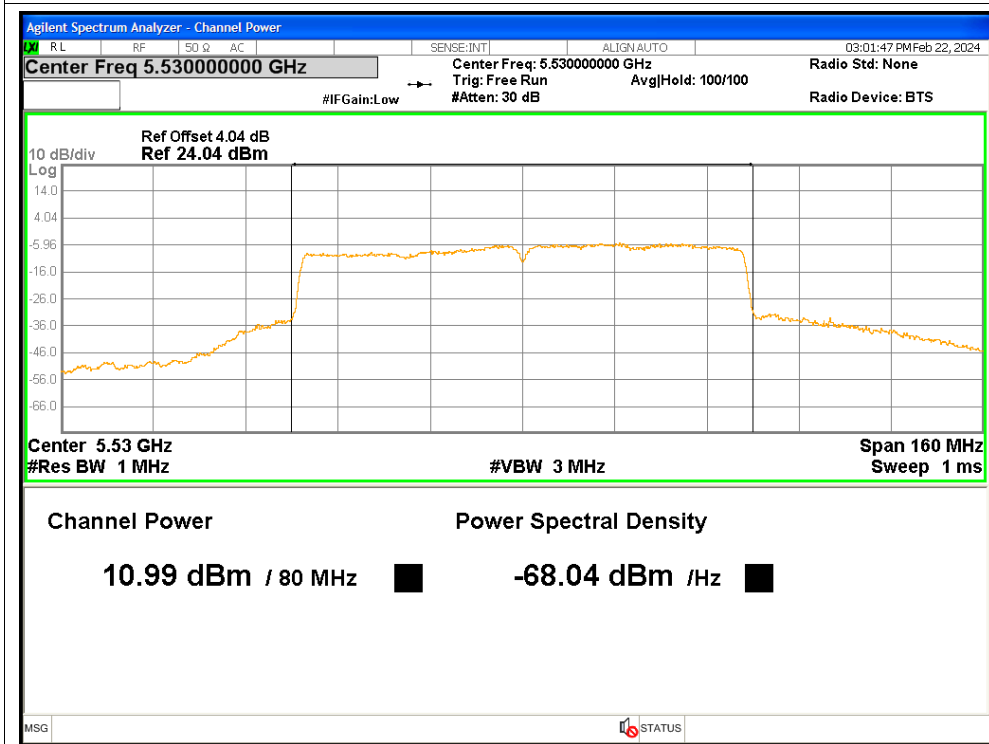


### Power NVNT ac80 5530MHz Ant3

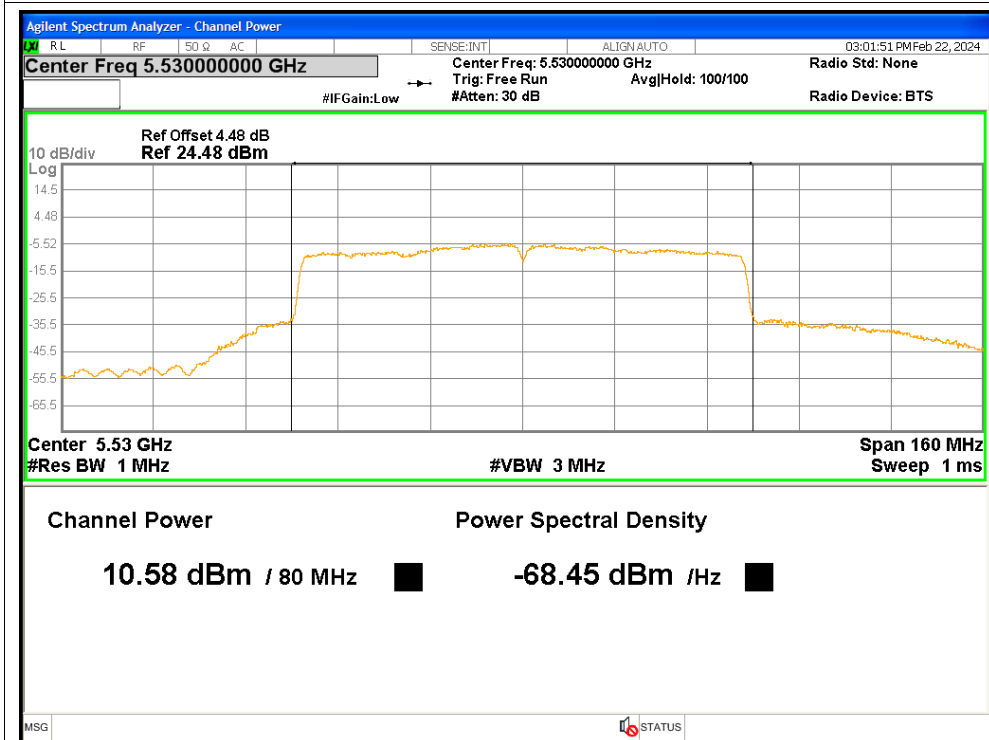


### Power NVNT ac80 5610MHz Ant1

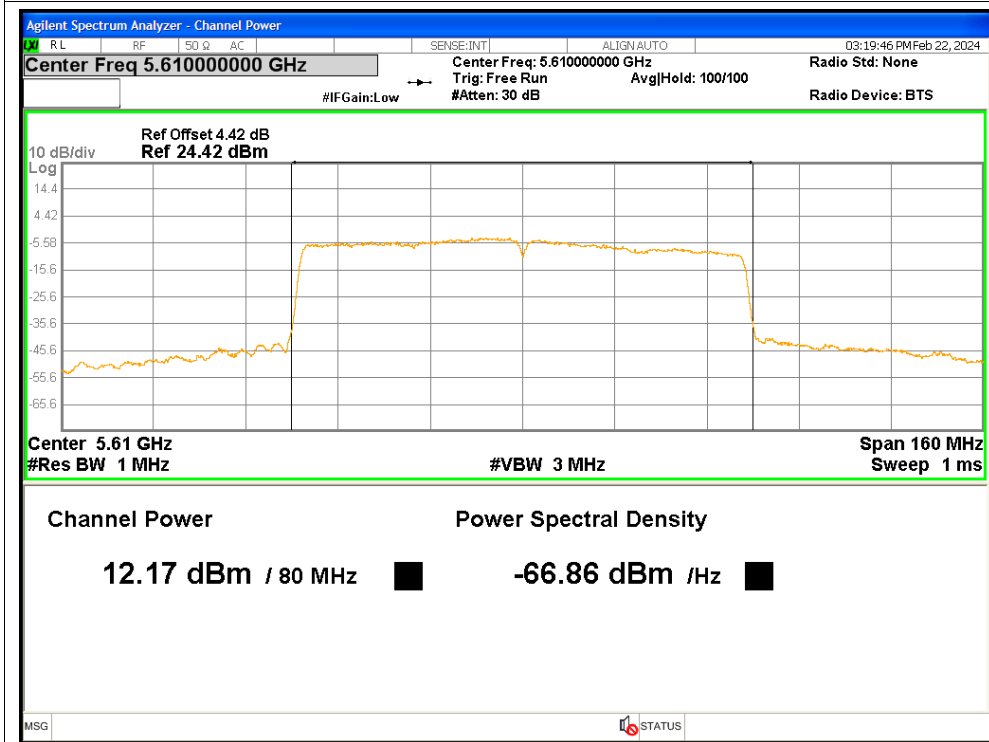


Power NVNT ac80 5610MHz Ant2

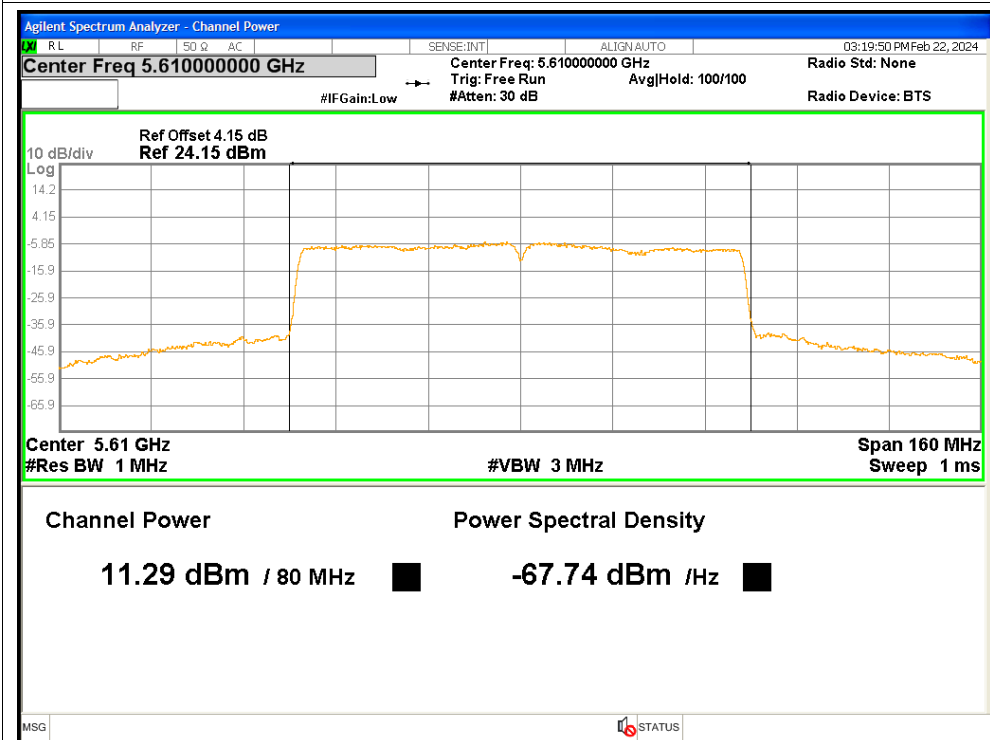


Power NVNT ac80 5610MHz Ant3

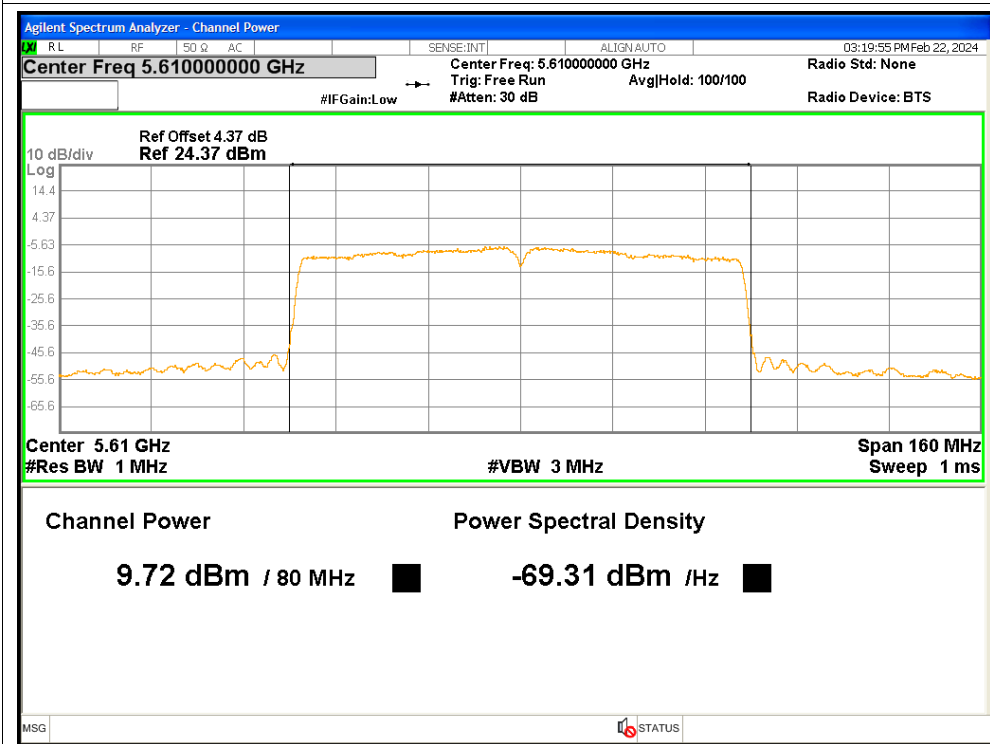

### Power NVNT ax160 5570MHz Ant1

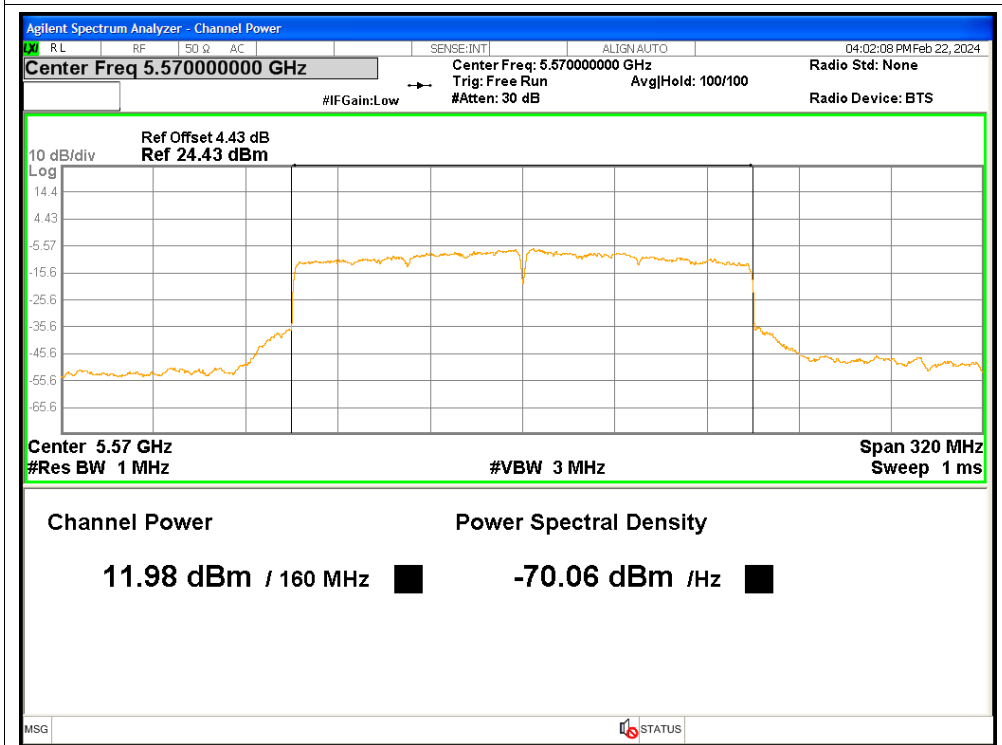


### Power NVNT ax160 5570MHz Ant2

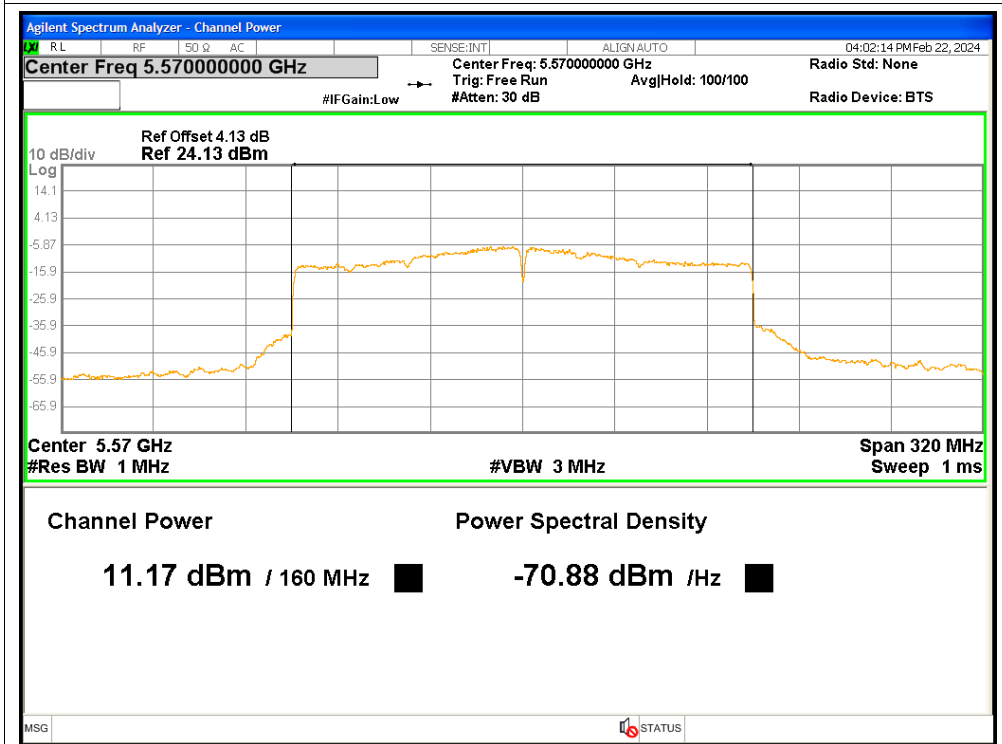





### Power NVNT ax160 5570MHz Ant3

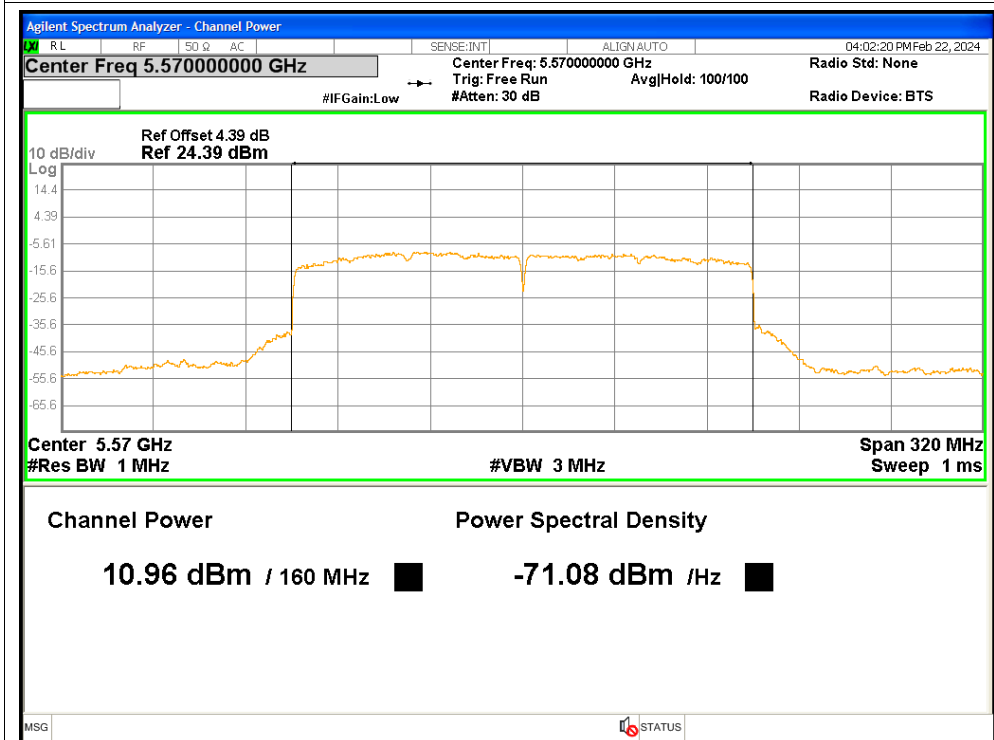


### Power NVNT ax20 5500MHz Ant1

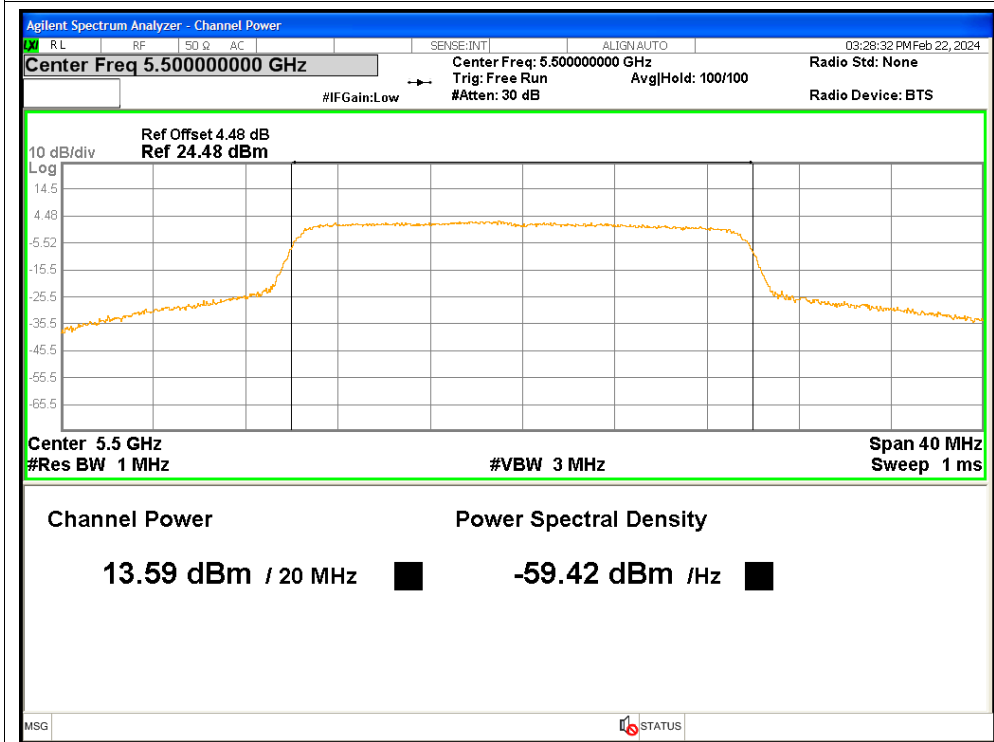


Power NVNT ax20 5500MHz Ant2

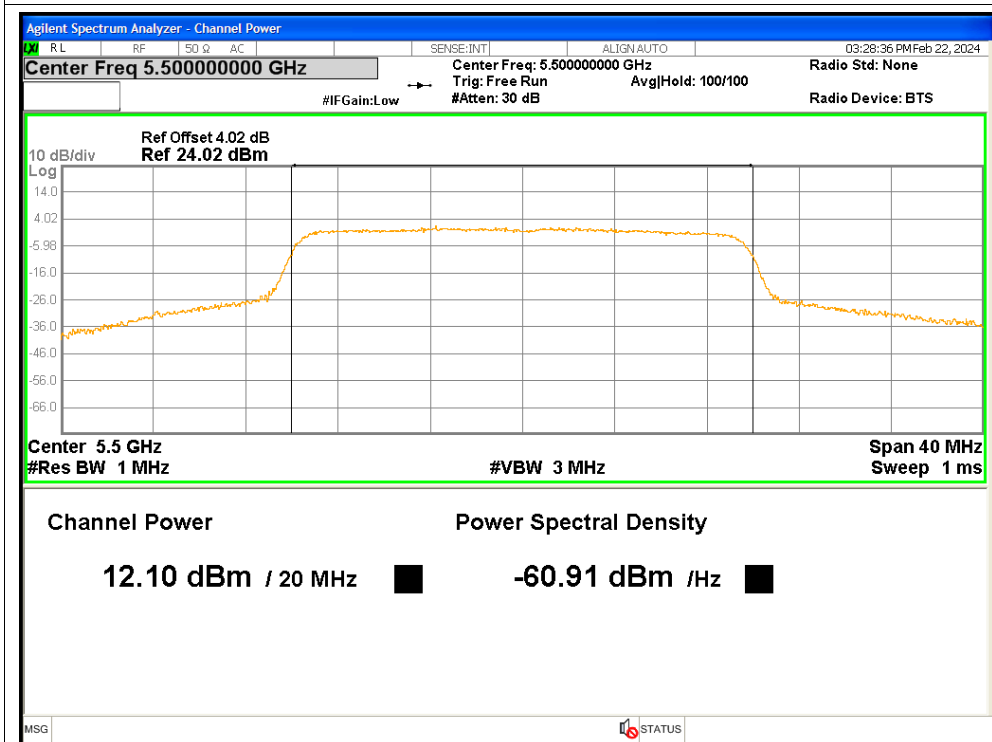


Power NVNT ax20 5500MHz Ant3

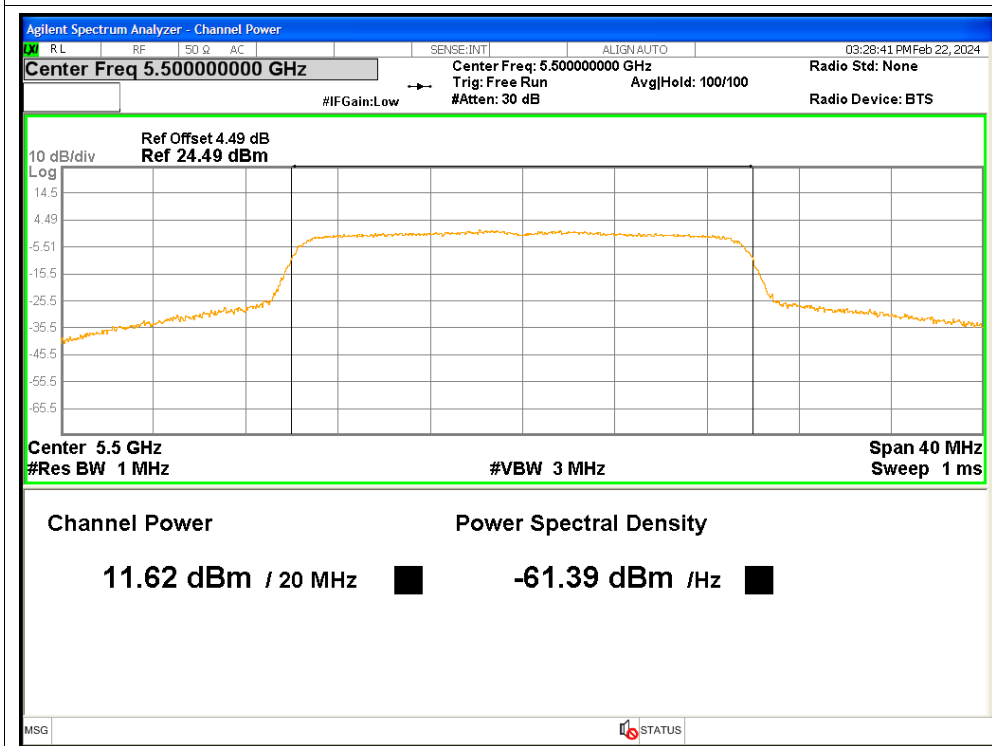


Power NVNT ax20 5580MHz Ant1

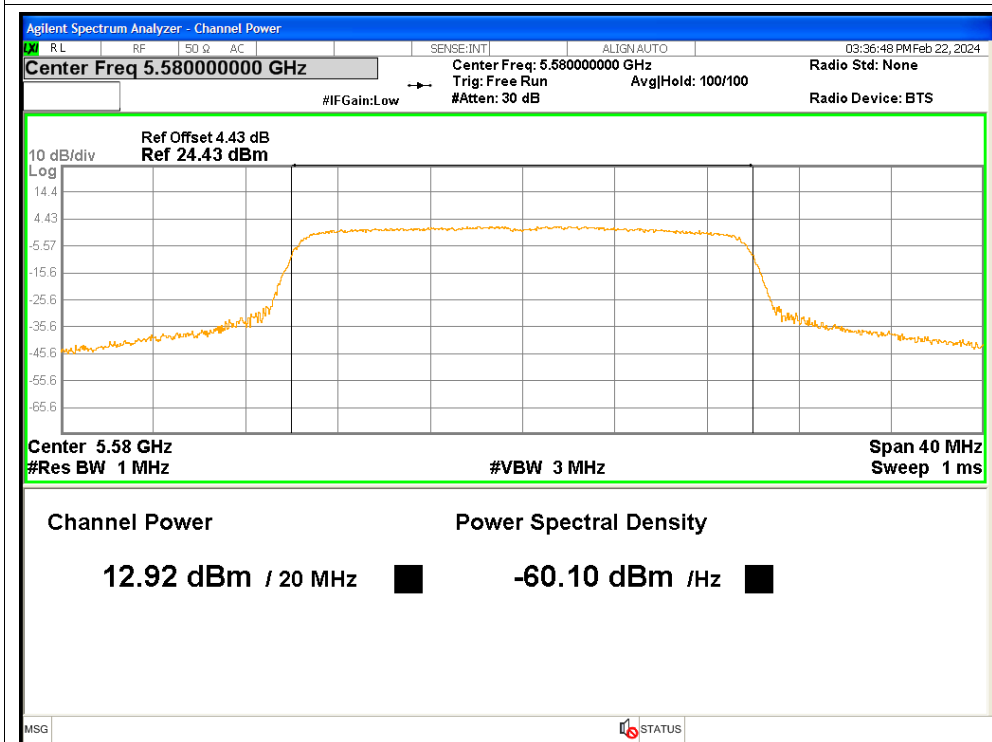


Power NVNT ax20 5580MHz Ant2

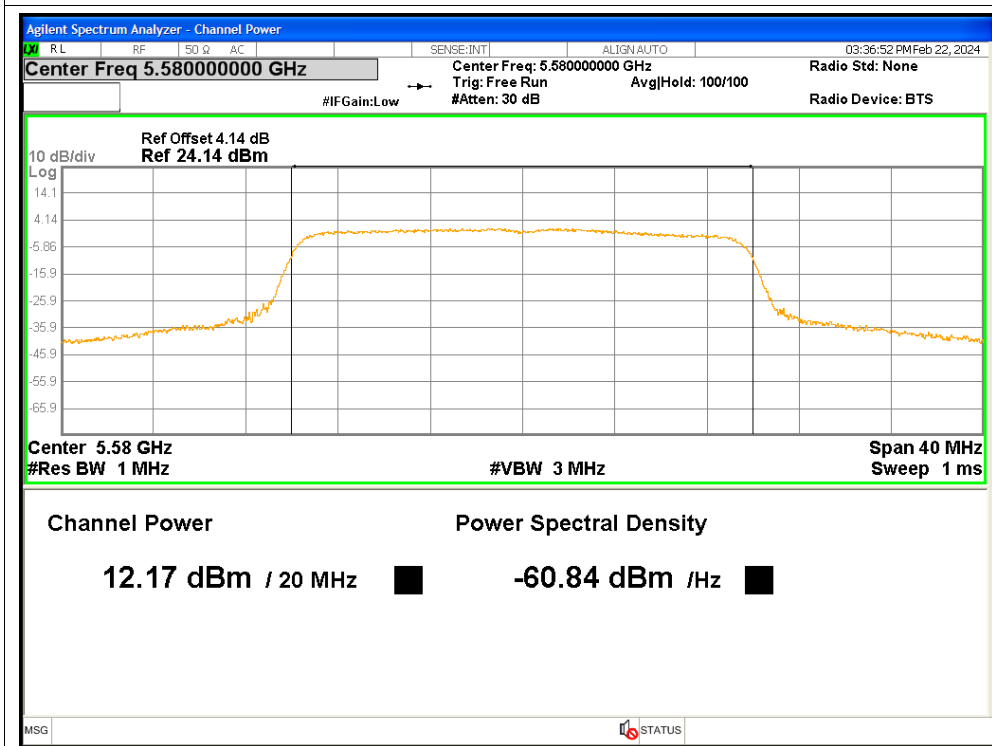


Power NVNT ax20 5580MHz Ant3

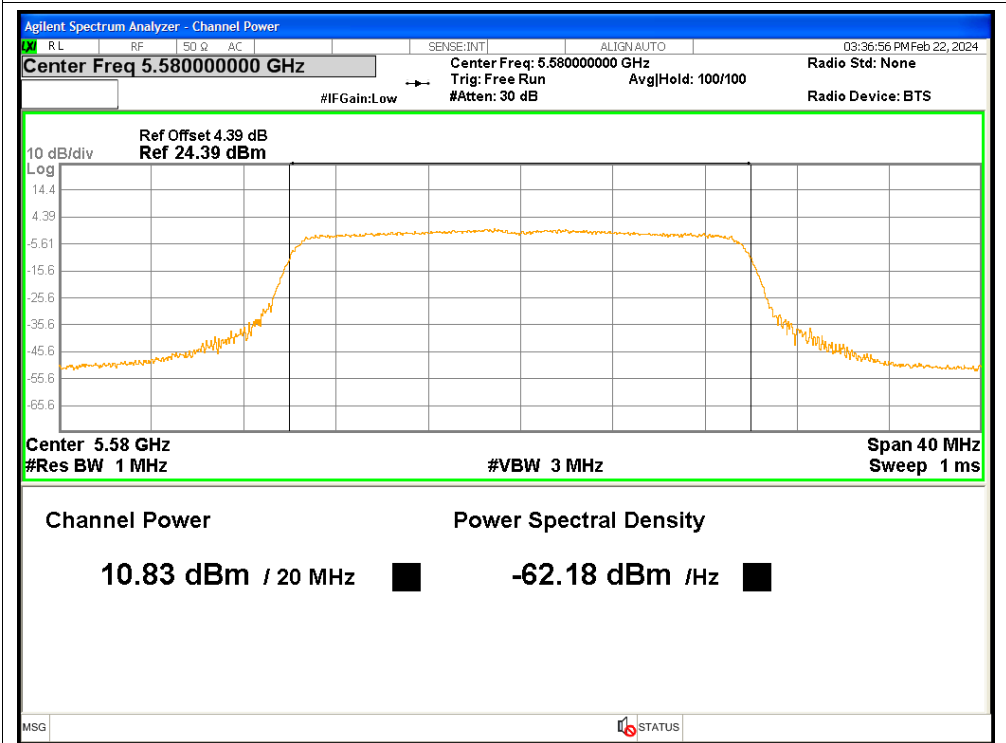


Power NVNT ax20 5700MHz Ant1

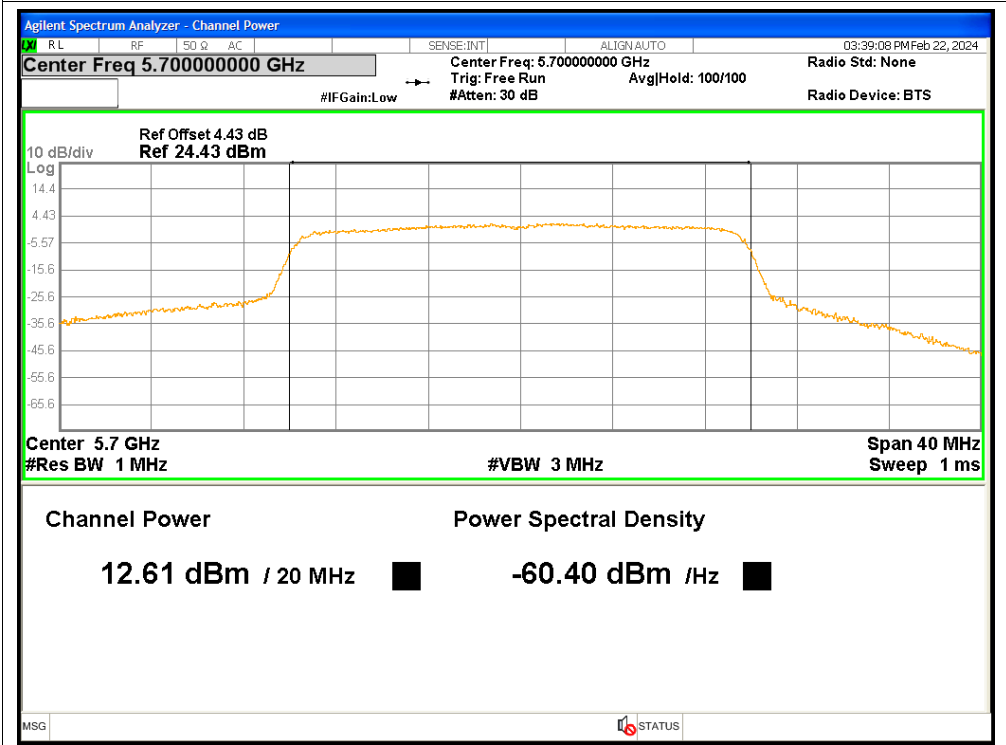


Power NVNT ax20 5700MHz Ant2

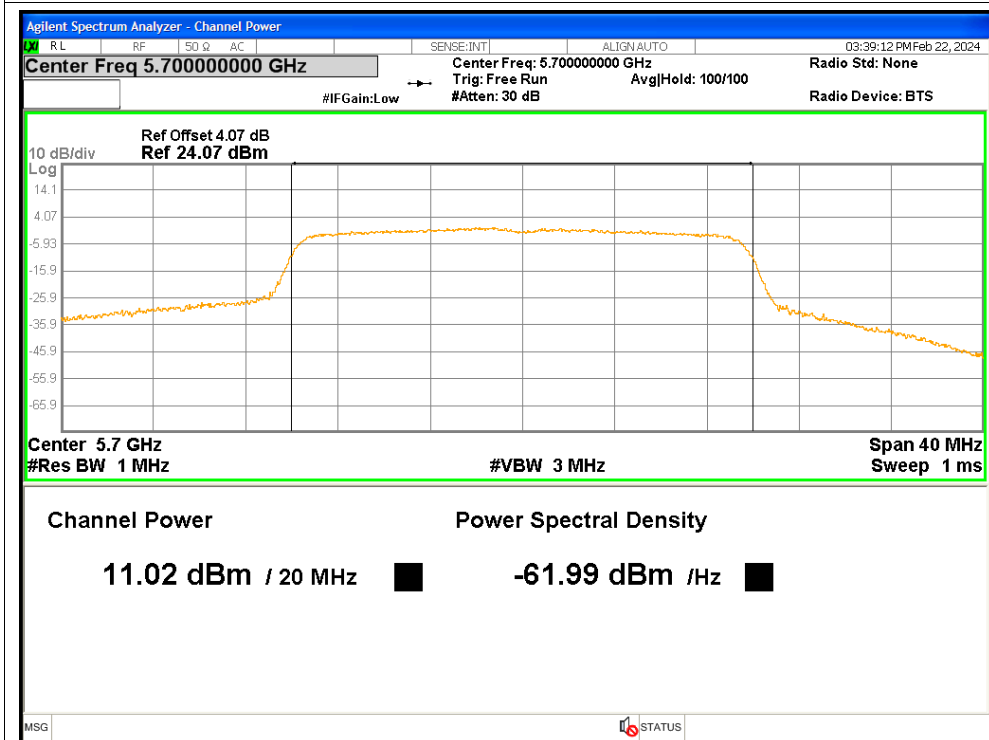


Power NVNT ax20 5700MHz Ant3

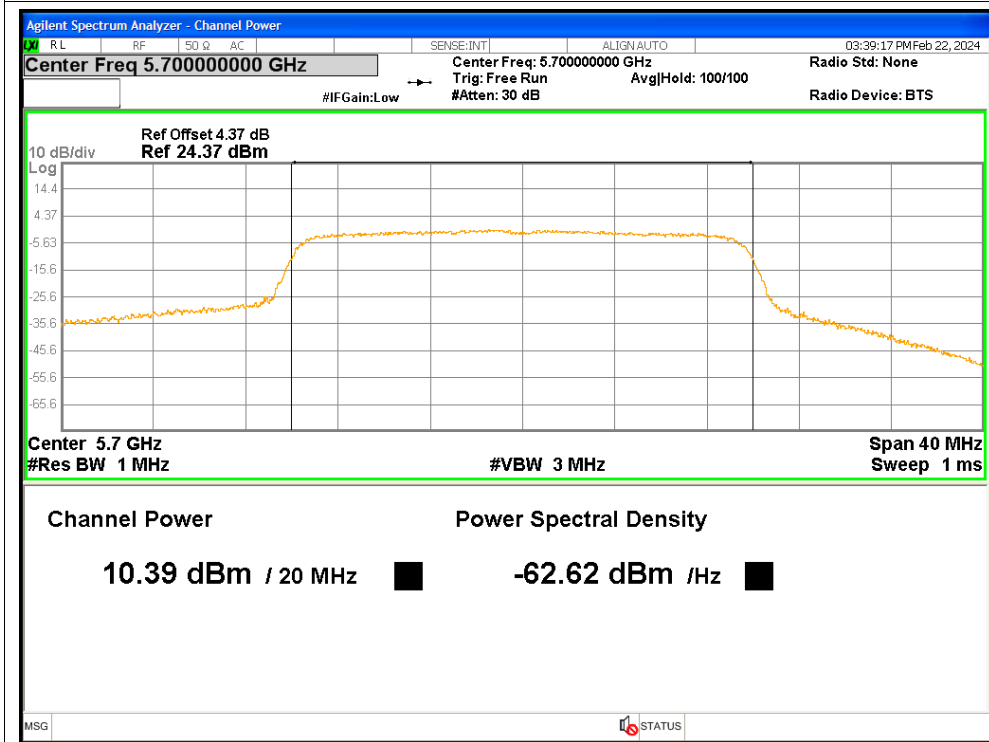


Power NVNT ax40 5510MHz Ant1

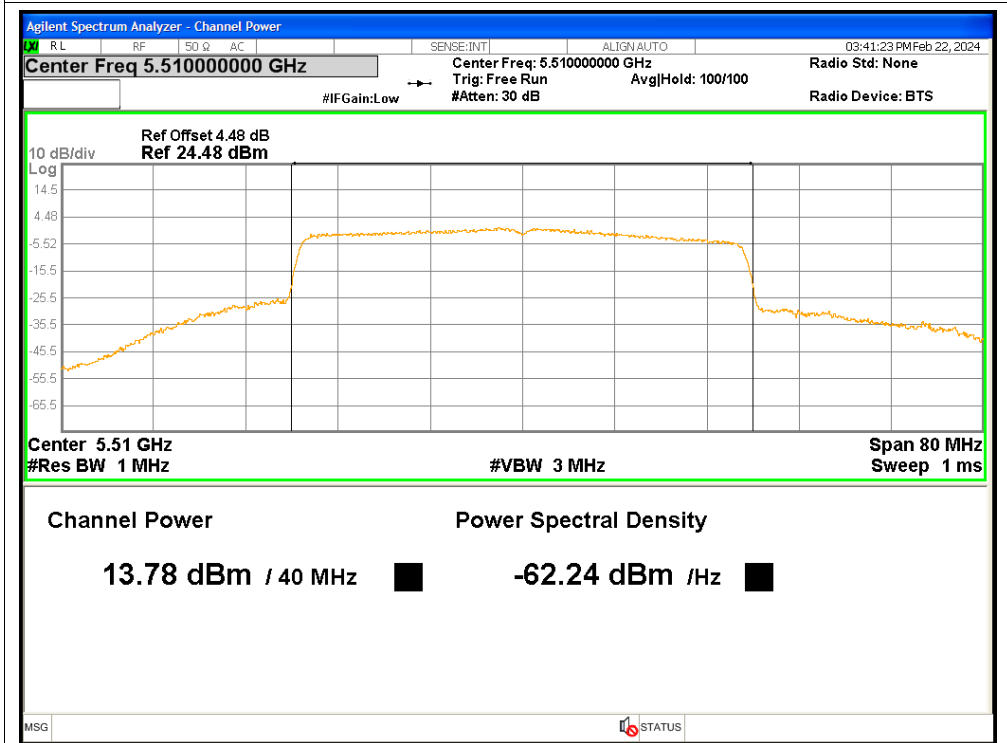


Power NVNT ax40 5510MHz Ant2

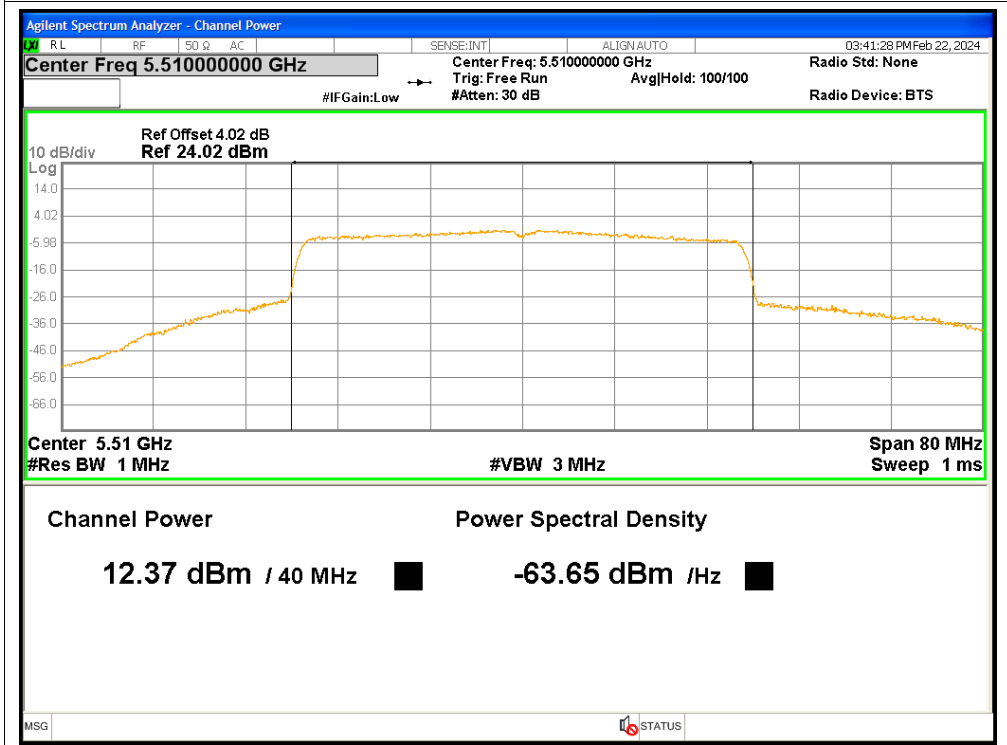


### Power NVNT ax40 5510MHz Ant3

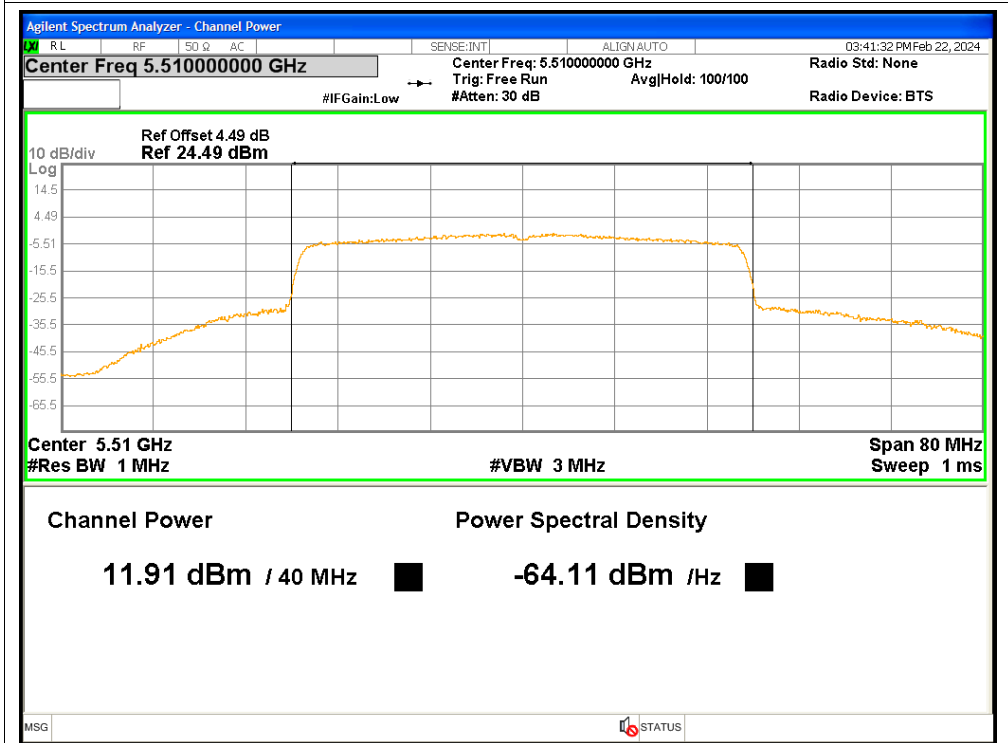


### Power NVNT ax40 5550MHz Ant1

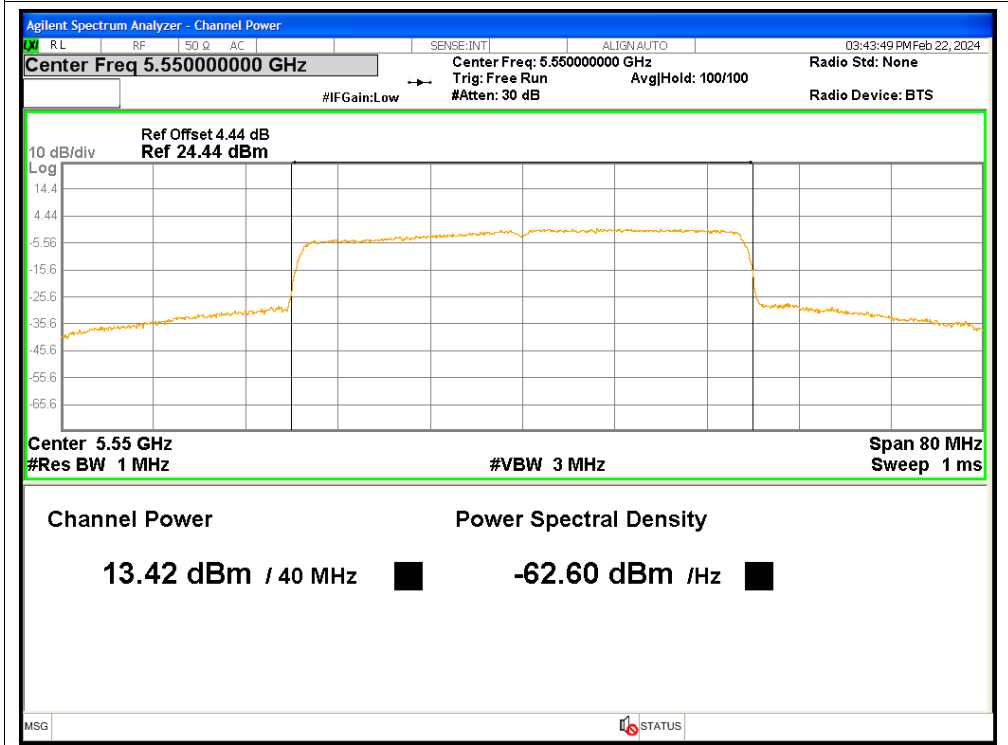

Power NVNT ax40 5550MHz Ant2

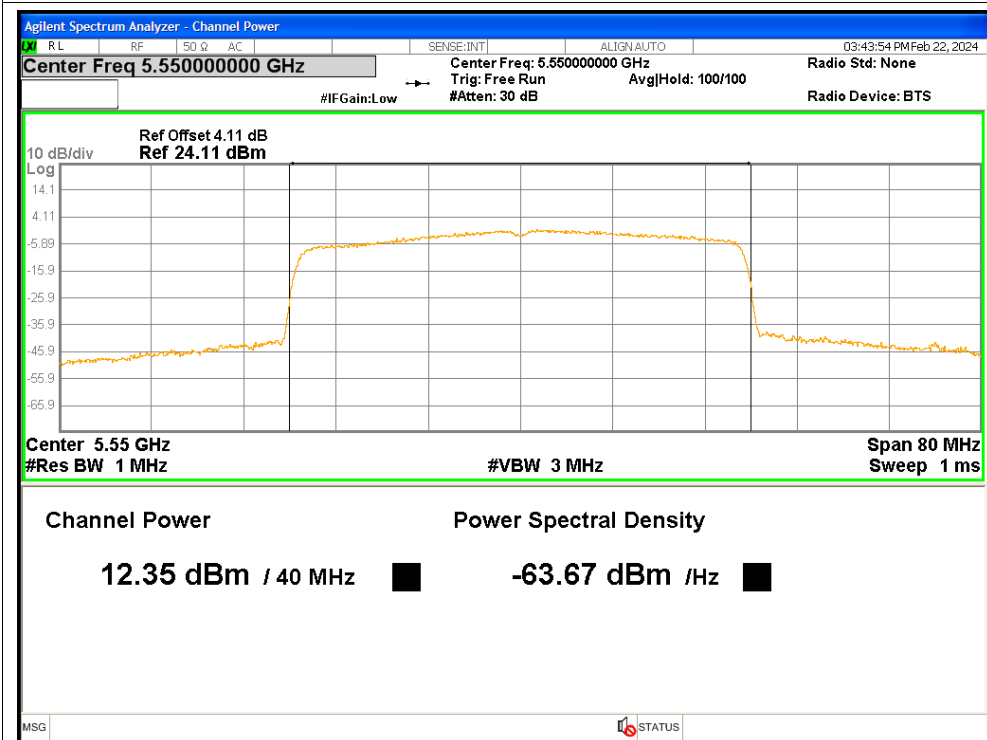


Power NVNT ax40 5550MHz Ant3

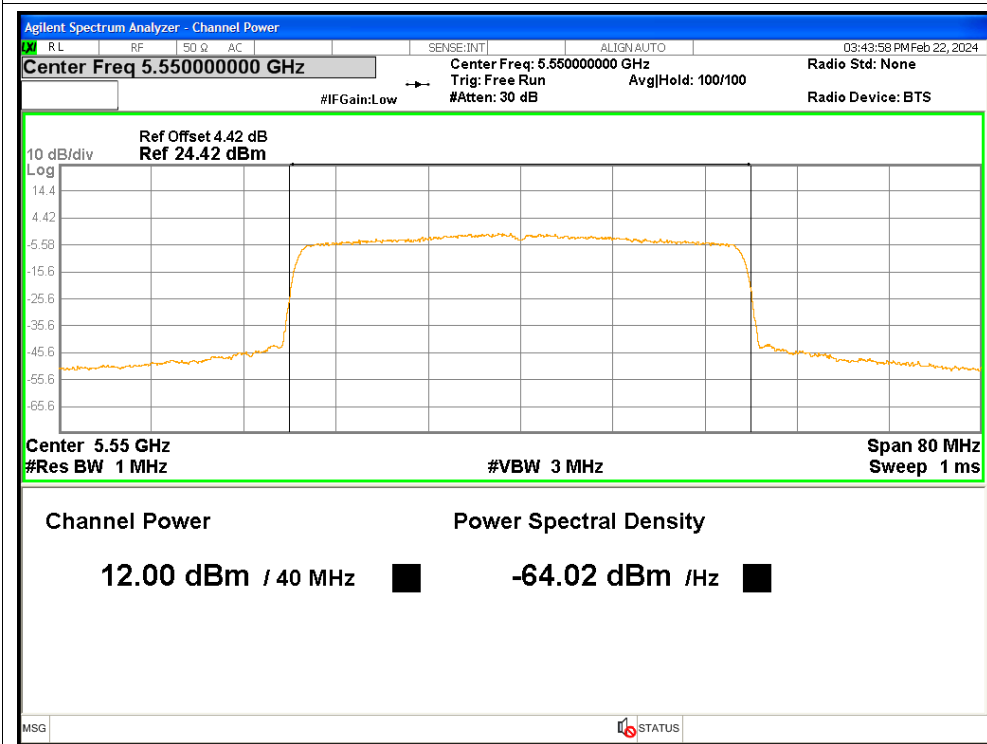





Power NVNT ax40 5670MHz Ant1

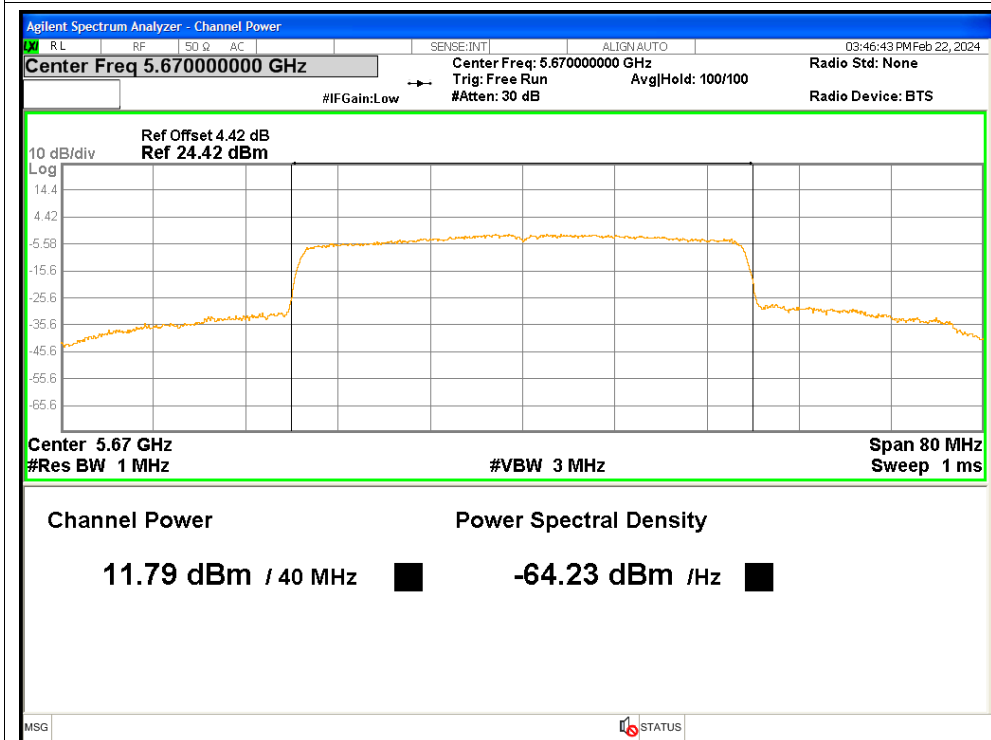


Power NVNT ax40 5670MHz Ant2

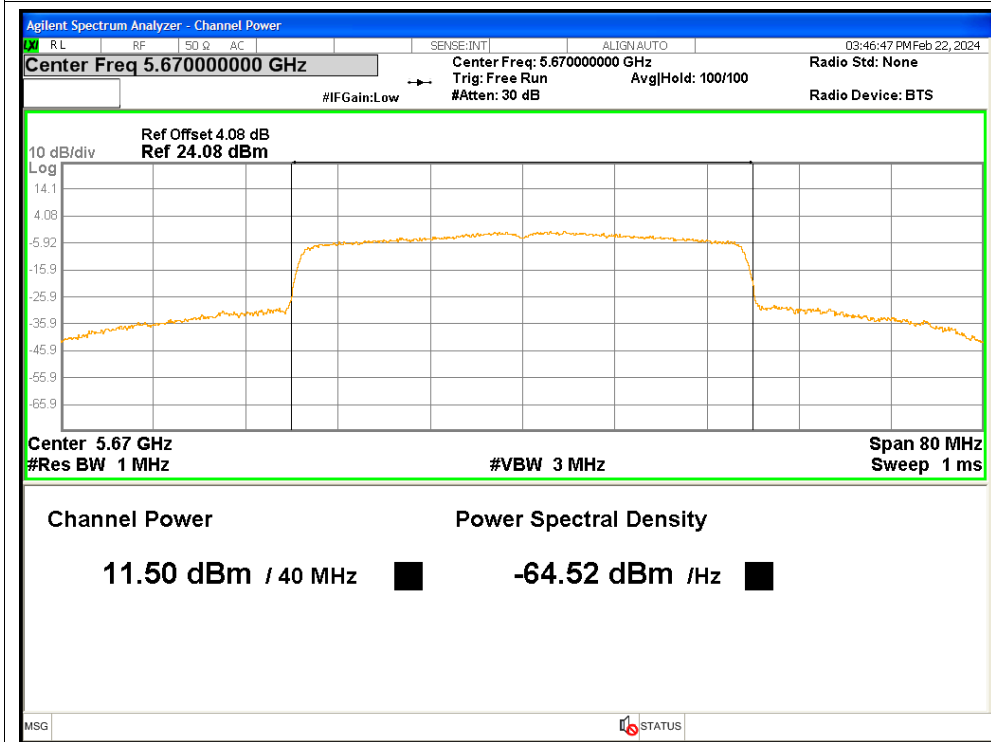


### Power NVNT ax40 5670MHz Ant3

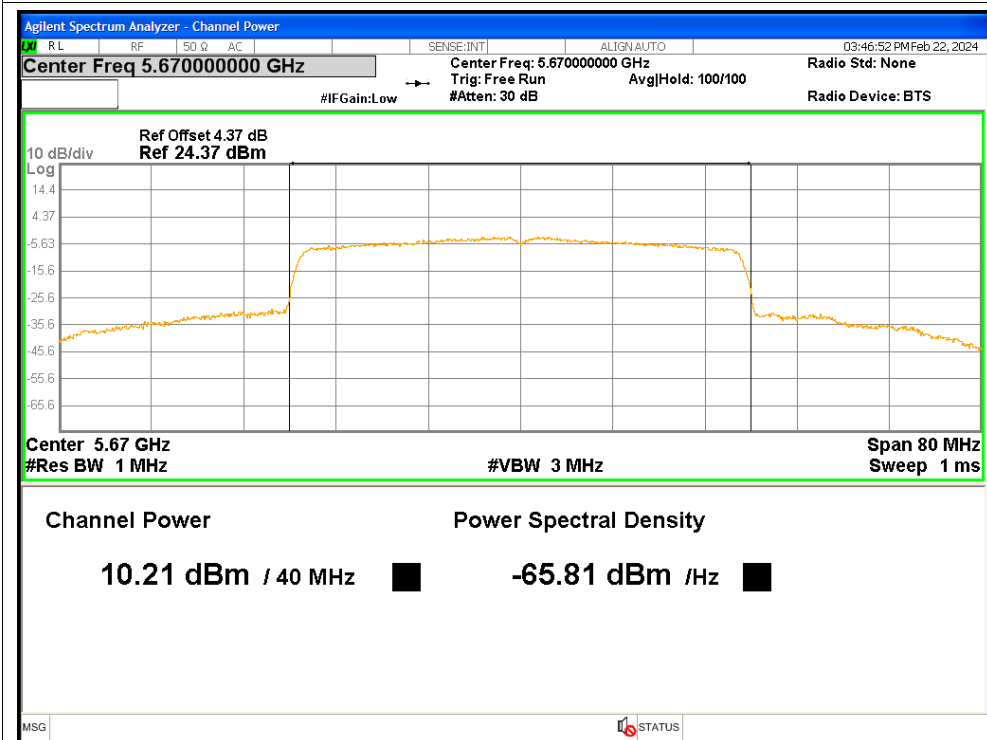


### Power NVNT ax80 5530MHz Ant1

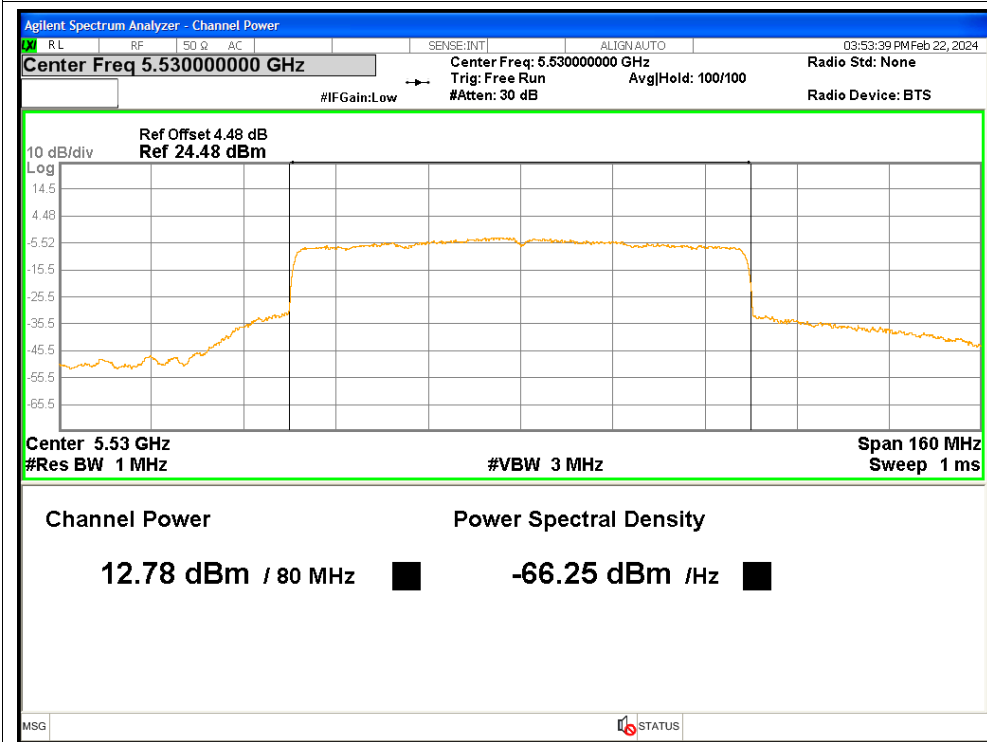


### Power NVNT ax80 5530MHz Ant2

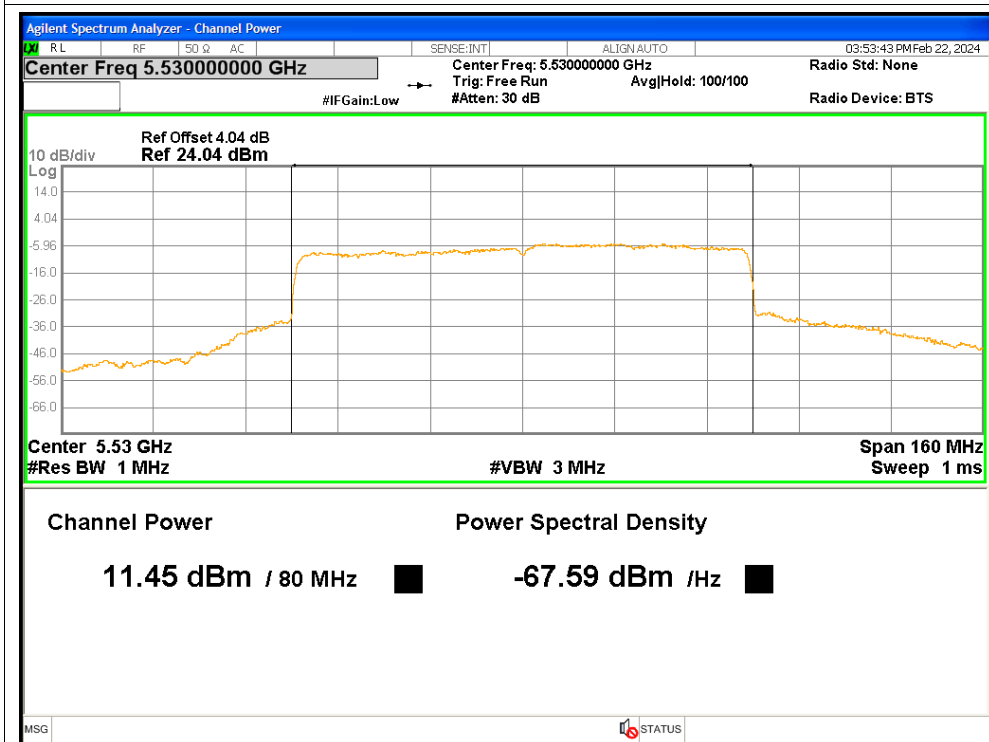


### Power NVNT ax80 5530MHz Ant3

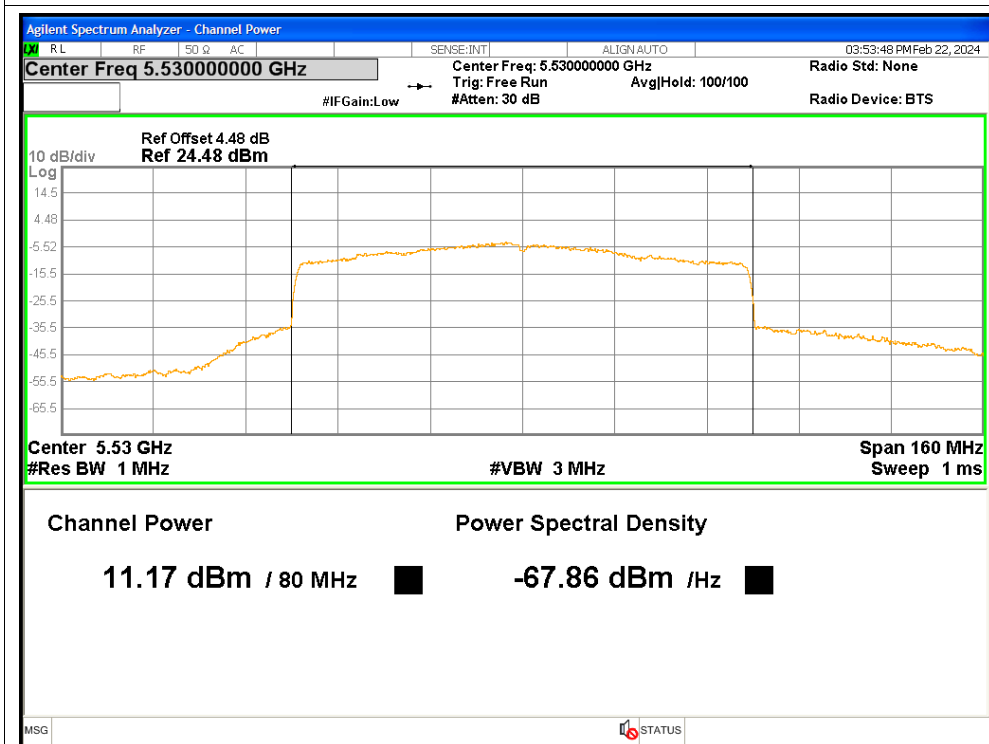


Power NVNT ax80 5610MHz Ant1

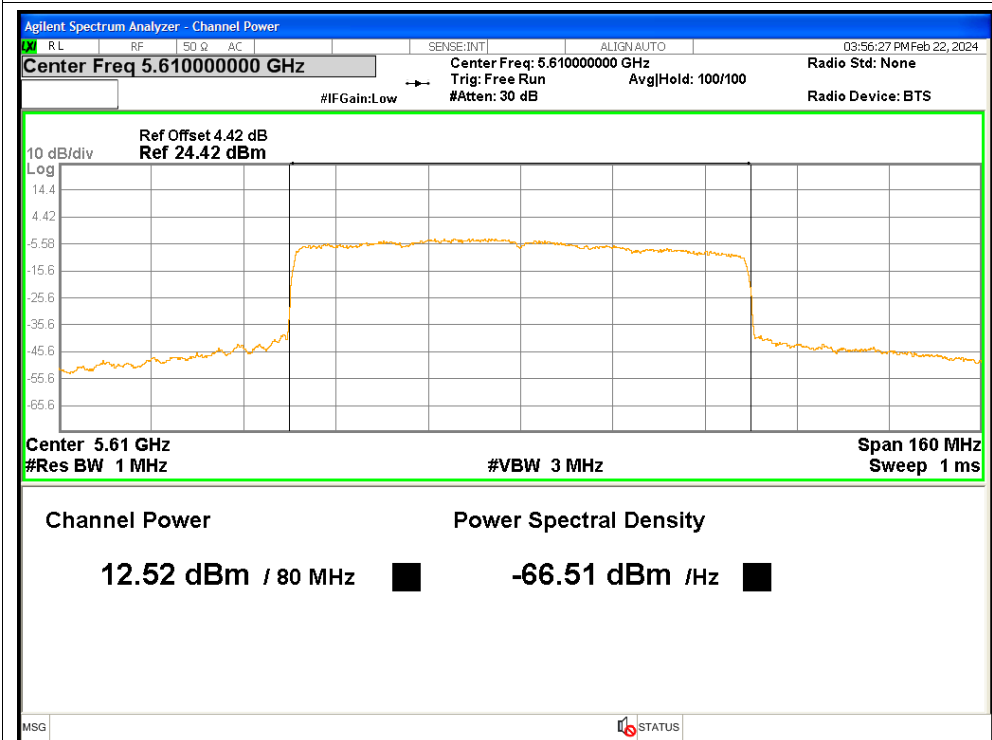


Power NVNT ax80 5610MHz Ant2

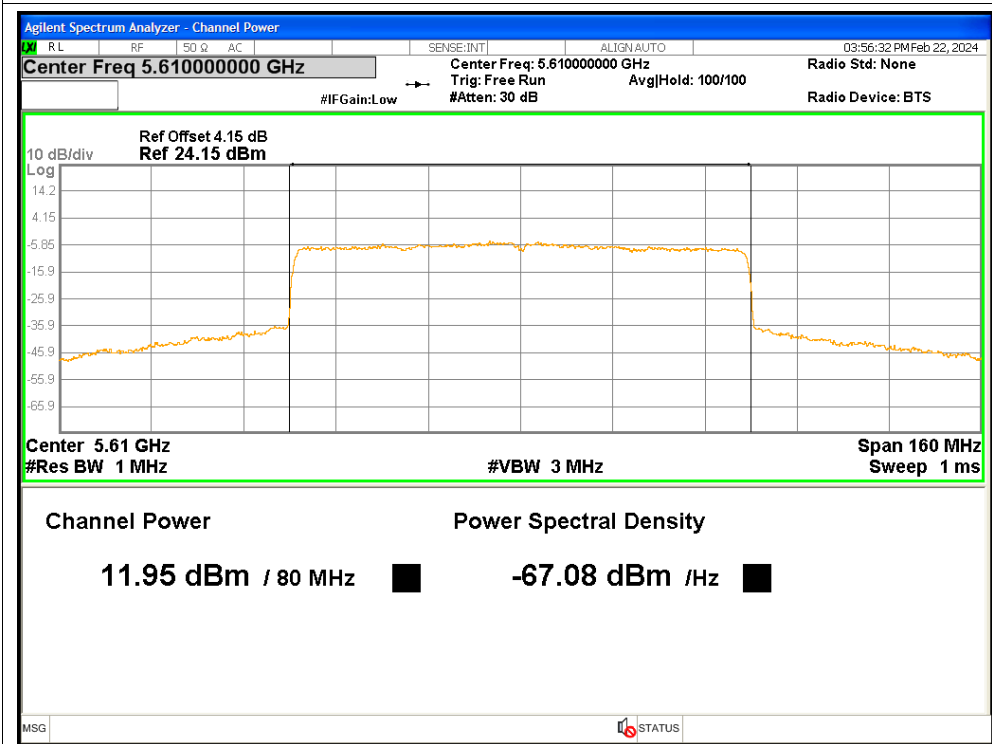


Power NVNT ax80 5610MHz Ant3

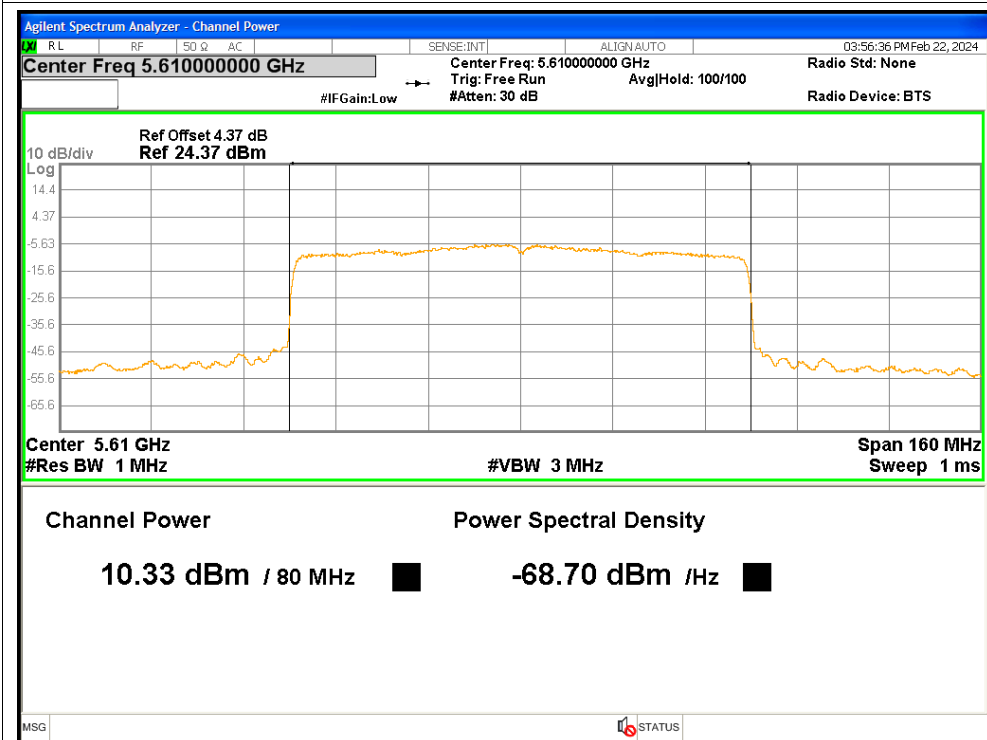


Power NVNT n20 5500MHz Ant1

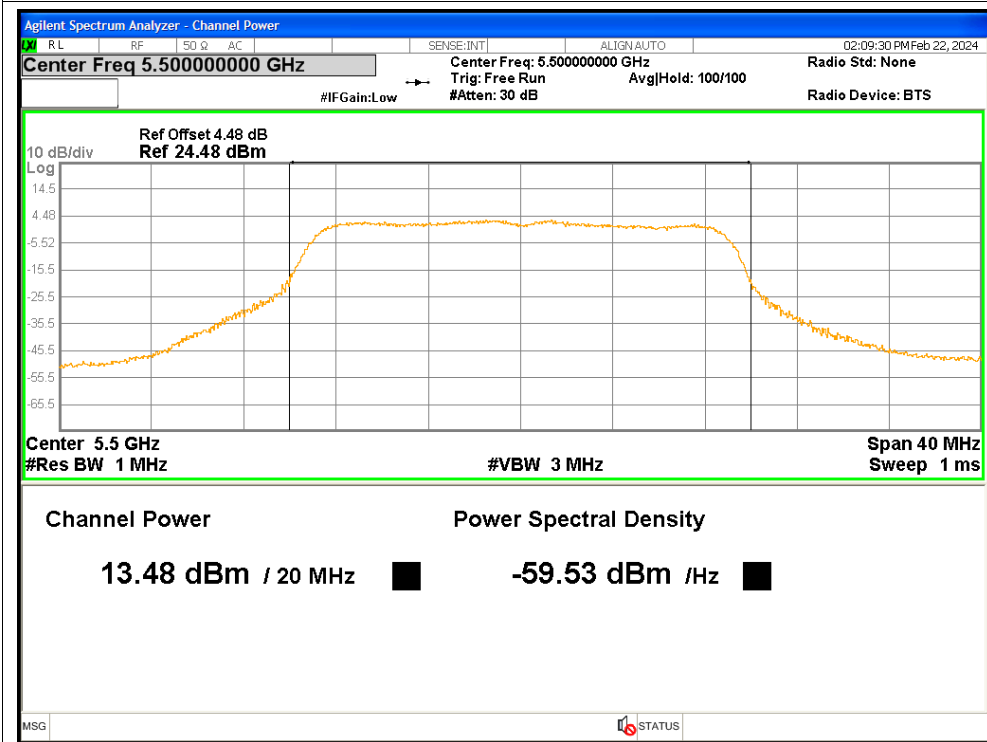


### Power NVNT n20 5500MHz Ant2

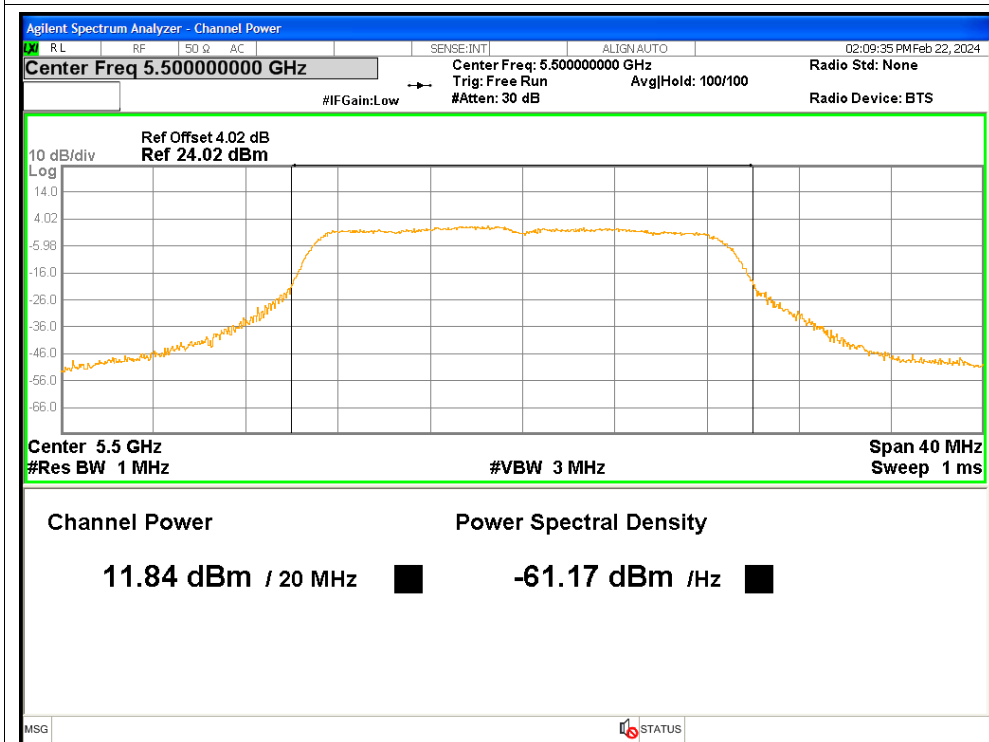


### Power NVNT n20 5500MHz Ant3

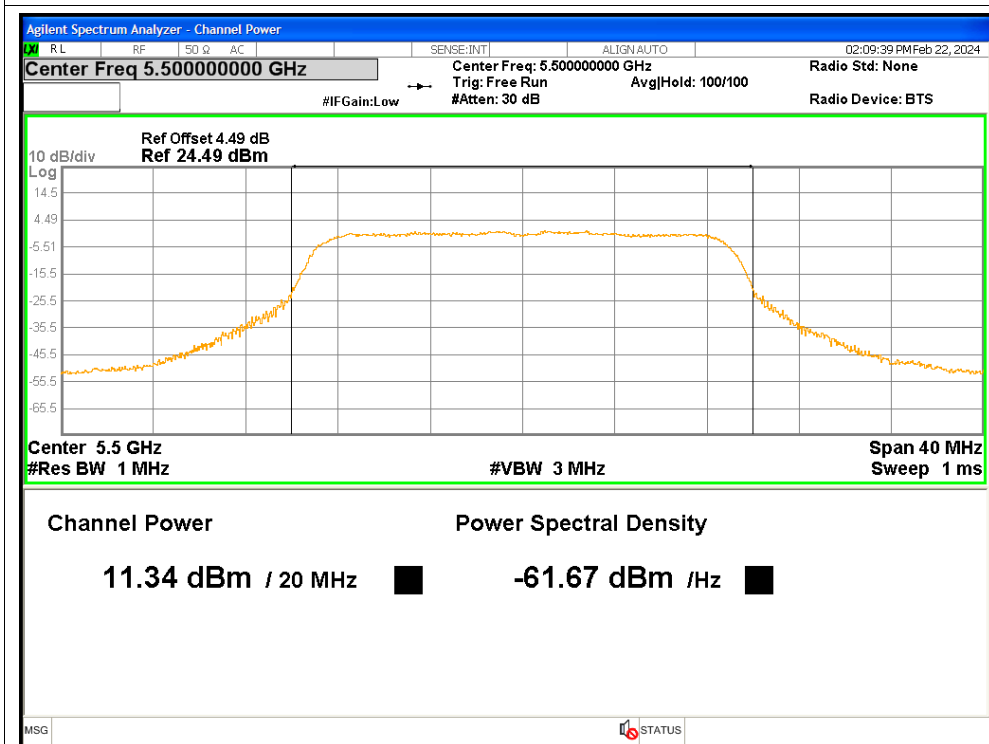


### Power NVNT n20 5580MHz Ant1

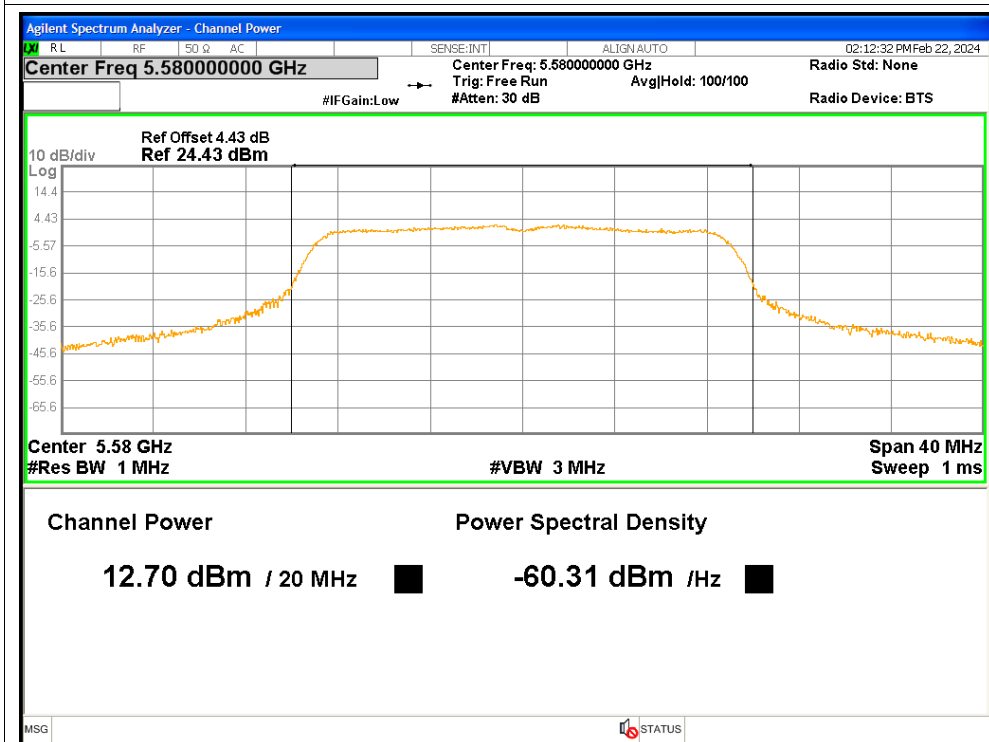


### Power NVNT n20 5580MHz Ant2

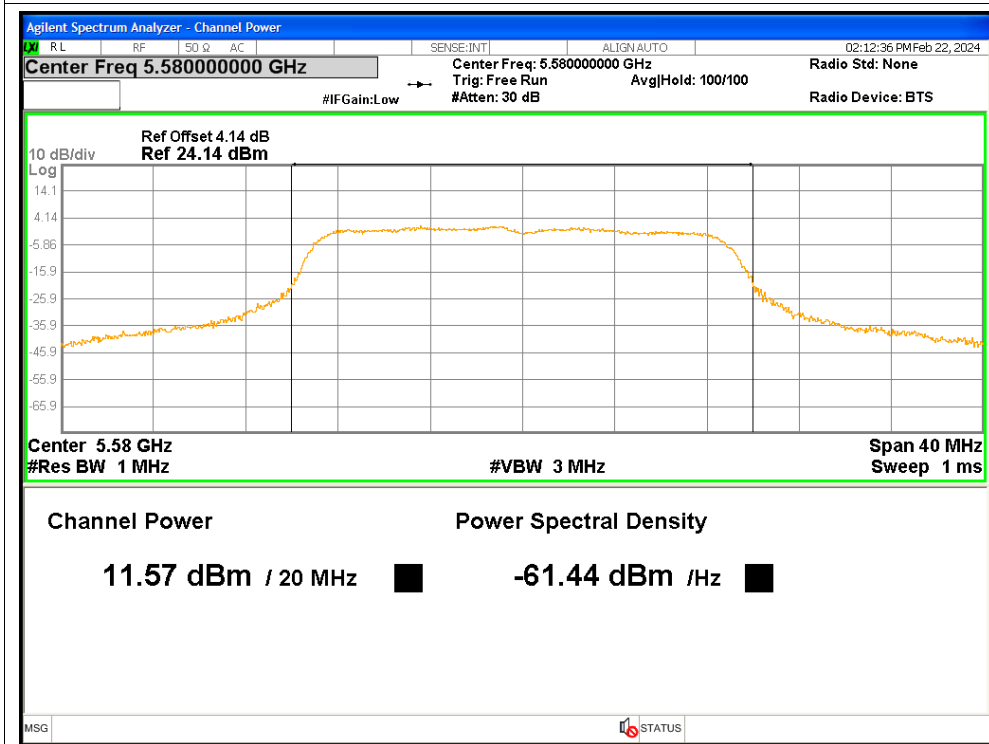

### Power NVNT n20 5580MHz Ant3

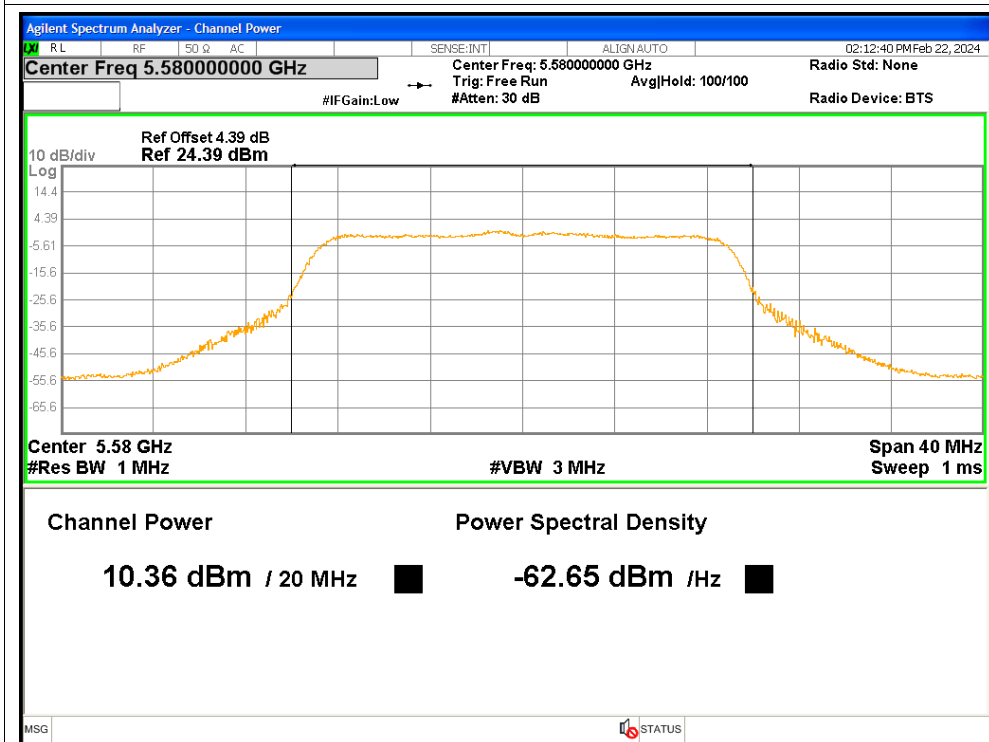


### Power NVNT n20 5700MHz Ant1

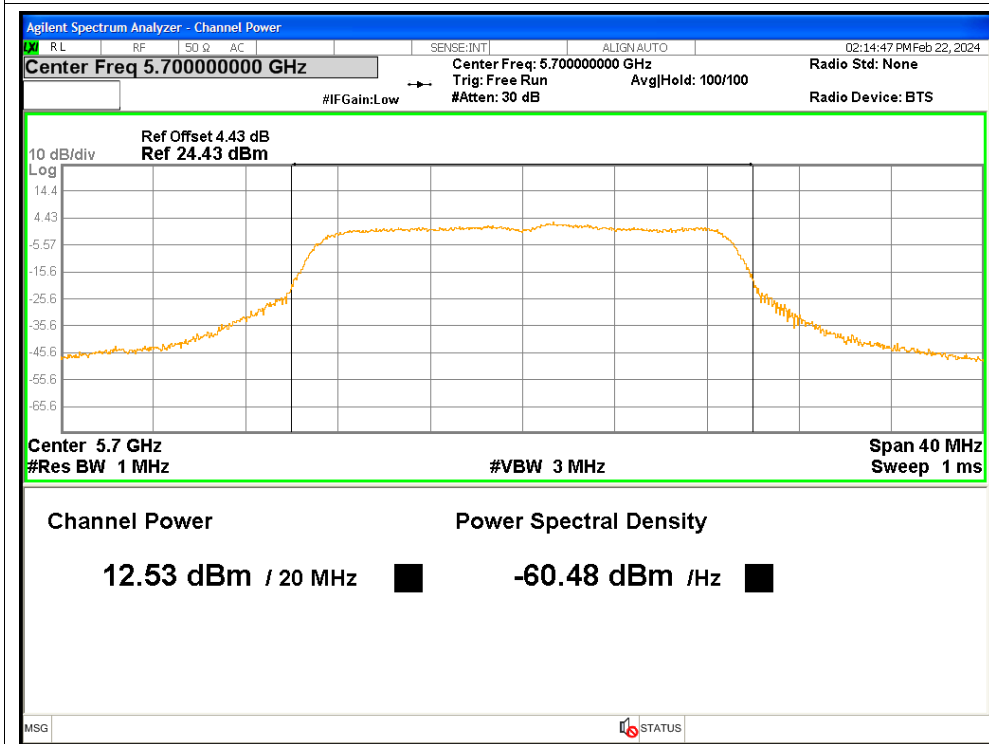





Power NVNT n20 5700MHz Ant2

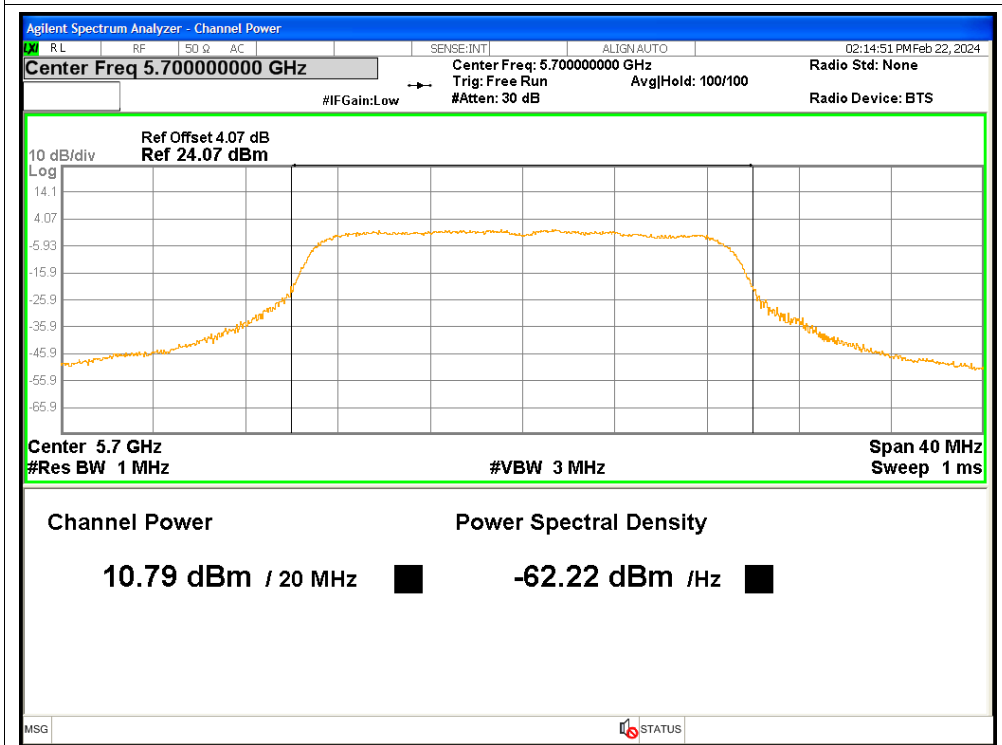


Power NVNT n20 5700MHz Ant3

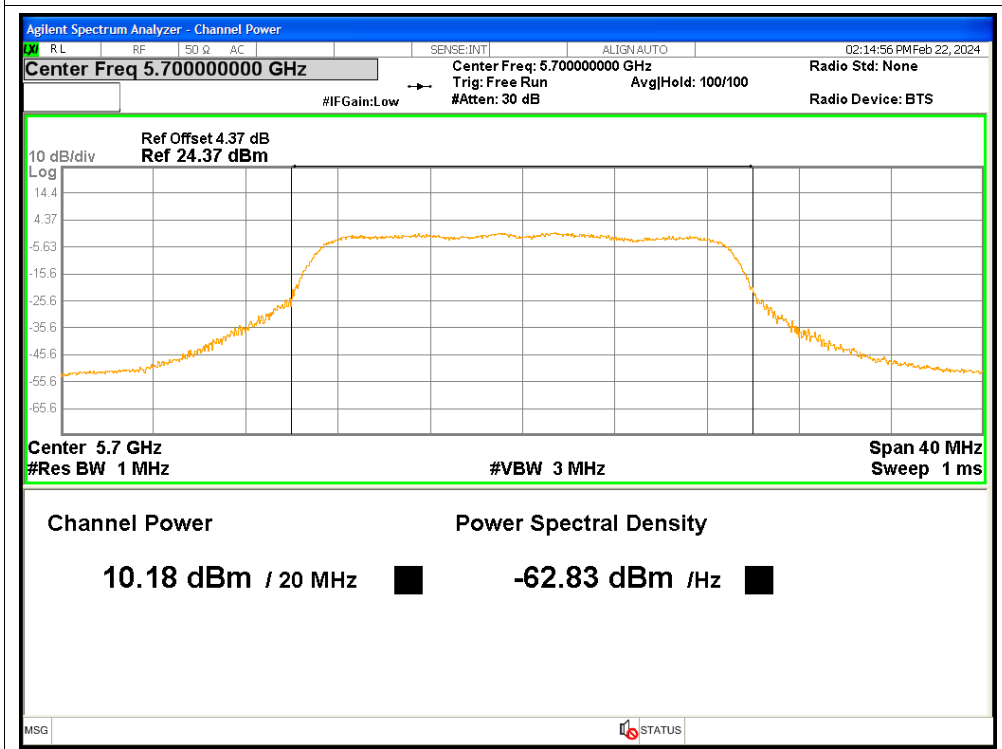


### Power NVNT n40 5510MHz Ant1

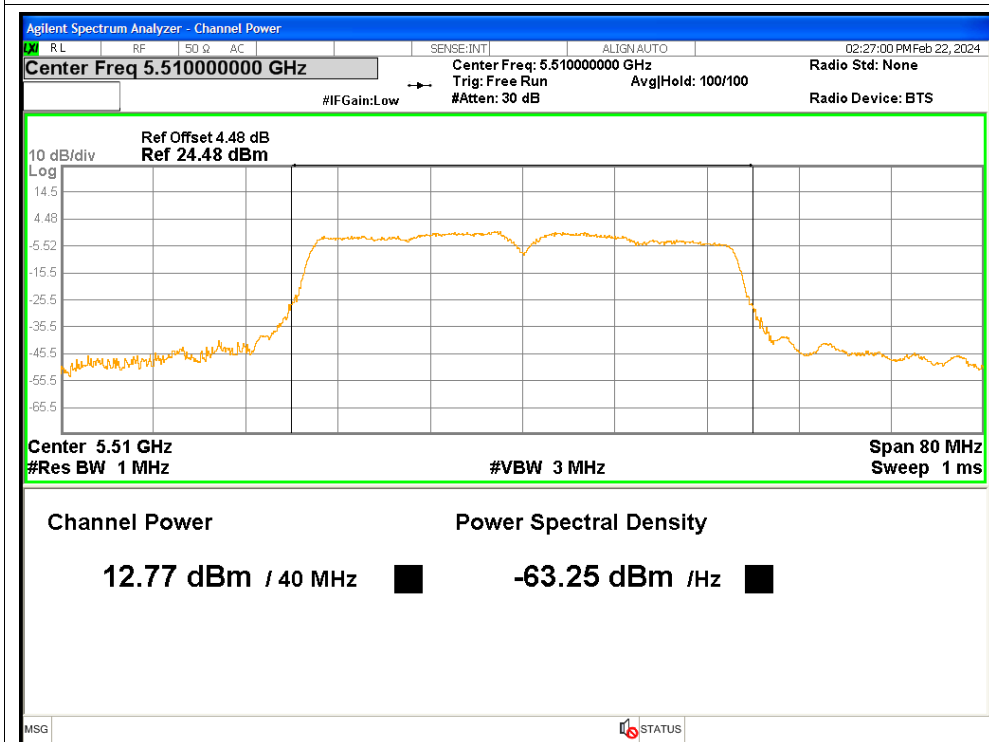


### Power NVNT n40 5510MHz Ant2

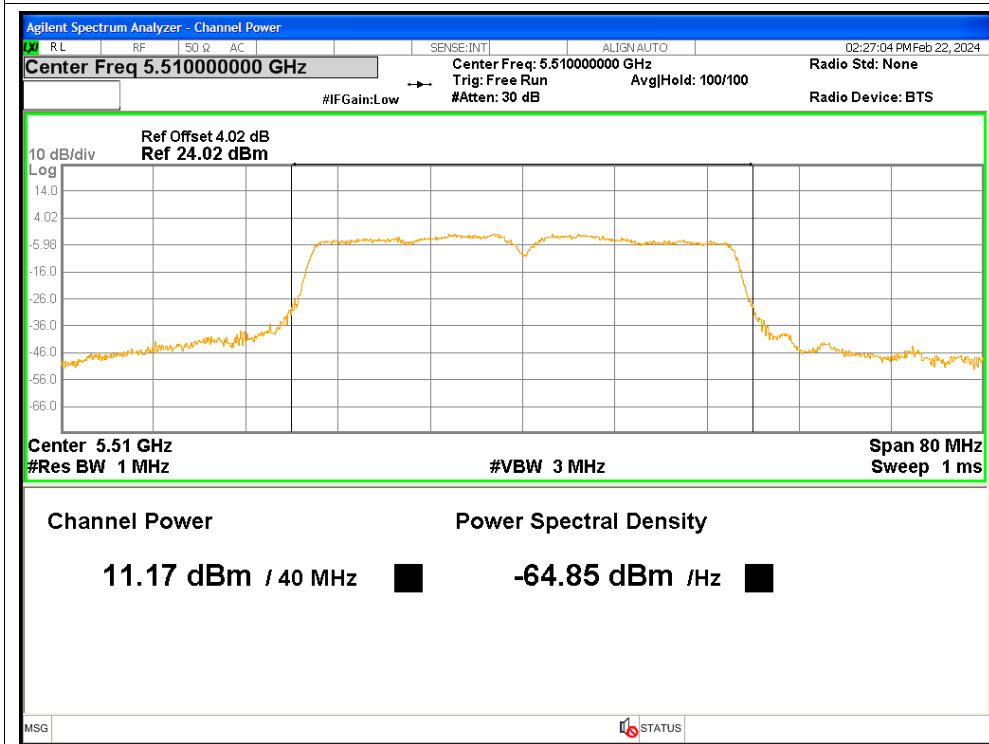


### Power NVNT n40 5510MHz Ant3

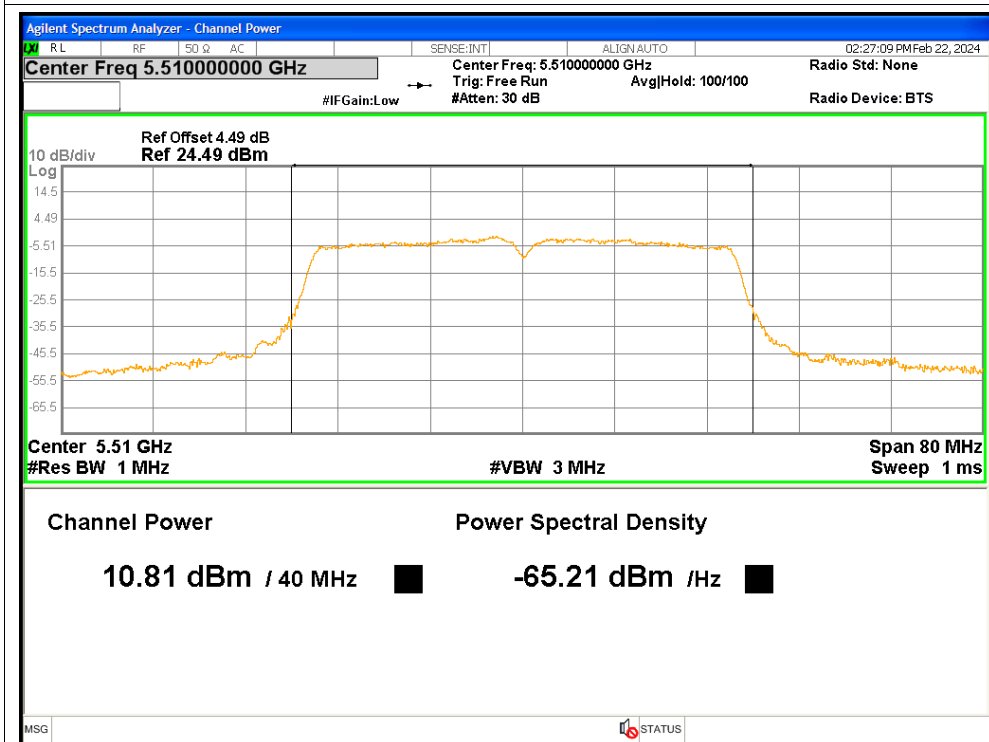


### Power NVNT n40 5550MHz Ant1

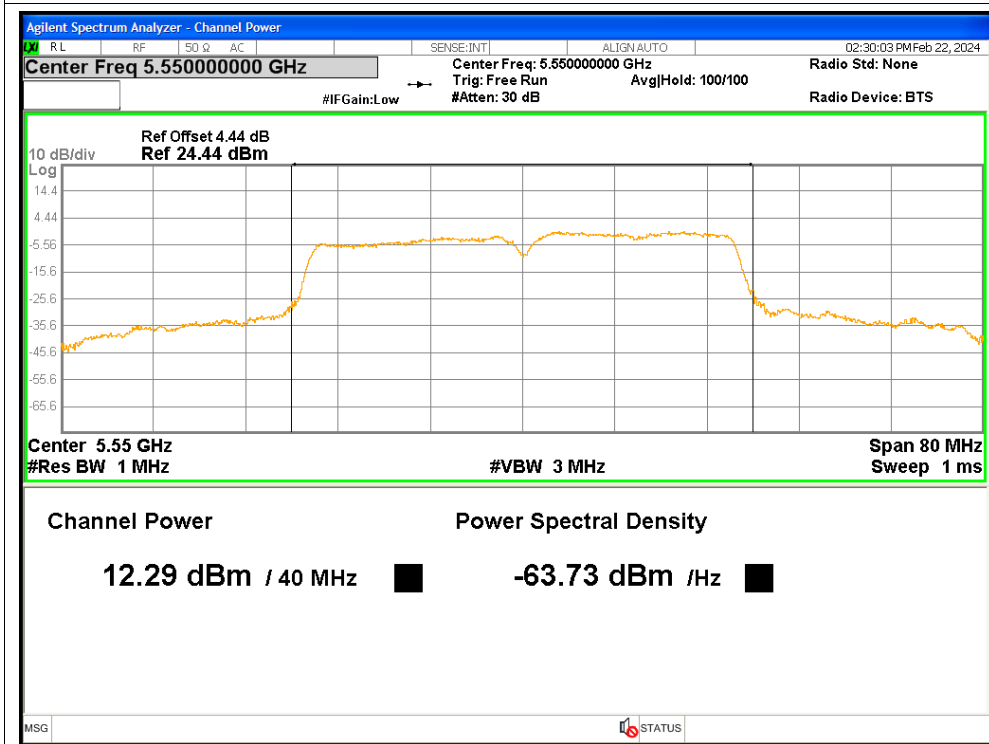


Power NVNT n40 5550MHz Ant2

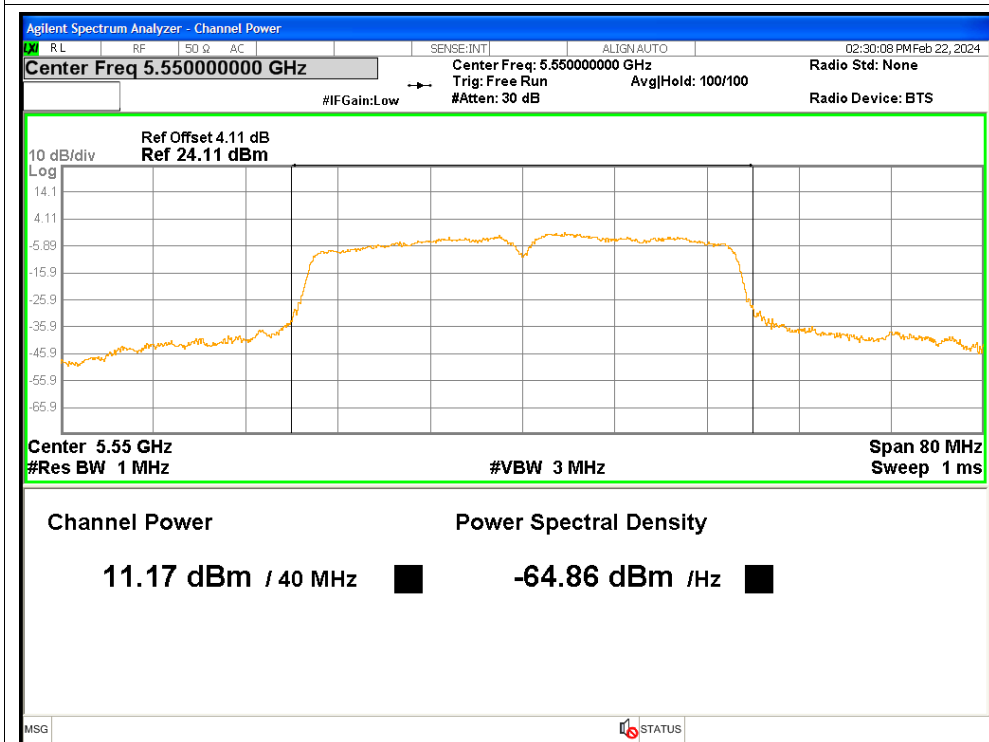


Power NVNT n40 5550MHz Ant3

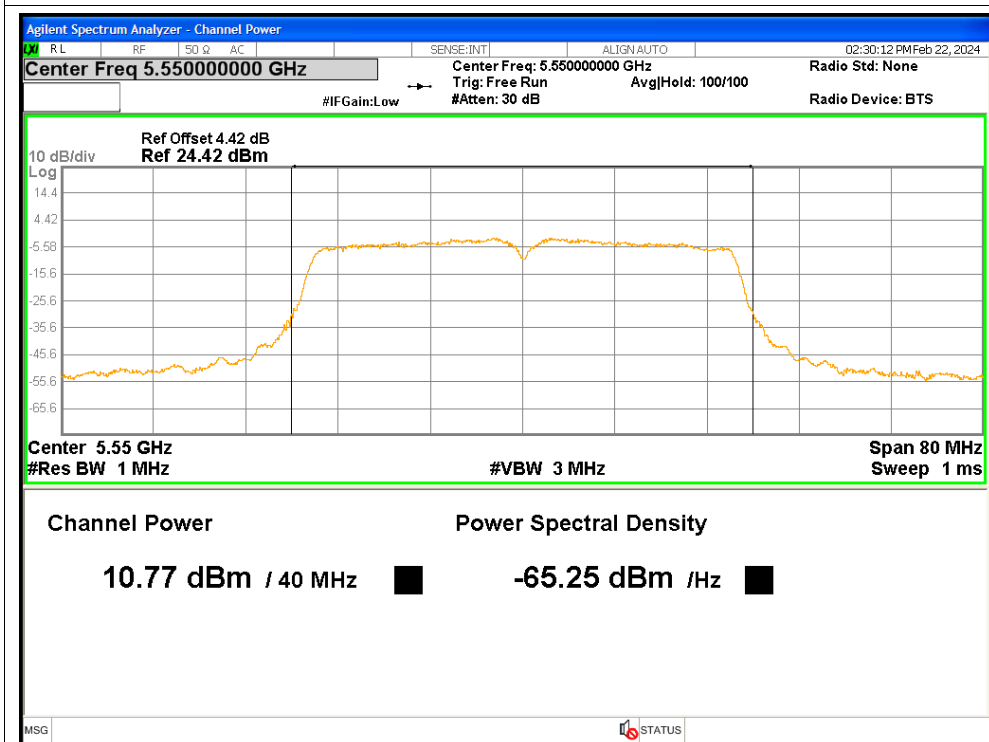


### Power NVNT n40 5670MHz Ant1

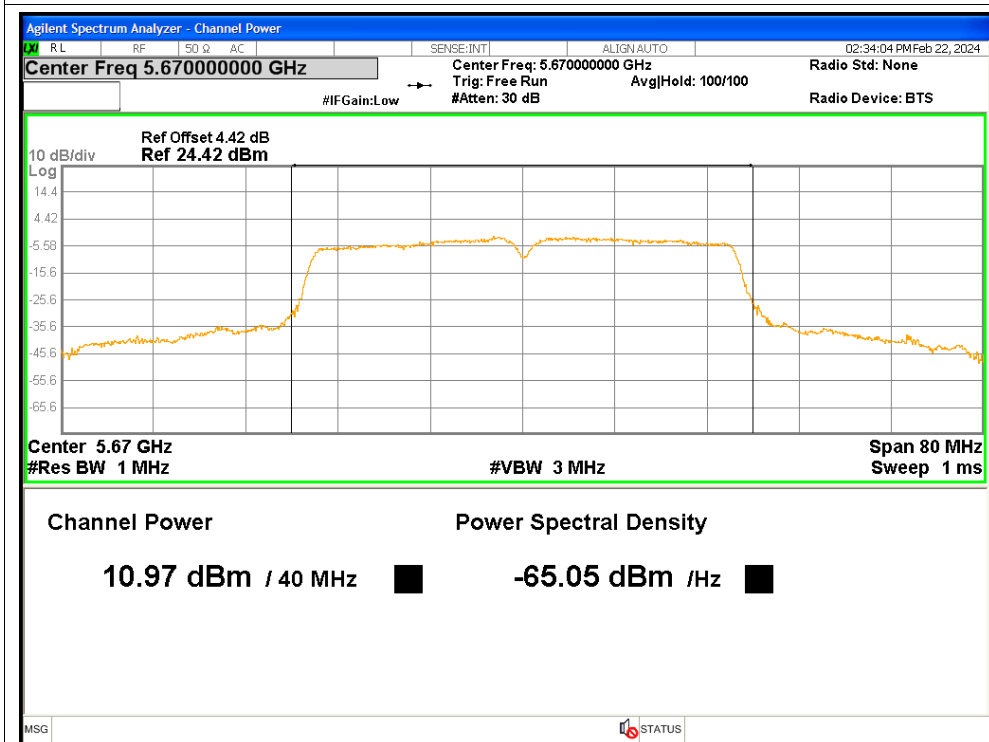

### Power NVNT n40 5670MHz Ant2

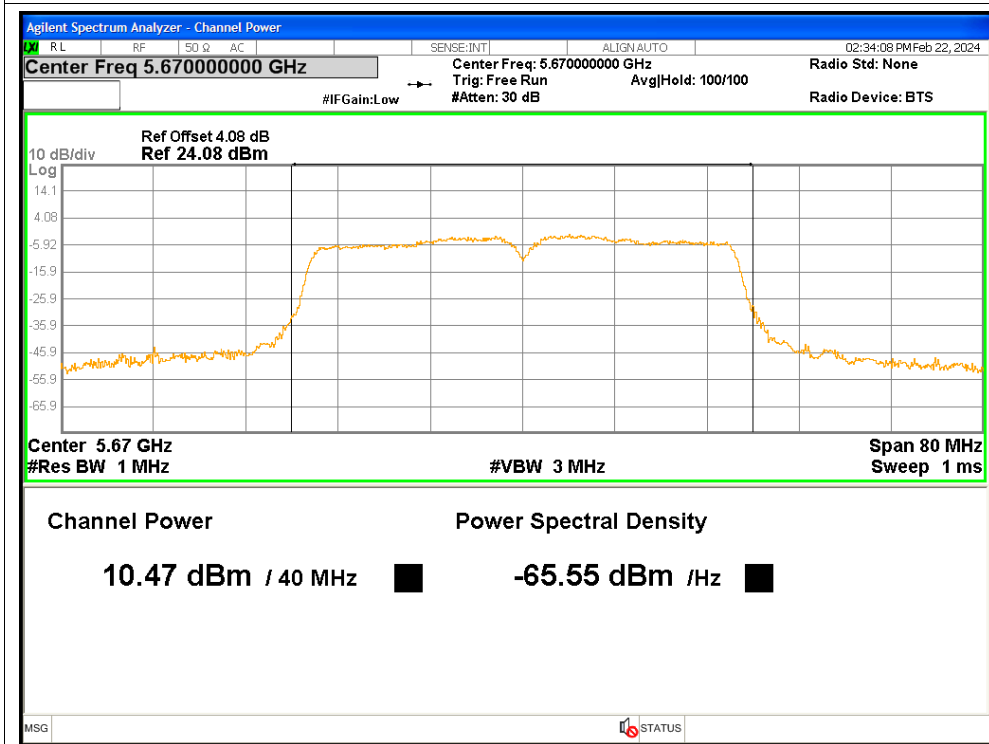

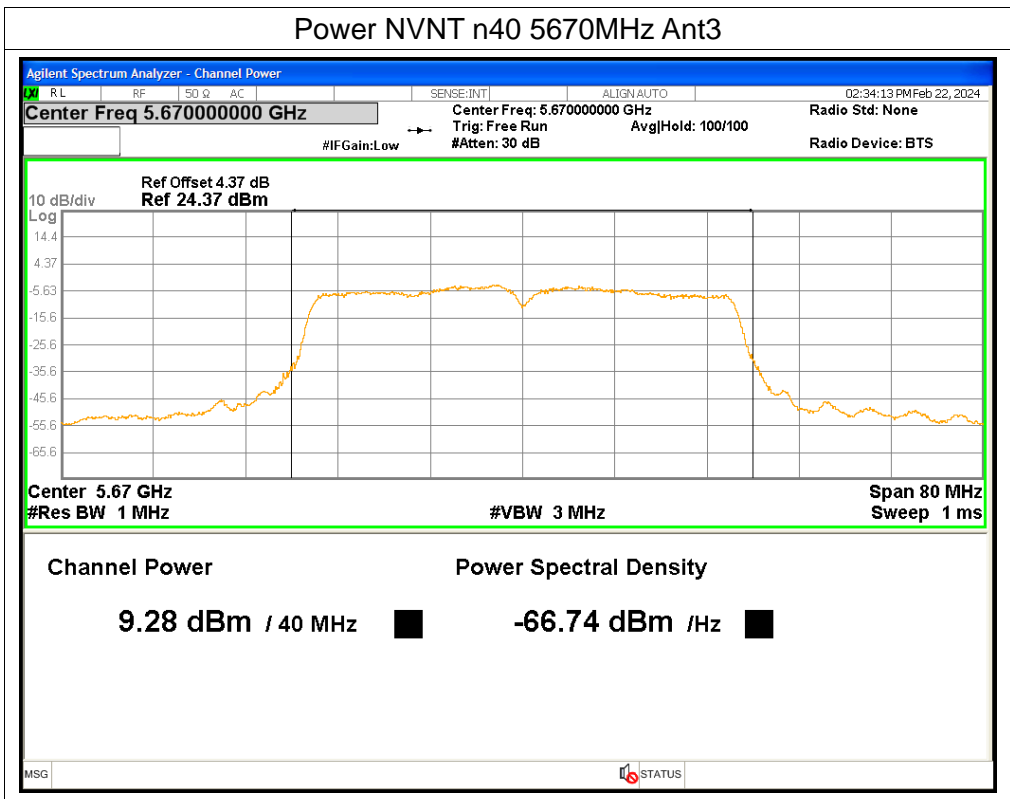

### 3. -26dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Verdict
NVNT	a	5500	Ant1	26.843	Pass
NVNT	a	5580	Ant1	21.2267	Pass
NVNT	a	5700	Ant1	22.7883	Pass
NVNT	a	5500	Ant2	26.2922	Pass
NVNT	a	5580	Ant2	22.801	Pass
NVNT	a	5700	Ant2	25.1091	Pass
NVNT	a	5500	Ant3	25.6335	Pass
NVNT	a	5580	Ant3	20.8634	Pass
NVNT	a	5700	Ant3	25.1532	Pass
NVNT	ac160	5570	Ant1	159.1148	Pass
NVNT	ac160	5570	Ant2	161.9545	Pass
NVNT	ac160	5570	Ant3	166.725	Pass
NVNT	ac20	5500	Ant1	26.8165	Pass
NVNT	ac20	5500	Ant2	26.4618	Pass
NVNT	ac20	5500	Ant3	28.1646	Pass
NVNT	ac20	5580	Ant1	22.1599	Pass
NVNT	ac20	5580	Ant2	21.7147	Pass
NVNT	ac20	5580	Ant3	21.7692	Pass
NVNT	ac20	5700	Ant1	25.1342	Pass
NVNT	ac20	5700	Ant2	25.8498	Pass
NVNT	ac20	5700	Ant3	26.0842	Pass
NVNT	ac40	5510	Ant1	46.5389	Pass
NVNT	ac40	5510	Ant2	48.7213	Pass
NVNT	ac40	5510	Ant3	48.0001	Pass
NVNT	ac40	5550	Ant1	46.4213	Pass
NVNT	ac40	5550	Ant2	39.1335	Pass
NVNT	ac40	5550	Ant3	40.108	Pass
NVNT	ac40	5670	Ant1	50.0911	Pass
NVNT	ac40	5670	Ant2	46.4253	Pass
NVNT	ac40	5670	Ant3	55.9291	Pass
NVNT	ac80	5530	Ant1	105.7885	Pass
NVNT	ac80	5530	Ant2	96.4749	Pass
NVNT	ac80	5530	Ant3	94.1678	Pass
NVNT	ac80	5610	Ant1	78.7581	Pass
NVNT	ac80	5610	Ant2	78.2622	Pass
NVNT	ac80	5610	Ant3	78.2853	Pass
NVNT	ax160	5570	Ant1	159.0273	Pass
NVNT	ax160	5570	Ant2	158.8901	Pass
NVNT	ax160	5570	Ant3	163.2229	Pass
NVNT	ax20	5500	Ant1	24.6828	Pass
NVNT	ax20	5500	Ant2	26.7692	Pass

NVNT	ax20	5500	Ant3	26.416	Pass
NVNT	ax20	5580	Ant1	22.1497	Pass
NVNT	ax20	5580	Ant2	21.5767	Pass
NVNT	ax20	5580	Ant3	21.8804	Pass
NVNT	ax20	5700	Ant1	22.9288	Pass
NVNT	ax20	5700	Ant2	24.7138	Pass
NVNT	ax20	5700	Ant3	23.0304	Pass
NVNT	ax40	5510	Ant1	46.4147	Pass
NVNT	ax40	5510	Ant2	51.7657	Pass
NVNT	ax40	5510	Ant3	47.0988	Pass
NVNT	ax40	5550	Ant1	50.3503	Pass
NVNT	ax40	5550	Ant2	39.1927	Pass
NVNT	ax40	5550	Ant3	39.0714	Pass
NVNT	ax40	5670	Ant1	54.6486	Pass
NVNT	ax40	5670	Ant2	51.9045	Pass
NVNT	ax40	5670	Ant3	46.5442	Pass
NVNT	ax80	5530	Ant1	81.5919	Pass
NVNT	ax80	5530	Ant2	89.6759	Pass
NVNT	ax80	5530	Ant3	91.8239	Pass
NVNT	ax80	5610	Ant1	79.0733	Pass
NVNT	ax80	5610	Ant2	79.1643	Pass
NVNT	ax80	5610	Ant3	79.0399	Pass
NVNT	n20	5500	Ant1	21.3573	Pass
NVNT	n20	5500	Ant2	21.4315	Pass
NVNT	n20	5500	Ant3	20.8064	Pass
NVNT	n20	5580	Ant1	21.6079	Pass
NVNT	n20	5580	Ant2	22.226	Pass
NVNT	n20	5580	Ant3	21.214	Pass
NVNT	n20	5700	Ant1	21.6048	Pass
NVNT	n20	5700	Ant2	21.3325	Pass
NVNT	n20	5700	Ant3	21.4345	Pass
NVNT	n40	5510	Ant1	40.2167	Pass
NVNT	n40	5510	Ant2	39.421	Pass
NVNT	n40	5510	Ant3	39.1952	Pass
NVNT	n40	5550	Ant1	40.7016	Pass
NVNT	n40	5550	Ant2	39.298	Pass
NVNT	n40	5550	Ant3	39.5117	Pass
NVNT	n40	5670	Ant1	40.9504	Pass
NVNT	n40	5670	Ant2	38.9634	Pass
NVNT	n40	5670	Ant3	39.7783	Pass




### Test Graphs


#### -26dB Bandwidth NVNT a 5500MHz Ant1

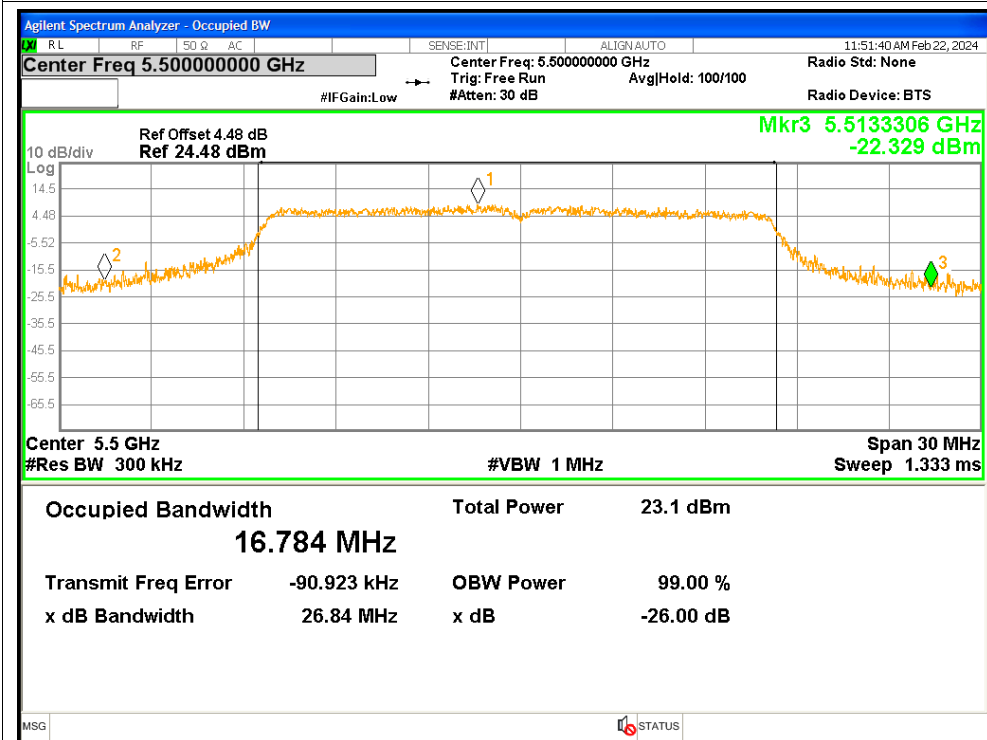


#### -26dB Bandwidth NVNT a 5580MHz Ant1

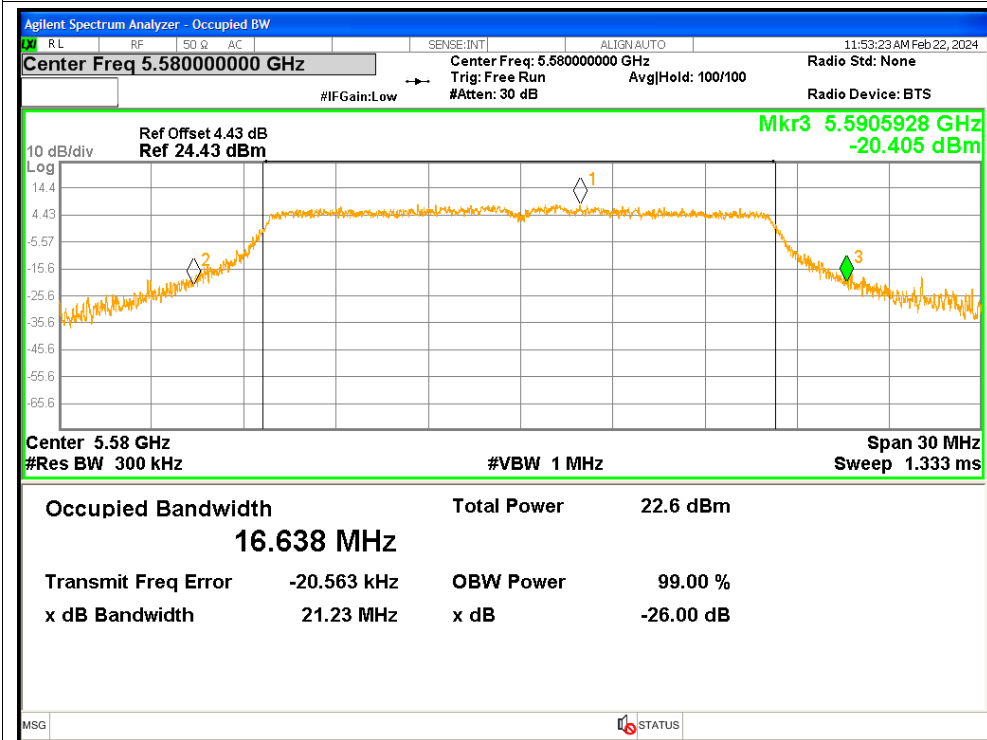


-26dB Bandwidth NVNT a 5700MHz Ant1

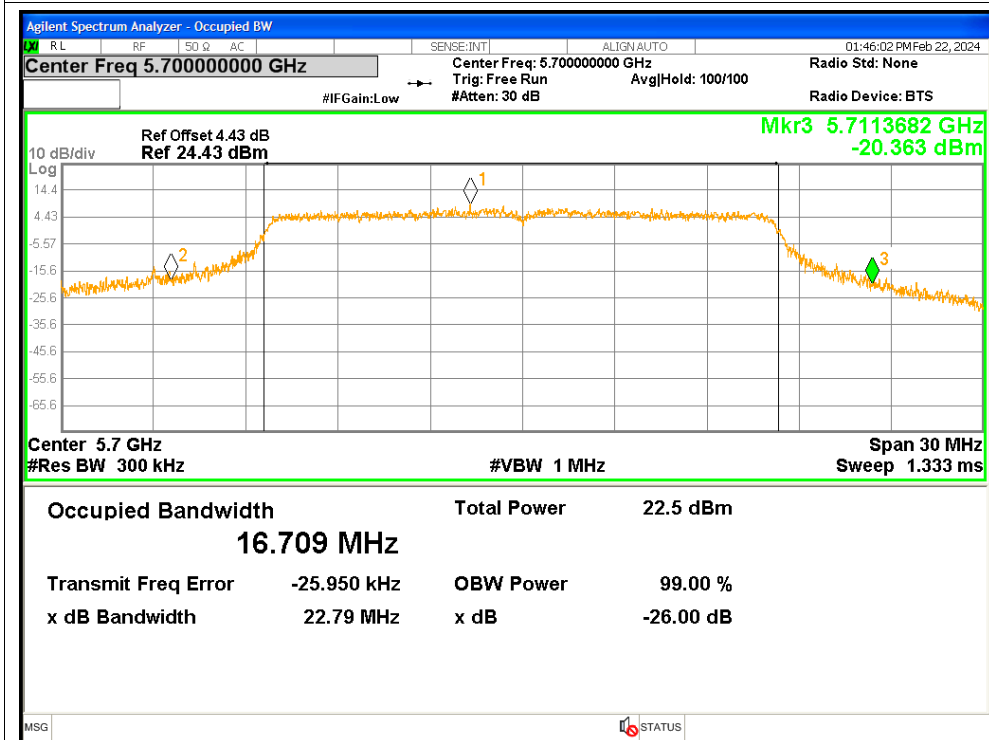


-26dB Bandwidth NVNT a 5500MHz Ant2

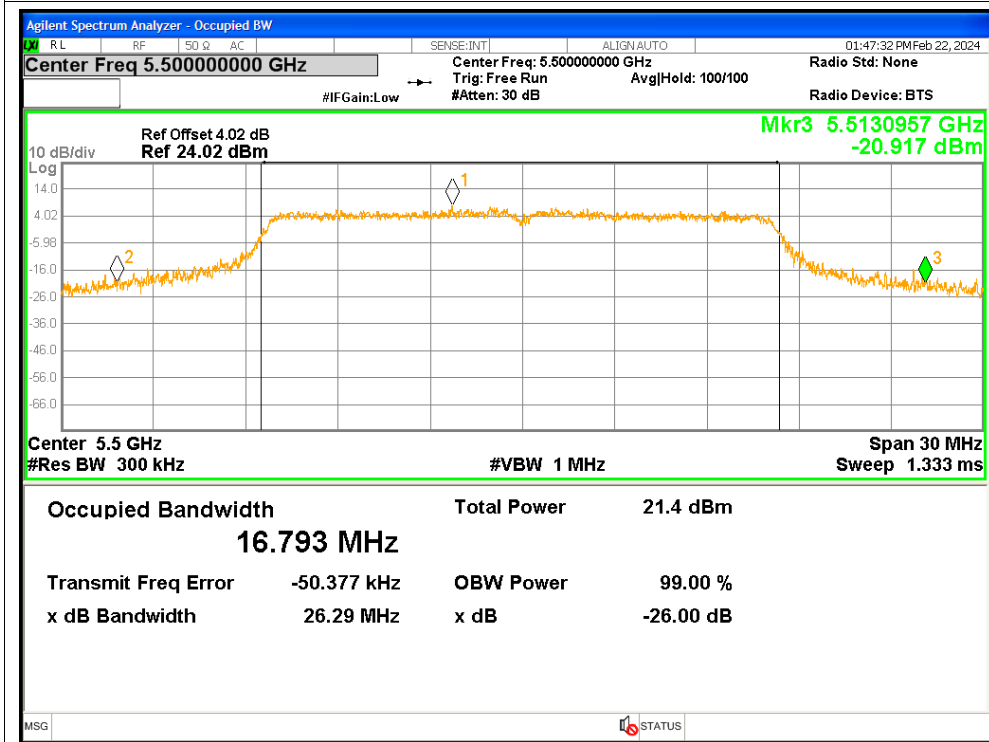


-26dB Bandwidth NVNT a 5580MHz Ant2

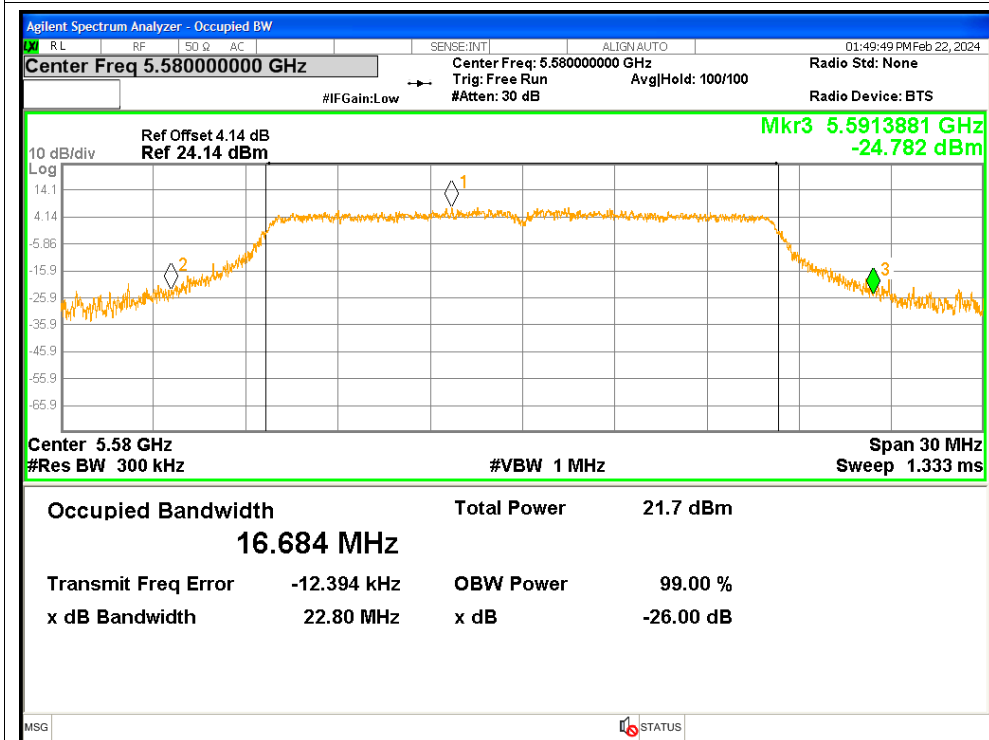


-26dB Bandwidth NVNT a 5700MHz Ant2

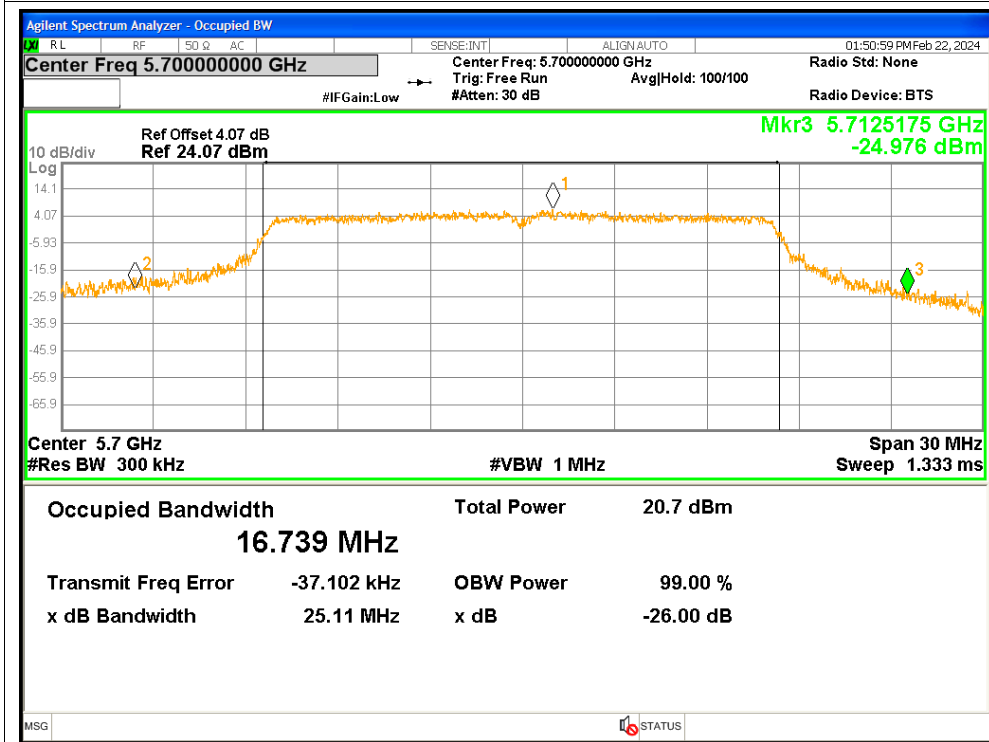


-26dB Bandwidth NVNT a 5500MHz Ant3

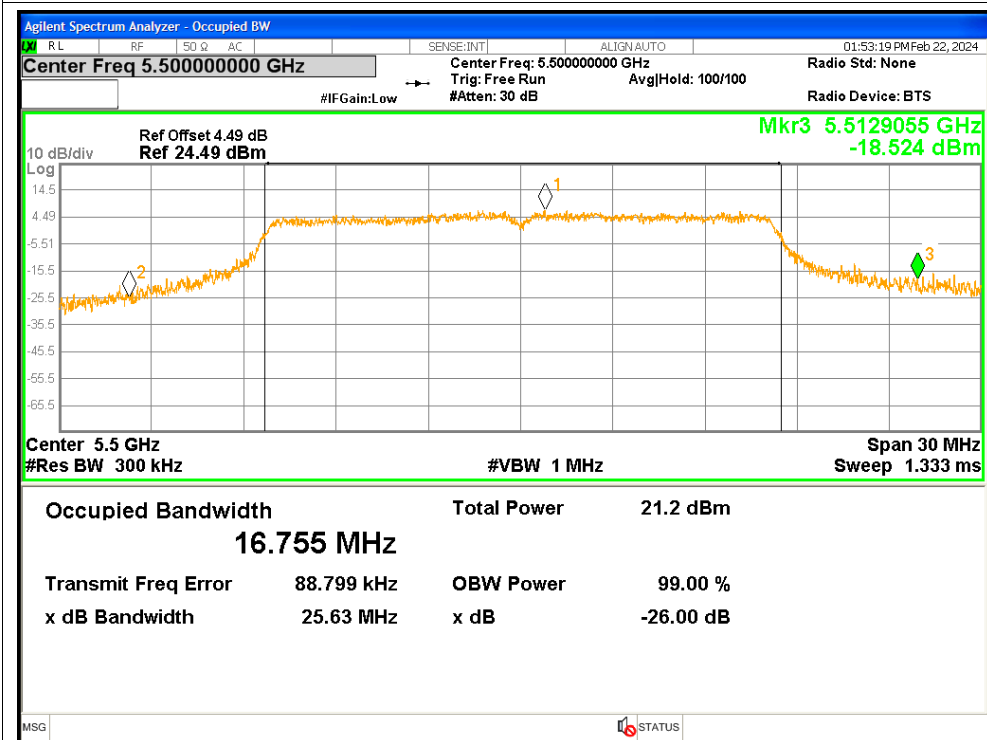


-26dB Bandwidth NVNT a 5580MHz Ant3

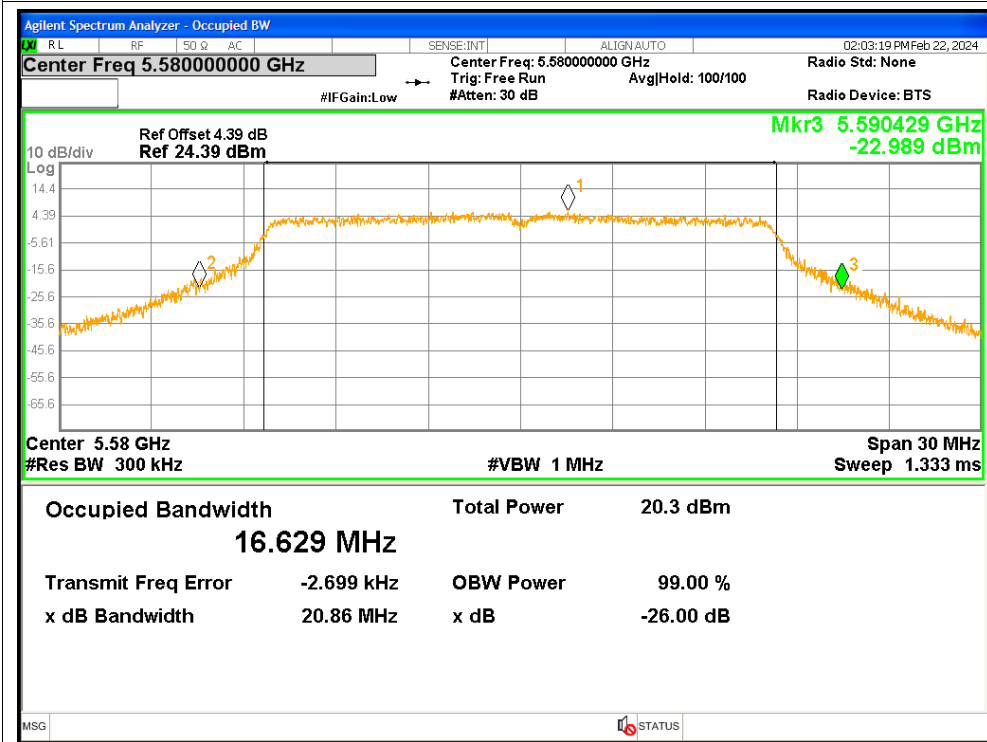


-26dB Bandwidth NVNT a 5700MHz Ant3

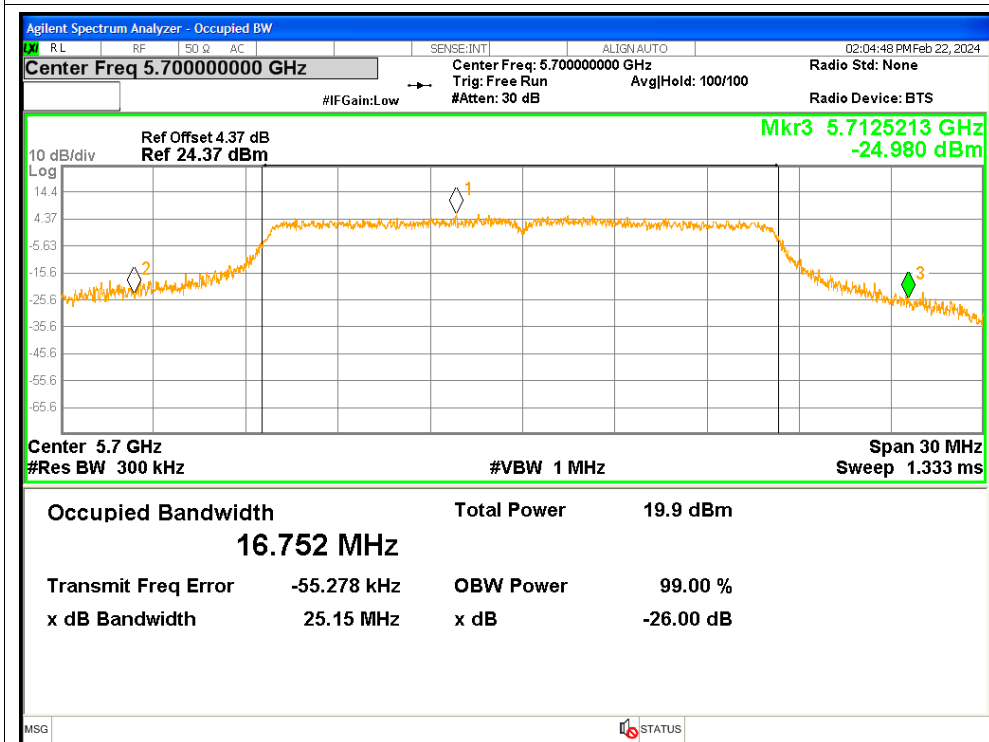


-26dB Bandwidth NVNT ac160 570MHz Ant1

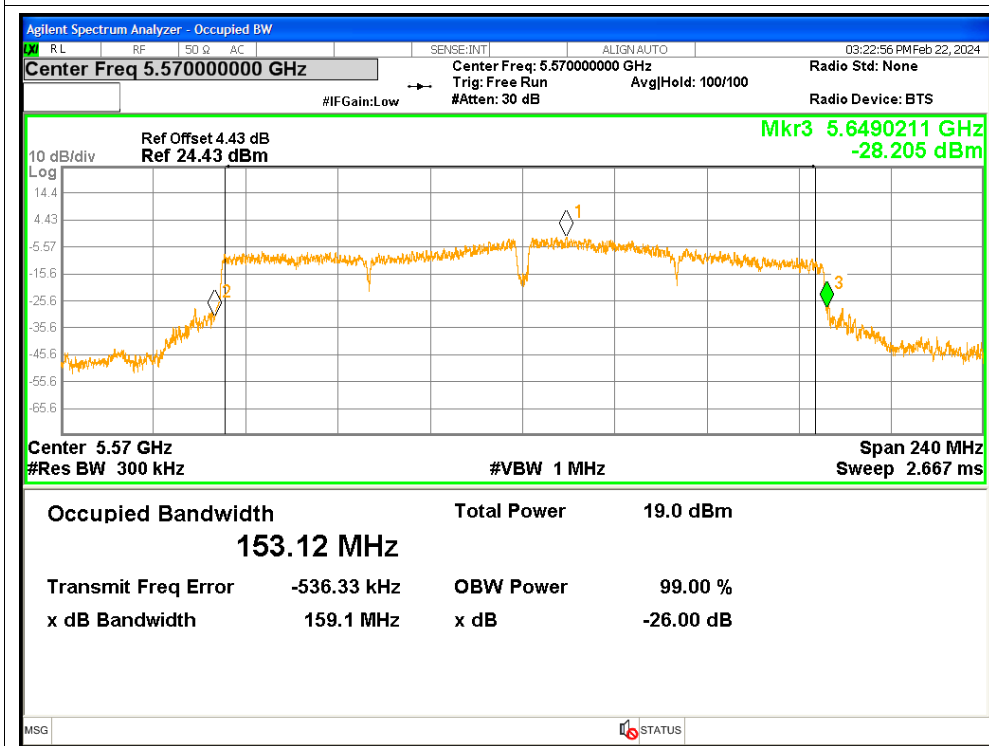


-26dB Bandwidth NVNT ac160 5570MHz Ant2

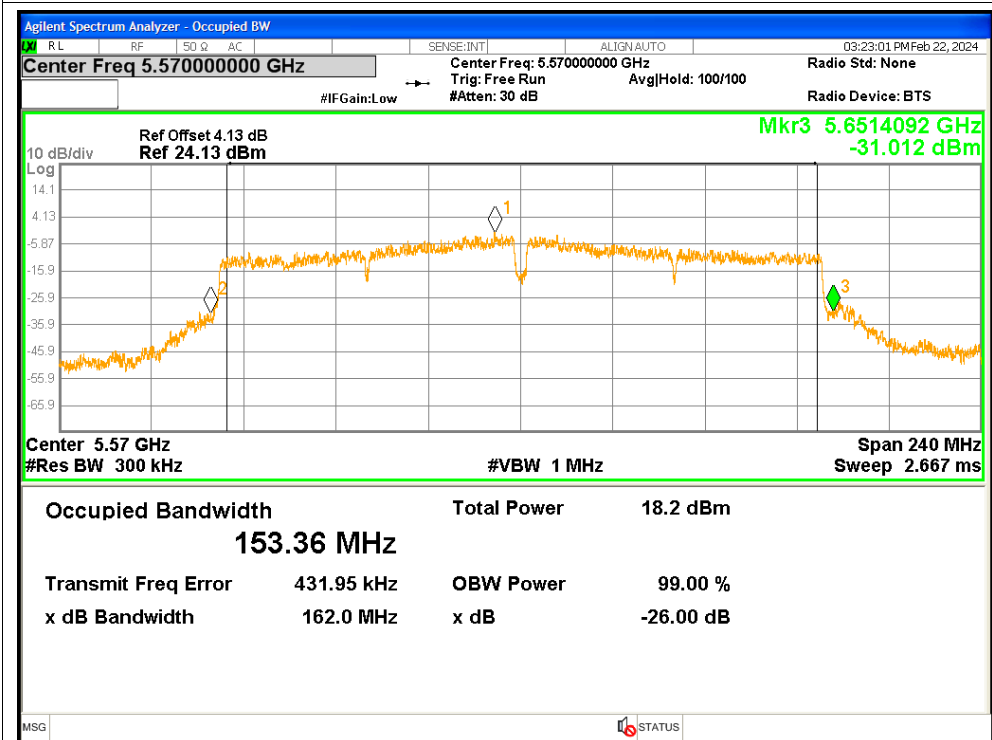


-26dB Bandwidth NVNT ac160 5570MHz Ant3

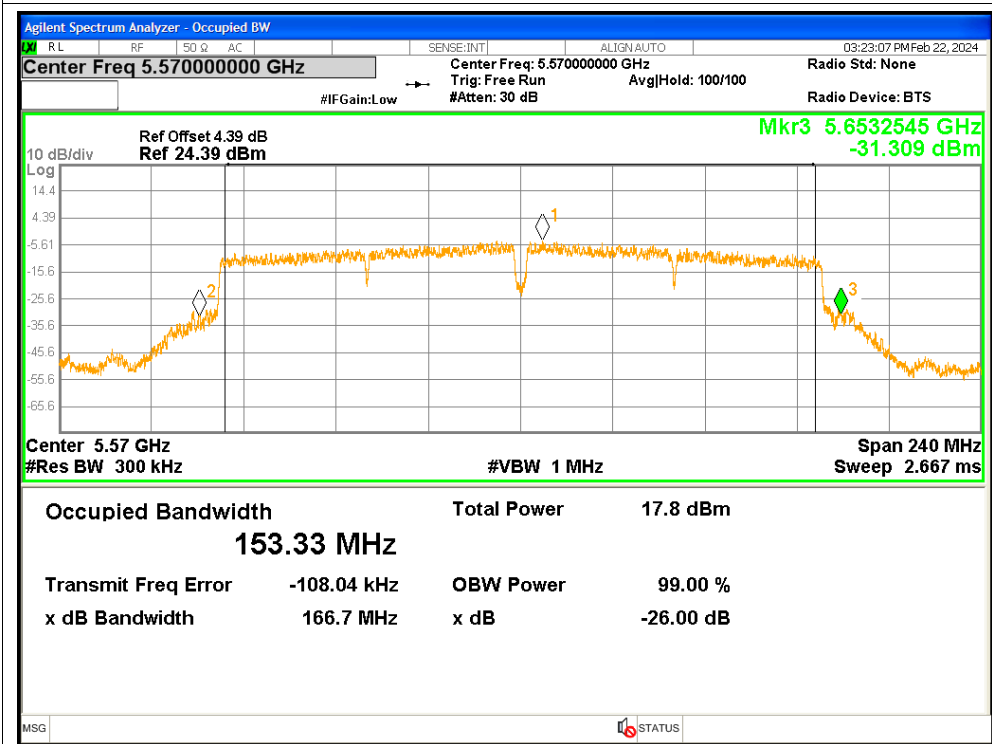


-26dB Bandwidth NVNT ac20 5500MHz Ant1

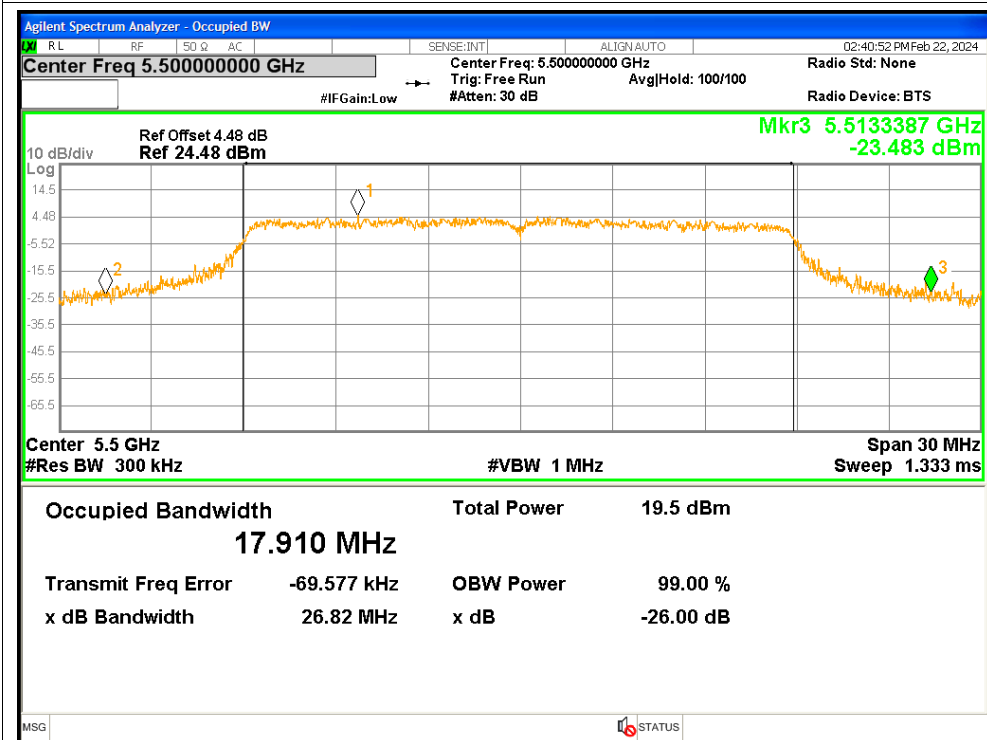


-26dB Bandwidth NVNT ac20 5500MHz Ant2

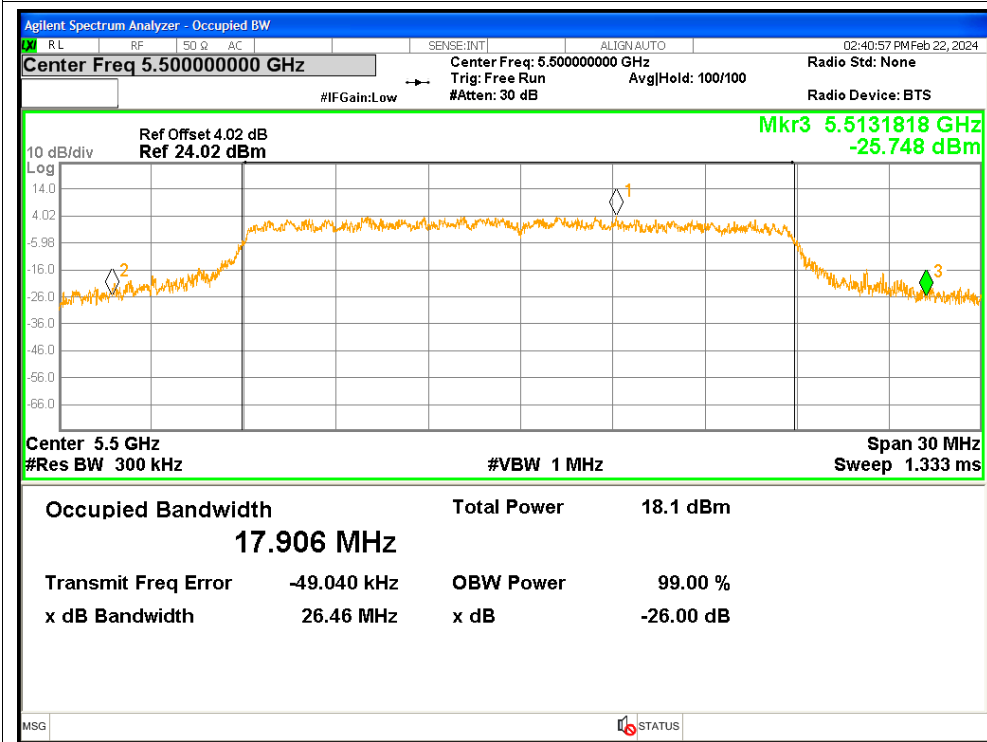

-26dB Bandwidth NVNT ac20 5500MHz Ant3

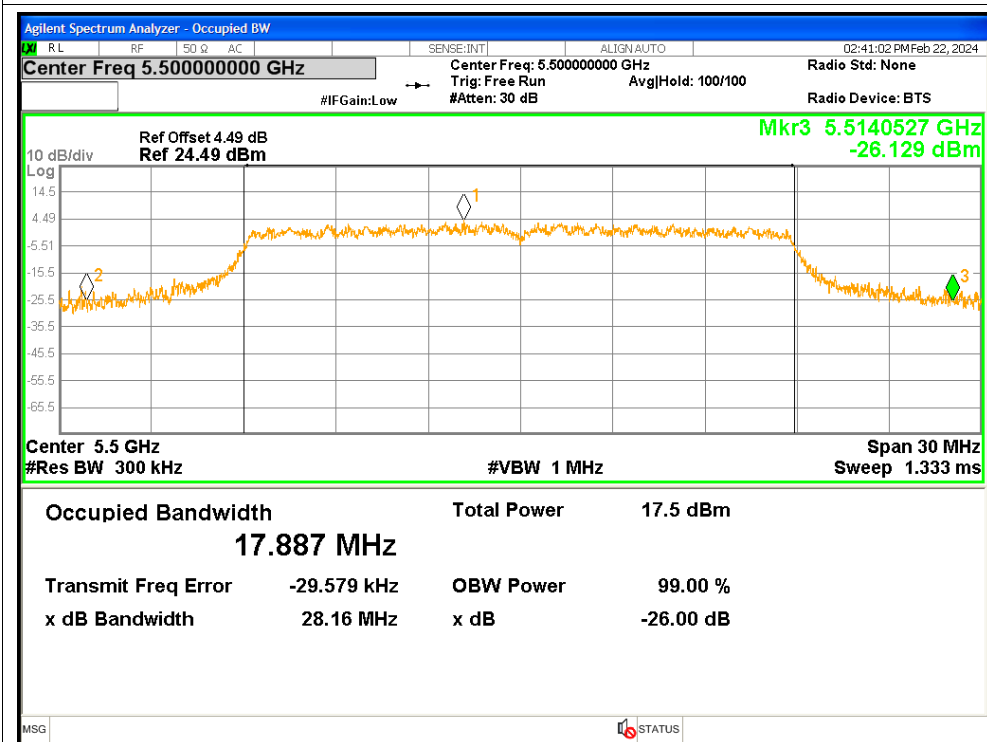


-26dB Bandwidth NVNT ac20 5580MHz Ant1

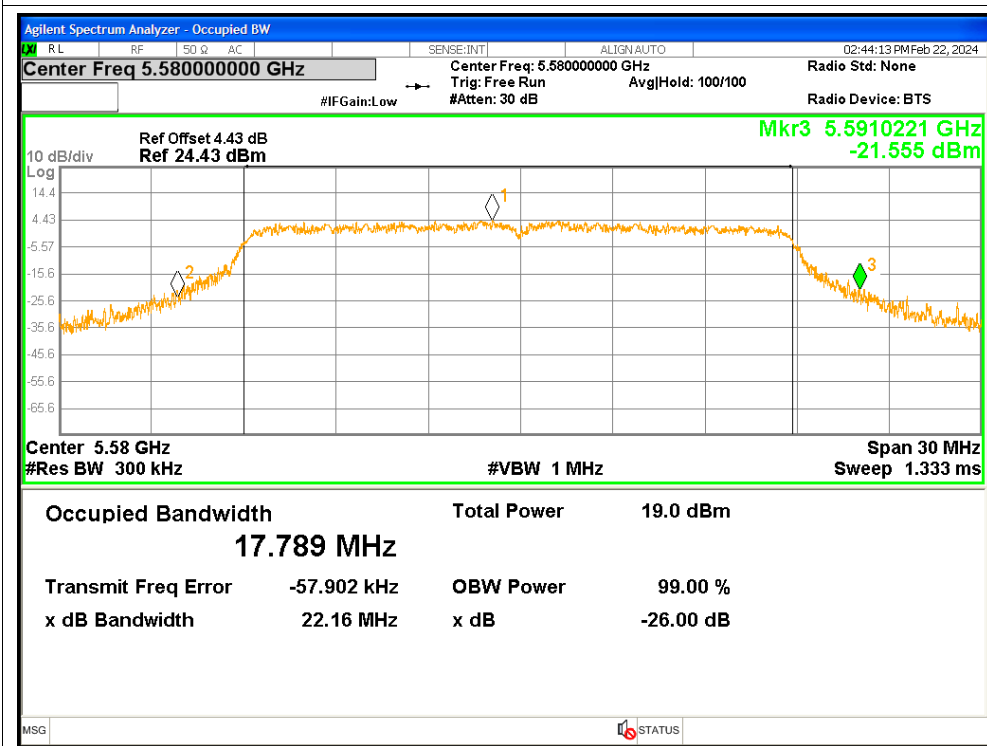





-26dB Bandwidth NVNT ac20 5580MHz Ant2

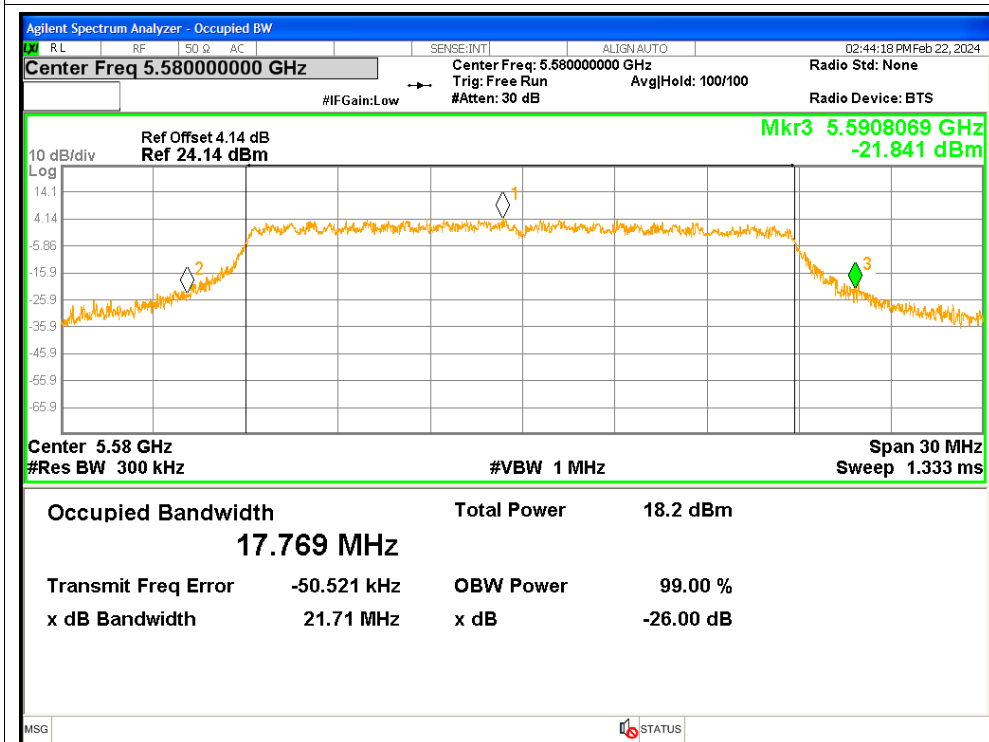


-26dB Bandwidth NVNT ac20 5580MHz Ant3

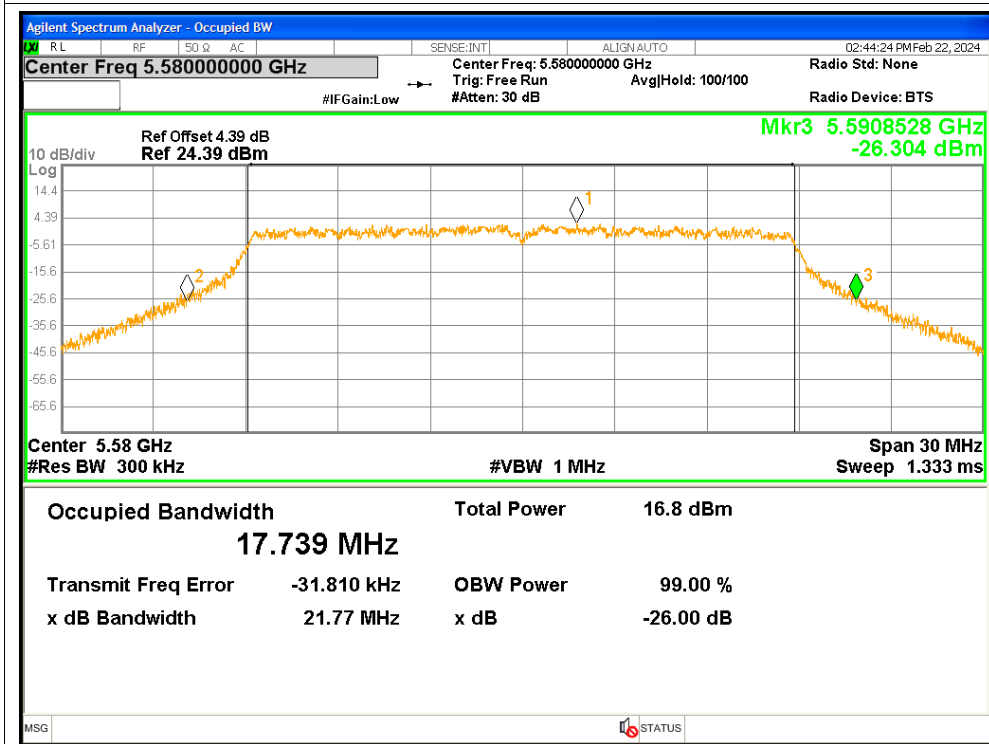


-26dB Bandwidth NVNT ac20 5700MHz Ant1

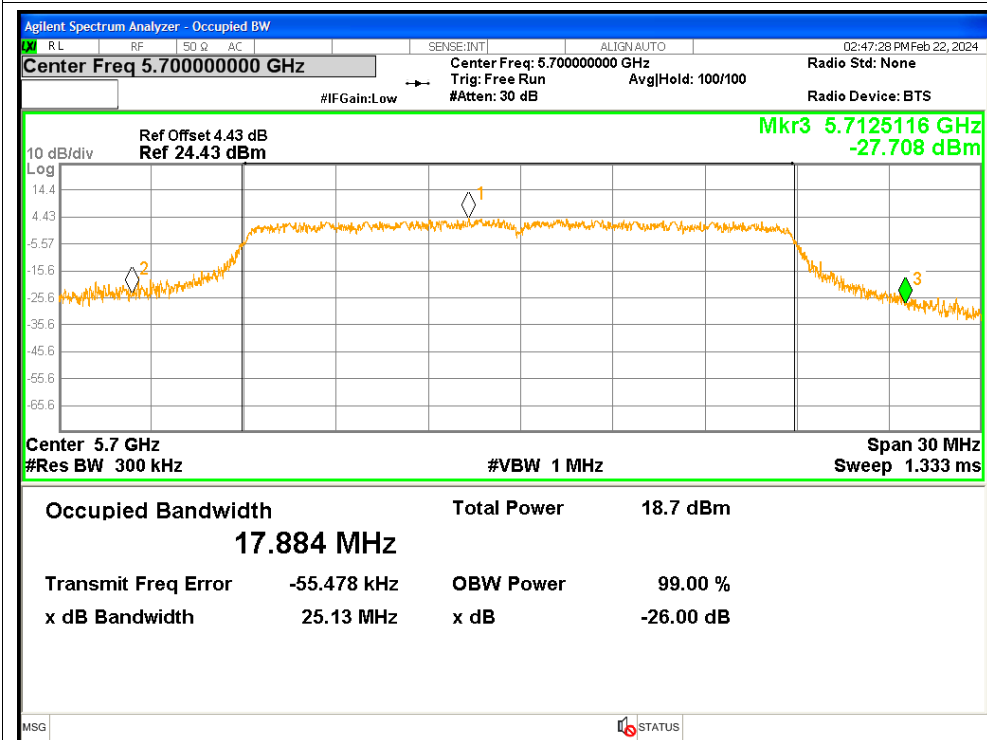


-26dB Bandwidth NVNT ac20 5700MHz Ant2

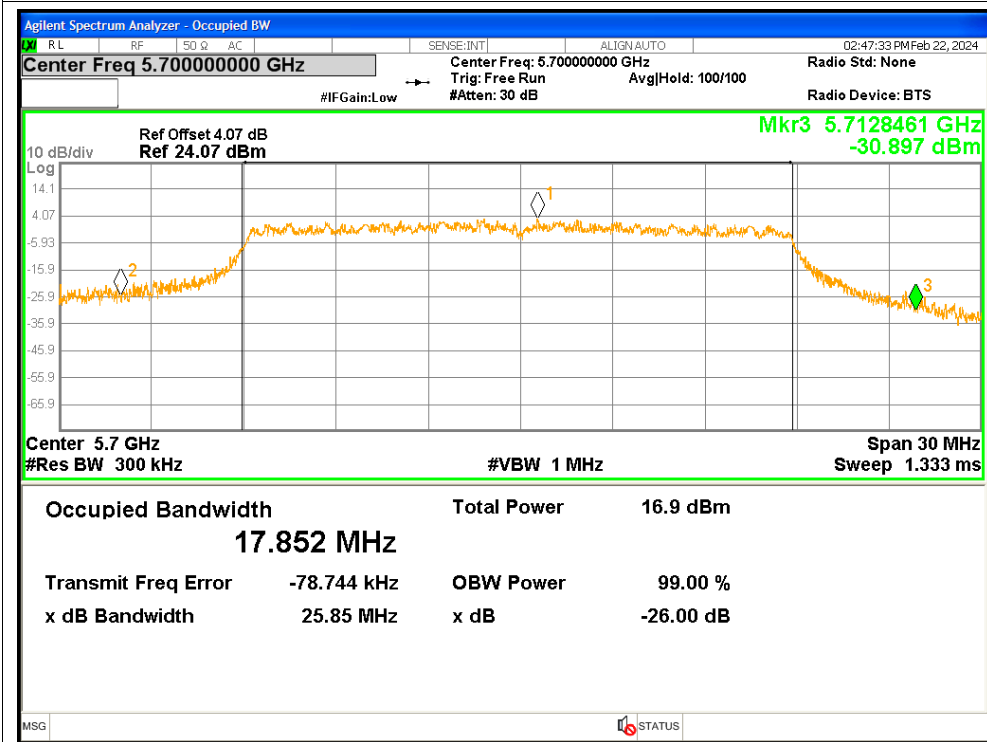


-26dB Bandwidth NVNT ac20 5700MHz Ant3

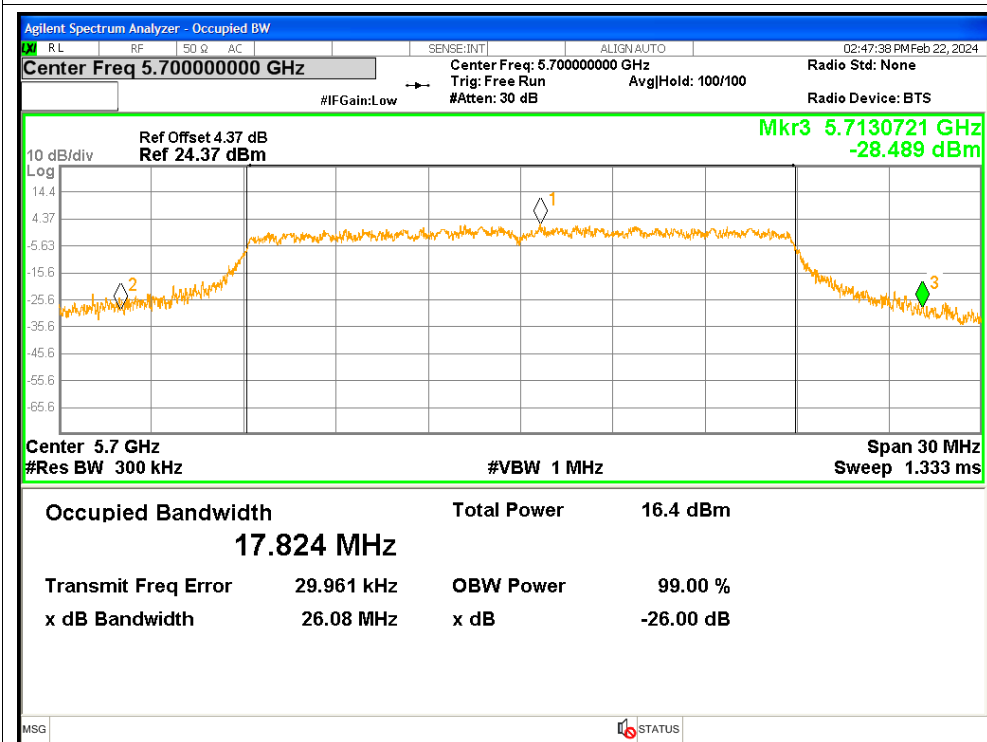


-26dB Bandwidth NVNT ac40 5510MHz Ant1

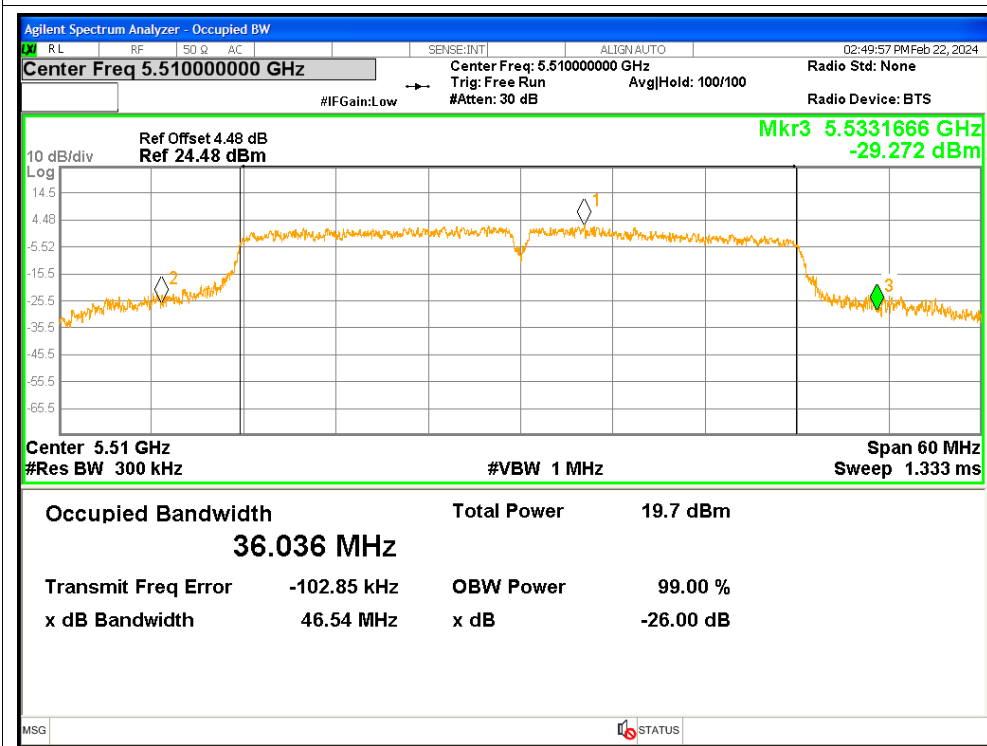


-26dB Bandwidth NVNT ac40 5510MHz Ant2

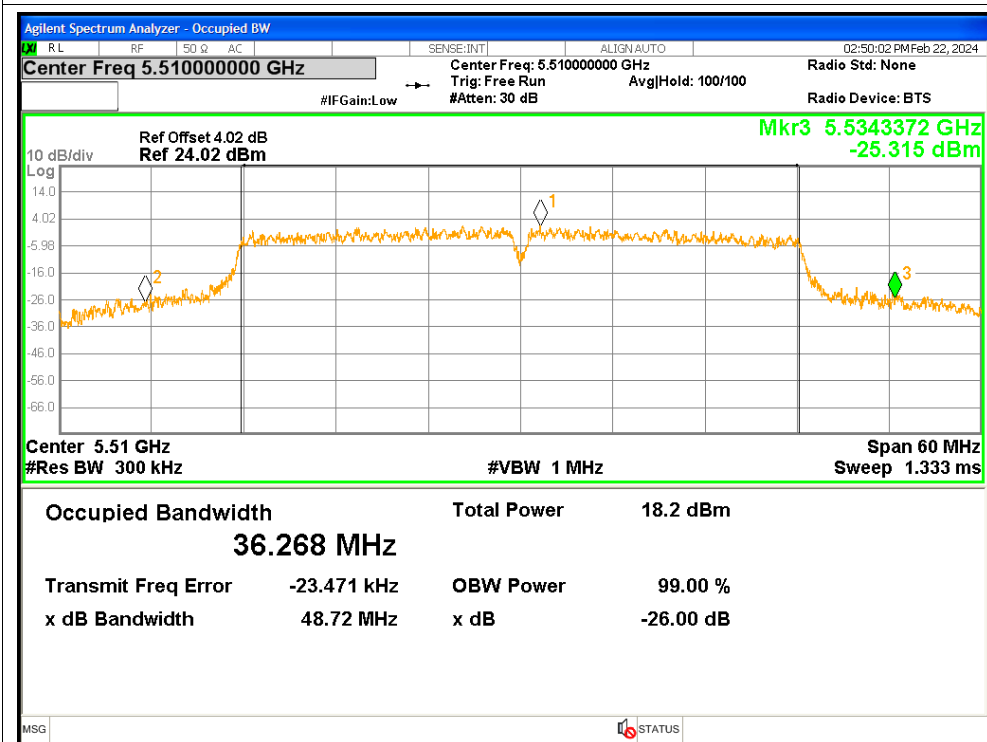


-26dB Bandwidth NVNT ac40 5510MHz Ant3

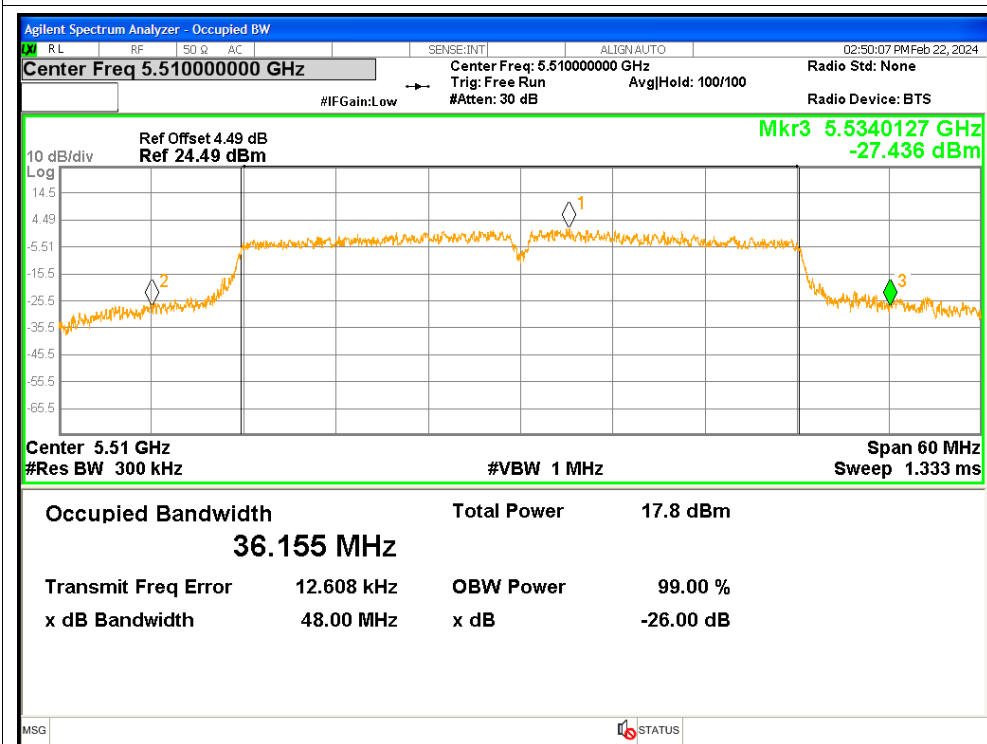


-26dB Bandwidth NVNT ac40 5550MHz Ant1

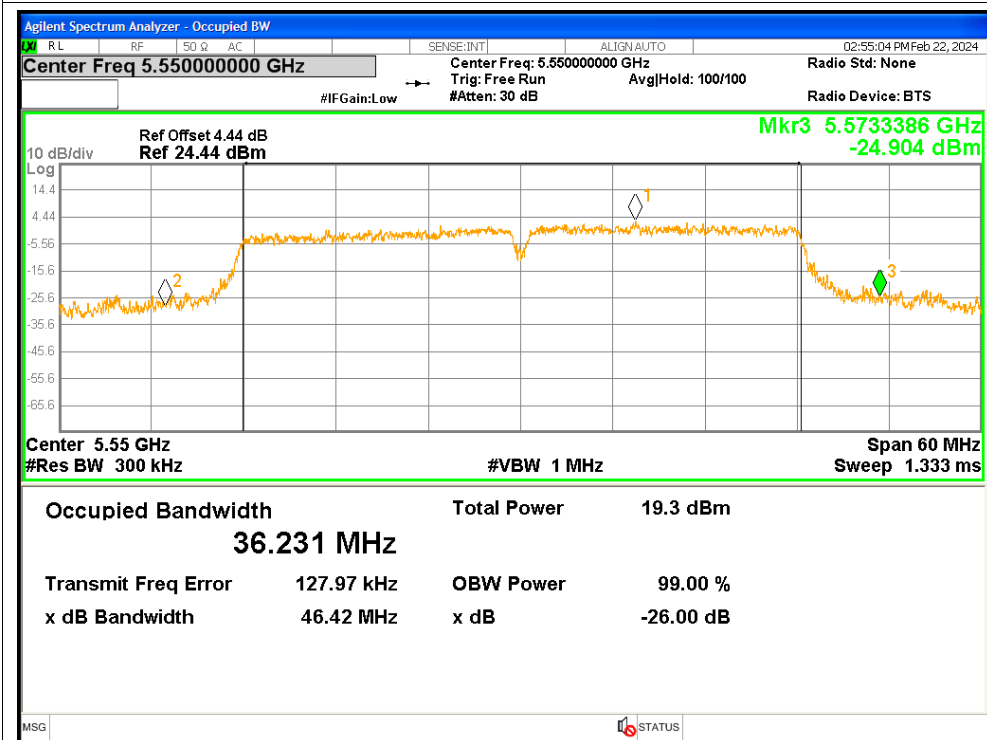


-26dB Bandwidth NVNT ac40 5550MHz Ant2

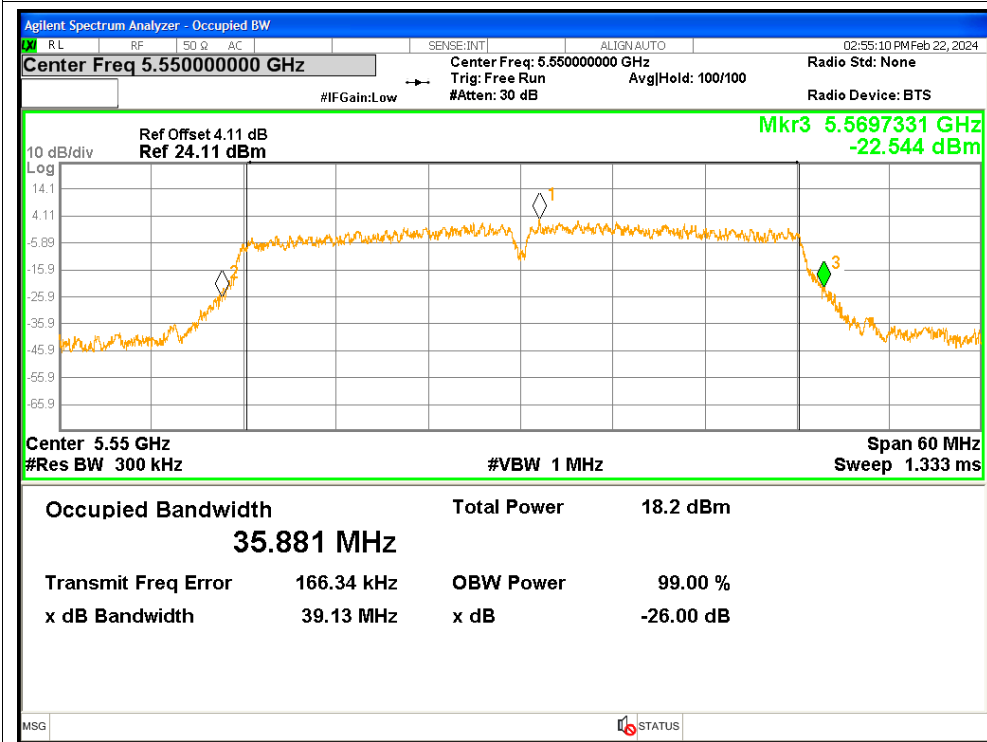


-26dB Bandwidth NVNT ac40 5550MHz Ant3

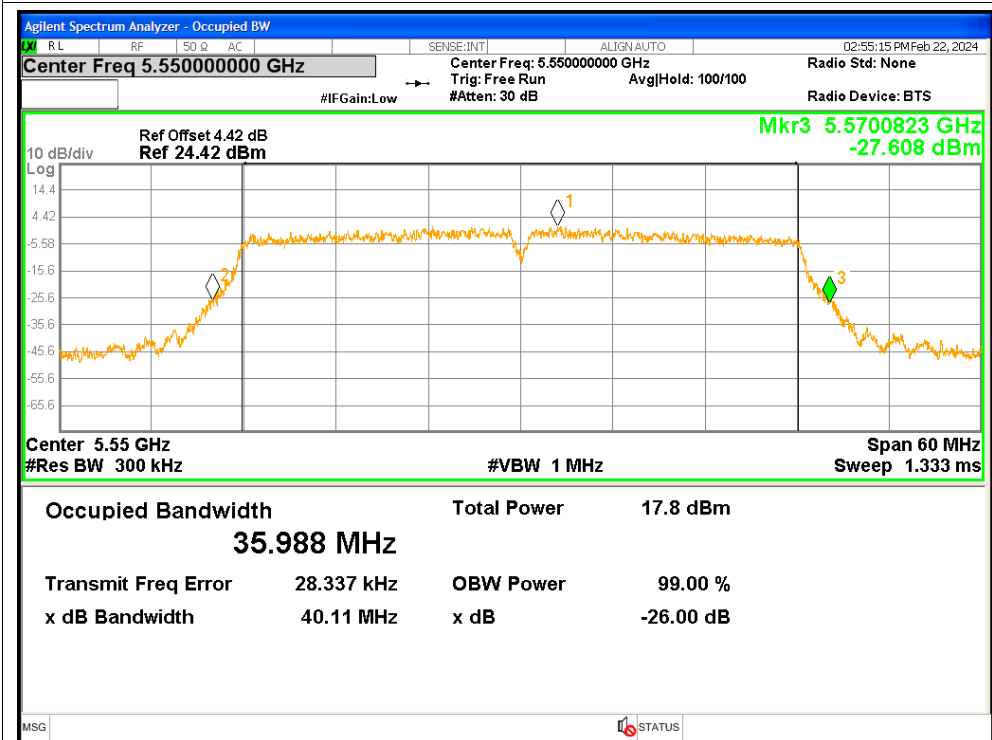


-26dB Bandwidth NVNT ac40 5670MHz Ant1

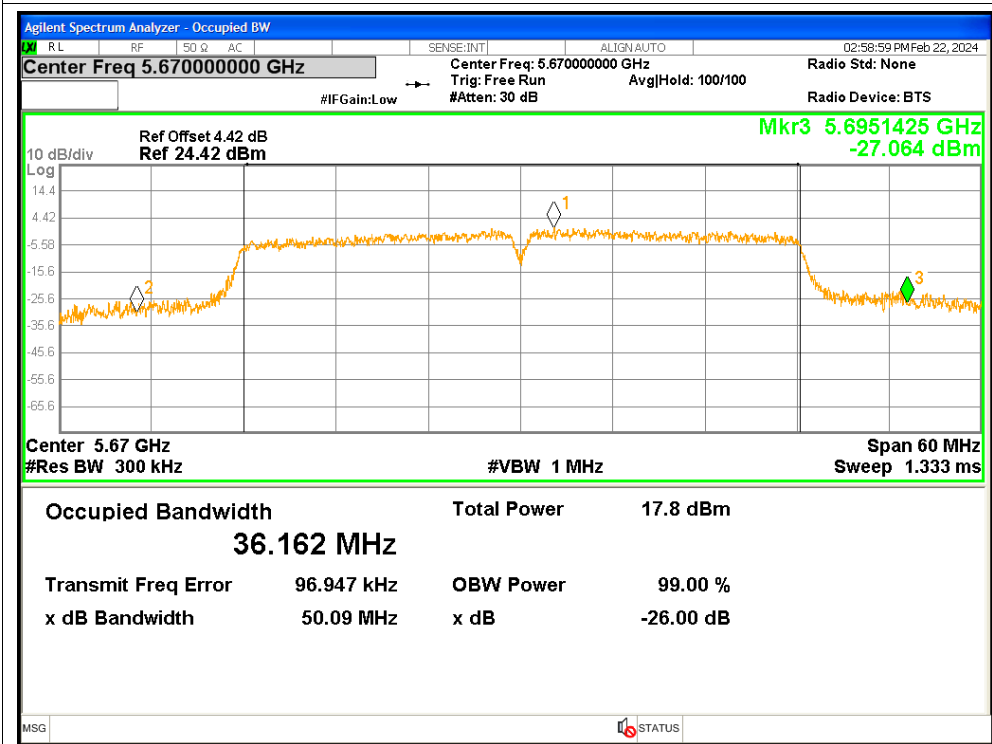


-26dB Bandwidth NVNT ac40 5670MHz Ant2

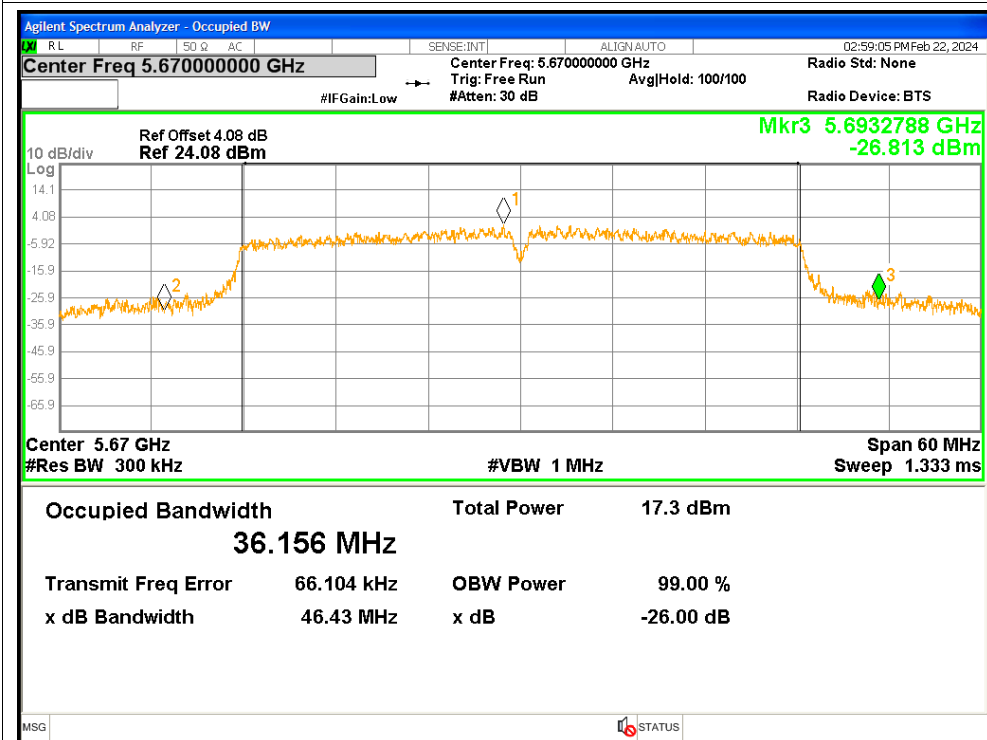


-26dB Bandwidth NVNT ac40 5670MHz Ant3

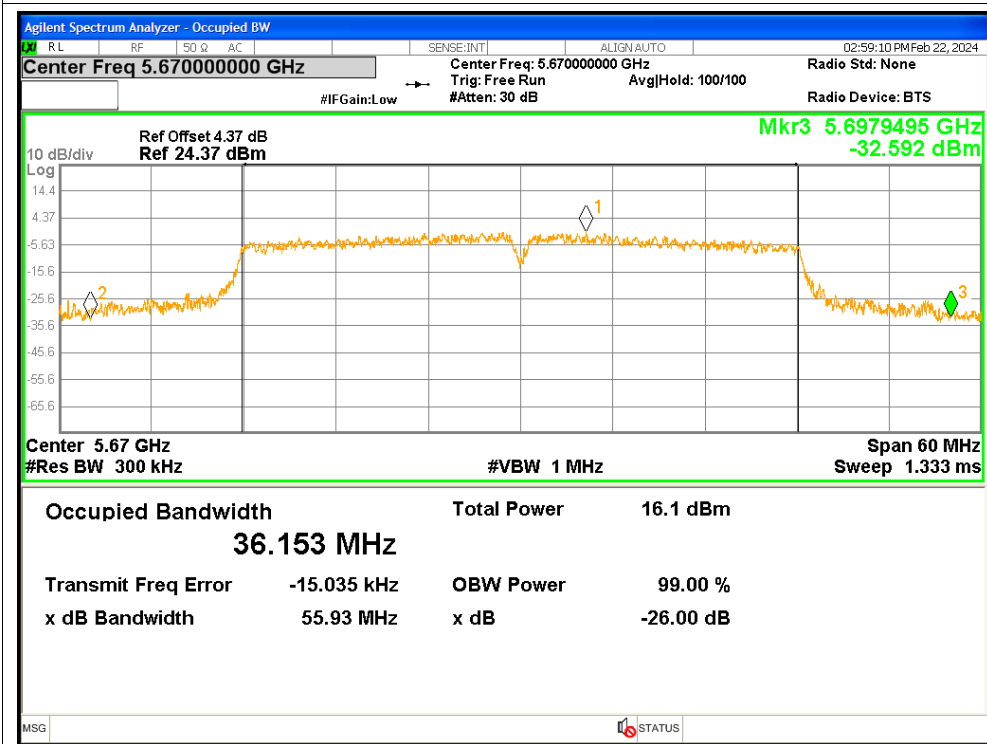

-26dB Bandwidth NVNT ac80 5530MHz Ant1

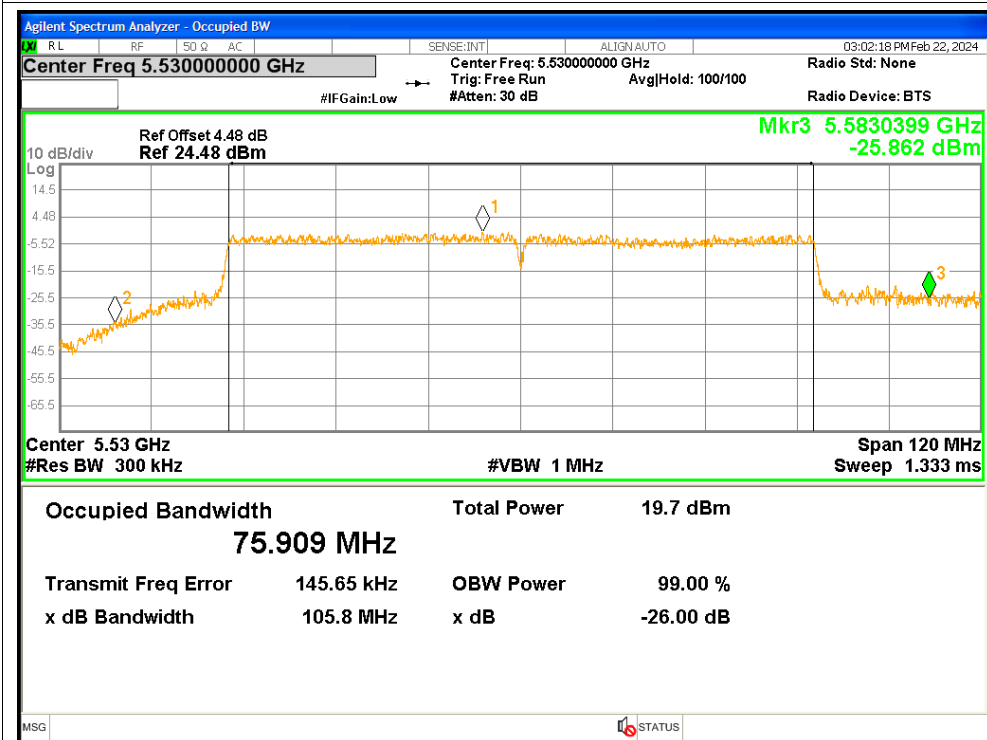


-26dB Bandwidth NVNT ac80 5530MHz Ant2

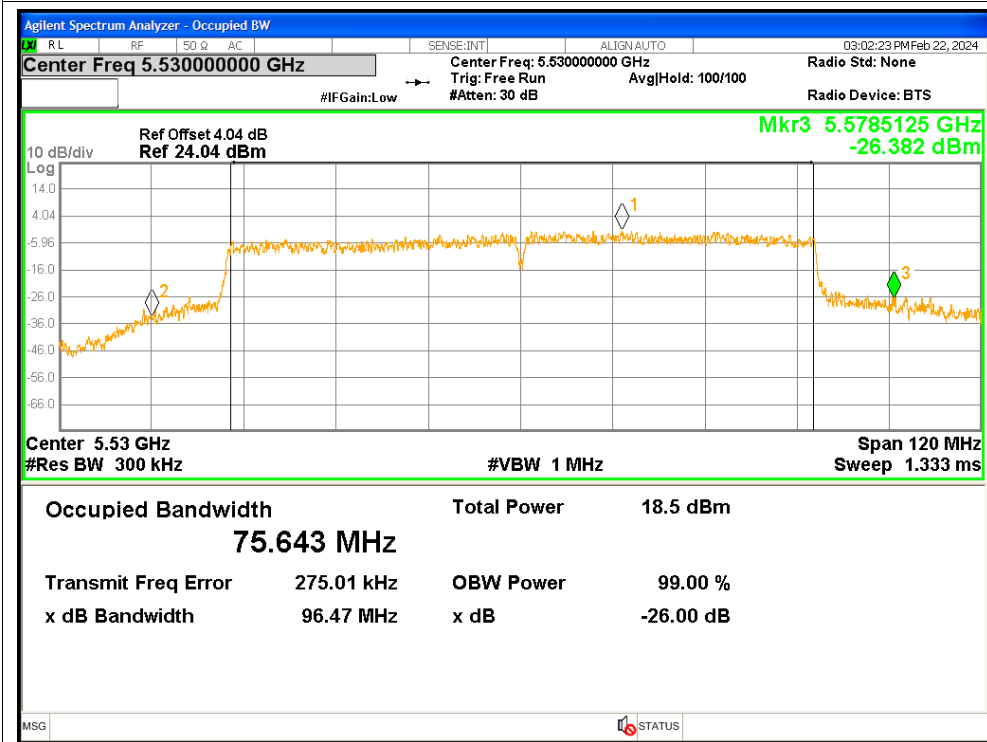





-26dB Bandwidth NVNT ac80 5530MHz Ant3

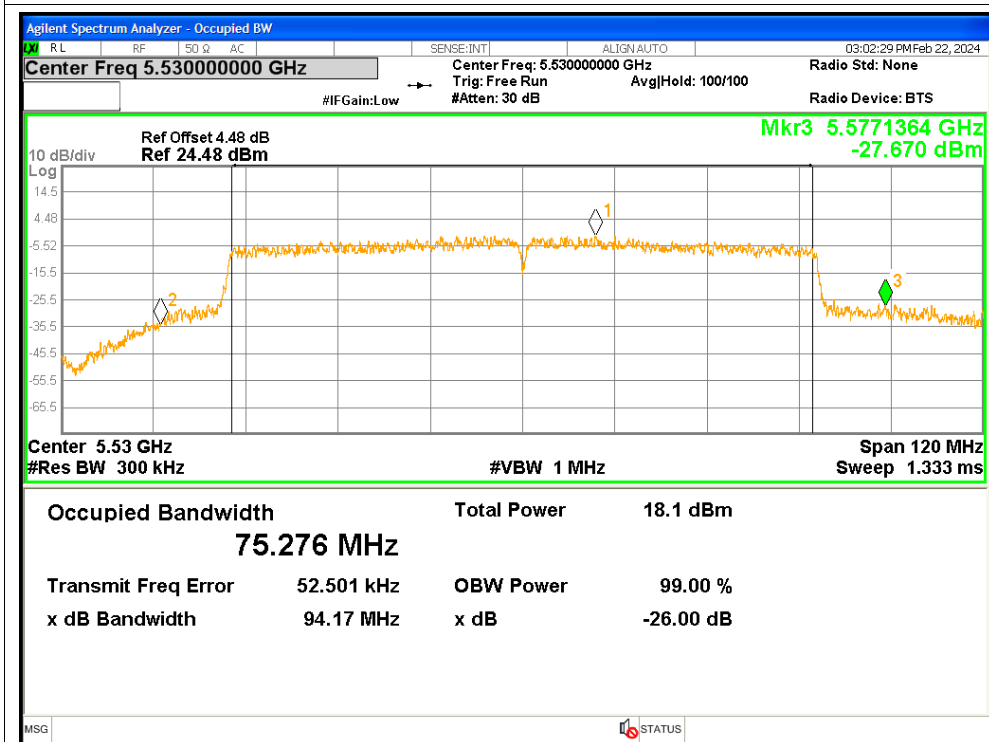


-26dB Bandwidth NVNT ac80 5610MHz Ant1

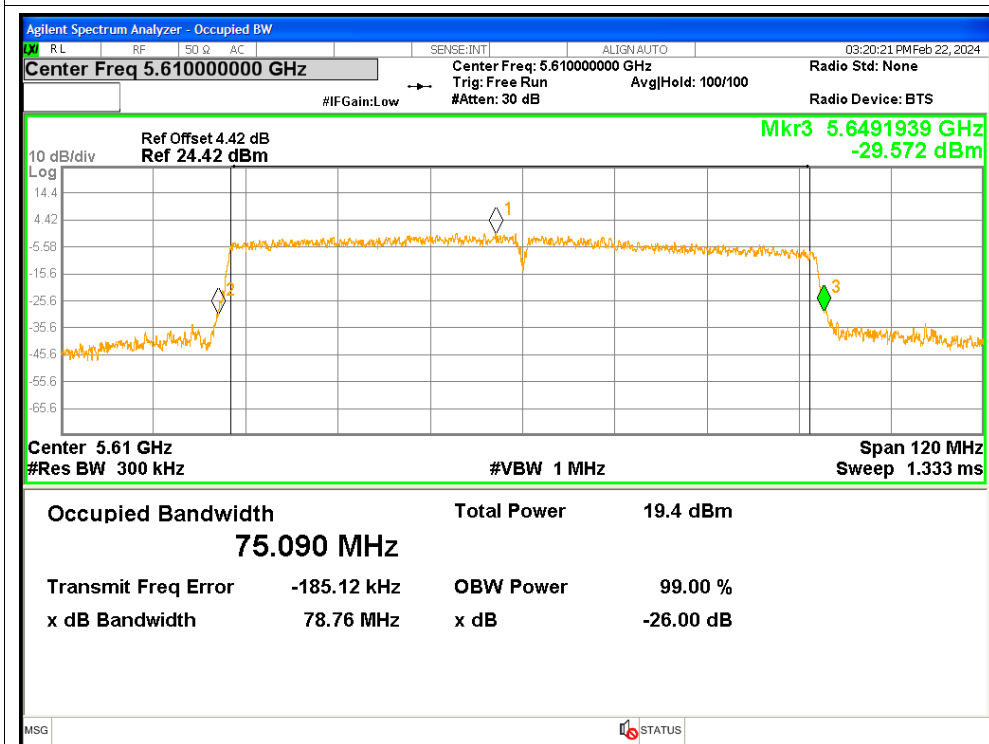


-26dB Bandwidth NVNT ac80 5610MHz Ant2

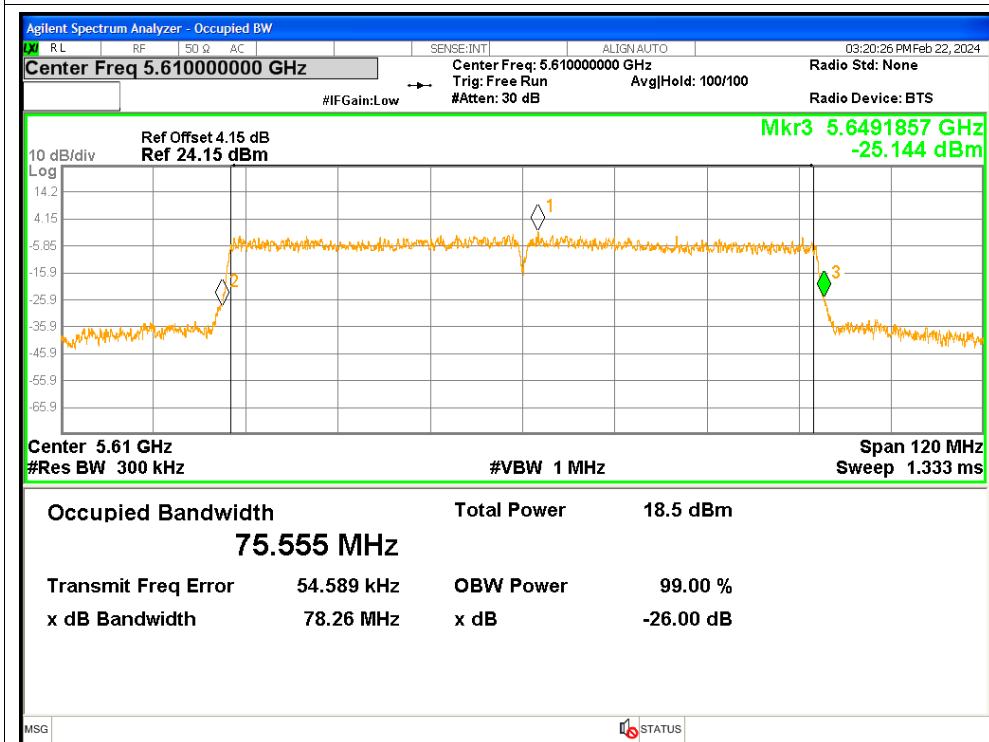


-26dB Bandwidth NVNT ac80 5610MHz Ant3

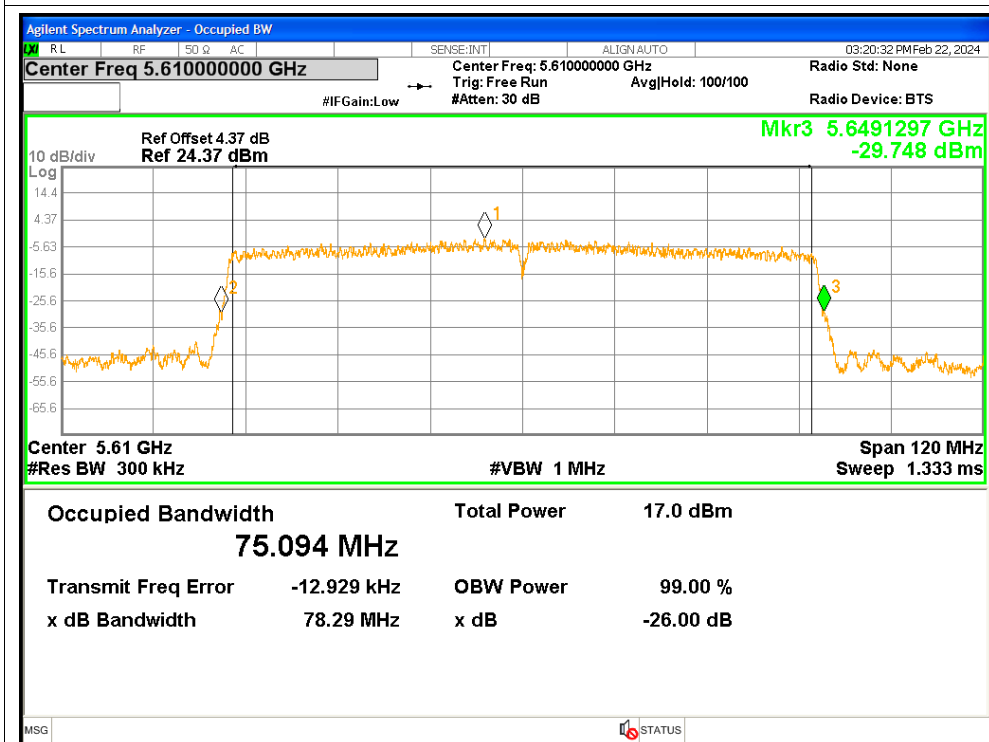


-26dB Bandwidth NVNT ax160 5570MHz Ant1

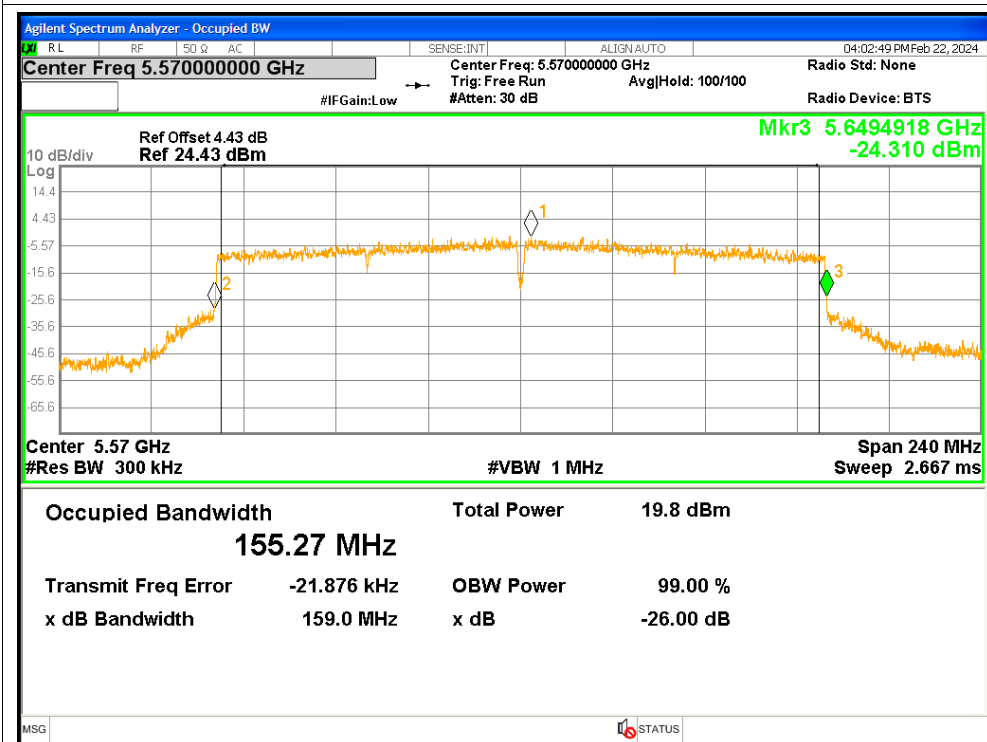


-26dB Bandwidth NVNT ax160 5570MHz Ant2

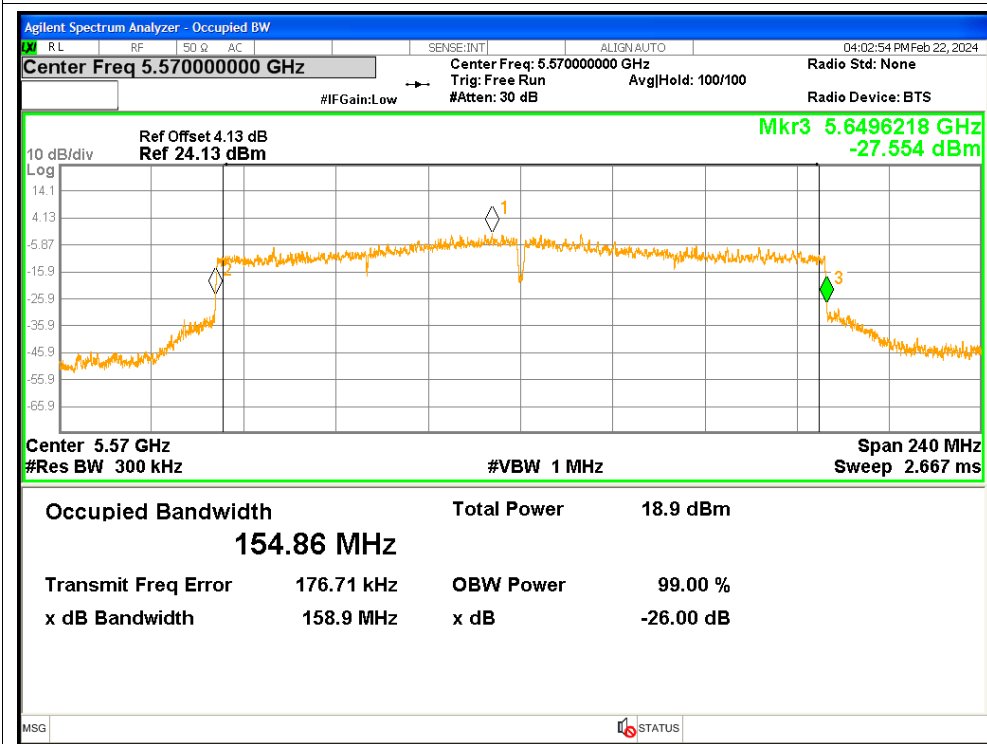


-26dB Bandwidth NVNT ax160 5570MHz Ant3

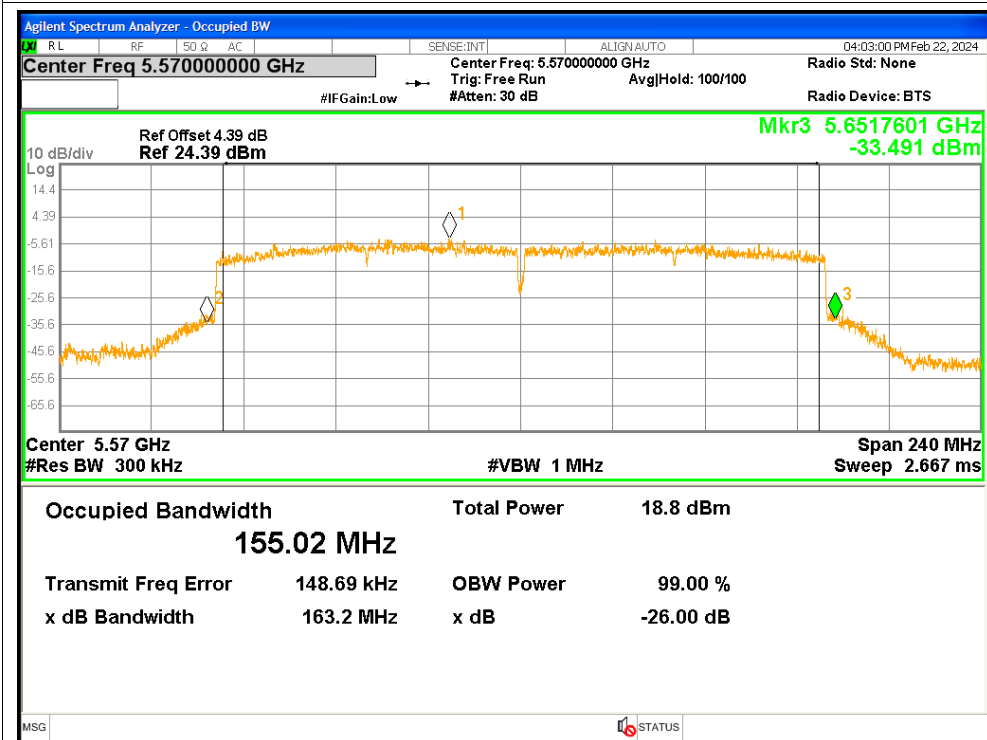


-26dB Bandwidth NVNT ax20 5500MHz Ant1

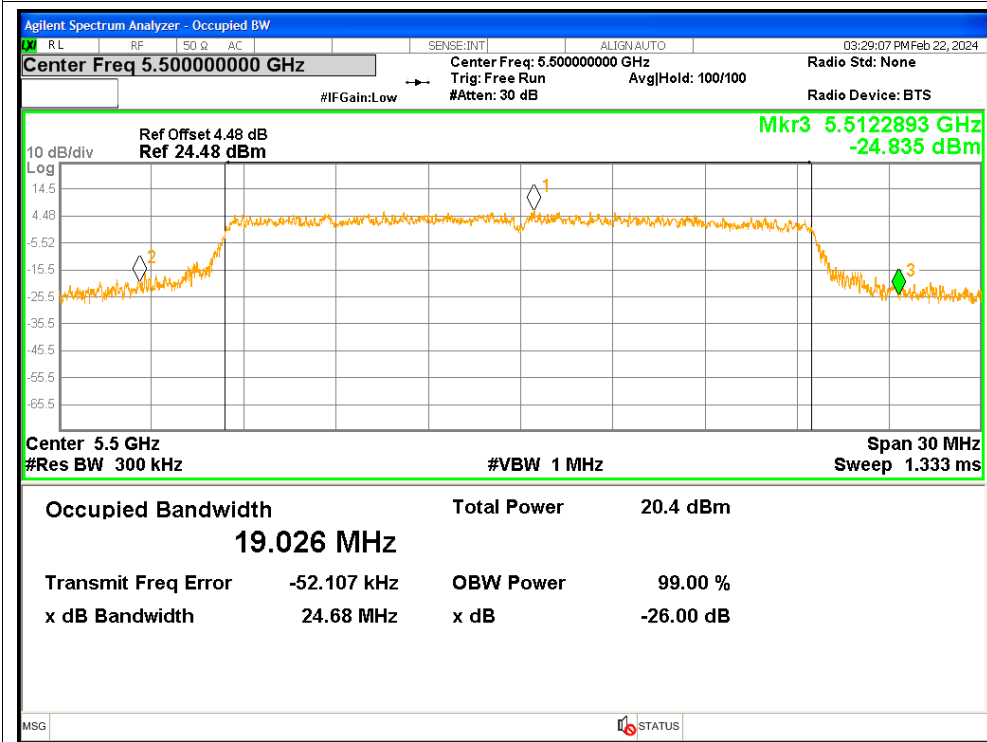


-26dB Bandwidth NVNT ax20 5500MHz Ant2

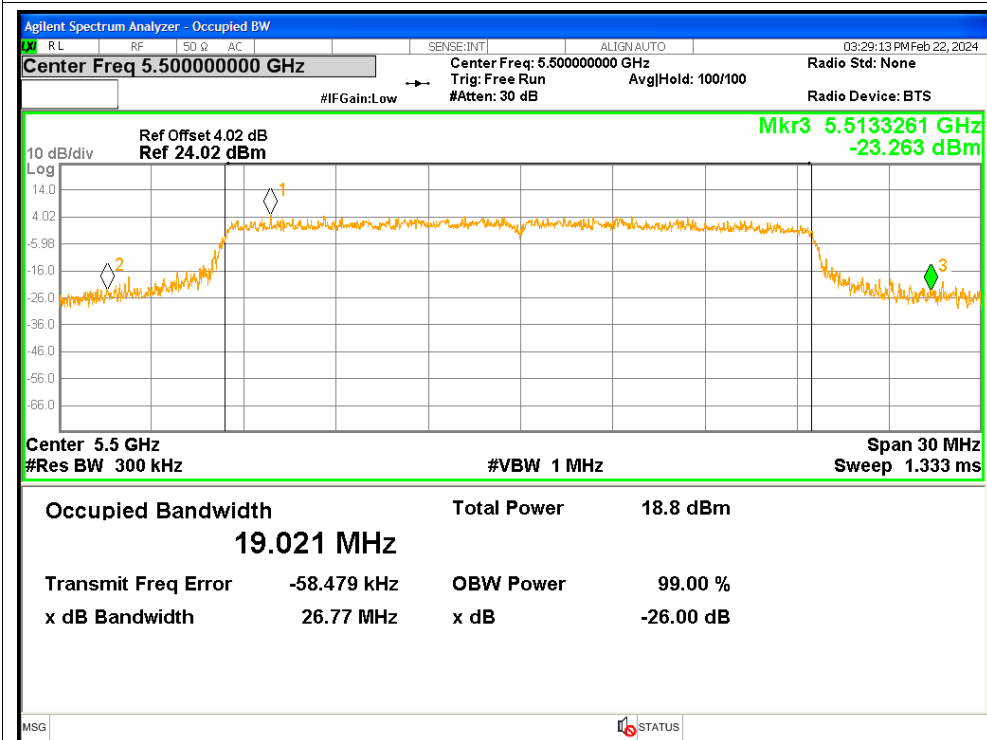


-26dB Bandwidth NVNT ax20 5500MHz Ant3

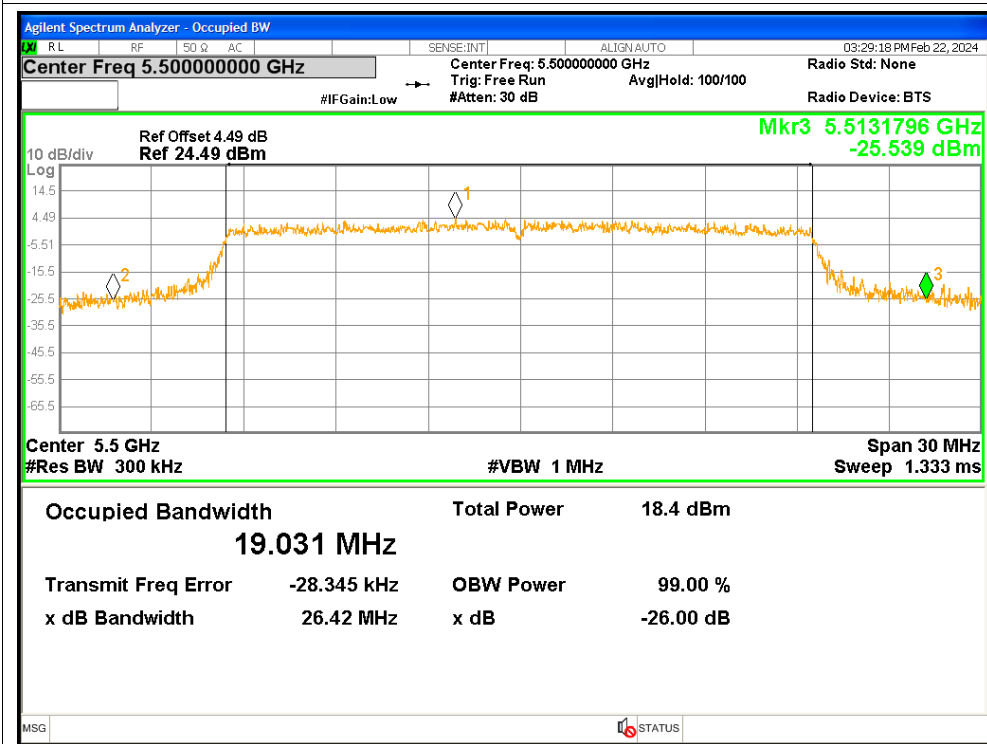


-26dB Bandwidth NVNT ax20 5580MHz Ant1

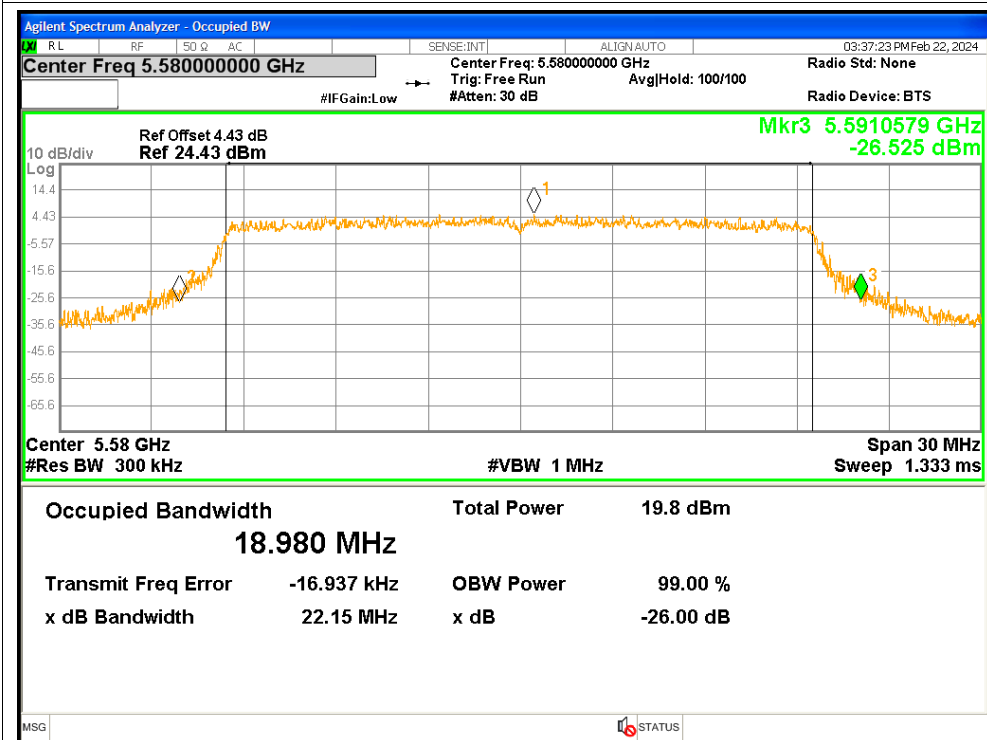


-26dB Bandwidth NVNT ax20 5580MHz Ant2

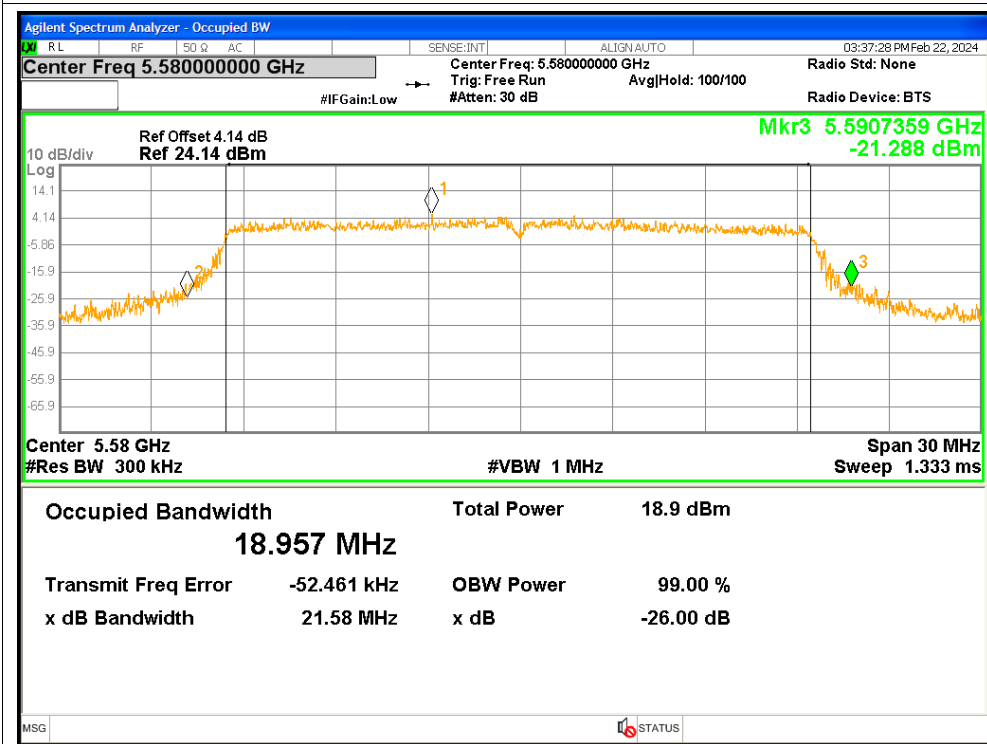


-26dB Bandwidth NVNT ax20 5580MHz Ant3

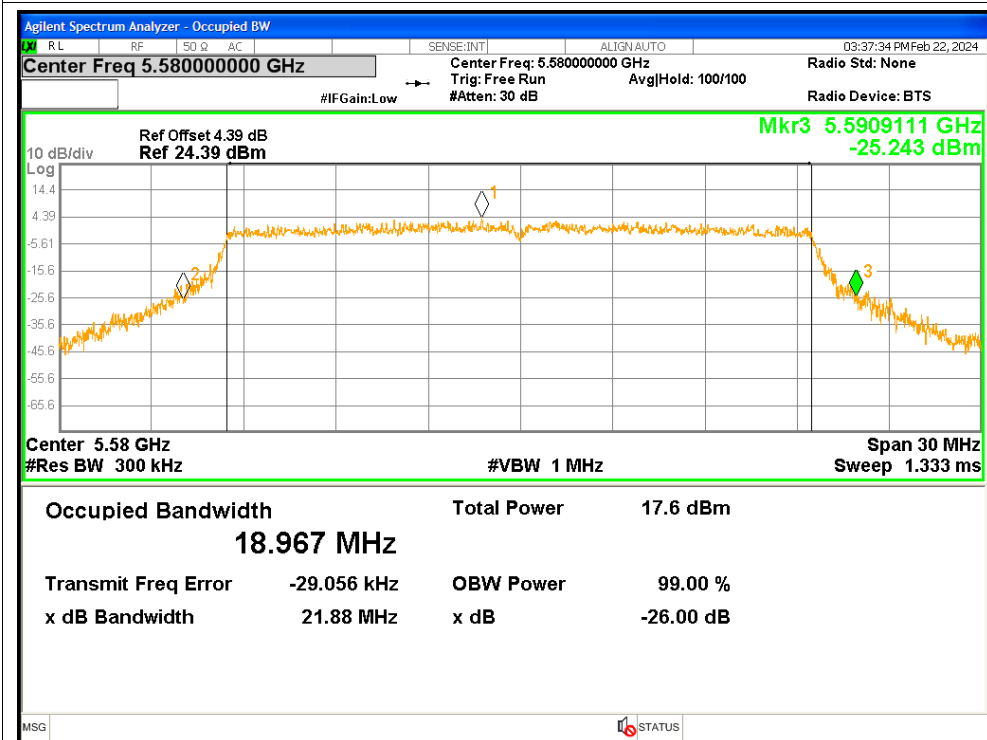


-26dB Bandwidth NVNT ax20 5700MHz Ant1

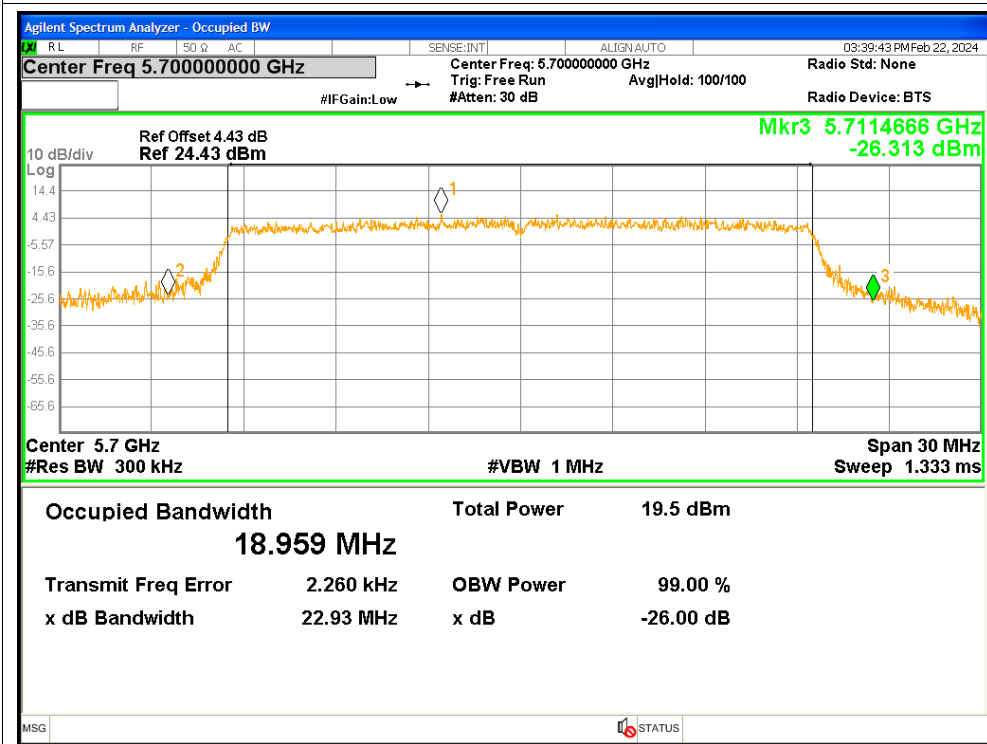

-26dB Bandwidth NVNT ax20 5700MHz Ant2

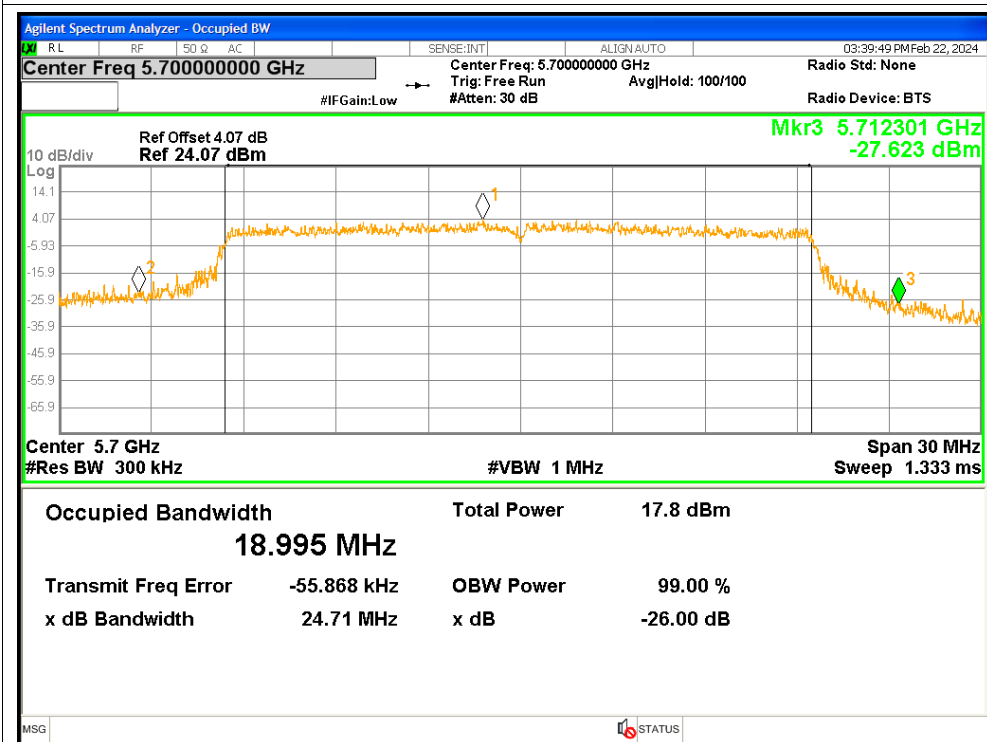


-26dB Bandwidth NVNT ax20 5700MHz Ant3

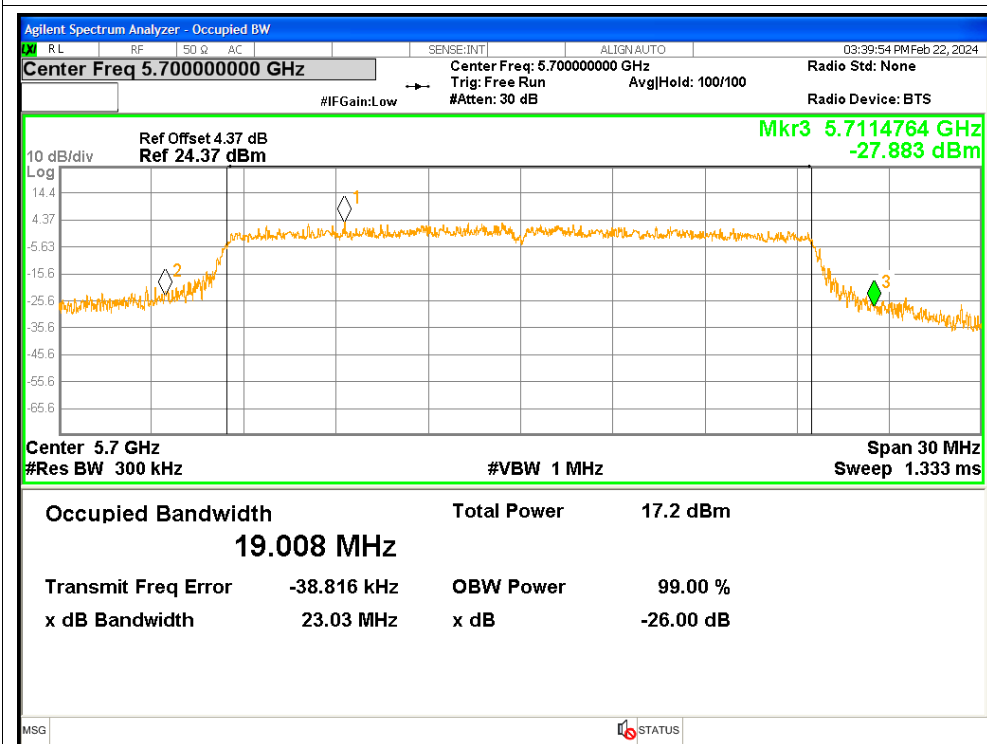





-26dB Bandwidth NVNT ax40 5510MHz Ant1

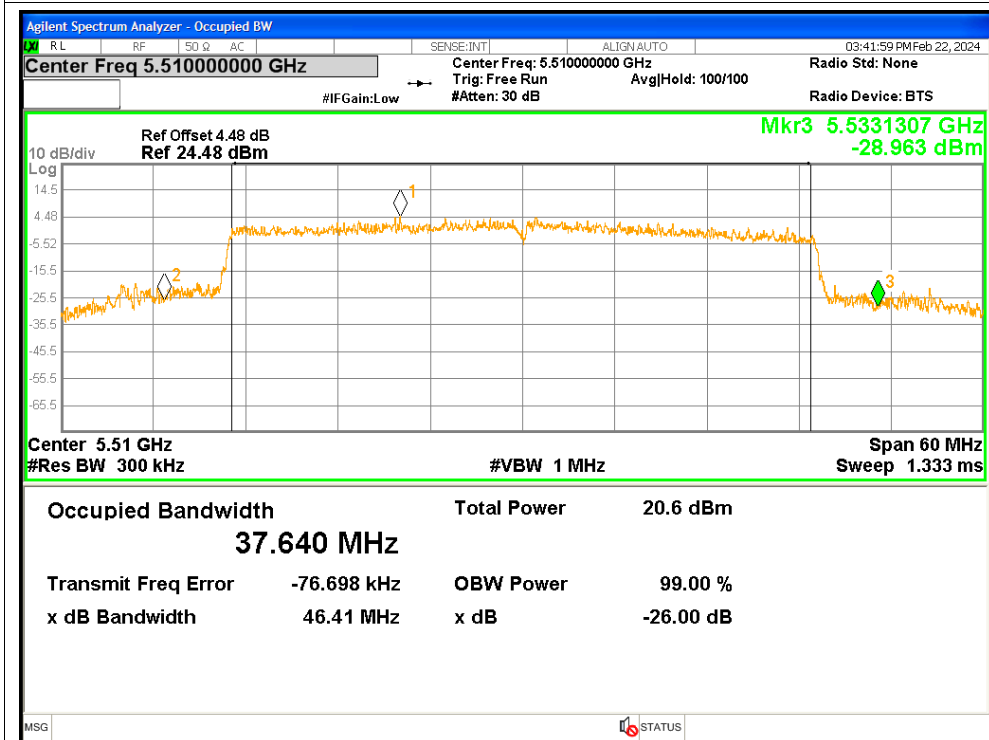

-26dB Bandwidth NVNT ax40 5510MHz Ant2

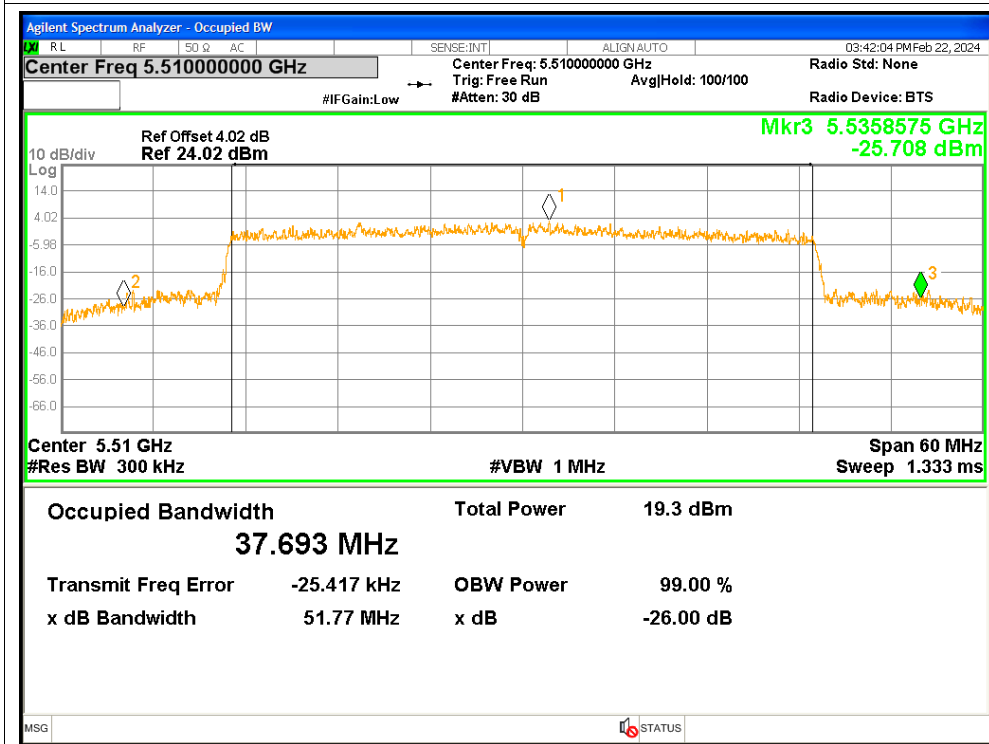

-26dB Bandwidth NVNT ax40 5510MHz Ant3

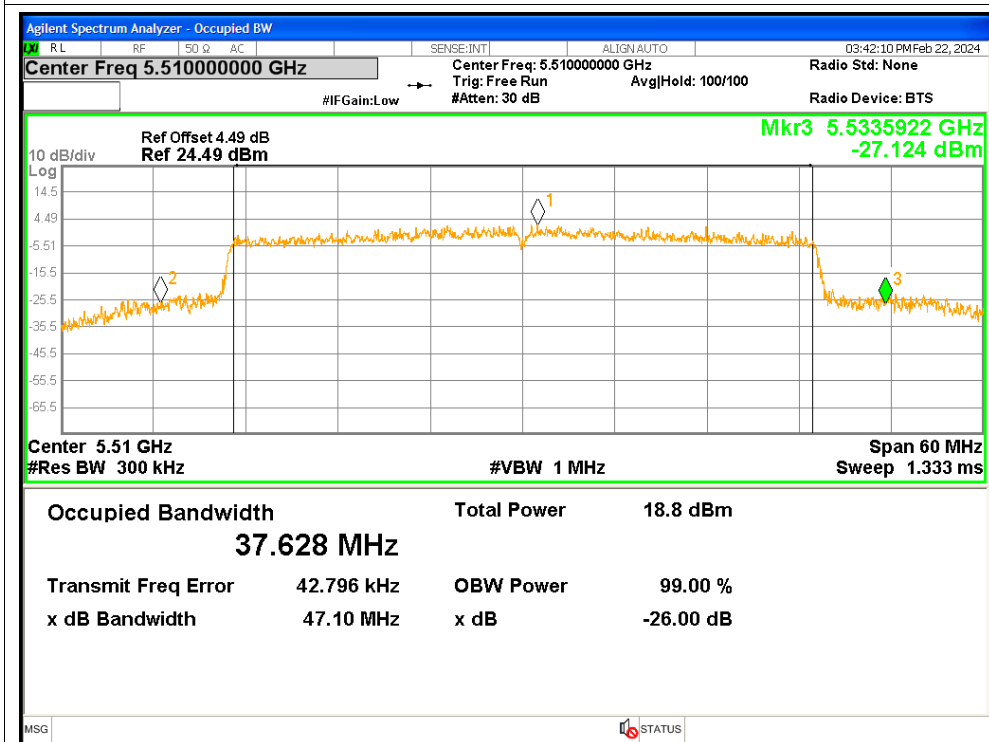

-26dB Bandwidth NVNT ax40 5550MHz Ant1

