




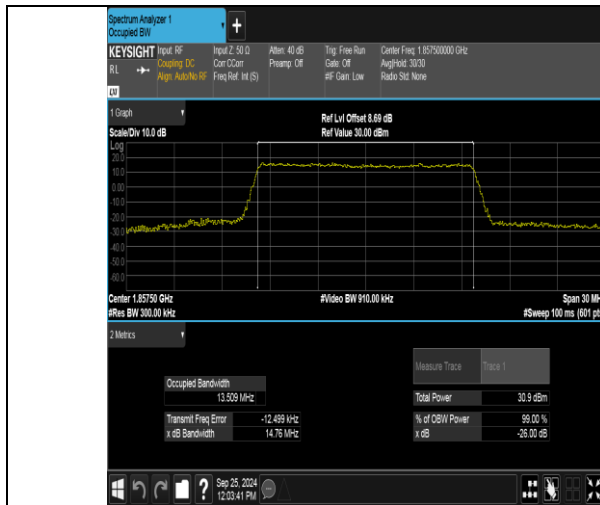


Band2-15MHz-QPSK-18675-75RB#0-PASS

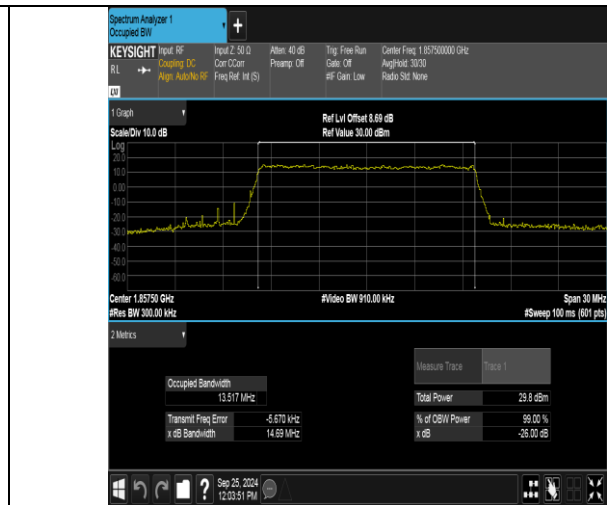


Band2-15MHz-16QAM-18675-75RB#0-PASS

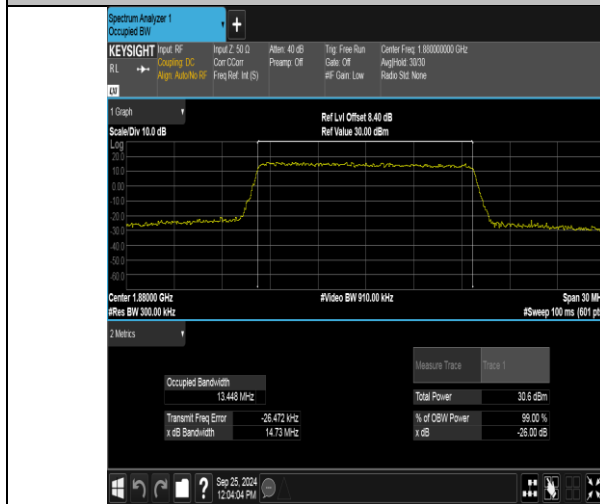


Band2-15MHz-QPSK-18900-75RB#0-PASS

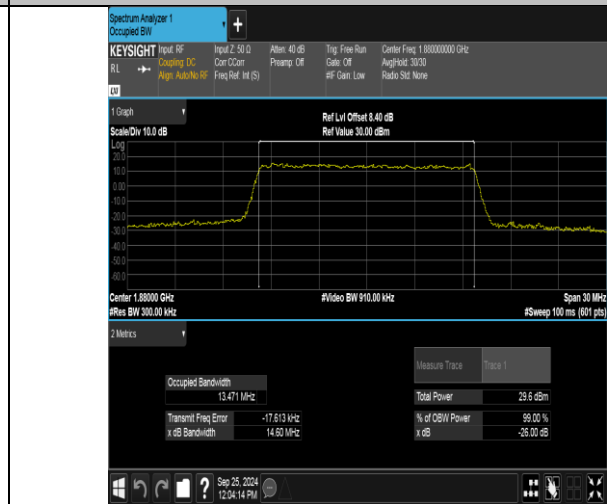

Band2-15MHz-16QAM-18900-75RB#0-PASS

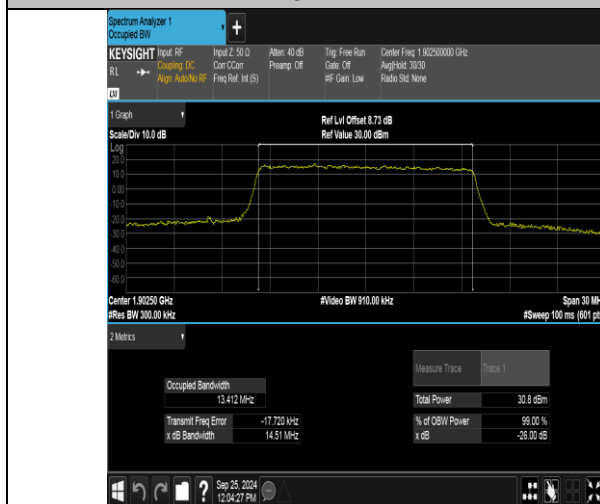


Band2-15MHz-QPSK-19125-75RB#0-PASS

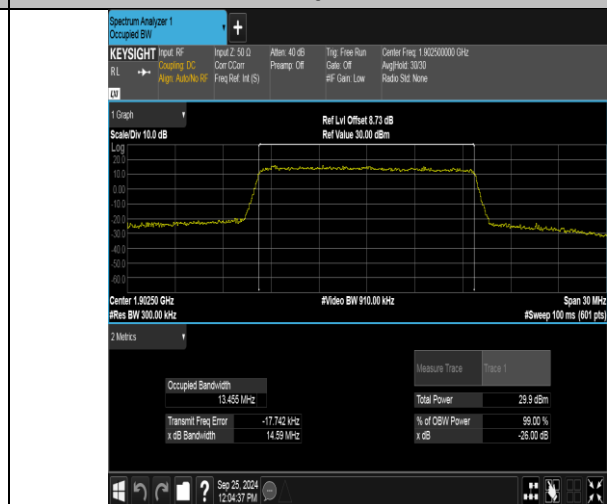


Band2-15MHz-16QAM-19125-75RB#0-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

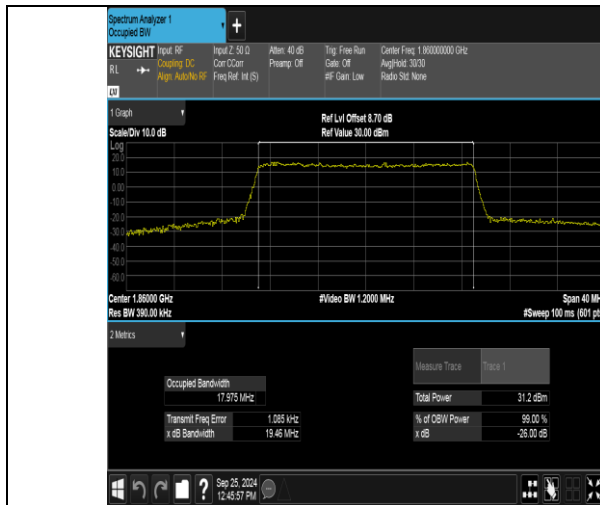


Band2-20MHz-QPSK-18700-100RB#0-PASS

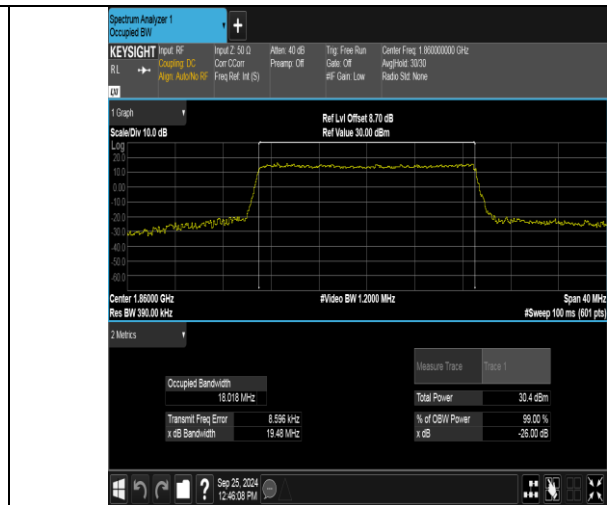


Band2-20MHz-16QAM-18700-100RB#0-PASS

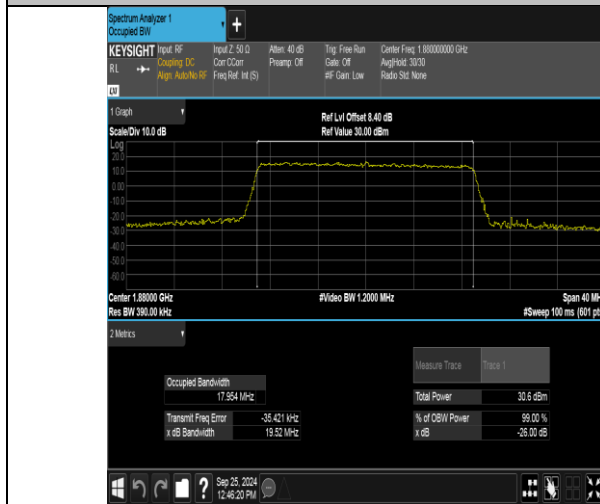


Band2-20MHz-QPSK-18900-100RB#0-PASS

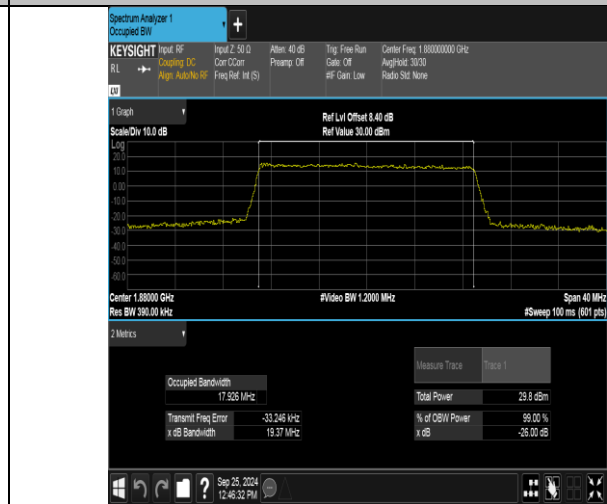

Band2-20MHz-16QAM-18900-100RB#0-PASS

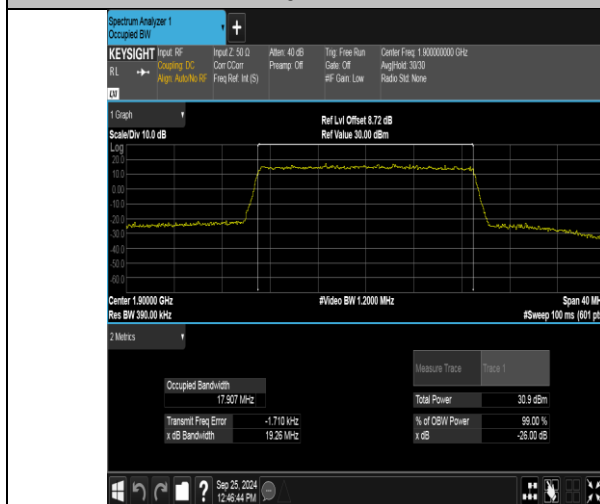

Band2-20MHz-QPSK-19100-100RB#0-PASS

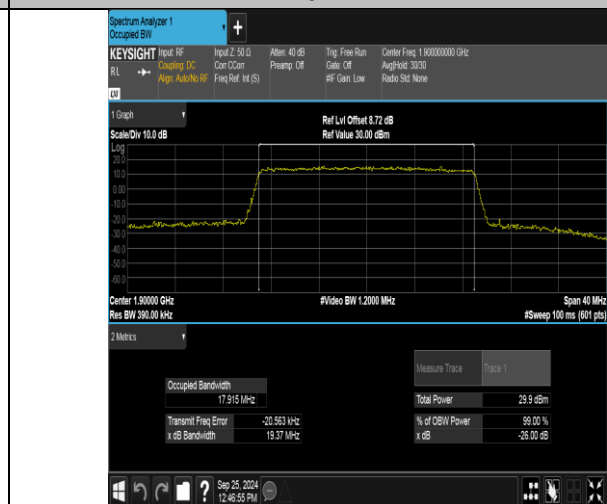

Band2-20MHz-16QAM-19100-100RB#0-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-22.98	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-25.17	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	-32.84	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	-34.79	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-29.27	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-32.34	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	-34.51	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	-36.26	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-25.13	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-27.73	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-31.99	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-32.63	PASS
Band2	3MHz	QPSK	18615	1RB#0	-20.91	PASS
Band2	3MHz	16QAM	18615	1RB#0	-22.30	PASS
Band2	3MHz	QPSK	18615	1RB#14	-49.19	PASS
Band2	3MHz	16QAM	18615	1RB#14	-49.99	PASS
Band2	3MHz	QPSK	18615	15RB#0	-31.39	PASS
Band2	3MHz	16QAM	18615	15RB#0	-33.82	PASS
Band2	3MHz	QPSK	19185	1RB#0	-50.65	PASS
Band2	3MHz	16QAM	19185	1RB#0	-51.09	PASS
Band2	3MHz	QPSK	19185	1RB#14	-22.96	PASS
Band2	3MHz	16QAM	19185	1RB#14	-23.97	PASS
Band2	3MHz	QPSK	19185	15RB#0	-33.12	PASS
Band2	3MHz	16QAM	19185	15RB#0	-34.20	PASS
Band2	5MHz	QPSK	18625	1RB#0	-20.48	PASS
Band2	5MHz	16QAM	18625	1RB#0	-20.76	PASS
Band2	5MHz	QPSK	18625	1RB#24	-48.66	PASS
Band2	5MHz	16QAM	18625	1RB#24	-48.63	PASS
Band2	5MHz	QPSK	18625	25RB#0	-31.74	PASS
Band2	5MHz	16QAM	18625	25RB#0	-32.70	PASS
Band2	5MHz	QPSK	19175	1RB#0	-49.23	PASS
Band2	5MHz	16QAM	19175	1RB#0	-49.78	PASS
Band2	5MHz	QPSK	19175	1RB#24	-21.74	PASS
Band2	5MHz	16QAM	19175	1RB#24	-22.43	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd


Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band2	5MHz	QPSK	19175	25RB#0	-32.57	PASS
Band2	5MHz	16QAM	19175	25RB#0	-32.96	PASS
Band2	10MHz	QPSK	18650	1RB#0	-23.36	PASS
Band2	10MHz	16QAM	18650	1RB#0	-24.92	PASS
Band2	10MHz	QPSK	18650	1RB#49	-47.73	PASS
Band2	10MHz	16QAM	18650	1RB#49	-47.92	PASS
Band2	10MHz	QPSK	18650	50RB#0	-34.49	PASS
Band2	10MHz	16QAM	18650	50RB#0	-36.12	PASS
Band2	10MHz	QPSK	19150	1RB#0	-49.37	PASS
Band2	10MHz	16QAM	19150	1RB#0	-49.21	PASS
Band2	10MHz	QPSK	19150	1RB#49	-23.70	PASS
Band2	10MHz	16QAM	19150	1RB#49	-24.23	PASS
Band2	10MHz	QPSK	19150	50RB#0	-35.78	PASS
Band2	10MHz	16QAM	19150	50RB#0	-37.38	PASS
Band2	15MHz	QPSK	18675	1RB#0	-26.80	PASS
Band2	15MHz	16QAM	18675	1RB#0	-27.51	PASS
Band2	15MHz	QPSK	18675	1RB#74	-49.43	PASS
Band2	15MHz	16QAM	18675	1RB#74	-49.50	PASS
Band2	15MHz	QPSK	18675	75RB#0	-37.41	PASS
Band2	15MHz	16QAM	18675	75RB#0	-38.86	PASS
Band2	15MHz	QPSK	19125	1RB#0	-50.17	PASS
Band2	15MHz	16QAM	19125	1RB#0	-50.01	PASS
Band2	15MHz	QPSK	19125	1RB#74	-26.78	PASS
Band2	15MHz	16QAM	19125	1RB#74	-27.94	PASS
Band2	15MHz	QPSK	19125	75RB#0	-37.52	PASS
Band2	15MHz	16QAM	19125	75RB#0	-38.94	PASS
Band2	20MHz	QPSK	18700	1RB#0	-30.81	PASS
Band2	20MHz	16QAM	18700	1RB#0	-31.20	PASS
Band2	20MHz	QPSK	18700	1RB#99	-49.52	PASS
Band2	20MHz	16QAM	18700	1RB#99	-49.81	PASS
Band2	20MHz	QPSK	18700	100RB#0	-40.71	PASS
Band2	20MHz	16QAM	18700	100RB#0	-41.30	PASS
Band2	20MHz	QPSK	19100	1RB#0	-49.83	PASS
Band2	20MHz	16QAM	19100	1RB#0	-49.88	PASS
Band2	20MHz	QPSK	19100	1RB#99	-30.82	PASS
Band2	20MHz	16QAM	19100	1RB#99	-31.73	PASS
Band2	20MHz	QPSK	19100	100RB#0	-40.50	PASS
Band2	20MHz	16QAM	19100	100RB#0	-41.07	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Test Graphs

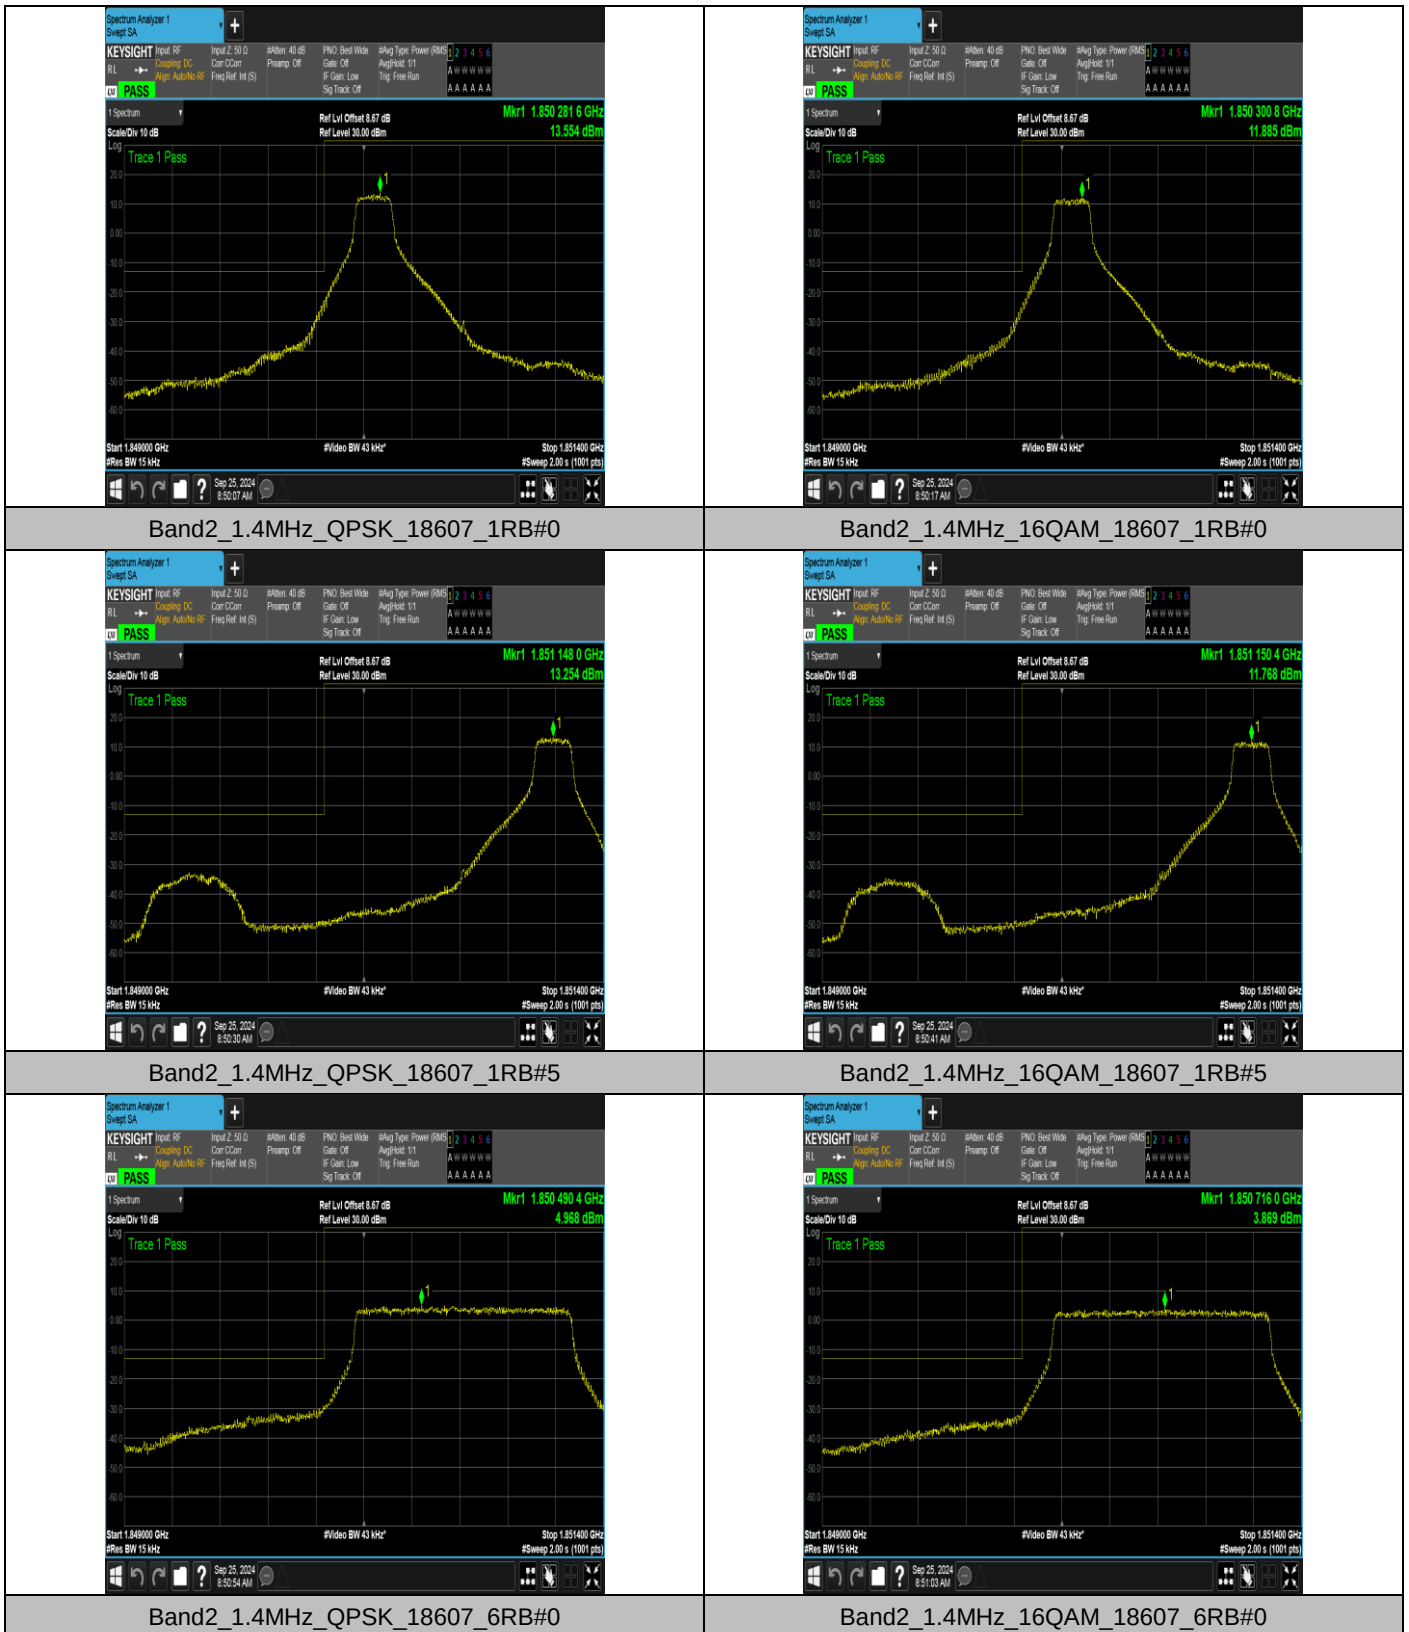


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band2_1.4MHz_QPSK_19193_1RB#0




Band2_1.4MHz_16QAM_19193_1RB#0

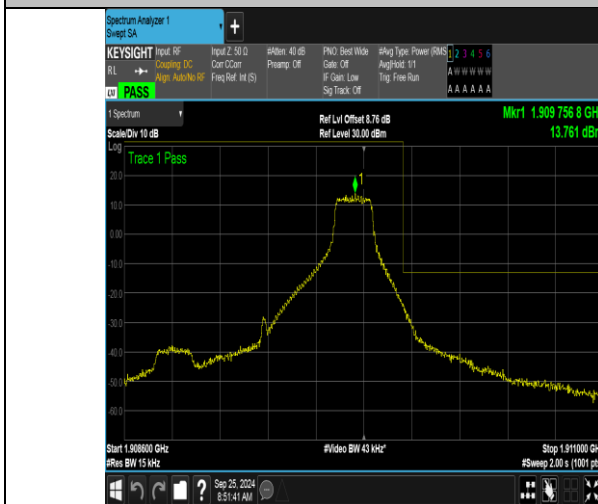

Band2_1.4MHz_QPSK_19193_1RB#5

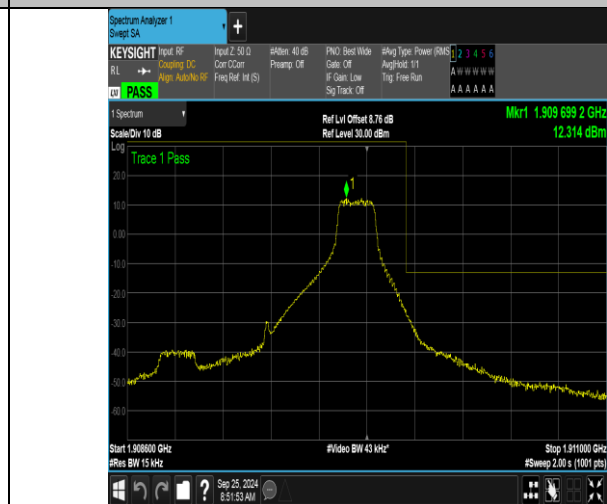

Band2_1.4MHz_16QAM_19193_1RB#5

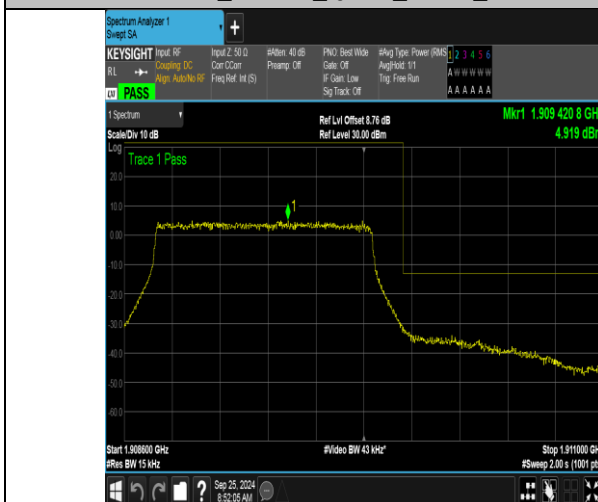


Band2_1.4MHz_QPSK_19193_6RB#0



Band2_1.4MHz_16QAM_19193_6RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

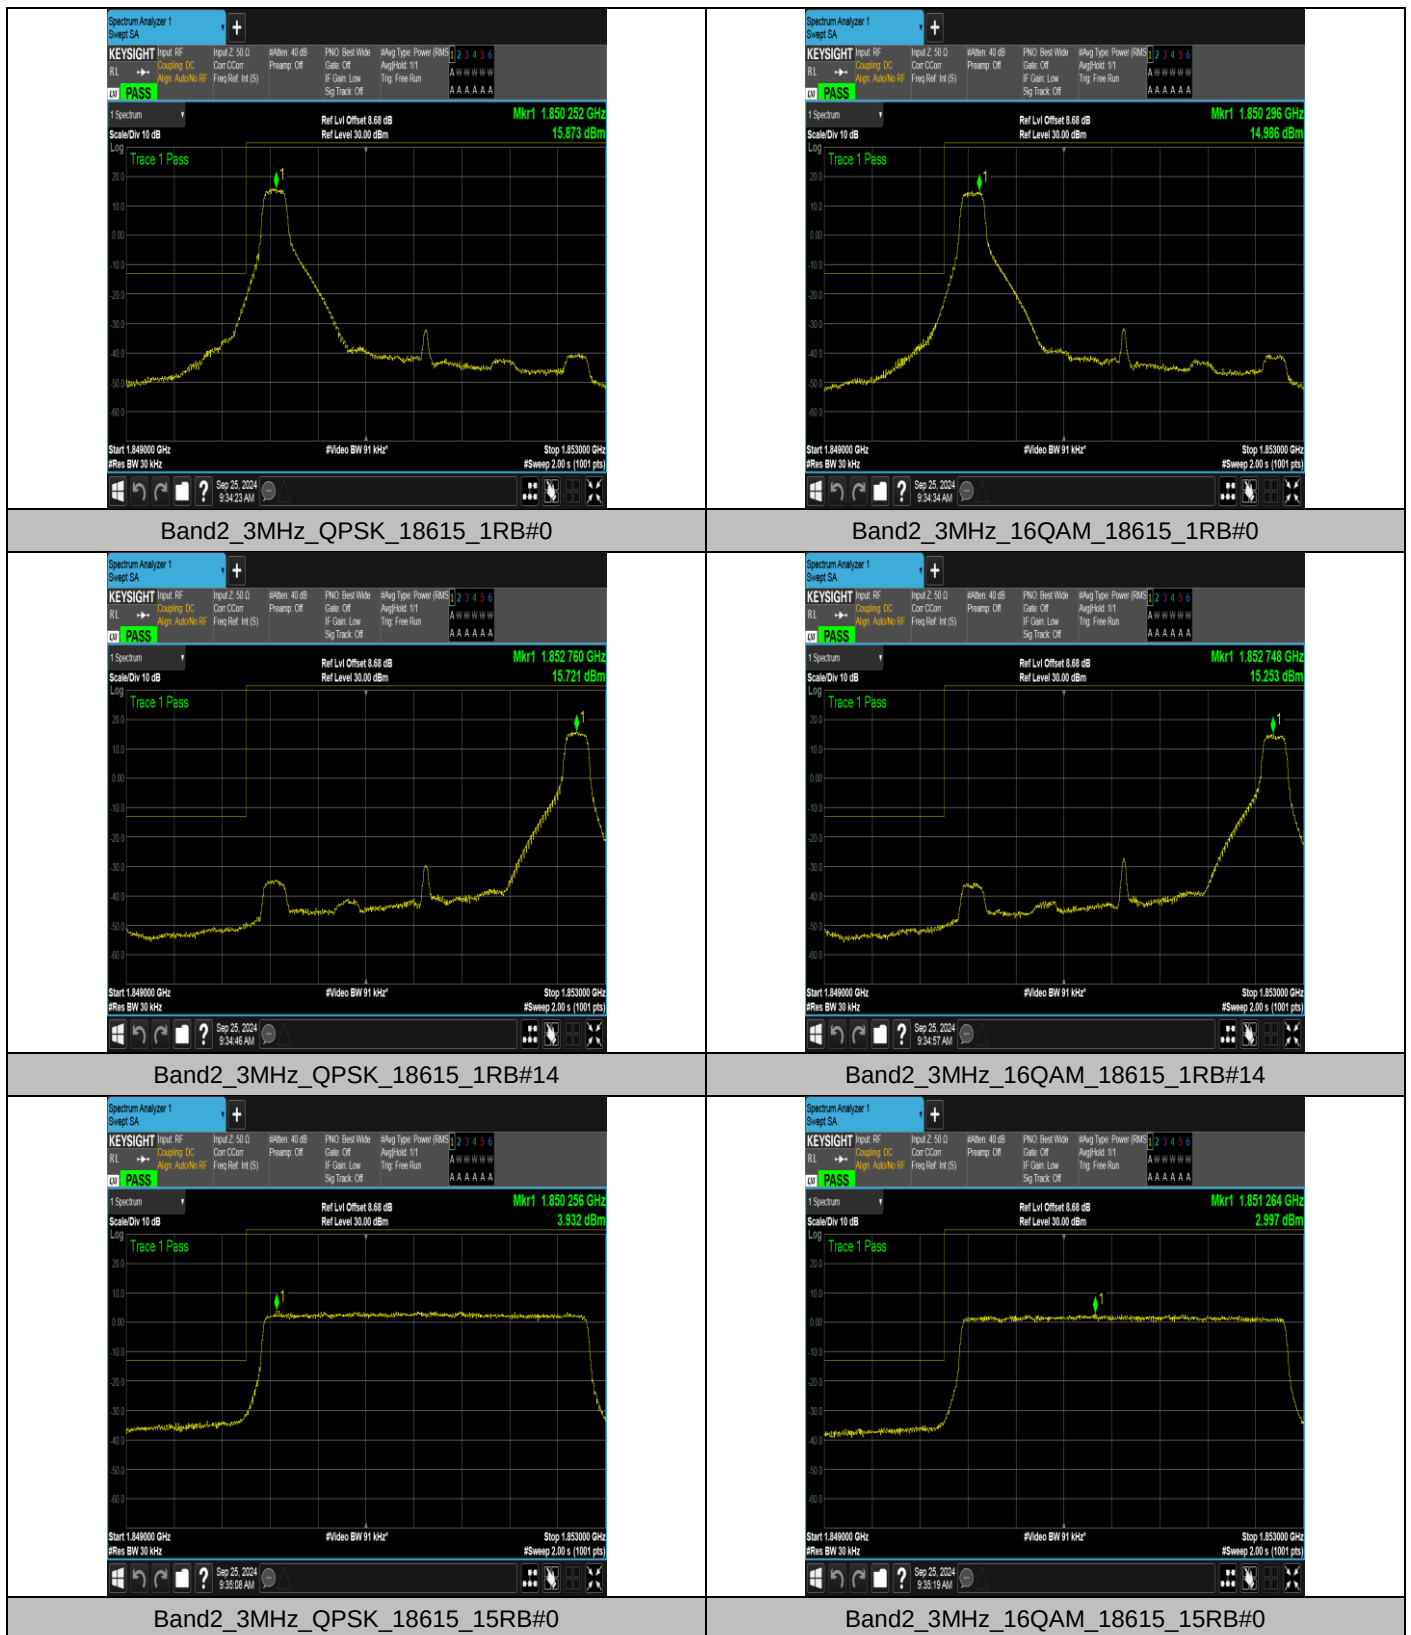


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band2_3MHz_QPSK_19185_1RB#0



Band2_3MHz_16QAM_19185_1RB#0

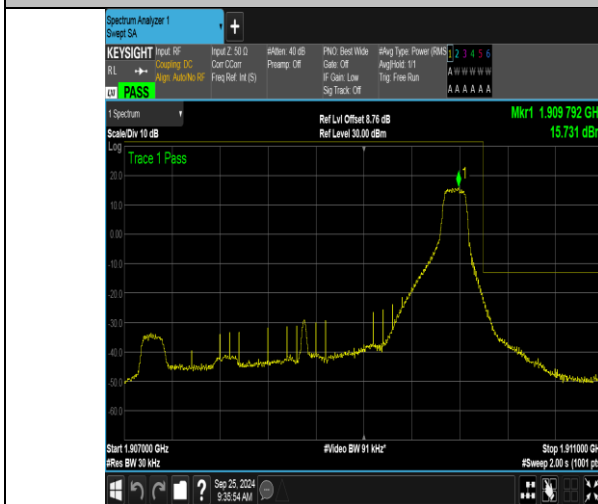


Band2_3MHz_QPSK_19185_1RB#14

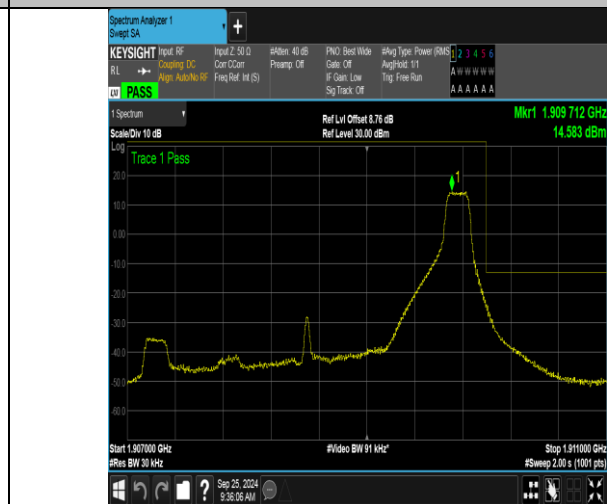

Band2_3MHz_16QAM_19185_1RB#14



Band2_3MHz_QPSK_19185_15RB#0

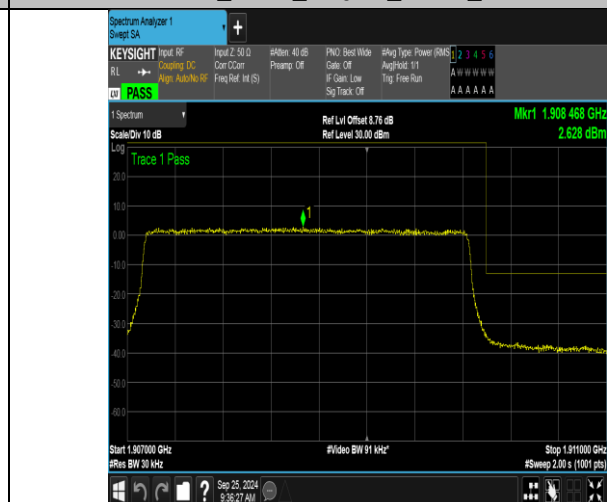


Band2_3MHz_16QAM_19185_15RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band2_5MHz_QPSK_18625_1RB#0

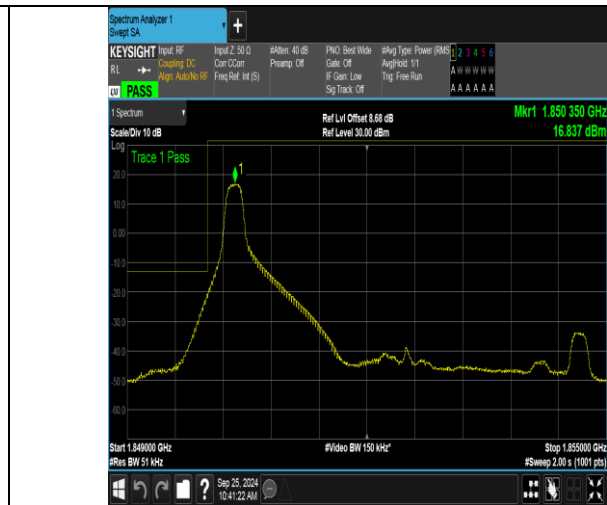


Band2_5MHz_16QAM_18625_1RB#0




Band2_5MHz_QPSK_18625_1RB#24



Band2_5MHz_16QAM_18625_1RB#24

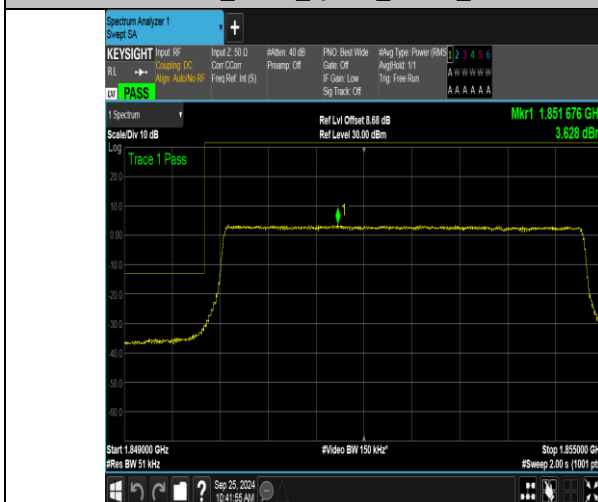

Band2_5MHz_QPSK_18625_25RB#0

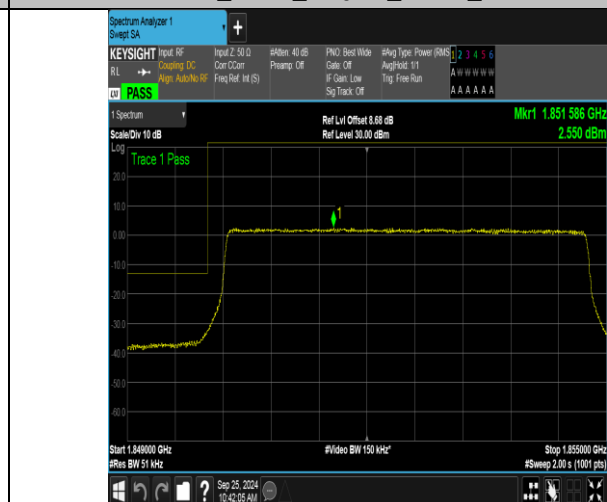

Band2_5MHz_16QAM_18625_25RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band2_5MHz_QPSK_19175_1RB#0




Band2_5MHz_16QAM_19175_1RB#0

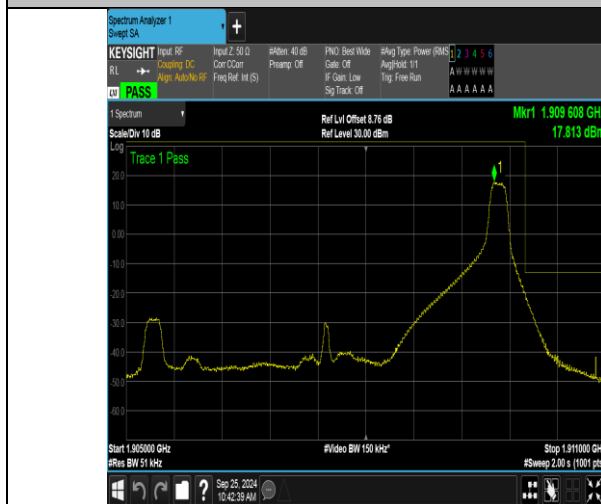


Band2_5MHz_QPSK_19175_1RB#24

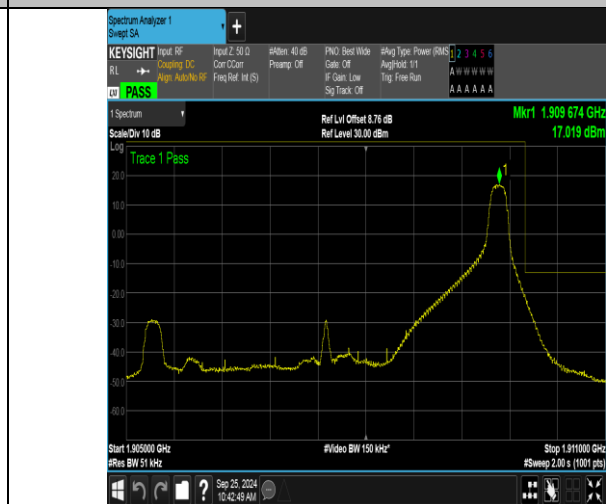

Band2_5MHz_16QAM_19175_1RB#24

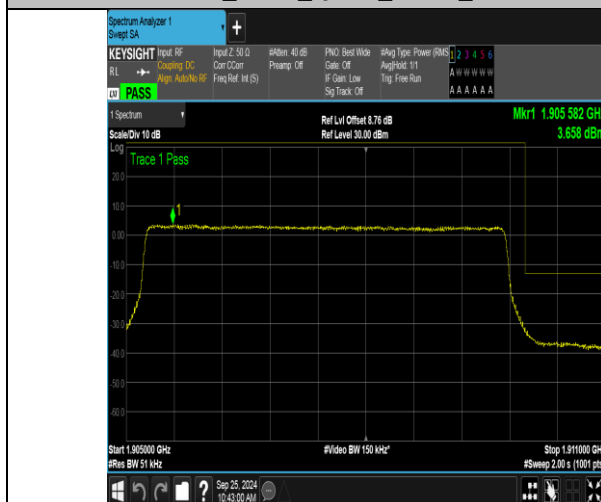


Band2_5MHz_QPSK_19175_25RB#0

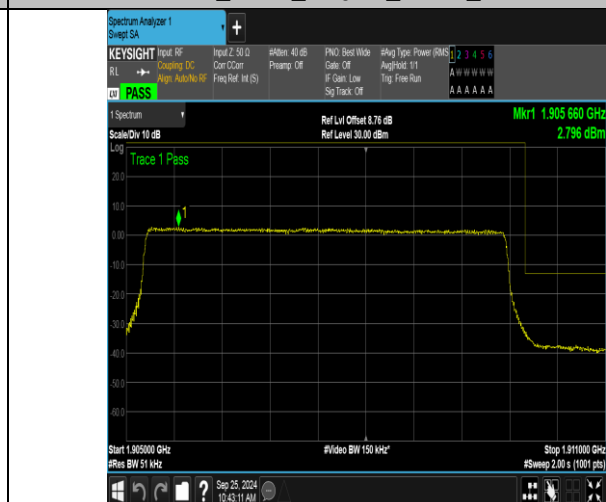


Band2_5MHz_16QAM_19175_25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

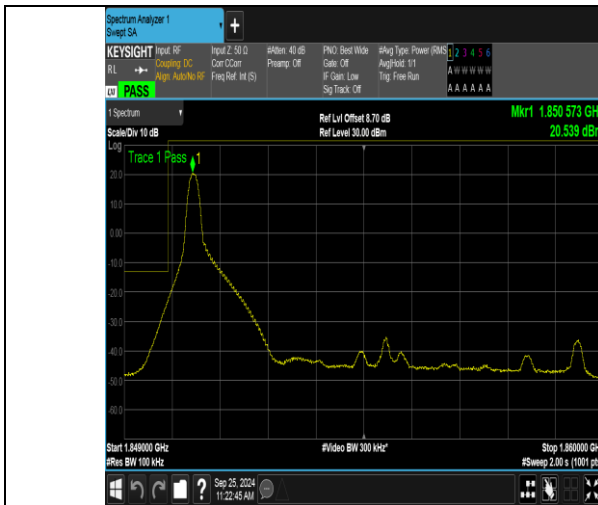


Band2_10MHz_QPSK_18650_1RB#0

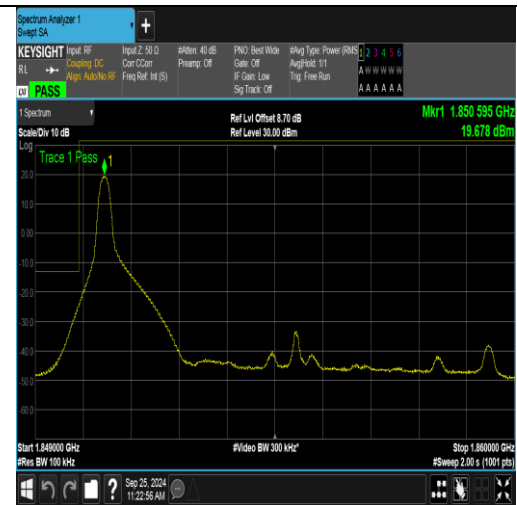


Band2_10MHz_16QAM_18650_1RB#0




Band2_10MHz_QPSK_18650_1RB#49

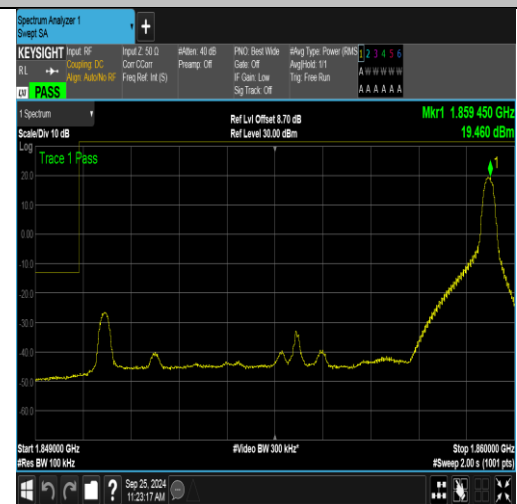

Band2_10MHz_16QAM_18650_1RB#49

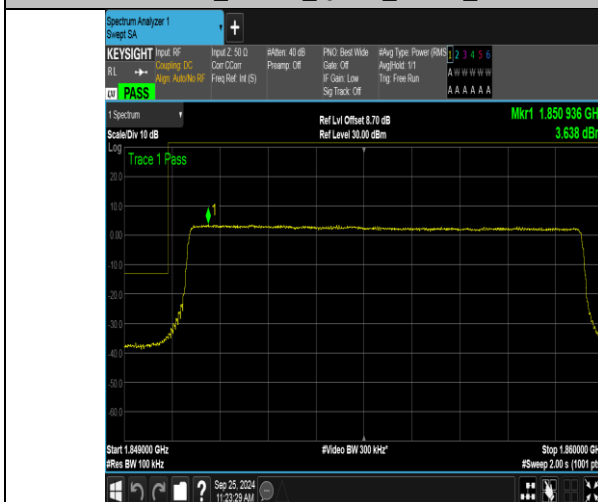


Band2_10MHz_QPSK_18650_50RB#0

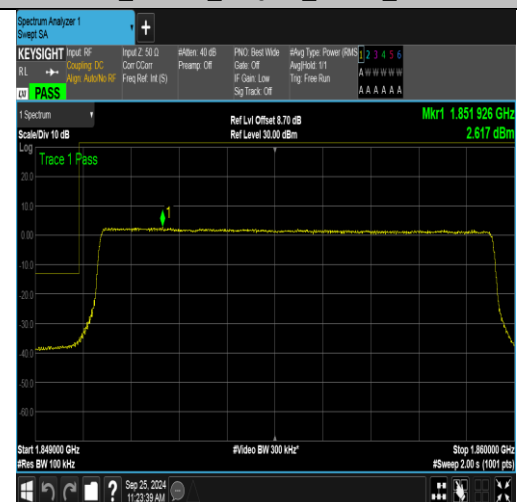


Band2_10MHz_16QAM_18650_50RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

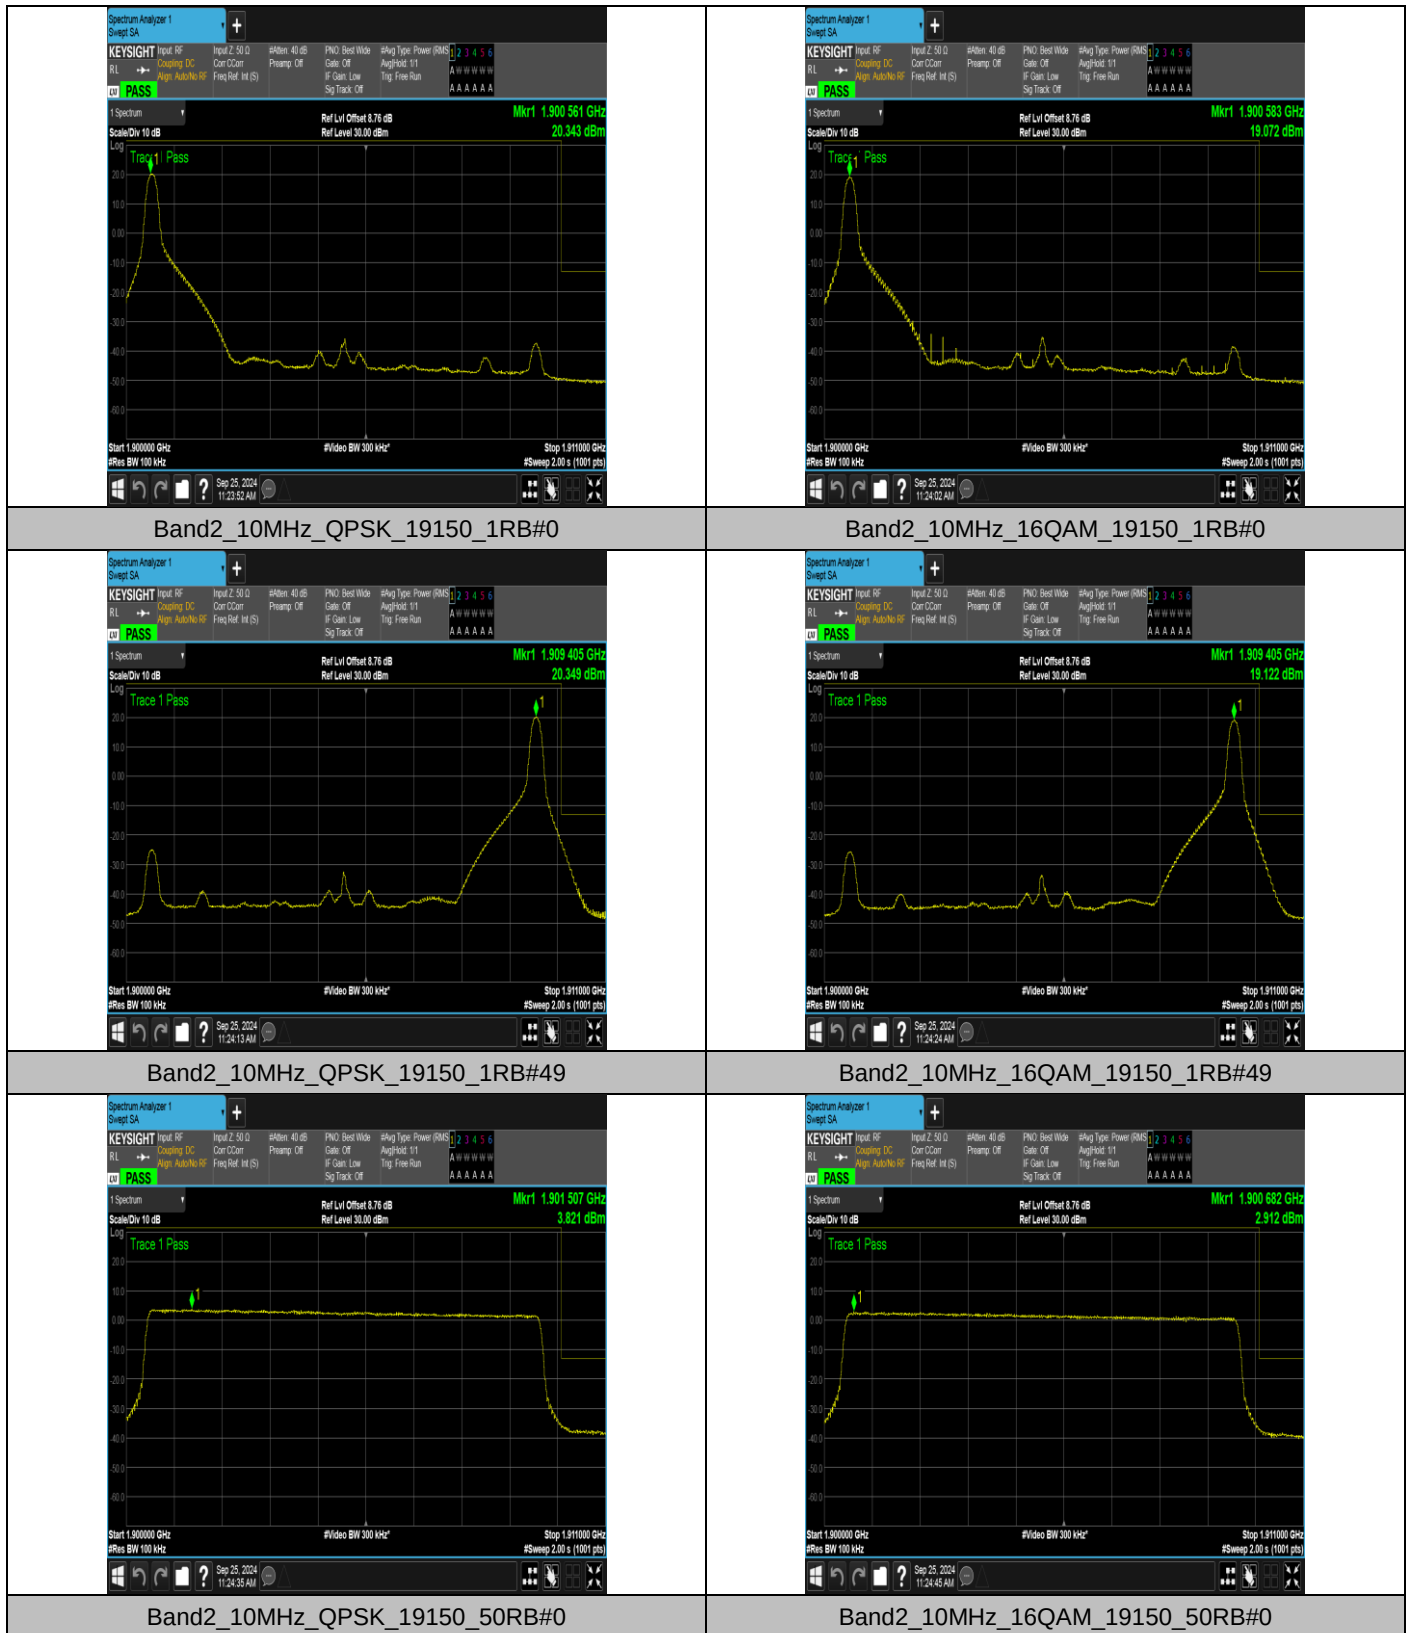


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

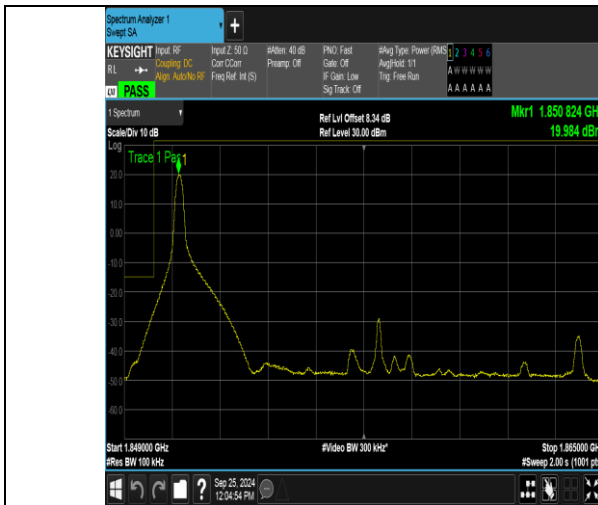


Band2_15MHz_QPSK_18675_1RB#0

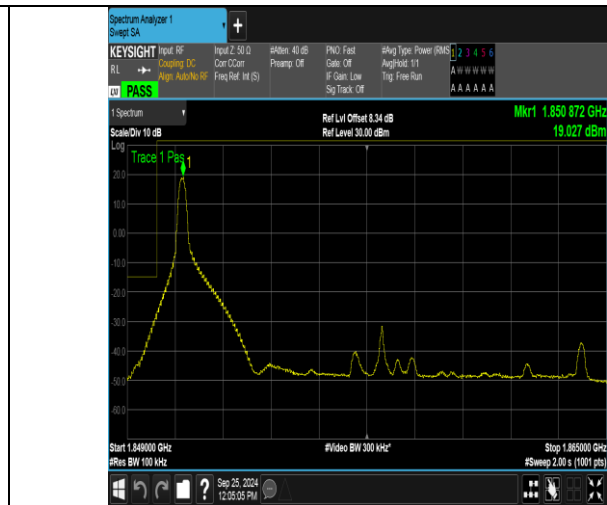


Band2_15MHz_16QAM_18675_1RB#0

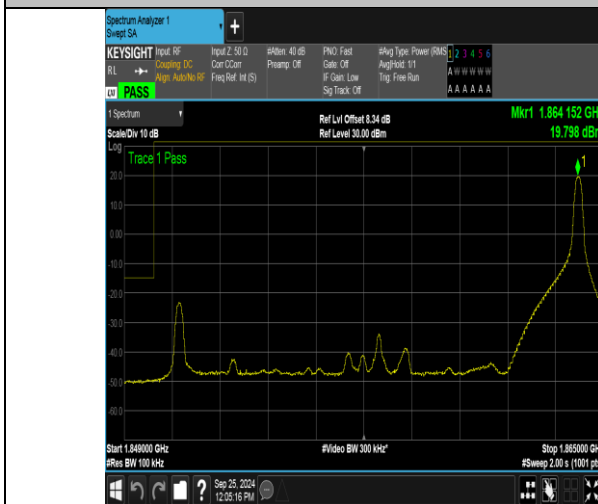


Band2_15MHz_QPSK_18675_1RB#74

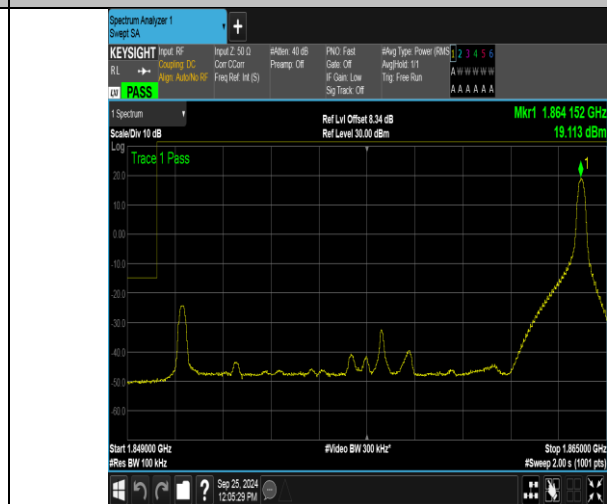

Band2_15MHz_16QAM_18675_1RB#74

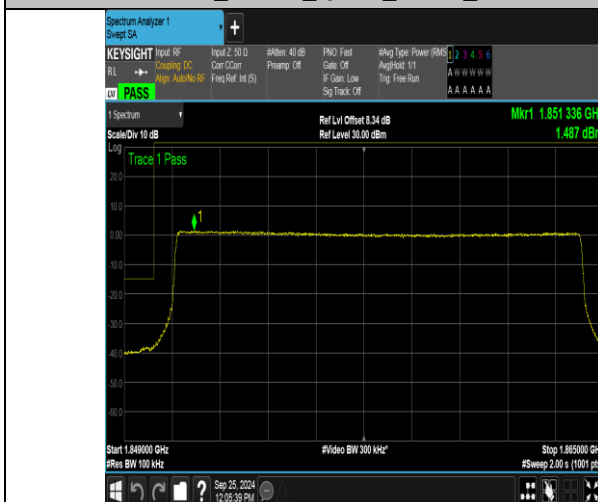


Band2_15MHz_QPSK_18675_75RB#0

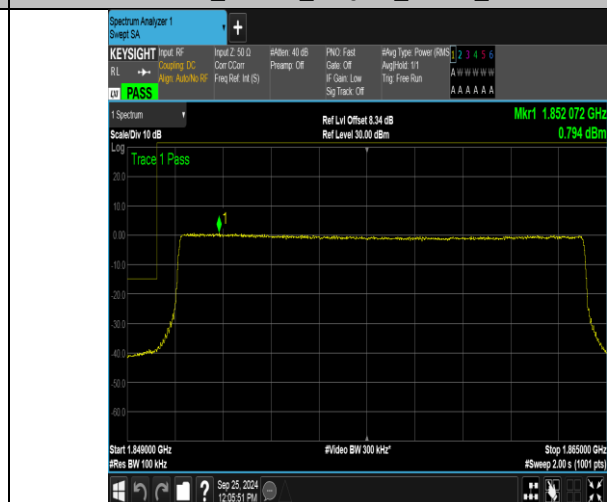


Band2_15MHz_16QAM_18675_75RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

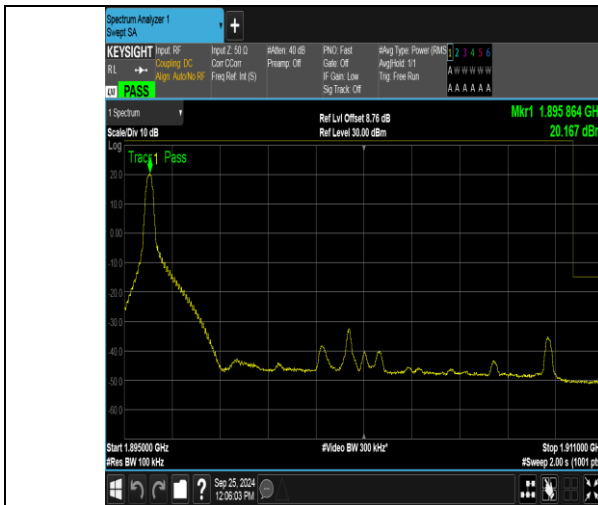


Band2_15MHz_QPSK_19125_1RB#0

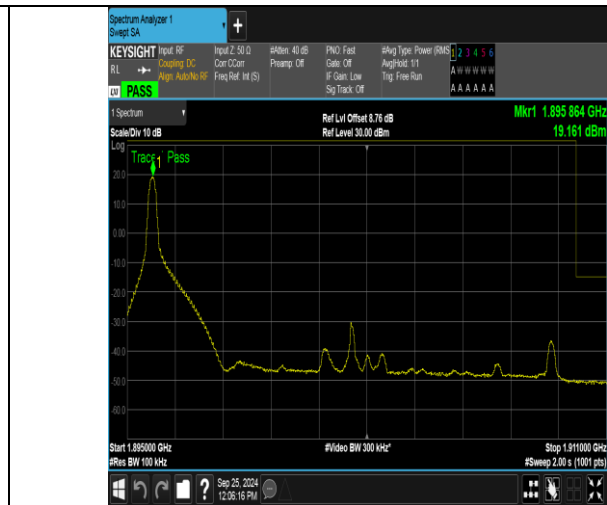


Band2_15MHz_16QAM_19125_1RB#0

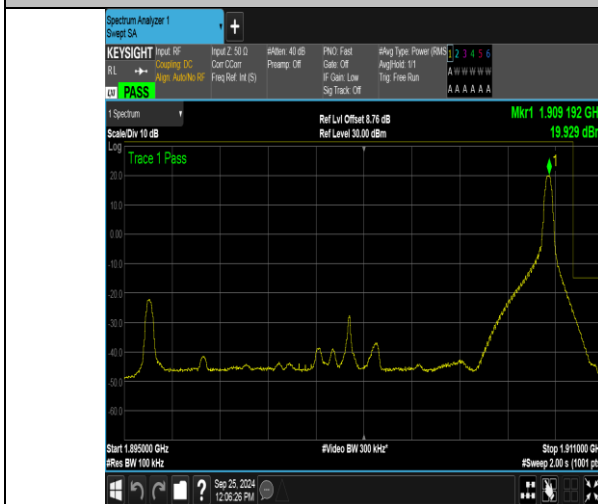

Band2_15MHz_QPSK_19125_1RB#74

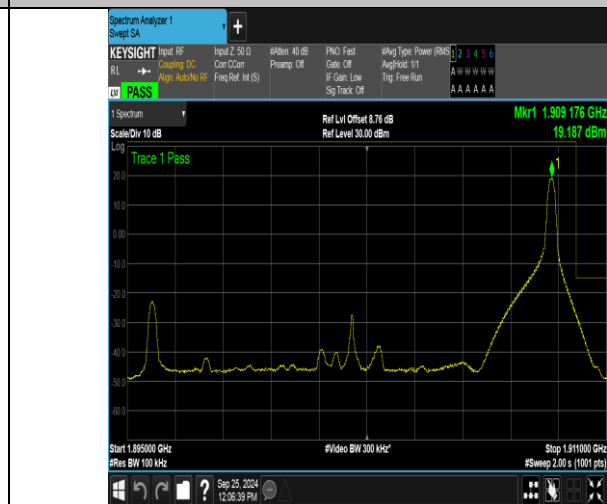

Band2_15MHz_16QAM_19125_1RB#74

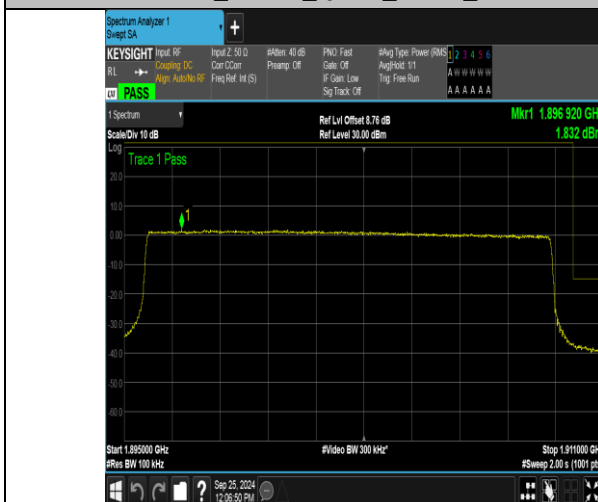


Band2_15MHz_QPSK_19125_75RB#0




Band2_15MHz_16QAM_19125_75RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

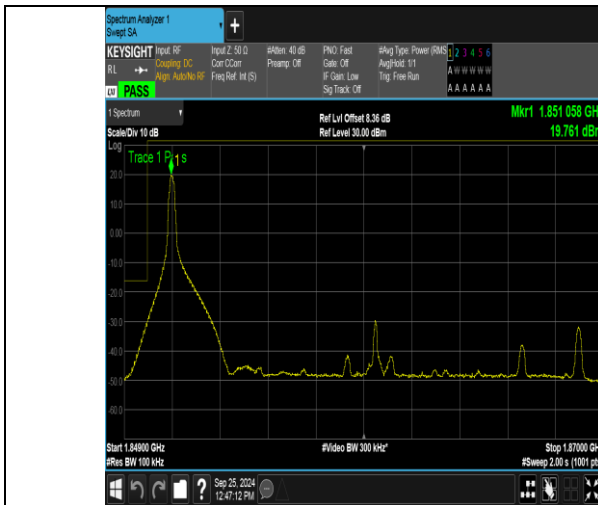


Band2_20MHz_QPSK_18700_1RB#0

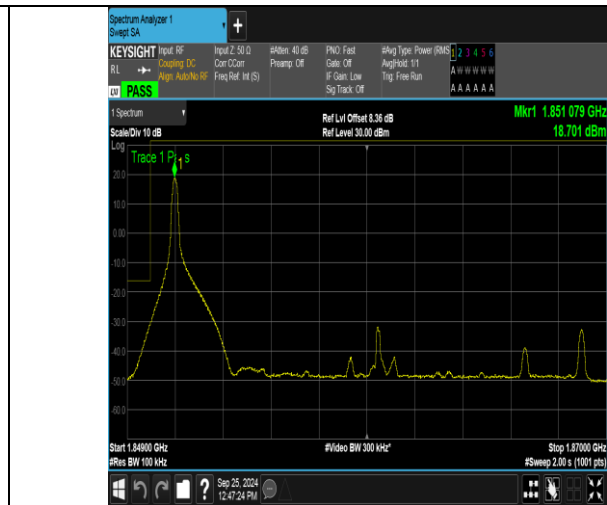


Band2_20MHz_16QAM_18700_1RB#0

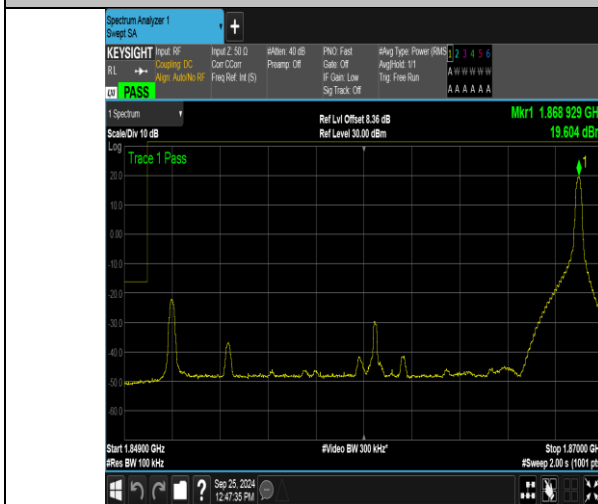


Band2_20MHz_QPSK_18700_1RB#99

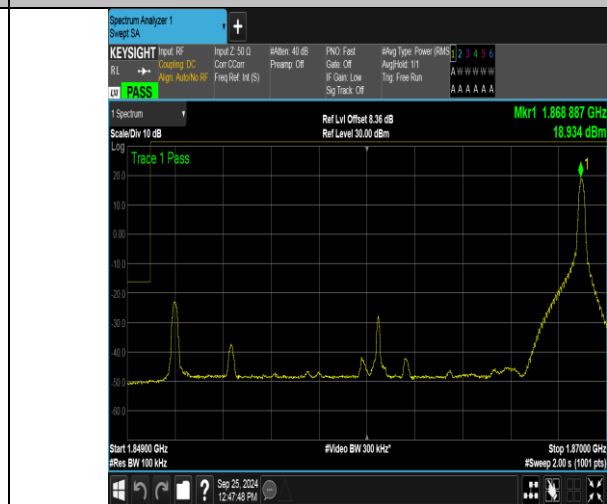

Band2_20MHz_16QAM_18700_1RB#99

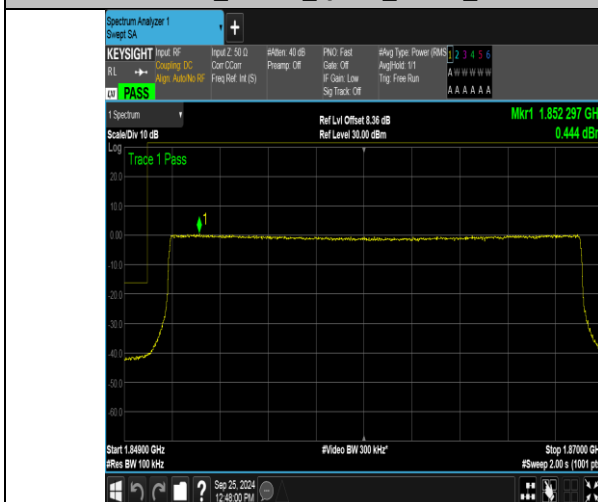


Band2_20MHz_QPSK_18700_100RB#0

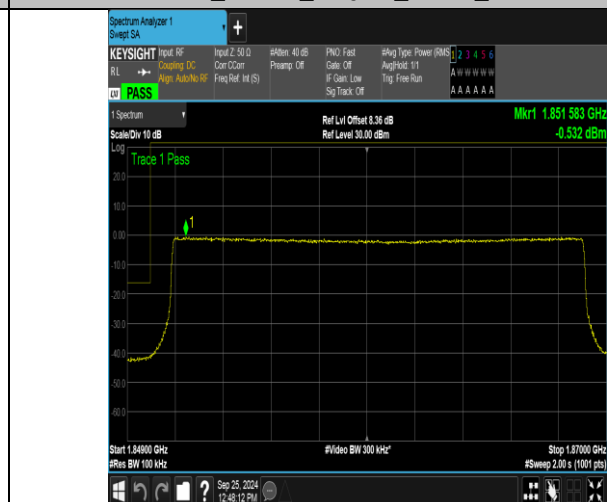

Band2_20MHz_16QAM_18700_100RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

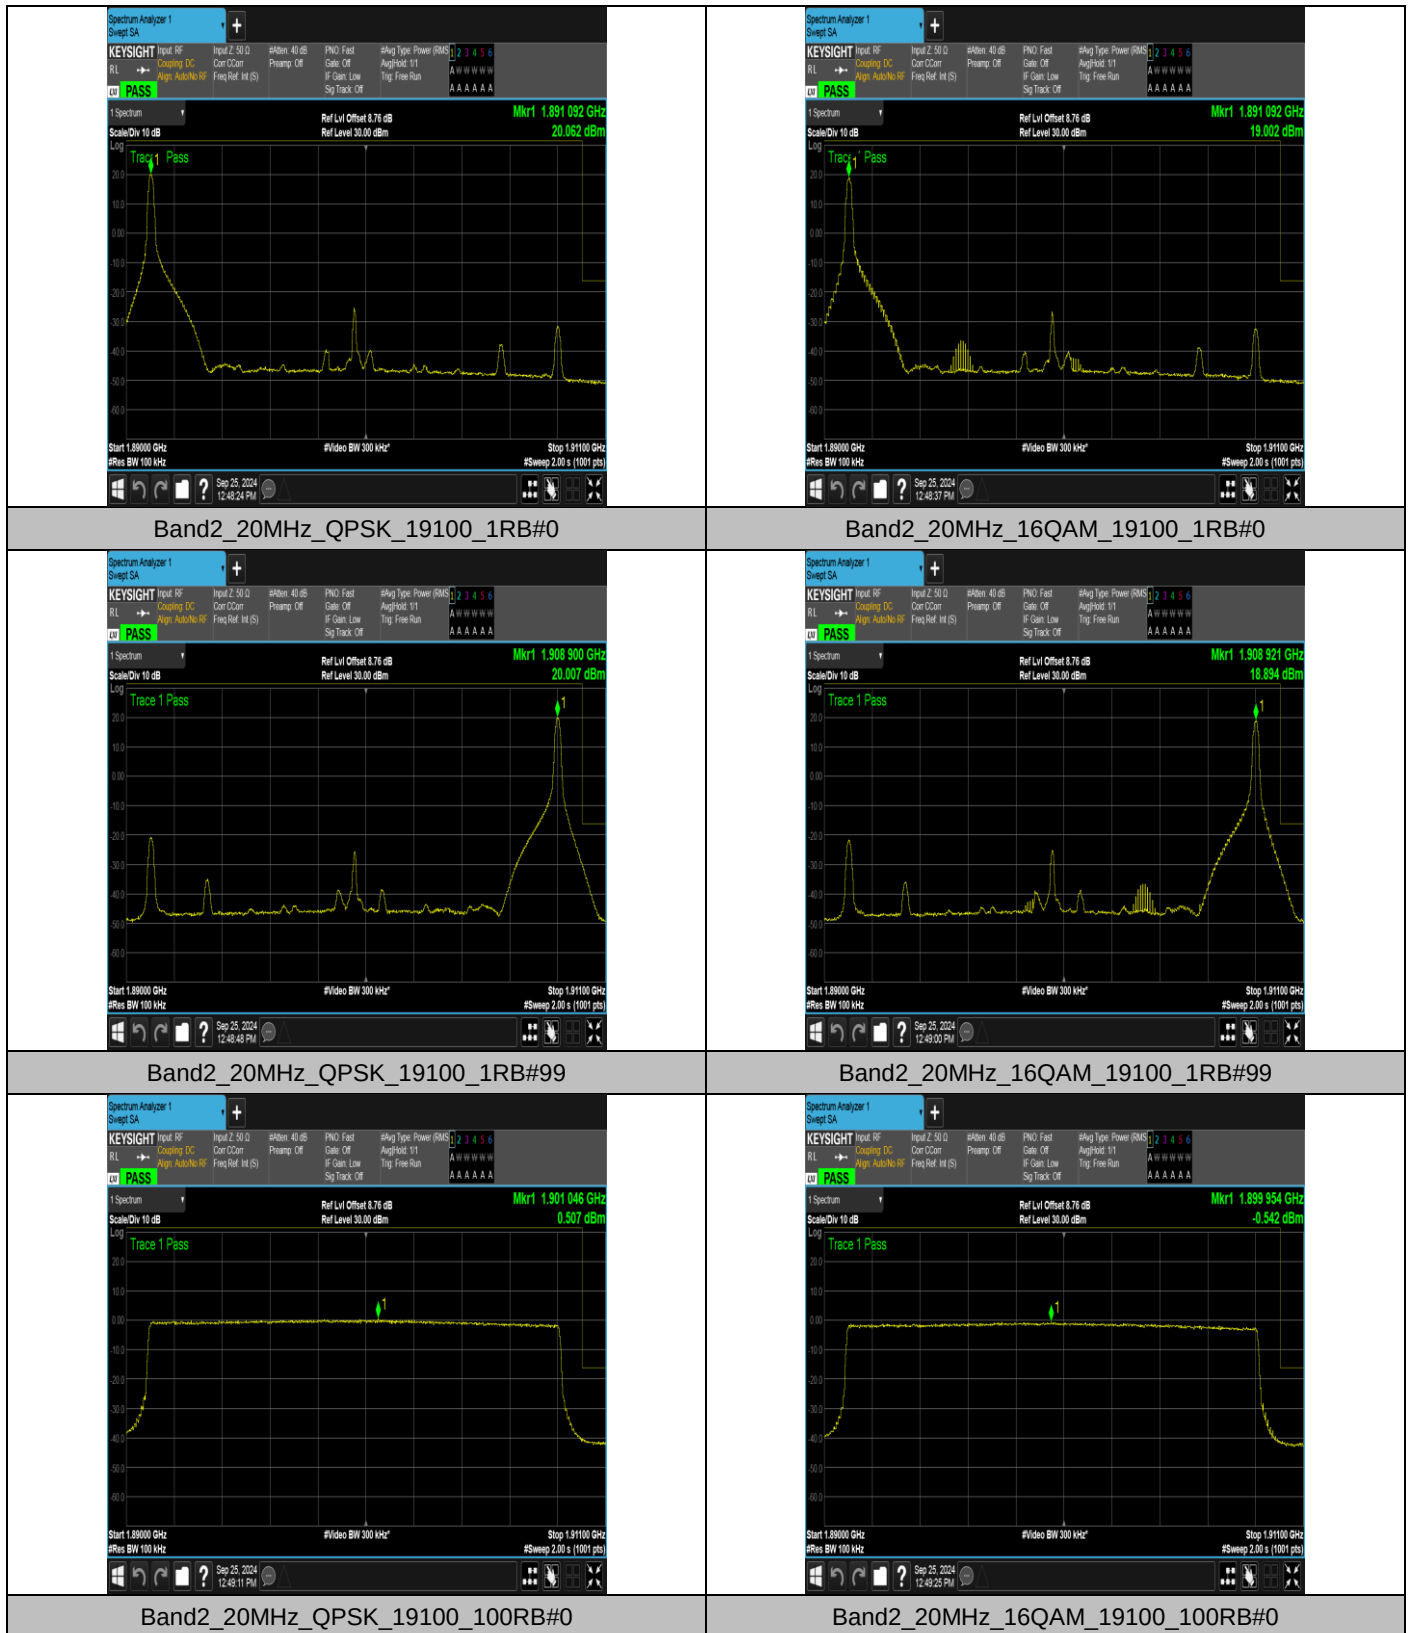

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	30~1000	-62.68	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	1000~3000	-41.32	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	3000~20000	-40.16	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	30~1000	-62.96	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	1000~3000	-41.92	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	3000~20000	-39.61	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	30~1000	-62.73	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	1000~3000	-42.12	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	3000~20000	-40.15	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	30~1000	-62.72	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	1000~3000	-41.92	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	3000~20000	-40.04	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	30~1000	-62.84	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	1000~3000	-33.03	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	3000~20000	-39.89	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	30~1000	-62.51	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	1000~3000	-33.39	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	3000~20000	-39.70	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	30~1000	-62.98	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	1000~3000	-40.77	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	3000~20000	-40.05	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	30~1000	-62.83	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	1000~3000	-41.48	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	3000~20000	-34.89	PASS
Band2	1.4MHz	QPSK	18900	1RB#5	30~1000	-62.59	PASS
Band2	1.4MHz	QPSK	18900	1RB#5	1000~3000	-41.10	PASS
Band2	1.4MHz	QPSK	18900	1RB#5	3000~20000	-31.27	PASS
Band2	1.4MHz	16QAM	18900	1RB#5	30~1000	-62.85	PASS
Band2	1.4MHz	16QAM	18900	1RB#5	1000~3000	-41.04	PASS
Band2	1.4MHz	16QAM	18900	1RB#5	3000~20000	-34.07	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	30~1000	-62.80	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	1000~3000	-34.00	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	3000~20000	-36.32	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	30~1000	-62.49	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	1000~3000	-37.97	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band2	1.4MHz	16QAM	18900	6RB#0	3000~20000	-37.74	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	30~1000	-62.80	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	1000~3000	-40.47	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	3000~20000	-39.07	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	30~1000	-62.61	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	1000~3000	-40.91	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	3000~20000	-39.85	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	30~1000	-62.12	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	1000~3000	-40.95	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	3000~20000	-39.85	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	30~1000	-62.51	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	1000~3000	-41.09	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	3000~20000	-39.29	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	30~1000	-62.74	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	1000~3000	-33.13	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	3000~20000	-39.44	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	30~1000	-62.57	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	1000~3000	-34.56	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	3000~20000	-40.01	PASS
Band2	3MHz	QPSK	18615	1RB#0	30~1000	-62.85	PASS
Band2	3MHz	QPSK	18615	1RB#0	1000~3000	-44.44	PASS
Band2	3MHz	QPSK	18615	1RB#0	3000~20000	-40.01	PASS
Band2	3MHz	16QAM	18615	1RB#0	30~1000	-62.81	PASS
Band2	3MHz	16QAM	18615	1RB#0	1000~3000	-47.49	PASS
Band2	3MHz	16QAM	18615	1RB#0	3000~20000	-39.77	PASS
Band2	3MHz	QPSK	18615	1RB#14	30~1000	-62.53	PASS
Band2	3MHz	QPSK	18615	1RB#14	1000~3000	-47.72	PASS
Band2	3MHz	QPSK	18615	1RB#14	3000~20000	-40.09	PASS
Band2	3MHz	16QAM	18615	1RB#14	30~1000	-62.74	PASS
Band2	3MHz	16QAM	18615	1RB#14	1000~3000	-47.81	PASS
Band2	3MHz	16QAM	18615	1RB#14	3000~20000	-40.02	PASS
Band2	3MHz	QPSK	18615	15RB#0	30~1000	-62.27	PASS
Band2	3MHz	QPSK	18615	15RB#0	1000~3000	-36.37	PASS
Band2	3MHz	QPSK	18615	15RB#0	3000~20000	-39.84	PASS
Band2	3MHz	16QAM	18615	15RB#0	30~1000	-62.86	PASS
Band2	3MHz	16QAM	18615	15RB#0	1000~3000	-38.01	PASS
Band2	3MHz	16QAM	18615	15RB#0	3000~20000	-39.89	PASS
Band2	3MHz	QPSK	18900	1RB#0	30~1000	-62.67	PASS
Band2	3MHz	QPSK	18900	1RB#0	1000~3000	-46.26	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band2	3MHz	QPSK	18900	1RB#0	3000~20000	-39.72	PASS
Band2	3MHz	16QAM	18900	1RB#0	30~1000	-62.65	PASS
Band2	3MHz	16QAM	18900	1RB#0	1000~3000	-47.67	PASS
Band2	3MHz	16QAM	18900	1RB#0	3000~20000	-39.88	PASS
Band2	3MHz	QPSK	18900	1RB#14	30~1000	-62.85	PASS
Band2	3MHz	QPSK	18900	1RB#14	1000~3000	-47.53	PASS
Band2	3MHz	QPSK	18900	1RB#14	3000~20000	-39.88	PASS
Band2	3MHz	16QAM	18900	1RB#14	30~1000	-62.75	PASS
Band2	3MHz	16QAM	18900	1RB#14	1000~3000	-46.67	PASS
Band2	3MHz	16QAM	18900	1RB#14	3000~20000	-39.63	PASS
Band2	3MHz	QPSK	18900	15RB#0	30~1000	-62.49	PASS
Band2	3MHz	QPSK	18900	15RB#0	1000~3000	-36.06	PASS
Band2	3MHz	QPSK	18900	15RB#0	3000~20000	-39.72	PASS
Band2	3MHz	16QAM	18900	15RB#0	30~1000	-62.44	PASS
Band2	3MHz	16QAM	18900	15RB#0	1000~3000	-38.61	PASS
Band2	3MHz	16QAM	18900	15RB#0	3000~20000	-39.38	PASS
Band2	3MHz	QPSK	19185	1RB#0	30~1000	-62.59	PASS
Band2	3MHz	QPSK	19185	1RB#0	1000~3000	-45.21	PASS
Band2	3MHz	QPSK	19185	1RB#0	3000~20000	-39.93	PASS
Band2	3MHz	16QAM	19185	1RB#0	30~1000	-62.71	PASS
Band2	3MHz	16QAM	19185	1RB#0	1000~3000	-46.10	PASS
Band2	3MHz	16QAM	19185	1RB#0	3000~20000	-39.84	PASS
Band2	3MHz	QPSK	19185	1RB#14	30~1000	-62.57	PASS
Band2	3MHz	QPSK	19185	1RB#14	1000~3000	-45.25	PASS
Band2	3MHz	QPSK	19185	1RB#14	3000~20000	-39.83	PASS
Band2	3MHz	16QAM	19185	1RB#14	30~1000	-62.48	PASS
Band2	3MHz	16QAM	19185	1RB#14	1000~3000	-46.07	PASS
Band2	3MHz	16QAM	19185	1RB#14	3000~20000	-39.83	PASS
Band2	3MHz	QPSK	19185	15RB#0	30~1000	-62.21	PASS
Band2	3MHz	QPSK	19185	15RB#0	1000~3000	-34.50	PASS
Band2	3MHz	QPSK	19185	15RB#0	3000~20000	-39.74	PASS
Band2	3MHz	16QAM	19185	15RB#0	30~1000	-62.88	PASS
Band2	3MHz	16QAM	19185	15RB#0	1000~3000	-37.95	PASS
Band2	3MHz	16QAM	19185	15RB#0	3000~20000	-40.00	PASS
Band2	5MHz	QPSK	18625	1RB#0	30~1000	-62.55	PASS
Band2	5MHz	QPSK	18625	1RB#0	1000~3000	-28.15	PASS
Band2	5MHz	QPSK	18625	1RB#0	3000~20000	-39.92	PASS
Band2	5MHz	16QAM	18625	1RB#0	30~1000	-62.87	PASS
Band2	5MHz	16QAM	18625	1RB#0	1000~3000	-47.75	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band2	5MHz	16QAM	18625	1RB#0	3000~20000	-39.44	PASS
Band2	5MHz	QPSK	18625	1RB#24	30~1000	-62.87	PASS
Band2	5MHz	QPSK	18625	1RB#24	1000~3000	-47.97	PASS
Band2	5MHz	QPSK	18625	1RB#24	3000~20000	-39.42	PASS
Band2	5MHz	16QAM	18625	1RB#24	30~1000	-62.52	PASS
Band2	5MHz	16QAM	18625	1RB#24	1000~3000	-47.52	PASS
Band2	5MHz	16QAM	18625	1RB#24	3000~20000	-39.68	PASS
Band2	5MHz	QPSK	18625	25RB#0	30~1000	-62.53	PASS
Band2	5MHz	QPSK	18625	25RB#0	1000~3000	-40.08	PASS
Band2	5MHz	QPSK	18625	25RB#0	3000~20000	-39.85	PASS
Band2	5MHz	16QAM	18625	25RB#0	30~1000	-62.43	PASS
Band2	5MHz	16QAM	18625	25RB#0	1000~3000	-40.91	PASS
Band2	5MHz	16QAM	18625	25RB#0	3000~20000	-40.14	PASS
Band2	5MHz	QPSK	18900	1RB#0	30~1000	-62.76	PASS
Band2	5MHz	QPSK	18900	1RB#0	1000~3000	-47.56	PASS
Band2	5MHz	QPSK	18900	1RB#0	3000~20000	-39.65	PASS
Band2	5MHz	16QAM	18900	1RB#0	30~1000	-62.83	PASS
Band2	5MHz	16QAM	18900	1RB#0	1000~3000	-47.75	PASS
Band2	5MHz	16QAM	18900	1RB#0	3000~20000	-39.34	PASS
Band2	5MHz	QPSK	18900	1RB#24	30~1000	-62.53	PASS
Band2	5MHz	QPSK	18900	1RB#24	1000~3000	-47.87	PASS
Band2	5MHz	QPSK	18900	1RB#24	3000~20000	-39.76	PASS
Band2	5MHz	16QAM	18900	1RB#24	30~1000	-62.91	PASS
Band2	5MHz	16QAM	18900	1RB#24	1000~3000	-47.51	PASS
Band2	5MHz	16QAM	18900	1RB#24	3000~20000	-40.03	PASS
Band2	5MHz	QPSK	18900	25RB#0	30~1000	-62.80	PASS
Band2	5MHz	QPSK	18900	25RB#0	1000~3000	-39.67	PASS
Band2	5MHz	QPSK	18900	25RB#0	3000~20000	-39.89	PASS
Band2	5MHz	16QAM	18900	25RB#0	30~1000	-62.89	PASS
Band2	5MHz	16QAM	18900	25RB#0	1000~3000	-41.05	PASS
Band2	5MHz	16QAM	18900	25RB#0	3000~20000	-39.74	PASS
Band2	5MHz	QPSK	19175	1RB#0	30~1000	-62.53	PASS
Band2	5MHz	QPSK	19175	1RB#0	1000~3000	-47.80	PASS
Band2	5MHz	QPSK	19175	1RB#0	3000~20000	-39.30	PASS
Band2	5MHz	16QAM	19175	1RB#0	30~1000	-62.73	PASS
Band2	5MHz	16QAM	19175	1RB#0	1000~3000	-36.00	PASS
Band2	5MHz	16QAM	19175	1RB#0	3000~20000	-39.91	PASS
Band2	5MHz	QPSK	19175	1RB#24	30~1000	-62.69	PASS
Band2	5MHz	QPSK	19175	1RB#24	1000~3000	-45.74	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band2	5MHz	QPSK	19175	1RB#24	3000~20000	-40.04	PASS
Band2	5MHz	16QAM	19175	1RB#24	30~1000	-62.64	PASS
Band2	5MHz	16QAM	19175	1RB#24	1000~3000	-47.83	PASS
Band2	5MHz	16QAM	19175	1RB#24	3000~20000	-39.90	PASS
Band2	5MHz	QPSK	19175	25RB#0	30~1000	-62.57	PASS
Band2	5MHz	QPSK	19175	25RB#0	1000~3000	-37.47	PASS
Band2	5MHz	QPSK	19175	25RB#0	3000~20000	-39.64	PASS
Band2	5MHz	16QAM	19175	25RB#0	30~1000	-62.39	PASS
Band2	5MHz	16QAM	19175	25RB#0	1000~3000	-39.32	PASS
Band2	5MHz	16QAM	19175	25RB#0	3000~20000	-39.88	PASS
Band2	10MHz	QPSK	18650	1RB#0	30~1000	-62.47	PASS
Band2	10MHz	QPSK	18650	1RB#0	1000~3000	-47.91	PASS
Band2	10MHz	QPSK	18650	1RB#0	3000~20000	-39.70	PASS
Band2	10MHz	16QAM	18650	1RB#0	30~1000	-62.86	PASS
Band2	10MHz	16QAM	18650	1RB#0	1000~3000	-47.63	PASS
Band2	10MHz	16QAM	18650	1RB#0	3000~20000	-39.94	PASS
Band2	10MHz	QPSK	18650	1RB#49	30~1000	-62.38	PASS
Band2	10MHz	QPSK	18650	1RB#49	1000~3000	-41.06	PASS
Band2	10MHz	QPSK	18650	1RB#49	3000~20000	-39.82	PASS
Band2	10MHz	16QAM	18650	1RB#49	30~1000	-62.64	PASS
Band2	10MHz	16QAM	18650	1RB#49	1000~3000	-47.49	PASS
Band2	10MHz	16QAM	18650	1RB#49	3000~20000	-39.65	PASS
Band2	10MHz	QPSK	18650	50RB#0	30~1000	-62.73	PASS
Band2	10MHz	QPSK	18650	50RB#0	1000~3000	-41.57	PASS
Band2	10MHz	QPSK	18650	50RB#0	3000~20000	-39.93	PASS
Band2	10MHz	16QAM	18650	50RB#0	30~1000	-62.72	PASS
Band2	10MHz	16QAM	18650	50RB#0	1000~3000	-43.23	PASS
Band2	10MHz	16QAM	18650	50RB#0	3000~20000	-39.88	PASS
Band2	10MHz	QPSK	18900	1RB#0	30~1000	-62.68	PASS
Band2	10MHz	QPSK	18900	1RB#0	1000~3000	-47.37	PASS
Band2	10MHz	QPSK	18900	1RB#0	3000~20000	-39.88	PASS
Band2	10MHz	16QAM	18900	1RB#0	30~1000	-62.95	PASS
Band2	10MHz	16QAM	18900	1RB#0	1000~3000	-47.79	PASS
Band2	10MHz	16QAM	18900	1RB#0	3000~20000	-39.67	PASS
Band2	10MHz	QPSK	18900	1RB#49	30~1000	-62.47	PASS
Band2	10MHz	QPSK	18900	1RB#49	1000~3000	-48.01	PASS
Band2	10MHz	QPSK	18900	1RB#49	3000~20000	-39.43	PASS
Band2	10MHz	16QAM	18900	1RB#49	30~1000	-62.74	PASS
Band2	10MHz	16QAM	18900	1RB#49	1000~3000	-47.96	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band2	10MHz	16QAM	18900	1RB#49	3000~20000	-39.86	PASS
Band2	10MHz	QPSK	18900	50RB#0	30~1000	-62.71	PASS
Band2	10MHz	QPSK	18900	50RB#0	1000~3000	-41.41	PASS
Band2	10MHz	QPSK	18900	50RB#0	3000~20000	-40.07	PASS
Band2	10MHz	16QAM	18900	50RB#0	30~1000	-62.43	PASS
Band2	10MHz	16QAM	18900	50RB#0	1000~3000	-43.76	PASS
Band2	10MHz	16QAM	18900	50RB#0	3000~20000	-39.43	PASS
Band2	10MHz	QPSK	19150	1RB#0	30~1000	-62.80	PASS
Band2	10MHz	QPSK	19150	1RB#0	1000~3000	-48.01	PASS
Band2	10MHz	QPSK	19150	1RB#0	3000~20000	-39.63	PASS
Band2	10MHz	16QAM	19150	1RB#0	30~1000	-62.37	PASS
Band2	10MHz	16QAM	19150	1RB#0	1000~3000	-47.75	PASS
Band2	10MHz	16QAM	19150	1RB#0	3000~20000	-39.63	PASS
Band2	10MHz	QPSK	19150	1RB#49	30~1000	-62.61	PASS
Band2	10MHz	QPSK	19150	1RB#49	1000~3000	-47.86	PASS
Band2	10MHz	QPSK	19150	1RB#49	3000~20000	-39.43	PASS
Band2	10MHz	16QAM	19150	1RB#49	30~1000	-62.62	PASS
Band2	10MHz	16QAM	19150	1RB#49	1000~3000	-47.49	PASS
Band2	10MHz	16QAM	19150	1RB#49	3000~20000	-39.73	PASS
Band2	10MHz	QPSK	19150	50RB#0	30~1000	-62.61	PASS
Band2	10MHz	QPSK	19150	50RB#0	1000~3000	-39.25	PASS
Band2	10MHz	QPSK	19150	50RB#0	3000~20000	-39.78	PASS
Band2	10MHz	16QAM	19150	50RB#0	30~1000	-62.78	PASS
Band2	10MHz	16QAM	19150	50RB#0	1000~3000	-41.28	PASS
Band2	10MHz	16QAM	19150	50RB#0	3000~20000	-39.58	PASS
Band2	15MHz	QPSK	18675	1RB#0	30~1000	-63.00	PASS
Band2	15MHz	QPSK	18675	1RB#0	1000~3000	-47.73	PASS
Band2	15MHz	QPSK	18675	1RB#0	3000~20000	-40.04	PASS
Band2	15MHz	16QAM	18675	1RB#0	30~1000	-62.78	PASS
Band2	15MHz	16QAM	18675	1RB#0	1000~3000	-47.73	PASS
Band2	15MHz	16QAM	18675	1RB#0	3000~20000	-39.90	PASS
Band2	15MHz	QPSK	18675	1RB#74	30~1000	-62.64	PASS
Band2	15MHz	QPSK	18675	1RB#74	1000~3000	-47.63	PASS
Band2	15MHz	QPSK	18675	1RB#74	3000~20000	-40.11	PASS
Band2	15MHz	16QAM	18675	1RB#74	30~1000	-62.69	PASS
Band2	15MHz	16QAM	18675	1RB#74	1000~3000	-47.77	PASS
Band2	15MHz	16QAM	18675	1RB#74	3000~20000	-39.85	PASS
Band2	15MHz	QPSK	18675	75RB#0	30~1000	-62.89	PASS
Band2	15MHz	QPSK	18675	75RB#0	1000~3000	-40.66	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band2	15MHz	QPSK	18675	75RB#0	3000~20000	-39.73	PASS
Band2	15MHz	16QAM	18675	75RB#0	30~1000	-62.67	PASS
Band2	15MHz	16QAM	18675	75RB#0	1000~3000	-41.88	PASS
Band2	15MHz	16QAM	18675	75RB#0	3000~20000	-39.91	PASS
Band2	15MHz	QPSK	18900	1RB#0	30~1000	-62.63	PASS
Band2	15MHz	QPSK	18900	1RB#0	1000~3000	-47.88	PASS
Band2	15MHz	QPSK	18900	1RB#0	3000~20000	-39.77	PASS
Band2	15MHz	16QAM	18900	1RB#0	30~1000	-62.57	PASS
Band2	15MHz	16QAM	18900	1RB#0	1000~3000	-47.68	PASS
Band2	15MHz	16QAM	18900	1RB#0	3000~20000	-39.68	PASS
Band2	15MHz	QPSK	18900	1RB#74	30~1000	-62.63	PASS
Band2	15MHz	QPSK	18900	1RB#74	1000~3000	-47.79	PASS
Band2	15MHz	QPSK	18900	1RB#74	3000~20000	-39.89	PASS
Band2	15MHz	16QAM	18900	1RB#74	30~1000	-62.82	PASS
Band2	15MHz	16QAM	18900	1RB#74	1000~3000	-46.97	PASS
Band2	15MHz	16QAM	18900	1RB#74	3000~20000	-39.82	PASS
Band2	15MHz	QPSK	18900	75RB#0	30~1000	-62.73	PASS
Band2	15MHz	QPSK	18900	75RB#0	1000~3000	-44.01	PASS
Band2	15MHz	QPSK	18900	75RB#0	3000~20000	-39.84	PASS
Band2	15MHz	16QAM	18900	75RB#0	30~1000	-62.69	PASS
Band2	15MHz	16QAM	18900	75RB#0	1000~3000	-46.10	PASS
Band2	15MHz	16QAM	18900	75RB#0	3000~20000	-39.90	PASS
Band2	15MHz	QPSK	19125	1RB#0	30~1000	-62.36	PASS
Band2	15MHz	QPSK	19125	1RB#0	1000~3000	-47.12	PASS
Band2	15MHz	QPSK	19125	1RB#0	3000~20000	-39.96	PASS
Band2	15MHz	16QAM	19125	1RB#0	30~1000	-62.52	PASS
Band2	15MHz	16QAM	19125	1RB#0	1000~3000	-47.82	PASS
Band2	15MHz	16QAM	19125	1RB#0	3000~20000	-39.58	PASS
Band2	15MHz	QPSK	19125	1RB#74	30~1000	-62.49	PASS
Band2	15MHz	QPSK	19125	1RB#74	1000~3000	-47.86	PASS
Band2	15MHz	QPSK	19125	1RB#74	3000~20000	-39.89	PASS
Band2	15MHz	16QAM	19125	1RB#74	30~1000	-62.77	PASS
Band2	15MHz	16QAM	19125	1RB#74	1000~3000	-47.93	PASS
Band2	15MHz	16QAM	19125	1RB#74	3000~20000	-39.75	PASS
Band2	15MHz	QPSK	19125	75RB#0	30~1000	-62.63	PASS
Band2	15MHz	QPSK	19125	75RB#0	1000~3000	-39.99	PASS
Band2	15MHz	QPSK	19125	75RB#0	3000~20000	-39.77	PASS
Band2	15MHz	16QAM	19125	75RB#0	30~1000	-62.76	PASS
Band2	15MHz	16QAM	19125	75RB#0	1000~3000	-40.11	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band2	15MHz	16QAM	19125	75RB#0	3000~20000	-39.73	PASS
Band2	20MHz	QPSK	18700	1RB#0	30~1000	-62.55	PASS
Band2	20MHz	QPSK	18700	1RB#0	1000~3000	-47.86	PASS
Band2	20MHz	QPSK	18700	1RB#0	3000~20000	-39.71	PASS
Band2	20MHz	16QAM	18700	1RB#0	30~1000	-62.52	PASS
Band2	20MHz	16QAM	18700	1RB#0	1000~3000	-47.68	PASS
Band2	20MHz	16QAM	18700	1RB#0	3000~20000	-39.67	PASS
Band2	20MHz	QPSK	18700	1RB#99	30~1000	-62.76	PASS
Band2	20MHz	QPSK	18700	1RB#99	1000~3000	-47.44	PASS
Band2	20MHz	QPSK	18700	1RB#99	3000~20000	-39.87	PASS
Band2	20MHz	16QAM	18700	1RB#99	30~1000	-62.69	PASS
Band2	20MHz	16QAM	18700	1RB#99	1000~3000	-47.41	PASS
Band2	20MHz	16QAM	18700	1RB#99	3000~20000	-39.60	PASS
Band2	20MHz	QPSK	18700	100RB#0	30~1000	-62.76	PASS
Band2	20MHz	QPSK	18700	100RB#0	1000~3000	-45.29	PASS
Band2	20MHz	QPSK	18700	100RB#0	3000~20000	-40.09	PASS
Band2	20MHz	16QAM	18700	100RB#0	30~1000	-62.56	PASS
Band2	20MHz	16QAM	18700	100RB#0	1000~3000	-47.04	PASS
Band2	20MHz	16QAM	18700	100RB#0	3000~20000	-39.81	PASS
Band2	20MHz	QPSK	18900	1RB#0	30~1000	-62.54	PASS
Band2	20MHz	QPSK	18900	1RB#0	1000~3000	-47.99	PASS
Band2	20MHz	QPSK	18900	1RB#0	3000~20000	-39.64	PASS
Band2	20MHz	16QAM	18900	1RB#0	30~1000	-62.43	PASS
Band2	20MHz	16QAM	18900	1RB#0	1000~3000	-47.94	PASS
Band2	20MHz	16QAM	18900	1RB#0	3000~20000	-40.02	PASS
Band2	20MHz	QPSK	18900	1RB#99	30~1000	-62.23	PASS
Band2	20MHz	QPSK	18900	1RB#99	1000~3000	-47.93	PASS
Band2	20MHz	QPSK	18900	1RB#99	3000~20000	-39.82	PASS
Band2	20MHz	16QAM	18900	1RB#99	30~1000	-62.47	PASS
Band2	20MHz	16QAM	18900	1RB#99	1000~3000	-47.85	PASS
Band2	20MHz	16QAM	18900	1RB#99	3000~20000	-39.50	PASS
Band2	20MHz	QPSK	18900	100RB#0	30~1000	-62.84	PASS
Band2	20MHz	QPSK	18900	100RB#0	1000~3000	-47.87	PASS
Band2	20MHz	QPSK	18900	100RB#0	3000~20000	-39.77	PASS
Band2	20MHz	16QAM	18900	100RB#0	30~1000	-62.33	PASS
Band2	20MHz	16QAM	18900	100RB#0	1000~3000	-47.31	PASS
Band2	20MHz	16QAM	18900	100RB#0	3000~20000	-40.19	PASS
Band2	20MHz	QPSK	19100	1RB#0	30~1000	-62.69	PASS
Band2	20MHz	QPSK	19100	1RB#0	1000~3000	-47.89	PASS





Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band2	20MHz	QPSK	19100	1RB#0	3000~20000	-39.79	PASS
Band2	20MHz	16QAM	19100	1RB#0	30~1000	-62.90	PASS
Band2	20MHz	16QAM	19100	1RB#0	1000~3000	-47.99	PASS
Band2	20MHz	16QAM	19100	1RB#0	3000~20000	-40.03	PASS
Band2	20MHz	QPSK	19100	1RB#99	30~1000	-62.52	PASS
Band2	20MHz	QPSK	19100	1RB#99	1000~3000	-46.96	PASS
Band2	20MHz	QPSK	19100	1RB#99	3000~20000	-39.67	PASS
Band2	20MHz	16QAM	19100	1RB#99	30~1000	-62.72	PASS
Band2	20MHz	16QAM	19100	1RB#99	1000~3000	-47.73	PASS
Band2	20MHz	16QAM	19100	1RB#99	3000~20000	-40.14	PASS
Band2	20MHz	QPSK	19100	100RB#0	30~1000	-62.72	PASS
Band2	20MHz	QPSK	19100	100RB#0	1000~3000	-43.97	PASS
Band2	20MHz	QPSK	19100	100RB#0	3000~20000	-39.35	PASS
Band2	20MHz	16QAM	19100	100RB#0	30~1000	-62.44	PASS
Band2	20MHz	16QAM	19100	100RB#0	1000~3000	-44.73	PASS
Band2	20MHz	16QAM	19100	100RB#0	3000~20000	-39.53	PASS


Test Graphs

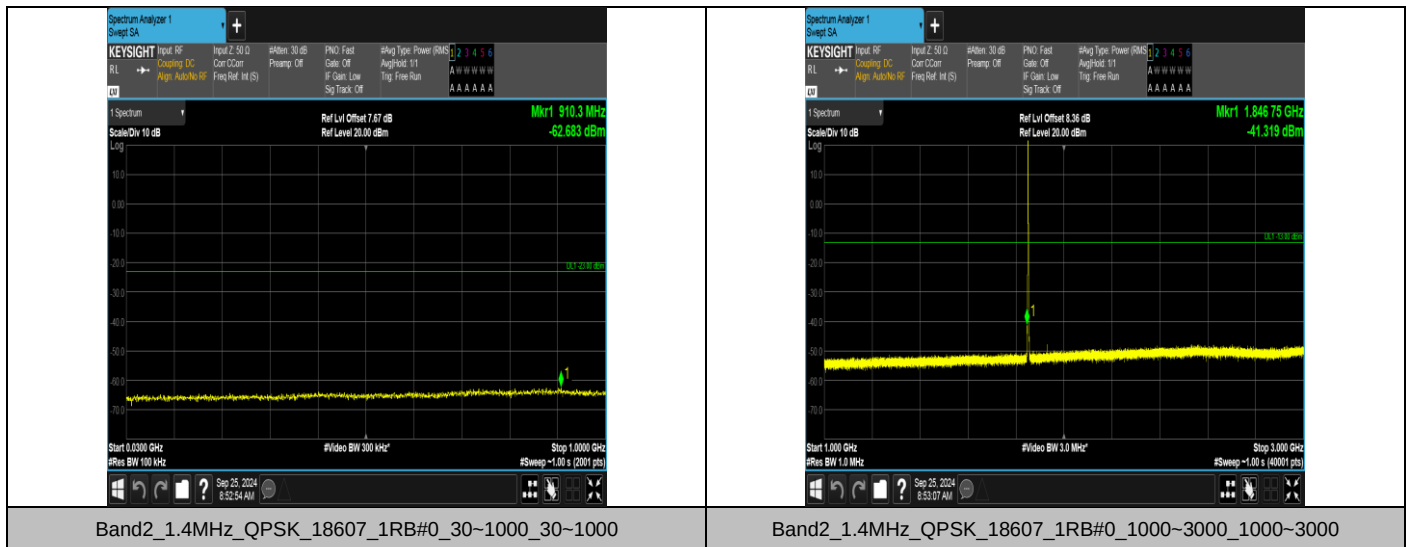

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

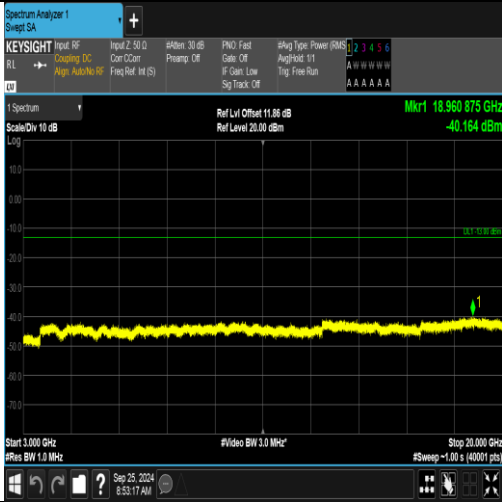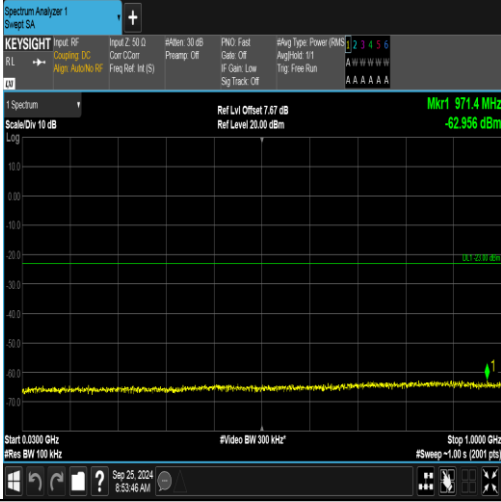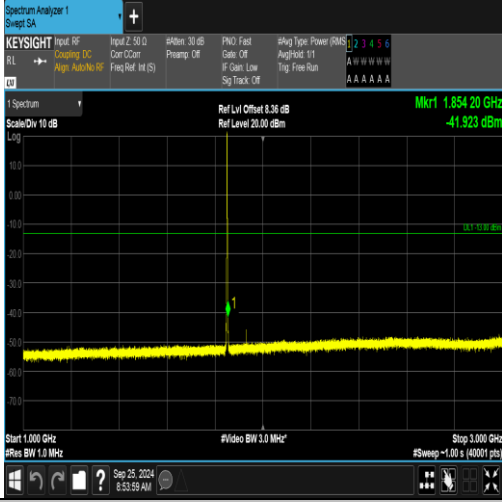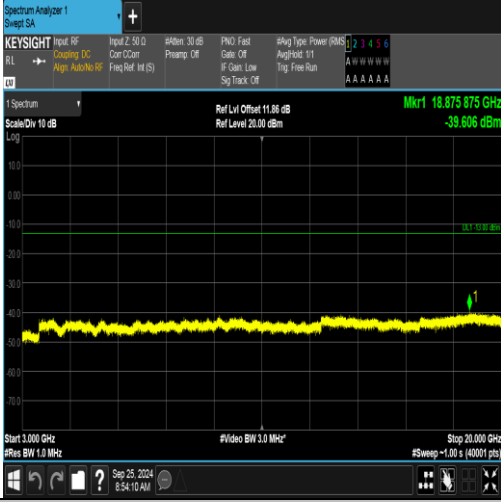	
Band2_1.4MHz_QPSK_18607_1RB#0_3000~20000_3000~20000	/
	
/	Band2_1.4MHz_16QAM_18607_1RB#0_30~1000_30~1000
	
Band2_1.4MHz_16QAM_18607_1RB#0_1000~3000_1000~3000	Band2_1.4MHz_16QAM_18607_1RB#0_3000~20000_3000~20000

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

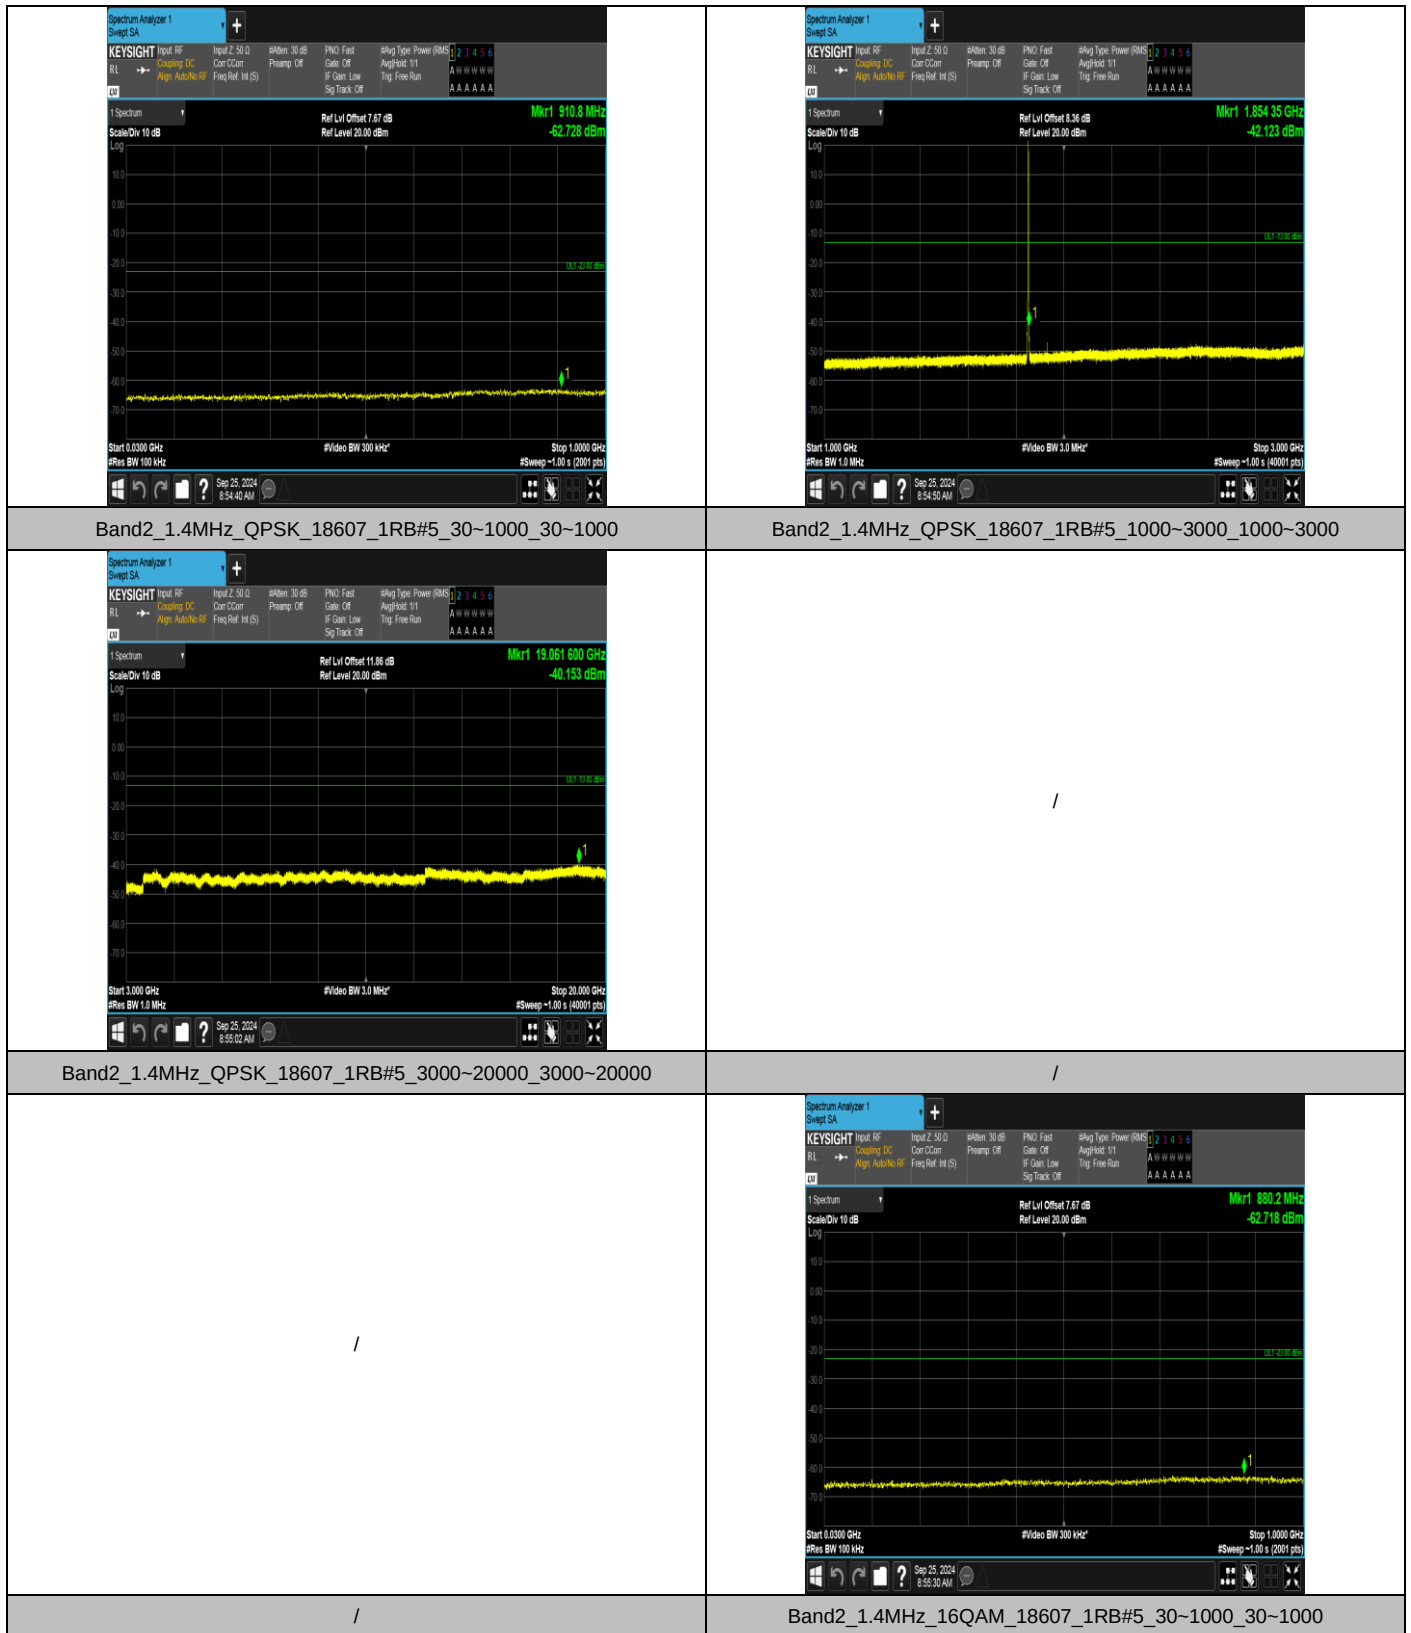

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.