



### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com



11AC80SISO\_Ant2\_5210



11AC80SISO\_Ant1\_5775




**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com

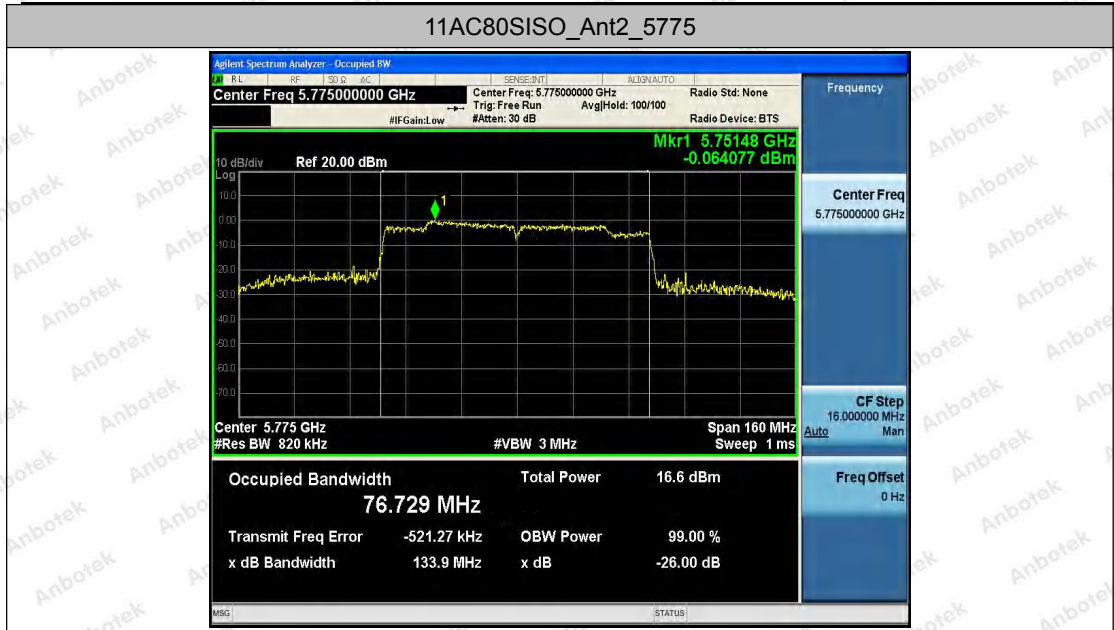

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com

## Appendix A3: Min emission bandwidth

### Test Result

| Test Mode      | Antenna | Channel | 6db EBW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|----------------|---------|---------|---------------|----------|----------|------------|---------|
| 11A            | Ant1    | 5745    | 13.240        | 5737.400 | 5750.640 | 0.5        | PASS    |
|                | Ant2    | 5745    | 13.560        | 5737.080 | 5750.640 | 0.5        | PASS    |
|                | Ant1    | 5785    | 15.840        | 5776.680 | 5792.520 | 0.5        | PASS    |
|                | Ant2    | 5785    | 16.360        | 5776.800 | 5793.160 | 0.5        | PASS    |
|                | Ant1    | 5825    | 15.360        | 5817.400 | 5832.760 | 0.5        | PASS    |
|                | Ant2    | 5825    | 15.080        | 5817.480 | 5832.560 | 0.5        | PASS    |
| 11N20SIS<br>O  | Ant1    | 5745    | 16.120        | 5736.400 | 5752.520 | 0.5        | PASS    |
|                | Ant2    | 5745    | 15.760        | 5736.800 | 5752.560 | 0.5        | PASS    |
|                | Ant1    | 5785    | 15.440        | 5777.080 | 5792.520 | 0.5        | PASS    |
|                | Ant2    | 5785    | 13.240        | 5777.400 | 5790.640 | 0.5        | PASS    |
|                | Ant1    | 5825    | 15.920        | 5817.480 | 5833.400 | 0.5        | PASS    |
|                | Ant2    | 5825    | 16.840        | 5816.520 | 5833.360 | 0.5        | PASS    |
| 11N40SIS<br>O  | Ant1    | 5755    | 33.920        | 5737.400 | 5771.320 | 0.5        | PASS    |
|                | Ant2    | 5755    | 33.920        | 5737.400 | 5771.320 | 0.5        | PASS    |
|                | Ant1    | 5795    | 35.120        | 5777.480 | 5812.600 | 0.5        | PASS    |
|                | Ant2    | 5795    | 35.280        | 5777.320 | 5812.600 | 0.5        | PASS    |
| 11AC20SI<br>SO | Ant1    | 5745    | 16.360        | 5736.160 | 5752.520 | 0.5        | PASS    |
|                | Ant2    | 5745    | 15.040        | 5737.480 | 5752.520 | 0.5        | PASS    |
|                | Ant1    | 5785    | 15.360        | 5777.480 | 5792.840 | 0.5        | PASS    |
|                | Ant2    | 5785    | 15.120        | 5777.360 | 5792.480 | 0.5        | PASS    |
|                | Ant1    | 5825    | 15.360        | 5817.160 | 5832.520 | 0.5        | PASS    |
|                | Ant2    | 5825    | 16.640        | 5816.760 | 5833.400 | 0.5        | PASS    |
| 11AC40SI<br>SO | Ant1    | 5755    | 35.280        | 5737.320 | 5772.600 | 0.5        | PASS    |
|                | Ant2    | 5755    | 32.720        | 5737.320 | 5770.040 | 0.5        | PASS    |
|                | Ant1    | 5795    | 31.520        | 5778.600 | 5810.120 | 0.5        | PASS    |
|                | Ant2    | 5795    | 35.200        | 5777.320 | 5812.520 | 0.5        | PASS    |
| 11AC80SI<br>SO | Ant1    | 5775    | 75.360        | 5737.240 | 5812.600 | 0.5        | PASS    |
|                | Ant2    | 5775    | 75.360        | 5737.240 | 5812.600 | 0.5        | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

## Test Graphs





11A\_Ant2\_5785




11A\_Ant1\_5825



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com

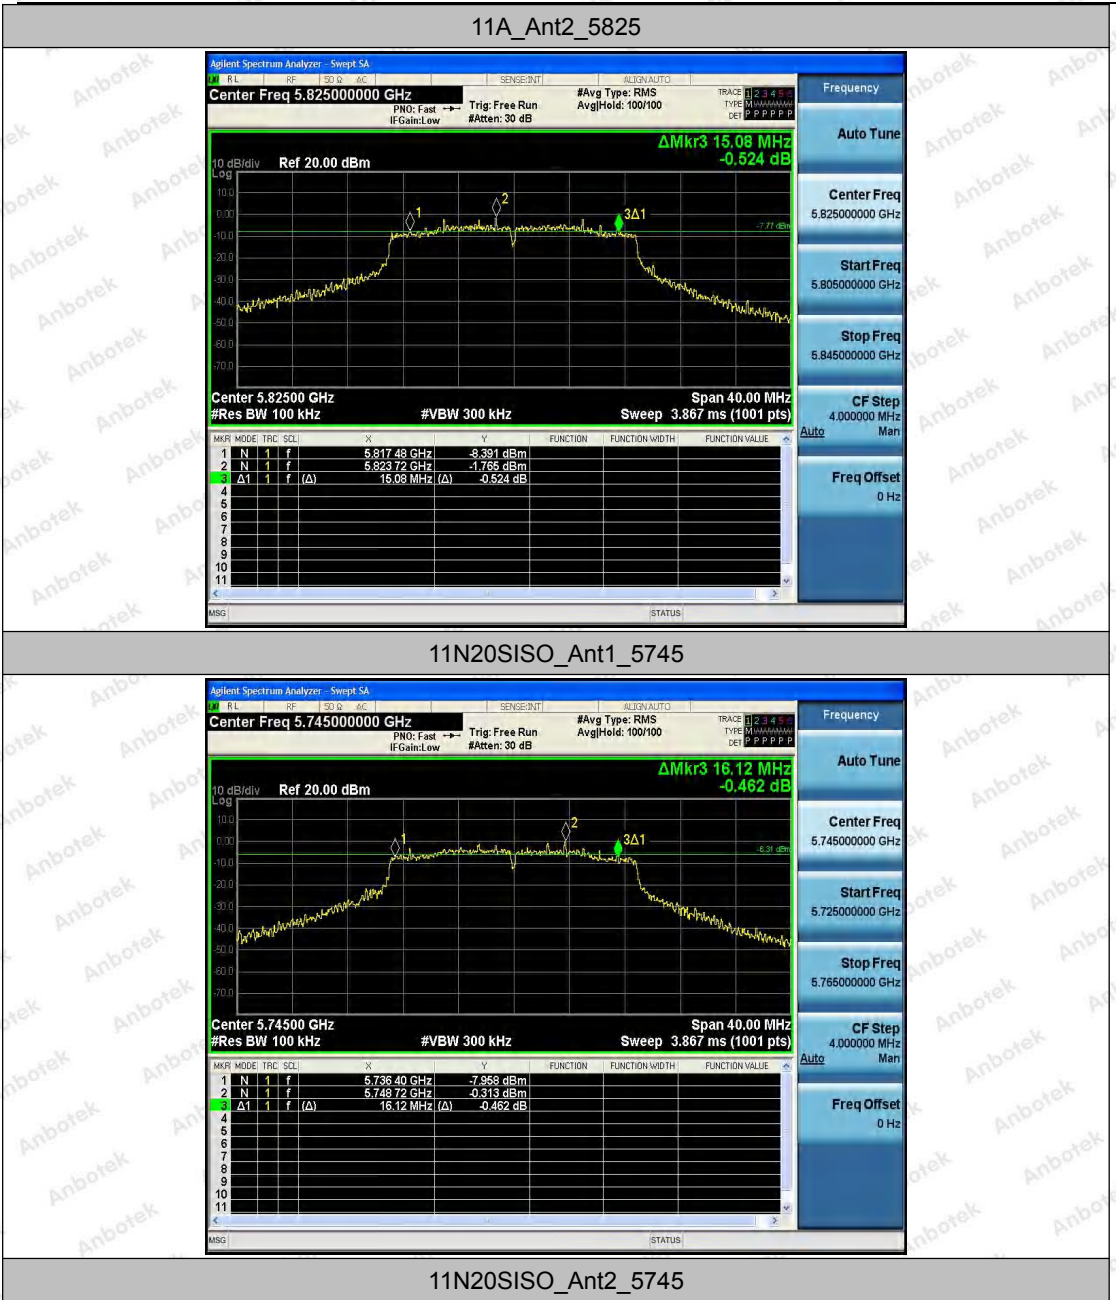

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline  
 400-003-0500  
[www.anbotek.com](http://www.anbotek.com)



11N20SISO\_Ant1\_5785



11N20SISO\_Ant2\_5785

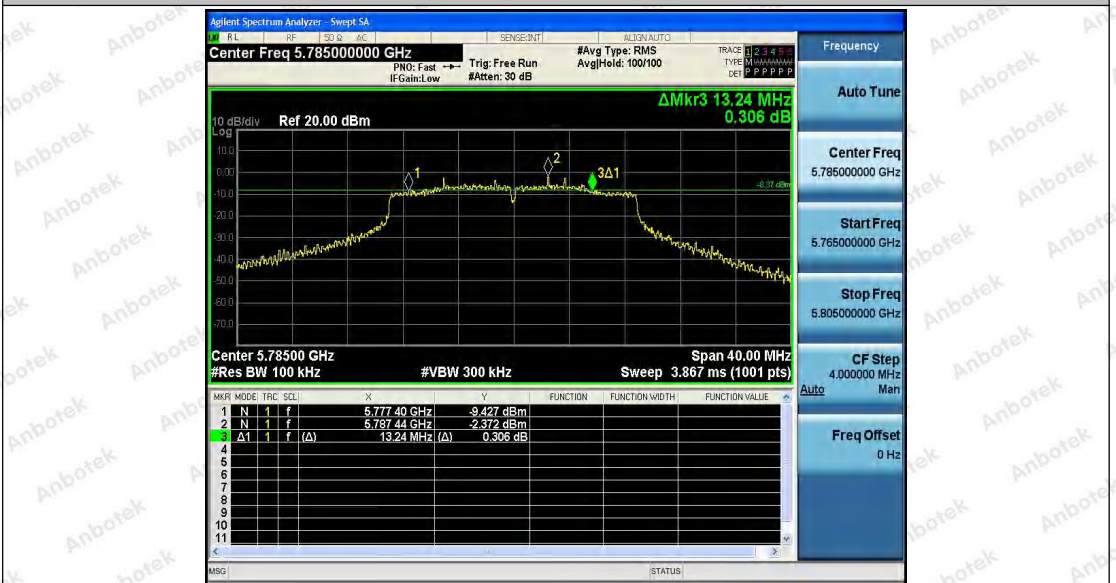


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com



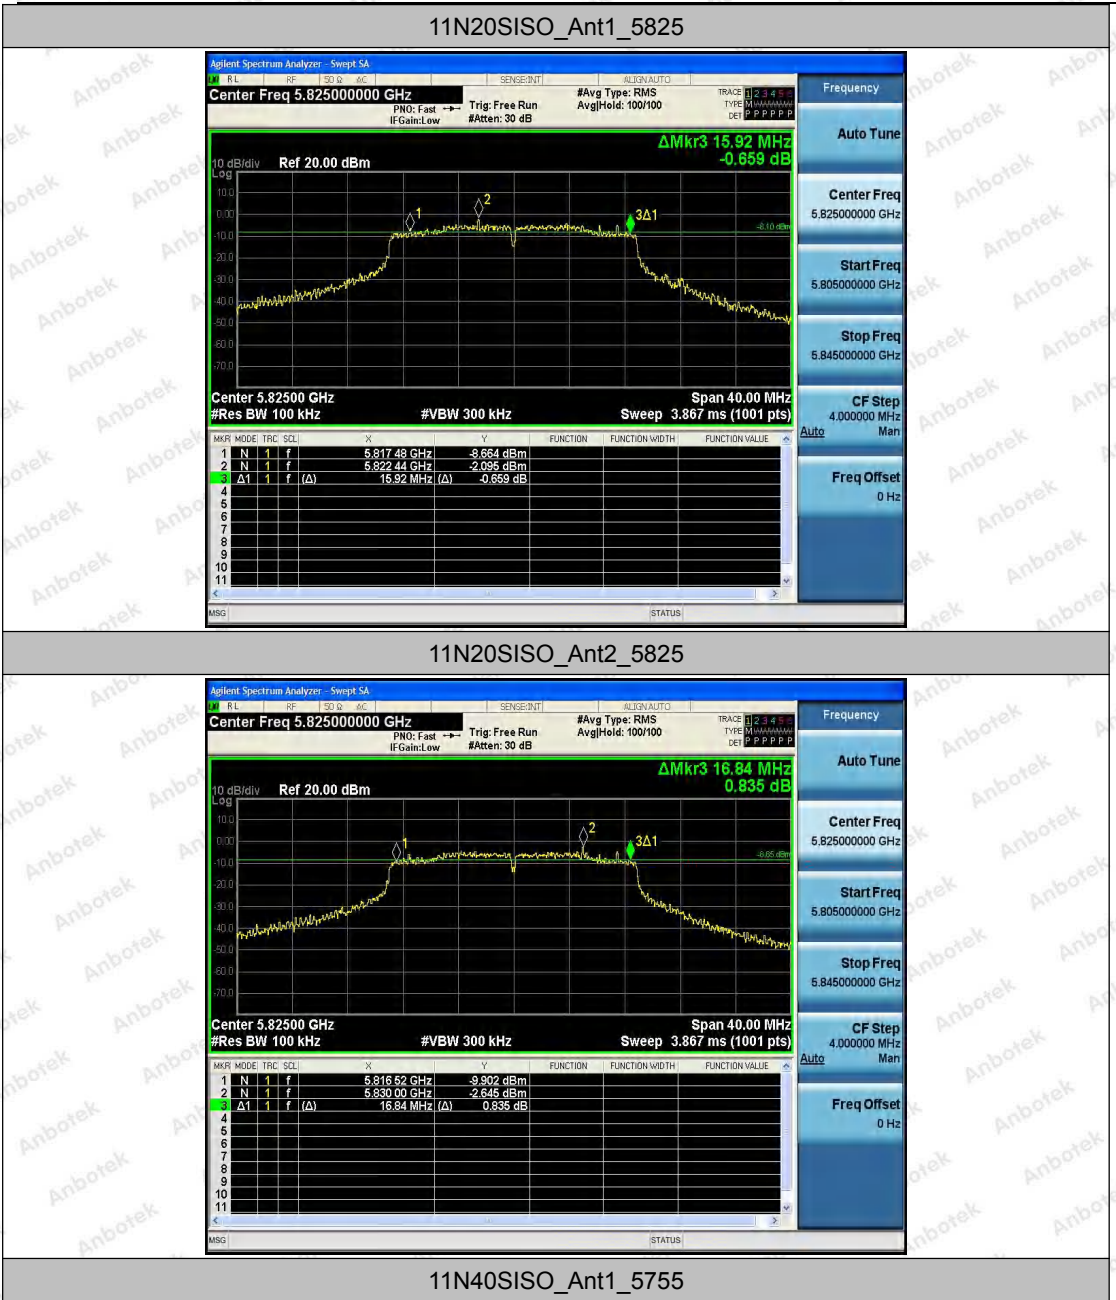

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline 400-003-0500  
 www.anbotek.com



11N40SISO\_Ant2\_5755



11N40SISO\_Ant1\_5795

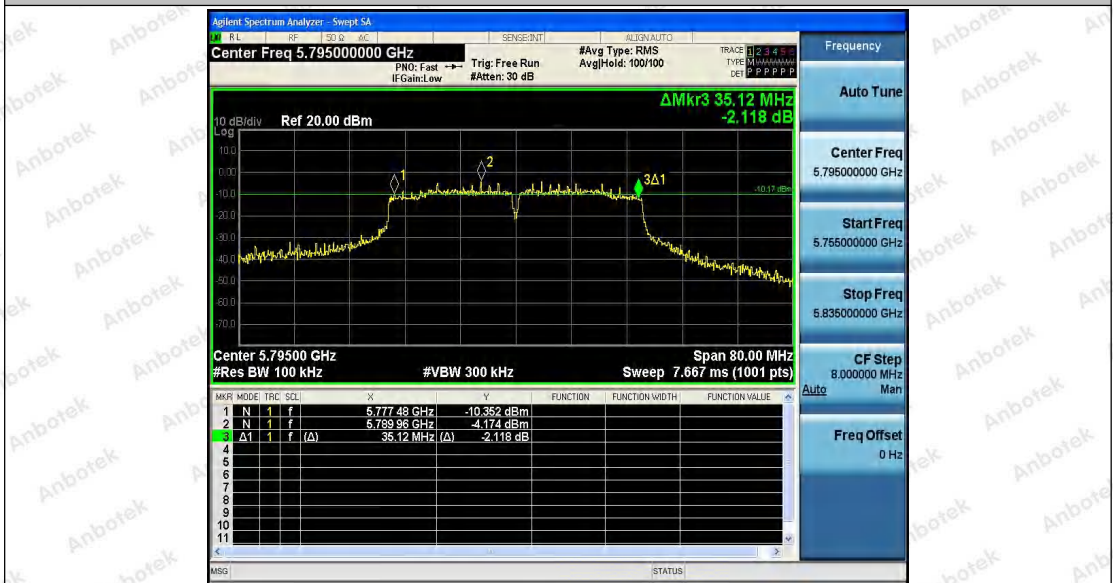

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline  
 400-003-0500  
 www.anbotek.com



11AC20SISO\_Ant1\_5785



11AC20SISO\_Ant2\_5785

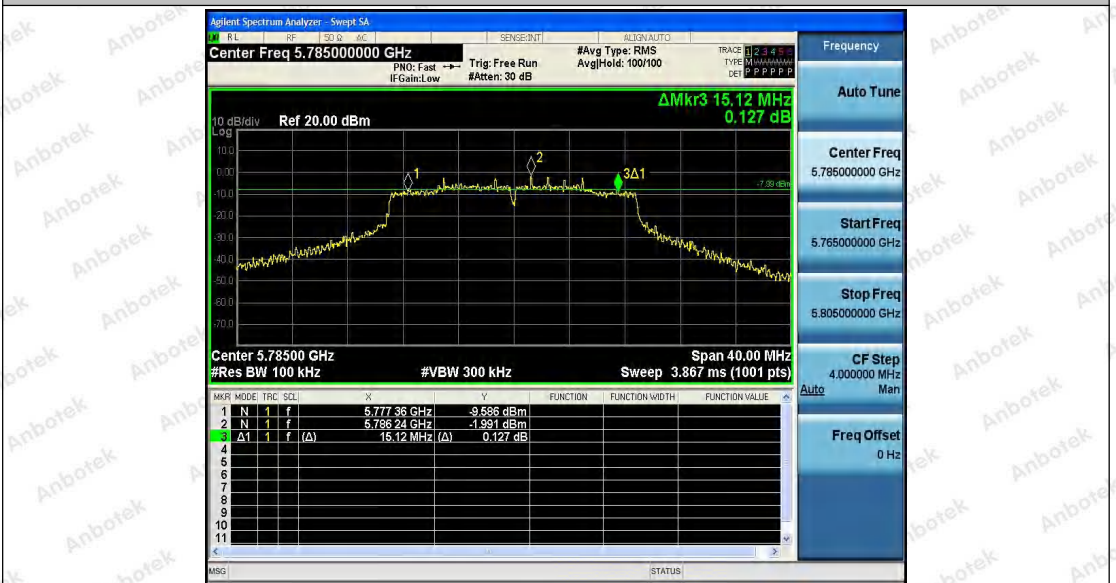

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com




**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline  
 400-003-0500  
 www.anbotek.com

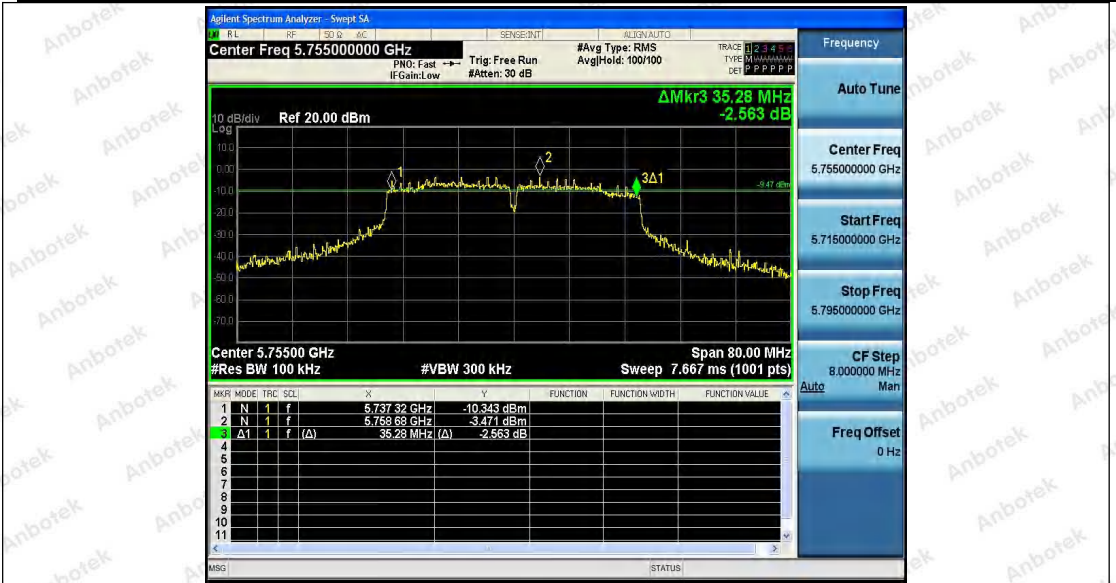

11AC40SISO\_Ant2\_5755




11AC40SISO\_Ant1\_5795

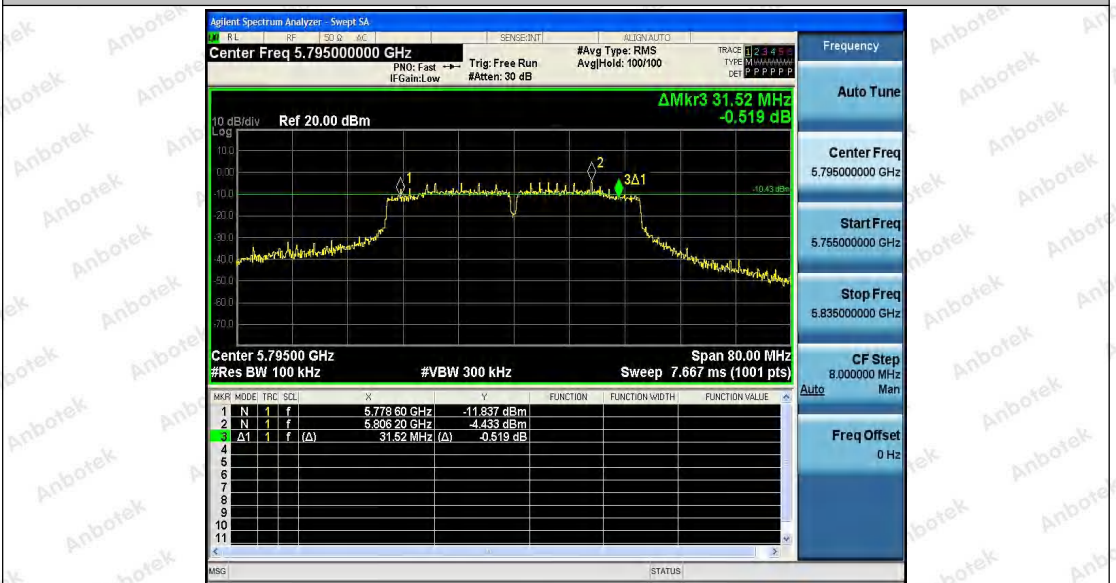

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com

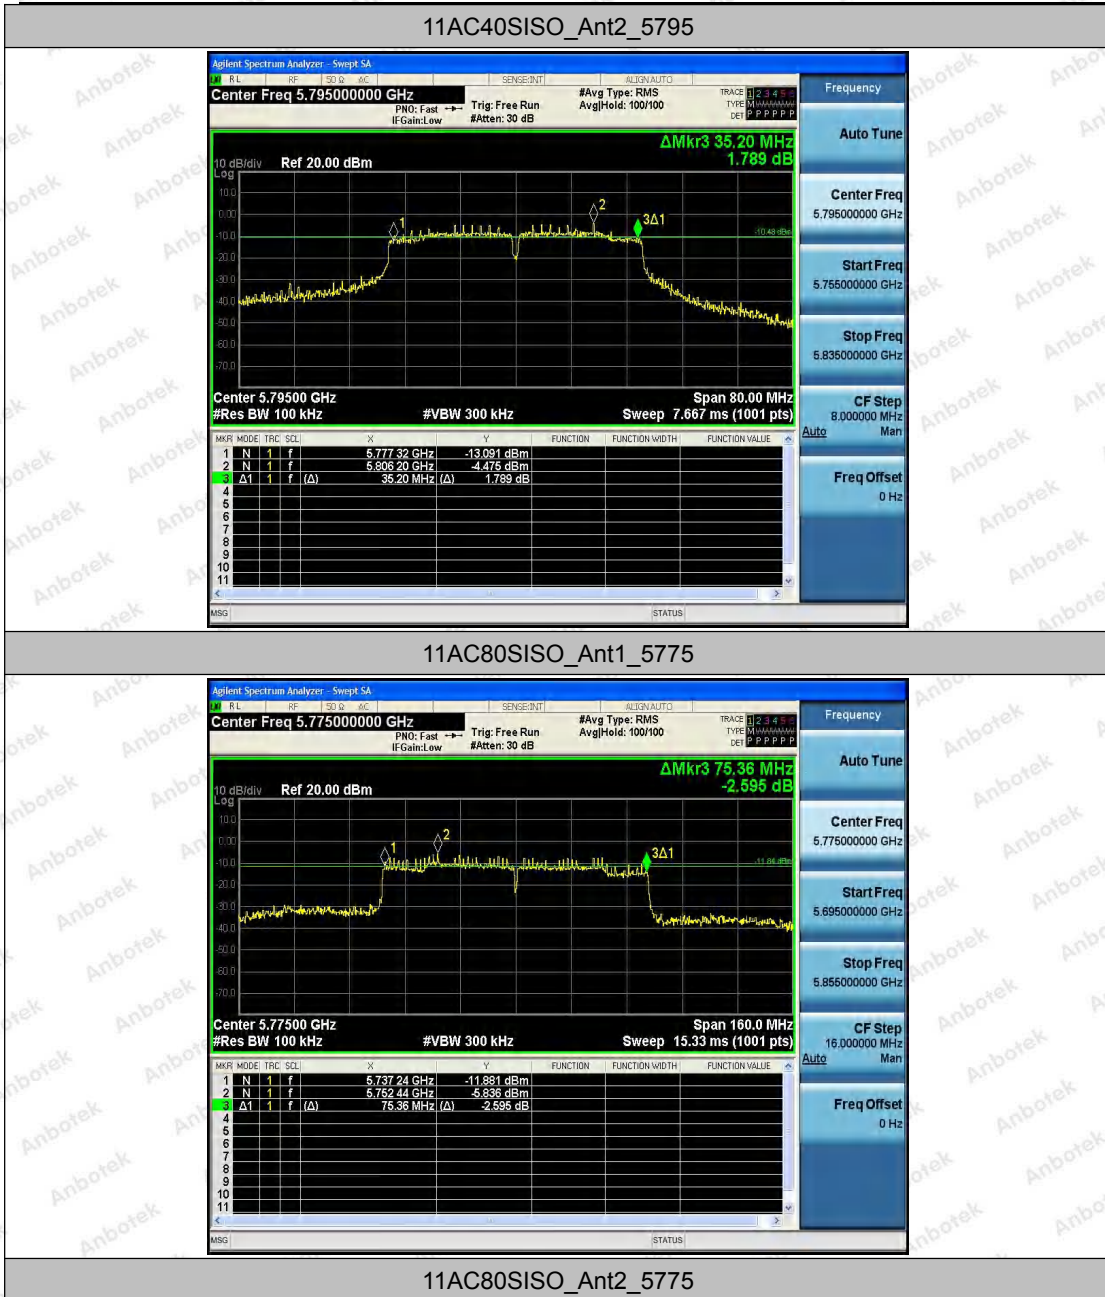


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com

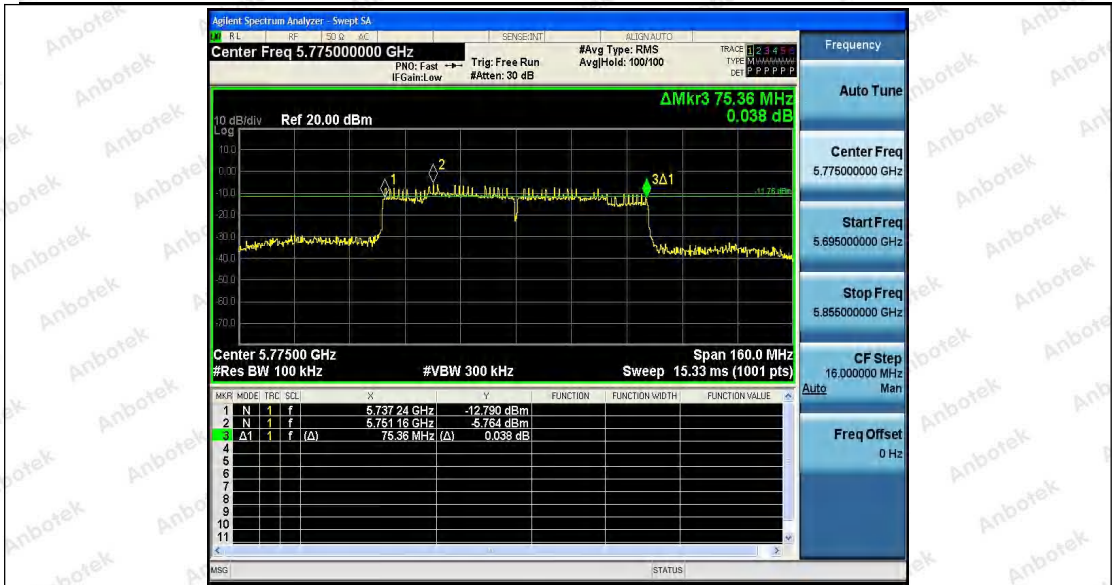

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com



## Appendix B: Maximum conducted output power

### Test Result

| Test Mode  | Antenna | Channel | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|---------|-------------|------------|---------|
| 11A        | Ant1    | 5180    | 13.25       | ≤23.98     | PASS    |
|            | Ant2    | 5180    | 14.36       | ≤23.98     | PASS    |
|            | Ant1    | 5200    | 13.81       | ≤23.98     | PASS    |
|            | Ant2    | 5200    | 14.52       | ≤23.98     | PASS    |
|            | Ant1    | 5240    | 13.84       | ≤23.98     | PASS    |
|            | Ant2    | 5240    | 14.50       | ≤23.98     | PASS    |
|            | Ant1    | 5745    | 15.29       | ≤30        | PASS    |
|            | Ant2    | 5745    | 15.22       | ≤30        | PASS    |
|            | Ant1    | 5785    | 12.89       | ≤30        | PASS    |
|            | Ant2    | 5785    | 13.11       | ≤30        | PASS    |
|            | Ant1    | 5825    | 13.83       | ≤30        | PASS    |
|            | Ant2    | 5825    | 13.78       | ≤30        | PASS    |
| 11N20SISO  | Ant1    | 5180    | 13.11       | ≤23.98     | PASS    |
|            | Ant2    | 5180    | 14.21       | ≤23.98     | PASS    |
|            | Ant1    | 5200    | 13.76       | ≤23.98     | PASS    |
|            | Ant2    | 5200    | 14.49       | ≤23.98     | PASS    |
|            | Ant1    | 5240    | 13.77       | ≤23.98     | PASS    |
|            | Ant2    | 5240    | 14.44       | ≤23.98     | PASS    |
|            | Ant1    | 5745    | 15.26       | ≤30        | PASS    |
|            | Ant2    | 5745    | 15.25       | ≤30        | PASS    |
|            | Ant1    | 5785    | 12.79       | ≤30        | PASS    |
|            | Ant2    | 5785    | 13.09       | ≤30        | PASS    |
|            | Ant1    | 5825    | 13.85       | ≤30        | PASS    |
|            | Ant2    | 5825    | 13.79       | ≤30        | PASS    |
| 11N40SISO  | Ant1    | 5190    | 13.19       | ≤23.98     | PASS    |
|            | Ant2    | 5190    | 16.20       | ≤23.98     | PASS    |
|            | Ant1    | 5230    | 15.90       | ≤23.98     | PASS    |
|            | Ant2    | 5230    | 15.30       | ≤23.98     | PASS    |
|            | Ant1    | 5755    | 15.45       | ≤30        | PASS    |
|            | Ant2    | 5755    | 15.42       | ≤30        | PASS    |
|            | Ant1    | 5795    | 14.21       | ≤30        | PASS    |
|            | Ant2    | 5795    | 14.11       | ≤30        | PASS    |
| 11AC20SISO | Ant1    | 5180    | 14.34       | ≤23.98     | PASS    |
|            | Ant2    | 5180    | 14.83       | ≤23.98     | PASS    |
|            | Ant1    | 5200    | 14.60       | ≤23.98     | PASS    |
|            | Ant2    | 5200    | 14.87       | ≤23.98     | PASS    |
|            | Ant1    | 5240    | 14.52       | ≤23.98     | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com

|            |      |      |       |        |      |
|------------|------|------|-------|--------|------|
|            | Ant2 | 5240 | 13.95 | ≤23.98 | PASS |
|            | Ant1 | 5745 | 15.25 | ≤30    | PASS |
|            | Ant2 | 5745 | 15.23 | ≤30    | PASS |
|            | Ant1 | 5785 | 12.84 | ≤30    | PASS |
|            | Ant2 | 5785 | 13.08 | ≤30    | PASS |
|            | Ant1 | 5825 | 13.92 | ≤30    | PASS |
|            | Ant2 | 5825 | 13.72 | ≤30    | PASS |
| 11AC40SISO | Ant1 | 5190 | 13.18 | ≤23.98 | PASS |
|            | Ant2 | 5190 | 16.36 | ≤23.98 | PASS |
|            | Ant1 | 5230 | 15.45 | ≤23.98 | PASS |
|            | Ant2 | 5230 | 15.32 | ≤23.98 | PASS |
|            | Ant1 | 5755 | 17.98 | ≤30    | PASS |
|            | Ant2 | 5755 | 12.80 | ≤30    | PASS |
|            | Ant1 | 5795 | 14.17 | ≤30    | PASS |
| 11AC80SISO | Ant2 | 5795 | 14.14 | ≤30    | PASS |
|            | Ant1 | 5210 | 13.72 | ≤23.98 | PASS |
|            | Ant2 | 5210 | 13.80 | ≤23.98 | PASS |
|            | Ant1 | 5775 | 14.82 | ≤30    | PASS |
|            | Ant2 | 5775 | 14.82 | ≤30    | PASS |

Note: The Duty Cycle Factor is compensated in the graph.

## MIMO:

### 5.2G:

| Test Mode  | Channel | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|-------------|------------|---------|
| 11N20SISO  | 5180    | 16.71       | ≤23.98     | PASS    |
|            | 5200    | 17.15       | ≤23.98     | PASS    |
|            | 5240    | 17.13       | ≤23.98     | PASS    |
| 11N40SISO  | 5190    | 17.96       | ≤23.98     | PASS    |
|            | 5230    | 18.62       | ≤23.98     | PASS    |
| 11AC20SISO | 5180    | 17.60       | ≤23.98     | PASS    |
|            | 5200    | 17.75       | ≤23.98     | PASS    |
|            | 5240    | 17.25       | ≤23.98     | PASS    |
| 11AC40SISO | 5190    | 18.07       | ≤23.98     | PASS    |
|            | 5230    | 18.40       | ≤23.98     | PASS    |
| 11AC80SISO | 5210    | 16.77       | ≤23.98     | PASS    |

## 5.8G:

| Test Mode  | Channel | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|-------------|------------|---------|
| 11N20SISO  | 5745    | 18.27       | ≤30        | PASS    |
|            | 5785    | 15.95       | ≤30        | PASS    |
|            | 5825    | 16.83       | ≤30        | PASS    |
| 11N40SISO  | 5755    | 18.45       | ≤30        | PASS    |
|            | 5795    | 17.17       | ≤30        | PASS    |
| 11AC20SISO | 5745    | 18.25       | ≤30        | PASS    |
|            | 5785    | 15.97       | ≤30        | PASS    |
|            | 5825    | 16.83       | ≤30        | PASS    |
| 11AC40SISO | 5755    | 19.13       | ≤30        | PASS    |
|            | 5795    | 17.17       | ≤30        | PASS    |
| 11AC80SISO | 5775    | 17.83       | ≤30        | PASS    |

## Appendix C: Maximum power spectral density

### Test Result

| Test Mode  | Antenna | Channel | Result [dBm/MHz] | Limit[dBm/MHz] | Verdict |
|------------|---------|---------|------------------|----------------|---------|
| 11A        | Ant1    | 5180    | 2.77             | ≤11            | PASS    |
|            | Ant2    | 5180    | 3.34             | ≤11            | PASS    |
|            | Ant1    | 5200    | 3.17             | ≤11            | PASS    |
|            | Ant2    | 5200    | 3.9              | ≤11            | PASS    |
|            | Ant1    | 5240    | 2.95             | ≤11            | PASS    |
|            | Ant2    | 5240    | 3.89             | ≤11            | PASS    |
| 11N20SISO  | Ant1    | 5180    | 2.22             | ≤11            | PASS    |
|            | Ant2    | 5180    | 3.29             | ≤11            | PASS    |
|            | Ant1    | 5200    | 3.13             | ≤11            | PASS    |
|            | Ant2    | 5200    | 3.33             | ≤11            | PASS    |
|            | Ant1    | 5240    | 2.93             | ≤11            | PASS    |
|            | Ant2    | 5240    | 3.53             | ≤11            | PASS    |
| 11N40SISO  | Ant1    | 5190    | -0.67            | ≤11            | PASS    |
|            | Ant2    | 5190    | 1.99             | ≤11            | PASS    |
|            | Ant1    | 5230    | 1.73             | ≤11            | PASS    |
|            | Ant2    | 5230    | 4.12             | ≤11            | PASS    |
| 11AC20SISO | Ant1    | 5180    | 3.45             | ≤11            | PASS    |
|            | Ant2    | 5180    | 6.59             | ≤11            | PASS    |
|            | Ant1    | 5200    | 3.78             | ≤11            | PASS    |
|            | Ant2    | 5200    | 6.59             | ≤11            | PASS    |
|            | Ant1    | 5240    | 3.62             | ≤11            | PASS    |
|            | Ant2    | 5240    | 5.88             | ≤11            | PASS    |
| 11AC40SISO | Ant1    | 5190    | -0.63            | ≤11            | PASS    |
|            | Ant2    | 5190    | 2.98             | ≤11            | PASS    |
|            | Ant1    | 5230    | 0.93             | ≤11            | PASS    |
|            | Ant2    | 5230    | 3.86             | ≤11            | PASS    |
| 11AC80SISO | Ant1    | 5210    | -3.64            | ≤11            | PASS    |
|            | Ant2    | 5210    | -0.45            | ≤11            | PASS    |

### 5.8G

| Test Mode | Antenna | Channel | Result [dBm/500 kHz] | Limit[dBm/500 kHz] | Verdict |
|-----------|---------|---------|----------------------|--------------------|---------|
| 11A       | Ant1    | 5745    | 3.24                 | ≤30                | PASS    |
|           | Ant2    | 5745    | 4.34                 | ≤30                | PASS    |
|           | Ant1    | 5785    | 0.66                 | ≤30                | PASS    |
|           | Ant2    | 5785    | 1                    | ≤30                | PASS    |
|           | Ant1    | 5825    | 1.86                 | ≤30                | PASS    |
|           | Ant2    | 5825    | 1.27                 | ≤30                | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com

|            |      |      |       |     |      |
|------------|------|------|-------|-----|------|
| 11N20SISO  | Ant1 | 5745 | 3.7   | ≤30 | PASS |
|            | Ant2 | 5745 | 3.17  | ≤30 | PASS |
|            | Ant1 | 5785 | 0.66  | ≤30 | PASS |
|            | Ant2 | 5785 | 1.04  | ≤30 | PASS |
|            | Ant1 | 5825 | 2.43  | ≤30 | PASS |
|            | Ant2 | 5825 | 1.73  | ≤30 | PASS |
| 11N40SISO  | Ant1 | 5755 | 0.43  | ≤30 | PASS |
|            | Ant2 | 5755 | -0.15 | ≤30 | PASS |
|            | Ant1 | 5795 | -0.88 | ≤30 | PASS |
|            | Ant2 | 5795 | -1.56 | ≤30 | PASS |
| 11AC20SISO | Ant1 | 5745 | 2.99  | ≤30 | PASS |
|            | Ant2 | 5745 | 3.16  | ≤30 | PASS |
|            | Ant1 | 5785 | 0.6   | ≤30 | PASS |
|            | Ant2 | 5785 | 1.1   | ≤30 | PASS |
|            | Ant1 | 5825 | 1.73  | ≤30 | PASS |
|            | Ant2 | 5825 | 2.07  | ≤30 | PASS |
| 11AC40SISO | Ant1 | 5755 | -0.02 | ≤30 | PASS |
|            | Ant2 | 5755 | 0.48  | ≤30 | PASS |
|            | Ant1 | 5795 | -1.11 | ≤30 | PASS |
|            | Ant2 | 5795 | -0.76 | ≤30 | PASS |
| 11AC80SISO | Ant1 | 5775 | -3.19 | ≤30 | PASS |
|            | Ant2 | 5775 | -3.74 | ≤30 | PASS |

**MIMO:**

**5.2G:**


| Test Mode  | Channel | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|-------------|------------|---------|
| 11N20SISO  | 5180    | 5.80        | ≤11        | PASS    |
|            | 5200    | 6.24        | ≤11        | PASS    |
|            | 5240    | 6.25        | ≤11        | PASS    |
| 11N40SISO  | 5190    | 3.87        | ≤11        | PASS    |
|            | 5230    | 6.10        | ≤11        | PASS    |
| 11AC20SISO | 5180    | 8.31        | ≤11        | PASS    |
|            | 5200    | 8.42        | ≤11        | PASS    |
|            | 5240    | 7.91        | ≤11        | PASS    |
| 11AC40SISO | 5190    | 4.55        | ≤11        | PASS    |
|            | 5230    | 5.65        | ≤11        | PASS    |
| 11AC80SISO | 5210    | 1.25        | ≤11        | PASS    |

## 5.8G:

| Test Mode  | Channel | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|-------------|------------|---------|
| 11N20SISO  | 5745    | 6.45        | ≤30        | PASS    |
|            | 5785    | 3.86        | ≤30        | PASS    |
|            | 5825    | 5.10        | ≤30        | PASS    |
| 11N40SISO  | 5755    | 3.16        | ≤30        | PASS    |
|            | 5795    | 1.80        | ≤30        | PASS    |
| 11AC20SISO | 5745    | 6.09        | ≤30        | PASS    |
|            | 5785    | 3.87        | ≤30        | PASS    |
|            | 5825    | 4.91        | ≤30        | PASS    |
| 11AC40SISO | 5755    | 3.25        | ≤30        | PASS    |
|            | 5795    | 2.08        | ≤30        | PASS    |
| 11AC80SISO | 5775    | -0.45       | ≤30        | PASS    |

Note: 1.The Result and Limit Unit is dBm/500 kHz in the band 5.725–5.85 GHz.  
 2.The Duty Cycle Factor and RBW Factor is compensated in the graph.

## Test Graphs

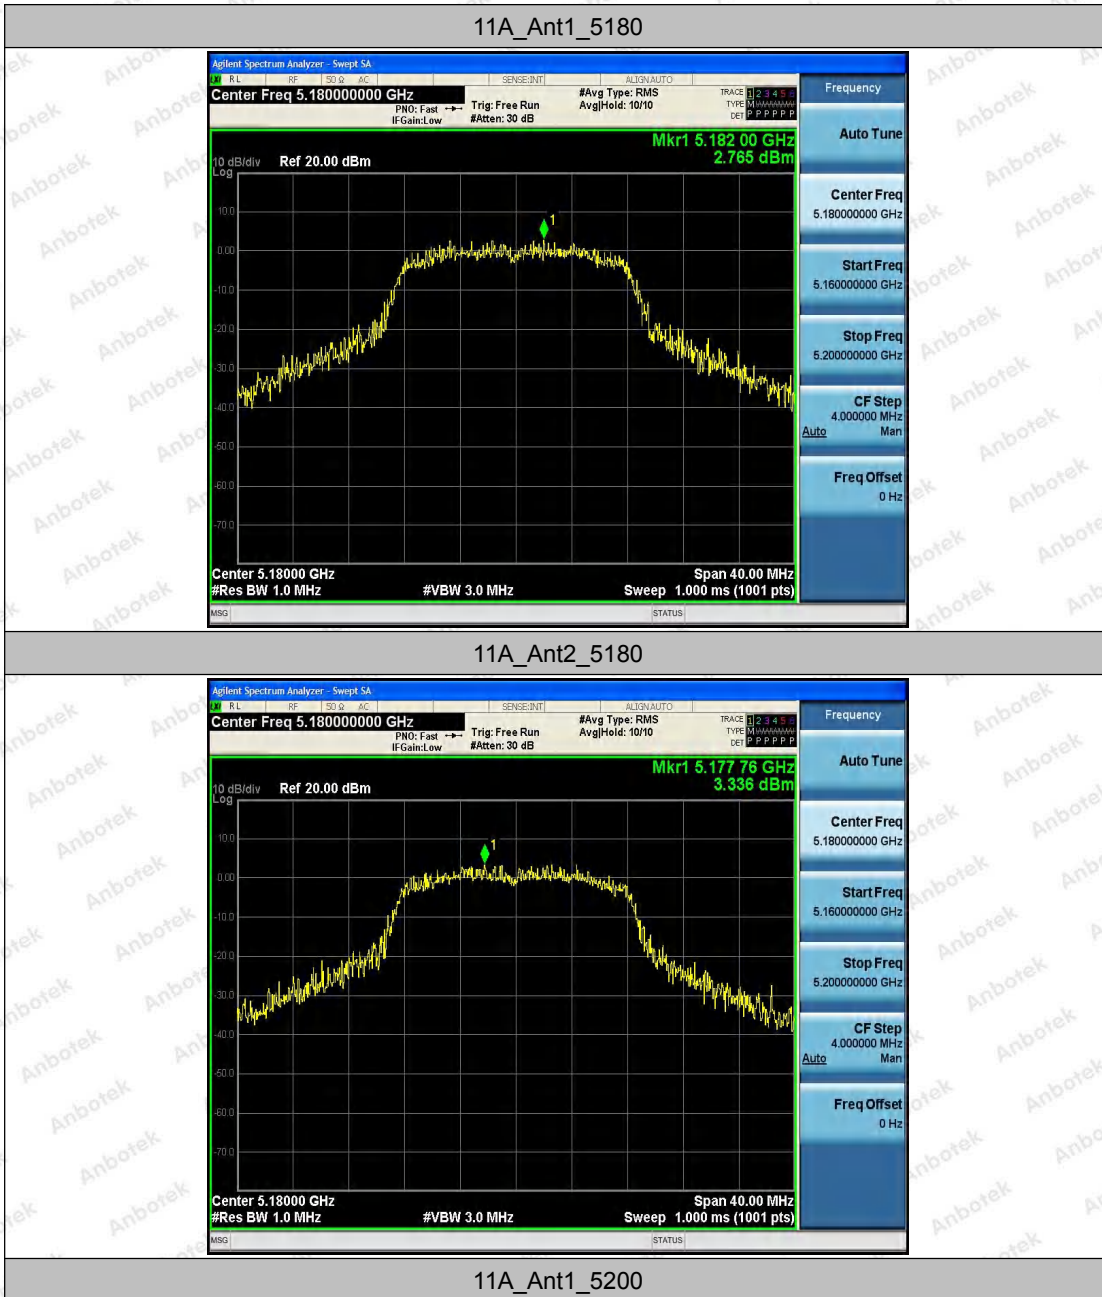


### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



11A\_Ant2\_5200

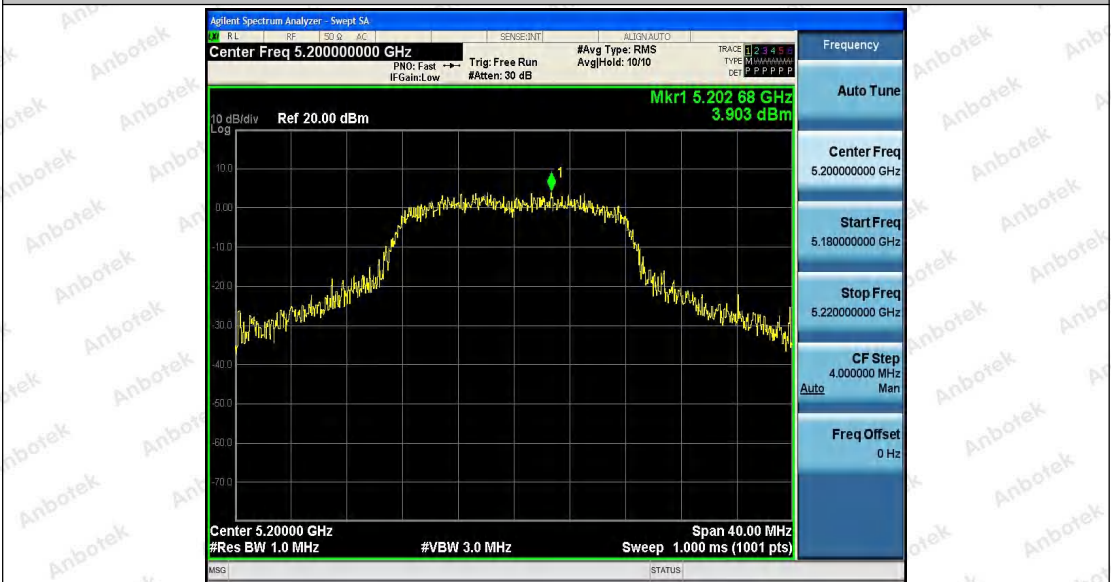

11A\_Ant1\_5240




**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



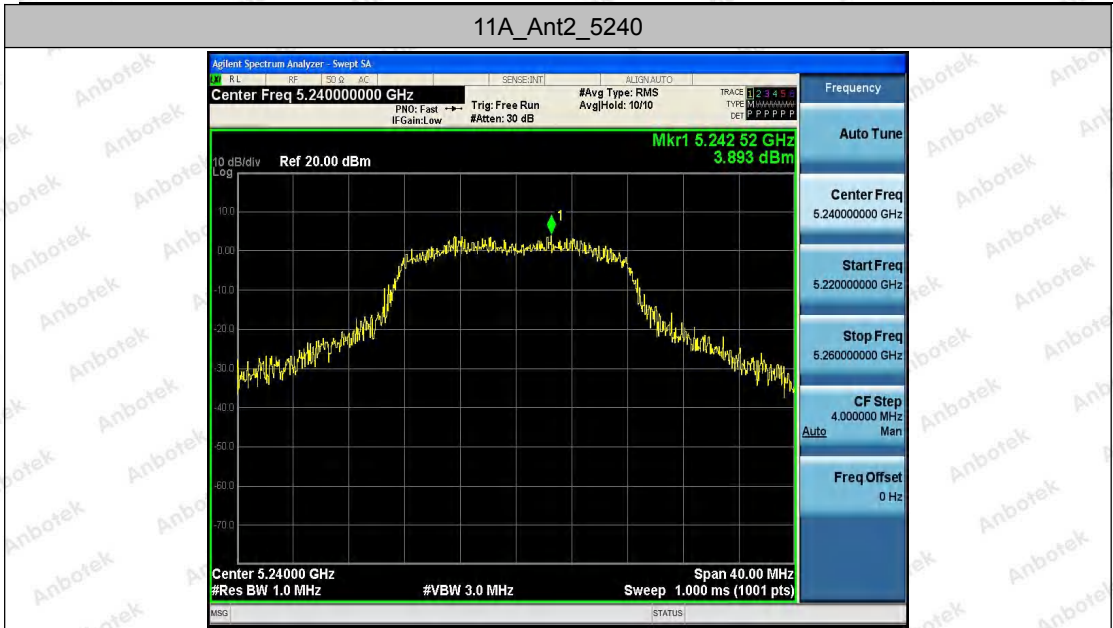

**11A\_Ant2\_5745**

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
[www.anbotek.com](http://www.anbotek.com)



**11N20SISO\_Ant1\_5180**

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



11N20SISO\_Ant2\_5180




11N20SISO\_Ant1\_5200



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com

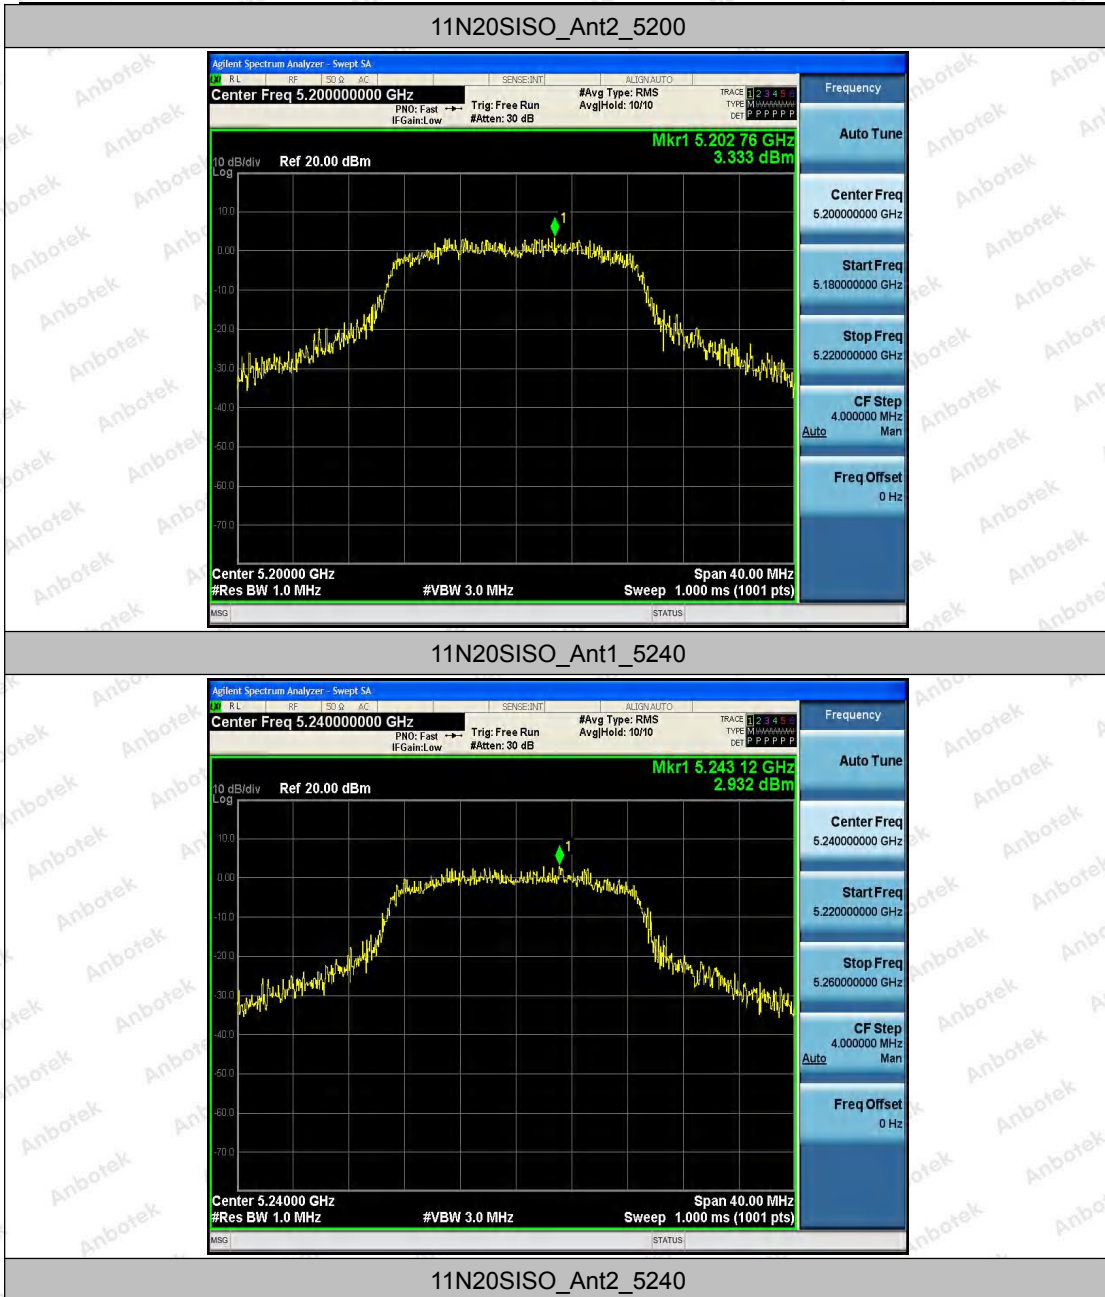


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



11N20SISO\_Ant1\_5745

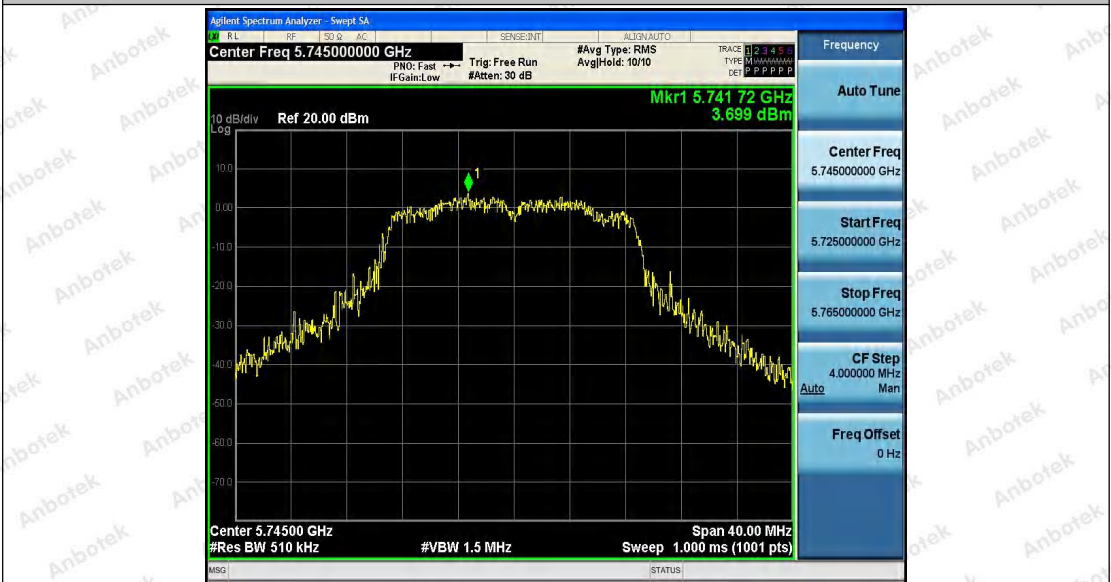

11N20SISO\_Ant2\_5745



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



11N20SISO\_Ant2\_5825



11N40SISO\_Ant1\_5190



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com





**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



11N40SISO\_Ant1\_5755



11N40SISO\_Ant2\_5755



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com




**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com

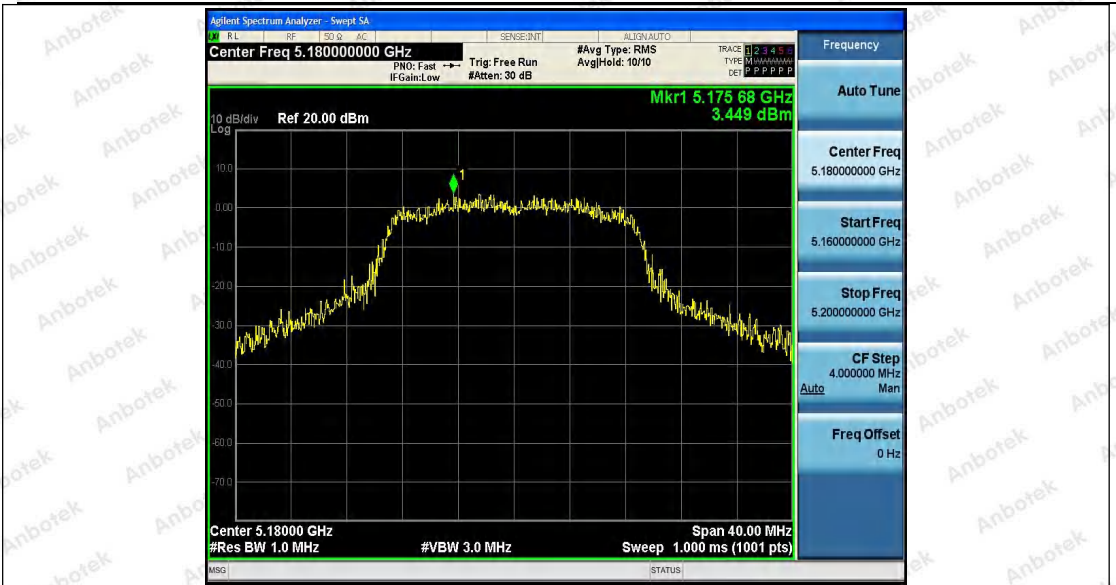

11AC20SISO\_Ant2\_5180

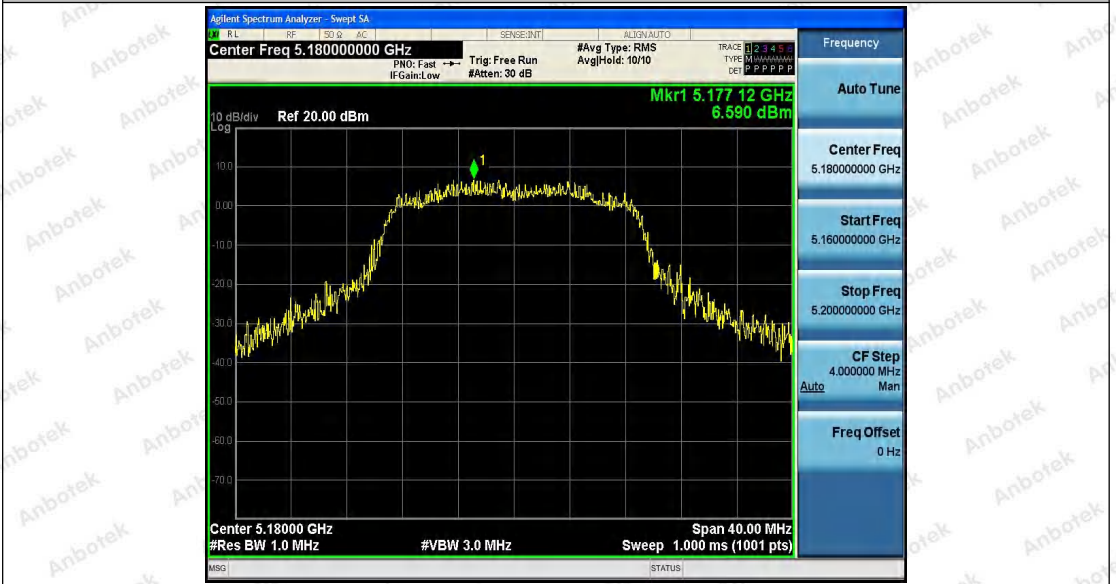


11AC20SISO\_Ant1\_5200



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com

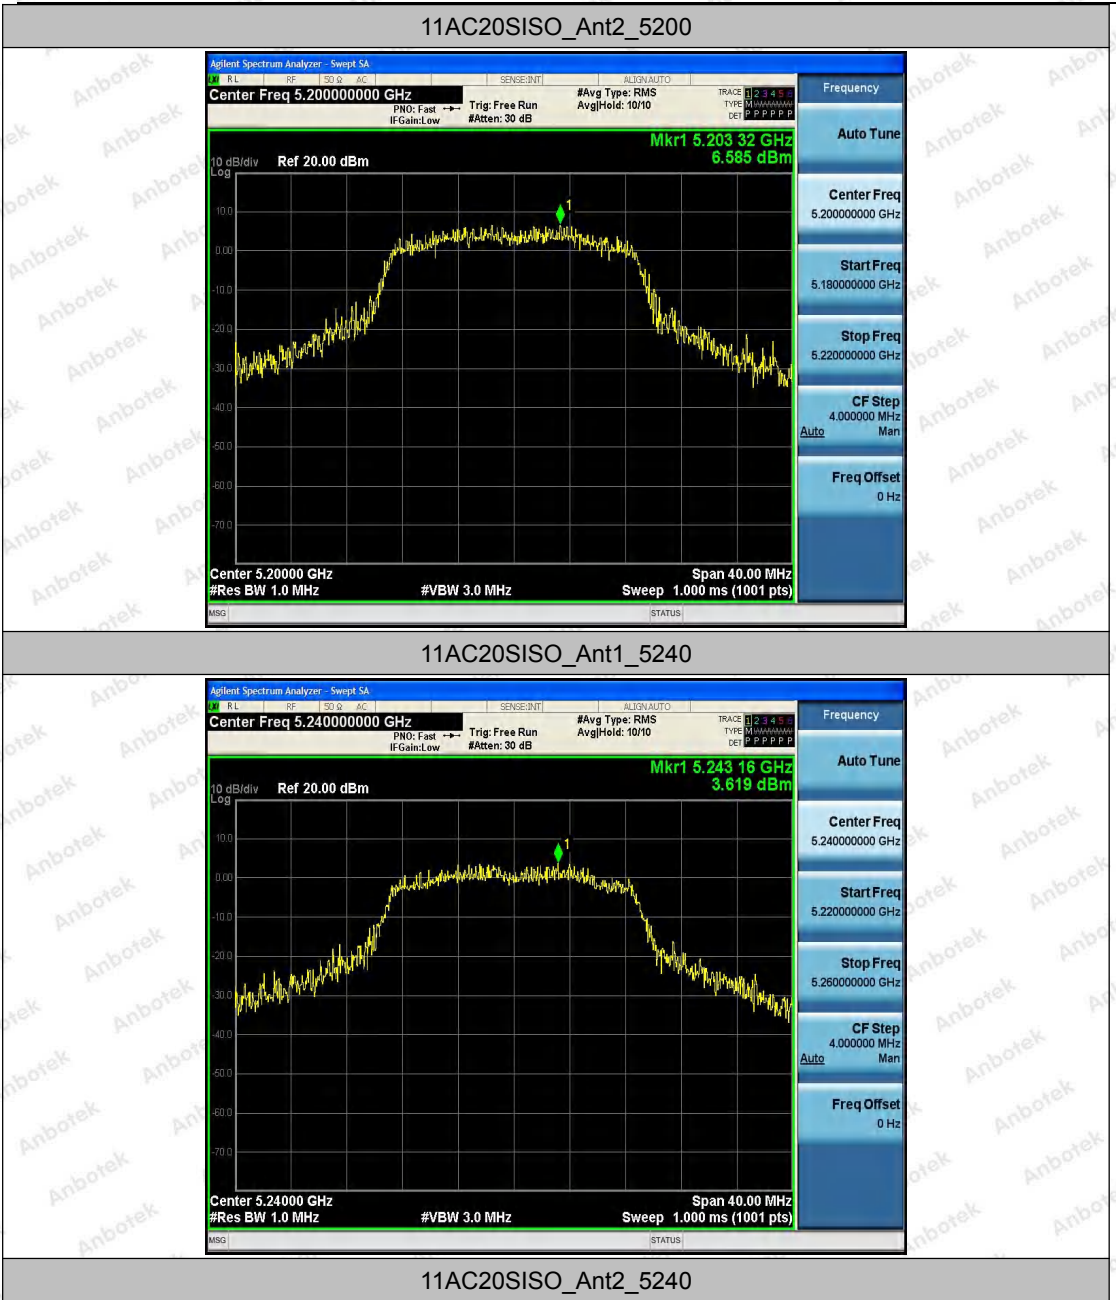

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



11AC20SISO\_Ant1\_5745



11AC20SISO\_Ant2\_5745



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline  
 400-003-0500  
 www.anbotek.com



11AC20SISO\_Ant2\_5825



11AC40SISO\_Ant1\_5190

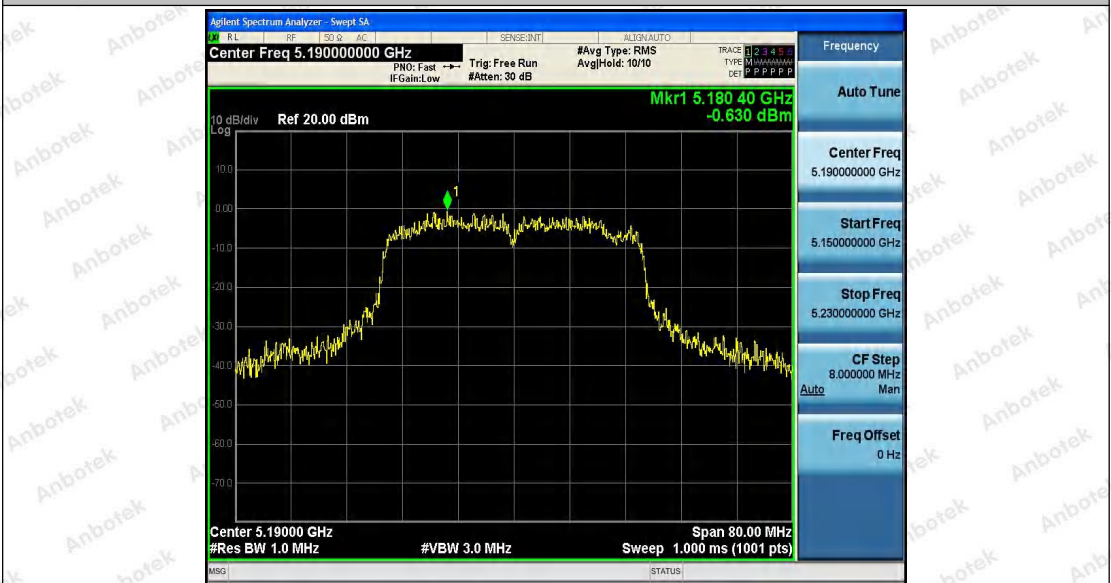

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com





**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
 400-003-0500  
 www.anbotek.com



11AC40SISO\_Ant1\_5755



11AC40SISO\_Ant2\_5755



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com



### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com



11AC80SISO\_Ant2\_5210



11AC80SISO\_Ant1\_5775



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com



### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

 Hotline  
400-003-0500  
www.anbotek.com

## Appendix D: Band edge measurements

### Test Result

| Test Mode  | Antenna | Ch Name | Channel | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|---------|---------|-------------|------------|---------|
| 11A        | Ant1    | Low     | 5180    | -40.52      | ≤-27       | PASS    |
|            | Ant2    | Low     | 5180    | -39         | ≤-27       | PASS    |
|            | Ant1    | High    | 5240    | -43.53      | ≤-27       | PASS    |
|            | Ant2    | High    | 5240    | -43.67      | ≤-27       | PASS    |
| 11N20SISO  | Ant1    | Low     | 5180    | -39.88      | ≤-27       | PASS    |
|            | Ant2    | Low     | 5180    | -38.21      | ≤-27       | PASS    |
|            | Ant1    | High    | 5240    | -44.13      | ≤-27       | PASS    |
|            | Ant2    | High    | 5240    | -43.41      | ≤-27       | PASS    |
| 11N40SISO  | Ant1    | Low     | 5190    | -35.04      | ≤-27       | PASS    |
|            | Ant2    | Low     | 5190    | -37.67      | ≤-27       | PASS    |
|            | Ant1    | High    | 5230    | -43         | ≤-27       | PASS    |
|            | Ant2    | High    | 5230    | -42.81      | ≤-27       | PASS    |
| 11AC20SISO | Ant1    | Low     | 5180    | -39.16      | ≤-27       | PASS    |
|            | Ant2    | Low     | 5180    | -38.25      | ≤-27       | PASS    |
|            | Ant1    | High    | 5240    | -43.96      | ≤-27       | PASS    |
|            | Ant2    | High    | 5240    | -42.94      | ≤-27       | PASS    |
| 11AC40SISO | Ant1    | Low     | 5190    | -35.25      | ≤-27       | PASS    |
|            | Ant2    | Low     | 5190    | -35.22      | ≤-27       | PASS    |
|            | Ant1    | High    | 5230    | -44.49      | ≤-27       | PASS    |
|            | Ant2    | High    | 5230    | -43.08      | ≤-27       | PASS    |
| 11AC80SISO | Ant1    | Low     | 5210    | -30.83      | ≤-27       | PASS    |
|            | Ant2    | Low     | 5210    | -29.2       | ≤-27       | PASS    |
|            | Ant1    | High    | 5210    | -44.02      | ≤-27       | PASS    |
|            | Ant2    | High    | 5210    | -41.96      | ≤-27       | PASS    |

| Test Mode | Antenna | Ch Name | Channel   | Freq Range [MHz] | Result [dBm] | Limit [dBm] | Verdict |
|-----------|---------|---------|-----------|------------------|--------------|-------------|---------|
| 11A       | Ant1    | Low     | 5745      | 5650~5700        | -41.24       | ≤8.95       | PASS    |
|           |         |         |           | 5700~5720        | -37.73       | ≤15.42      | PASS    |
|           |         |         |           | 5720~5725        | -30.54       | ≤24.01      | PASS    |
|           |         |         |           | 5755~5650        | -41.61       | ≤-27        | PASS    |
|           | Ant2    | Low     | 5745      | 5650~5700        | -42.32       | ≤-24.08     | PASS    |
|           |         |         |           | 5700~5720        | -38.69       | ≤15.37      | PASS    |
|           |         |         |           | 5720~5725        | -31.22       | ≤25.07      | PASS    |
|           |         |         |           | 5755~5650        | -41.86       | ≤-27        | PASS    |
| Ant1      | High    | 5825    | 5850~5855 | -40.96           | ≤18.22       | PASS        |         |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

 Hotline  
 400-003-0500  
[www.anbotek.com](http://www.anbotek.com)

|                |      |      |      |           |        |         |      |
|----------------|------|------|------|-----------|--------|---------|------|
|                |      |      |      | 5855~5875 | -41.74 | ≤10.56  | PASS |
|                |      |      |      | 5875~5925 | -41.58 | ≤4.64   | PASS |
|                |      |      |      | 5925~5950 | -42.14 | ≤-27    | PASS |
|                | Ant2 | High | 5825 | 5850~5855 | -41.15 | ≤23.69  | PASS |
|                |      |      |      | 5855~5875 | -42.09 | ≤11.15  | PASS |
|                |      |      |      | 5875~5925 | -42.93 | ≤5.86   | PASS |
|                |      |      |      | 5925~5950 | -40.55 | ≤-27    | PASS |
| 11N20SI<br>SO  | Ant1 | Low  | 5745 | 5650~5700 | -41.99 | ≤5.28   | PASS |
|                |      |      |      | 5700~5720 | -38.04 | ≤15.07  | PASS |
|                |      |      |      | 5720~5725 | -28.54 | ≤25.43  | PASS |
|                |      |      |      | 5755~5650 | -41.89 | ≤-27    | PASS |
|                | Ant2 | Low  | 5745 | 5650~5700 | -41.83 | ≤4.36   | PASS |
|                |      |      |      | 5700~5720 | -37.42 | ≤15.50  | PASS |
|                |      |      |      | 5720~5725 | -31.85 | ≤25.78  | PASS |
|                |      |      |      | 5755~5650 | -42.48 | ≤-27    | PASS |
|                | Ant1 | High | 5825 | 5850~5855 | -39.85 | ≤17.54  | PASS |
|                |      |      |      | 5855~5875 | -42.83 | ≤11.69  | PASS |
|                |      |      |      | 5875~5925 | -42.67 | ≤7.74   | PASS |
|                |      |      |      | 5925~5950 | -41.87 | ≤-27    | PASS |
|                | Ant2 | High | 5825 | 5850~5855 | -41.21 | ≤17.20  | PASS |
|                |      |      |      | 5855~5875 | -41.6  | ≤10.39  | PASS |
|                |      |      |      | 5875~5925 | -42.52 | ≤8.30   | PASS |
|                |      |      |      | 5925~5950 | -42.09 | ≤-27    | PASS |
| 11N40SI<br>SO  | Ant1 | Low  | 5755 | 5650~5700 | -37.13 | ≤7.16   | PASS |
|                |      |      |      | 5700~5720 | -29.45 | ≤15.17  | PASS |
|                |      |      |      | 5720~5725 | -26.94 | ≤21.16  | PASS |
|                |      |      |      | 5745~5650 | -42.27 | ≤-27    | PASS |
|                | Ant2 | Low  | 5755 | 5650~5700 | -38.15 | ≤9.29   | PASS |
|                |      |      |      | 5700~5720 | -28.96 | ≤14.23  | PASS |
|                |      |      |      | 5720~5725 | -27.07 | ≤20.89  | PASS |
|                |      |      |      | 5745~5650 | -41.58 | ≤-27    | PASS |
|                | Ant1 | High | 5795 | 5850~5855 | -39.83 | ≤16.81  | PASS |
|                |      |      |      | 5855~5875 | -41.25 | ≤11.47  | PASS |
|                |      |      |      | 5875~5925 | -41.94 | ≤-9.59  | PASS |
|                |      |      |      | 5925~5950 | -42.03 | ≤-27    | PASS |
|                | Ant2 | High | 5795 | 5850~5855 | -38.11 | ≤15.82  | PASS |
|                |      |      |      | 5855~5875 | -40.38 | ≤10.41  | PASS |
|                |      |      |      | 5875~5925 | -41.93 | ≤-20.43 | PASS |
|                |      |      |      | 5925~5950 | -42.47 | ≤-27    | PASS |
| 11AC20S<br>ISO | Ant1 | Low  | 5745 | 5650~5700 | -41.23 | ≤5.51   | PASS |
|                |      |      |      | 5700~5720 | -38.39 | ≤15.55  | PASS |
|                |      |      |      | 5720~5725 | -30.65 | ≤25.07  | PASS |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

 Hotline  
 400-003-0500  
[www.anbotek.com](http://www.anbotek.com)