

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	18.47	PASS
Band38	5MHz	QPSK	37775	1RB#12	18.58	PASS
Band38	5MHz	QPSK	37775	1RB#24	18.40	PASS
Band38	5MHz	QPSK	37775	12RB#0	17.46	PASS
Band38	5MHz	QPSK	37775	12RB#6	17.47	PASS
Band38	5MHz	QPSK	37775	12RB#13	17.44	PASS
Band38	5MHz	QPSK	37775	25RB#0	17.48	PASS
Band38	5MHz	QPSK	38000	1RB#0	18.20	PASS
Band38	5MHz	QPSK	38000	1RB#12	18.41	PASS
Band38	5MHz	QPSK	38000	1RB#24	18.34	PASS
Band38	5MHz	QPSK	38000	12RB#0	17.29	PASS
Band38	5MHz	QPSK	38000	12RB#6	17.24	PASS
Band38	5MHz	QPSK	38000	12RB#13	17.35	PASS
Band38	5MHz	QPSK	38000	25RB#0	17.31	PASS
Band38	5MHz	QPSK	38225	1RB#0	18.52	PASS
Band38	5MHz	QPSK	38225	1RB#12	18.64	PASS
Band38	5MHz	QPSK	38225	1RB#24	18.55	PASS
Band38	5MHz	QPSK	38225	12RB#0	17.59	PASS
Band38	5MHz	QPSK	38225	12RB#6	17.53	PASS
Band38	5MHz	QPSK	38225	12RB#13	17.55	PASS
Band38	5MHz	QPSK	38225	25RB#0	17.57	PASS
Band38	5MHz	16QAM	37775	1RB#0	17.69	PASS
Band38	5MHz	16QAM	37775	1RB#12	17.82	PASS
Band38	5MHz	16QAM	37775	1RB#24	17.62	PASS
Band38	5MHz	16QAM	37775	12RB#0	16.43	PASS
Band38	5MHz	16QAM	37775	12RB#6	16.40	PASS
Band38	5MHz	16QAM	37775	12RB#13	16.39	PASS
Band38	5MHz	16QAM	37775	25RB#0	16.41	PASS
Band38	5MHz	16QAM	38000	1RB#0	17.53	PASS
Band38	5MHz	16QAM	38000	1RB#12	17.77	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	5MHz	16QAM	38000	1RB#24	17.68	PASS
Band38	5MHz	16QAM	38000	12RB#0	16.22	PASS
Band38	5MHz	16QAM	38000	12RB#6	16.17	PASS
Band38	5MHz	16QAM	38000	12RB#13	16.26	PASS
Band38	5MHz	16QAM	38000	25RB#0	16.29	PASS
Band38	5MHz	16QAM	38225	1RB#0	17.80	PASS
Band38	5MHz	16QAM	38225	1RB#12	17.95	PASS
Band38	5MHz	16QAM	38225	1RB#24	17.82	PASS
Band38	5MHz	16QAM	38225	12RB#0	16.55	PASS
Band38	5MHz	16QAM	38225	12RB#6	16.56	PASS
Band38	5MHz	16QAM	38225	12RB#13	16.58	PASS
Band38	5MHz	16QAM	38225	25RB#0	16.56	PASS
Band38	10MHz	QPSK	37800	1RB#0	18.53	PASS
Band38	10MHz	QPSK	37800	1RB#24	18.50	PASS
Band38	10MHz	QPSK	37800	1RB#49	18.44	PASS
Band38	10MHz	QPSK	37800	25RB#0	17.44	PASS
Band38	10MHz	QPSK	37800	25RB#12	17.44	PASS
Band38	10MHz	QPSK	37800	25RB#25	17.42	PASS
Band38	10MHz	QPSK	37800	50RB#0	17.44	PASS
Band38	10MHz	QPSK	38000	1RB#0	18.31	PASS
Band38	10MHz	QPSK	38000	1RB#24	18.42	PASS
Band38	10MHz	QPSK	38000	1RB#49	18.43	PASS
Band38	10MHz	QPSK	38000	25RB#0	17.29	PASS
Band38	10MHz	QPSK	38000	25RB#12	17.31	PASS
Band38	10MHz	QPSK	38000	25RB#25	17.38	PASS
Band38	10MHz	QPSK	38000	50RB#0	17.32	PASS
Band38	10MHz	QPSK	38200	1RB#0	18.60	PASS
Band38	10MHz	QPSK	38200	1RB#24	18.67	PASS
Band38	10MHz	QPSK	38200	1RB#49	18.68	PASS
Band38	10MHz	QPSK	38200	25RB#0	17.61	PASS
Band38	10MHz	QPSK	38200	25RB#12	17.58	PASS
Band38	10MHz	QPSK	38200	25RB#25	17.57	PASS
Band38	10MHz	QPSK	38200	50RB#0	17.60	PASS
Band38	10MHz	16QAM	37800	1RB#0	17.86	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	10MHz	16QAM	37800	1RB#24	17.81	PASS
Band38	10MHz	16QAM	37800	1RB#49	17.81	PASS
Band38	10MHz	16QAM	37800	25RB#0	16.55	PASS
Band38	10MHz	16QAM	37800	25RB#12	16.56	PASS
Band38	10MHz	16QAM	37800	25RB#25	16.51	PASS
Band38	10MHz	16QAM	37800	50RB#0	16.46	PASS
Band38	10MHz	16QAM	38000	1RB#0	17.20	PASS
Band38	10MHz	16QAM	38000	1RB#24	17.33	PASS
Band38	10MHz	16QAM	38000	1RB#49	17.38	PASS
Band38	10MHz	16QAM	38000	25RB#0	16.28	PASS
Band38	10MHz	16QAM	38000	25RB#12	16.28	PASS
Band38	10MHz	16QAM	38000	25RB#25	16.39	PASS
Band38	10MHz	16QAM	38000	50RB#0	16.30	PASS
Band38	10MHz	16QAM	38200	1RB#0	17.57	PASS
Band38	10MHz	16QAM	38200	1RB#24	17.69	PASS
Band38	10MHz	16QAM	38200	1RB#49	17.70	PASS
Band38	10MHz	16QAM	38200	25RB#0	16.61	PASS
Band38	10MHz	16QAM	38200	25RB#12	16.57	PASS
Band38	10MHz	16QAM	38200	25RB#25	16.63	PASS
Band38	10MHz	16QAM	38200	50RB#0	16.59	PASS
Band38	15MHz	QPSK	37825	1RB#0	18.44	PASS
Band38	15MHz	QPSK	37825	1RB#38	18.45	PASS
Band38	15MHz	QPSK	37825	1RB#74	18.31	PASS
Band38	15MHz	QPSK	37825	38RB#0	17.37	PASS
Band38	15MHz	QPSK	37825	38RB#18	17.38	PASS
Band38	15MHz	QPSK	37825	38RB#37	17.38	PASS
Band38	15MHz	QPSK	37825	75RB#0	17.41	PASS
Band38	15MHz	QPSK	38000	1RB#0	18.39	PASS
Band38	15MHz	QPSK	38000	1RB#38	18.46	PASS
Band38	15MHz	QPSK	38000	1RB#74	18.49	PASS
Band38	15MHz	QPSK	38000	38RB#0	17.31	PASS
Band38	15MHz	QPSK	38000	38RB#18	17.33	PASS
Band38	15MHz	QPSK	38000	38RB#37	17.32	PASS
Band38	15MHz	QPSK	38000	75RB#0	17.34	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	QPSK	38175	1RB#0	18.41	PASS
Band38	15MHz	QPSK	38175	1RB#38	18.63	PASS
Band38	15MHz	QPSK	38175	1RB#74	18.60	PASS
Band38	15MHz	QPSK	38175	38RB#0	17.50	PASS
Band38	15MHz	QPSK	38175	38RB#18	17.50	PASS
Band38	15MHz	QPSK	38175	38RB#37	17.53	PASS
Band38	15MHz	QPSK	38175	75RB#0	17.49	PASS
Band38	15MHz	16QAM	37825	1RB#0	17.76	PASS
Band38	15MHz	16QAM	37825	1RB#38	17.78	PASS
Band38	15MHz	16QAM	37825	1RB#74	17.64	PASS
Band38	15MHz	16QAM	37825	38RB#0	17.34	PASS
Band38	15MHz	16QAM	37825	38RB#18	17.40	PASS
Band38	15MHz	16QAM	37825	38RB#37	17.37	PASS
Band38	15MHz	16QAM	37825	75RB#0	16.38	PASS
Band38	15MHz	16QAM	38000	1RB#0	17.37	PASS
Band38	15MHz	16QAM	38000	1RB#38	17.48	PASS
Band38	15MHz	16QAM	38000	1RB#74	17.47	PASS
Band38	15MHz	16QAM	38000	38RB#0	17.36	PASS
Band38	15MHz	16QAM	38000	38RB#18	17.34	PASS
Band38	15MHz	16QAM	38000	38RB#37	17.35	PASS
Band38	15MHz	16QAM	38000	75RB#0	16.32	PASS
Band38	15MHz	16QAM	38175	1RB#0	17.40	PASS
Band38	15MHz	16QAM	38175	1RB#38	17.63	PASS
Band38	15MHz	16QAM	38175	1RB#74	17.59	PASS
Band38	15MHz	16QAM	38175	38RB#0	17.49	PASS
Band38	15MHz	16QAM	38175	38RB#18	17.50	PASS
Band38	15MHz	16QAM	38175	38RB#37	17.51	PASS
Band38	15MHz	16QAM	38175	75RB#0	16.45	PASS
Band38	20MHz	QPSK	37850	1RB#0	18.43	PASS
Band38	20MHz	QPSK	37850	1RB#49	18.46	PASS
Band38	20MHz	QPSK	37850	1RB#99	18.30	PASS
Band38	20MHz	QPSK	37850	50RB#0	17.39	PASS
Band38	20MHz	QPSK	37850	50RB#25	17.41	PASS
Band38	20MHz	QPSK	37850	50RB#50	17.38	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	20MHz	QPSK	37850	100RB#0	17.39	PASS
Band38	20MHz	QPSK	38000	1RB#0	18.29	PASS
Band38	20MHz	QPSK	38000	1RB#49	18.45	PASS
Band38	20MHz	QPSK	38000	1RB#99	18.43	PASS
Band38	20MHz	QPSK	38000	50RB#0	17.23	PASS
Band38	20MHz	QPSK	38000	50RB#25	17.24	PASS
Band38	20MHz	QPSK	38000	50RB#50	17.44	PASS
Band38	20MHz	QPSK	38000	100RB#0	17.31	PASS
Band38	20MHz	QPSK	38150	1RB#0	18.28	PASS
Band38	20MHz	QPSK	38150	1RB#49	18.62	PASS
Band38	20MHz	QPSK	38150	1RB#99	18.57	PASS
Band38	20MHz	QPSK	38150	50RB#0	17.43	PASS
Band38	20MHz	QPSK	38150	50RB#25	17.38	PASS
Band38	20MHz	QPSK	38150	50RB#50	17.56	PASS
Band38	20MHz	QPSK	38150	100RB#0	17.47	PASS
Band38	20MHz	16QAM	37850	1RB#0	17.56	PASS
Band38	20MHz	16QAM	37850	1RB#49	17.66	PASS
Band38	20MHz	16QAM	37850	1RB#99	17.45	PASS
Band38	20MHz	16QAM	37850	50RB#0	16.41	PASS
Band38	20MHz	16QAM	37850	50RB#25	16.39	PASS
Band38	20MHz	16QAM	37850	50RB#50	16.41	PASS
Band38	20MHz	16QAM	37850	100RB#0	16.35	PASS
Band38	20MHz	16QAM	38000	1RB#0	16.97	PASS
Band38	20MHz	16QAM	38000	1RB#49	17.12	PASS
Band38	20MHz	16QAM	38000	1RB#99	17.07	PASS
Band38	20MHz	16QAM	38000	50RB#0	16.24	PASS
Band38	20MHz	16QAM	38000	50RB#25	16.27	PASS
Band38	20MHz	16QAM	38000	50RB#50	16.42	PASS
Band38	20MHz	16QAM	38000	100RB#0	16.27	PASS
Band38	20MHz	16QAM	38150	1RB#0	17.24	PASS
Band38	20MHz	16QAM	38150	1RB#49	17.62	PASS
Band38	20MHz	16QAM	38150	1RB#99	17.48	PASS
Band38	20MHz	16QAM	38150	50RB#0	16.34	PASS
Band38	20MHz	16QAM	38150	50RB#25	16.36	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	20MHz	16QAM	38150	50RB#50	16.47	PASS
Band38	20MHz	16QAM	38150	100RB#0	16.43	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix B: Peak-to-Average Ratio(CCDF)


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	6.53	13	PASS
Band38	5MHz	QPSK	37775	25RB#0	5.81	13	PASS
Band38	5MHz	QPSK	38000	1RB#0	5.87	13	PASS
Band38	5MHz	QPSK	38000	25RB#0	5.71	13	PASS
Band38	5MHz	QPSK	38225	1RB#0	5.97	13	PASS
Band38	5MHz	QPSK	38225	25RB#0	5.74	13	PASS
Band38	5MHz	16QAM	37775	1RB#0	6.88	13	PASS
Band38	5MHz	16QAM	37775	25RB#0	6.65	13	PASS
Band38	5MHz	16QAM	38000	1RB#0	6.67	13	PASS
Band38	5MHz	16QAM	38000	25RB#0	6.45	13	PASS
Band38	5MHz	16QAM	38225	1RB#0	6.66	13	PASS
Band38	5MHz	16QAM	38225	25RB#0	6.63	13	PASS
Band38	10MHz	QPSK	37800	1RB#0	6.64	13	PASS
Band38	10MHz	QPSK	37800	50RB#0	5.74	13	PASS
Band38	10MHz	QPSK	38000	1RB#0	6.22	13	PASS
Band38	10MHz	QPSK	38000	50RB#0	5.68	13	PASS
Band38	10MHz	QPSK	38200	1RB#0	6.20	13	PASS
Band38	10MHz	QPSK	38200	50RB#0	5.66	13	PASS
Band38	10MHz	16QAM	37800	1RB#0	6.92	13	PASS
Band38	10MHz	16QAM	37800	50RB#0	6.46	13	PASS
Band38	10MHz	16QAM	38000	1RB#0	7.00	13	PASS
Band38	10MHz	16QAM	38000	50RB#0	6.44	13	PASS
Band38	10MHz	16QAM	38200	1RB#0	6.56	13	PASS
Band38	10MHz	16QAM	38200	50RB#0	6.41	13	PASS
Band38	15MHz	QPSK	37825	1RB#0	6.32	13	PASS
Band38	15MHz	QPSK	37825	75RB#0	6.06	13	PASS
Band38	15MHz	QPSK	38000	1RB#0	6.53	13	PASS
Band38	15MHz	QPSK	38000	75RB#0	6.02	13	PASS
Band38	15MHz	QPSK	38175	1RB#0	6.16	13	PASS
Band38	15MHz	QPSK	38175	75RB#0	5.97	13	PASS
Band38	15MHz	16QAM	37825	1RB#0	7.03	13	PASS
Band38	15MHz	16QAM	37825	75RB#0	6.51	13	PASS
Band38	15MHz	16QAM	38000	1RB#0	6.80	13	PASS
Band38	15MHz	16QAM	38000	75RB#0	6.48	13	PASS
Band38	15MHz	16QAM	38175	1RB#0	6.94	13	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	16QAM	38175	75RB#0	6.45	13	PASS
Band38	20MHz	QPSK	37850	1RB#0	6.11	13	PASS
Band38	20MHz	QPSK	37850	100RB#0	5.65	13	PASS
Band38	20MHz	QPSK	38000	1RB#0	5.18	13	PASS
Band38	20MHz	QPSK	38000	100RB#0	5.61	13	PASS
Band38	20MHz	QPSK	38150	1RB#0	5.81	13	PASS
Band38	20MHz	QPSK	38150	100RB#0	5.72	13	PASS
Band38	20MHz	16QAM	37850	1RB#0	5.96	13	PASS
Band38	20MHz	16QAM	37850	100RB#0	6.37	13	PASS
Band38	20MHz	16QAM	38000	1RB#0	6.16	13	PASS
Band38	20MHz	16QAM	38000	100RB#0	6.36	13	PASS
Band38	20MHz	16QAM	38150	1RB#0	6.44	13	PASS
Band38	20MHz	16QAM	38150	100RB#0	6.38	13	PASS


Test Graphs

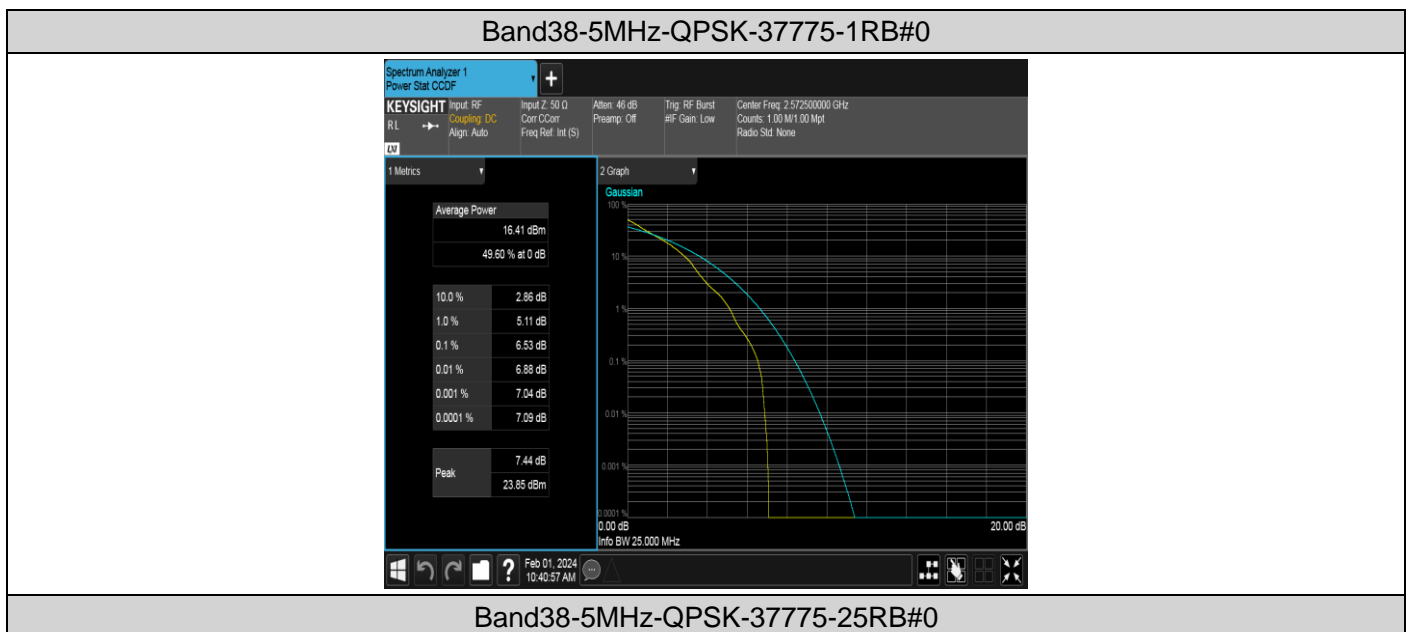


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

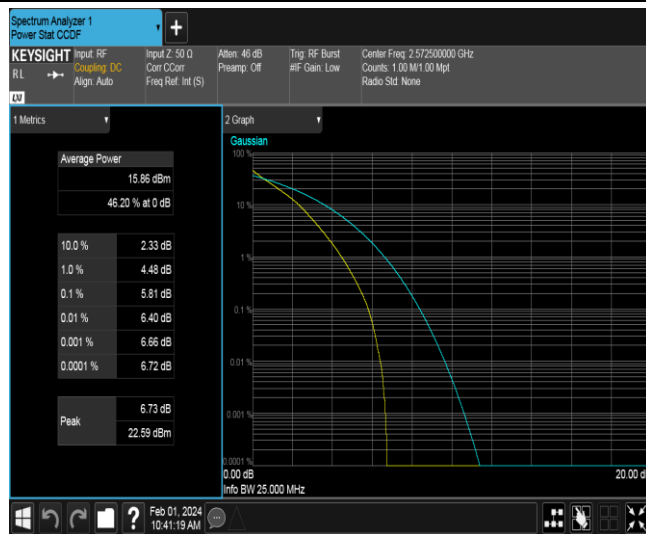

Band38-5MHz-QPSK-38000-1RB#0

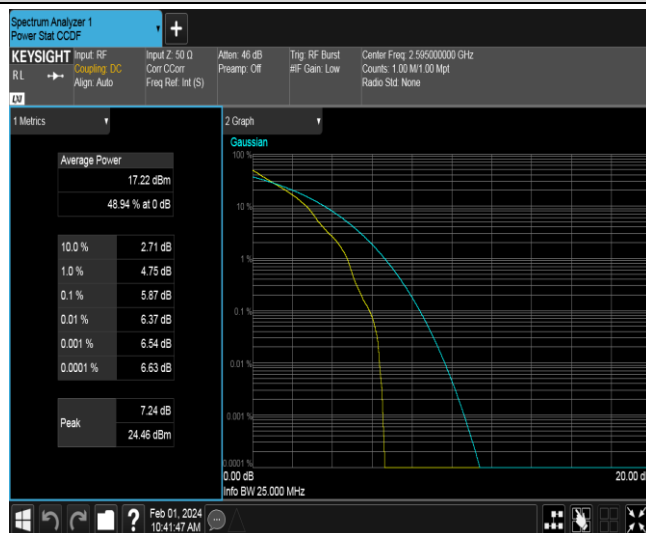

Band38-5MHz-QPSK-38000-25RB#0

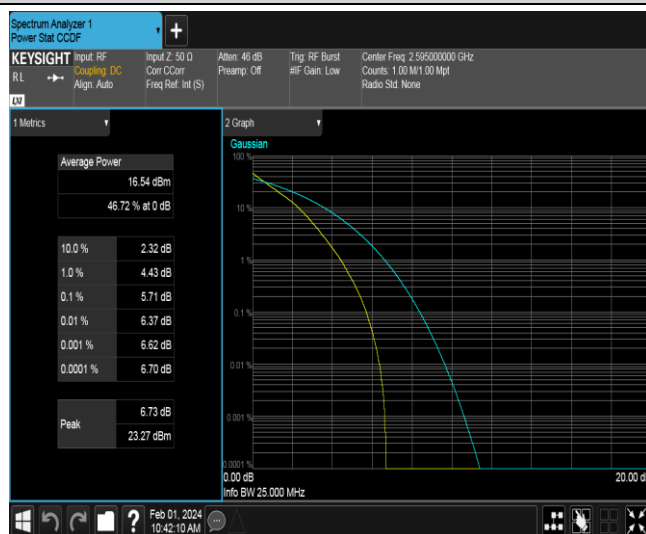


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-QPSK-38225-1RB#0




Band38-5MHz-QPSK-38225-25RB#0

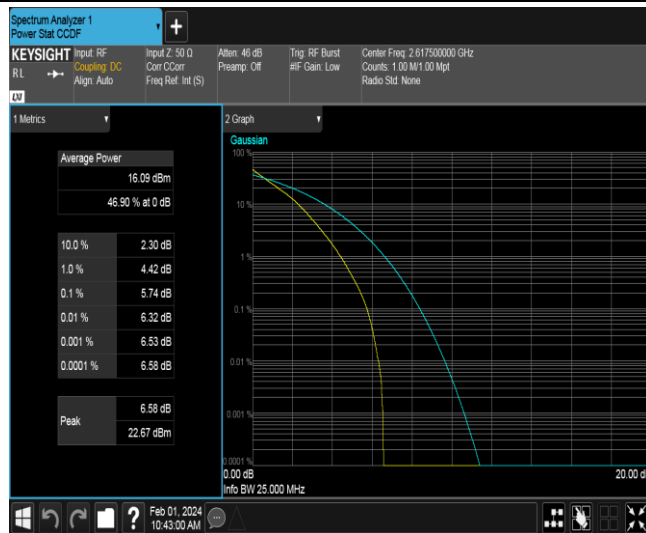

Band38-5MHz-16QAM-37775-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
 Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
 Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: http://www.agccert.com/

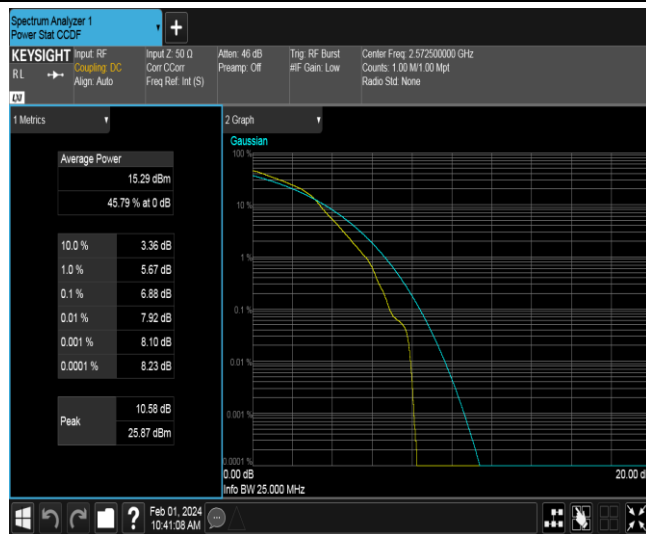

Band38-5MHz-16QAM-37775-25RB#0




Band38-5MHz-16QAM-38000-1RB#0




Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-16QAM-38000-25RB#0

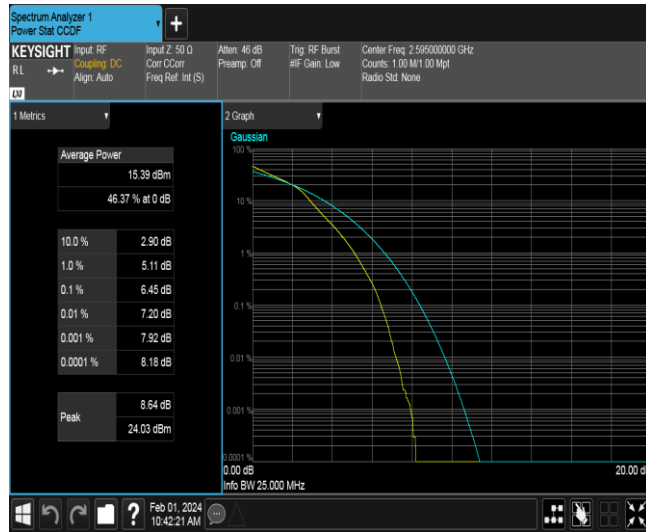


Band38-5MHz-16QAM-38225-1RB#0

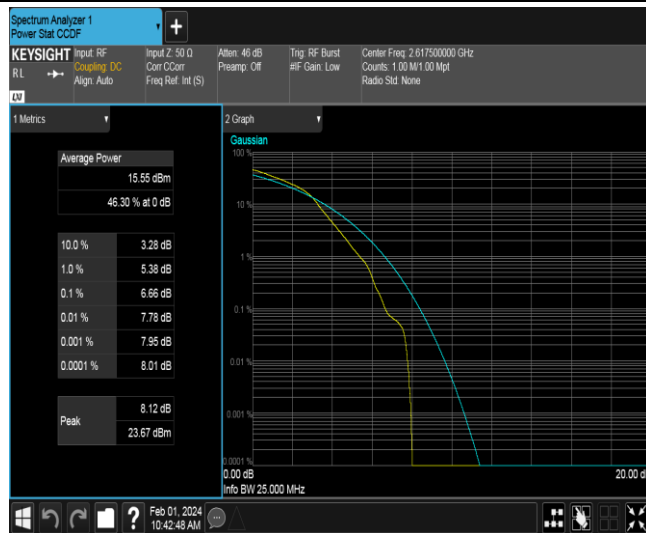


Band38-5MHz-16QAM-38225-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

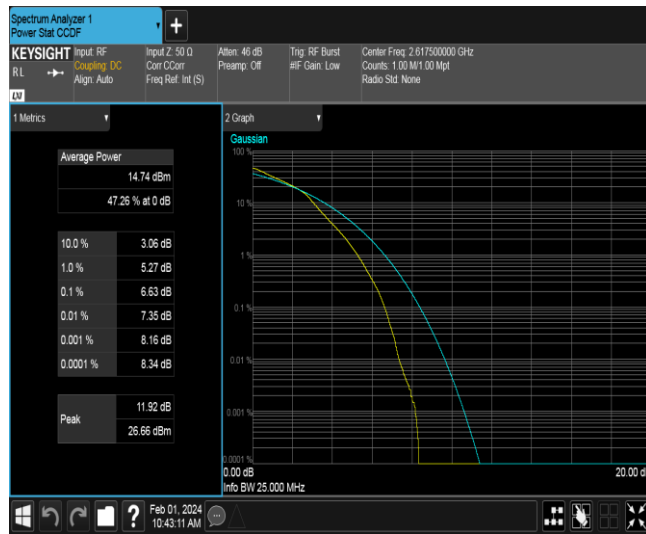

Band38-10MHz-QPSK-37800-1RB#0

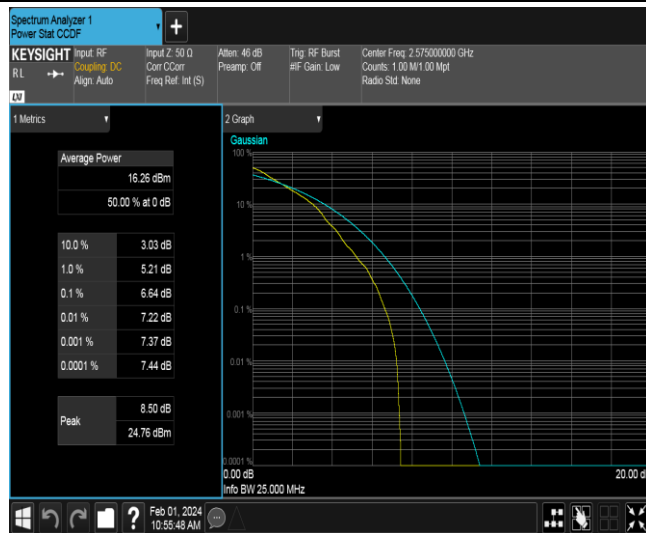


Band38-10MHz-QPSK-37800-50RB#0




Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-10MHz-QPSK-38000-1RB#0

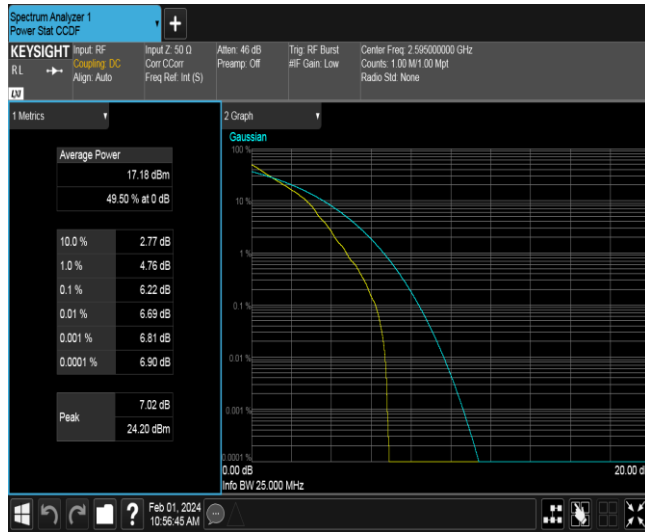


Band38-10MHz-QPSK-38000-50RB#0

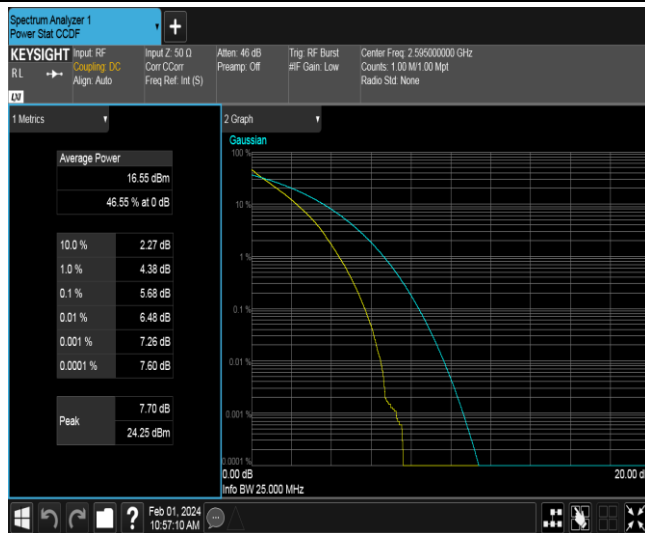

Band38-10MHz-QPSK-38200-1RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

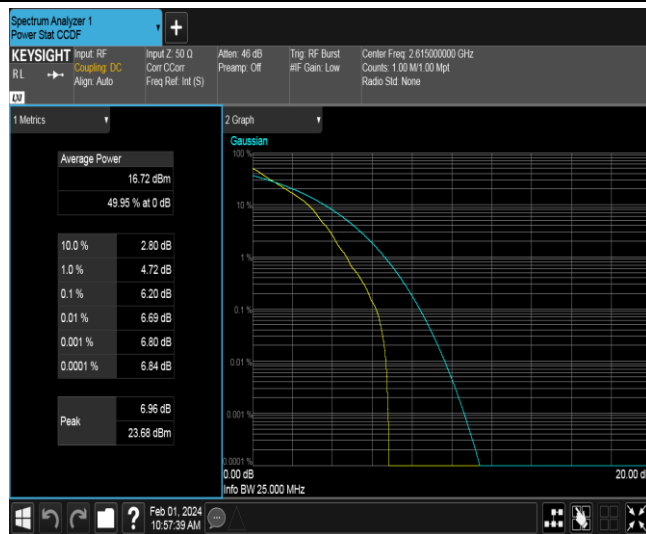

Band38-10MHz-QPSK-38200-50RB#0




Band38-10MHz-16QAM-37800-1RB#0

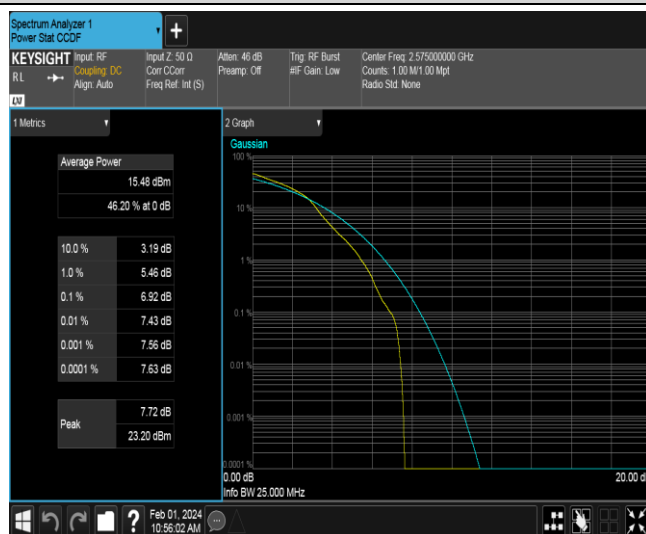

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-10MHz-16QAM-37800-50RB#0

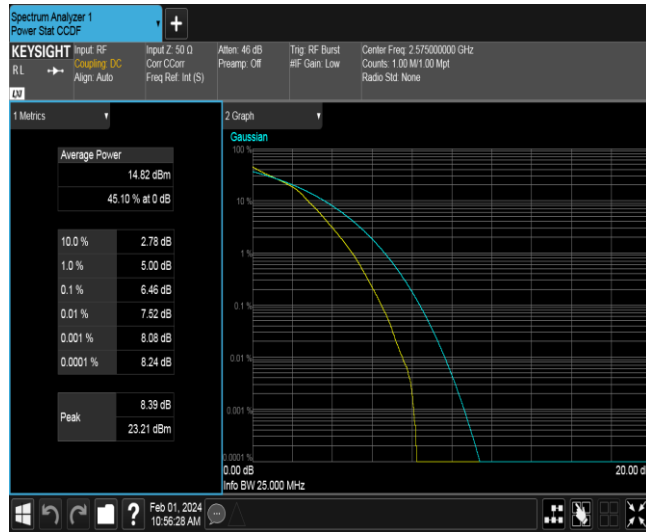


Band38-10MHz-16QAM-38000-1RB#0



Band38-10MHz-16QAM-38000-50RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

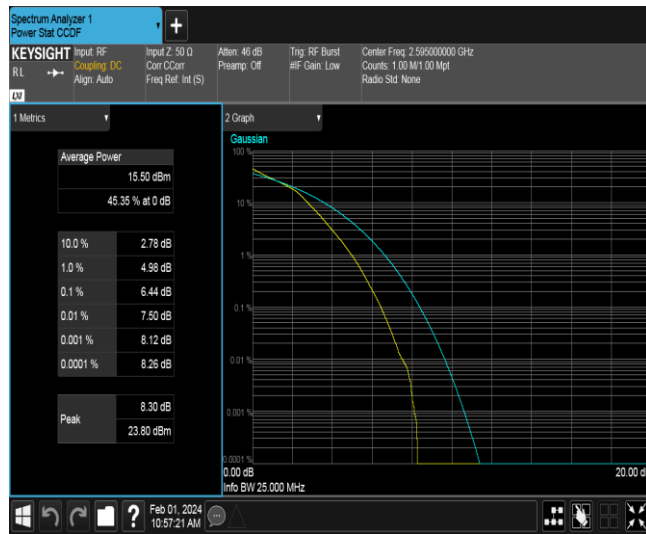

Band38-10MHz-16QAM-38200-1RB#0



Band38-10MHz-16QAM-38200-50RB#0

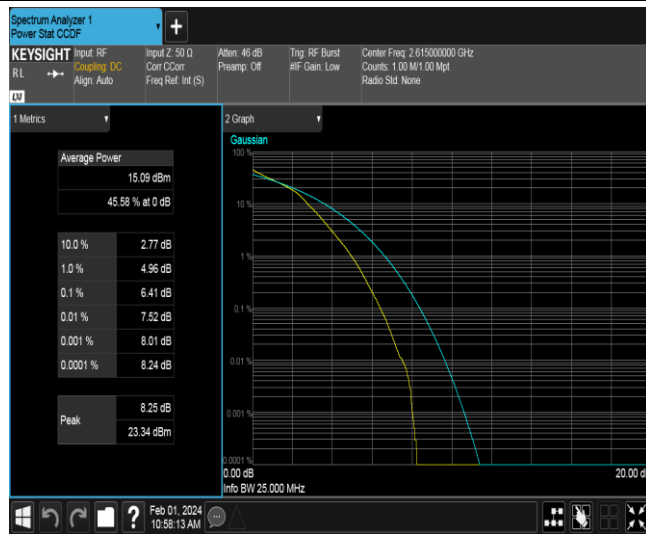


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-QPSK-37825-1RB#0




Band38-15MHz-QPSK-37825-75RB#0

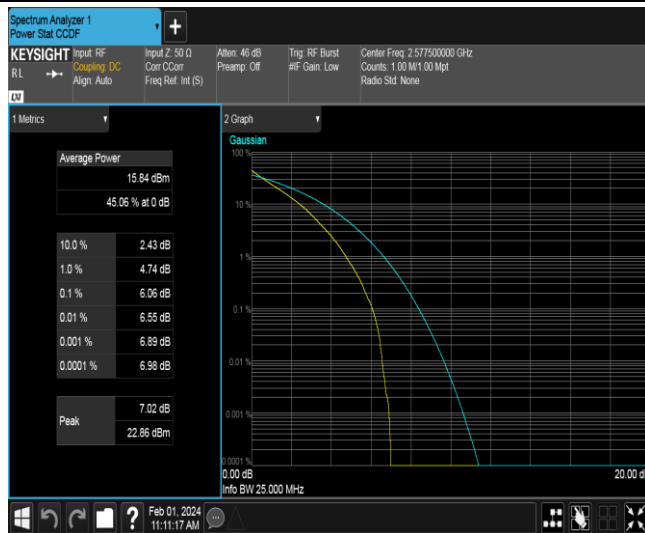

Band38-15MHz-QPSK-38000-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

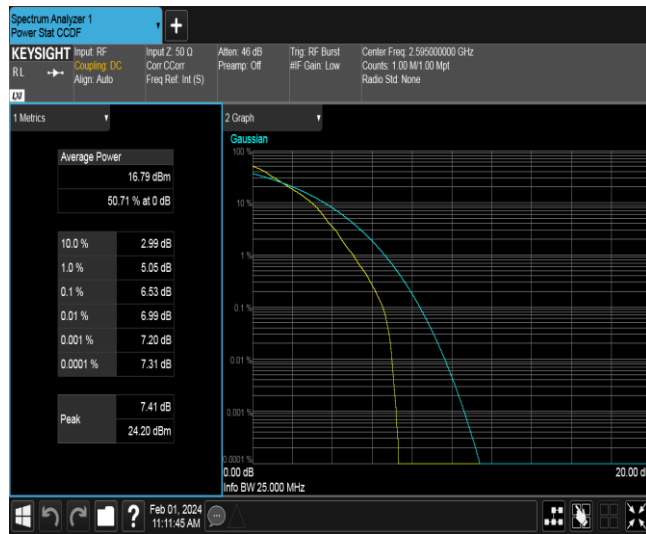

Band38-15MHz-QPSK-38000-75RB#0




Band38-15MHz-QPSK-38175-1RB#0




Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-QPSK-38175-75RB#0

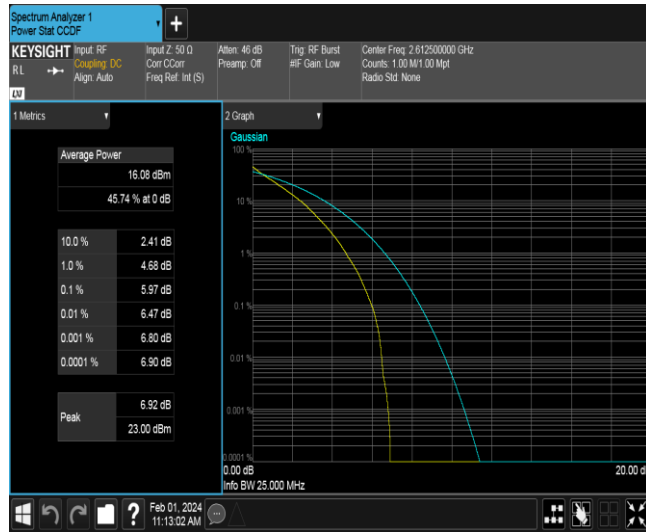


Band38-15MHz-16QAM-37825-1RB#0

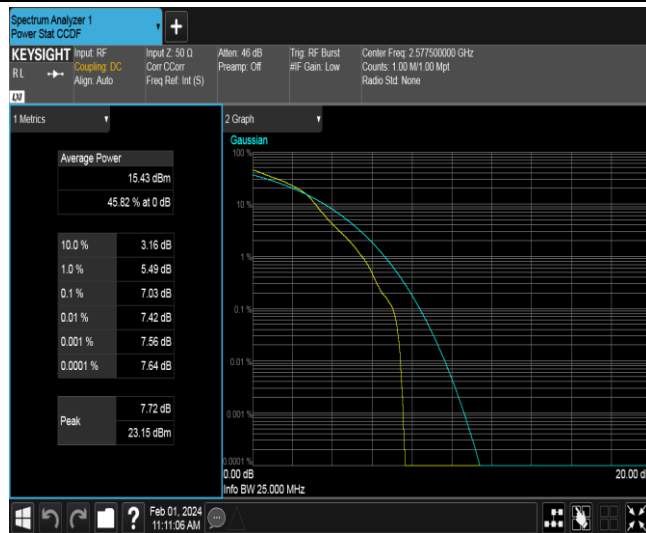

Band38-15MHz-16QAM-37825-75RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

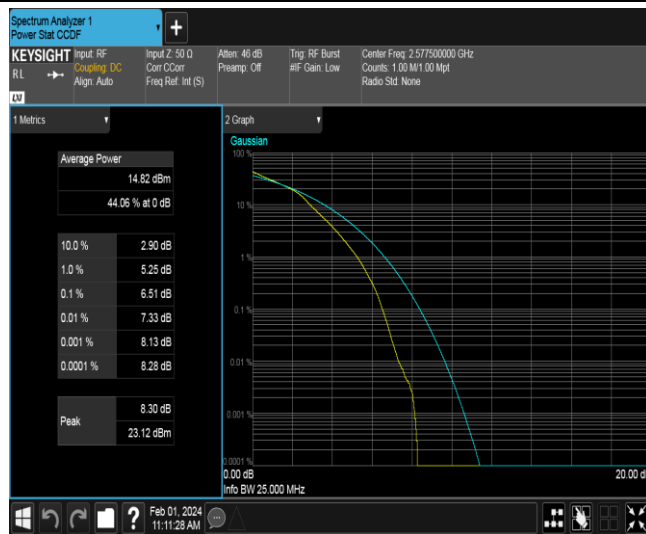

Band38-15MHz-16QAM-38000-1RB#0




Band38-15MHz-16QAM-38000-75RB#0

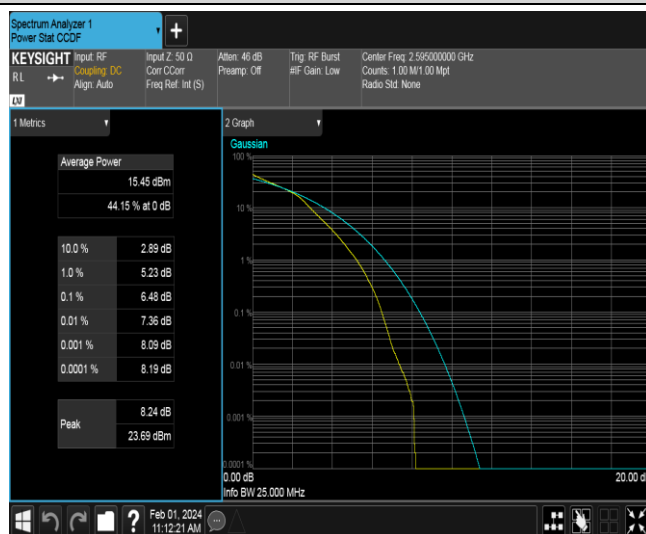


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-16QAM-38175-1RB#0

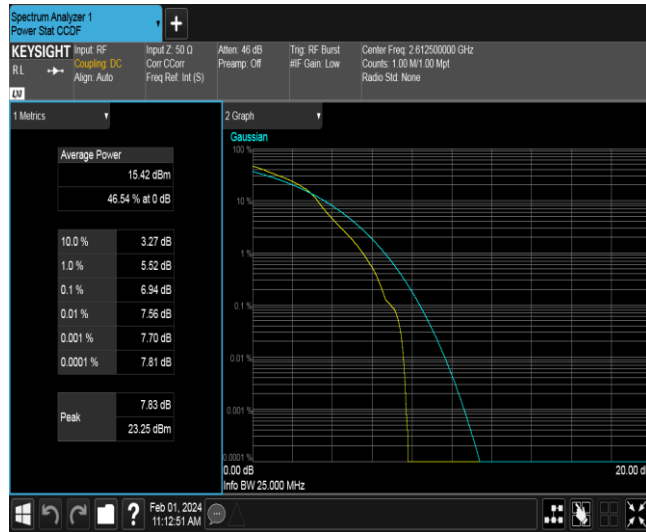

Band38-15MHz-16QAM-38175-75RB#0

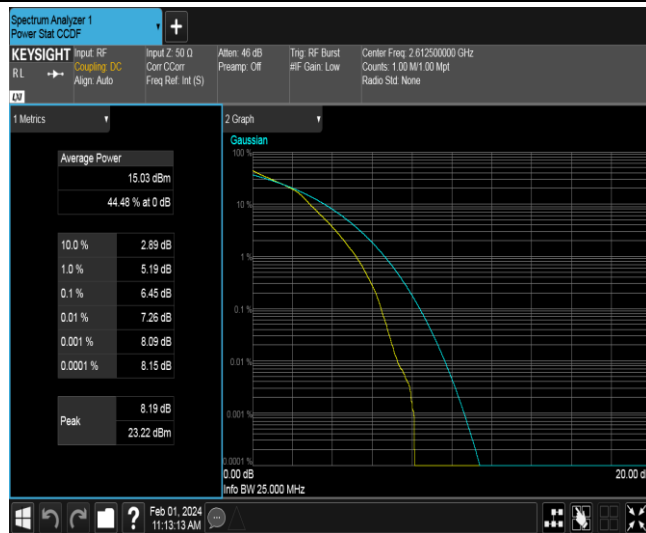


Band38-20MHz-QPSK-37850-1RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band38-20MHz-QPSK-37850-100RB#0

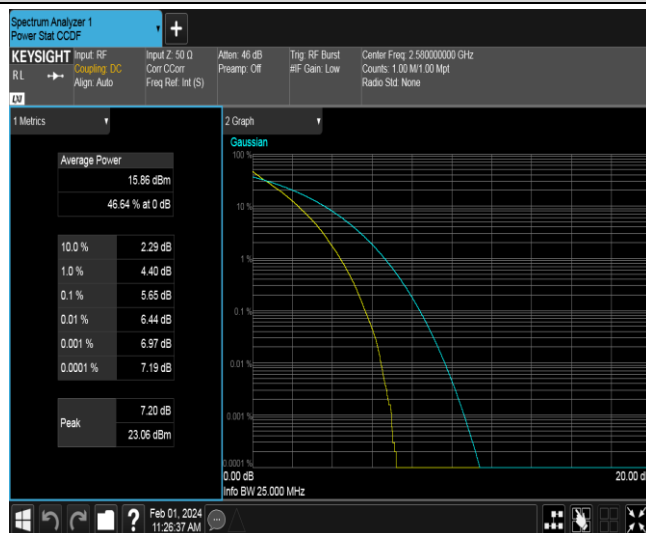


Band38-20MHz-QPSK-38000-1RB#0

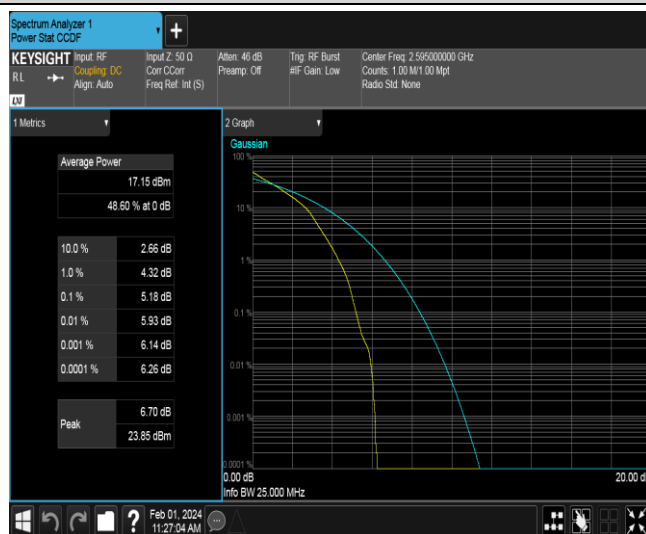


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-QPSK-38000-100RB#0

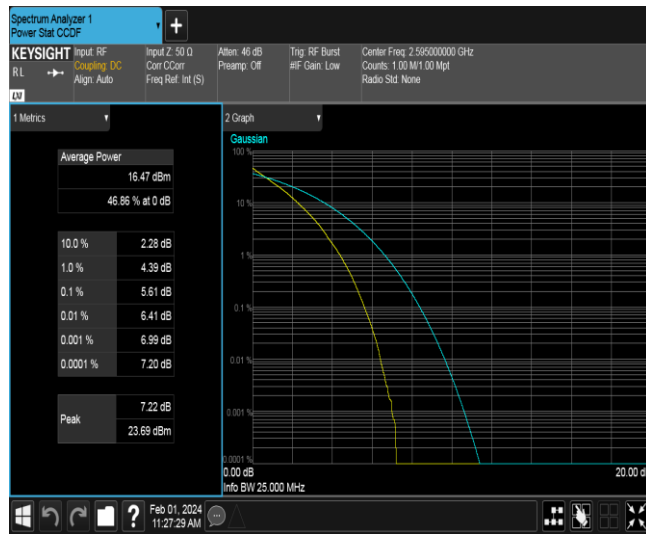


Band38-20MHz-QPSK-38150-1RB#0

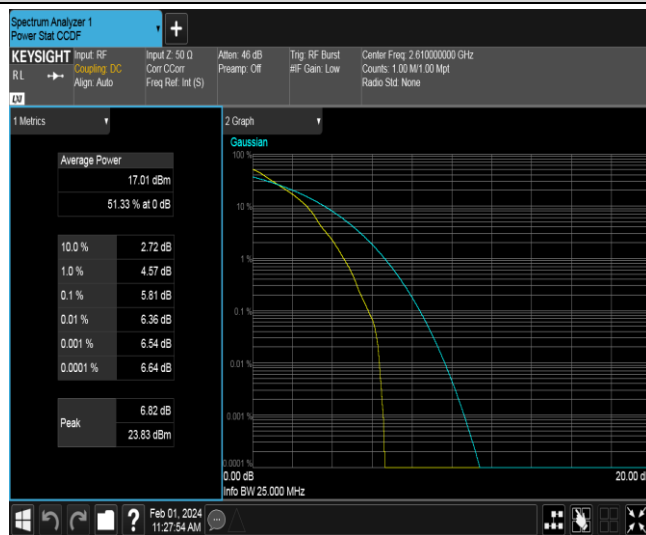


Band38-20MHz-QPSK-38150-100RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

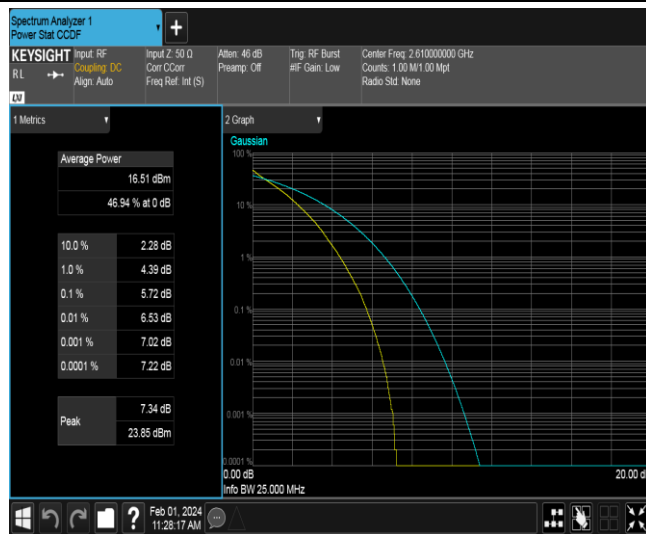

Band38-20MHz-16QAM-37850-1RB#0

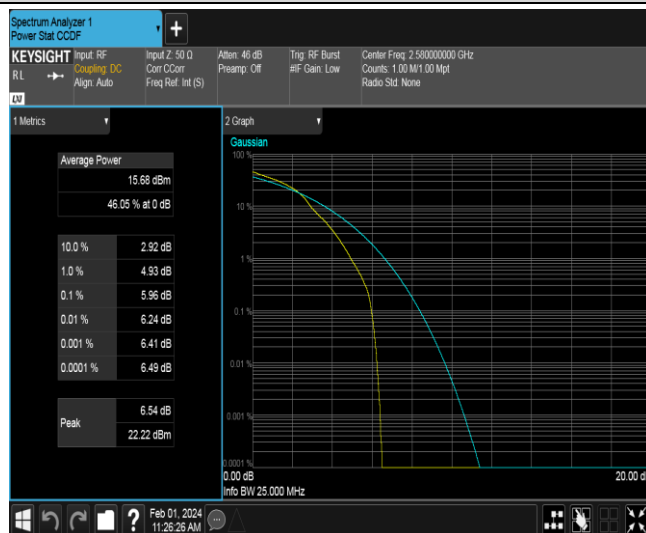


Band38-20MHz-16QAM-37850-100RB#0

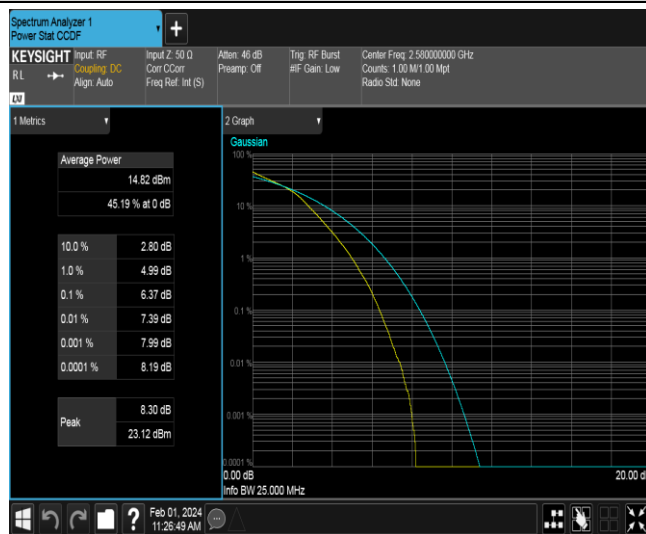


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-16QAM-38000-1RB#0

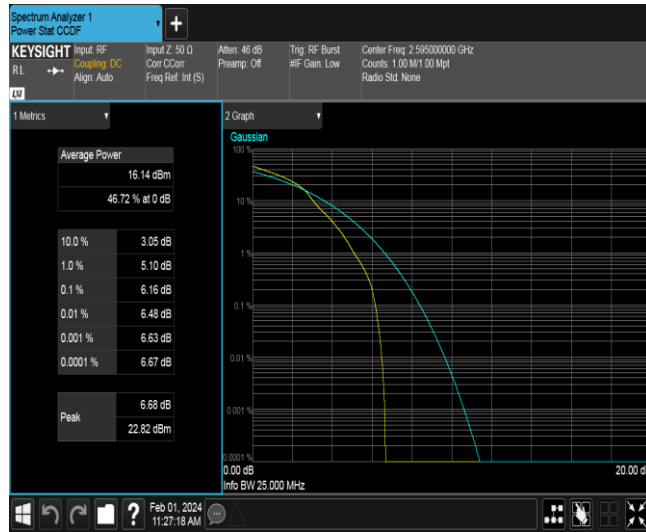


Band38-20MHz-16QAM-38000-100RB#0

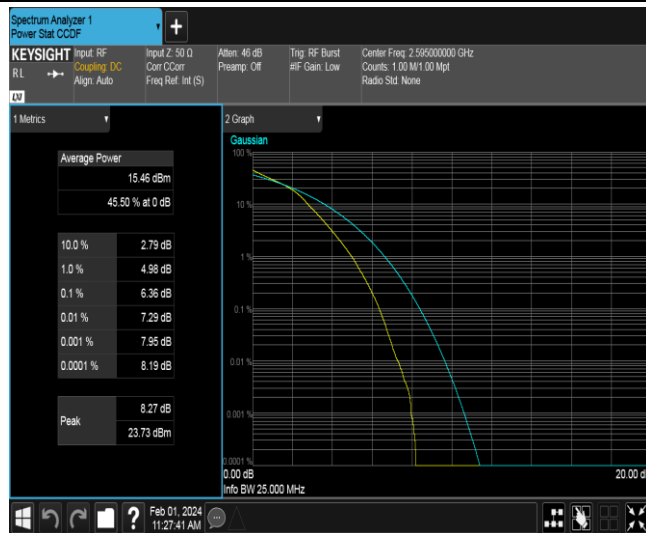

Band38-20MHz-16QAM-38150-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

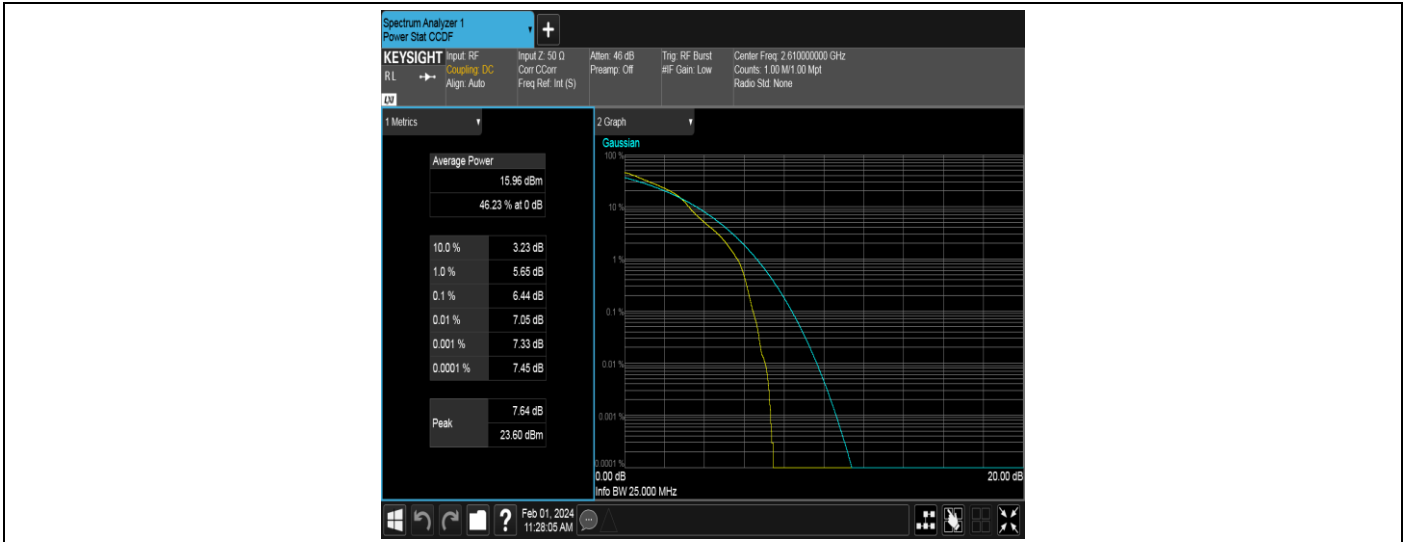

Band38-20MHz-16QAM-38150-100RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix C: 26dB Bandwidth and Occupied Bandwidth


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	4.4997	4.830	PASS
Band38	5MHz	QPSK	38000	25RB#0	4.4959	4.827	PASS
Band38	5MHz	QPSK	38225	25RB#0	4.4954	4.823	PASS
Band38	5MHz	16QAM	37775	25RB#0	4.4951	4.807	PASS
Band38	5MHz	16QAM	38000	25RB#0	4.4935	4.815	PASS
Band38	5MHz	16QAM	38225	25RB#0	4.4903	4.809	PASS
Band38	10MHz	QPSK	37800	50RB#0	8.9625	9.511	PASS
Band38	10MHz	QPSK	38000	50RB#0	8.9667	9.503	PASS
Band38	10MHz	QPSK	38200	50RB#0	8.9715	9.526	PASS
Band38	10MHz	16QAM	37800	50RB#0	8.9815	9.514	PASS
Band38	10MHz	16QAM	38000	50RB#0	8.9767	9.511	PASS
Band38	10MHz	16QAM	38200	50RB#0	8.9804	9.516	PASS
Band38	15MHz	QPSK	37825	75RB#0	13.461	14.25	PASS
Band38	15MHz	QPSK	38000	75RB#0	13.470	14.25	PASS
Band38	15MHz	QPSK	38175	75RB#0	13.465	14.24	PASS
Band38	15MHz	16QAM	37825	75RB#0	13.445	14.24	PASS
Band38	15MHz	16QAM	38000	75RB#0	13.455	14.23	PASS
Band38	15MHz	16QAM	38175	75RB#0	13.459	14.23	PASS
Band38	20MHz	QPSK	37850	100RB#0	17.917	18.93	PASS
Band38	20MHz	QPSK	38000	100RB#0	17.909	18.94	PASS
Band38	20MHz	QPSK	38150	100RB#0	17.925	18.93	PASS
Band38	20MHz	16QAM	37850	100RB#0	17.911	18.93	PASS
Band38	20MHz	16QAM	38000	100RB#0	17.904	18.93	PASS
Band38	20MHz	16QAM	38150	100RB#0	17.922	18.93	PASS


Test Graphs

Band38-5MHz-QPSK-37775-25RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

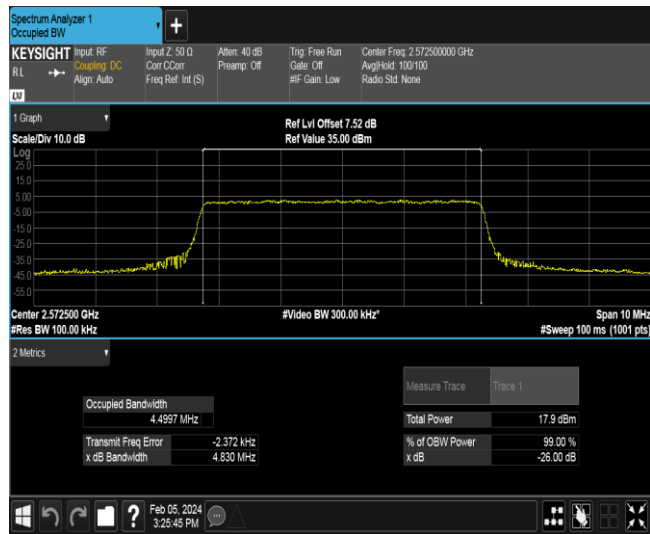

Band38-5MHz-QPSK-38000-25RB#0

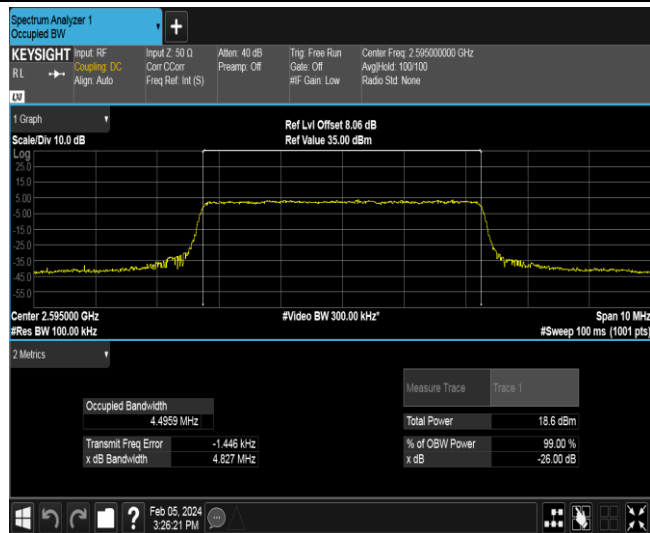


Band38-5MHz-QPSK-38225-25RB#0

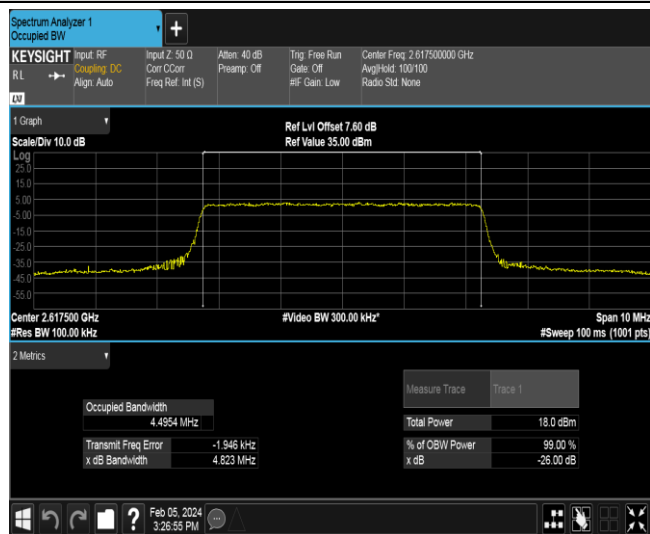


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-16QAM-37775-25RB#0



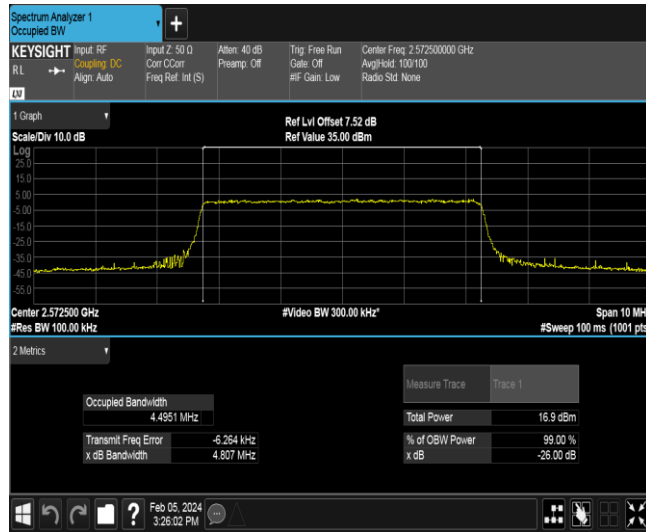


Band38-5MHz-16QAM-38000-25RB#0

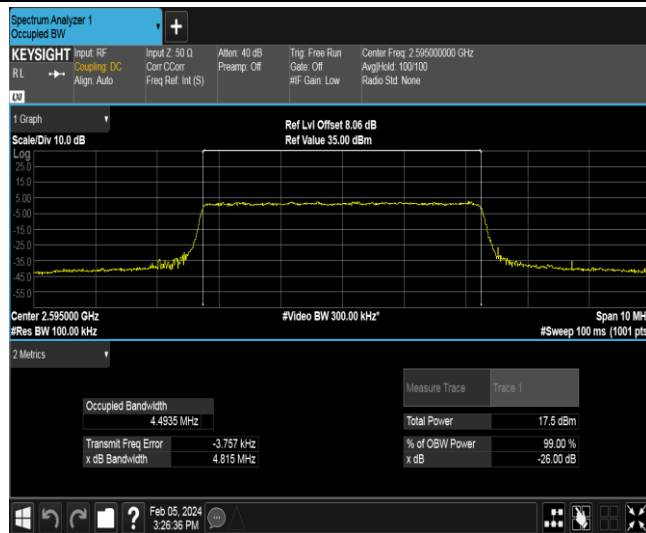


Band38-5MHz-16QAM-38225-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

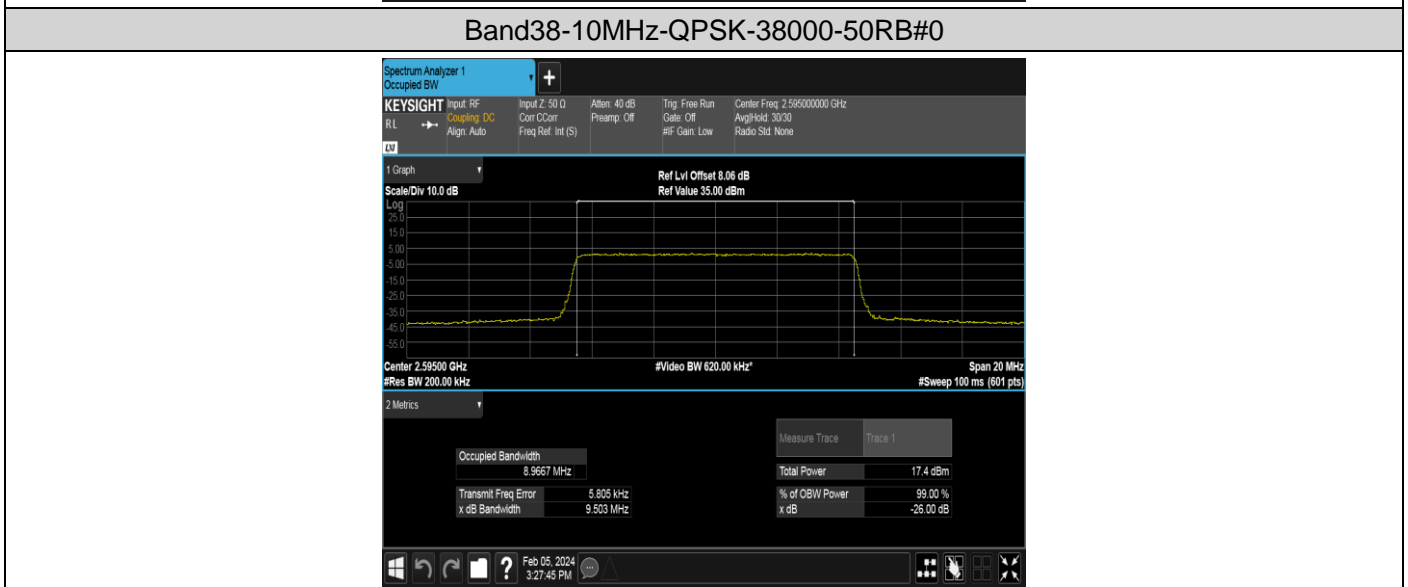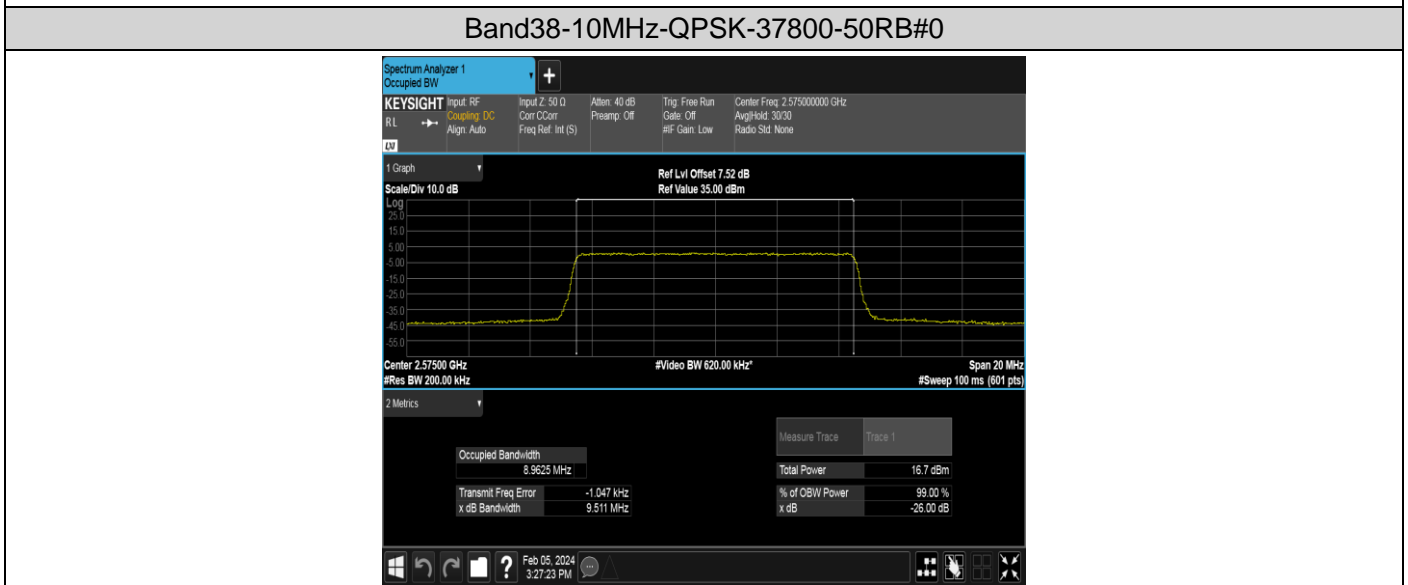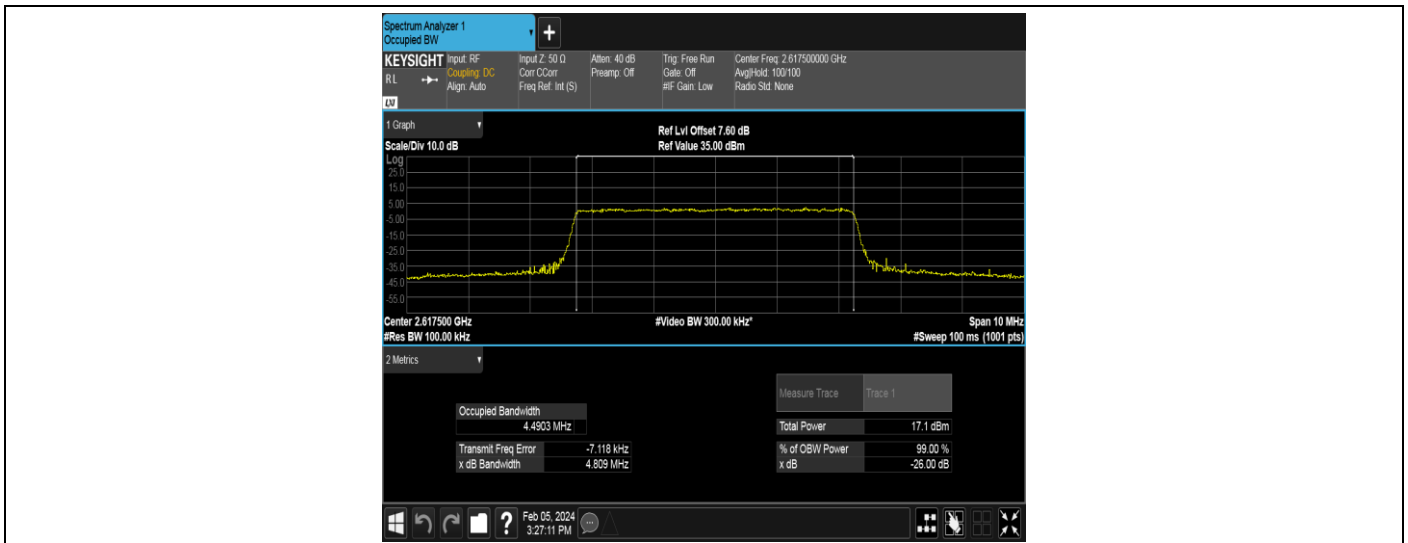

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-10MHz-QPSK-38200-50RB#0

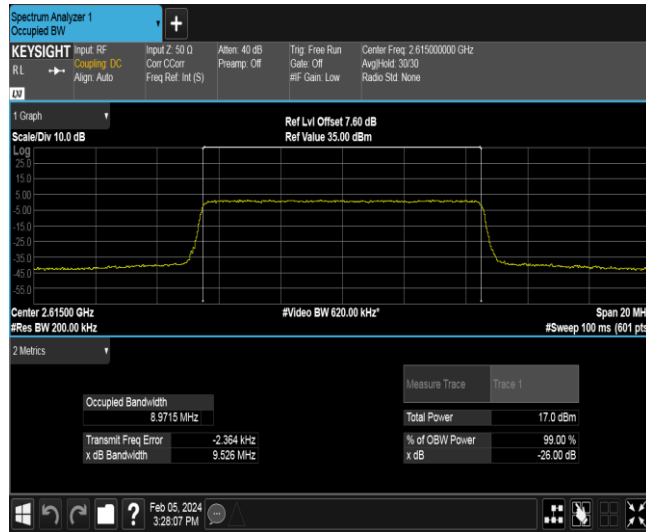

Band38-10MHz-16QAM-37800-50RB#0




Band38-10MHz-16QAM-38000-50RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band38-10MHz-16QAM-38200-50RB#0

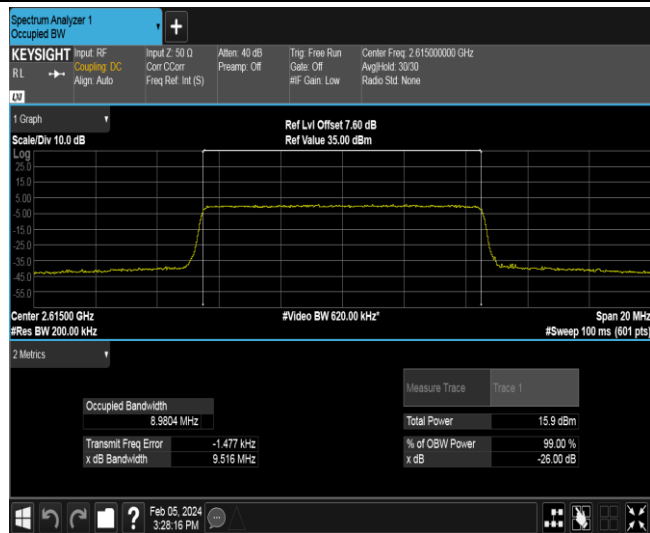


Band38-15MHz-QPSK-37825-75RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-QPSK-38000-75RB#0

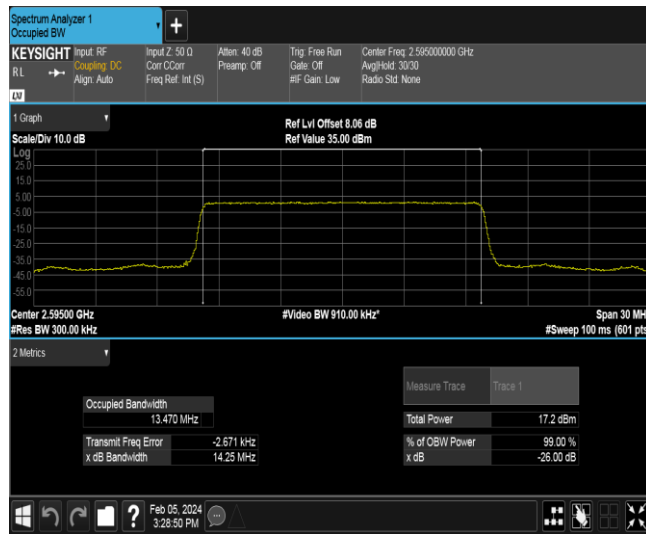

Band38-15MHz-QPSK-38175-75RB#0




Band38-15MHz-16QAM-37825-75RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band38-15MHz-16QAM-38000-75RB#0

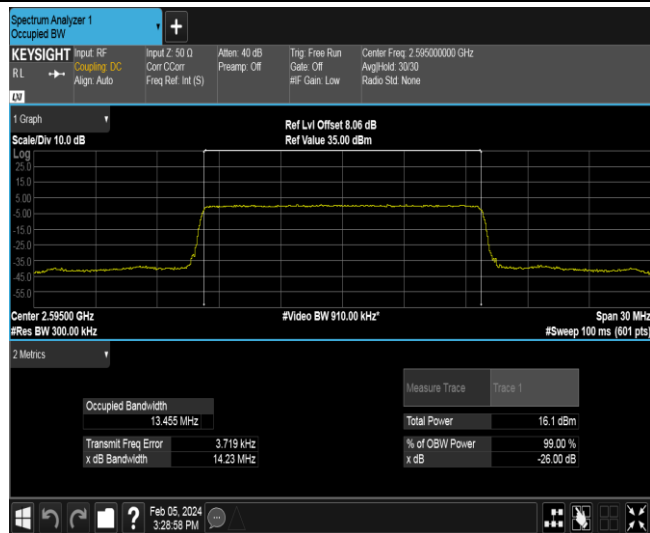


Band38-15MHz-16QAM-38175-75RB#0

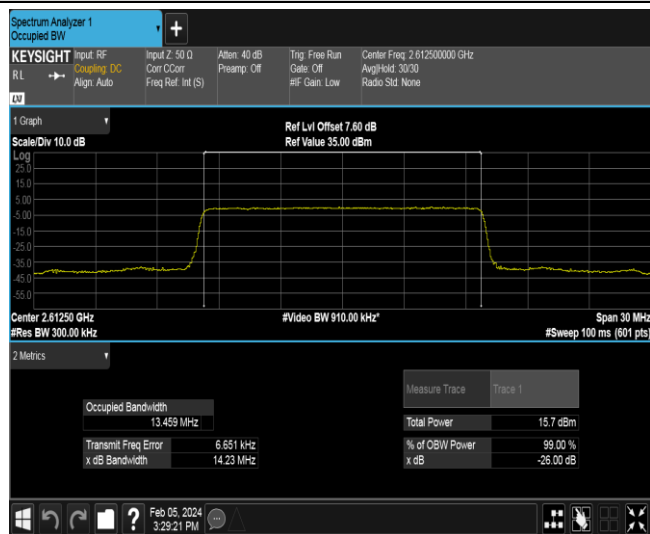

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15 days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-QPSK-37850-100RB#0

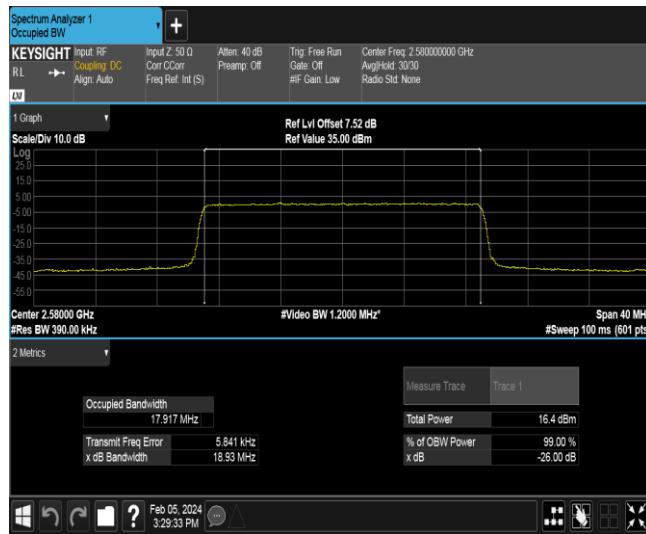

Band38-20MHz-QPSK-38000-100RB#0




Band38-20MHz-QPSK-38150-100RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band38-20MHz-16QAM-37850-100RB#0

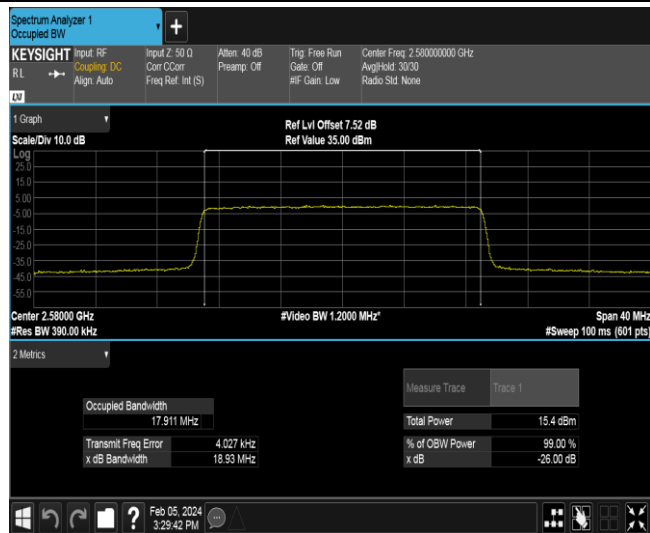


Band38-20MHz-16QAM-38000-100RB#0

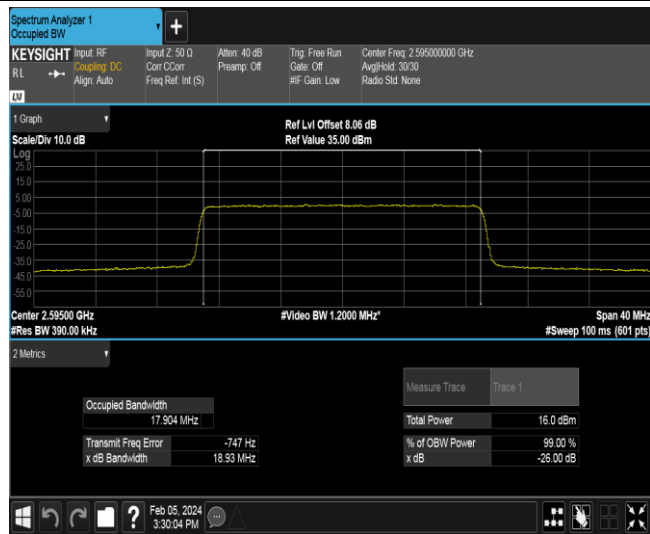

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-16QAM-38150-100RB#0

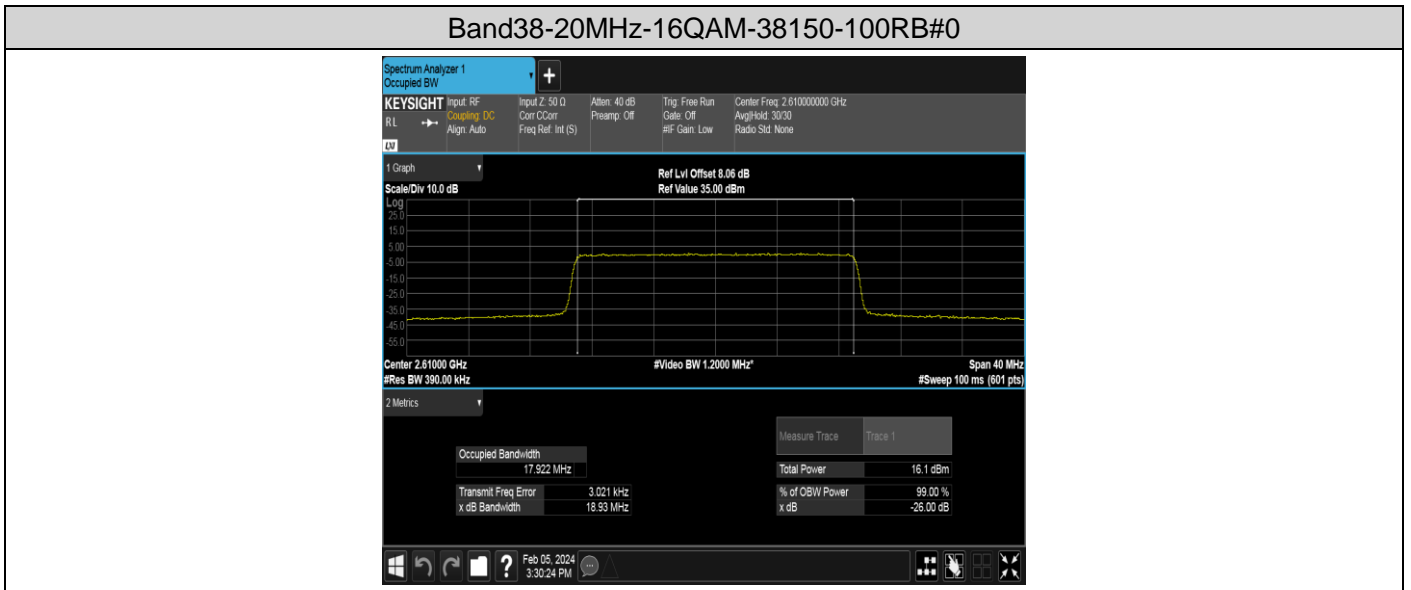

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix D: Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	-49.25,-50.02,-38.60,-20.23	PASS
Band38	5MHz	QPSK	37775	1RB#24	-49.88,-50.32,-38.48,-42.78	PASS
Band38	5MHz	QPSK	37775	25RB#0	-48.99,-49.02,-42.79,-33.55	PASS
Band38	5MHz	QPSK	38225	1RB#0	-43.78,-39.02,-49.74,-48.98	PASS
Band38	5MHz	QPSK	38225	1RB#24	-19.55,-32.78,-49.07,-49.63	PASS
Band38	5MHz	QPSK	38225	25RB#0	-33.71,-38.18,-48.38,-48.78	PASS
Band38	5MHz	16QAM	37775	1RB#0	-49.78,-49.44,-40.27,-21.07	PASS
Band38	5MHz	16QAM	37775	1RB#24	-49.36,-50.54,-38.32,-43.44	PASS
Band38	5MHz	16QAM	37775	25RB#0	-49.52,-49.27,-39.51,-34.91	PASS
Band38	5MHz	16QAM	38225	1RB#0	-42.48,-38.21,-49.74,-49.82	PASS
Band38	5MHz	16QAM	38225	1RB#24	-21.90,-35.87,-49.44,-48.68	PASS
Band38	5MHz	16QAM	38225	25RB#0	-34.73,-39.83,-48.07,-48.75	PASS
Band38	10MHz	QPSK	37800	1RB#0	-45.95,-44.15,-29.49,-23.70	PASS
Band38	10MHz	QPSK	37800	1RB#49	-47.67,-36.11,-42.30,-43.47	PASS
Band38	10MHz	QPSK	37800	50RB#0	-46.88,-42.96,-41.10,-38.56	PASS
Band38	10MHz	QPSK	38200	1RB#0	-42.94,-45.50,-35.06,-47.17	PASS
Band38	10MHz	QPSK	38200	1RB#49	-23.64,-35.90,-45.68,-46.82	PASS
Band38	10MHz	QPSK	38200	50RB#0	-34.65,-39.21,-41.36,-47.00	PASS
Band38	10MHz	16QAM	37800	1RB#0	-46.16,-44.16,-31.94,-22.78	PASS
Band38	10MHz	16QAM	37800	1RB#49	-47.43,-33.39,-45.37,-43.52	PASS
Band38	10MHz	16QAM	37800	50RB#0	-47.00,-43.39,-40.97,-37.09	PASS
Band38	10MHz	16QAM	38200	1RB#0	-43.78,-46.28,-36.45,-47.45	PASS
Band38	10MHz	16QAM	38200	1RB#49	-23.73,-34.99,-44.17,-46.19	PASS
Band38	10MHz	16QAM	38200	50RB#0	-35.14,-39.41,-41.86,-46.81	PASS
Band38	15MHz	QPSK	37825	1RB#0	-46.06,-44.40,-37.91,-25.01	PASS
Band38	15MHz	QPSK	37825	1RB#74	-46.30,-32.67,-46.05,-39.47	PASS
Band38	15MHz	QPSK	37825	75RB#0	-45.03,-41.05,-39.92,-38.03	PASS
Band38	15MHz	QPSK	38175	1RB#0	-38.93,-45.28,-32.41,-46.43	PASS
Band38	15MHz	QPSK	38175	1RB#74	-25.64,-37.18,-41.97,-45.96	PASS
Band38	15MHz	QPSK	38175	75RB#0	-35.24,-38.04,-39.56,-45.45	PASS
Band38	15MHz	16QAM	37825	1RB#0	-46.21,-44.79,-34.24,-24.83	PASS
Band38	15MHz	16QAM	37825	1RB#74	-45.99,-34.50,-45.64,-40.18	PASS
Band38	15MHz	16QAM	37825	75RB#0	-45.68,-41.15,-39.38,-36.02	PASS
Band38	15MHz	16QAM	38175	1RB#0	-39.54,-45.85,-33.36,-45.84	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	16QAM	38175	1RB#74	-25.84,-35.42,-43.95,-46.02	PASS
Band38	15MHz	16QAM	38175	75RB#0	-34.71,-37.85,-39.61,-45.22	PASS
Band38	20MHz	QPSK	37850	1RB#0	-45.18,-40.06,-34.39,-27.19	PASS
Band38	20MHz	QPSK	37850	1RB#99	-45.36,-33.19,-44.82,-39.42	PASS
Band38	20MHz	QPSK	37850	100RB#0	-44.94,-41.37,-39.97,-38.44	PASS
Band38	20MHz	QPSK	38150	1RB#0	-38.79,-44.70,-31.10,-45.32	PASS
Band38	20MHz	QPSK	38150	1RB#99	-24.48,-35.62,-38.96,-45.17	PASS
Band38	20MHz	QPSK	38150	100RB#0	-36.89,-38.51,-40.52,-44.54	PASS
Band38	20MHz	16QAM	37850	1RB#0	-45.30,-43.87,-33.71,-25.06	PASS
Band38	20MHz	16QAM	37850	1RB#99	-45.15,-34.20,-44.53,-40.04	PASS
Band38	20MHz	16QAM	37850	100RB#0	-45.14,-41.35,-40.10,-38.78	PASS
Band38	20MHz	16QAM	38150	1RB#0	-39.17,-44.81,-31.74,-45.35	PASS
Band38	20MHz	16QAM	38150	1RB#99	-26.41,-34.71,-43.71,-45.19	PASS
Band38	20MHz	16QAM	38150	100RB#0	-38.26,-38.85,-40.08,-44.55	PASS


Test Graphs

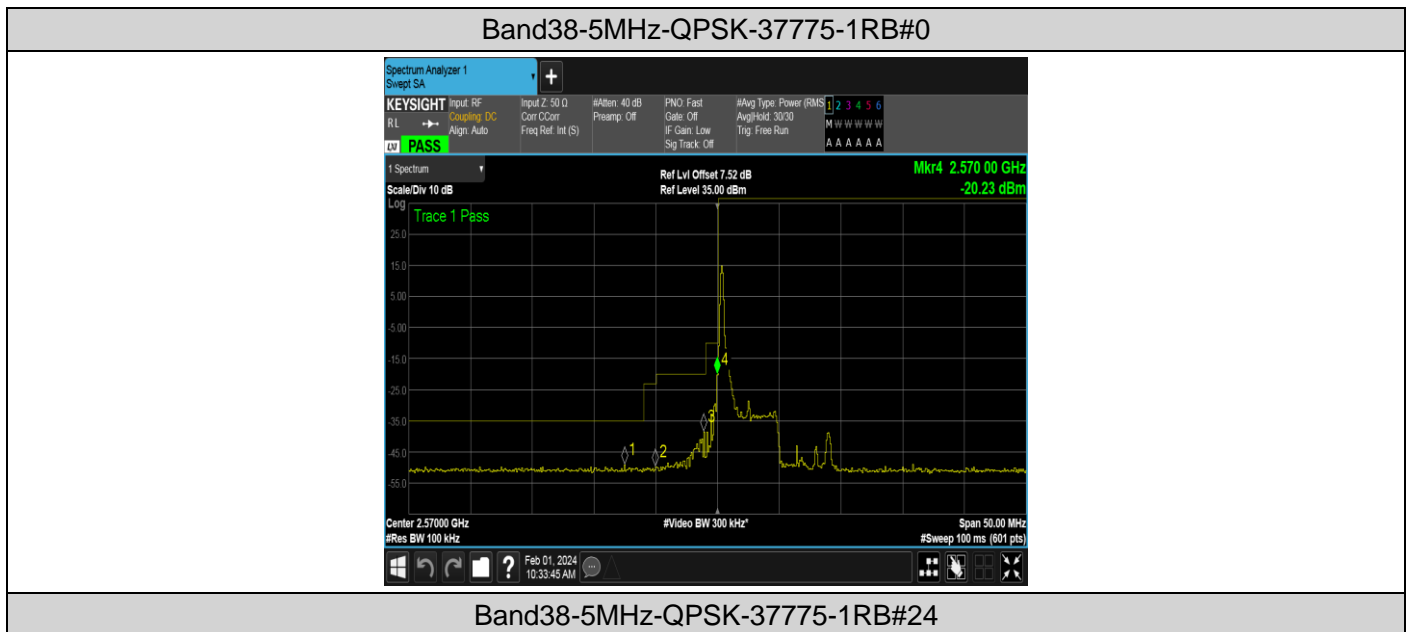

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

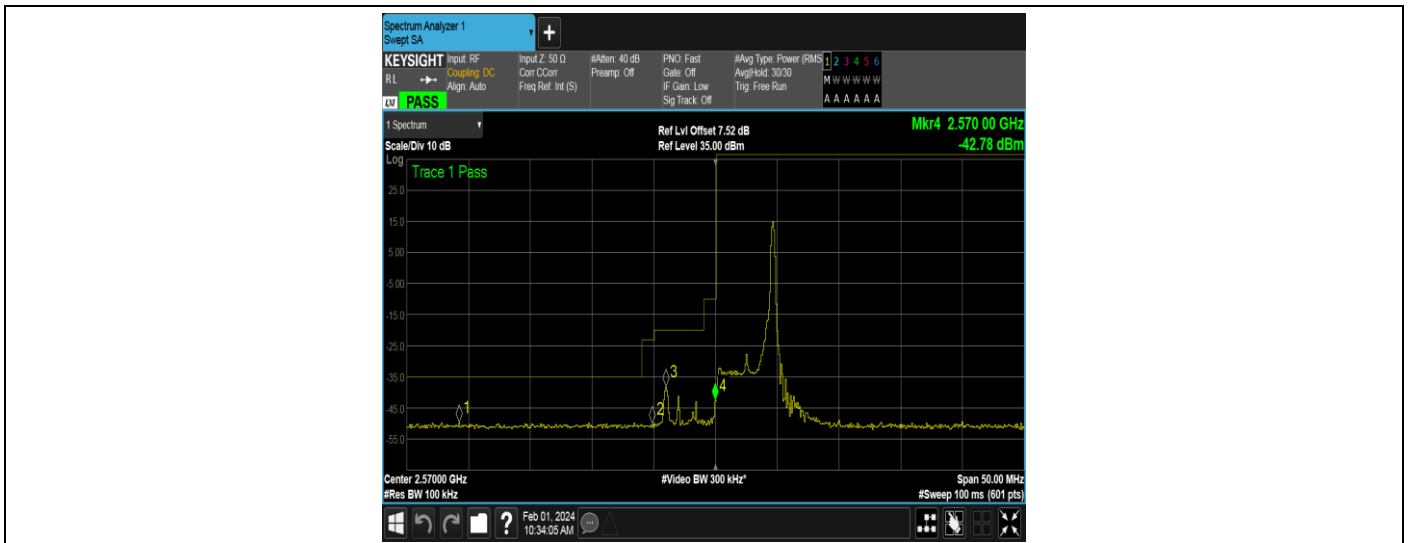

Band38-5MHz-QPSK-37775-25RB#0

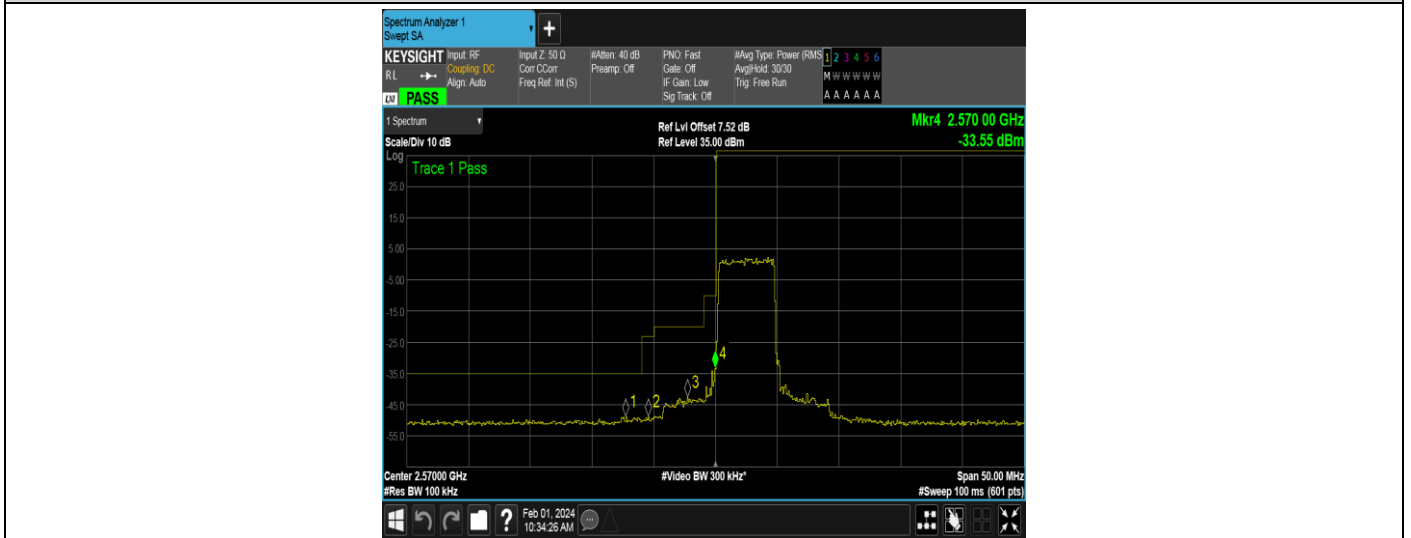

Band38-5MHz-QPSK-38225-1RB#0




Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-QPSK-38225-1RB#24




Band38-5MHz-QPSK-38225-25RB#0

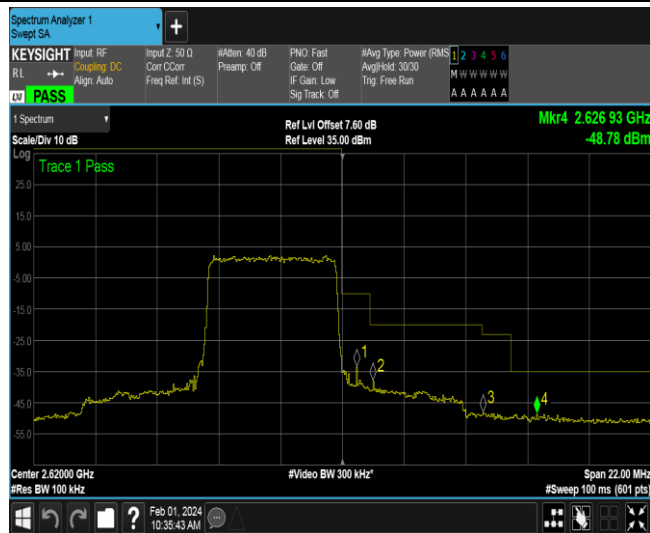

Band38-5MHz-16QAM-37775-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: http://www.agccert.com/

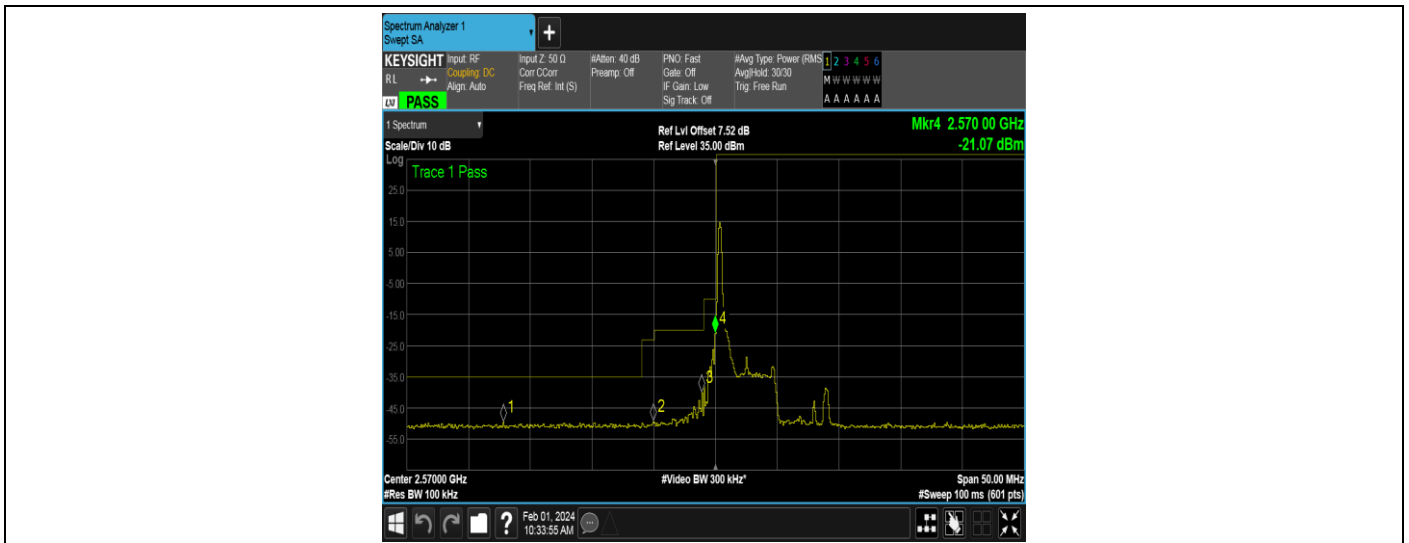

Band38-5MHz-16QAM-37775-1RB#24




Band38-5MHz-16QAM-37775-25RB#0

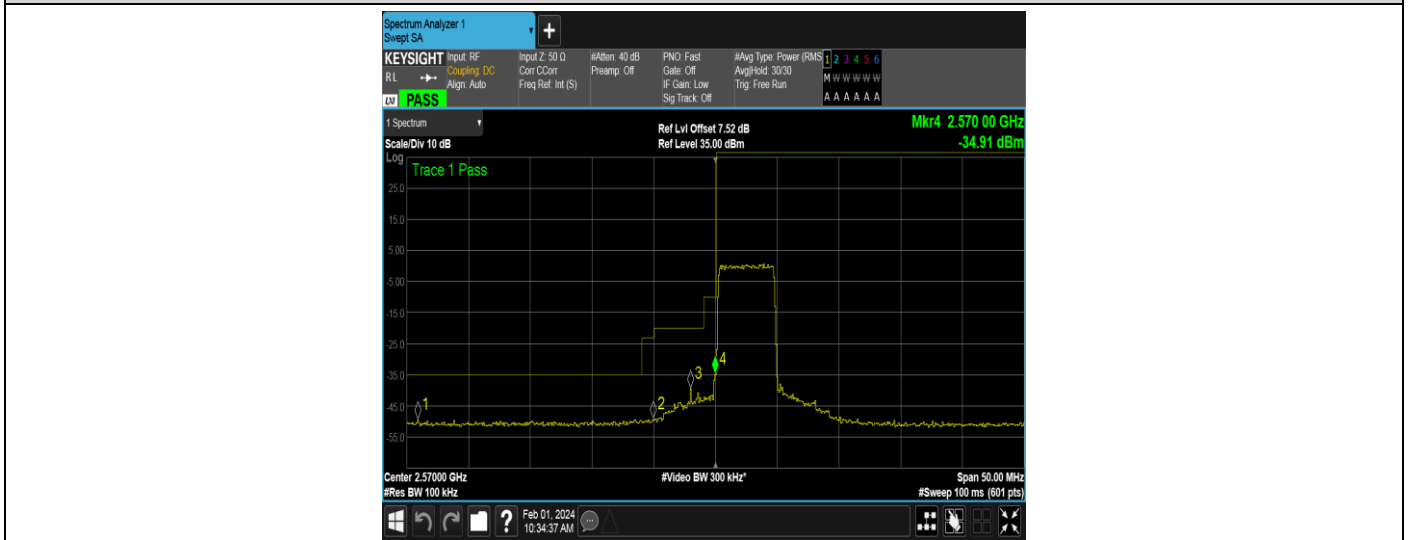

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-16QAM-38225-1RB#0

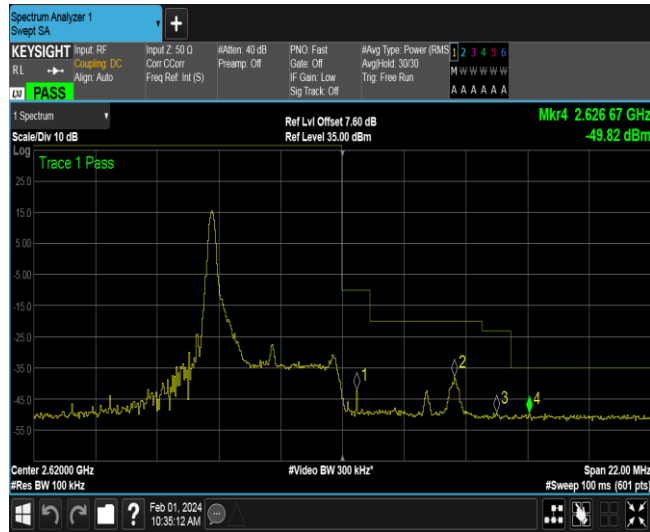

Band38-5MHz-16QAM-38225-1RB#24



Band38-5MHz-16QAM-38225-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: http://www.agccert.com/