





Band38-5MHz-16QAM-38225-1RB#24

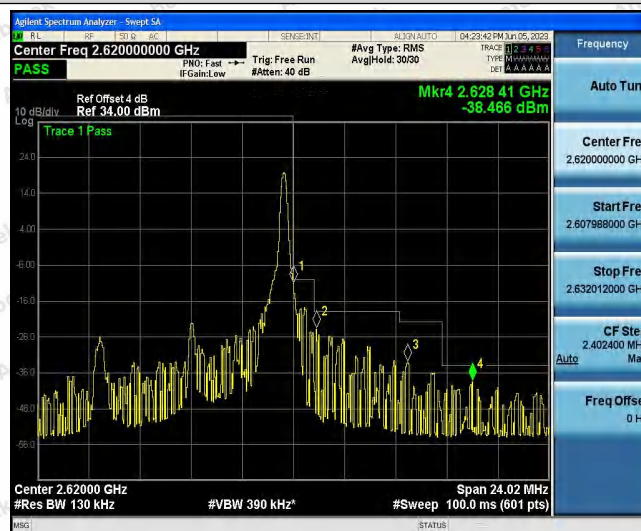

Band38-5MHz-16QAM-38225-25RB#0

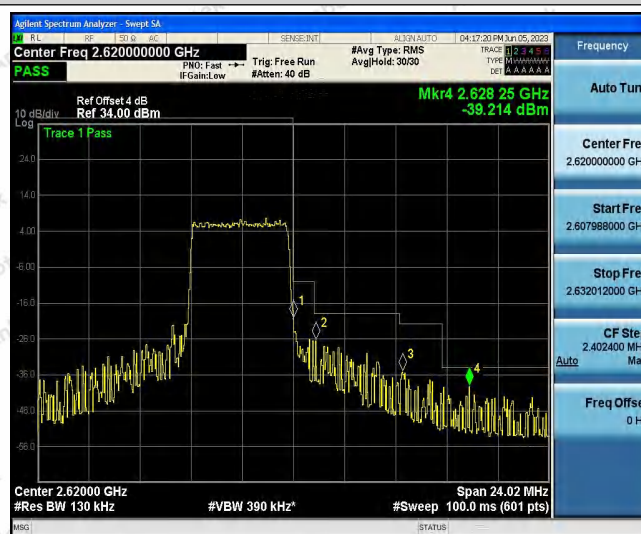

Band38-10MHz-QPSK-37800-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band38-10MHz-QPSK-37800-1RB#49



Band38-10MHz-QPSK-37800-50RB#0

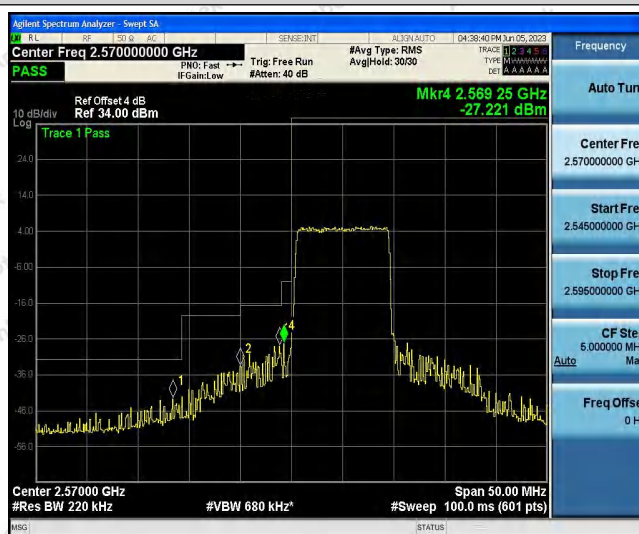

Band38-10MHz-QPSK-38200-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




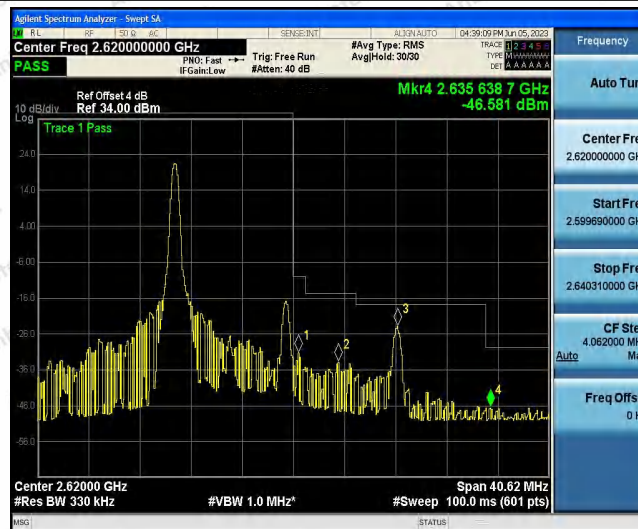

Band38-10MHz-QPSK-38200-1RB#49

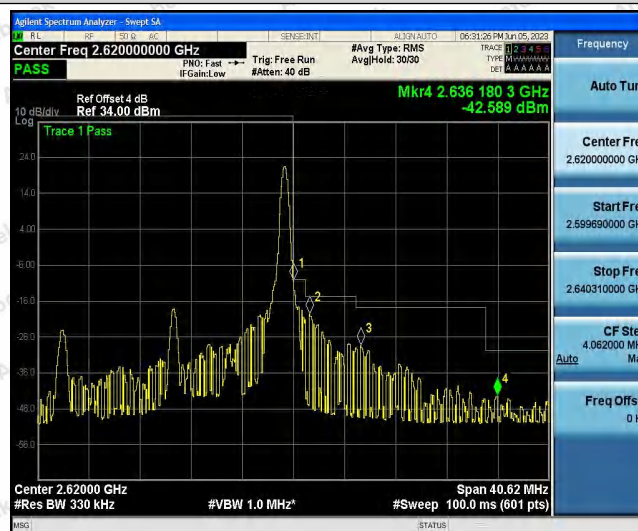

Band38-10MHz-QPSK-38200-50RB#0

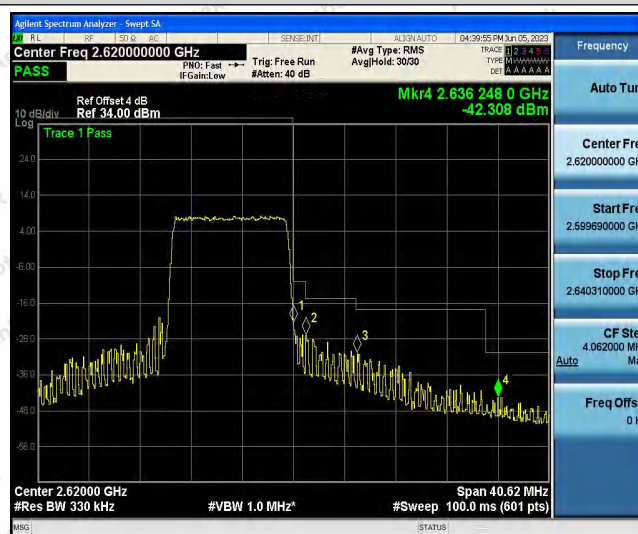

Band38-10MHz-16QAM-37800-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band38-10MHz-16QAM-37800-1RB#49



Band38-10MHz-16QAM-37800-50RB#0

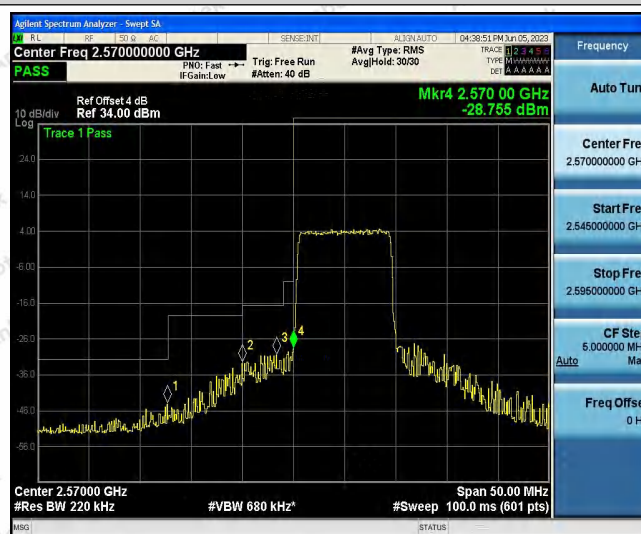

Band38-10MHz-16QAM-38200-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




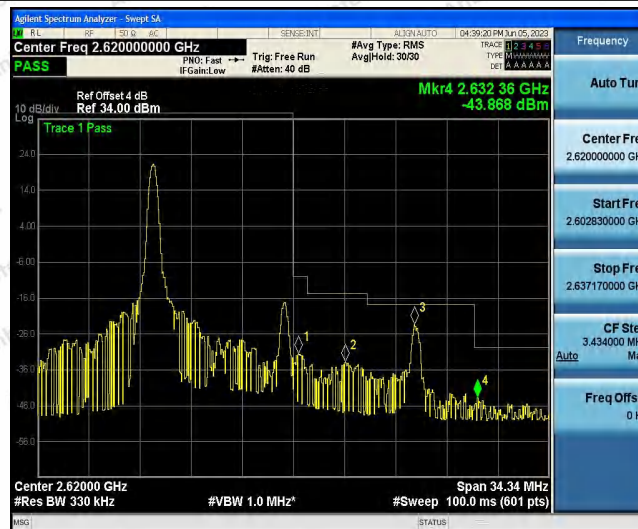

Band38-10MHz-16QAM-38200-1RB#49

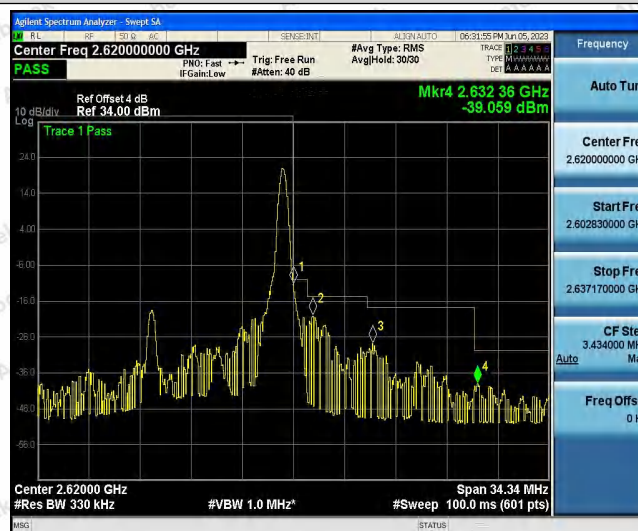

Band38-10MHz-16QAM-38200-50RB#0

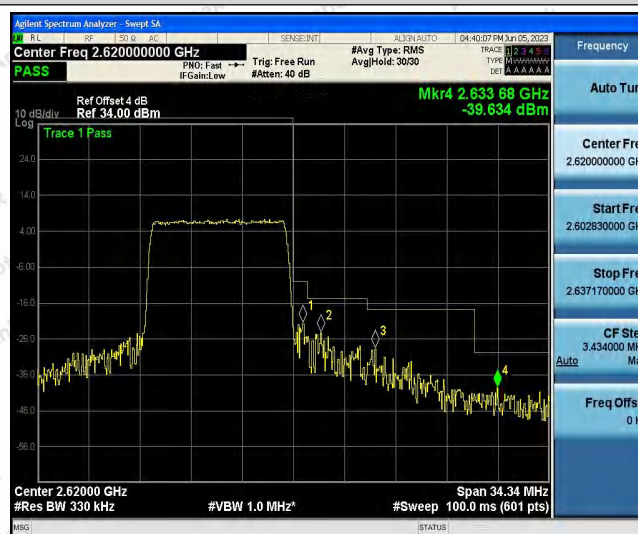

Band38-15MHz-QPSK-37825-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



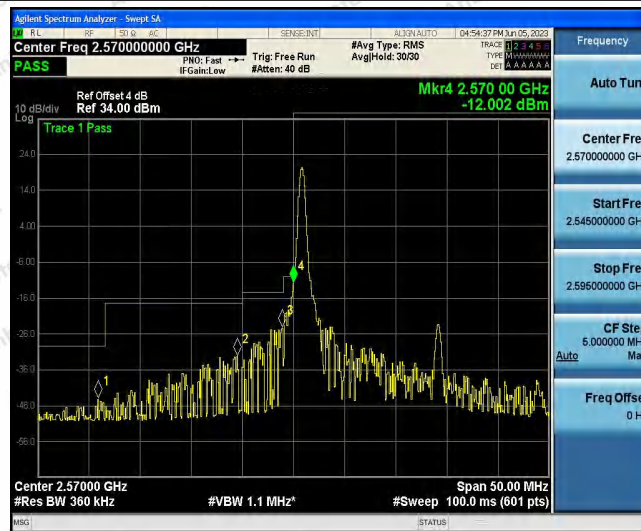

Band38-15MHz-QPSK-37825-1RB#74



Band38-15MHz-QPSK-37825-75RB#0



Band38-15MHz-QPSK-38175-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band38-15MHz-QPSK-38175-1RB#74



Band38-15MHz-QPSK-38175-75RB#0

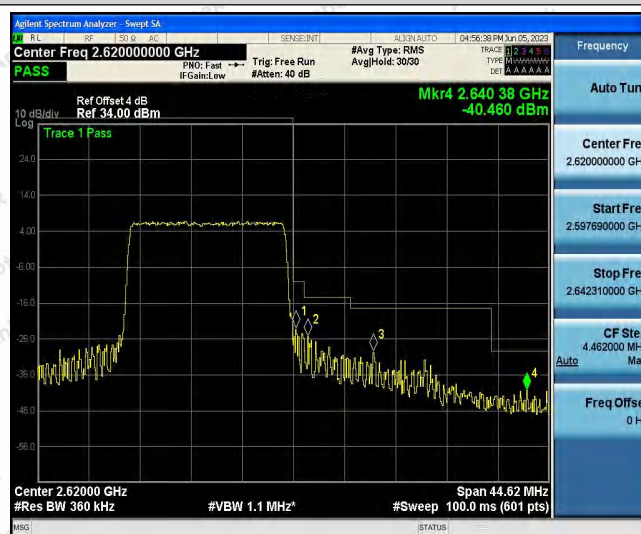

Band38-15MHz-16QAM-37825-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




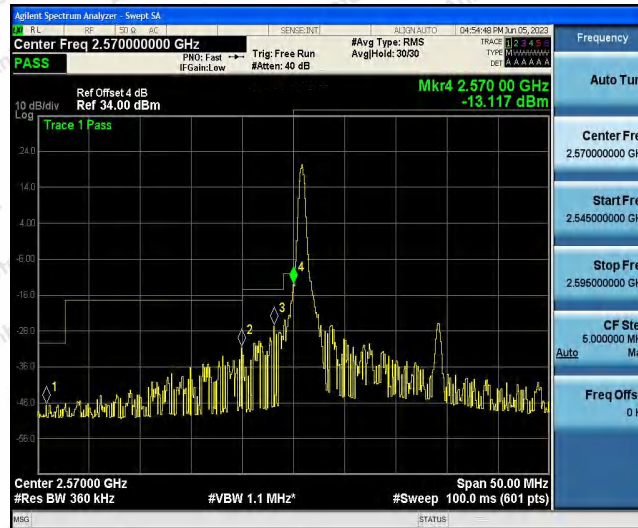

Band38-15MHz-16QAM-37825-1RB#74

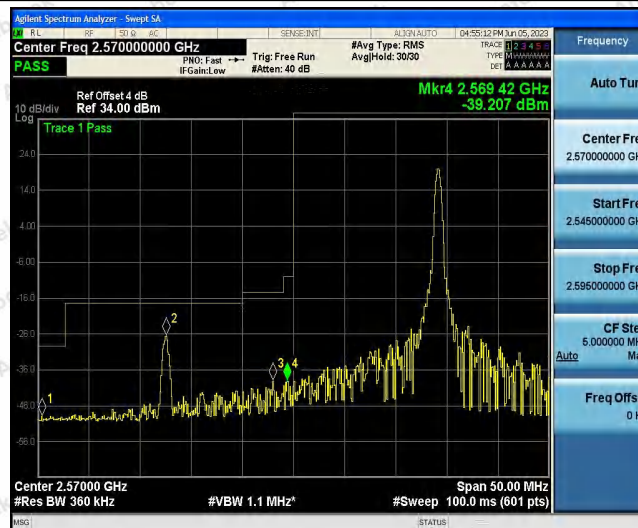

Band38-15MHz-16QAM-37825-75RB#0

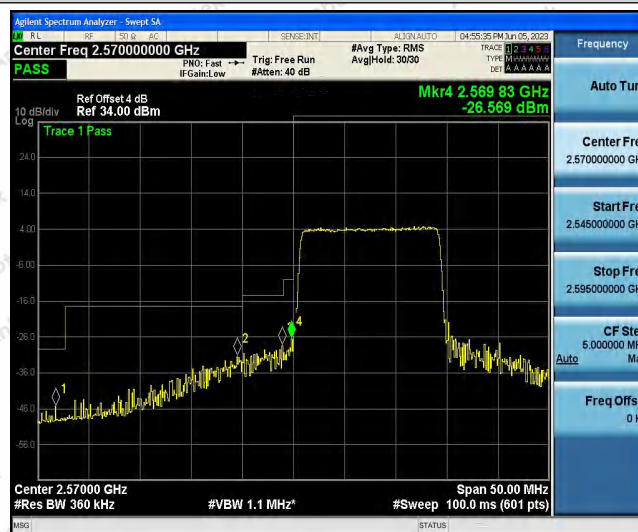

Band38-15MHz-16QAM-38175-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




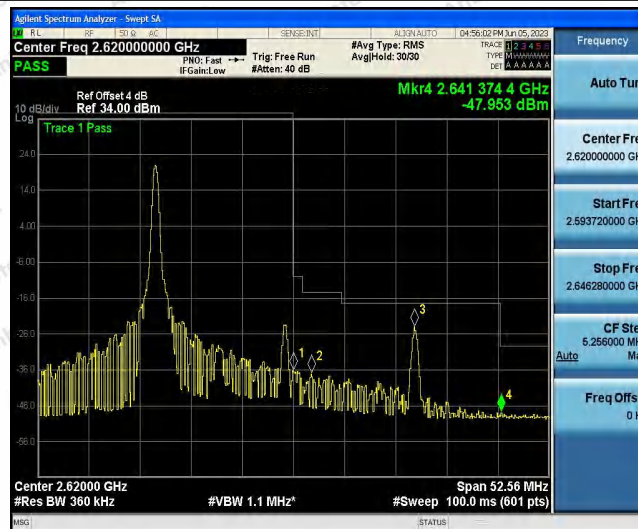

Band38-15MHz-16QAM-38175-1RB#74

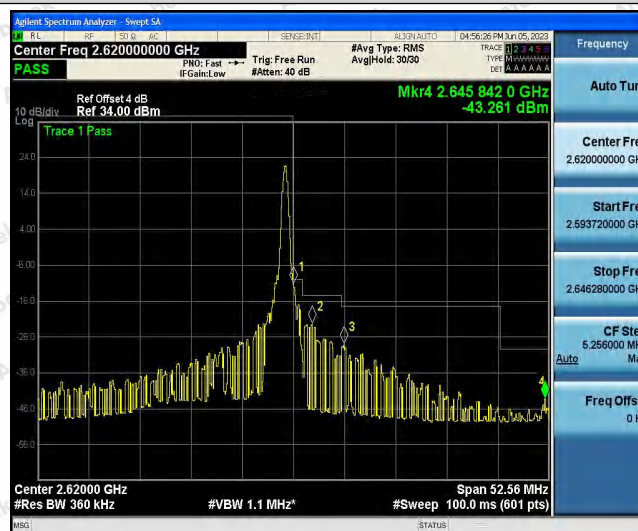

Band38-15MHz-16QAM-38175-75RB#0

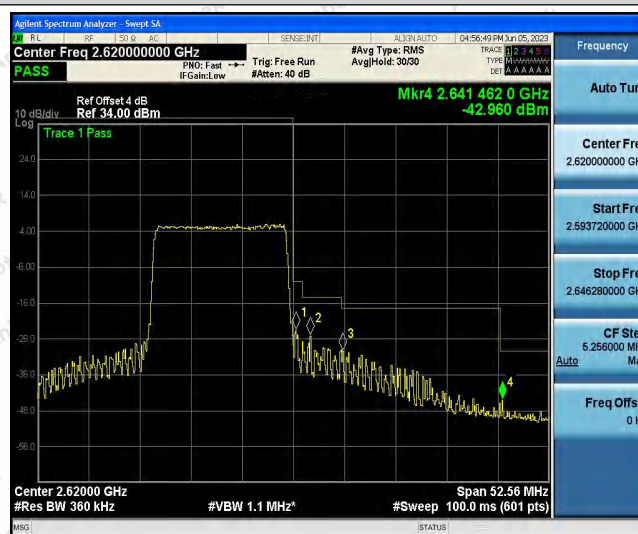

Band38-20MHz-QPSK-37850-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band38-20MHz-QPSK-37850-1RB#99

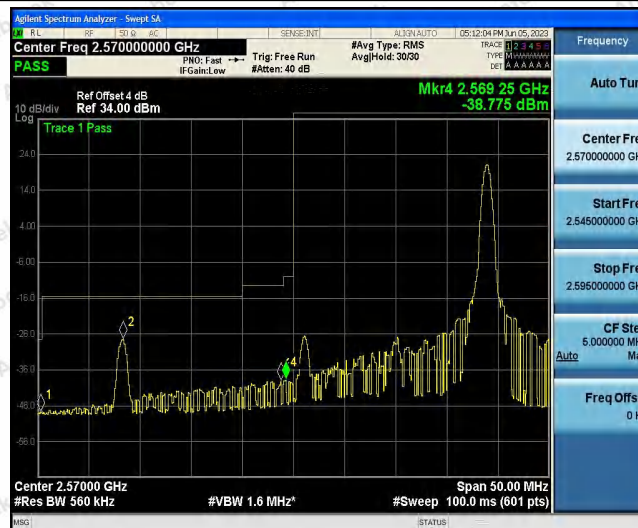

Band38-20MHz-QPSK-37850-100RB#0



Band38-20MHz-QPSK-38150-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band38-20MHz-QPSK-38150-1RB#99



Band38-20MHz-QPSK-38150-100RB#0

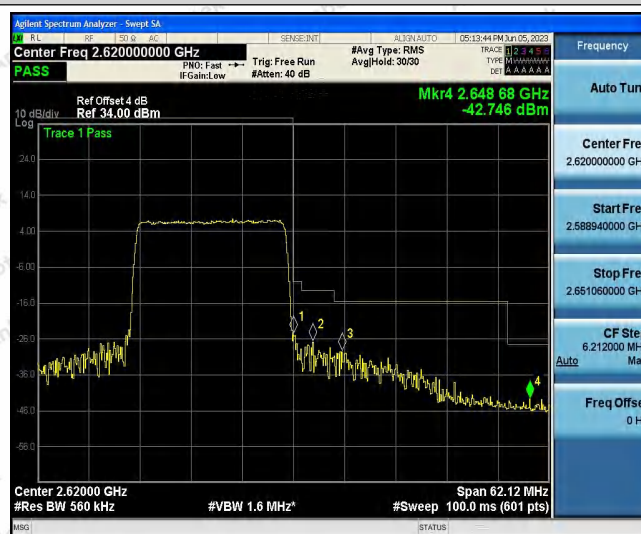

Band38-20MHz-16QAM-37850-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




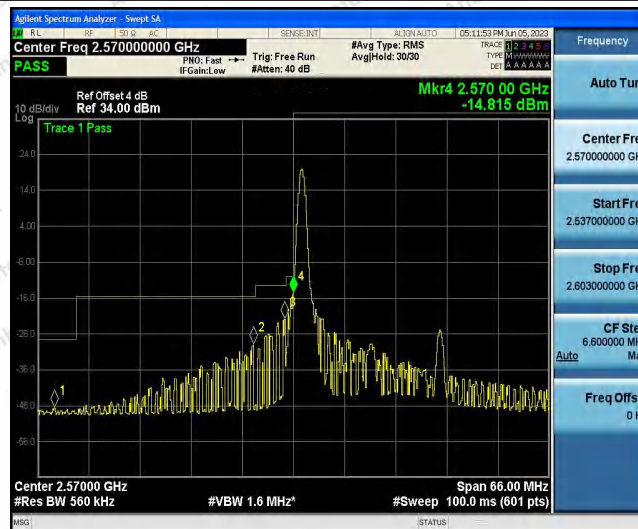

Band38-20MHz-16QAM-37850-1RB#99

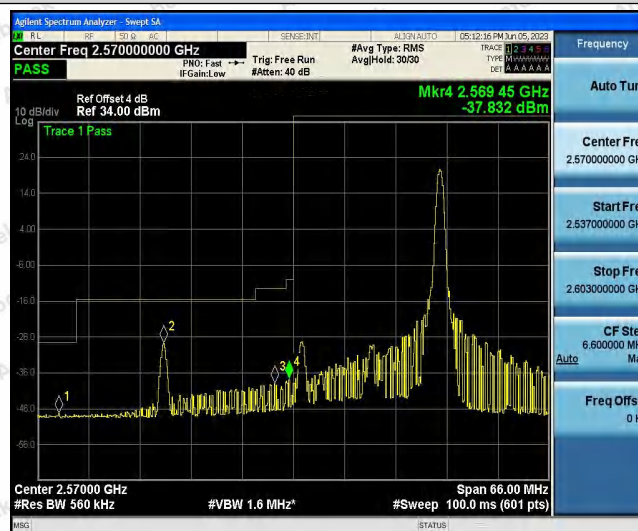

Band38-20MHz-16QAM-37850-100RB#0

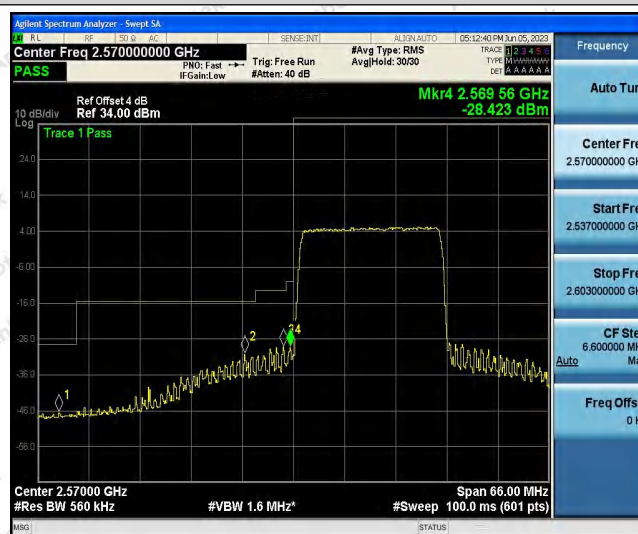

Band38-20MHz-16QAM-38150-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




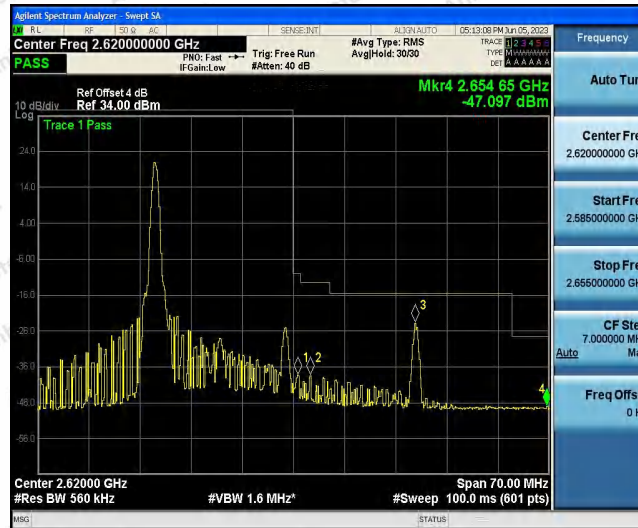

Band38-20MHz-16QAM-38150-1RB#99

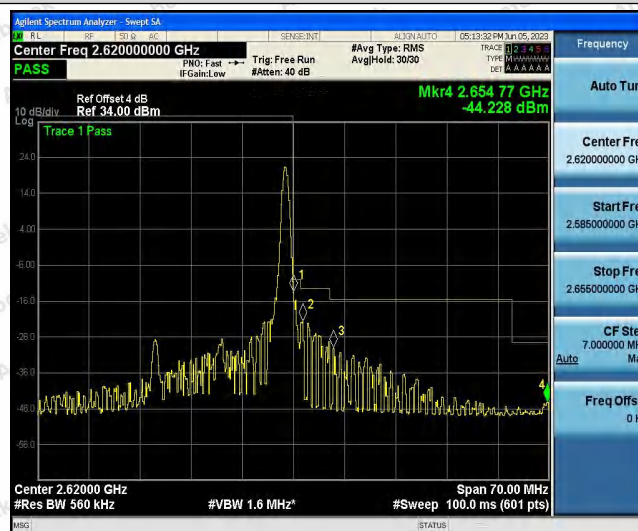

Band38-20MHz-16QAM-38150-100RB#0

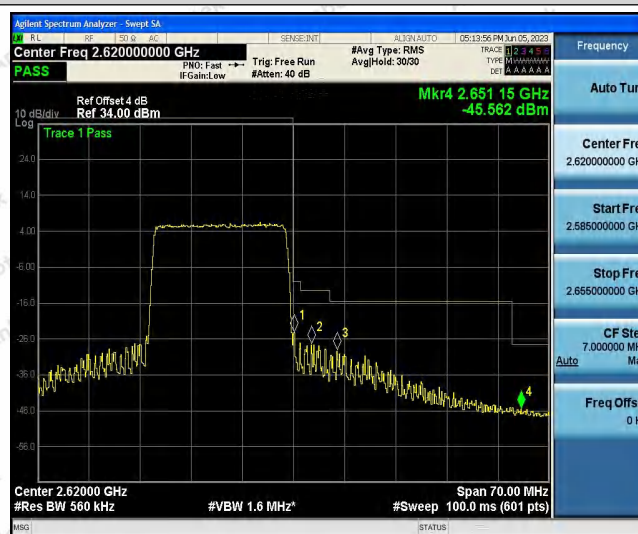

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	Range1:30~1000MHz	-57.01	PASS
Band38	5MHz	QPSK	37775	1RB#0	Range2:1000~27000MHz	-33.52	PASS
Band38	5MHz	QPSK	38000	1RB#0	Range1:30~1000MHz	-57.55	PASS
Band38	5MHz	QPSK	38000	1RB#0	Range2:1000~27000MHz	-34.13	PASS
Band38	5MHz	QPSK	38225	1RB#0	Range1:30~1000MHz	-56.77	PASS
Band38	5MHz	QPSK	38225	1RB#0	Range2:1000~27000MHz	-33	PASS
Band38	5MHz	16QAM	37775	1RB#0	Range1:30~1000MHz	-57.33	PASS
Band38	5MHz	16QAM	37775	1RB#0	Range2:1000~27000MHz	-33.54	PASS
Band38	5MHz	16QAM	38000	1RB#0	Range1:30~1000MHz	-55.8	PASS
Band38	5MHz	16QAM	38000	1RB#0	Range2:1000~27000MHz	-33.4	PASS
Band38	5MHz	16QAM	38225	1RB#0	Range1:30~1000MHz	-56.83	PASS
Band38	5MHz	16QAM	38225	1RB#0	Range2:1000~27000MHz	-33.67	PASS
Band38	10MHz	QPSK	37800	1RB#0	Range1:30~1000MHz	-56.72	PASS
Band38	10MHz	QPSK	37800	1RB#0	Range2:1000~27000MHz	-33.55	PASS
Band38	10MHz	QPSK	38000	1RB#0	Range1:30~1000MHz	-57.53	PASS
Band38	10MHz	QPSK	38000	1RB#0	Range2:1000~27000MHz	-32.63	PASS
Band38	10MHz	QPSK	38200	1RB#0	Range1:30~1000MHz	-56.23	PASS
Band38	10MHz	QPSK	38200	1RB#0	Range2:1000~27000MHz	-32.04	PASS



Band38	10MHz	16QAM	37800	1RB#0	Range1:30~1000MHz	-56.88	PASS
Band38	10MHz	16QAM	37800	1RB#0	Range2:1000~27000MHz	-33.24	PASS
Band38	10MHz	16QAM	38000	1RB#0	Range1:30~1000MHz	-56.95	PASS
Band38	10MHz	16QAM	38000	1RB#0	Range2:1000~27000MHz	-33.59	PASS
Band38	10MHz	16QAM	38200	1RB#0	Range1:30~1000MHz	-56.75	PASS
Band38	10MHz	16QAM	38200	1RB#0	Range2:1000~27000MHz	-33.52	PASS
Band38	15MHz	QPSK	37825	1RB#0	Range1:30~1000MHz	-56.99	PASS
Band38	15MHz	QPSK	37825	1RB#0	Range2:1000~27000MHz	-33.83	PASS
Band38	15MHz	QPSK	38000	1RB#0	Range1:30~1000MHz	-56.54	PASS
Band38	15MHz	QPSK	38000	1RB#0	Range2:1000~27000MHz	-33.19	PASS
Band38	15MHz	QPSK	38175	1RB#0	Range1:30~1000MHz	-51.31	PASS
Band38	15MHz	QPSK	38175	1RB#0	Range2:1000~27000MHz	-33.65	PASS
Band38	15MHz	16QAM	37825	1RB#0	Range1:30~1000MHz	-57.61	PASS
Band38	15MHz	16QAM	37825	1RB#0	Range2:1000~27000MHz	-33.52	PASS
Band38	15MHz	16QAM	38000	1RB#0	Range1:30~1000MHz	-56.47	PASS
Band38	15MHz	16QAM	38000	1RB#0	Range2:1000~27000MHz	-32.83	PASS
Band38	15MHz	16QAM	38175	1RB#0	Range1:30~1000MHz	-56.97	PASS
Band38	15MHz	16QAM	38175	1RB#0	Range2:1000~27000MHz	-33.33	PASS
Band38	20MHz	QPSK	37850	1RB#0	Range1:30~1000MHz	-56.62	PASS
Band38	20MHz	QPSK	37850	1RB#0	Range2:1000~27000MHz	-32.65	PASS
Band38	20MHz	QPSK	38000	1RB#0	Range1:30~1000MHz	-57.19	PASS
Band38	20MHz	QPSK	38000	1RB#0	Range2:1000~	-33.42	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



					27000MHz		
Band38	20MHz	QPSK	38150	1RB#0	Range1:30~1000MHz	-56.69	PASS
Band38	20MHz	QPSK	38150	1RB#0	Range2:1000~27000MHz	-33.36	PASS
Band38	20MHz	16QAM	37850	1RB#0	Range1:30~1000MHz	-57.01	PASS
Band38	20MHz	16QAM	37850	1RB#0	Range2:1000~27000MHz	-34.02	PASS
Band38	20MHz	16QAM	38000	1RB#0	Range1:30~1000MHz	-57.16	PASS
Band38	20MHz	16QAM	38000	1RB#0	Range2:1000~27000MHz	-32.78	PASS
Band38	20MHz	16QAM	38150	1RB#0	Range1:30~1000MHz	-53.12	PASS
Band38	20MHz	16QAM	38150	1RB#0	Range2:1000~27000MHz	-33.98	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
www.anbotek.com.cn



Test Graphs


Band38-5MHz-QPSK-37775-1RB#0-Range1:30~1000MHz

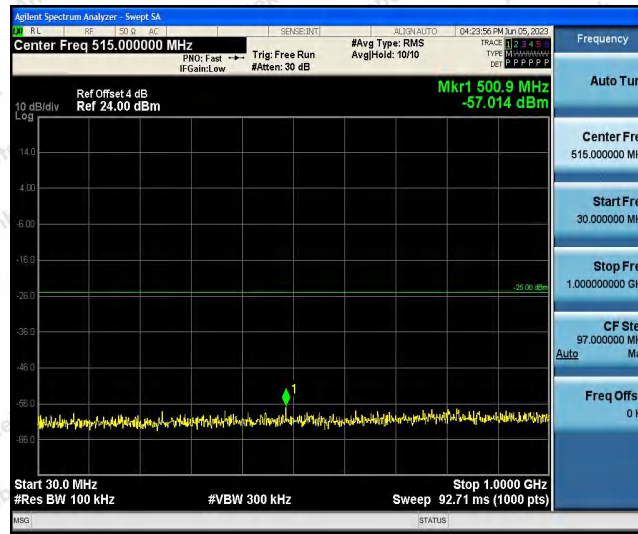

Band38-5MHz-QPSK-37775-1RB#0-Range2:1000~27000MHz



Band38-5MHz-QPSK-38000-1RB#0-Range1:30~1000MHz

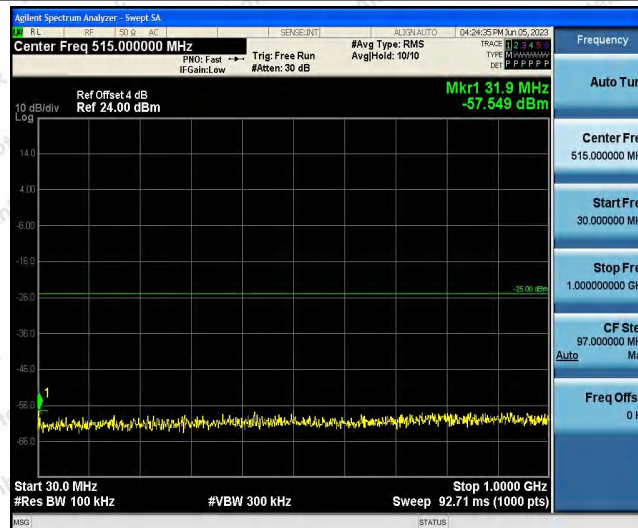

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



Band38-5MHz-QPSK-38000-1RB#0-Range2:1000~27000MHz



Band38-5MHz-QPSK-38225-1RB#0-Range1:30~1000MHz

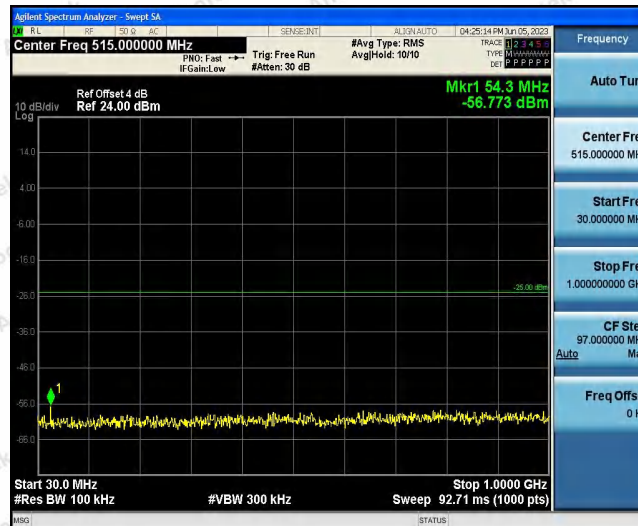

Band38-5MHz-QPSK-38225-1RB#0-Range2:1000~27000MHz



Band38-5MHz-16QAM-37775-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




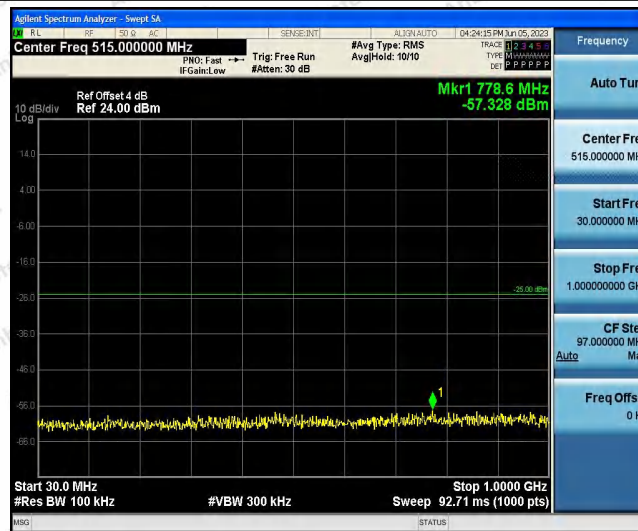

Band38-5MHz-16QAM-37775-1RB#0-Range2:1000~27000MHz

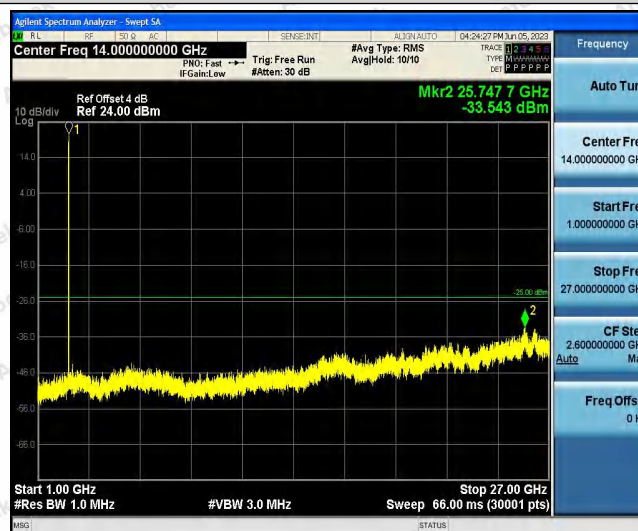

Band38-5MHz-16QAM-38000-1RB#0-Range1:30~1000MHz

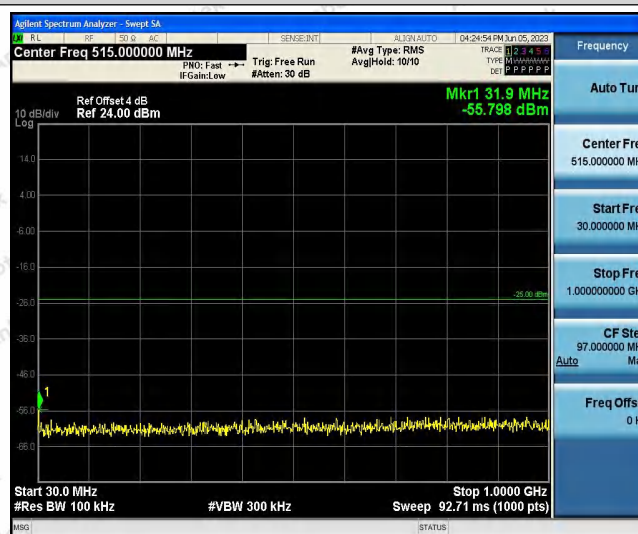

Band38-5MHz-16QAM-38000-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band38-5MHz-16QAM-38225-1RB#0-Range1:30~1000MHz

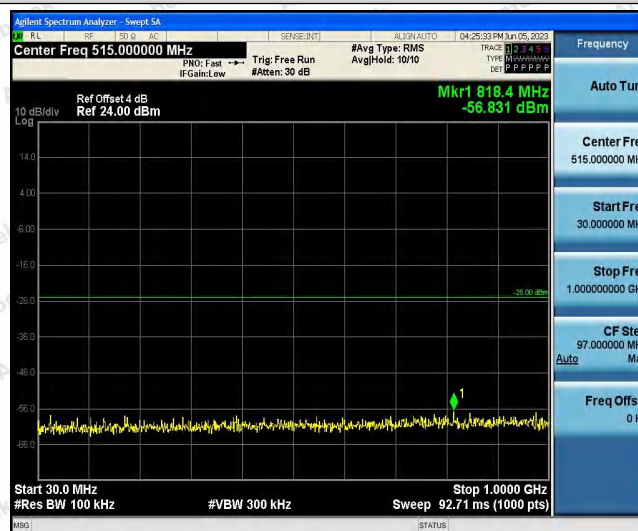

Band38-5MHz-16QAM-38225-1RB#0-Range2:1000~27000MHz



Band38-10MHz-QPSK-37800-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band38-10MHz-QPSK-37800-1RB#0-Range2:1000~27000MHz



Band38-10MHz-QPSK-38000-1RB#0-Range1:30~1000MHz

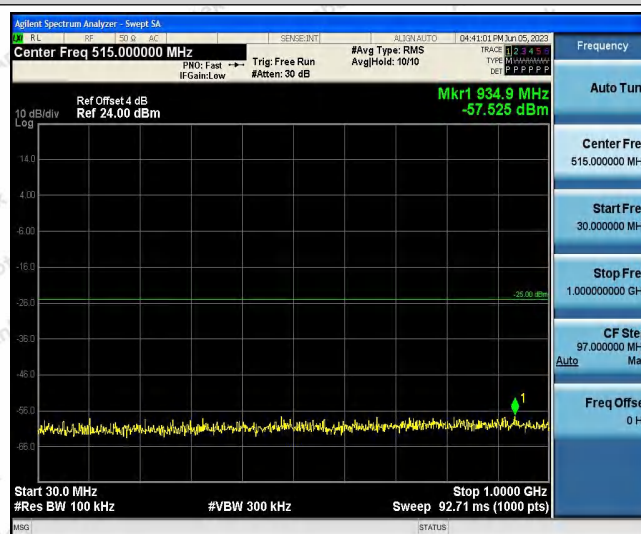


Band38-10MHz-QPSK-38000-1RB#0-Range2:1000~27000MHz





Band38-10MHz-QPSK-38200-1RB#0-Range1:30~1000MHz

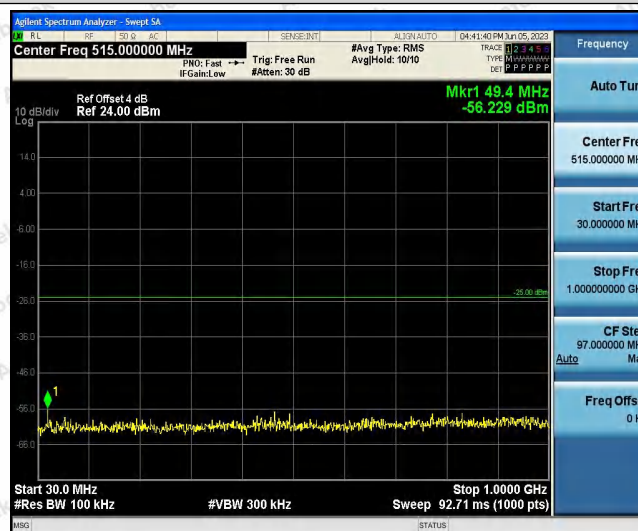

Band38-10MHz-QPSK-38200-1RB#0-Range2: 1000~27000MHz



Band38-10MHz-16QAM-37800-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




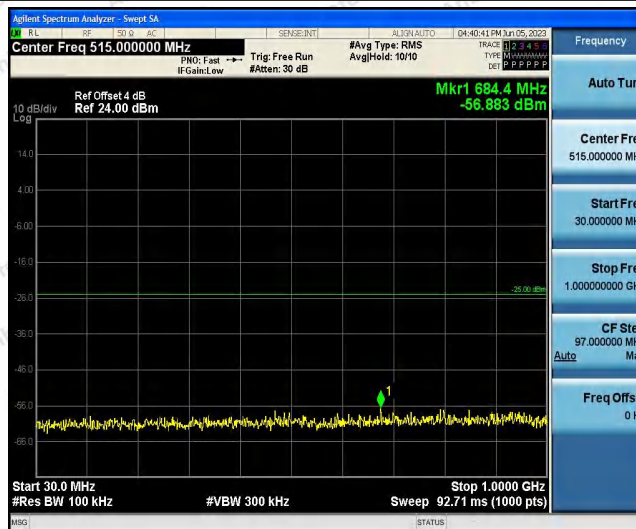

Band38-10MHz-16QAM-37800-1RB#0-Range2:1000~27000MHz



Band38-10MHz-16QAM-38000-1RB#0-Range1:30~1000MHz

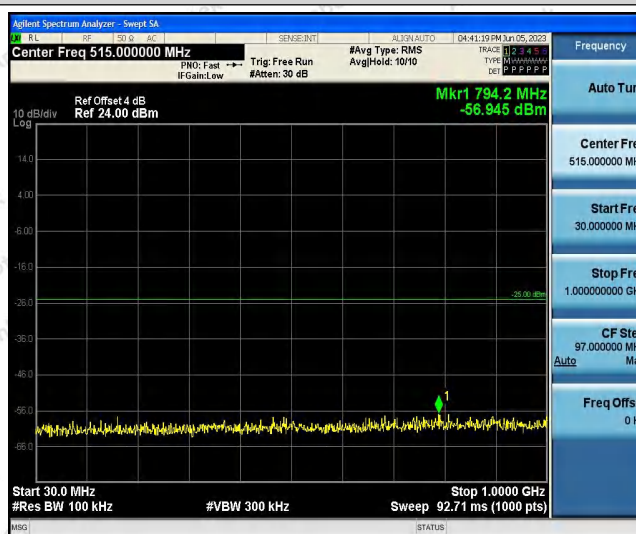

Band38-10MHz-16QAM-38000-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band38-10MHz-16QAM-38200-1RB#0-Range1:30~1000MHz

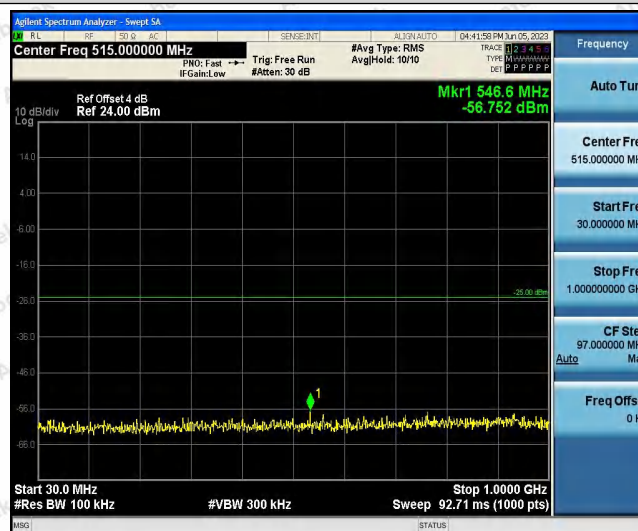

Band38-10MHz-16QAM-38200-1RB#0-Range2:1000~27000MHz



Band38-15MHz-QPSK-37825-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




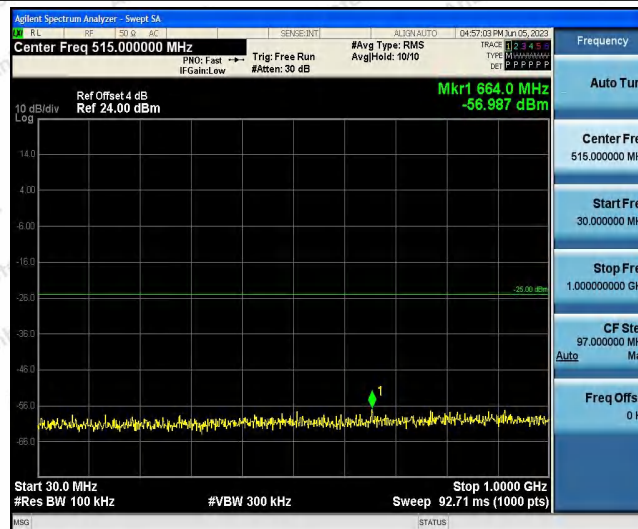

Band38-15MHz-QPSK-37825-1RB#0-Range2:1000~27000MHz



Band38-15MHz-QPSK-38000-1RB#0-Range1:30~1000MHz

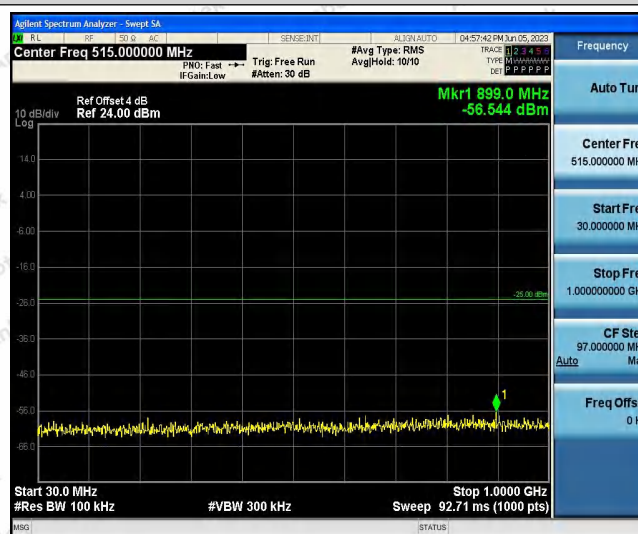

Band38-15MHz-QPSK-38000-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band38-15MHz-QPSK-38175-1RB#0-Range1:30~1000MHz

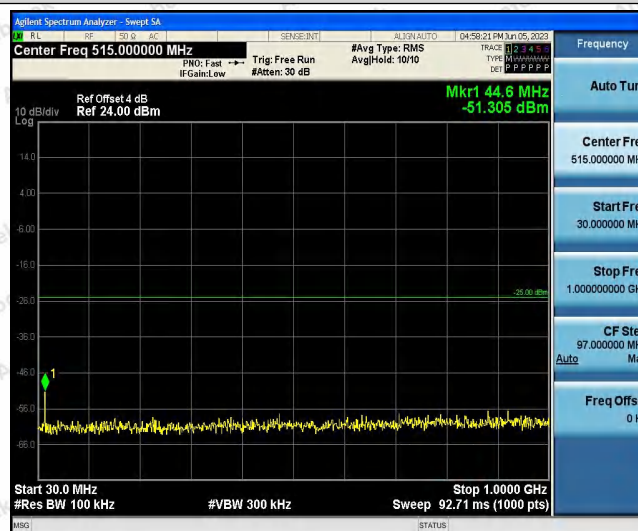

Band38-15MHz-QPSK-38175-1RB#0-Range2: 1000~27000MHz



Band38-15MHz-16QAM-37825-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




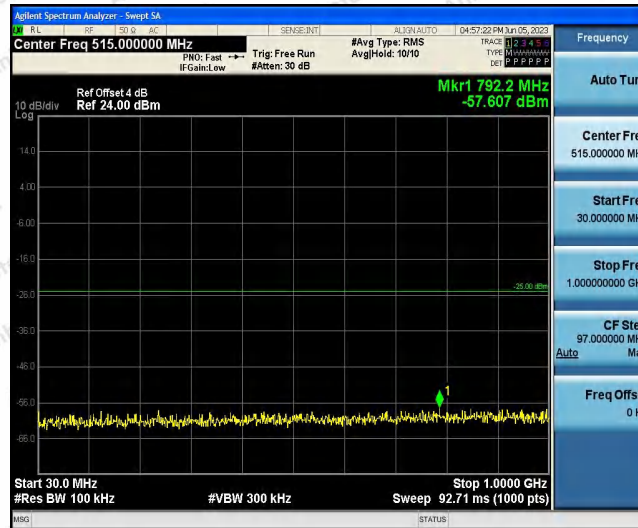

Band38-15MHz-16QAM-37825-1RB#0-Range2:1000~27000MHz



Band38-15MHz-16QAM-38000-1RB#0-Range1:30~1000MHz

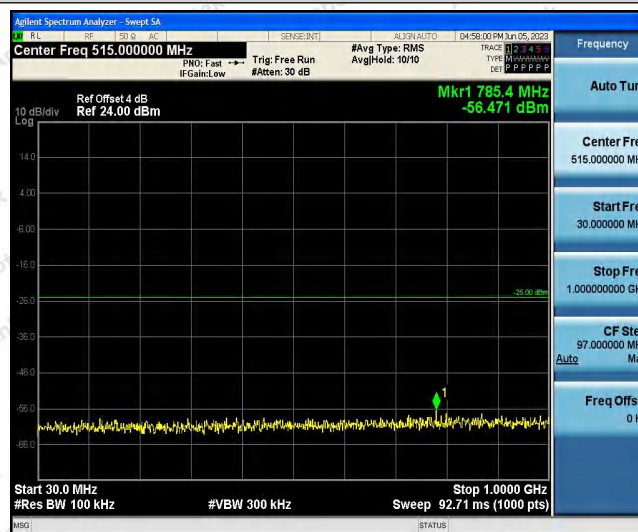

Band38-15MHz-16QAM-38000-1RB#0-Range2:1000~27000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



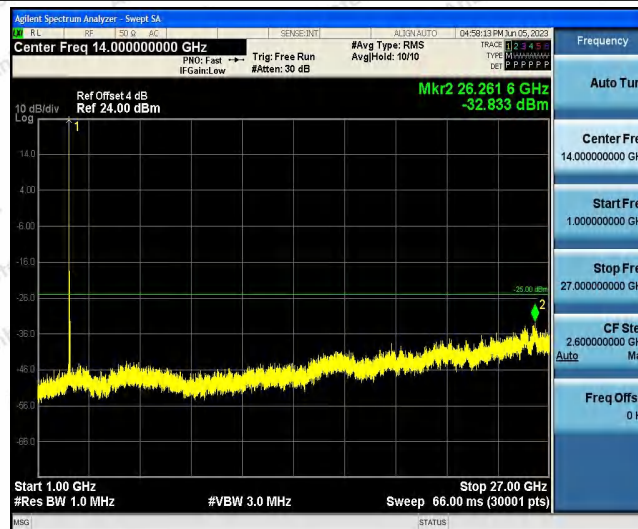

Band38-15MHz-16QAM-38175-1RB#0-Range1:30~1000MHz

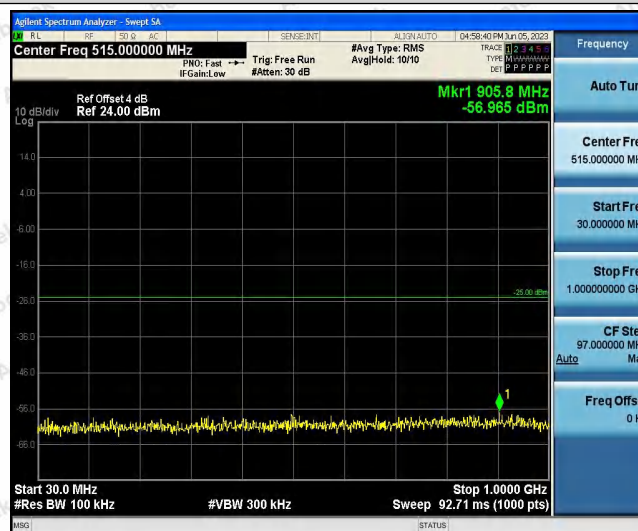

Band38-15MHz-16QAM-38175-1RB#0-Range2:1000~27000MHz



Band38-20MHz-QPSK-37850-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




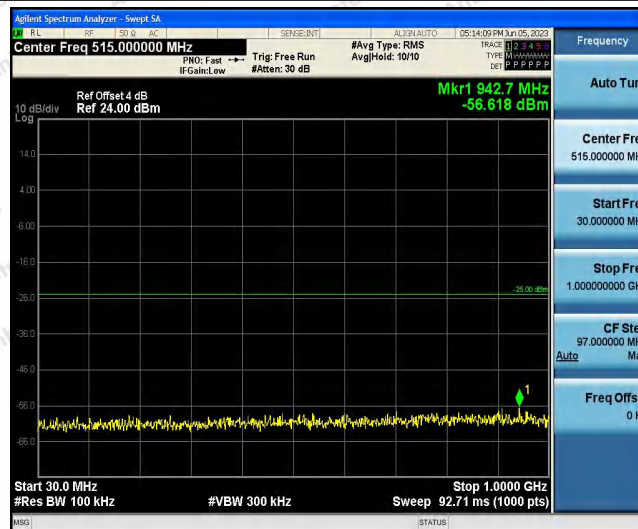

Band38-20MHz-QPSK-37850-1RB#0-Range2:1000~27000MHz

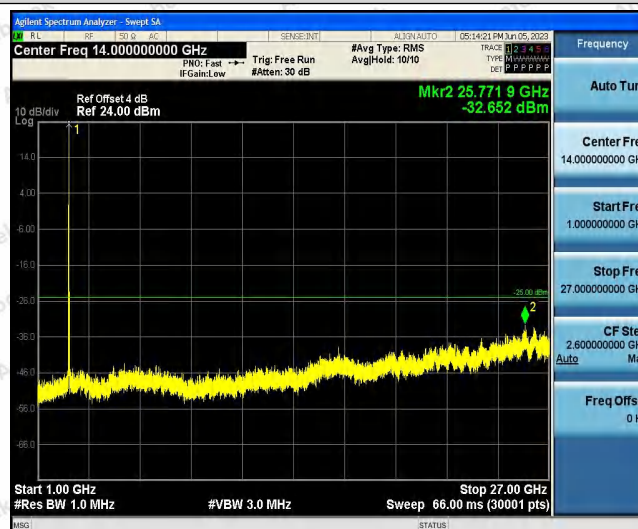

Band38-20MHz-QPSK-38000-1RB#0-Range1:30~1000MHz

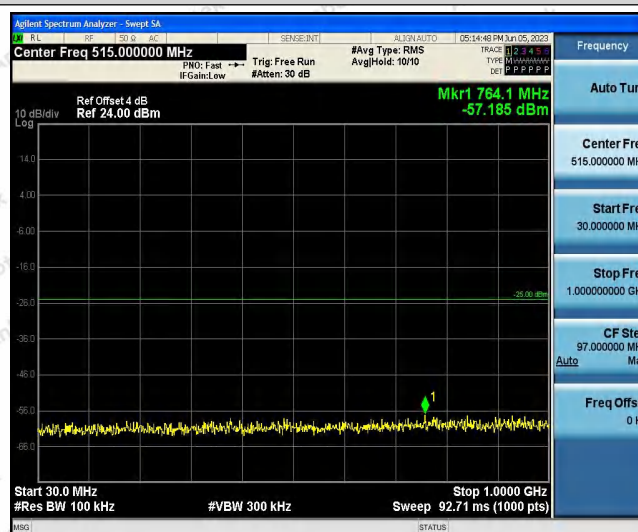

Band38-20MHz-QPSK-38000-1RB#0-Range2:1000~27000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



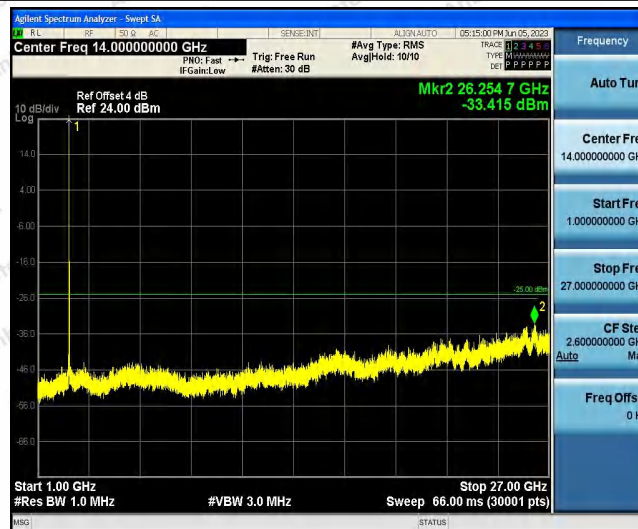

Band38-20MHz-QPSK-38150-1RB#0-Range1:30~1000MHz

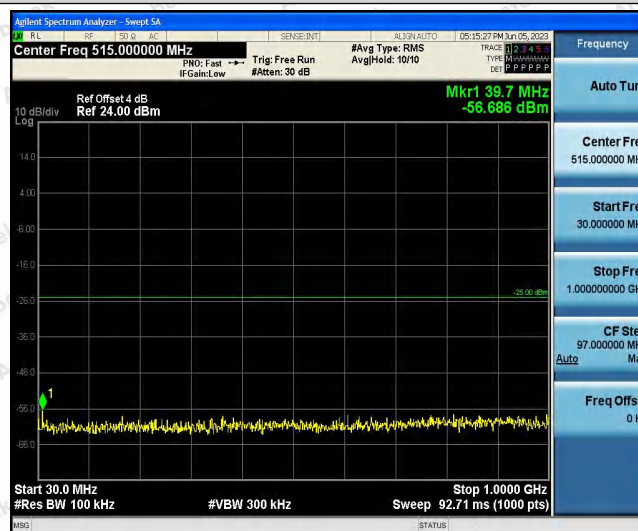

Band38-20MHz-QPSK-38150-1RB#0-Range2: 1000~27000MHz



Band38-20MHz-16QAM-37850-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




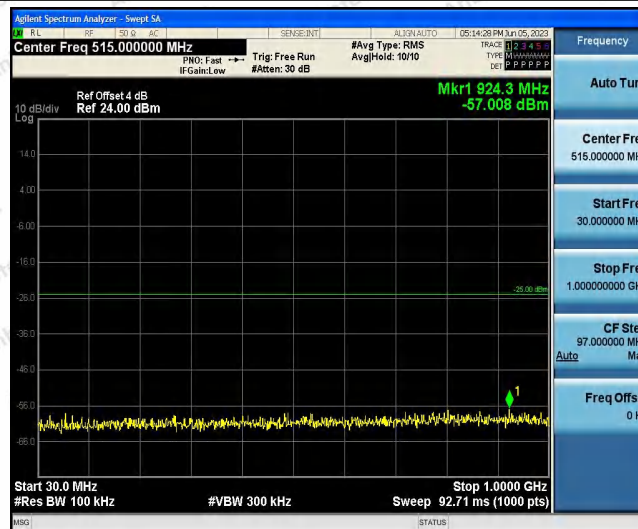

Band38-20MHz-16QAM-37850-1RB#0-Range2:1000~27000MHz



Band38-20MHz-16QAM-38000-1RB#0-Range1:30~1000MHz

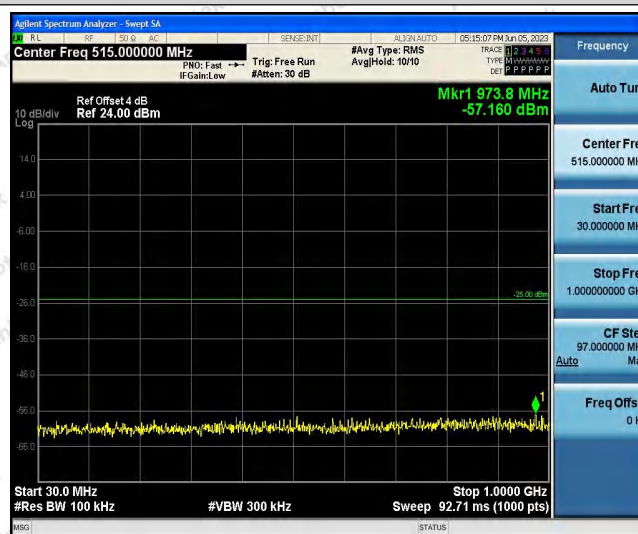

Band38-20MHz-16QAM-38000-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band38-20MHz-16QAM-38150-1RB#0-Range1:30~1000MHz

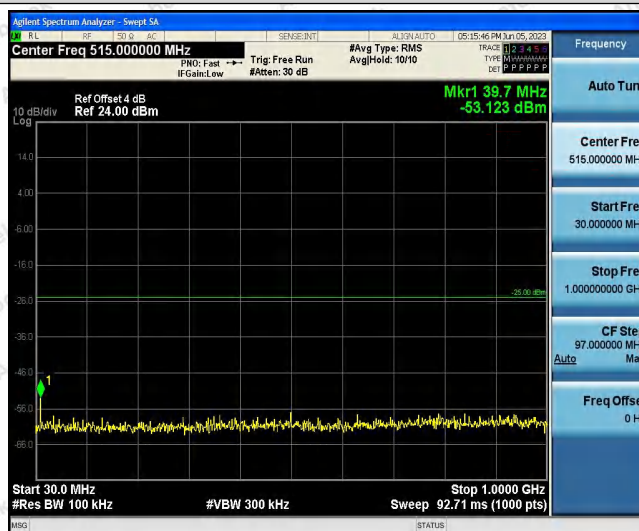

Band38-20MHz-16QAM-38150-1RB#0-Range2:1000~27000MHz



Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	-15.59	-0.006060	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	-5.99	-0.002328	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	-10.99	-0.004272	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	9.41	0.003626	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	35.49	0.013676	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	-6.27	-0.002416	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	-9.36	-0.003576	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	21.31	0.008141	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	-23.12	-0.008833	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	-25.88	-0.010060	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	17.75	0.006900	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	-10.04	-0.003903	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	17.80	0.006859	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	9.18	0.003538	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	46.05	0.017746	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	13.46	0.005142	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	-9.37	-0.003580	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	16.06	0.006136	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	-9.23	-0.003584	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	-20.40	-0.007922	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	-8.25	-0.003204	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	-13.38	-0.005156	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	16.69	0.006432	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	-6.91	-0.002663	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	-18.30	-0.006998	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	-6.55	-0.002505	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	7.11	0.002719	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	-6.74	-0.002617	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	7.18	0.002788	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	-15.84	-0.006151	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	-20.03	-0.007719	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	11.54	0.004447	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VH	NT	-8.57	-0.003303	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VL	NT	-7.81	-0.002987	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	10MHz	16QAM	38200	50RB#0	VN	NT	-18.42	-0.007044	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VH	NT	5.62	0.002149	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	-19.97	-0.007748	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	-4.11	-0.001595	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	-6.90	-0.002677	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	8.43	0.003249	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	5.88	0.002266	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	-10.04	-0.003869	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	-22.59	-0.008647	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	11.12	0.004256	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	5.25	0.002010	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	-6.78	-0.002630	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	8.40	0.003259	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	-17.68	-0.006859	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	-3.93	-0.001514	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	-6.81	-0.002624	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	-11.36	-0.004378	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	4.69	0.001795	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	3.05	0.001167	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	-13.93	-0.005332	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	-23.62	-0.009155	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	-4.36	-0.001690	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	-8.18	-0.003171	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	-19.64	-0.007568	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	7.70	0.002967	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	9.68	0.003730	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	-22.37	-0.008571	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	9.53	0.003651	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	-4.88	-0.001870	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	-21.24	-0.008233	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	8.87	0.003438	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	6.49	0.002516	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	-11.96	-0.004609	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	7.02	0.002705	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	-11.89	-0.004582	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	5.45	0.002088	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VN	NT	-8.97	-0.003437	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VH	NT	-10.00	-0.003831	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	NV	-30	-21.80	-0.008474	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	-11.42	-0.004439	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-10	14.53	0.005648	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	-16.97	-0.006597	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	-10.84	-0.004214	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	18.53	0.007203	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	30	-22.67	-0.008812	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	40	-9.46	-0.003677	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	50	9.26	0.003600	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	21.62	0.008331	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	48.65	0.018748	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-10	13.09	0.005044	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	16.28	0.006274	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	23.92	0.009218	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	42.03	0.016197	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	30	-4.61	-0.001776	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	40	17.85	0.006879	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	50	44.02	0.016963	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	-20.91	-0.007989	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	19.76	0.007549	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-10	-28.42	-0.010858	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	-24.46	-0.009345	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	18.02	0.006884	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	20	-29.57	-0.011297	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	30	-26.32	-0.010055	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	40	14.81	0.005658	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	50	-11.26	-0.004302	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	14.96	0.005815	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	-26.98	-0.010488	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-10	-14.46	-0.005621	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	8.81	0.003425	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	-19.77	-0.007685	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	-16.26	-0.006321	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	30	8.60	0.003343	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	40	-12.87	-0.005003	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	5MHz	16QAM	37775	25RB#0	NV	50	-20.67	-0.008035	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	8.40	0.003237	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	4.56	0.001757	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-10	36.19	0.013946	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	7.47	0.002879	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	-4.19	-0.001615	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	20	20.17	0.007773	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	30	19.86	0.007653	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	40	7.04	0.002713	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	50	20.59	0.007934	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	46.78	0.017872	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	5.94	0.002269	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-10	6.69	0.002556	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	40.80	0.015587	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	10	11.12	0.004248	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	9.40	0.003591	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	30	30.94	0.011820	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	40	13.42	0.005127	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	50	8.88	0.003393	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	4.06	0.001577	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	-11.34	-0.004404	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-10	-13.70	-0.005320	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	-6.22	-0.002416	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	10	-12.86	-0.004994	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	20	-14.20	-0.005515	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	30	8.08	0.003138	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	40	-8.58	-0.003332	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	50	-14.86	-0.005771	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	4.56	0.001757	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-20	13.42	0.005171	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-10	-21.63	-0.008335	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	-9.13	-0.003518	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	6.55	0.002524	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	-18.22	-0.007021	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	30	-10.84	-0.004177	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	40	9.38	0.003615	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	50	-5.11	-0.001969	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	7.32	0.002799	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	14.78	0.005652	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-10	-17.58	-0.006723	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	7.12	0.002723	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com.cn



Band38	10MHz	QPSK	38200	50RB#0	NV	10	13.70	0.005239	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	-16.87	-0.006451	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	30	-7.97	-0.003048	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	40	7.08	0.002707	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	50	16.37	0.006260	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	-11.80	-0.004583	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	-5.48	-0.002128	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-10	-7.28	-0.002827	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	-6.45	-0.002505	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	-15.23	-0.005915	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	-6.78	-0.002633	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	30	-5.79	-0.002249	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	40	-16.65	-0.006466	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	50	-9.58	-0.003720	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	2.92	0.001125	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-20	5.69	0.002193	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-10	-23.69	-0.009129	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	-8.85	-0.003410	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	-6.17	-0.002378	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	8.55	0.003295	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	30	5.24	0.002019	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	40	-24.62	-0.009487	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	50	4.41	0.001699	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	-23.12	-0.008841	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	-6.72	-0.002570	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-10	5.06	0.001935	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	9.00	0.003442	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	-17.94	-0.006860	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	5.24	0.002004	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	30	-4.12	-0.001576	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	40	9.84	0.003763	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	50	-23.16	-0.008857	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	5.36	0.002080	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	-7.01	-0.002720	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-10	-16.92	-0.006565	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	-7.11	-0.002758	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	10	-12.02	-0.004663	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	4.43	0.001719	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	30	-3.75	-0.001455	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	40	-22.10	-0.008574	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	50	-12.73	-0.004939	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	15MHz	QPSK	38000	75RB#0	NV	-30	-17.14	-0.006605	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	5.82	0.002243	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-10	-19.70	-0.007592	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	-7.91	-0.003048	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	8.98	0.003461	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	-19.45	-0.007495	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	30	-5.69	-0.002193	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	40	13.86	0.005341	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	50	-17.71	-0.006825	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	-4.65	-0.001780	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-20	9.13	0.003495	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-10	5.81	0.002224	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	0	-11.20	-0.004287	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	11.04	0.004226	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	-4.36	-0.001669	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	30	9.17	0.003510	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	40	8.90	0.003407	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	50	-11.53	-0.004413	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	-10.49	-0.004070	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	-3.99	-0.001548	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-10	-6.90	-0.002677	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	-15.49	-0.006010	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	-5.21	-0.002021	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	9.97	0.003868	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	30	-20.77	-0.008058	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	40	2.83	0.001098	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	50	10.60	0.004113	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	-3.38	-0.001303	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	-18.10	-0.006975	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-10	-14.41	-0.005553	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	-6.44	-0.002482	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	-6.52	-0.002513	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	-11.17	-0.004304	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	30	-8.63	-0.003326	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	40	-5.84	-0.002250	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	50	-15.49	-0.005969	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	-14.26	-0.005458	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	-8.98	-0.003437	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-10	12.00	0.004593	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	-19.37	-0.007414	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	-7.07	-0.002706	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	15MHz	16QAM	38175	75RB#0	NV	20	7.22	0.002764	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	30	-20.56	-0.007870	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	40	-8.33	-0.003189	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	50	8.13	0.003112	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	-5.14	-0.001992	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	6.88	0.002667	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-10	-7.65	-0.002965	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	-18.75	-0.007267	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	-7.85	-0.003043	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	2.12	0.000822	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	30	11.46	0.004442	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	40	-19.28	-0.007473	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	50	5.85	0.002267	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	13.07	0.005037	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	-19.64	-0.007568	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-10	5.97	0.002301	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	3.33	0.001283	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	-21.47	-0.008274	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	-8.40	-0.003237	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	30	8.31	0.003202	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	40	-16.84	-0.006489	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	50	6.95	0.002678	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	10.63	0.004073	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	-20.08	-0.007693	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-10	3.49	0.001337	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	15.65	0.005996	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	-17.21	-0.006594	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	5.95	0.002280	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	30	6.12	0.002345	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	40	-4.26	-0.001632	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	50	-9.93	-0.003805	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	-5.91	-0.002291	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	-14.85	-0.005756	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-10	6.04	0.002341	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	12.62	0.004891	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	10	-19.47	-0.007547	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	20	-10.41	-0.004035	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	30	9.28	0.003597	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	40	-14.56	-0.005643	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	50	9.01	0.003492	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-30	5.95	0.002293	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	16QAM	38000	100RB#0	NV	-20	-4.69	-0.001807	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-10	8.77	0.003380	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	-12.75	-0.004913	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	-5.28	-0.002035	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	10.37	0.003996	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	30	-18.12	-0.006983	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	40	-6.12	-0.002358	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	50	5.29	0.002039	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	-11.50	-0.004406	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	6.77	0.002594	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-10	-20.03	-0.007674	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	-7.18	-0.002751	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	8.14	0.003119	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	-18.50	-0.007088	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	30	-7.11	-0.002724	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	40	14.43	0.005529	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	50	-17.21	-0.006594	±2.5	PASS

---END---

