




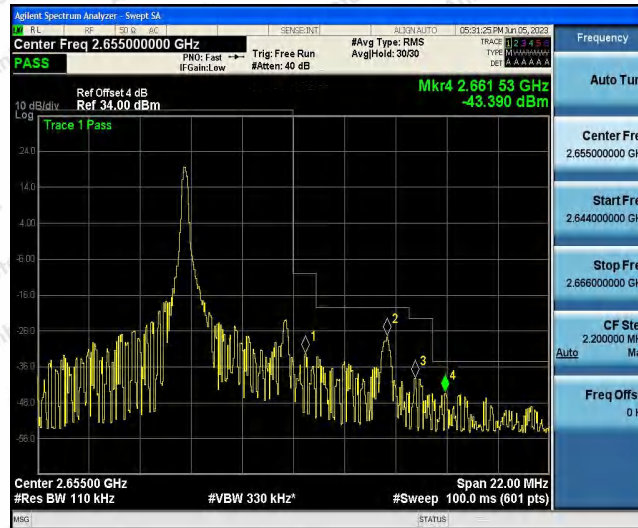

Band41-5MHz-16QAM-41215-1RB#24

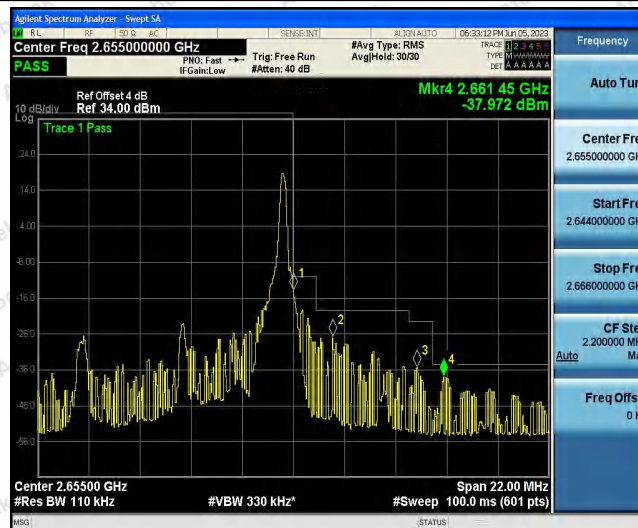

Band41-5MHz-16QAM-41215-25RB#0

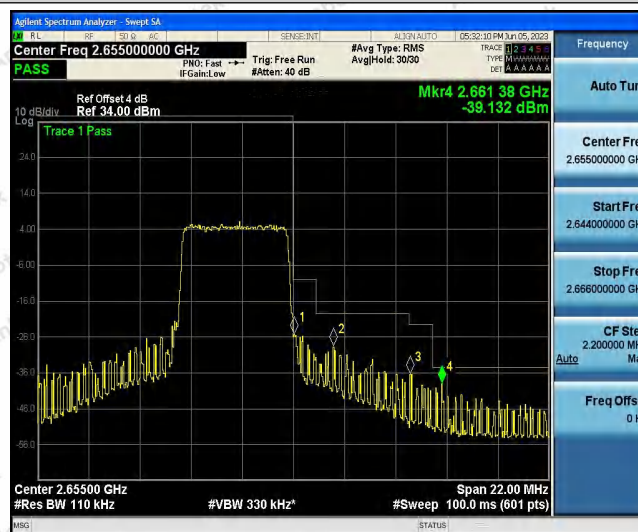

Band41-10MHz-QPSK-40290-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band41-10MHz-QPSK-40290-1RB#49



Band41-10MHz-QPSK-40290-50RB#0

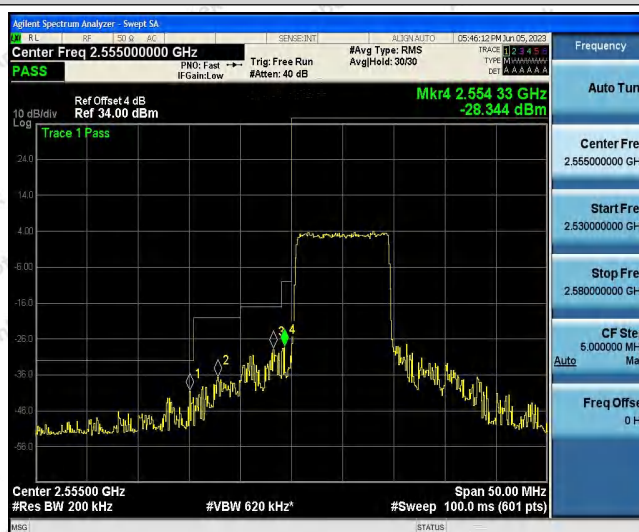

Band41-10MHz-QPSK-41190-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




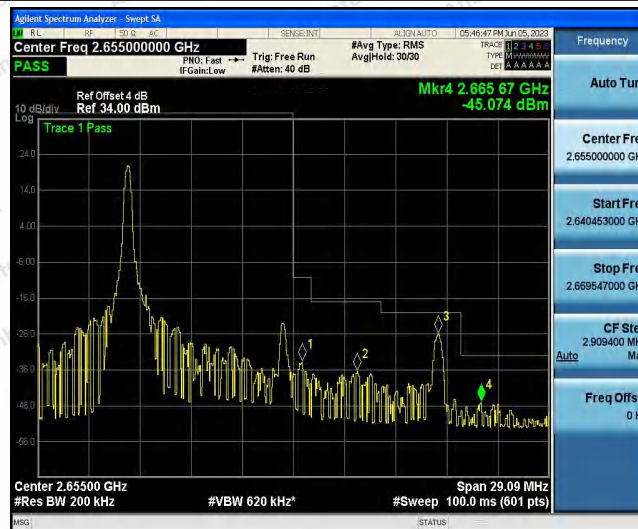

Band41-10MHz-QPSK-41190-1RB#49

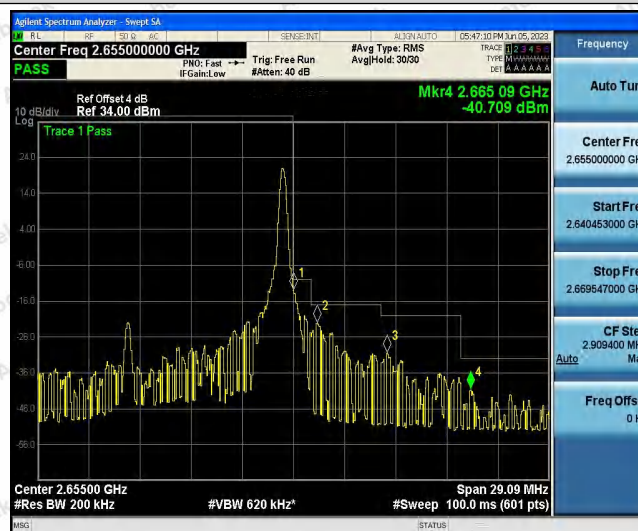

Band41-10MHz-QPSK-41190-50RB#0

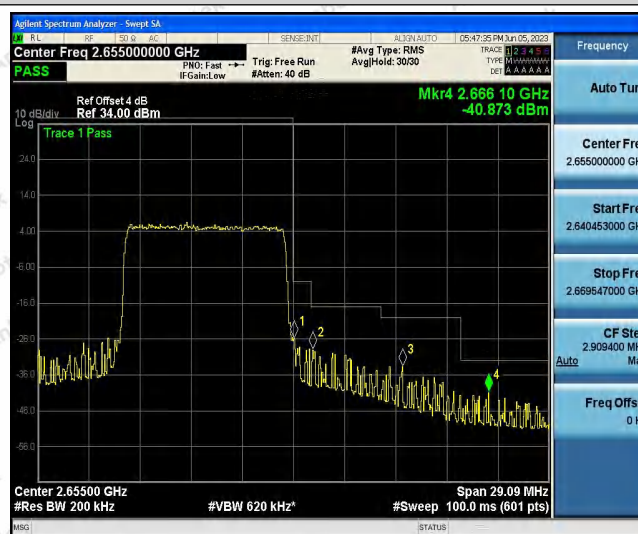

Band41-10MHz-16QAM-40290-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




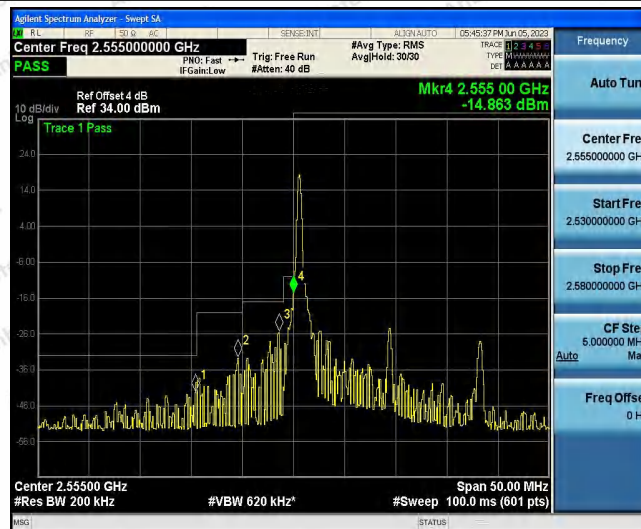

Band41-10MHz-16QAM-40290-1RB#49



Band41-10MHz-16QAM-40290-50RB#0

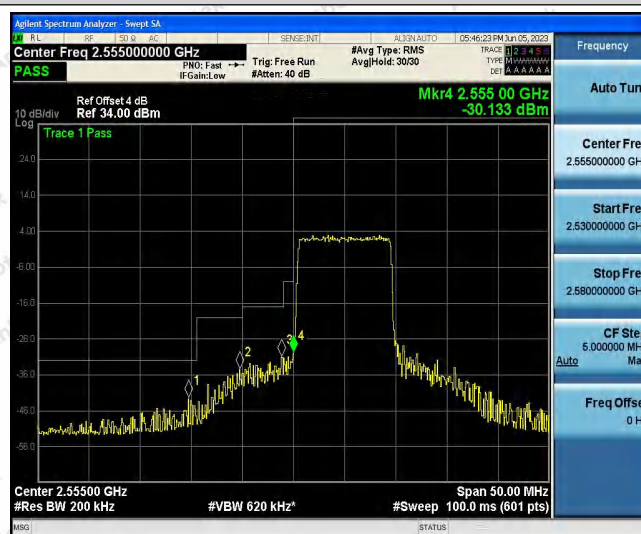

Band41-10MHz-16QAM-41190-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




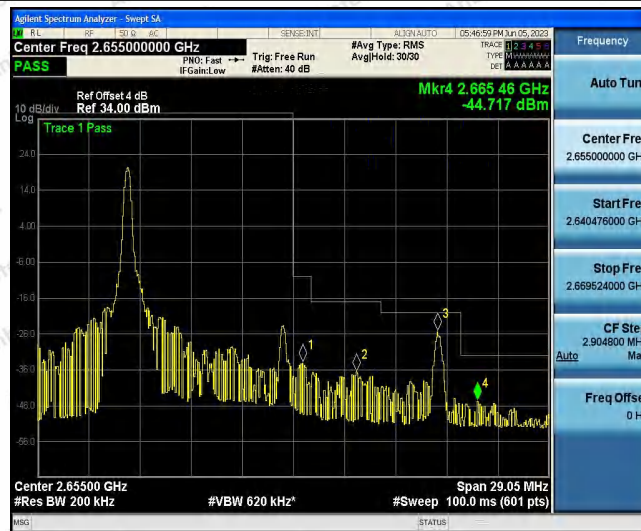

Band41-10MHz-16QAM-41190-1RB#49

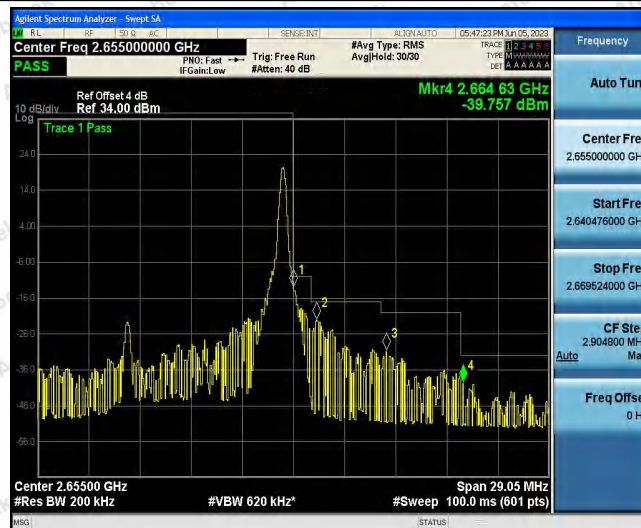

Band41-10MHz-16QAM-41190-50RB#0

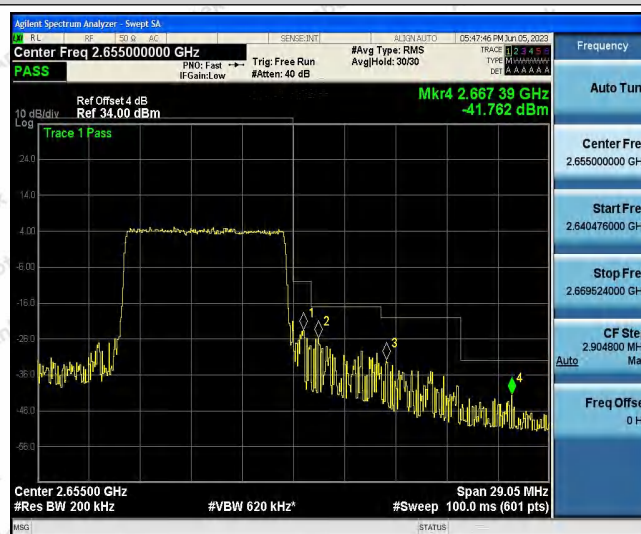

Band41-15MHz-QPSK-40315-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



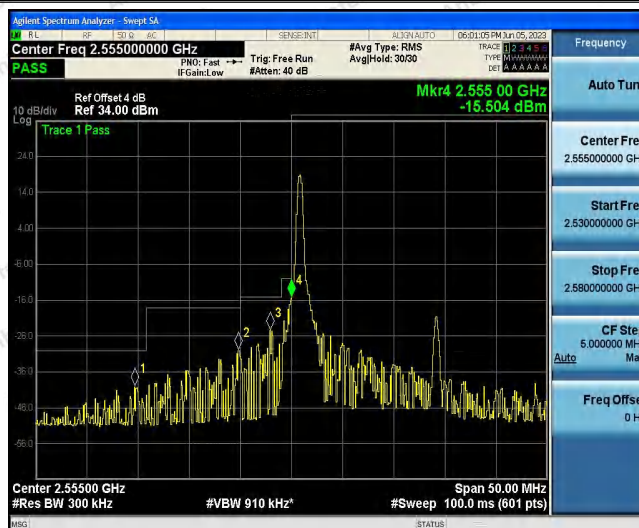

Band41-15MHz-QPSK-40315-1RB#74

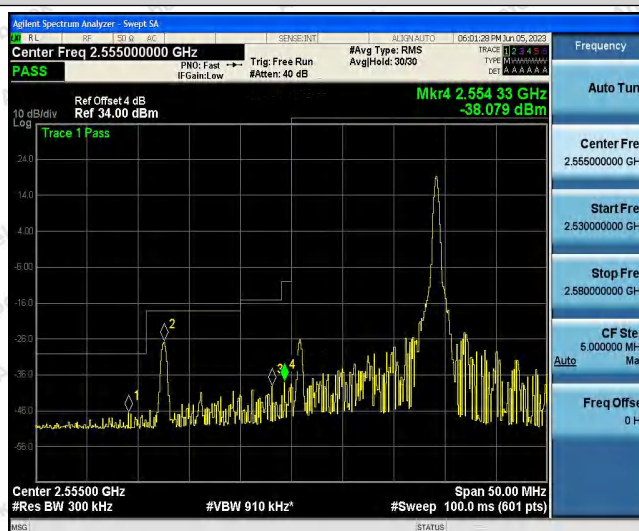

Band41-15MHz-QPSK-40315-75RB#0



Band41-15MHz-QPSK-41165-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




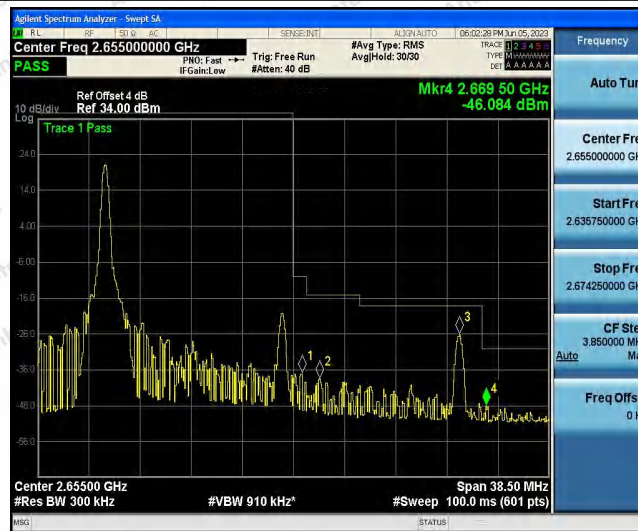

Band41-15MHz-QPSK-41165-1RB#74

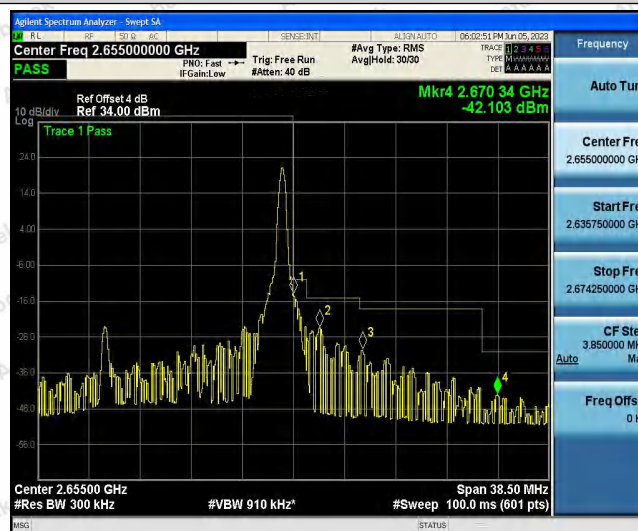


Band41-15MHz-QPSK-41165-75RB#0

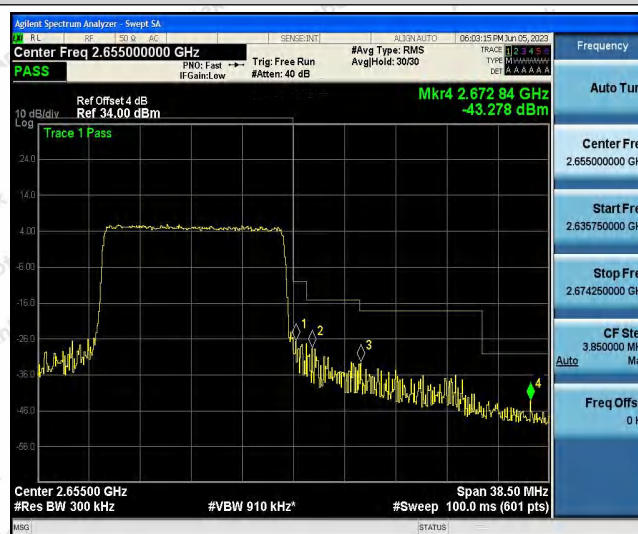


Band41-15MHz-16QAM-40315-1RB#0




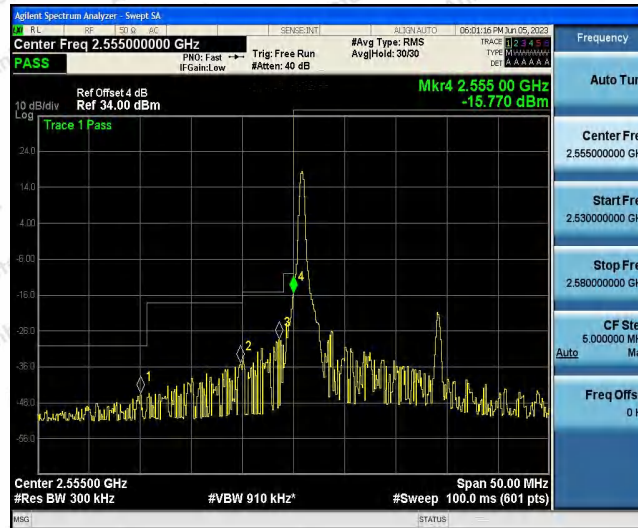

Band41-15MHz-16QAM-40315-1RB#74

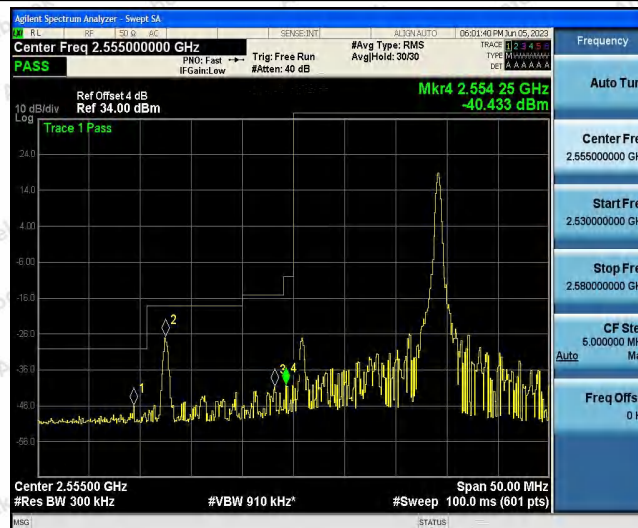

Band41-15MHz-16QAM-40315-75RB#0

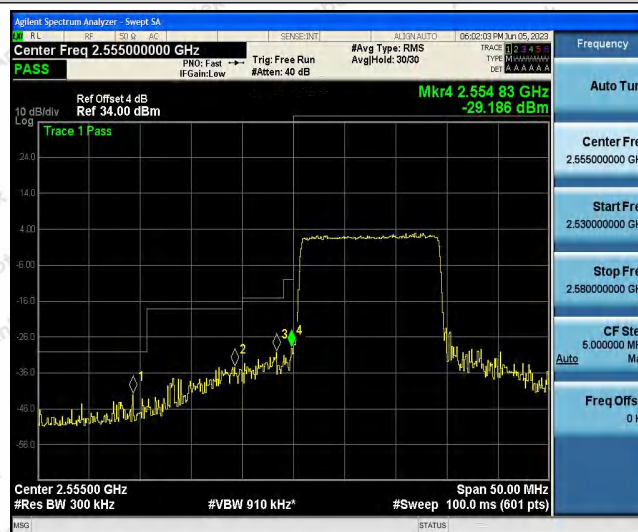

Band41-15MHz-16QAM-41165-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band41-15MHz-16QAM-41165-1RB#74

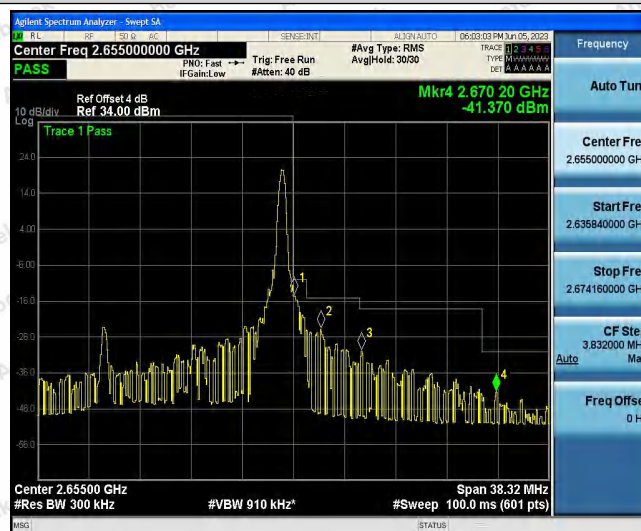

Band41-15MHz-16QAM-41165-75RB#0

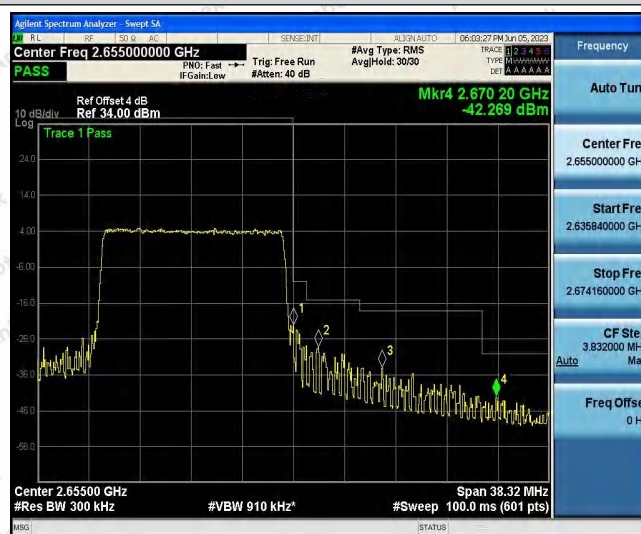

Band41-20MHz-QPSK-40340-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




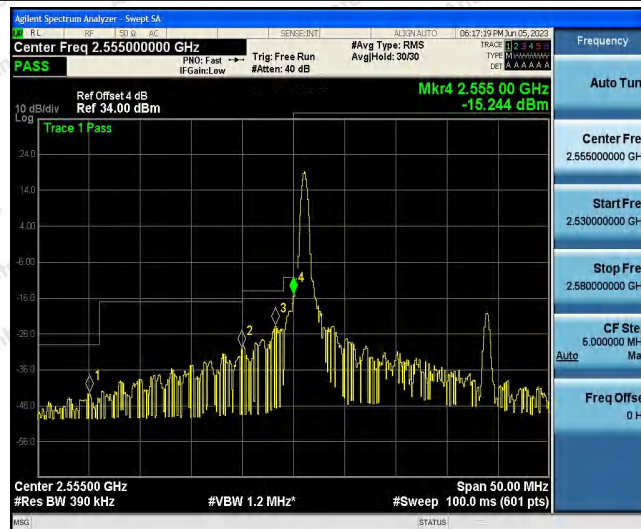

Band41-20MHz-QPSK-40340-1RB#99

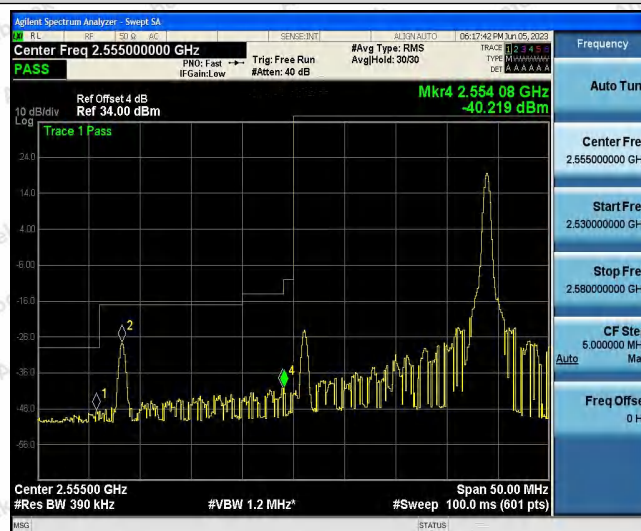

Band41-20MHz-QPSK-40340-100RB#0

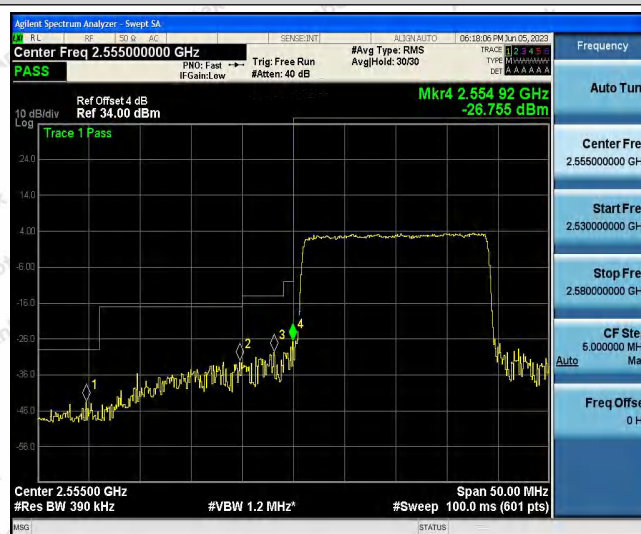

Band41-20MHz-QPSK-41140-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band41-20MHz-QPSK-41140-1RB#99



Band41-20MHz-QPSK-41140-100RB#0

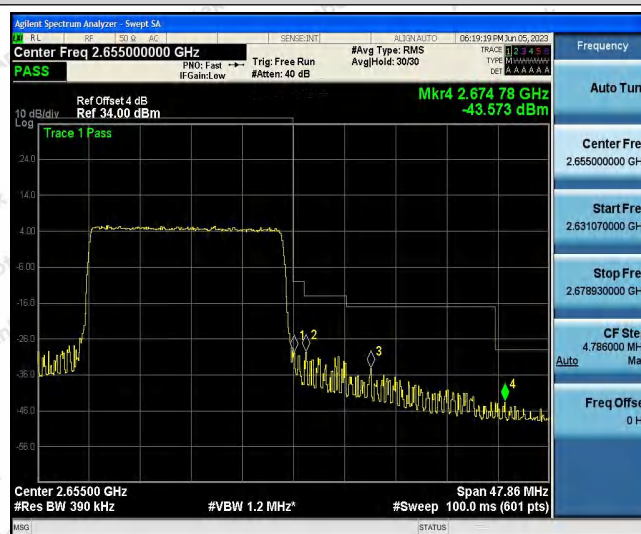

Band41-20MHz-16QAM-40340-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




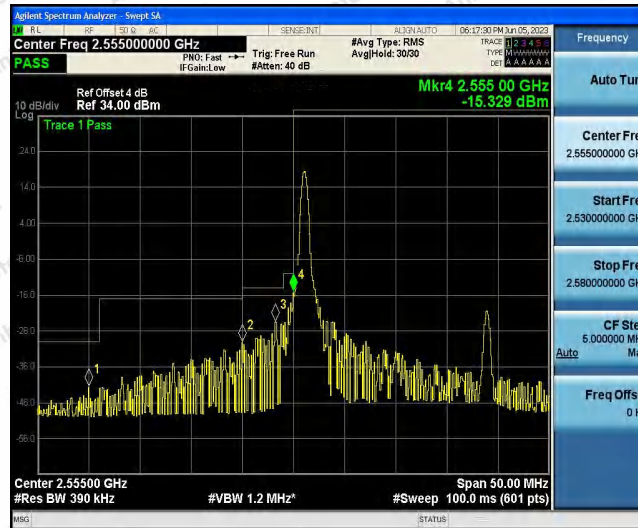

Band41-20MHz-16QAM-40340-1RB#99

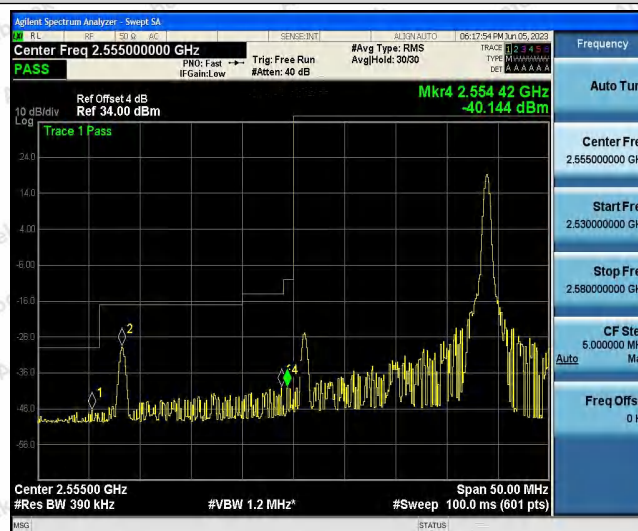

Band41-20MHz-16QAM-40340-100RB#0

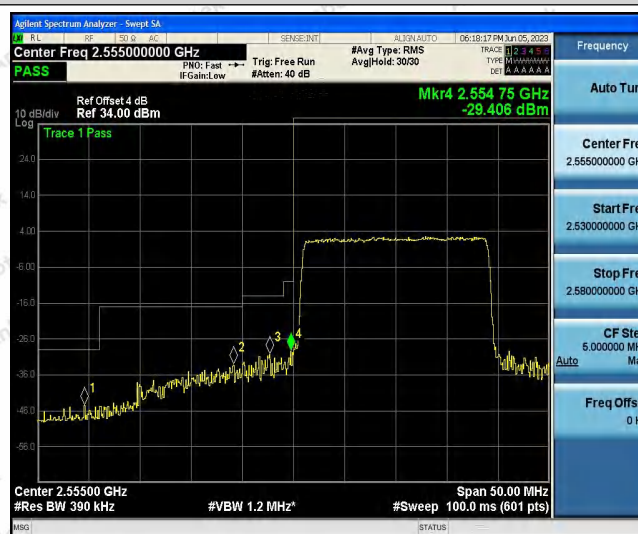

Band41-20MHz-16QAM-41140-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




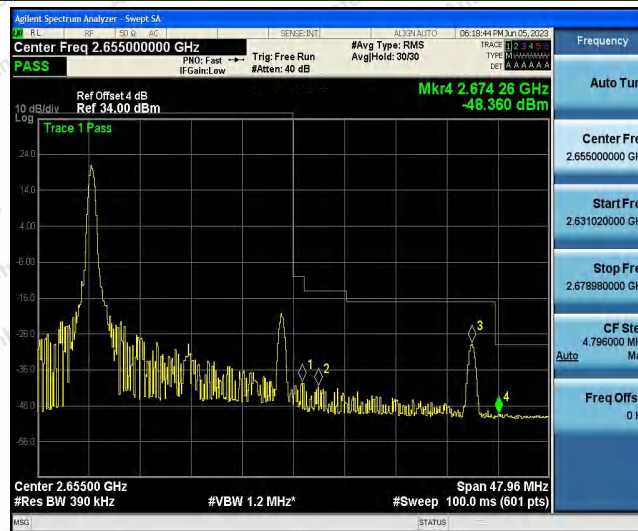

Band41-20MHz-16QAM-41140-1RB#99

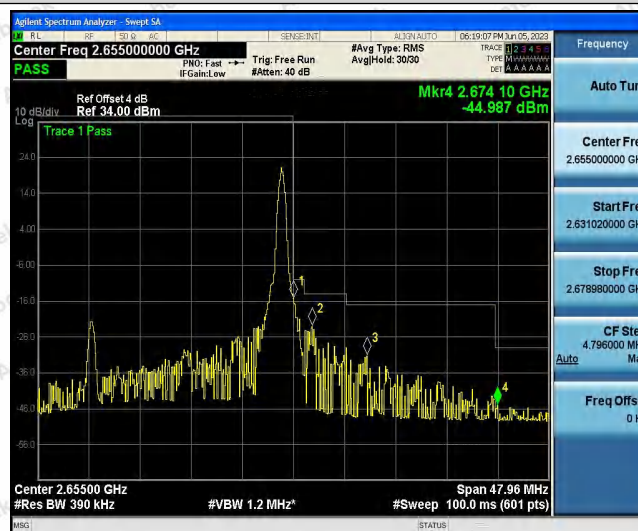

Band41-20MHz-16QAM-41140-100RB#0

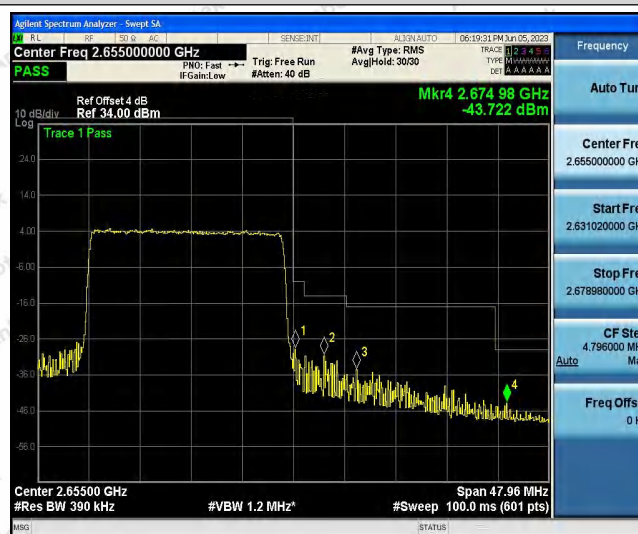

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	40265	1RB#0	Range1:30~1000MHz	-57.5	PASS
Band41	5MHz	QPSK	40265	1RB#0	Range2:1000~27000MHz	-33.4	PASS
Band41	5MHz	QPSK	40690	1RB#0	Range1:30~1000MHz	-56.63	PASS
Band41	5MHz	QPSK	40690	1RB#0	Range2:1000~27000MHz	-33.79	PASS
Band41	5MHz	QPSK	41215	1RB#0	Range1:30~1000MHz	-56.82	PASS
Band41	5MHz	QPSK	41215	1RB#0	Range2:1000~27000MHz	-33.63	PASS
Band41	5MHz	16QAM	40265	1RB#0	Range1:30~1000MHz	-57.02	PASS
Band41	5MHz	16QAM	40265	1RB#0	Range2:1000~27000MHz	-32.36	PASS
Band41	5MHz	16QAM	40690	1RB#0	Range1:30~1000MHz	-56.99	PASS
Band41	5MHz	16QAM	40690	1RB#0	Range2:1000~27000MHz	-33.29	PASS
Band41	5MHz	16QAM	41215	1RB#0	Range1:30~1000MHz	-55.01	PASS
Band41	5MHz	16QAM	41215	1RB#0	Range2:1000~27000MHz	-33.28	PASS
Band41	10MHz	QPSK	40290	1RB#0	Range1:30~1000MHz	-56.76	PASS
Band41	10MHz	QPSK	40290	1RB#0	Range2:1000~27000MHz	-33.44	PASS
Band41	10MHz	QPSK	40690	1RB#0	Range1:30~1000MHz	-56.18	PASS
Band41	10MHz	QPSK	40690	1RB#0	Range2:1000~27000MHz	-33.04	PASS
Band41	10MHz	QPSK	41190	1RB#0	Range1:30~1000MHz	-55.19	PASS
Band41	10MHz	QPSK	41190	1RB#0	Range2:1000~27000MHz	-33.45	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band41	10MHz	16QAM	40290	1RB#0	Range1:30~1000MHz	-56.75	PASS
Band41	10MHz	16QAM	40290	1RB#0	Range2:1000~27000MHz	-33.57	PASS
Band41	10MHz	16QAM	40690	1RB#0	Range1:30~1000MHz	-56.32	PASS
Band41	10MHz	16QAM	40690	1RB#0	Range2:1000~27000MHz	-32.78	PASS
Band41	10MHz	16QAM	41190	1RB#0	Range1:30~1000MHz	-56.95	PASS
Band41	10MHz	16QAM	41190	1RB#0	Range2:1000~27000MHz	-32.95	PASS
Band41	15MHz	QPSK	40315	1RB#0	Range1:30~1000MHz	-56.84	PASS
Band41	15MHz	QPSK	40315	1RB#0	Range2:1000~27000MHz	-33.47	PASS
Band41	15MHz	QPSK	40690	1RB#0	Range1:30~1000MHz	-56.61	PASS
Band41	15MHz	QPSK	40690	1RB#0	Range2:1000~27000MHz	-33.51	PASS
Band41	15MHz	QPSK	41165	1RB#0	Range1:30~1000MHz	-55.34	PASS
Band41	15MHz	QPSK	41165	1RB#0	Range2:1000~27000MHz	-33.18	PASS
Band41	15MHz	16QAM	40315	1RB#0	Range1:30~1000MHz	-57.15	PASS
Band41	15MHz	16QAM	40315	1RB#0	Range2:1000~27000MHz	-32.72	PASS
Band41	15MHz	16QAM	40690	1RB#0	Range1:30~1000MHz	-56.17	PASS
Band41	15MHz	16QAM	40690	1RB#0	Range2:1000~27000MHz	-34.21	PASS
Band41	15MHz	16QAM	41165	1RB#0	Range1:30~1000MHz	-55.84	PASS
Band41	15MHz	16QAM	41165	1RB#0	Range2:1000~27000MHz	-34.07	PASS
Band41	20MHz	QPSK	40340	1RB#0	Range1:30~1000MHz	-57.17	PASS
Band41	20MHz	QPSK	40340	1RB#0	Range2:1000~27000MHz	-33.64	PASS
Band41	20MHz	QPSK	40690	1RB#0	Range1:30~1000MHz	-57.05	PASS
Band41	20MHz	QPSK	40690	1RB#0	Range2:1000~	-33.97	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



					27000MHz		
Band41	20MHz	QPSK	41140	1RB#0	Range1:30~1000MHz	-56.83	PASS
Band41	20MHz	QPSK	41140	1RB#0	Range2:1000~27000MHz	-34.13	PASS
Band41	20MHz	16QAM	40340	1RB#0	Range1:30~1000MHz	-57.26	PASS
Band41	20MHz	16QAM	40340	1RB#0	Range2:1000~27000MHz	-33.3	PASS
Band41	20MHz	16QAM	40690	1RB#0	Range1:30~1000MHz	-56.25	PASS
Band41	20MHz	16QAM	40690	1RB#0	Range2:1000~27000MHz	-32.65	PASS
Band41	20MHz	16QAM	41140	1RB#0	Range1:30~1000MHz	-55.94	PASS
Band41	20MHz	16QAM	41140	1RB#0	Range2:1000~27000MHz	-33.87	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
www.anbotek.com.cn



Test Graphs


Band41-5MHz-QPSK-40265-1RB#0-Range1:30~1000MHz

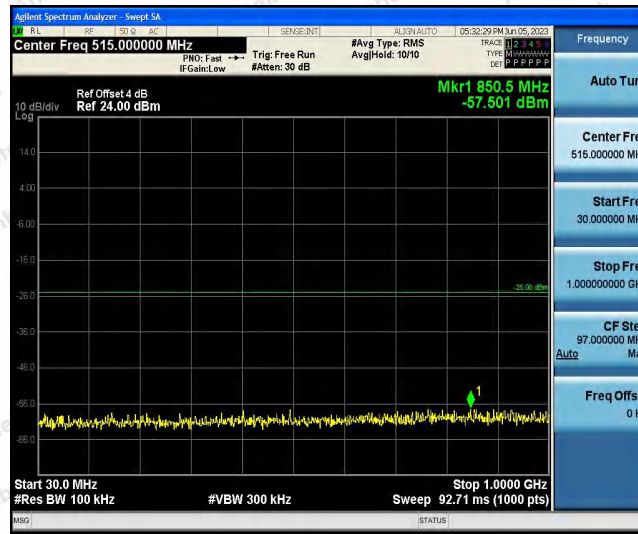

Band41-5MHz-QPSK-40265-1RB#0-Range2:1000~27000MHz



Band41-5MHz-QPSK-40690-1RB#0-Range1:30~1000MHz

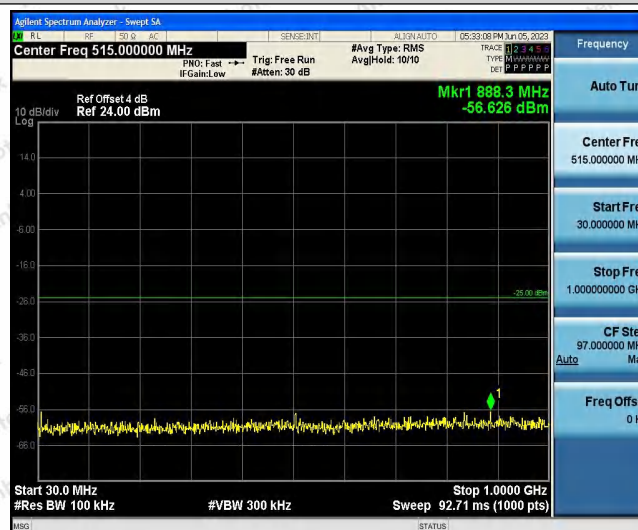

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



Band41-5MHz-QPSK-40690-1RB#0-Range2:1000~27000MHz



Band41-5MHz-QPSK-41215-1RB#0-Range1:30~1000MHz

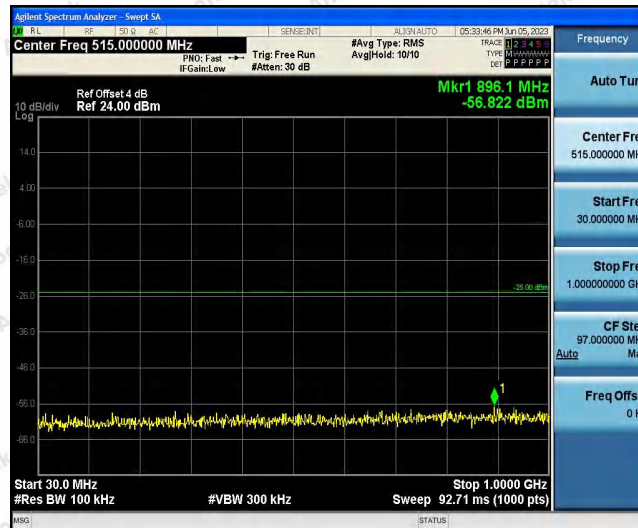

Band41-5MHz-QPSK-41215-1RB#0-Range2:1000~27000MHz



Band41-5MHz-16QAM-40265-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




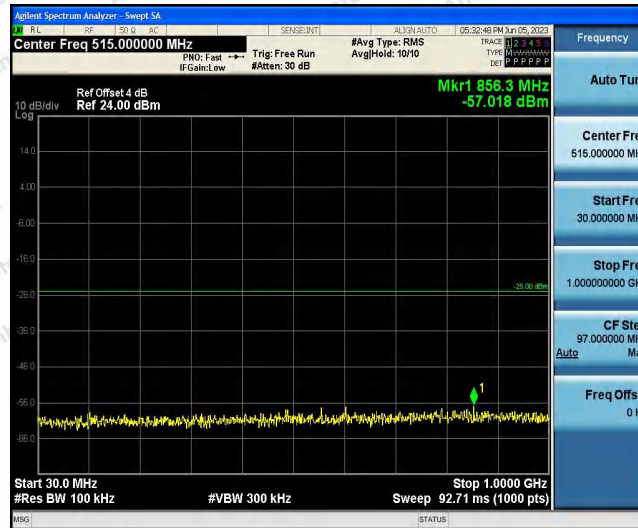

Band41-5MHz-16QAM-40265-1RB#0-Range2:1000~27000MHz




Band41-5MHz-16QAM-40690-1RB#0-Range1:30~1000MHz

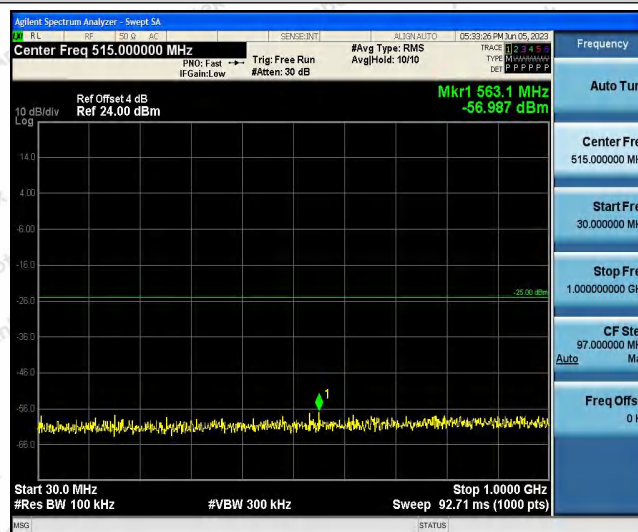


Band41-5MHz-16QAM-40690-1RB#0-Range2:1000~27000MHz



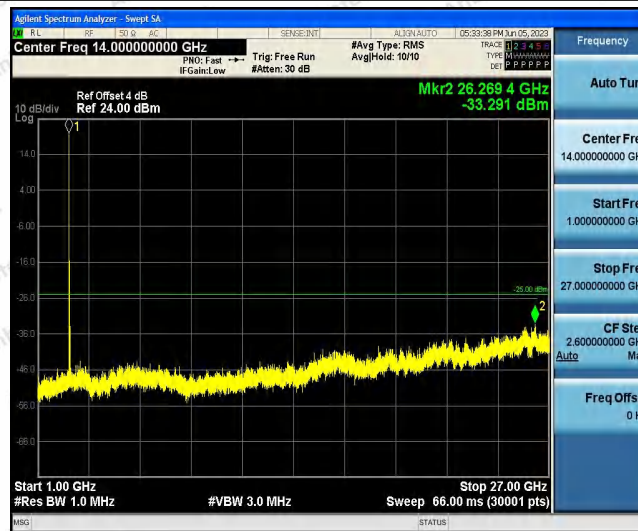

Band41-5MHz-16QAM-41215-1RB#0-Range1:30~1000MHz

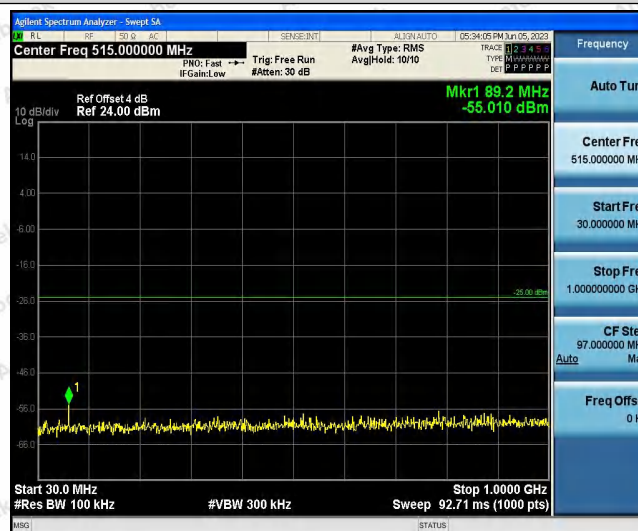

Band41-5MHz-16QAM-41215-1RB#0-Range2:1000~27000MHz



Band41-10MHz-QPSK-40290-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




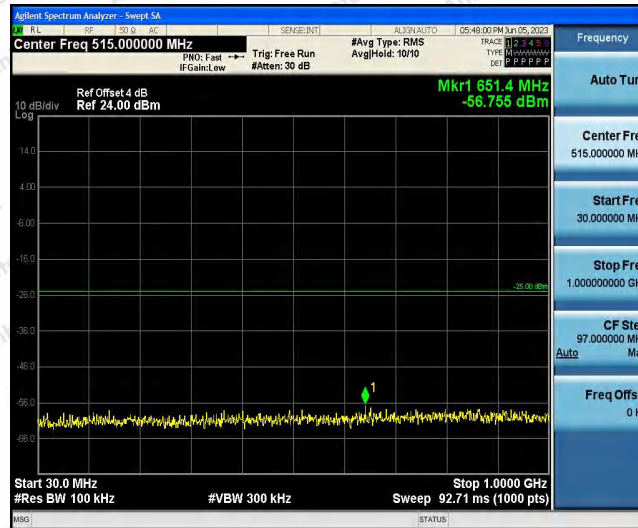

Band41-10MHz-QPSK-40290-1RB#0-Range2:1000~27000MHz

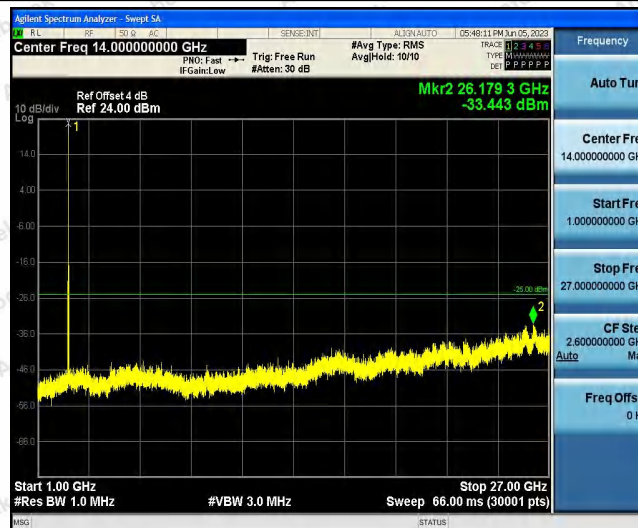

Band41-10MHz-QPSK-40690-1RB#0-Range1:30~1000MHz

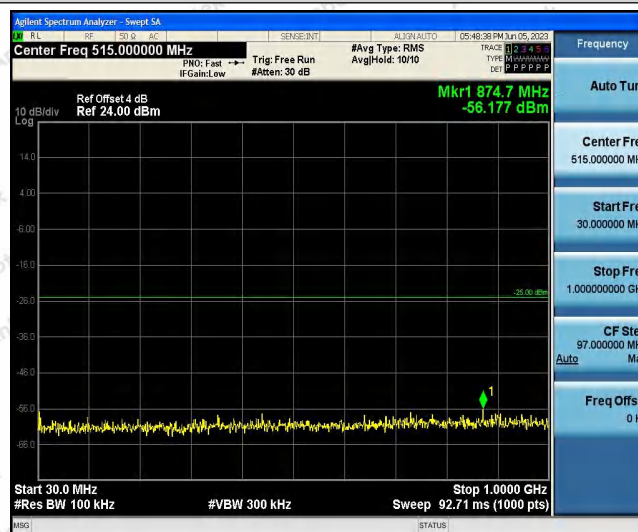


Band41-10MHz-QPSK-40690-1RB#0-Range2:1000~27000MHz





Band41-10MHz-QPSK-41190-1RB#0-Range1:30~1000MHz

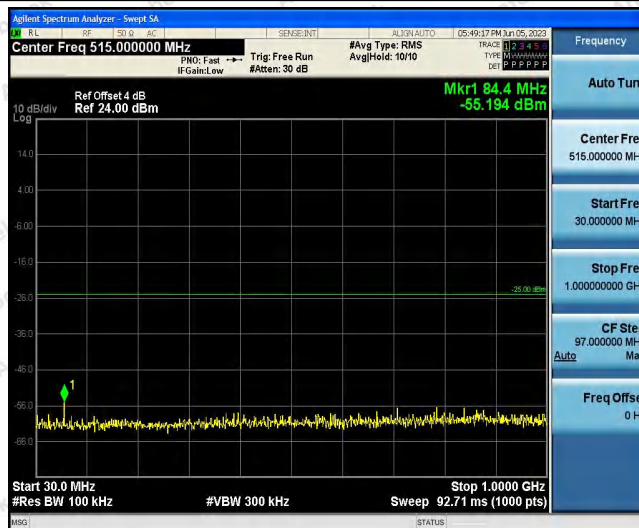

Band41-10MHz-QPSK-41190-1RB#0-Range2: 1000~27000MHz



Band41-10MHz-16QAM-40290-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




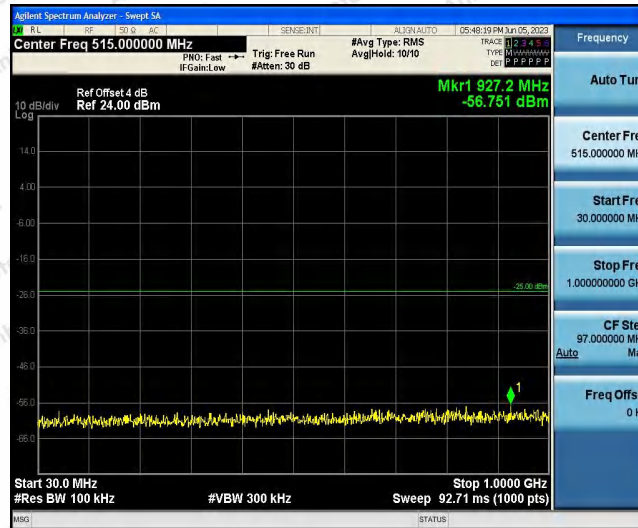

Band41-10MHz-16QAM-40290-1RB#0-Range2:1000~27000MHz



Band41-10MHz-16QAM-40690-1RB#0-Range1:30~1000MHz

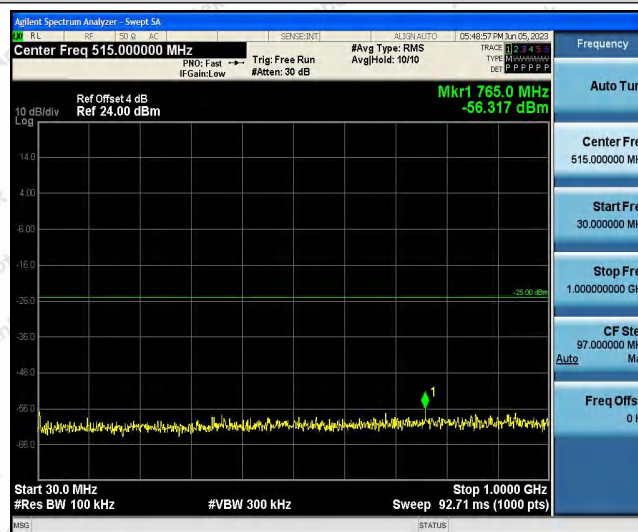


Band41-10MHz-16QAM-40690-1RB#0-Range2:1000~27000MHz





Band41-10MHz-16QAM-41190-1RB#0-Range1:30~1000MHz

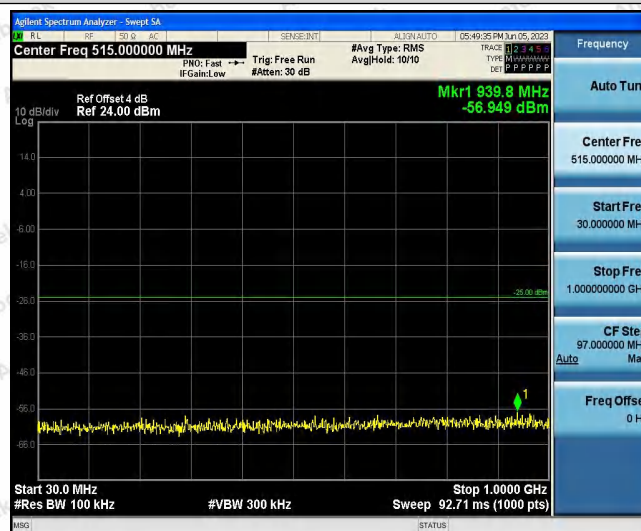

Band41-10MHz-16QAM-41190-1RB#0-Range2:1000~27000MHz



Band41-15MHz-QPSK-40315-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




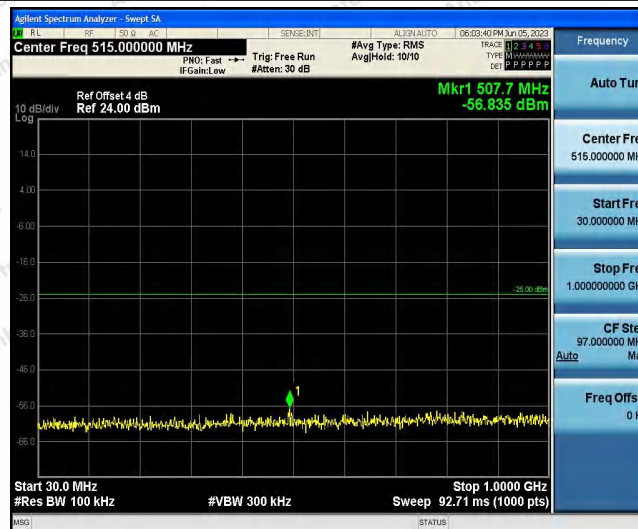

Band41-15MHz-QPSK-40315-1RB#0-Range2:1000~27000MHz

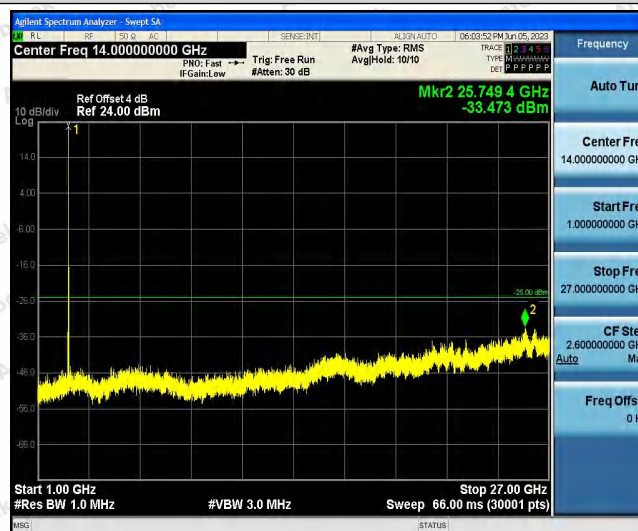


Band41-15MHz-QPSK-40690-1RB#0-Range1:30~1000MHz

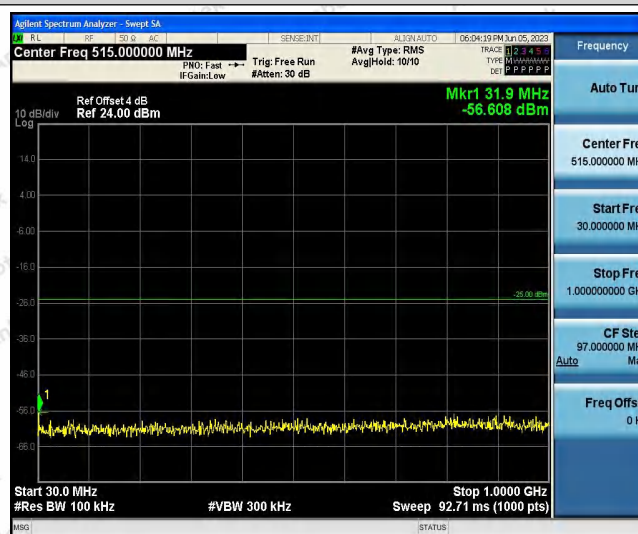


Band41-15MHz-QPSK-40690-1RB#0-Range2:1000~27000MHz



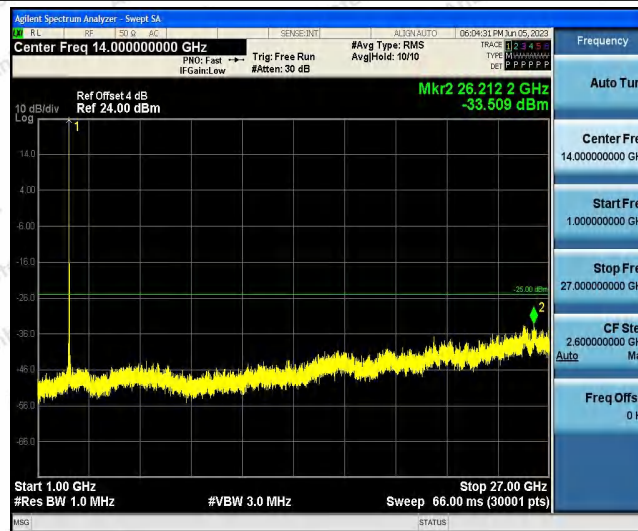

Band41-15MHz-QPSK-41165-1RB#0-Range1:30~1000MHz

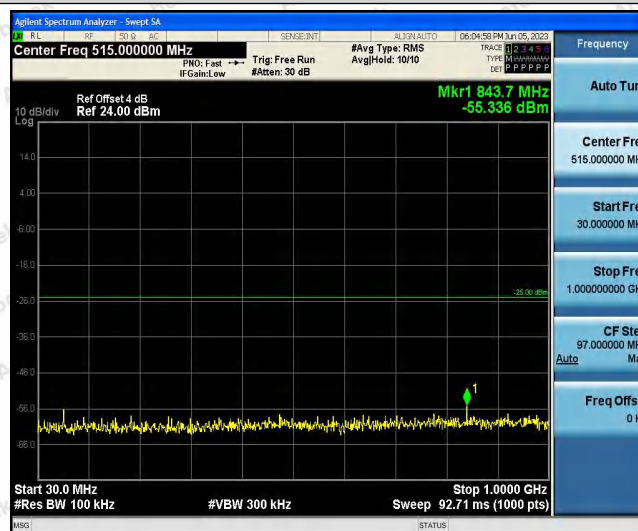

Band41-15MHz-QPSK-41165-1RB#0-Range2: 1000~27000MHz



Band41-15MHz-16QAM-40315-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




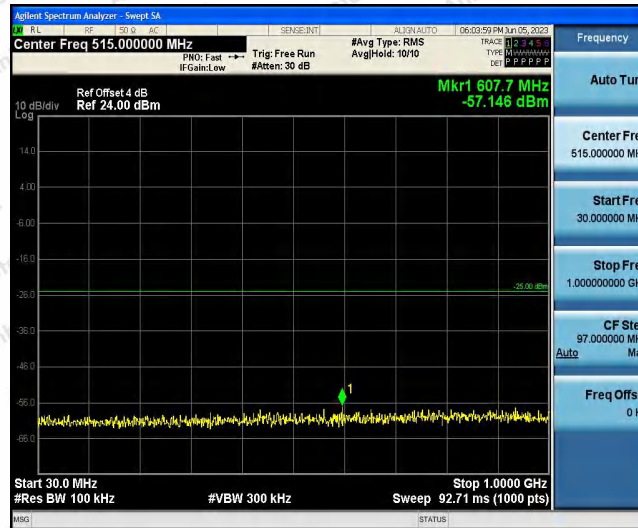

Band41-15MHz-16QAM-40315-1RB#0-Range2:1000~27000MHz

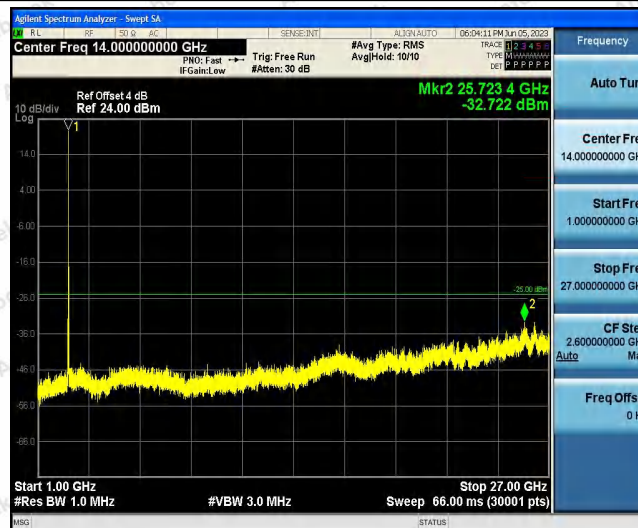

Band41-15MHz-16QAM-40690-1RB#0-Range1:30~1000MHz

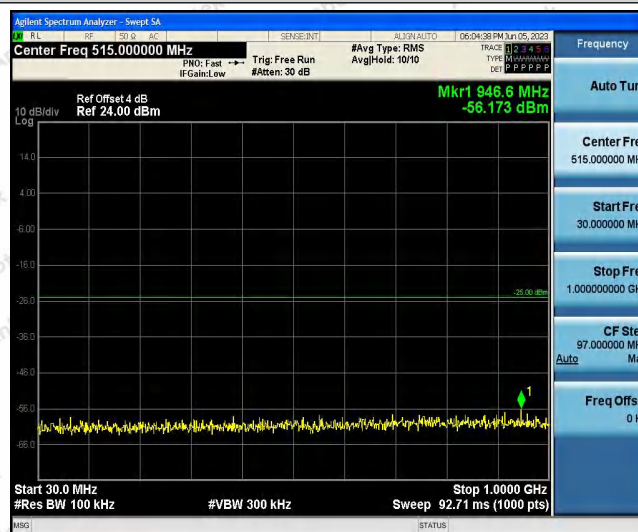


Band41-15MHz-16QAM-40690-1RB#0-Range2:1000~27000MHz





Band41-15MHz-16QAM-41165-1RB#0-Range1:30~1000MHz

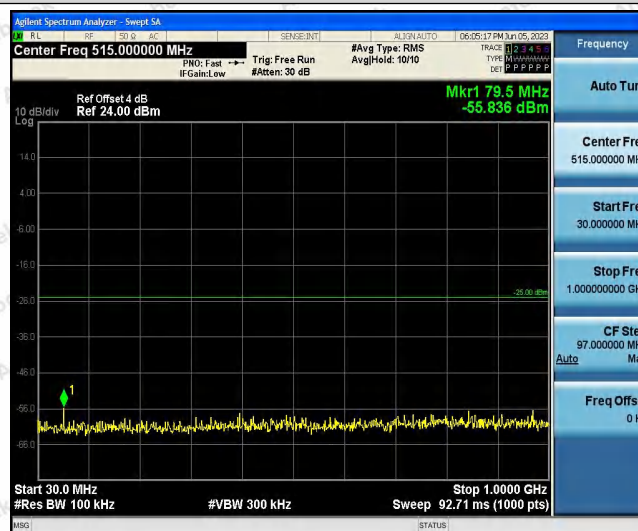

Band41-15MHz-16QAM-41165-1RB#0-Range2:1000~27000MHz



Band41-20MHz-QPSK-40340-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




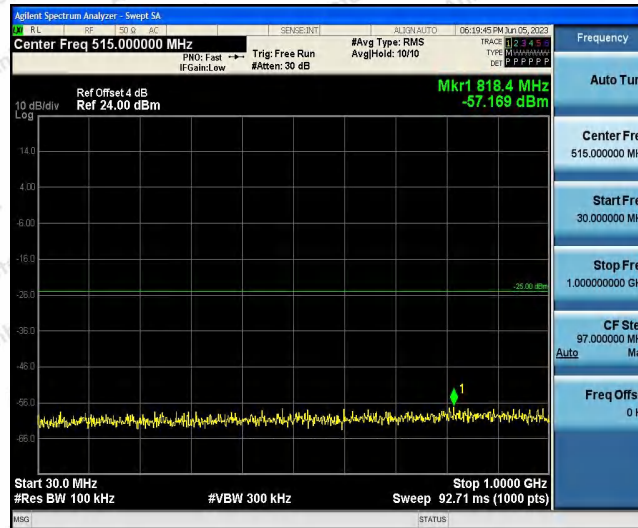

Band41-20MHz-QPSK-40340-1RB#0-Range2:1000~27000MHz



Band41-20MHz-QPSK-40690-1RB#0-Range1:30~1000MHz

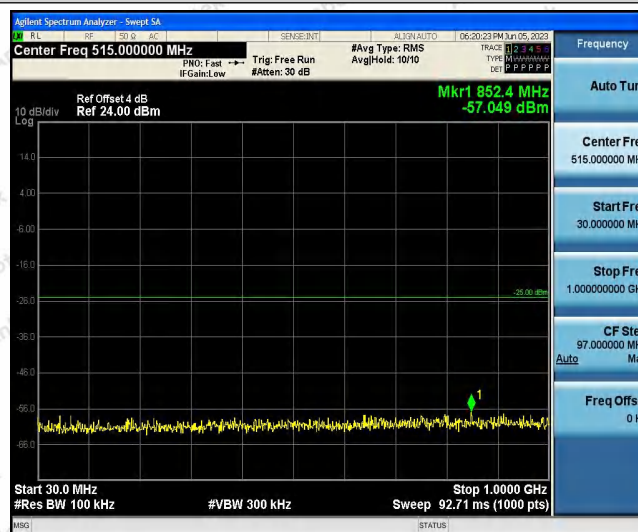


Band41-20MHz-QPSK-40690-1RB#0-Range2:1000~27000MHz





Band41-20MHz-QPSK-41140-1RB#0-Range1:30~1000MHz

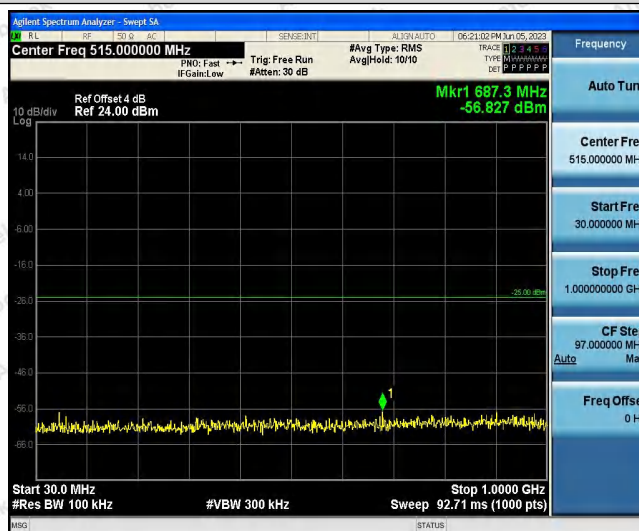

Band41-20MHz-QPSK-41140-1RB#0-Range2: 1000~27000MHz



Band41-20MHz-16QAM-40340-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




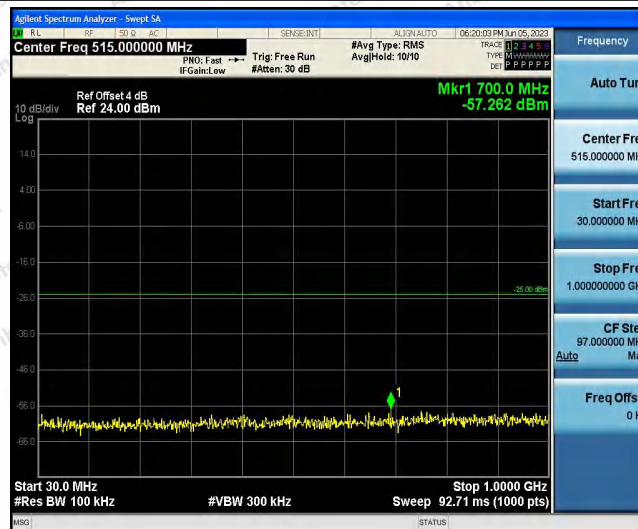

Band41-20MHz-16QAM-40340-1RB#0-Range2:1000~27000MHz



Band41-20MHz-16QAM-40690-1RB#0-Range1:30~1000MHz

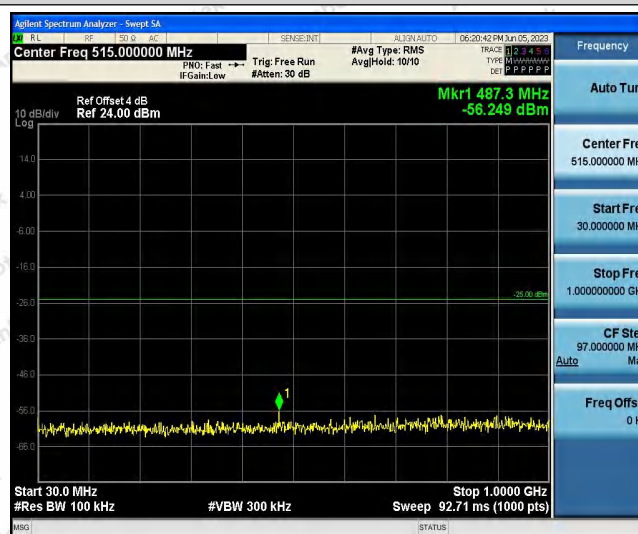


Band41-20MHz-16QAM-40690-1RB#0-Range2:1000~27000MHz






Band41-20MHz-16QAM-41140-1RB#0-Range1:30~1000MHz

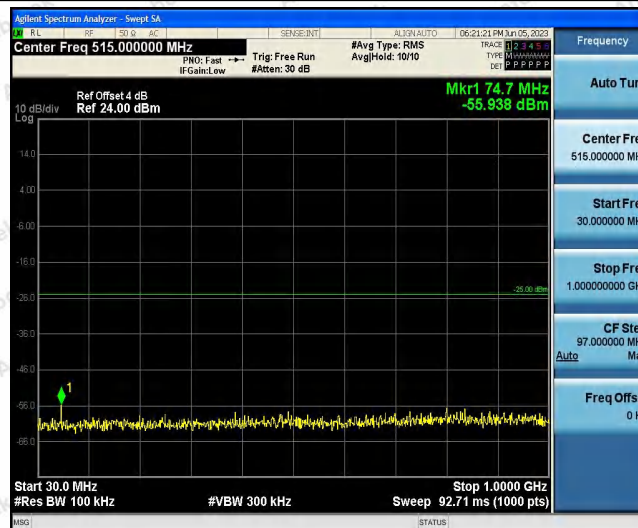

Band41-20MHz-16QAM-41140-1RB#0-Range2:1000~27000MHz

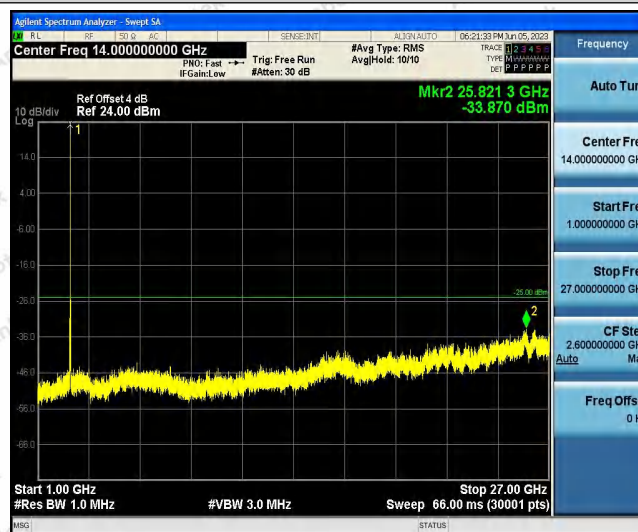

Appendix F: Frequency stability VS Voltage measurement

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band41	5MHz	QPSK	40265	25RB#0	VL	NT	41.30	0.016149	±2.5	PASS
Band41	5MHz	QPSK	40265	25RB#0	VN	NT	23.45	0.009169	±2.5	PASS
Band41	5MHz	QPSK	40265	25RB#0	VH	NT	54.22	0.021200	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	VL	NT	-6.02	-0.002315	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	VN	NT	9.67	0.003719	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	VH	NT	12.87	0.004950	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	VL	NT	22.03	0.008305	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	VN	NT	28.11	0.010598	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	VH	NT	49.71	0.018741	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	VL	NT	18.12	0.007085	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	VN	NT	52.80	0.020645	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	VH	NT	41.04	0.016047	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	VL	NT	-18.51	-0.007119	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	VN	NT	15.74	0.006054	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	VH	NT	-5.24	-0.002015	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	VL	NT	13.50	0.005090	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	VN	NT	46.29	0.017451	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	VH	NT	14.33	0.005402	±2.5	PASS
Band41	10MHz	QPSK	40290	50RB#0	VL	NT	-7.75	-0.003027	±2.5	PASS
Band41	10MHz	QPSK	40290	50RB#0	VN	NT	-13.30	-0.005195	±2.5	PASS
Band41	10MHz	QPSK	40290	50RB#0	VH	NT	-19.17	-0.007488	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	VL	NT	-16.38	-0.006300	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	VN	NT	7.55	0.002904	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	VH	NT	-12.32	-0.004738	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	VL	NT	-19.23	-0.007257	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	VN	NT	17.42	0.006574	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	VH	NT	-7.77	-0.002932	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	VL	NT	3.22	0.001258	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	VN	NT	-7.57	-0.002957	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	VH	NT	5.94	0.002320	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	VL	NT	-14.78	-0.005685	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	VN	NT	-6.88	-0.002646	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	VH	NT	-7.12	-0.002738	±2.5	PASS



Band41	10MHz	16QAM	41190	50RB#0	VL	NT	-12.43	-0.004691	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	VN	NT	5.52	0.002083	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	VH	NT	6.35	0.002396	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	VL	NT	-4.32	-0.001686	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	VN	NT	-14.49	-0.005655	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	VH	NT	8.38	0.003270	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	VL	NT	-20.40	-0.007846	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	VN	NT	4.25	0.001635	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	VH	NT	-8.93	-0.003435	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	VL	NT	-20.50	-0.007743	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	VN	NT	10.66	0.004026	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	VH	NT	-10.11	-0.003819	±2.5	PASS
Band41	15MHz	16QAM	40315	75RB#0	VL	NT	-8.05	-0.003141	±2.5	PASS
Band41	15MHz	16QAM	40315	75RB#0	VN	NT	-14.75	-0.005756	±2.5	PASS
Band41	15MHz	16QAM	40315	75RB#0	VH	NT	3.26	0.001272	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	VL	NT	-7.05	-0.002712	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	VN	NT	-15.36	-0.005908	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	VH	NT	-6.44	-0.002477	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	VL	NT	-9.44	-0.003566	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	VN	NT	7.34	0.002772	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	VH	NT	-15.66	-0.005915	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	VL	NT	-12.02	-0.004686	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	VN	NT	-15.54	-0.006058	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	VH	NT	-9.37	-0.003653	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	VL	NT	-15.46	-0.005946	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	VN	NT	9.14	0.003515	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	VH	NT	-12.06	-0.004638	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	VL	NT	-17.88	-0.006760	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	VN	NT	11.97	0.004526	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	VH	NT	13.79	0.005214	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	VL	NT	6.28	0.002448	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	VN	NT	-15.85	-0.006179	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	VH	NT	-23.15	-0.009025	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	VL	NT	-21.16	-0.008138	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	VN	NT	8.05	0.003096	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	VH	NT	8.43	0.003242	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	VL	NT	11.37	0.004299	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	VN	NT	-23.96	-0.009059	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	VH	NT	17.84	0.006745	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band41	5MHz	QPSK	40265	25RB#0	NV	-30	26.56	0.010385	±2.5	PASS
Band41	5MHz	QPSK	40265	25RB#0	NV	-20	27.01	0.010561	±2.5	PASS
Band41	5MHz	QPSK	40265	25RB#0	NV	0	47.44	0.018549	±2.5	PASS
Band41	5MHz	QPSK	40265	25RB#0	NV	10	14.42	0.005638	±2.5	PASS
Band41	5MHz	QPSK	40265	25RB#0	NV	20	20.93	0.008184	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	NV	-30	-33.82	-0.013008	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	NV	-20	-11.94	-0.004592	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	NV	0	14.42	0.005546	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	NV	10	-24.13	-0.009281	±2.5	PASS
Band41	5MHz	QPSK	40690	25RB#0	NV	20	-10.43	-0.004012	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	-30	9.36	0.003529	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	-20	10.99	0.004143	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	0	36.95	0.013930	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	10	18.12	0.006831	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	20	21.47	0.008094	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	NV	-30	70.81	0.027687	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	NV	-20	28.85	0.011281	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	NV	0	26.18	0.010237	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	NV	10	63.33	0.024762	±2.5	PASS
Band41	5MHz	16QAM	40265	25RB#0	NV	20	14.72	0.005756	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	NV	-30	12.52	0.004815	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	NV	-20	-23.85	-0.009173	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	NV	0	7.08	0.002723	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	NV	10	9.07	0.003488	±2.5	PASS
Band41	5MHz	16QAM	40690	25RB#0	NV	20	-25.78	-0.009915	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	-30	33.36	0.012577	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	-20	16.91	0.006375	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	0	-6.71	-0.002530	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	10	14.03	0.005289	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	20	13.65	0.005146	±2.5	PASS
Band41	10MHz	QPSK	40290	50RB#0	NV	-30	-10.16	-0.003969	±2.5	PASS
Band41	10MHz	QPSK	40290	50RB#0	NV	-20	-12.96	-0.005063	±2.5	PASS
Band41	10MHz	QPSK	40290	50RB#0	NV	0	7.31	0.002855	±2.5	PASS
Band41	10MHz	QPSK	40290	50RB#0	NV	10	-20.28	-0.007922	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	10MHz	QPSK	40290	50RB#0	NV	20	-2.65	-0.001035	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	NV	-30	5.42	0.002085	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	NV	-20	-4.49	-0.001727	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	NV	0	-12.72	-0.004892	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	NV	10	-11.10	-0.004269	±2.5	PASS
Band41	10MHz	QPSK	40690	50RB#0	NV	20	-7.38	-0.002838	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	-30	-5.45	-0.002057	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	-20	10.36	0.003909	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	0	-20.40	-0.007698	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	10	-8.78	-0.003313	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	20	-4.16	-0.001570	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	NV	-30	-20.14	-0.007867	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	NV	-20	-2.35	-0.000918	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	NV	0	-3.30	-0.001289	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	NV	10	-16.98	-0.006633	±2.5	PASS
Band41	10MHz	16QAM	40290	50RB#0	NV	20	-10.14	-0.003961	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	NV	-30	5.22	0.002008	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	NV	-20	-16.44	-0.006323	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	NV	0	-6.34	-0.002438	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	NV	10	6.39	0.002458	±2.5	PASS
Band41	10MHz	16QAM	40690	50RB#0	NV	20	-17.74	-0.006823	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	-30	7.52	0.002838	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	-20	-19.25	-0.007264	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	0	-7.42	-0.002800	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	10	6.55	0.002472	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	20	-14.10	-0.005321	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	NV	-30	-5.78	-0.002256	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	NV	-20	-5.11	-0.001994	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	NV	0	-19.80	-0.007727	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	NV	10	-8.54	-0.003333	±2.5	PASS
Band41	15MHz	QPSK	40315	75RB#0	NV	20	5.28	0.002060	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	NV	-30	6.48	0.002492	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	NV	-20	11.83	0.004550	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	NV	0	-8.64	-0.003323	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	NV	10	-4.96	-0.001908	±2.5	PASS
Band41	15MHz	QPSK	40690	75RB#0	NV	20	14.29	0.005496	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	-30	8.81	0.003328	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	-20	-18.00	-0.006799	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	0	-8.54	-0.003226	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	10	-19.38	-0.007320	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	20	-7.52	-0.002840	±2.5	PASS



Band41	15MHz	16QAM	40315	75RB#0	NV	-30	5.46	0.002131	±2.5	PASS
Band41	15MHz	16QAM	40315	75RB#0	NV	-20	-12.39	-0.004835	±2.5	PASS
Band41	15MHz	16QAM	40315	75RB#0	NV	0	-3.60	-0.001405	±2.5	PASS
Band41	15MHz	16QAM	40315	75RB#0	NV	10	-5.59	-0.002181	±2.5	PASS
Band41	15MHz	16QAM	40315	75RB#0	NV	20	-12.56	-0.004901	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	NV	-30	8.38	0.003223	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	NV	-20	-13.95	-0.005365	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	NV	0	4.59	0.001765	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	NV	10	-15.98	-0.006146	±2.5	PASS
Band41	15MHz	16QAM	40690	75RB#0	NV	20	-9.46	-0.003638	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	-30	-13.26	-0.005008	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	-20	9.33	0.003524	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	0	-18.04	-0.006814	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	10	3.78	0.001428	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	20	6.90	0.002606	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	NV	-30	-20.27	-0.007903	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	NV	-20	-17.87	-0.006967	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	NV	0	-19.31	-0.007528	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	NV	10	-10.40	-0.004055	±2.5	PASS
Band41	20MHz	QPSK	40340	100RB#0	NV	20	13.16	0.005131	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	NV	-30	9.74	0.003746	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	NV	-20	-14.48	-0.005569	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	NV	0	-9.88	-0.003800	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	NV	10	3.66	0.001408	±2.5	PASS
Band41	20MHz	QPSK	40690	100RB#0	NV	20	-16.68	-0.006415	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	-30	-23.00	-0.008696	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	-20	-14.62	-0.005527	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	0	14.95	0.005652	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	10	-15.79	-0.005970	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	20	8.10	0.003062	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	NV	-30	-12.40	-0.004834	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	NV	-20	-5.76	-0.002246	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	NV	0	-15.85	-0.006179	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	NV	10	-11.80	-0.004600	±2.5	PASS
Band41	20MHz	16QAM	40340	100RB#0	NV	20	-29.23	-0.011396	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	NV	-30	9.87	0.003796	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	NV	-20	-20.33	-0.007819	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	NV	0	-8.55	-0.003288	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	NV	10	-18.17	-0.006988	±2.5	PASS
Band41	20MHz	16QAM	40690	100RB#0	NV	20	-9.91	-0.003812	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	-30	-20.11	-0.007603	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band41	20MHz	16QAM	41140	100RB#0	NV	-20	-13.23	-0.005002	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	0	-6.59	-0.002491	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	10	-5.82	-0.002200	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	20	7.80	0.002949	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

