





Restrict Band NVNT n20 5180MHz Ant1 Peak

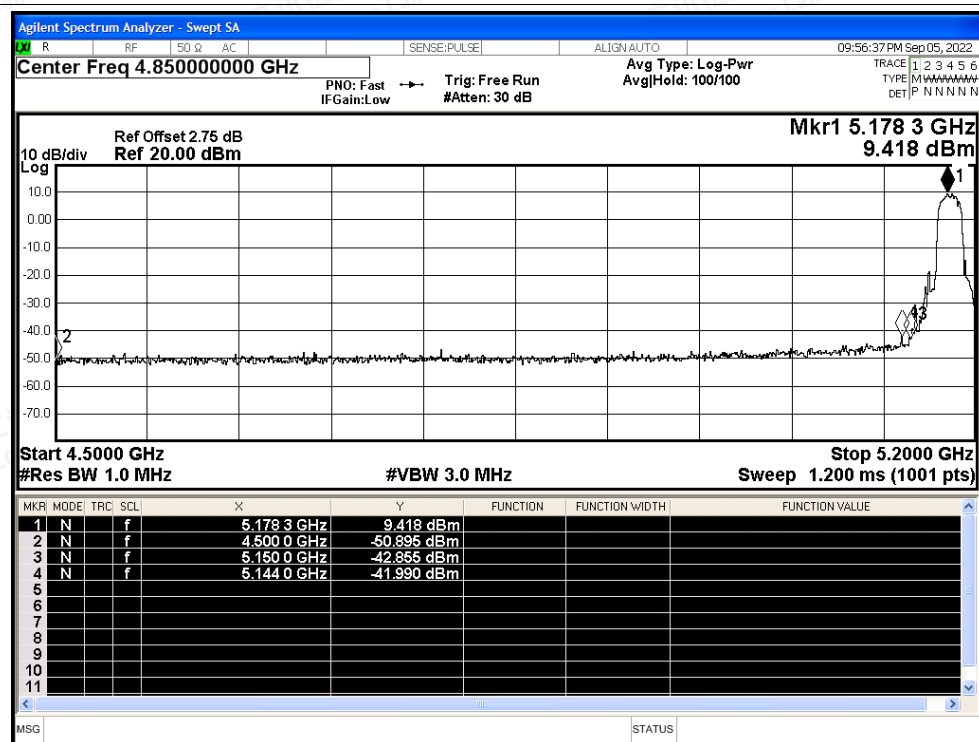


Restrict Band NVNT n20 5180MHz Ant1 Average

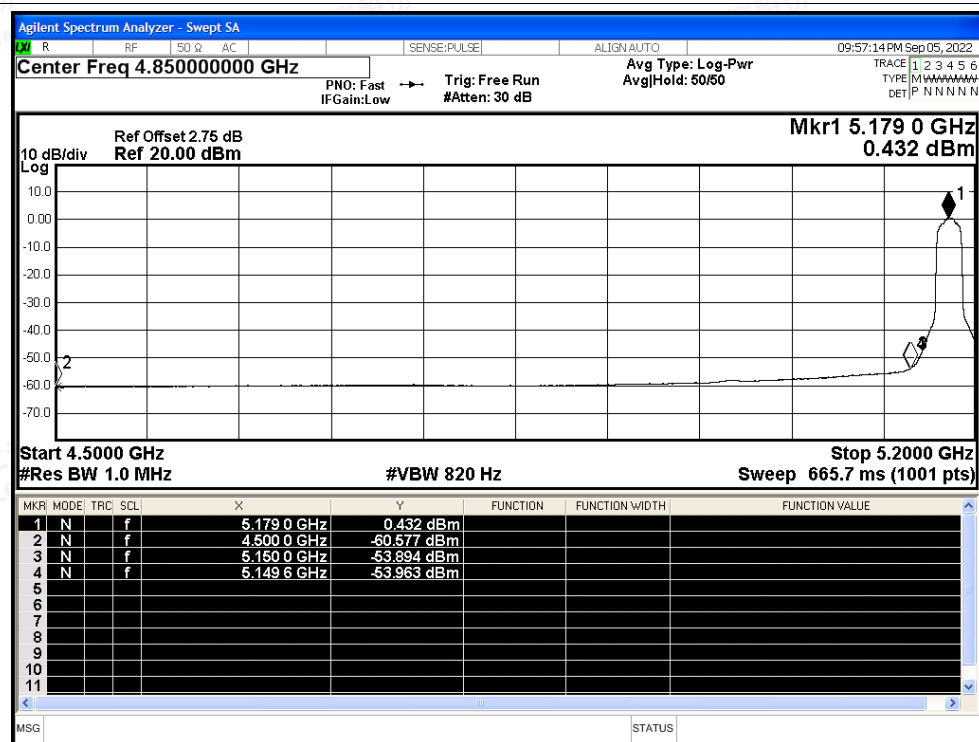




Restrict Band NVNT n20 5240MHz Ant1 Peak

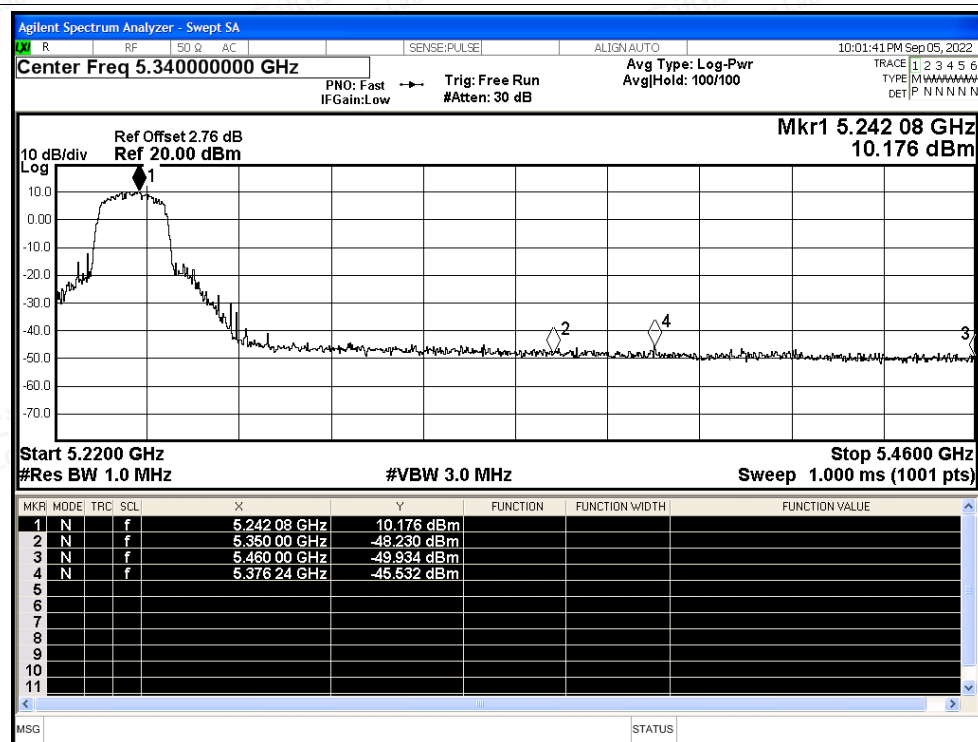

Restrict Band NVNT n20 5240MHz Ant1 Average

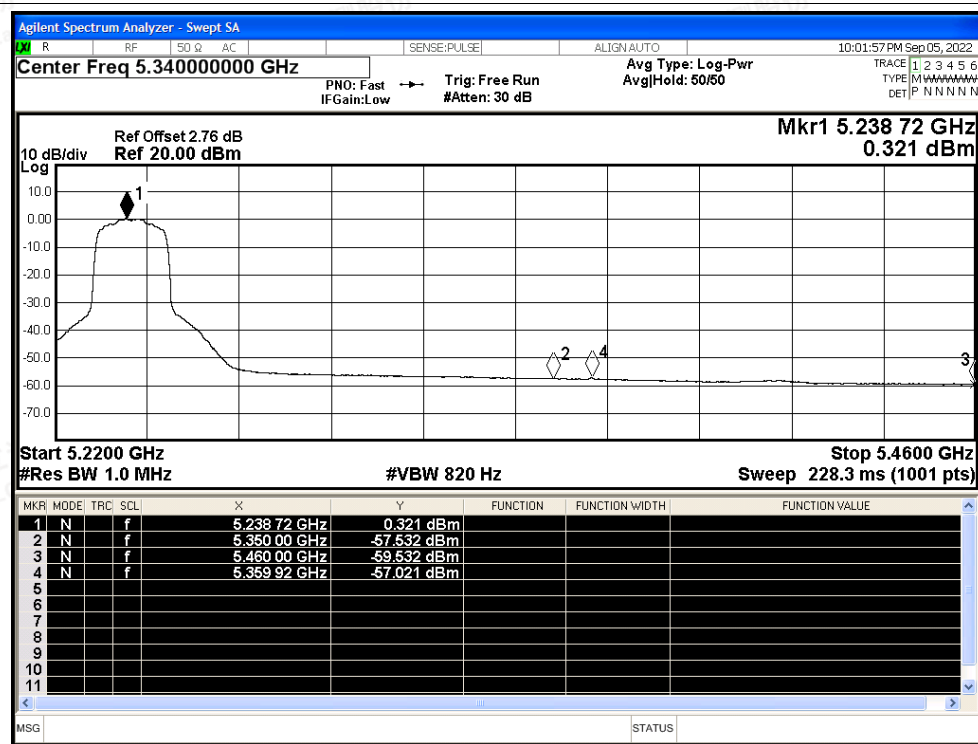

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant1 Peak

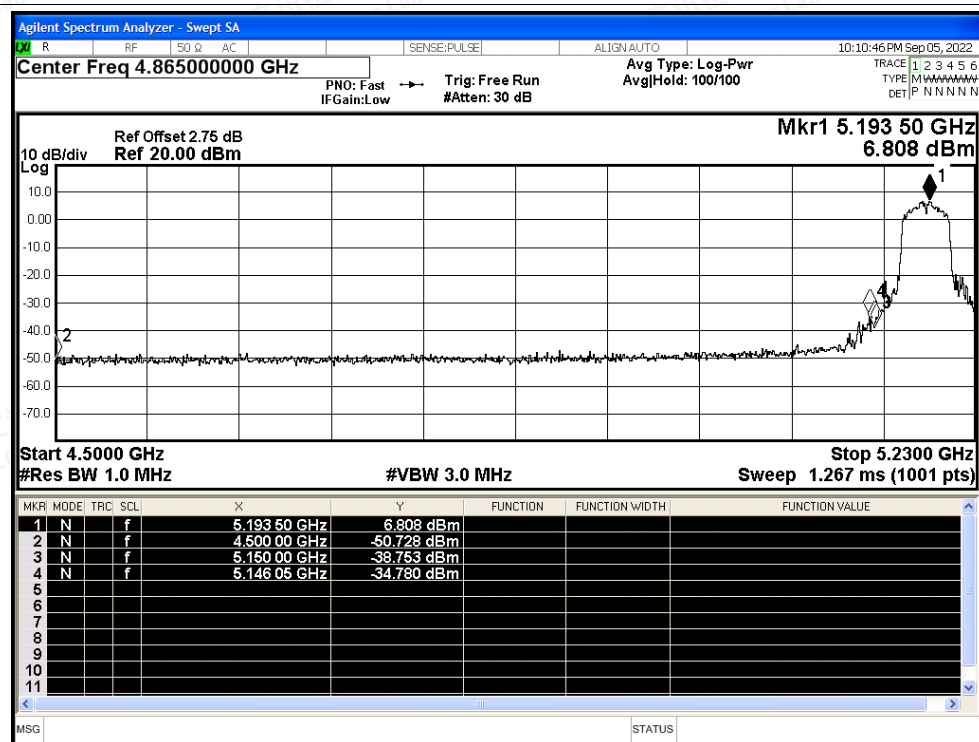

Restrict Band NVNT n40 5190MHz Ant1 Average

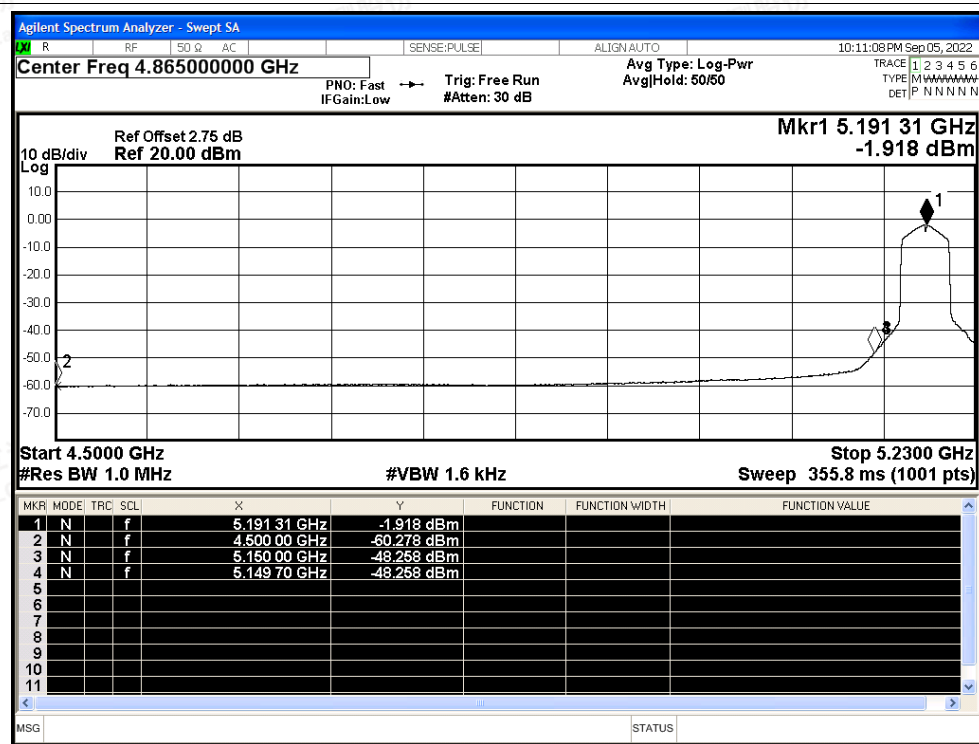

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

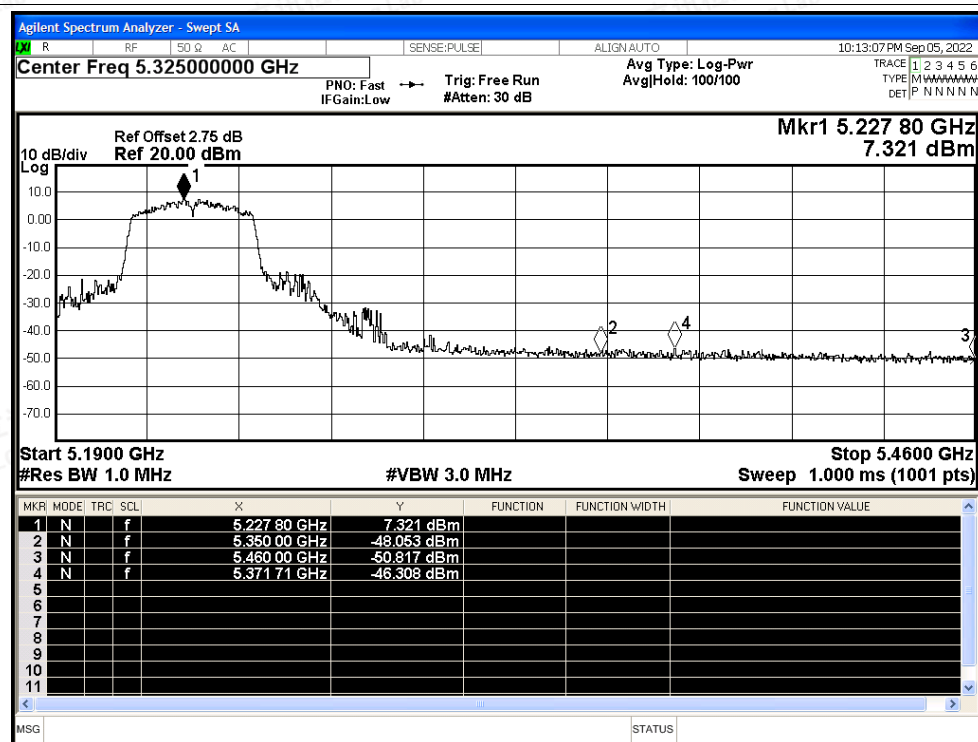


Restrict Band NVNT n40 5230MHz Ant1 Average

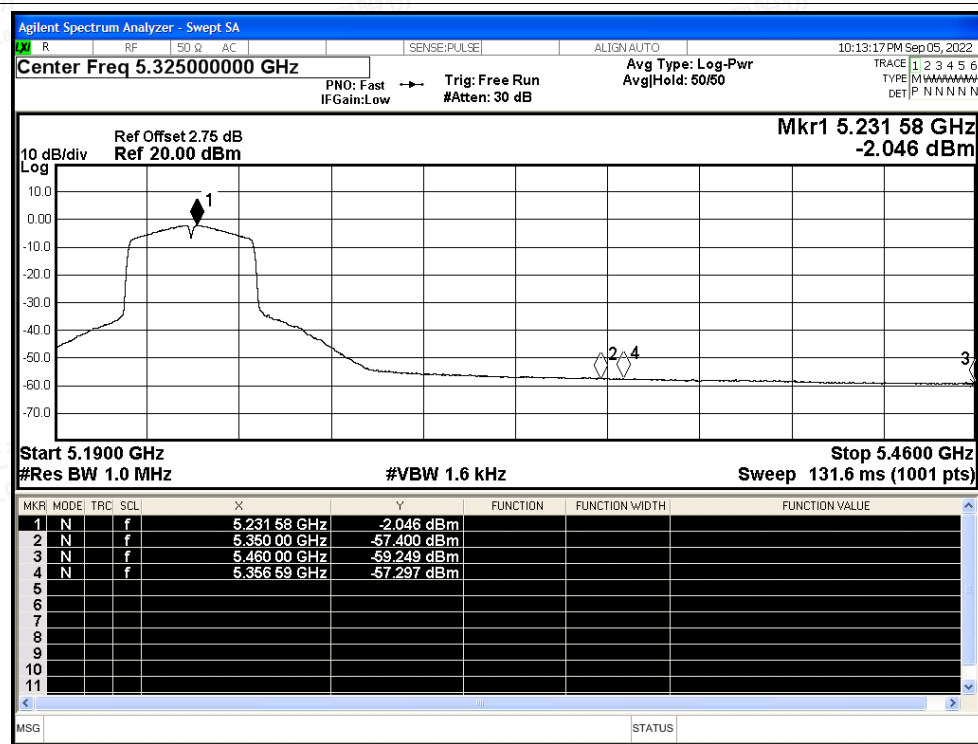




Restrict Band NVNT ac20 5180MHz Ant1 Peak

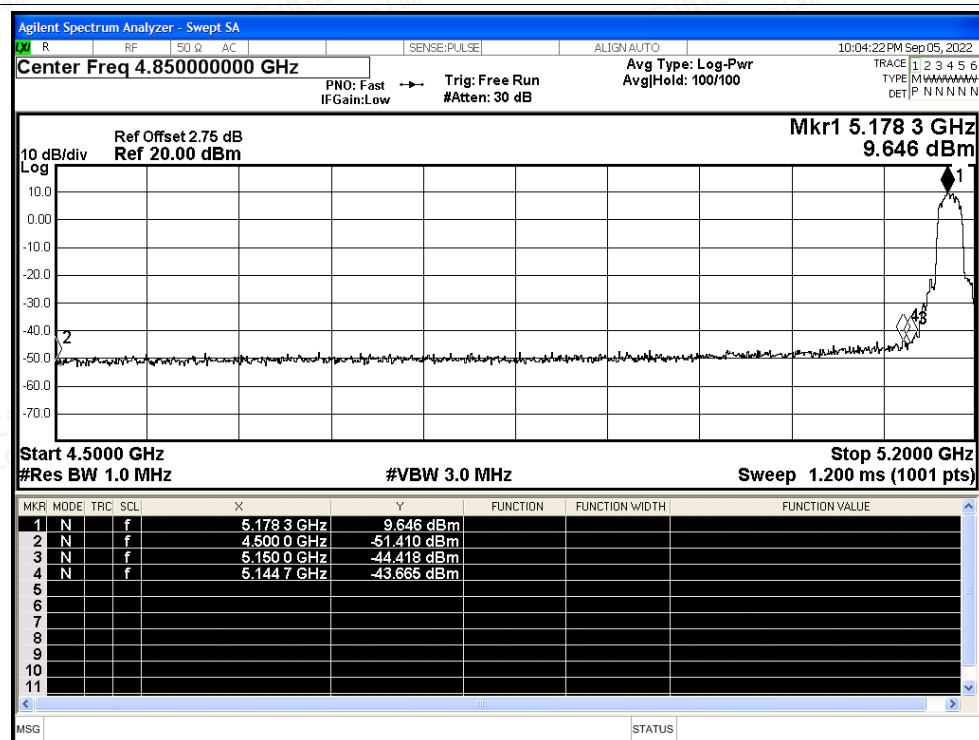


Restrict Band NVNT ac20 5180MHz Ant1 Average

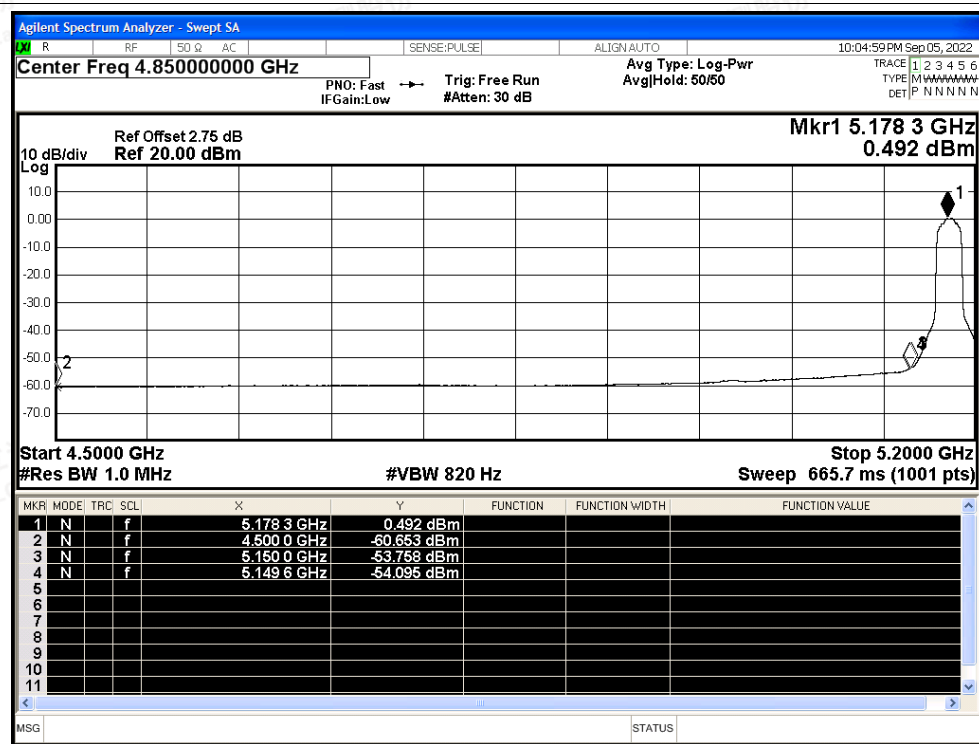




Restrict Band NVNT ac20 5240MHz Ant1 Peak

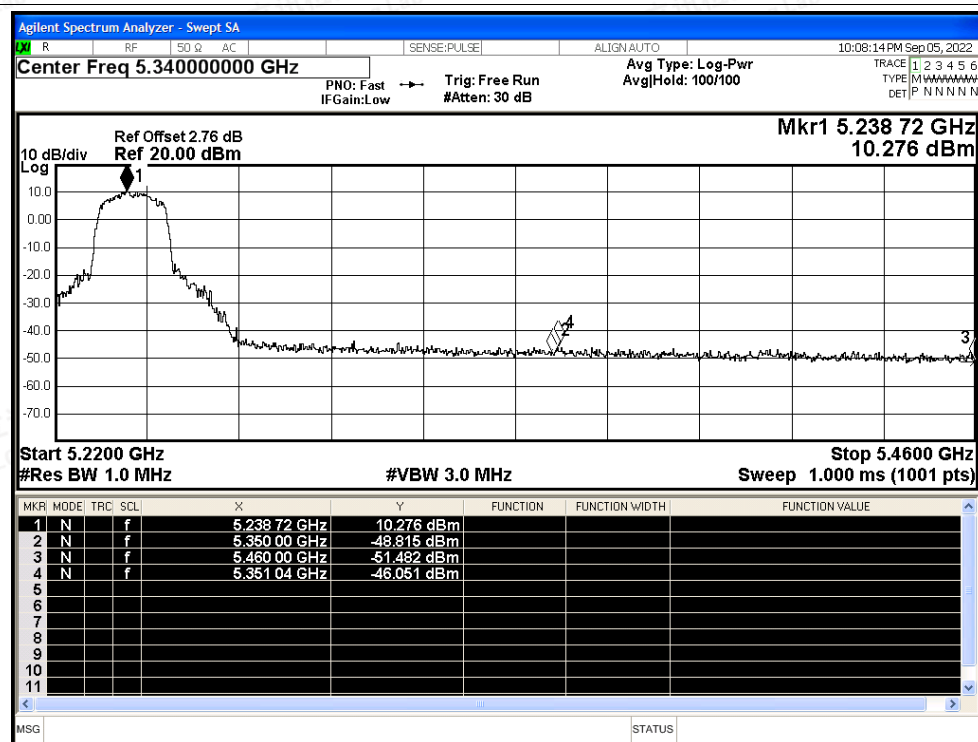

Restrict Band NVNT ac20 5240MHz Ant1 Average

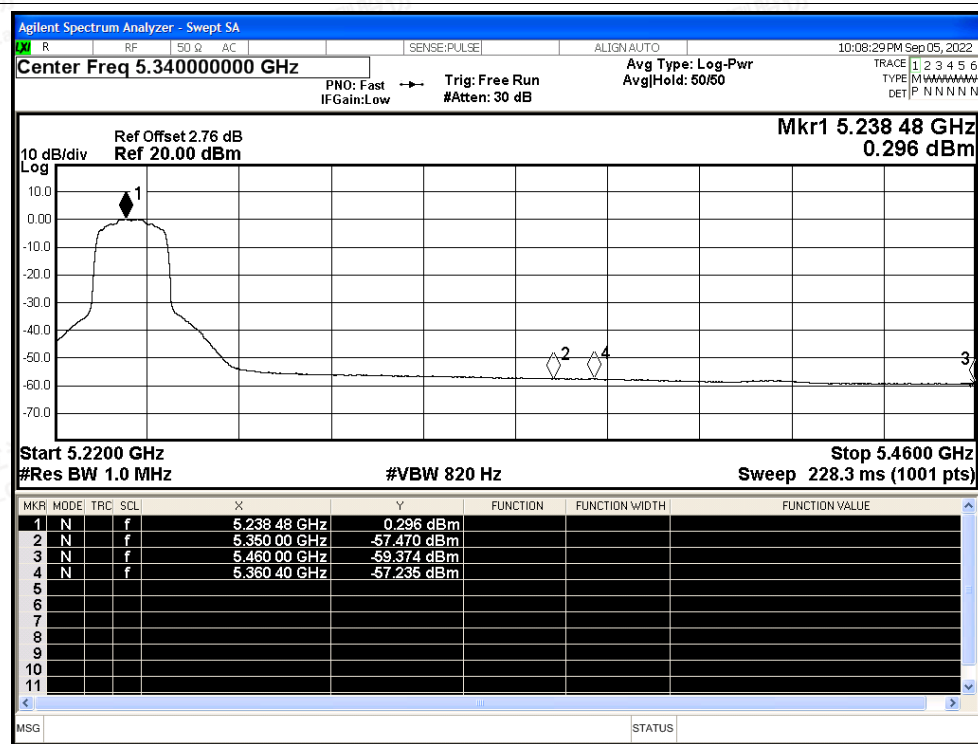

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

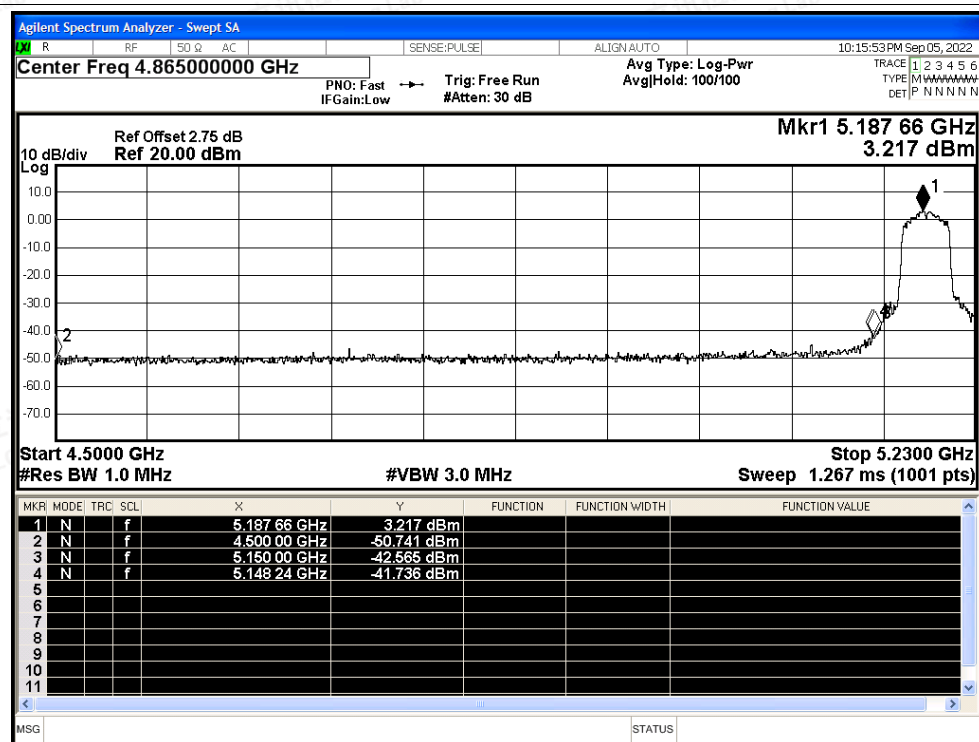


Restrict Band NVNT ac40 5190MHz Ant1 Average

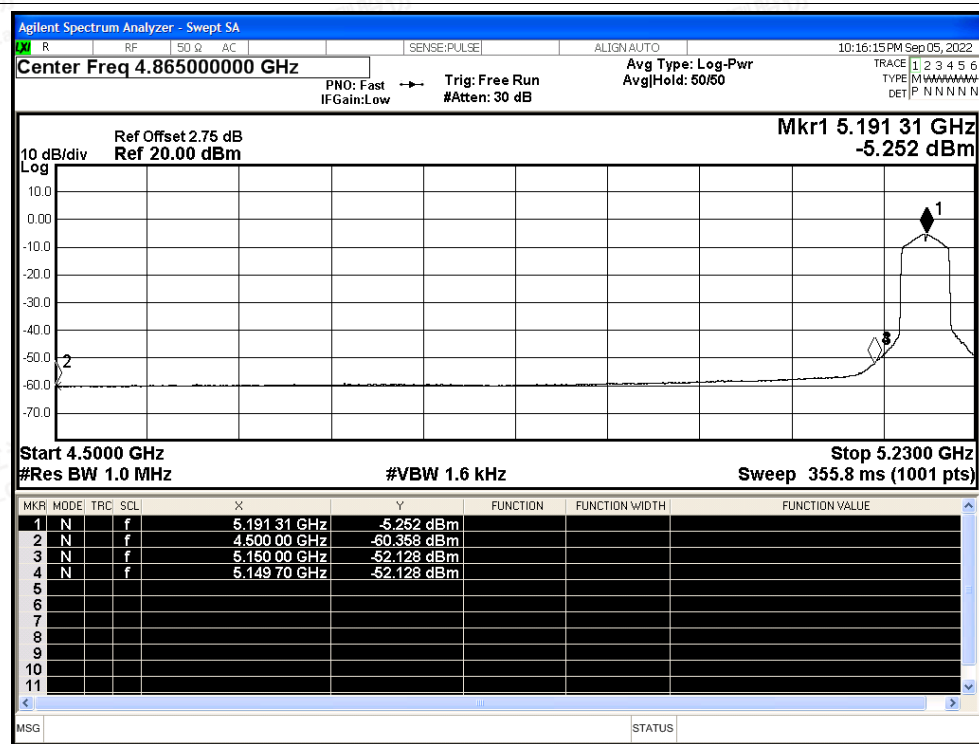




Restrict Band NVNT ac40 5230MHz Ant1 Peak

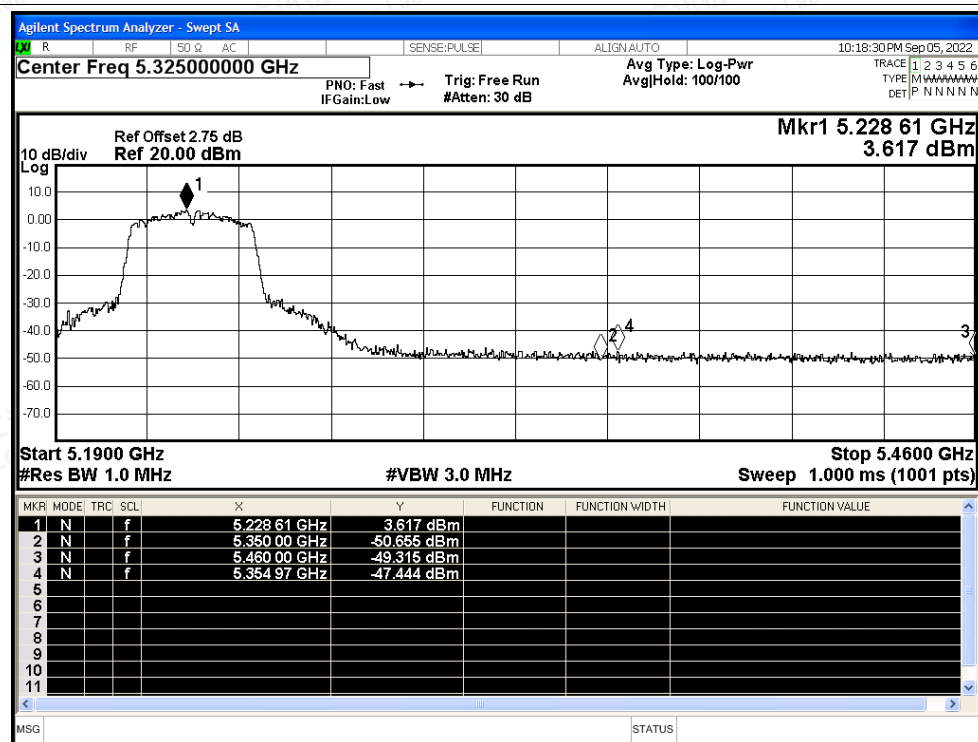

Restrict Band NVNT ac40 5230MHz Ant1 Average

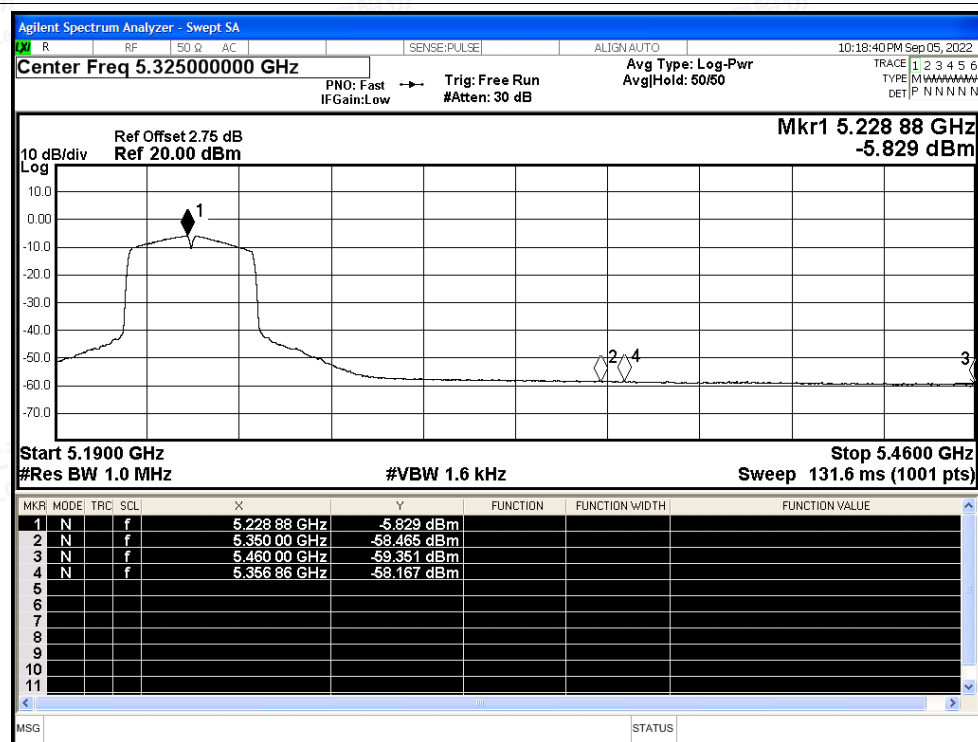

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

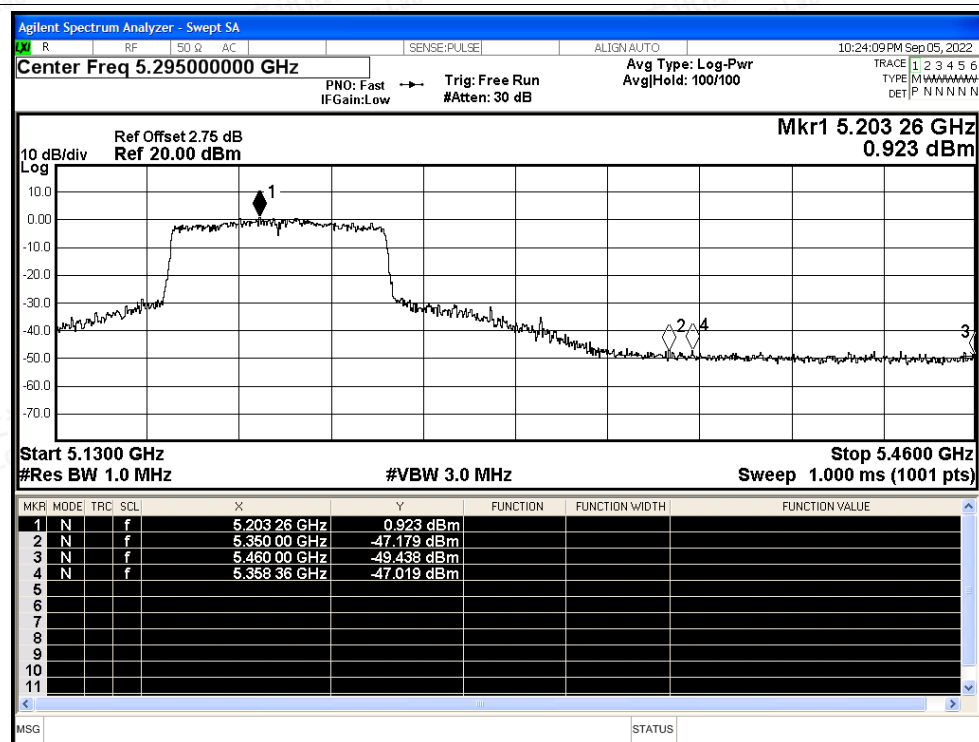


Restrict Band NVNT ac80 5210MHz Ant1 Average

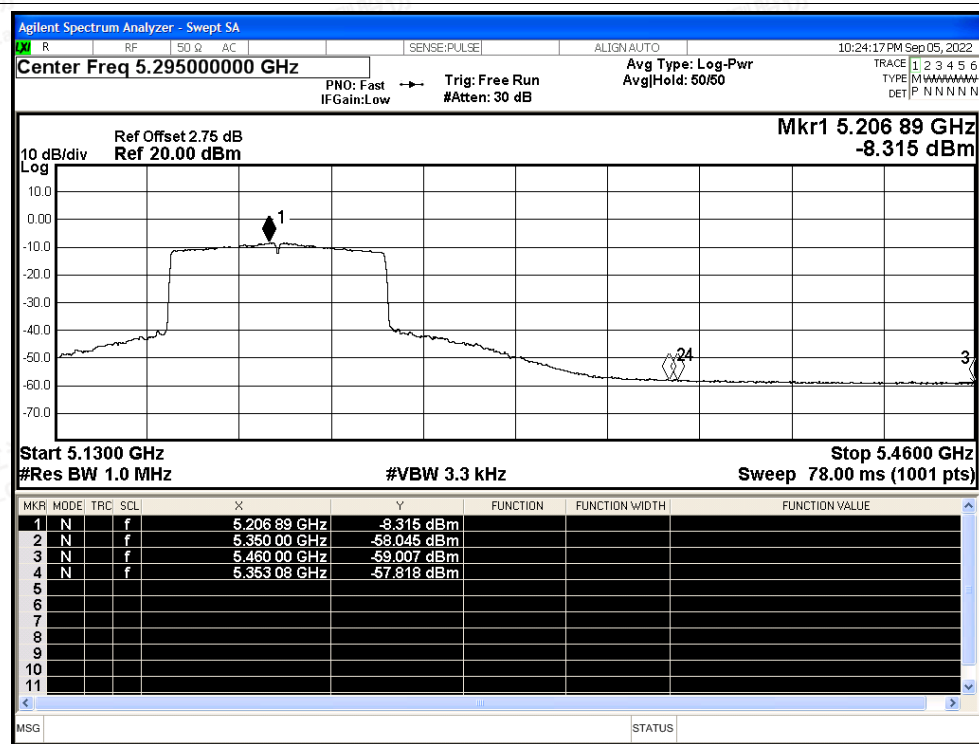




Restrict Band NVNT ac80 5210MHz Ant1 Peak

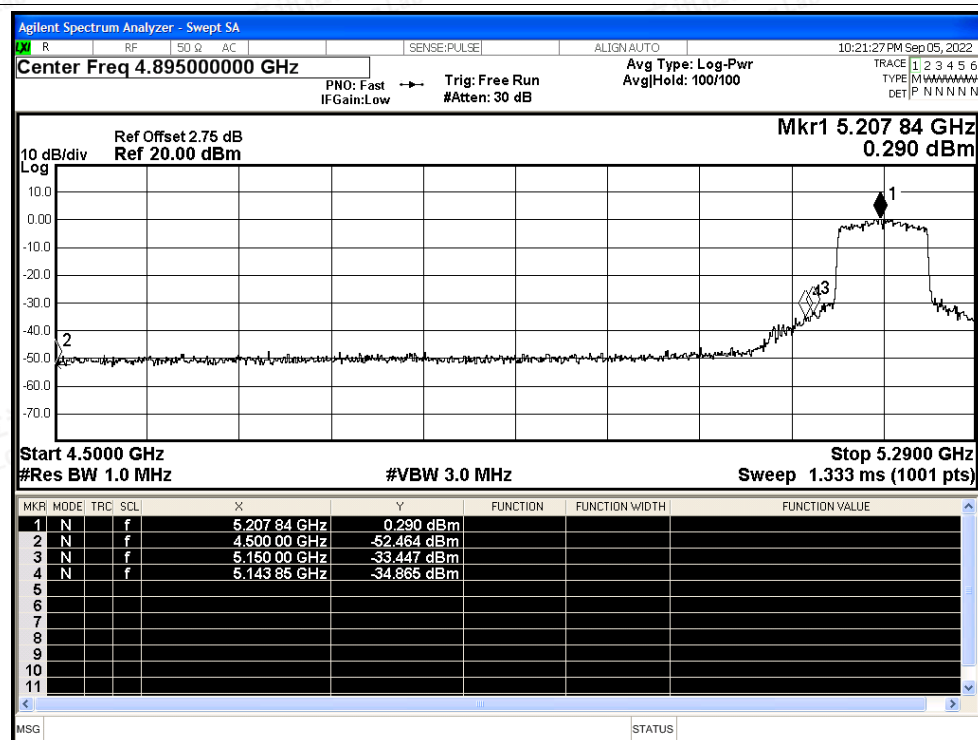

Restrict Band NVNT ac80 5210MHz Ant1 Average

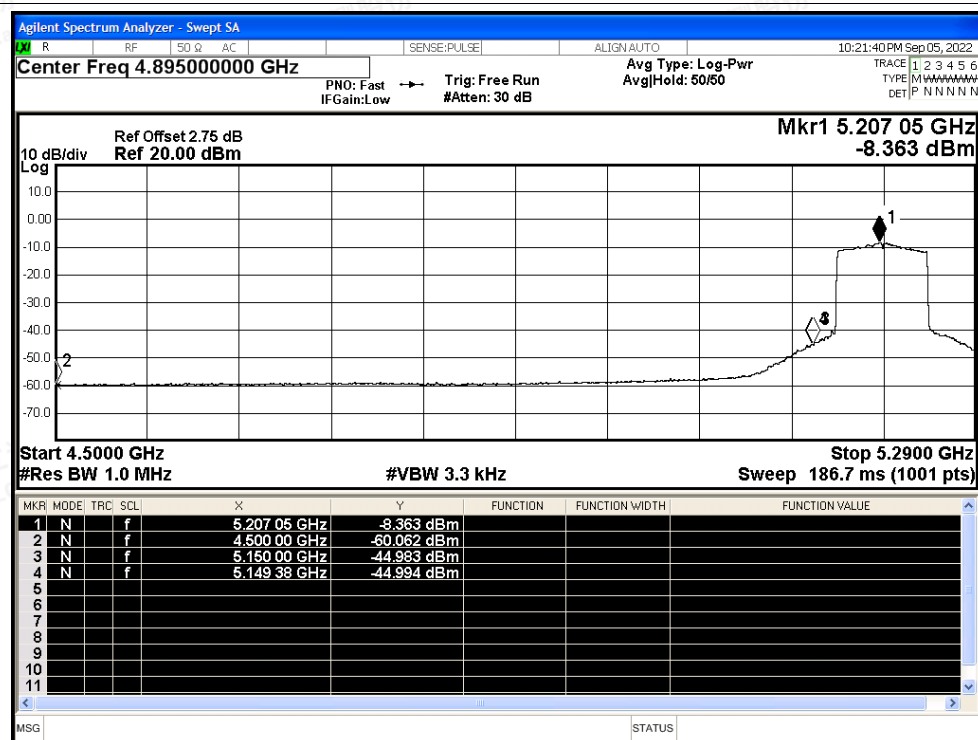

Restrict Band NVNT ax20 5180MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

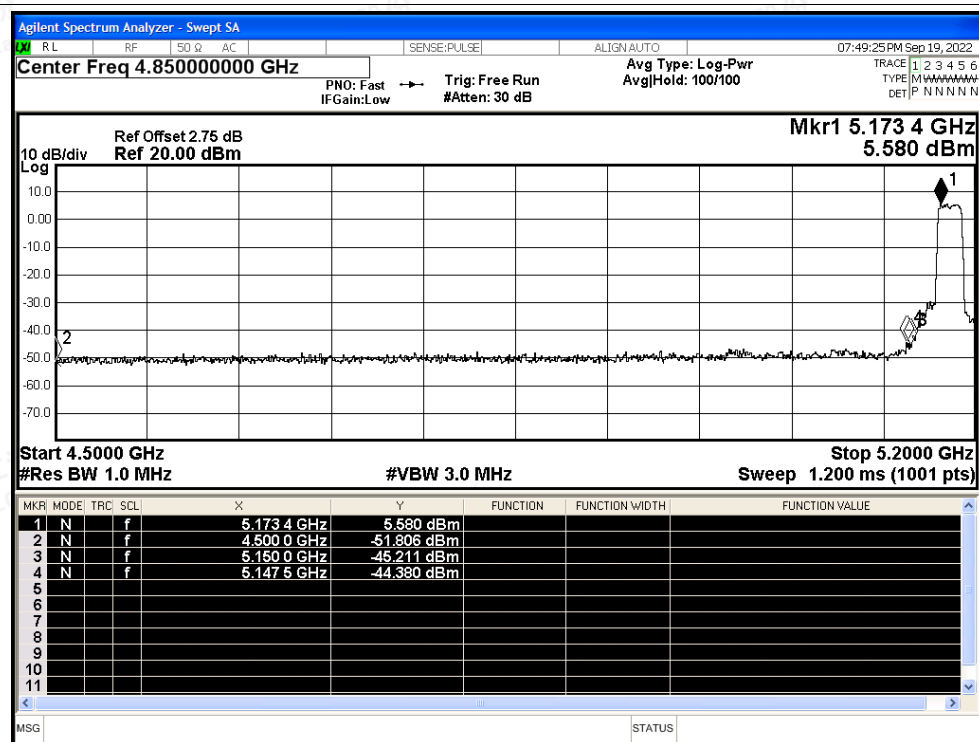


Restrict Band NVNT ax20 5180MHz Ant1 Average

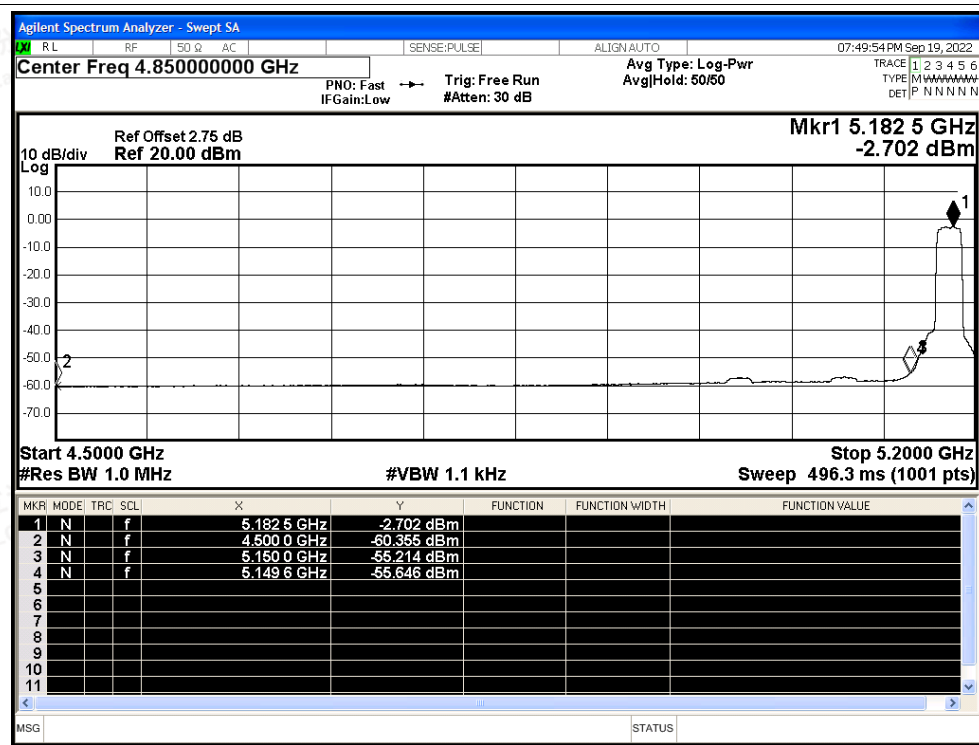




Restrict Band NVNT ax20 5240MHz Ant1 Peak

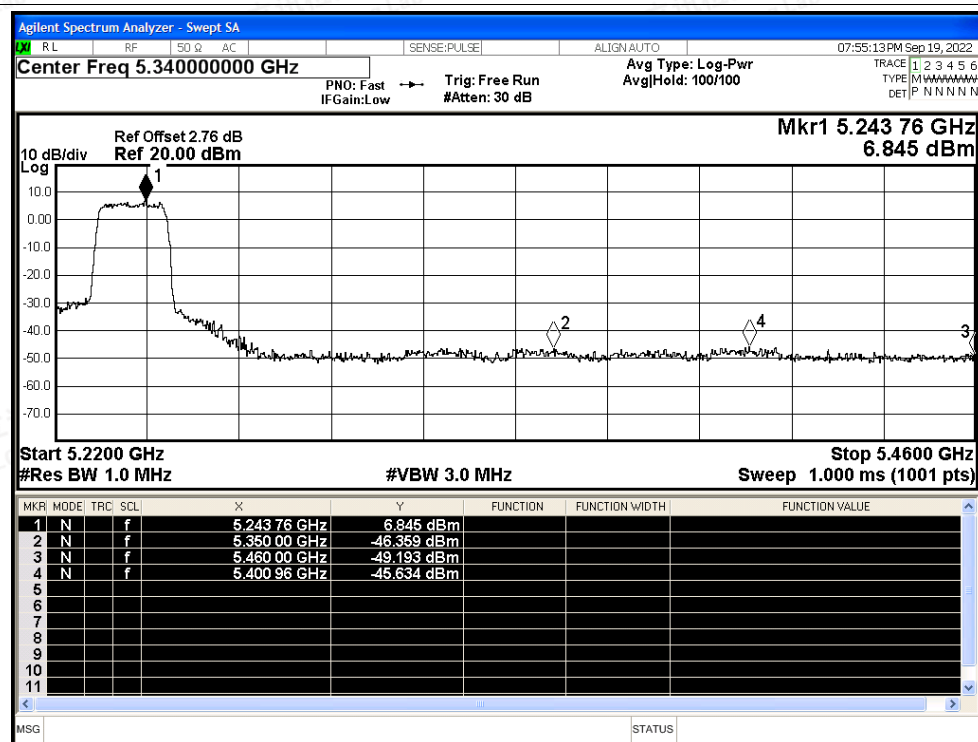

Restrict Band NVNT ax20 5240MHz Ant1 Average

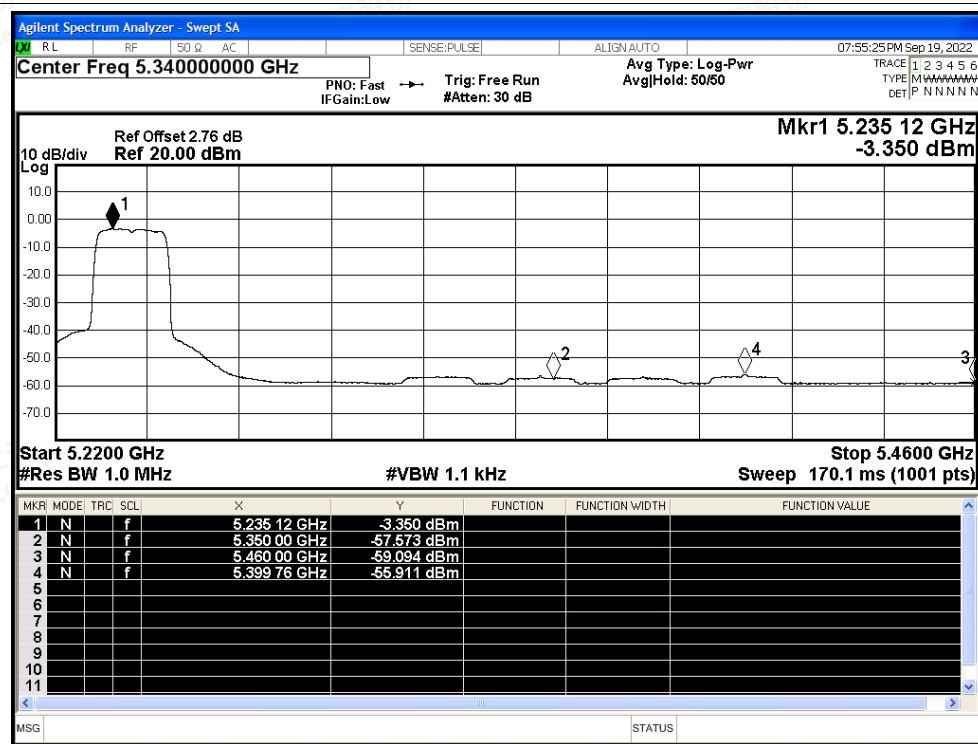

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

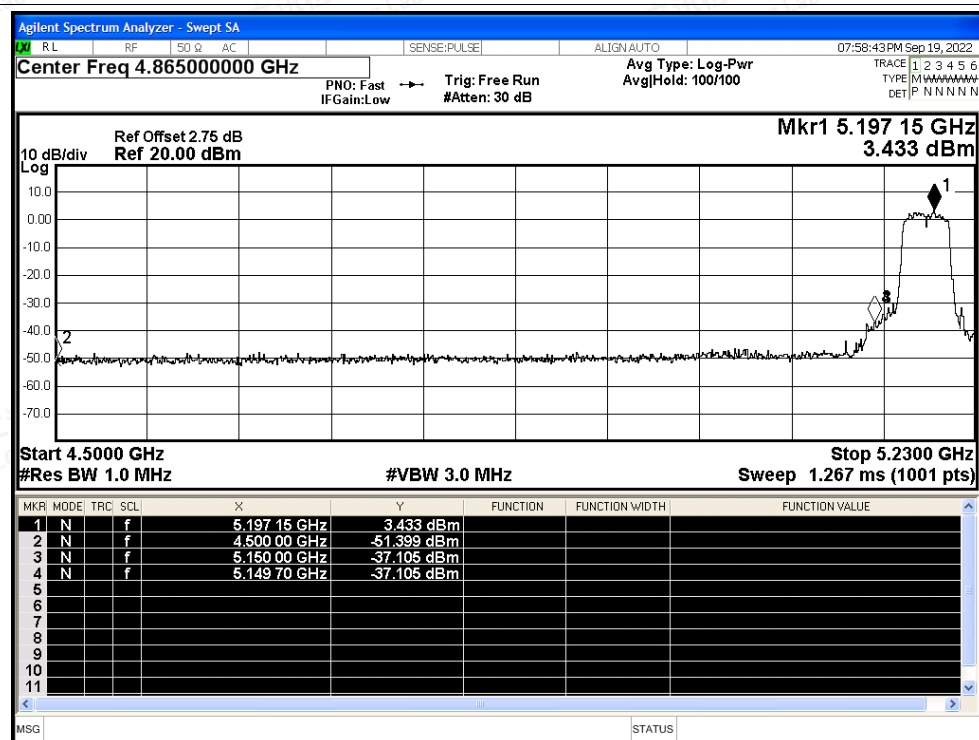


Restrict Band NVNT ax40 5190MHz Ant1 Average

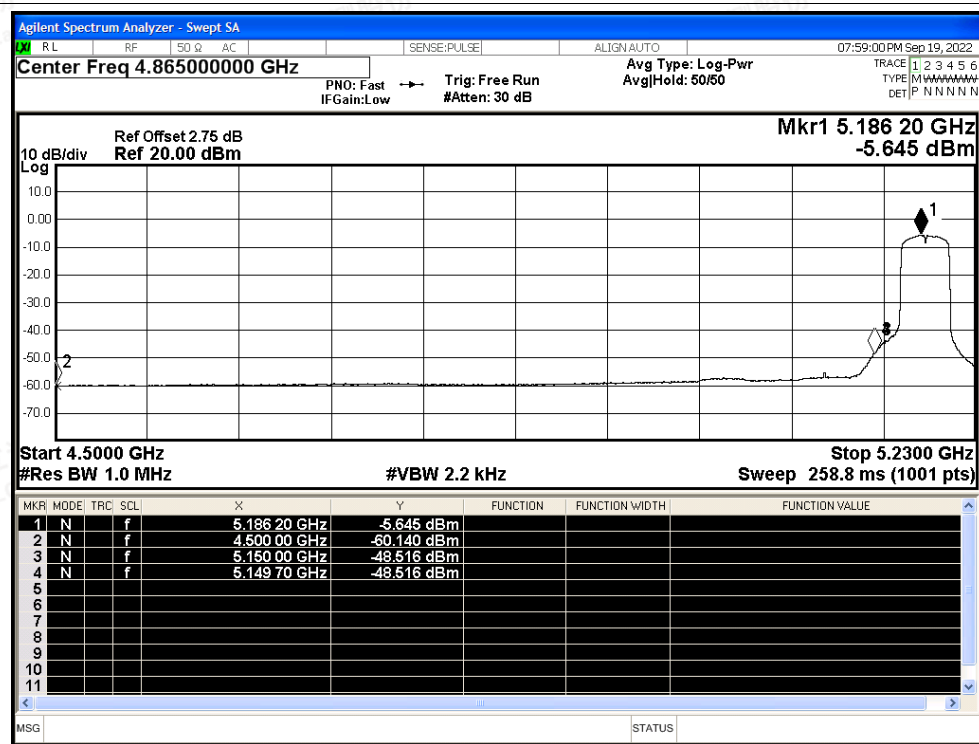




Restrict Band NVNT ax40 5230MHz Ant1 Peak

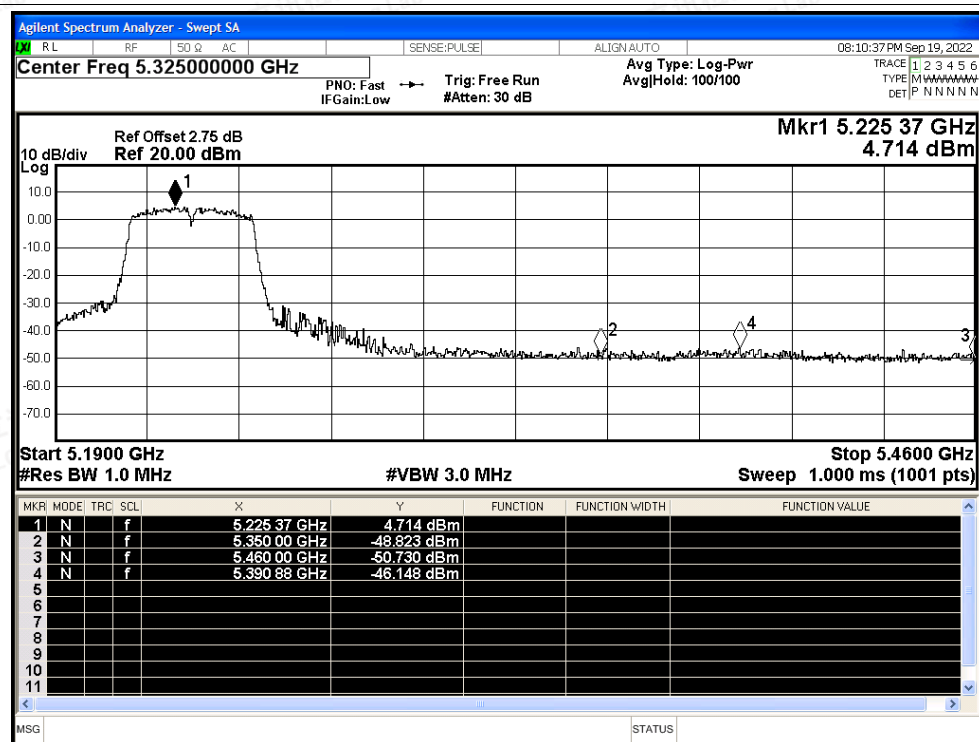


Restrict Band NVNT ax40 5230MHz Ant1 Average

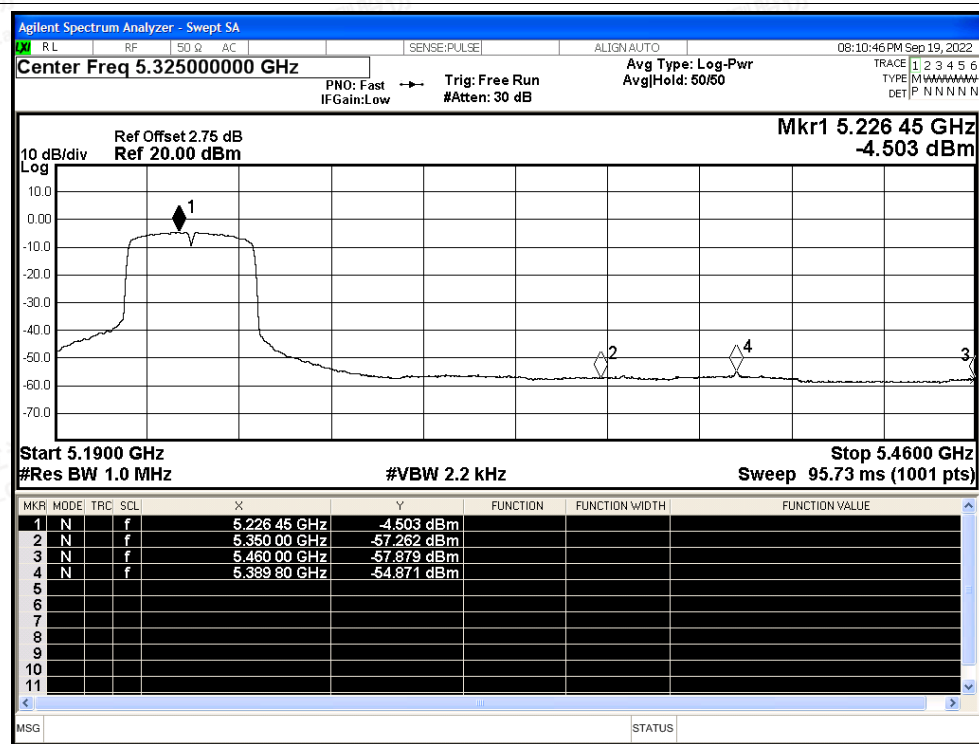




Restrict Band NVNT ax80 5210MHz Ant1 Peak

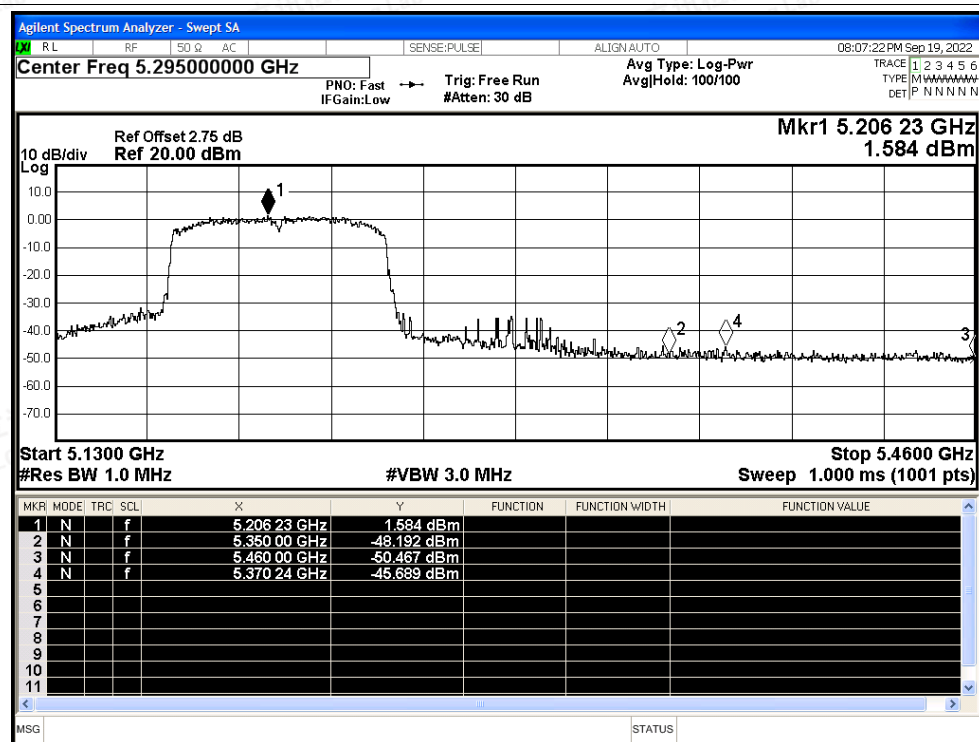


Restrict Band NVNT ax80 5210MHz Ant1 Average

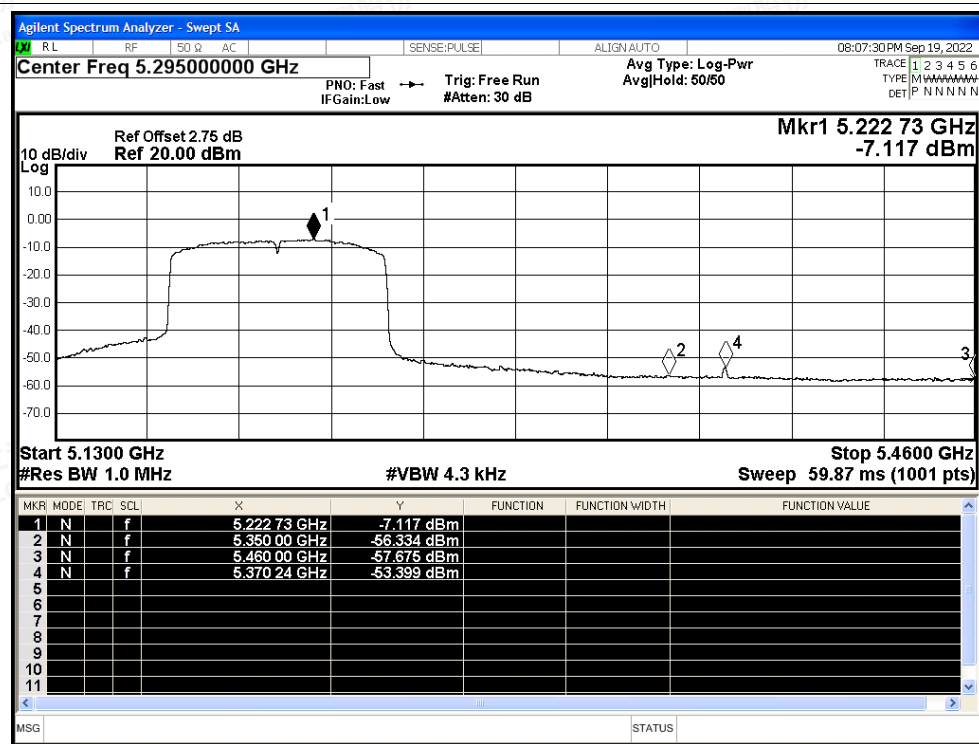




Restrict Band NVNT ax80 5210MHz Ant1 Peak

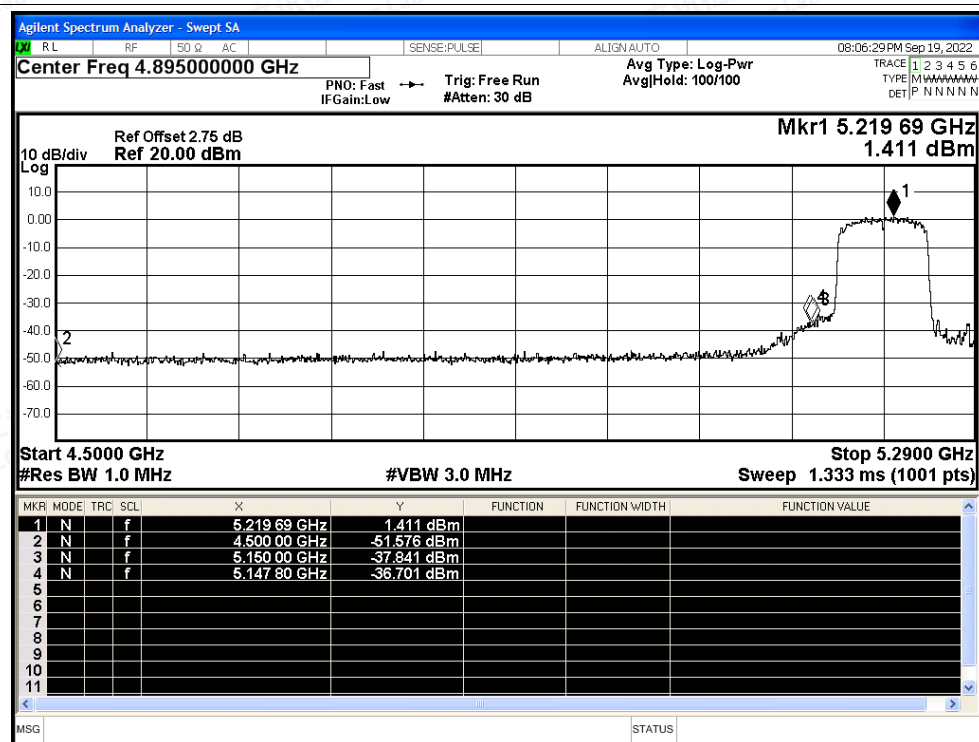

Restrict Band NVNT ax80 5210MHz Ant1 Average

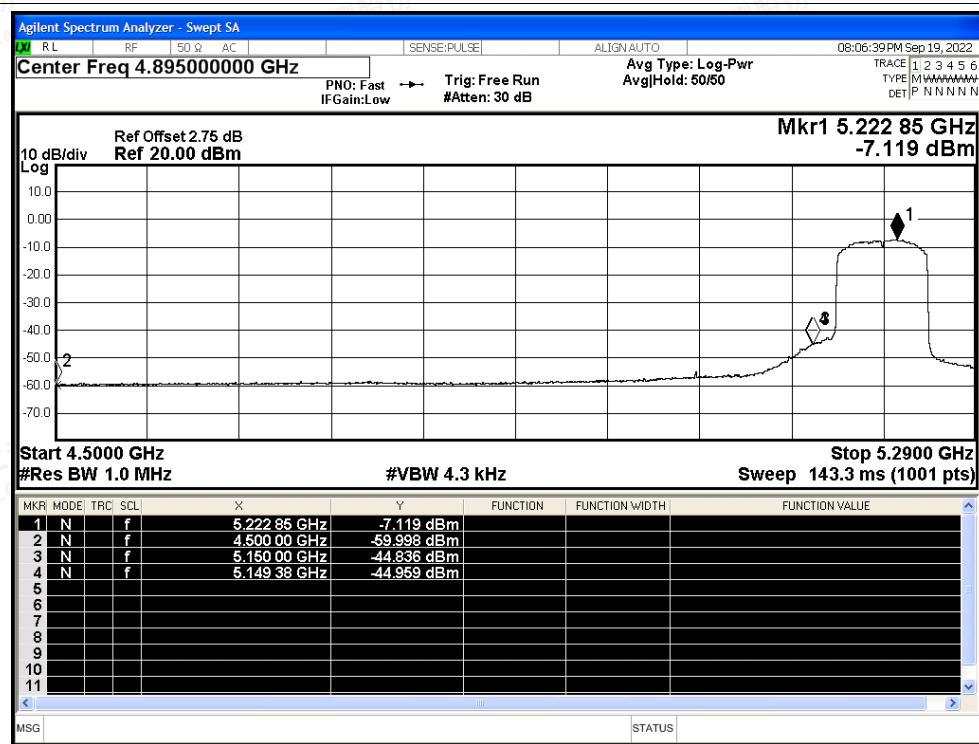



MIMO:

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	Ant0+Ant1	4500	-51.76	4.11	47.58	Peak	68.2	Pass
NVNT	n20	5180	Ant0+Ant1	4500	-60.63	4.11	38.71	Average	54	Pass
NVNT	n20	5180	Ant0+Ant1	5080.3	-45.72	4.11	53.62	Peak	68.2	Pass
NVNT	n20	5180	Ant0+Ant1	5149.6	-57.14	4.11	42.20	Average	54	Pass
NVNT	n20	5180	Ant0+Ant1	5150	-48.17	4.11	51.17	Peak	68.2	Pass
NVNT	n20	5180	Ant0+Ant1	5150	-56.97	4.11	42.37	Average	54	Pass
NVNT	n20	5240	Ant0+Ant1	5350	-48.21	4.11	51.13	Peak	68.2	Pass
NVNT	n20	5240	Ant0+Ant1	5350	-58.42	4.11	40.92	Average	54	Pass
NVNT	n20	5240	Ant0+Ant1	5367.84	-46.87	4.11	52.47	Peak	68.2	Pass
NVNT	n20	5240	Ant0+Ant1	5373.12	-58.04	4.11	41.30	Average	54	Pass
NVNT	n20	5240	Ant0+Ant1	5460	-50.25	4.11	49.09	Peak	68.2	Pass
NVNT	n20	5240	Ant0+Ant1	5460	-59.62	4.11	39.72	Average	54	Pass
NVNT	n40	5190	Ant0+Ant1	4500	-49.33	4.11	50.01	Peak	68.2	Pass
NVNT	n40	5190	Ant0+Ant1	4500	-60.36	4.11	38.98	Average	54	Pass
NVNT	n40	5190	Ant0+Ant1	5148.24	-37.1	4.11	62.24	Peak	68.2	Pass
NVNT	n40	5190	Ant0+Ant1	5149.7	-49.72	4.11	49.62	Average	54	Pass
NVNT	n40	5190	Ant0+Ant1	5150	-41.13	4.11	58.21	Peak	68.2	Pass
NVNT	n40	5190	Ant0+Ant1	5150	-49.72	4.11	49.62	Average	54	Pass
NVNT	n40	5230	Ant0+Ant1	5350	-49.88	4.11	49.46	Peak	68.2	Pass
NVNT	n40	5230	Ant0+Ant1	5350	-58.32	4.11	41.02	Average	54	Pass
NVNT	n40	5230	Ant0+Ant1	5365.77	-47.13	4.11	52.21	Peak	68.2	Pass
NVNT	n40	5230	Ant0+Ant1	5352	-58.04	4.11	41.30	Average	54	Pass
NVNT	n40	5230	Ant0+Ant1	5460	-48.08	4.11	51.26	Peak	68.2	Pass
NVNT	n40	5230	Ant0+Ant1	5460	-58.81	4.11	40.53	Average	54	Pass
NVNT	ac20	5180	Ant0+Ant1	4500	-51.44	4.11	47.90	Peak	68.2	Pass
NVNT	ac20	5180	Ant0+Ant1	4500	-60.15	4.11	39.19	Average	54	Pass
NVNT	ac20	5180	Ant0+Ant1	5107.6	-46.15	4.11	53.19	Peak	68.2	Pass
NVNT	ac20	5180	Ant0+Ant1	5149.6	-56.6	4.11	42.74	Average	54	Pass
NVNT	ac20	5180	Ant0+Ant1	5150	-46.83	4.11	52.51	Peak	68.2	Pass
NVNT	ac20	5180	Ant0+Ant1	5150	-56.52	4.11	42.82	Average	54	Pass
NVNT	ac20	5240	Ant0+Ant1	5350	-49.63	4.11	49.71	Peak	68.2	Pass
NVNT	ac20	5240	Ant0+Ant1	5350	-57.91	4.11	41.43	Average	54	Pass
NVNT	ac20	5240	Ant0+Ant1	5352.48	-45.97	4.11	53.37	Peak	68.2	Pass
NVNT	ac20	5240	Ant0+Ant1	5373.36	-57.75	4.11	41.59	Average	54	Pass
NVNT	ac20	5240	Ant0+Ant1	5460	-49.17	4.11	50.17	Peak	68.2	Pass
NVNT	ac20	5240	Ant0+Ant1	5460	-59.16	4.11	40.18	Average	54	Pass
NVNT	ac40	5190	Ant0+Ant1	4500	-51.59	4.11	47.75	Peak	68.2	Pass
NVNT	ac40	5190	Ant0+Ant1	4500	-60.35	4.11	38.99	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac40	5190	Ant0+Ant1	5147.51	-40.29	4.11	59.05	Peak	68.2	Pass
NVNT	ac40	5190	Ant0+Ant1	5149.7	-49.94	4.11	49.40	Average	54	Pass
NVNT	ac40	5190	Ant0+Ant1	5150	-40.63	4.11	58.71	Peak	68.2	Pass
NVNT	ac40	5190	Ant0+Ant1	5150	-49.94	4.11	49.40	Average	54	Pass
NVNT	ac40	5230	Ant0+Ant1	5350	-48.51	4.11	50.83	Peak	68.2	Pass
NVNT	ac40	5230	Ant0+Ant1	5350	-58.29	4.11	41.05	Average	54	Pass
NVNT	ac40	5230	Ant0+Ant1	5359.56	-46.69	4.11	52.65	Peak	68.2	Pass
NVNT	ac40	5230	Ant0+Ant1	5356.05	-58.18	4.11	41.16	Average	54	Pass
NVNT	ac40	5230	Ant0+Ant1	5460	-47.66	4.11	51.68	Peak	68.2	Pass
NVNT	ac40	5230	Ant0+Ant1	5460	-58.66	4.11	40.68	Average	54	Pass
NVNT	ac80	5210	Ant0+Ant1	5350	-47.59	4.11	51.75	Peak	68.2	Pass
NVNT	ac80	5210	Ant0+Ant1	5350	-57.86	4.11	41.48	Average	54	Pass
NVNT	ac80	5210	Ant0+Ant1	5409.84	-46.8	4.11	52.54	Peak	68.2	Pass
NVNT	ac80	5210	Ant0+Ant1	5370.24	-57.28	4.11	42.06	Average	54	Pass
NVNT	ac80	5210	Ant0+Ant1	5460	-50.95	4.11	48.39	Peak	68.2	Pass
NVNT	ac80	5210	Ant0+Ant1	5460	-58.73	4.11	40.61	Average	54	Pass
NVNT	ac80	5210	Ant0+Ant1	4500	-51.94	4.11	47.40	Peak	68.2	Pass
NVNT	ac80	5210	Ant0+Ant1	4500	-60.08	4.11	39.26	Average	54	Pass
NVNT	ac80	5210	Ant0+Ant1	5146.22	-41.64	4.11	57.70	Peak	68.2	Pass
NVNT	ac80	5210	Ant0+Ant1	5149.38	-50.29	4.11	49.05	Average	54	Pass
NVNT	ac80	5210	Ant0+Ant1	5150	-41.22	4.11	58.12	Peak	68.2	Pass
NVNT	ac80	5210	Ant0+Ant1	5150	-50.53	4.11	48.81	Average	54	Pass
NVNT	ax20	5180	Ant0+Ant1	4500	-51.99	4.11	47.35	Peak	68.2	Pass
NVNT	ax20	5180	Ant0+Ant1	4500	-60.55	4.11	38.79	Average	54	Pass
NVNT	ax20	5180	Ant0+Ant1	5028.5	-46.48	4.11	52.86	Peak	68.2	Pass
NVNT	ax20	5180	Ant0+Ant1	5149.6	-56.81	4.11	42.53	Average	54	Pass
NVNT	ax20	5180	Ant0+Ant1	5150	-46.04	4.11	53.30	Peak	68.2	Pass
NVNT	ax20	5180	Ant0+Ant1	5150	-56.6	4.11	42.74	Average	54	Pass
NVNT	ax20	5240	Ant0+Ant1	5350	-48.37	4.11	50.97	Peak	68.2	Pass
NVNT	ax20	5240	Ant0+Ant1	5350	-58.45	4.11	40.89	Average	54	Pass
NVNT	ax20	5240	Ant0+Ant1	5424.96	-46.72	4.11	52.62	Peak	68.2	Pass
NVNT	ax20	5240	Ant0+Ant1	5373.36	-57.99	4.11	41.35	Average	54	Pass
NVNT	ax20	5240	Ant0+Ant1	5460	-50.15	4.11	49.19	Peak	68.2	Pass
NVNT	ax20	5240	Ant0+Ant1	5460	-59.59	4.11	39.75	Average	54	Pass
NVNT	ax40	5190	Ant0+Ant1	4500	-50.15	4.11	49.19	Peak	68.2	Pass
NVNT	ax40	5190	Ant0+Ant1	4500	-60.32	4.11	39.02	Average	54	Pass
NVNT	ax40	5190	Ant0+Ant1	5148.97	-38.28	4.11	61.06	Peak	68.2	Pass
NVNT	ax40	5190	Ant0+Ant1	5149.7	-50.21	4.11	49.13	Average	54	Pass
NVNT	ax40	5190	Ant0+Ant1	5150	-41.77	4.11	57.57	Peak	68.2	Pass
NVNT	ax40	5190	Ant0+Ant1	5150	-50.21	4.11	49.13	Average	54	Pass
NVNT	ax40	5230	Ant0+Ant1	5350	-49.67	4.11	49.67	Peak	68.2	Pass






NVNT	ax40	5230	Ant0+Ant1	5350	-58.34	4.11	41.00	Average	54	Pass
NVNT	ax40	5230	Ant0+Ant1	5364.69	-46.75	4.11	52.59	Peak	68.2	Pass
NVNT	ax40	5230	Ant0+Ant1	5356.32	-58.09	4.11	41.25	Average	54	Pass
NVNT	ax40	5230	Ant0+Ant1	5460	-49.86	4.11	49.48	Peak	68.2	Pass
NVNT	ax40	5230	Ant0+Ant1	5460	-58.82	4.11	40.52	Average	54	Pass
NVNT	ax80	5210	Ant0+Ant1	5350	-46.45	4.11	52.89	Peak	68.2	Pass
NVNT	ax80	5210	Ant0+Ant1	5350	-58.16	4.11	41.18	Average	54	Pass
NVNT	ax80	5210	Ant0+Ant1	5350.11	-46.45	4.11	52.89	Peak	68.2	Pass
NVNT	ax80	5210	Ant0+Ant1	5369.91	-57.39	4.11	41.95	Average	54	Pass
NVNT	ax80	5210	Ant0+Ant1	5460	-50.52	4.11	48.82	Peak	68.2	Pass
NVNT	ax80	5210	Ant0+Ant1	5460	-58.94	4.11	40.40	Average	54	Pass
NVNT	ax80	5210	Ant0+Ant1	4500	-50.41	4.11	48.93	Peak	68.2	Pass
NVNT	ax80	5210	Ant0+Ant1	4500	-60.32	4.11	39.02	Average	54	Pass
NVNT	ax80	5210	Ant0+Ant1	5149.38	-40.92	4.11	58.42	Peak	68.2	Pass
NVNT	ax80	5210	Ant0+Ant1	5149.38	-50.57	4.11	48.77	Average	54	Pass
NVNT	ax80	5210	Ant0+Ant1	5150	-40.54	4.11	58.80	Peak	68.2	Pass
NVNT	ax80	5210	Ant0+Ant1	5150	-50.69	4.11	48.65	Average	54	Pass






Test Graphs

Restrict Band NVNT n20 5180MHz Ant0+Ant1 Peak

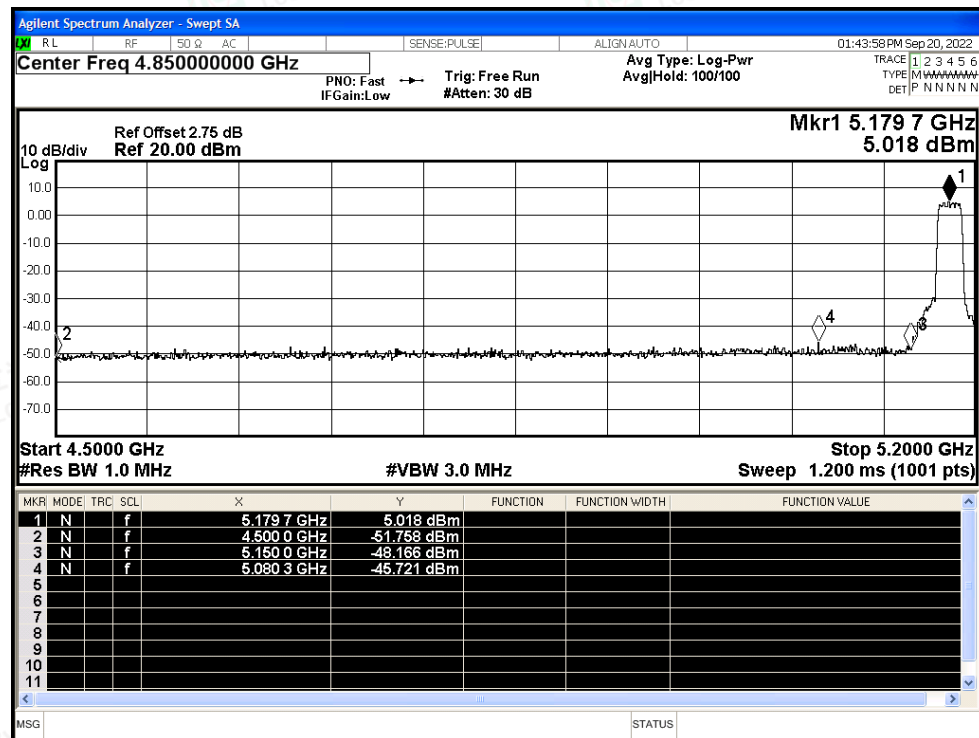


Restrict Band NVNT n20 5180MHz Ant0+Ant1 Average

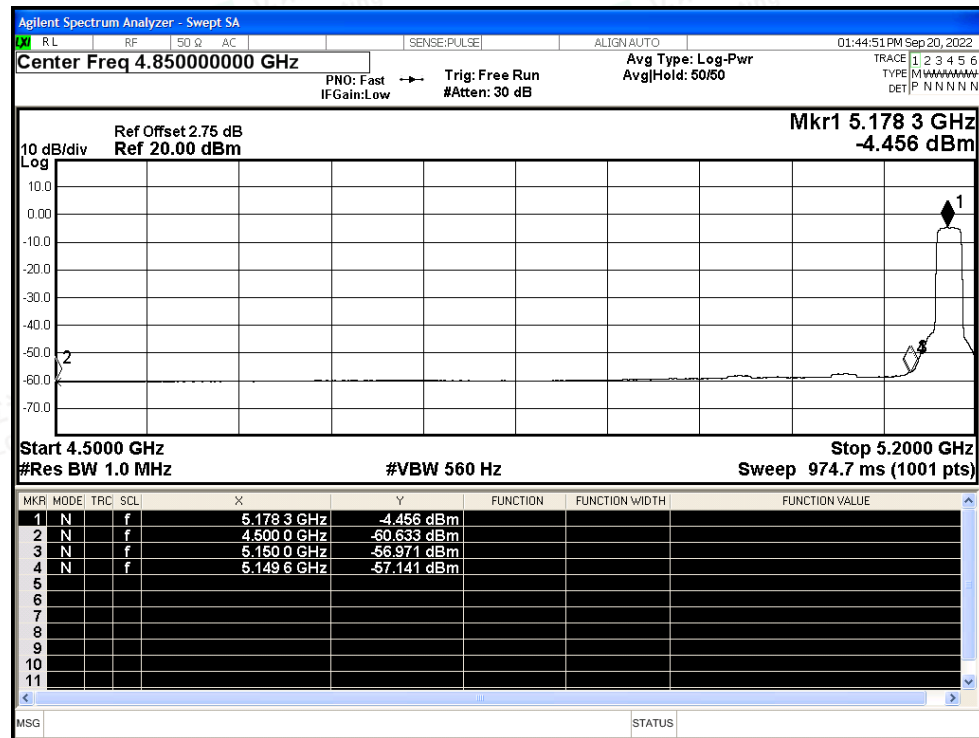




Restrict Band NVNT n20 5240MHz Ant0+Ant1 Peak

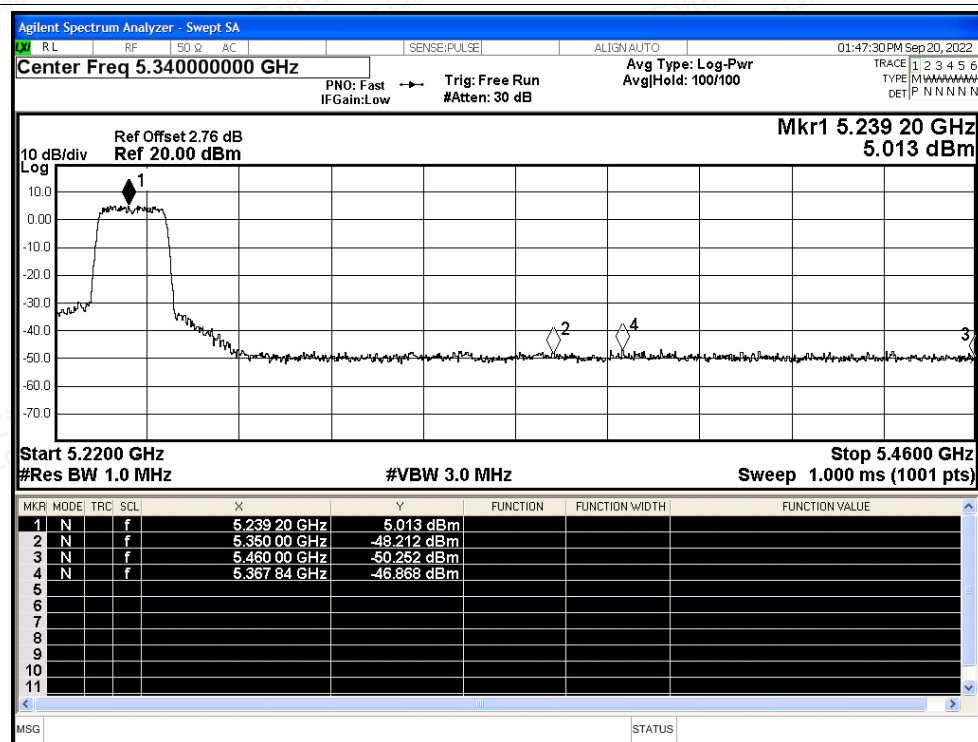


Restrict Band NVNT n20 5240MHz Ant0+Ant1 Average

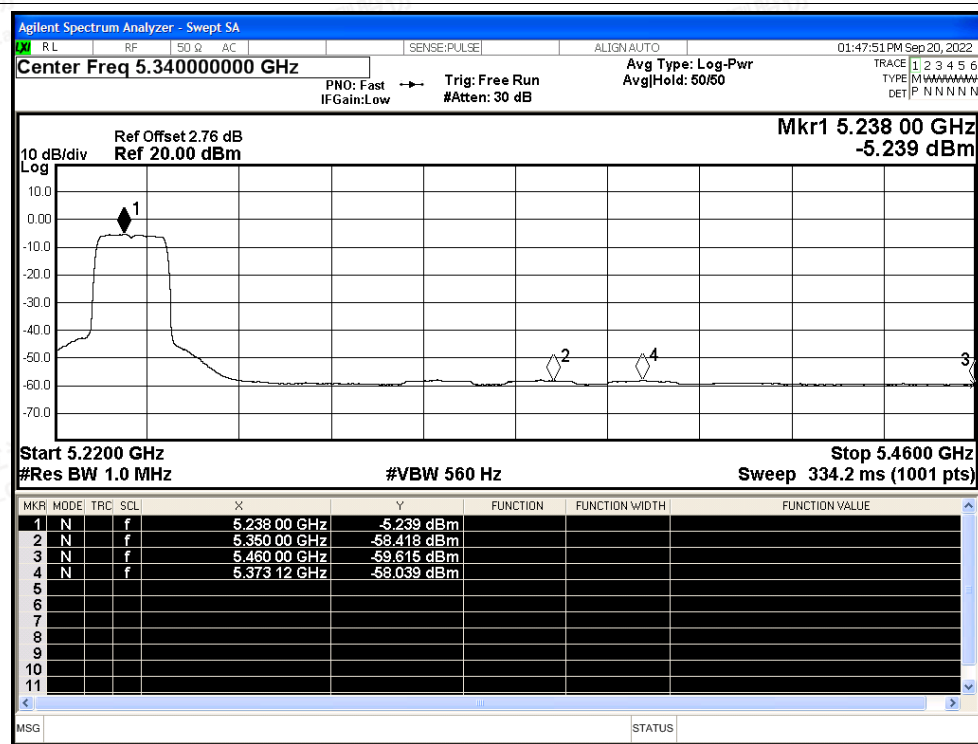




Restrict Band NVNT n40 5190MHz Ant0+Ant1 Peak

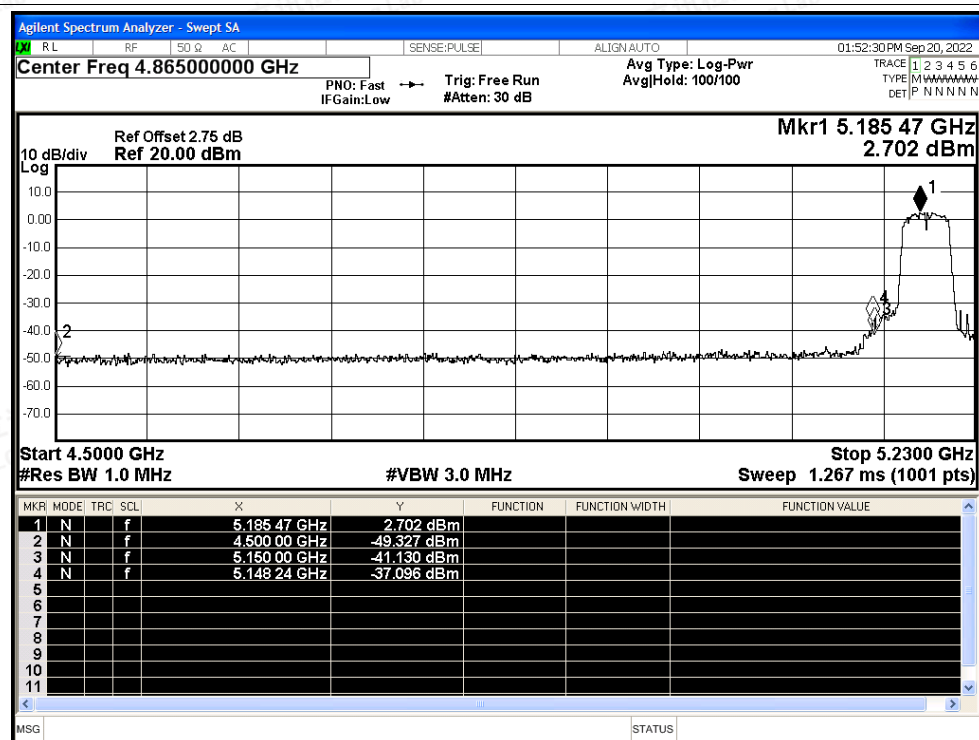


Restrict Band NVNT n40 5190MHz Ant0+Ant1 Average

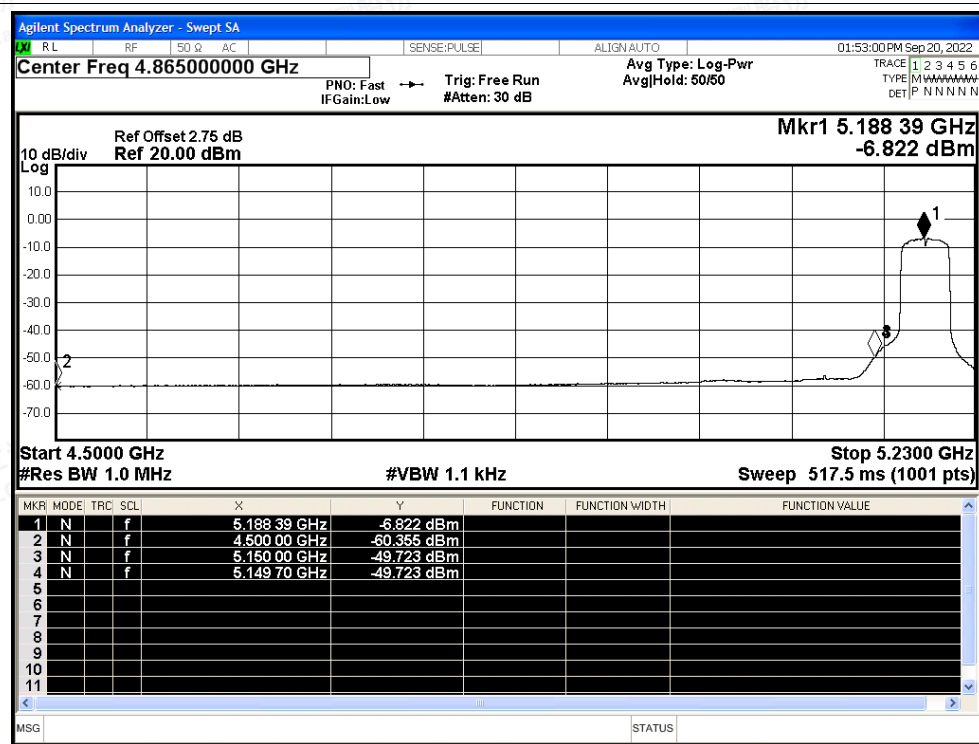




Restrict Band NVNT n40 5230MHz Ant0+Ant1 Peak

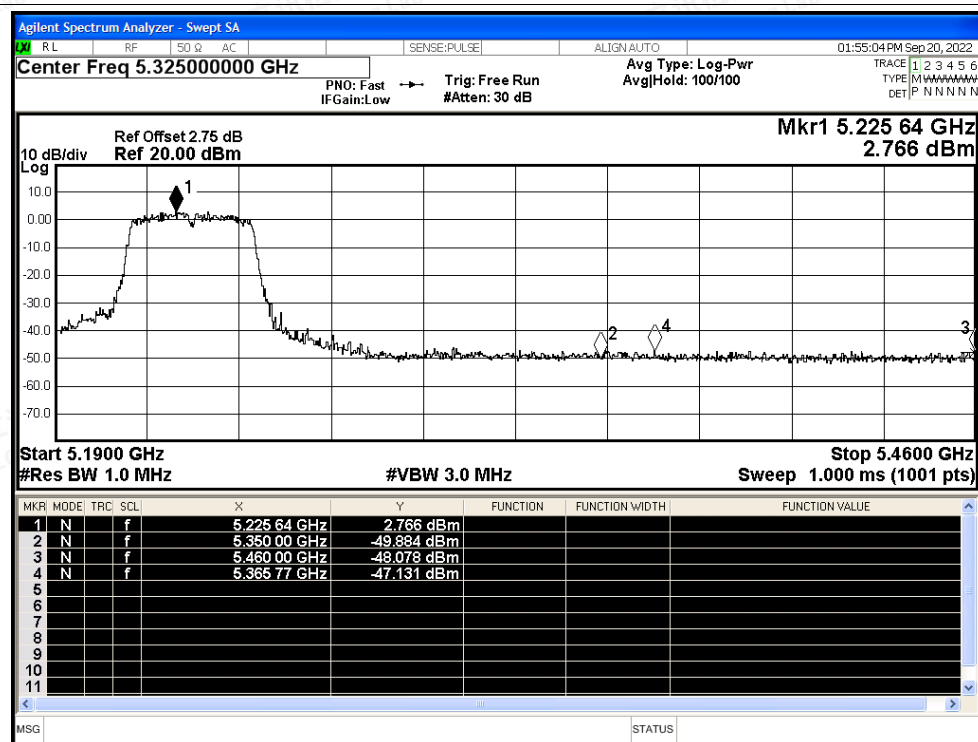

Restrict Band NVNT n40 5230MHz Ant0+Ant1 Average

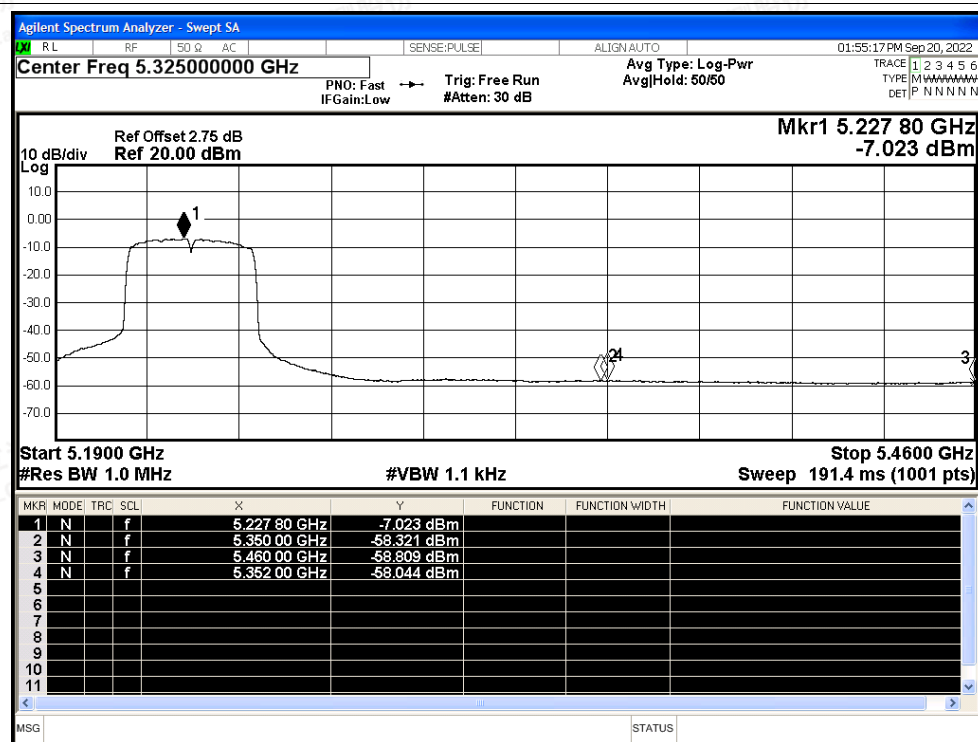

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant0+Ant1 Peak

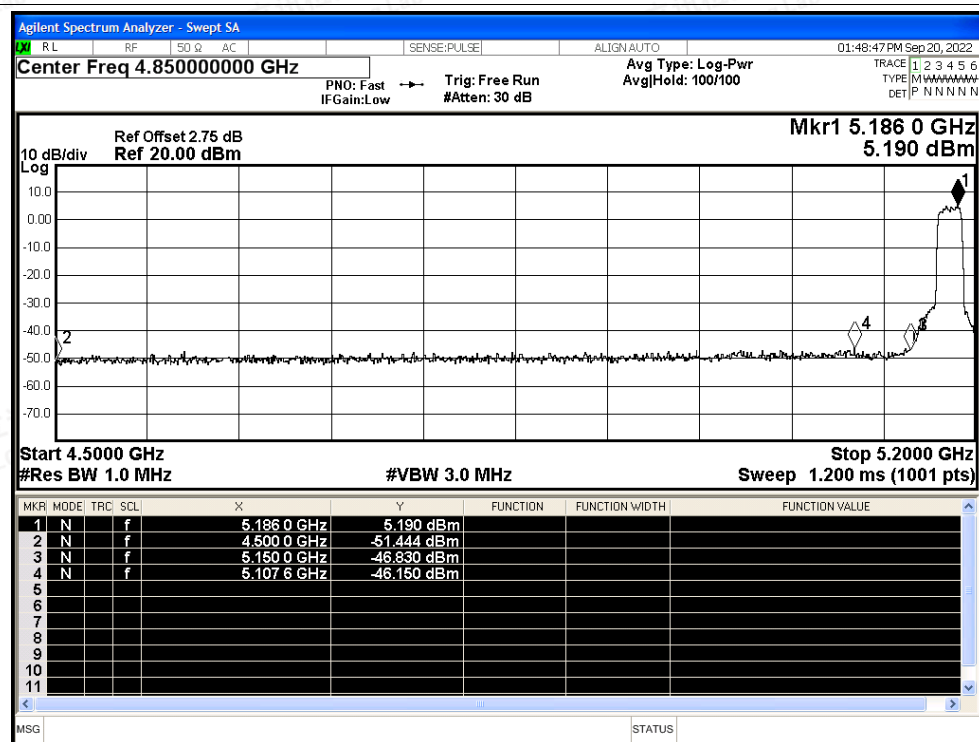

Restrict Band NVNT ac20 5180MHz Ant0+Ant1 Average

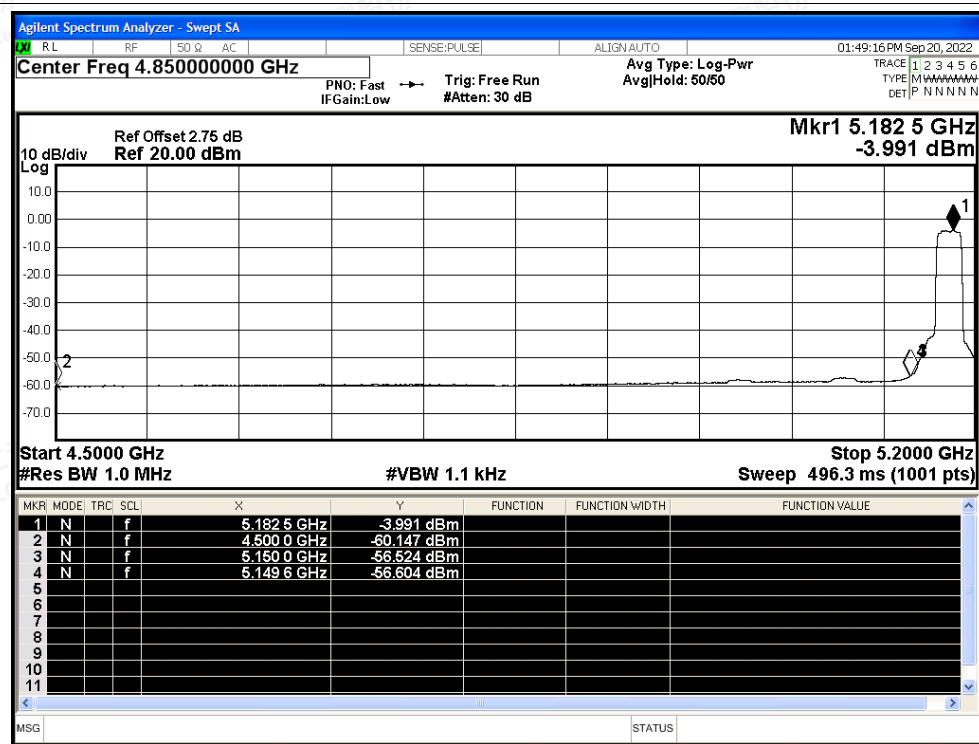

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant0+Ant1 Peak

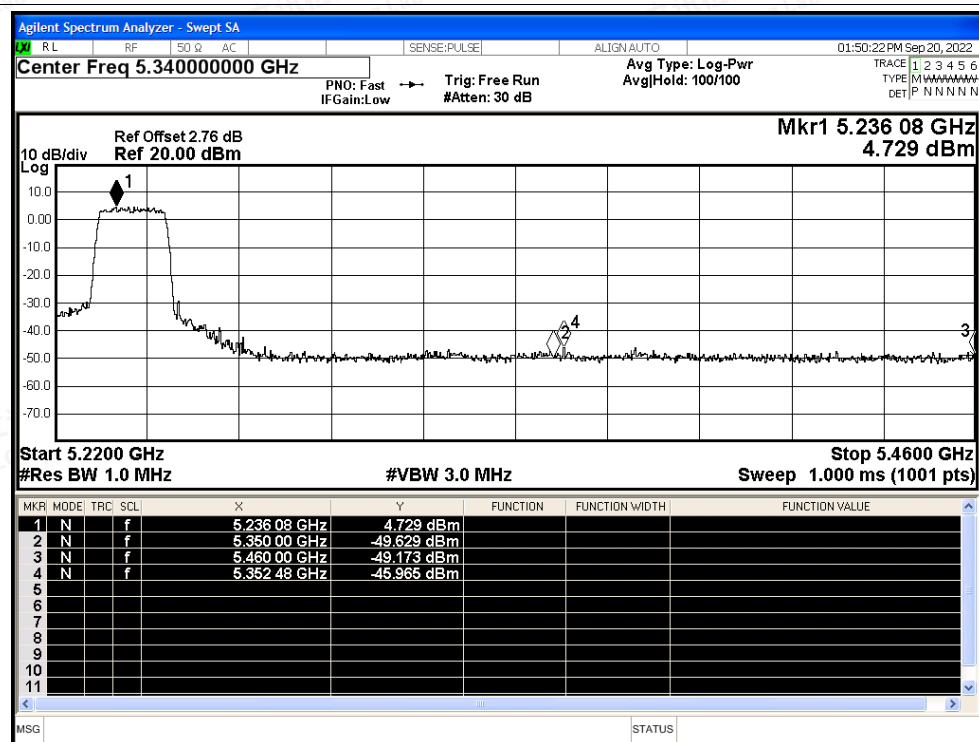


Restrict Band NVNT ac20 5240MHz Ant0+Ant1 Average

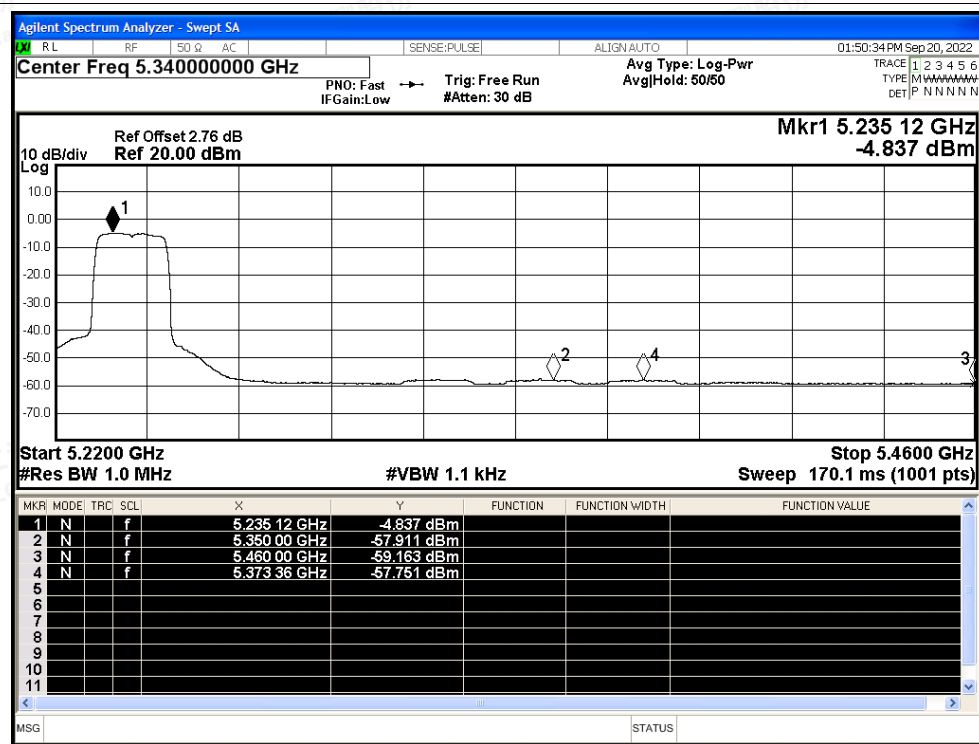




Restrict Band NVNT ac40 5190MHz Ant0+Ant1 Peak

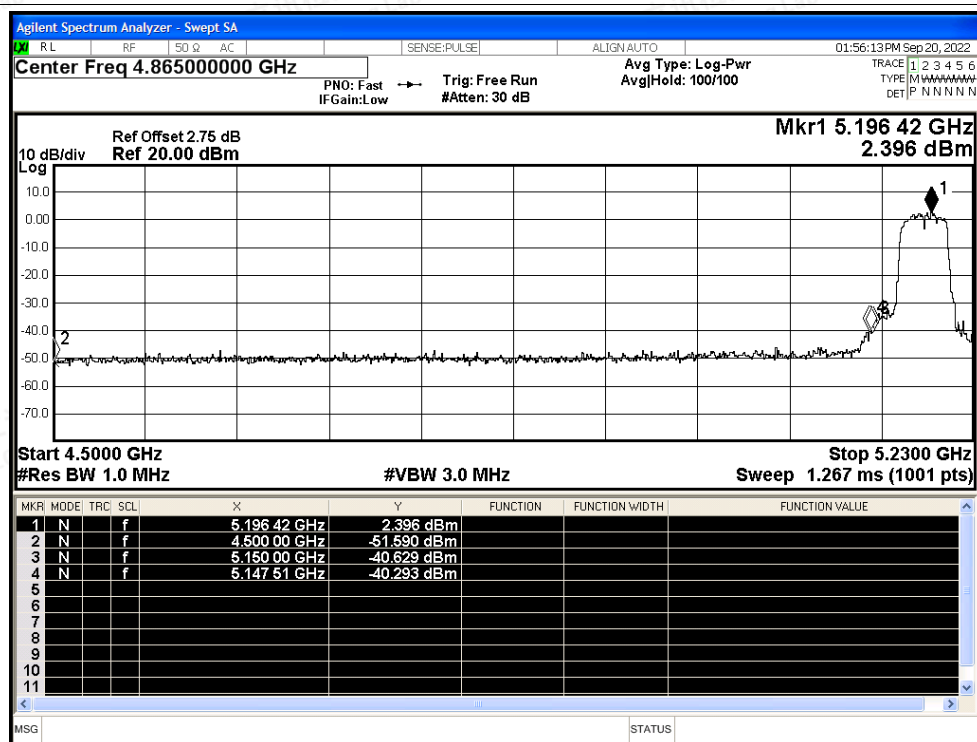


Restrict Band NVNT ac40 5190MHz Ant0+Ant1 Average

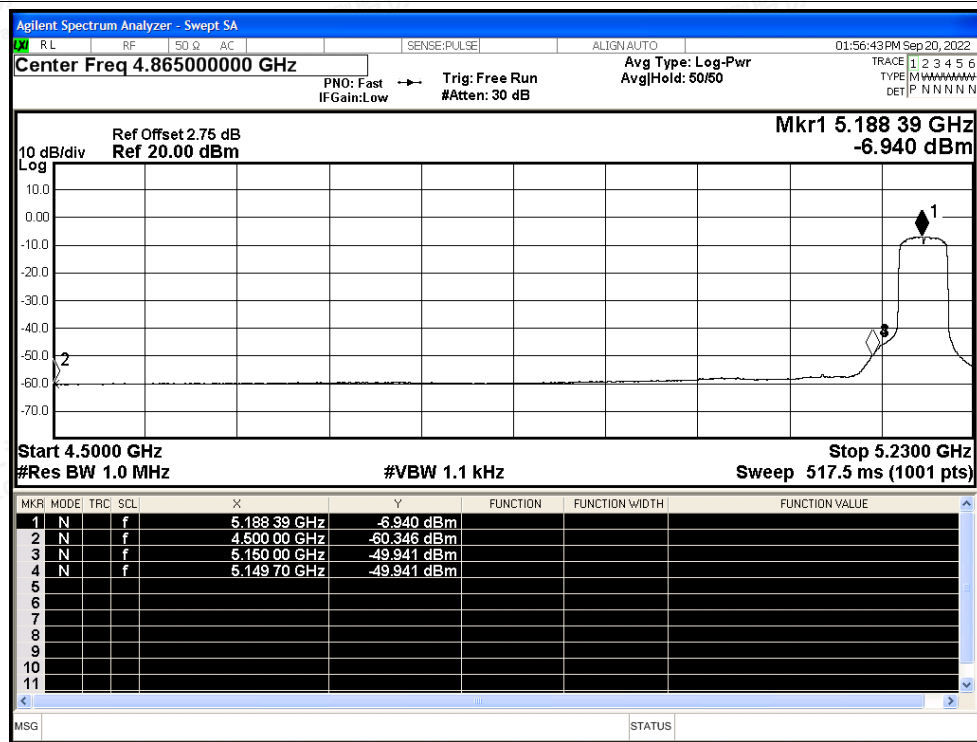




Restrict Band NVNT ac40 5230MHz Ant0+Ant1 Peak

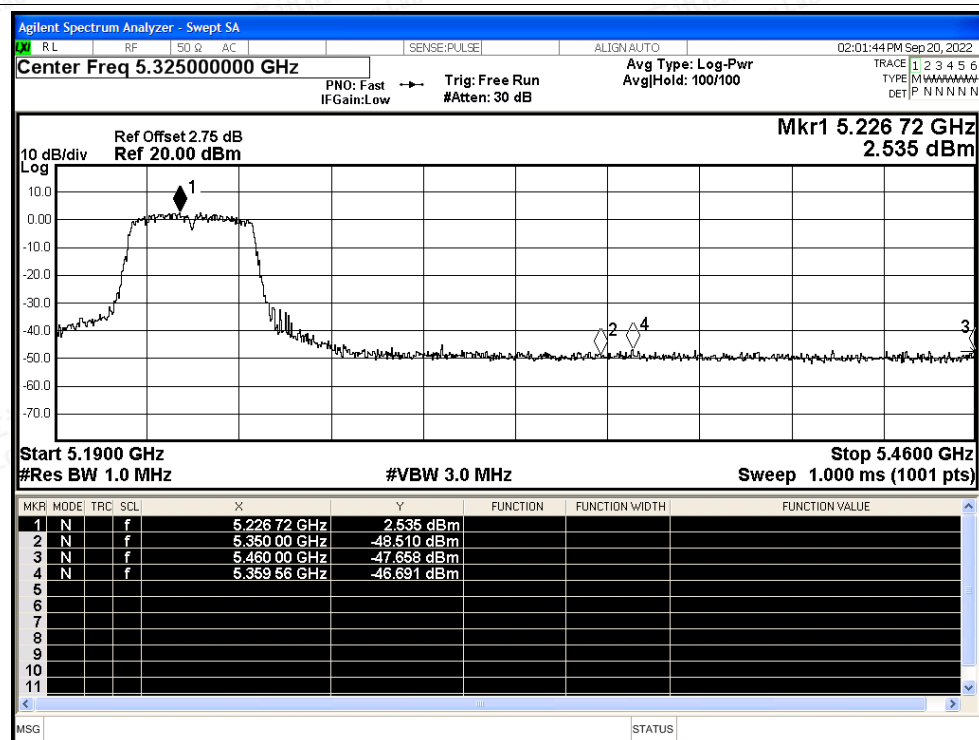


Restrict Band NVNT ac40 5230MHz Ant0+Ant1 Average

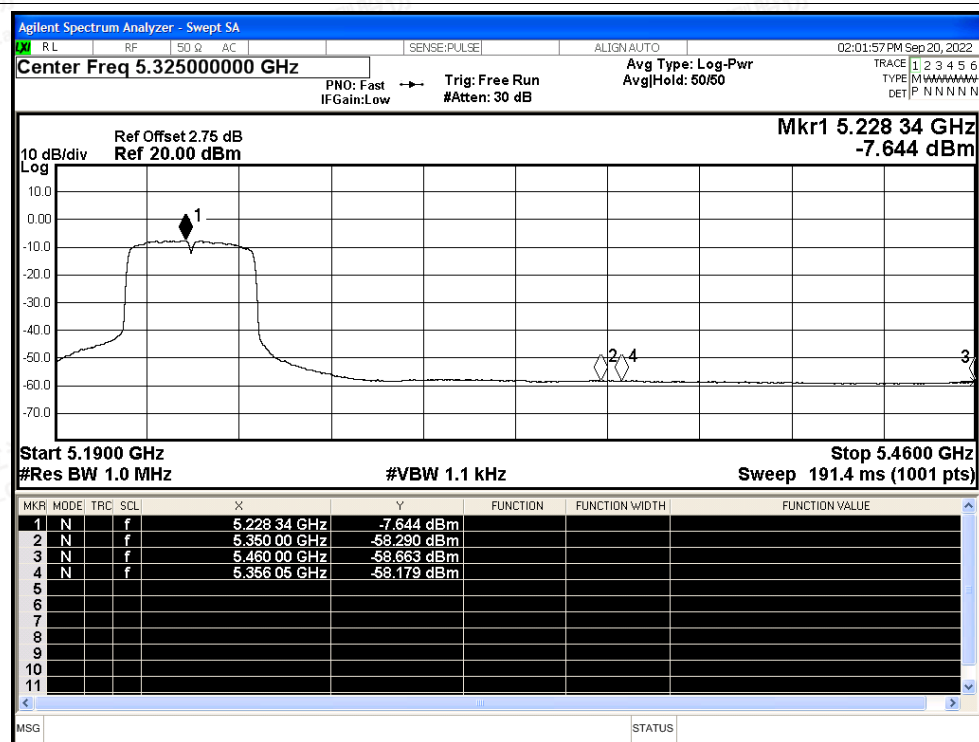




Restrict Band NVNT ac80 5210MHz Ant0+Ant1 Peak

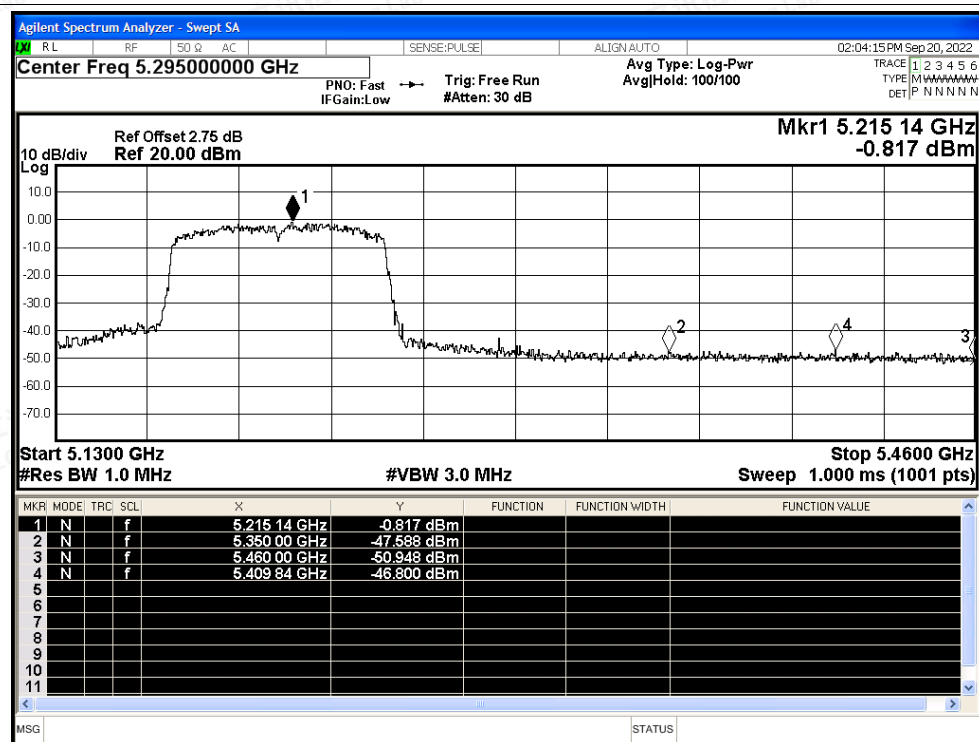


Restrict Band NVNT ac80 5210MHz Ant0+Ant1 Average

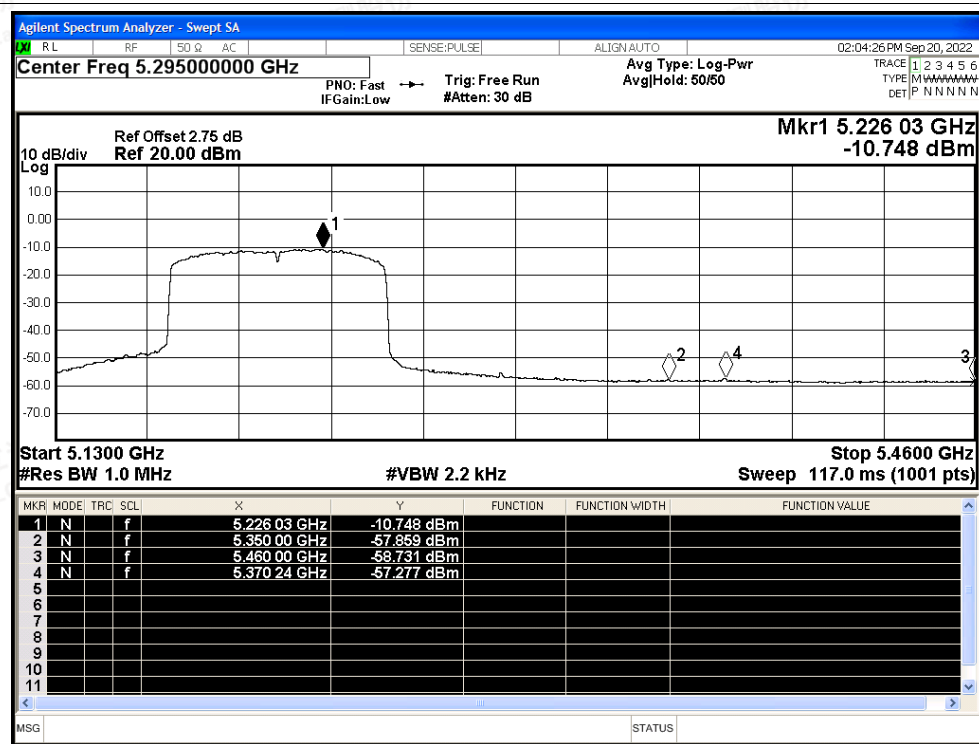




Restrict Band NVNT ac80 5210MHz Ant0+Ant1 Peak

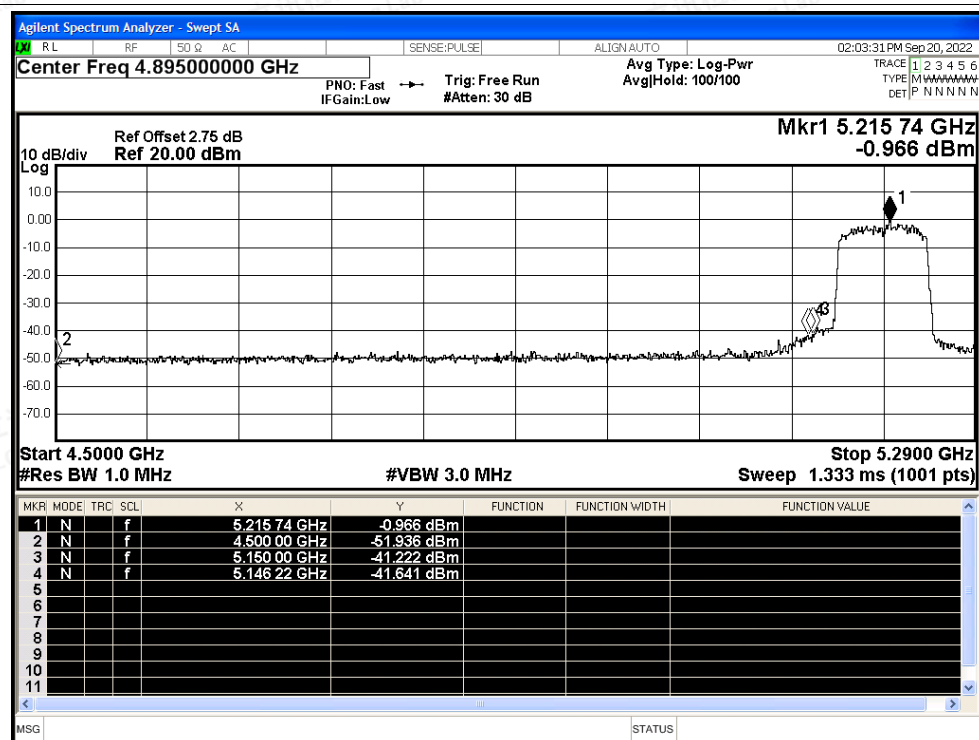


Restrict Band NVNT ac80 5210MHz Ant0+Ant1 Average

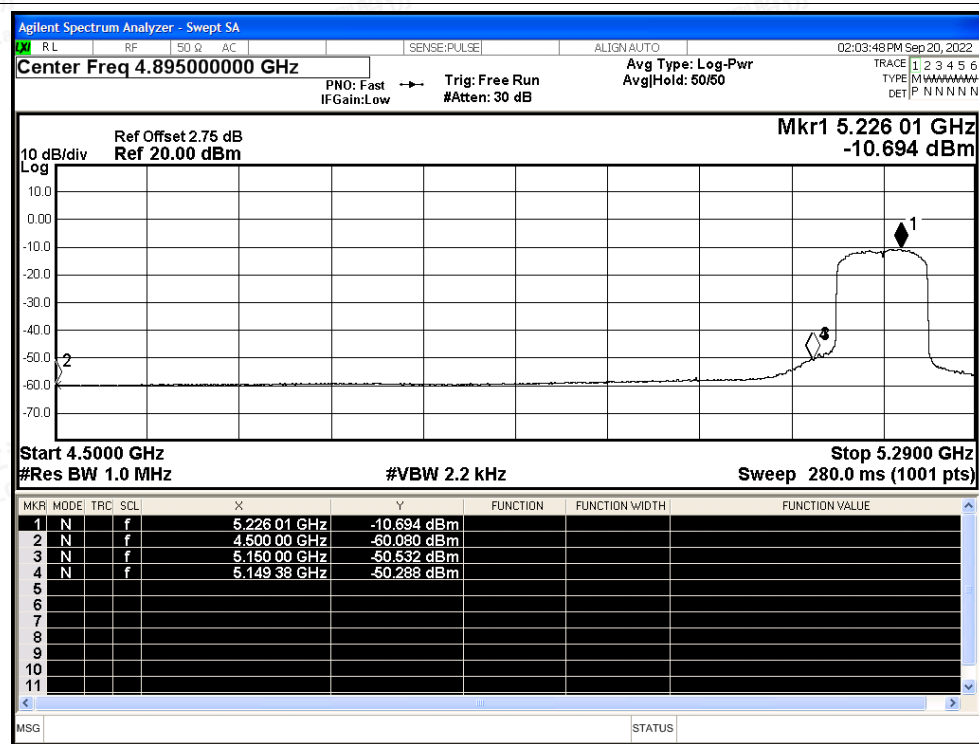




Restrict Band NVNT ax20 5180MHz Ant0+Ant1 Peak

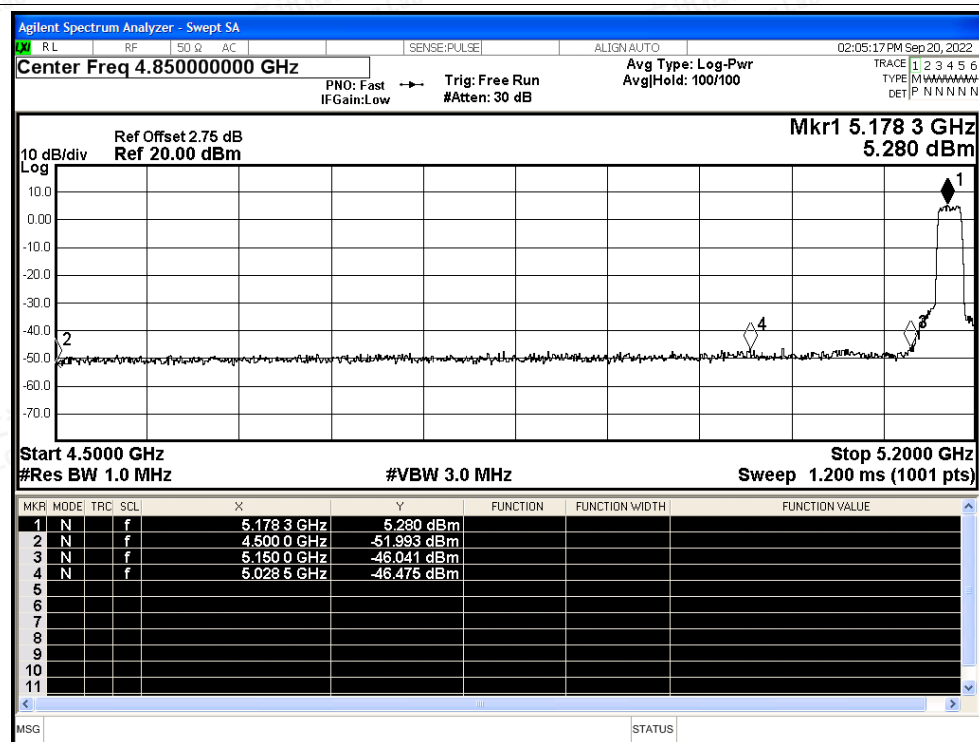


Restrict Band NVNT ax20 5180MHz Ant0+Ant1 Average

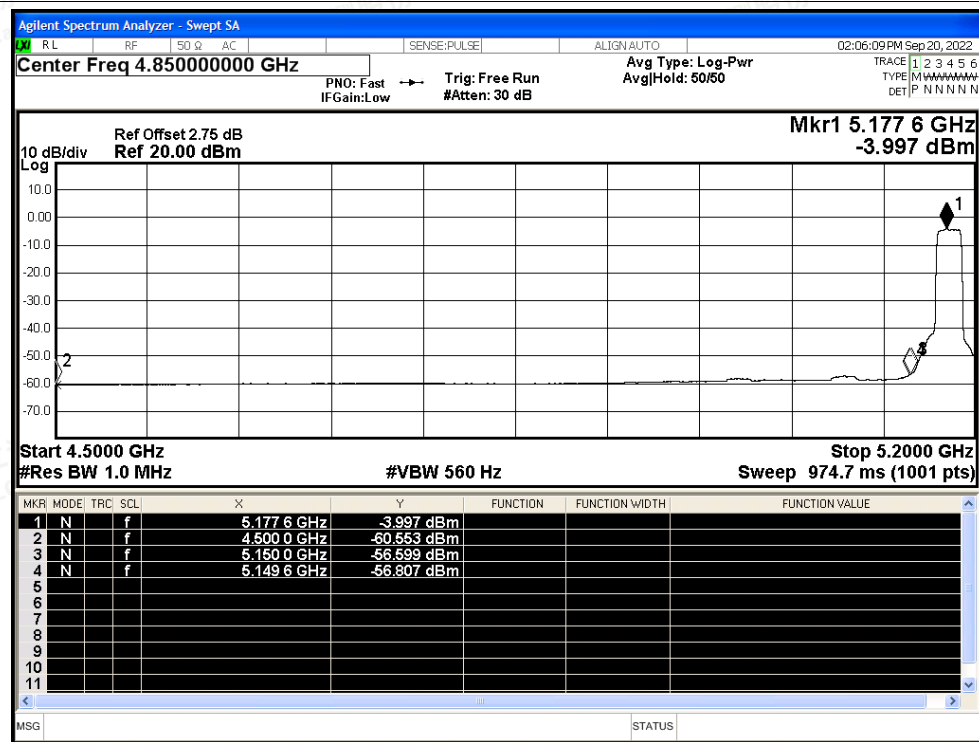




Restrict Band NVNT ax20 5240MHz Ant0+Ant1 Peak

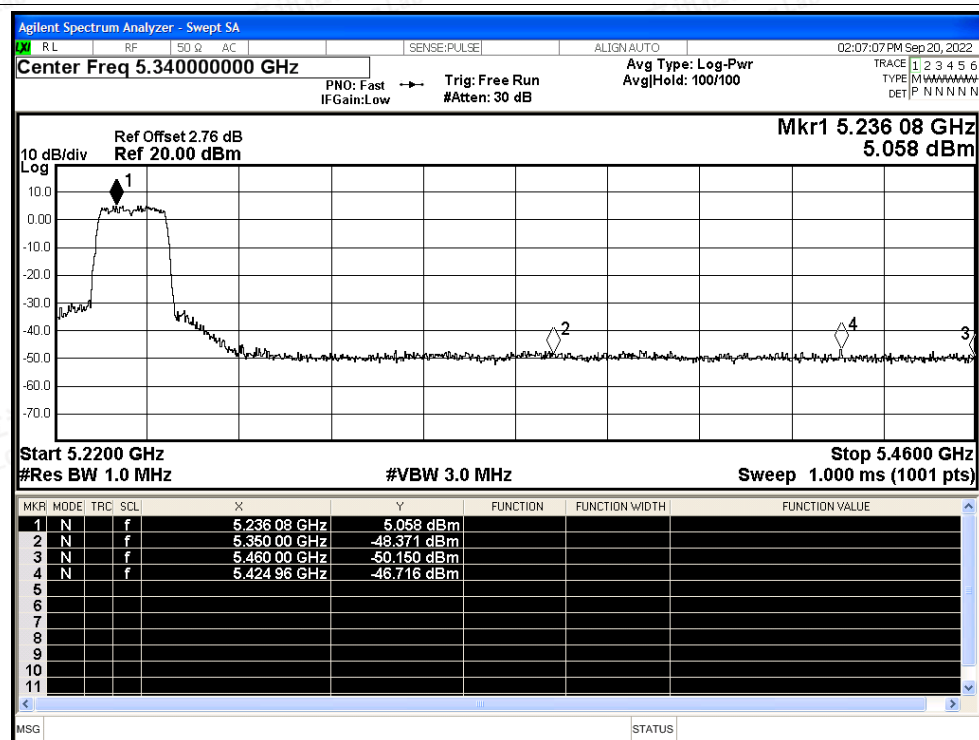


Restrict Band NVNT ax20 5240MHz Ant0+Ant1 Average

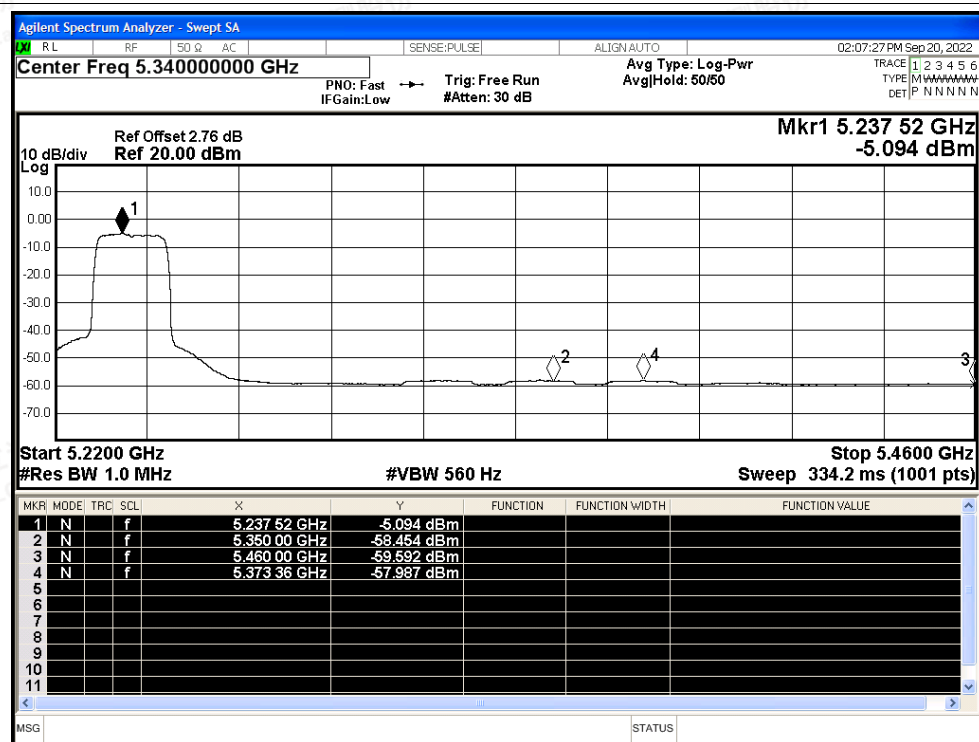




Restrict Band NVNT ax40 5190MHz Ant0+Ant1 Peak

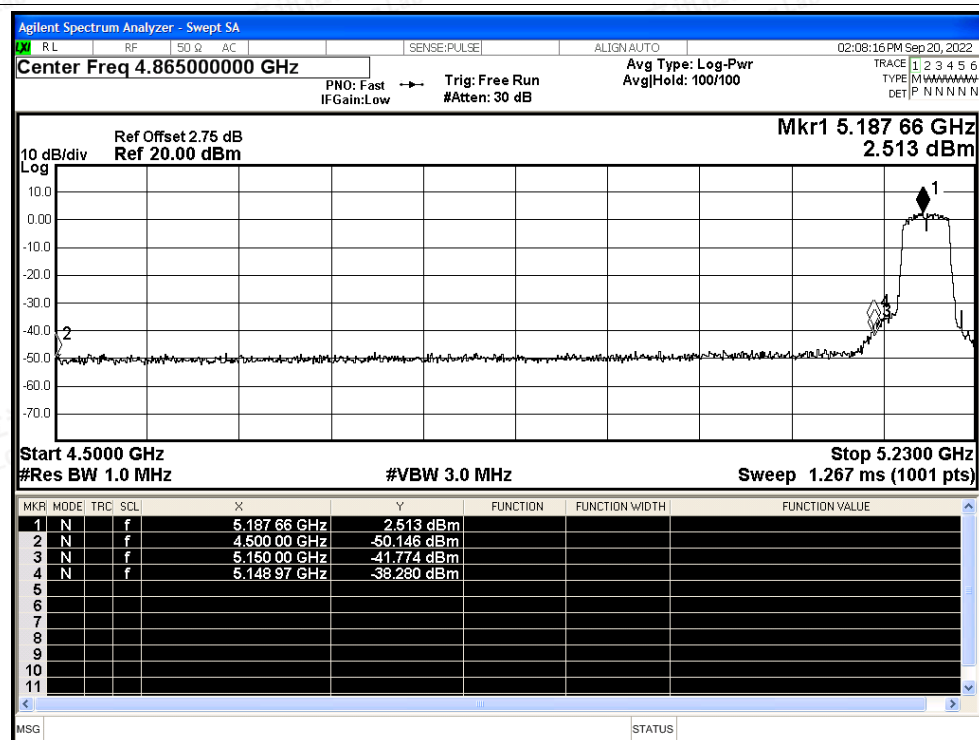


Restrict Band NVNT ax40 5190MHz Ant0+Ant1 Average

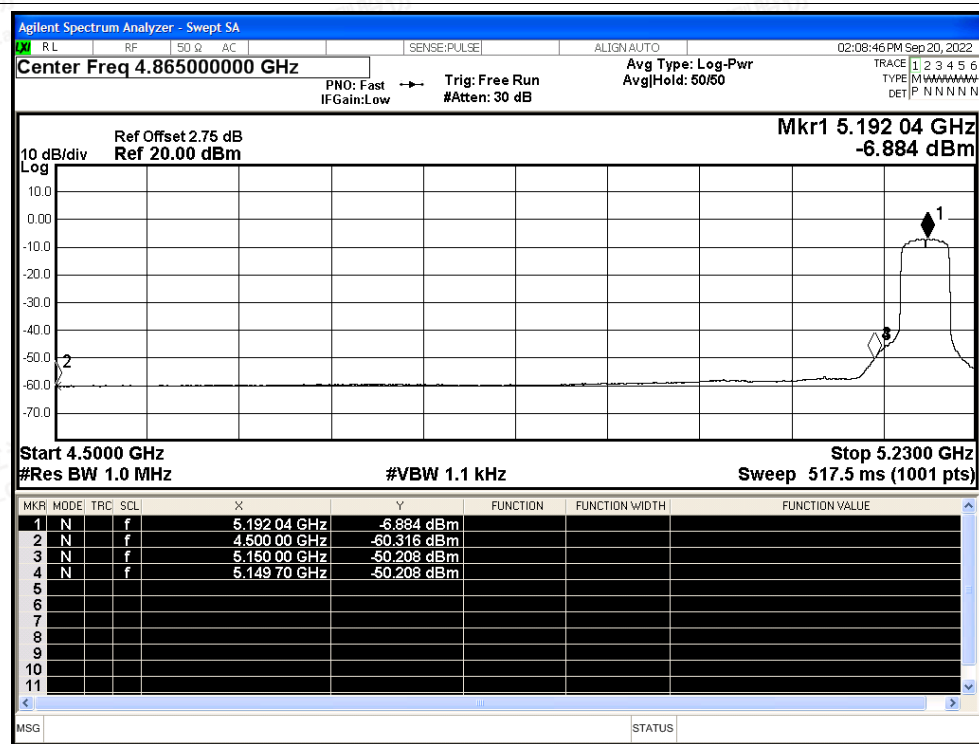




Restrict Band NVNT ax40 5230MHz Ant0+Ant1 Peak

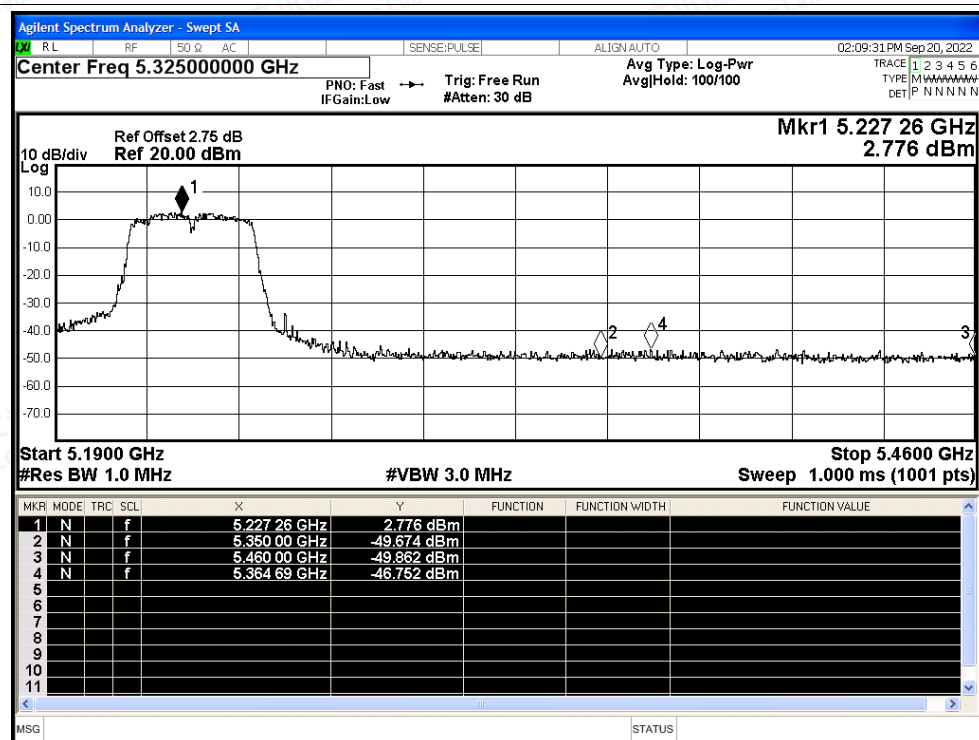


Restrict Band NVNT ax40 5230MHz Ant0+Ant1 Average

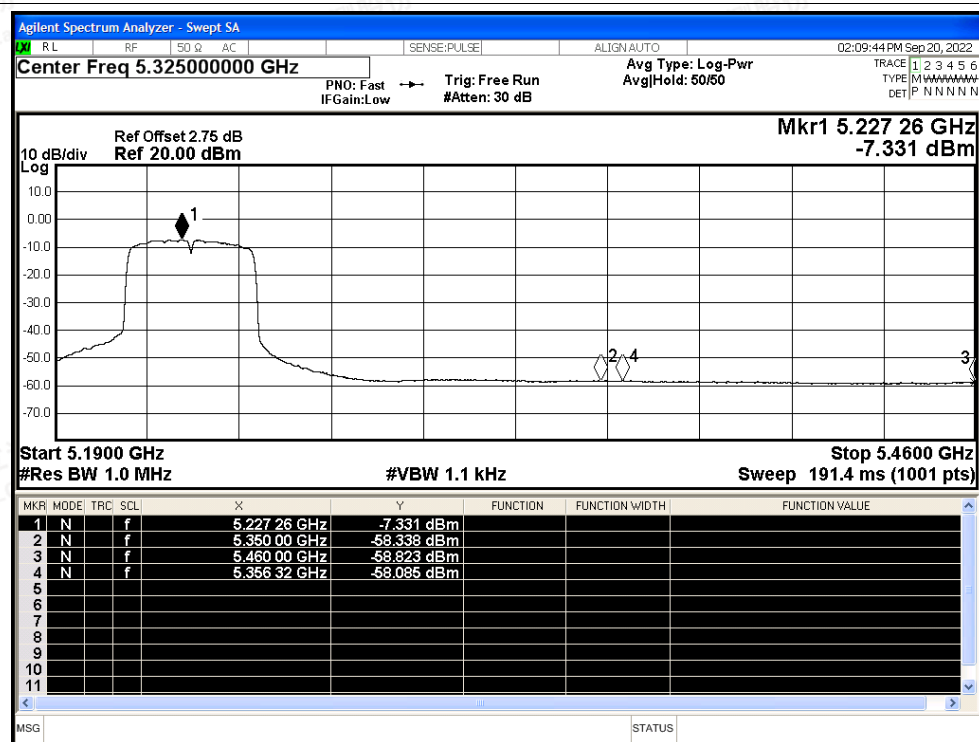




Restrict Band NVNT ax80 5210MHz Ant0+Ant1 Peak

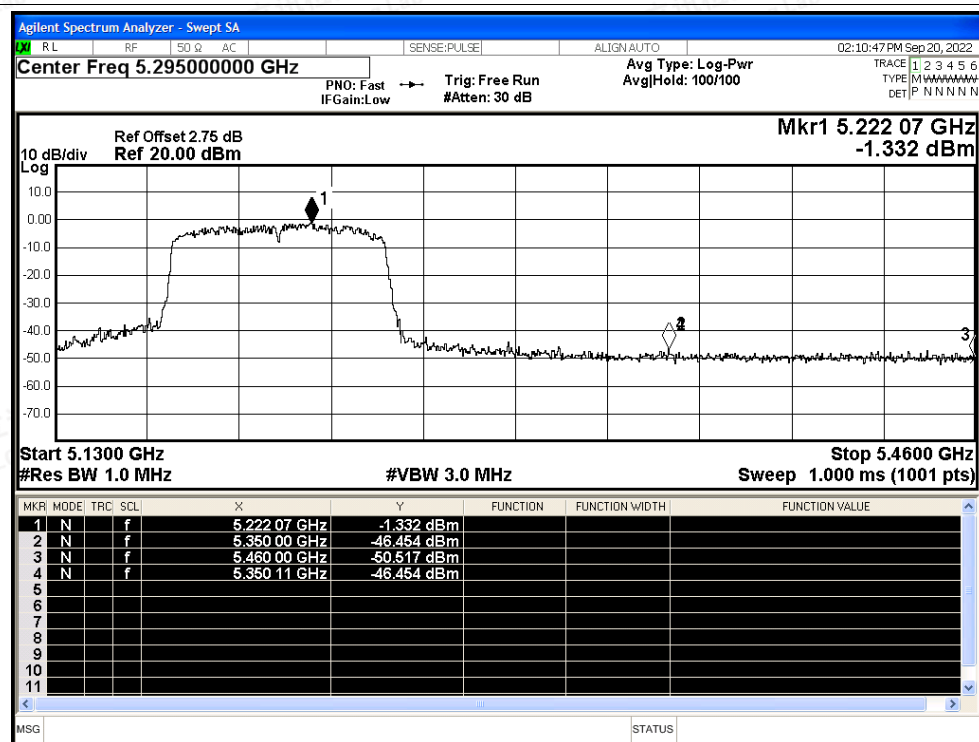


Restrict Band NVNT ax80 5210MHz Ant0+Ant1 Average

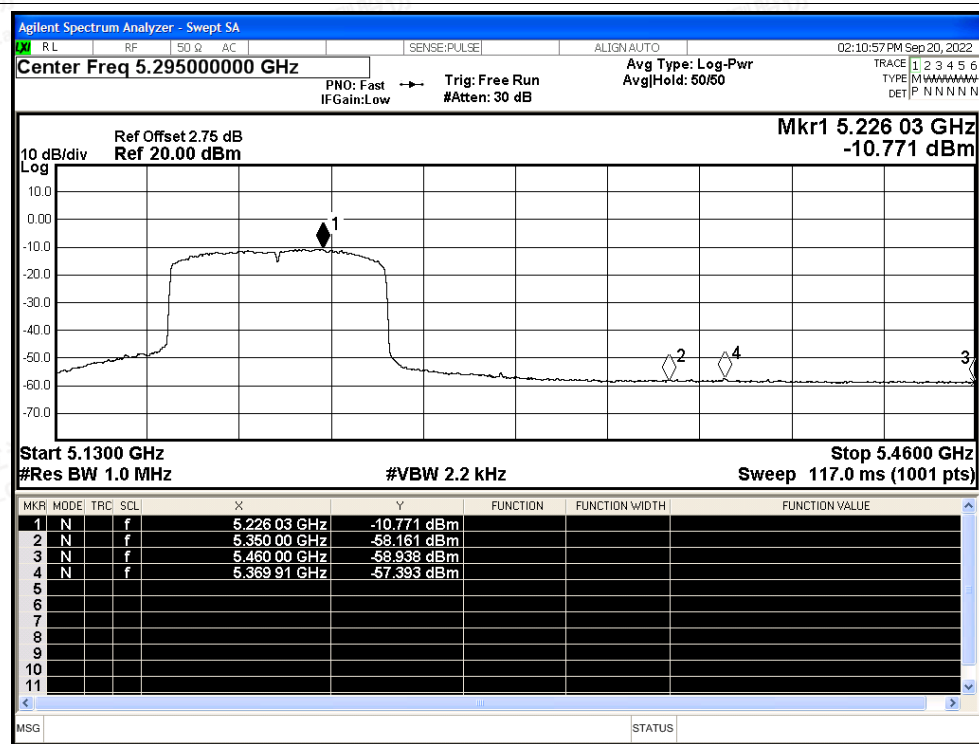




Restrict Band NVNT ax80 5210MHz Ant0+Ant1 Peak

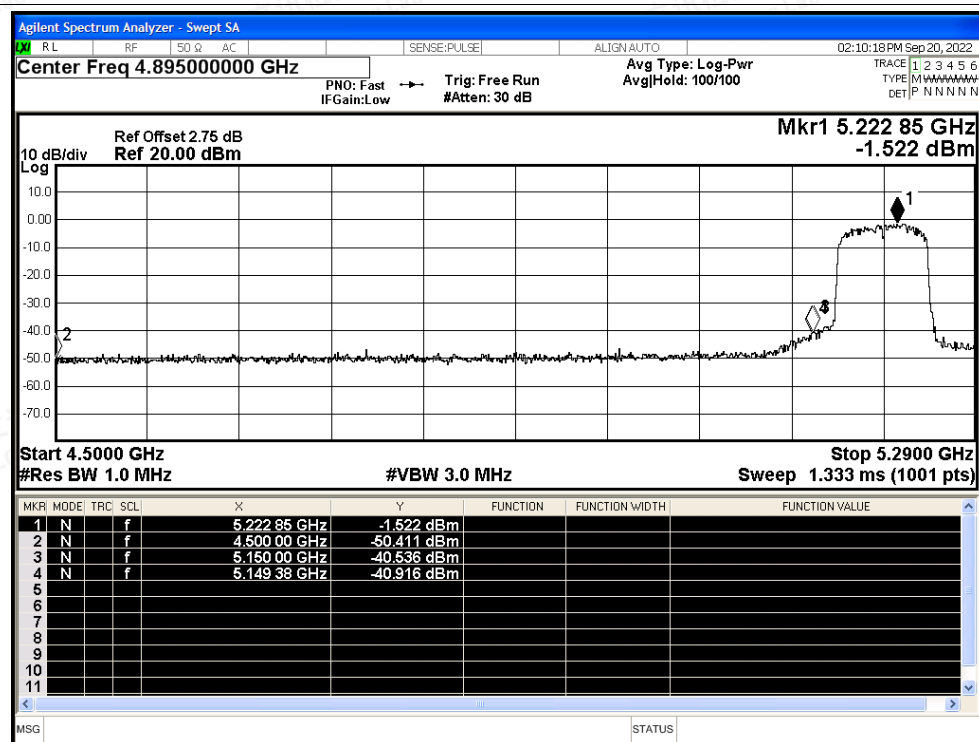

Restrict Band NVNT ax80 5210MHz Ant0+Ant1 Average

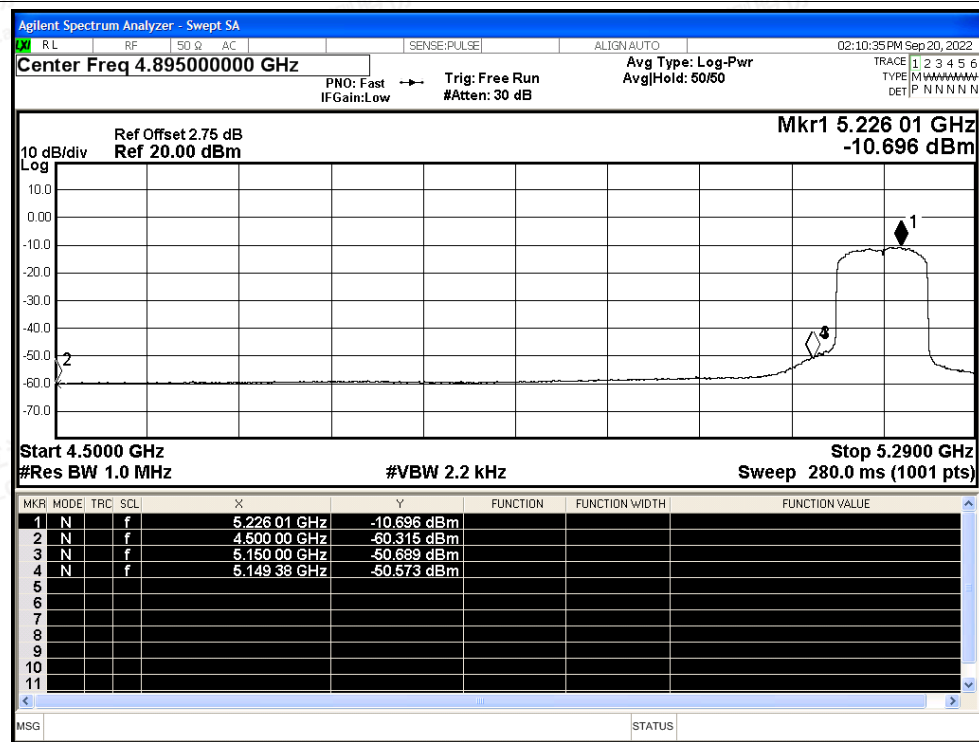

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant0	5180.02	20000	3.86	25	Pass
NVNT	a	5200	Ant0	5200	0	0	25	Pass
NVNT	a	5240	Ant0	5240	0	0	25	Pass
NVNT	n20	5180	Ant0	5180	0	0	25	Pass
NVNT	n20	5200	Ant0	5200	0	0	25	Pass
NVNT	n20	5240	Ant0	5240	0	0	25	Pass
NVNT	n40	5190	Ant0	5190	0	0	25	Pass
NVNT	n40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac20	5180	Ant0	5180	0	0	25	Pass
NVNT	ac20	5200	Ant0	5200.02	20000	3.85	25	Pass
NVNT	ac20	5240	Ant0	5240	0	0	25	Pass
NVNT	ac40	5190	Ant0	5190	0	0	25	Pass
NVNT	ac40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac80	5210	Ant0	5210	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant0

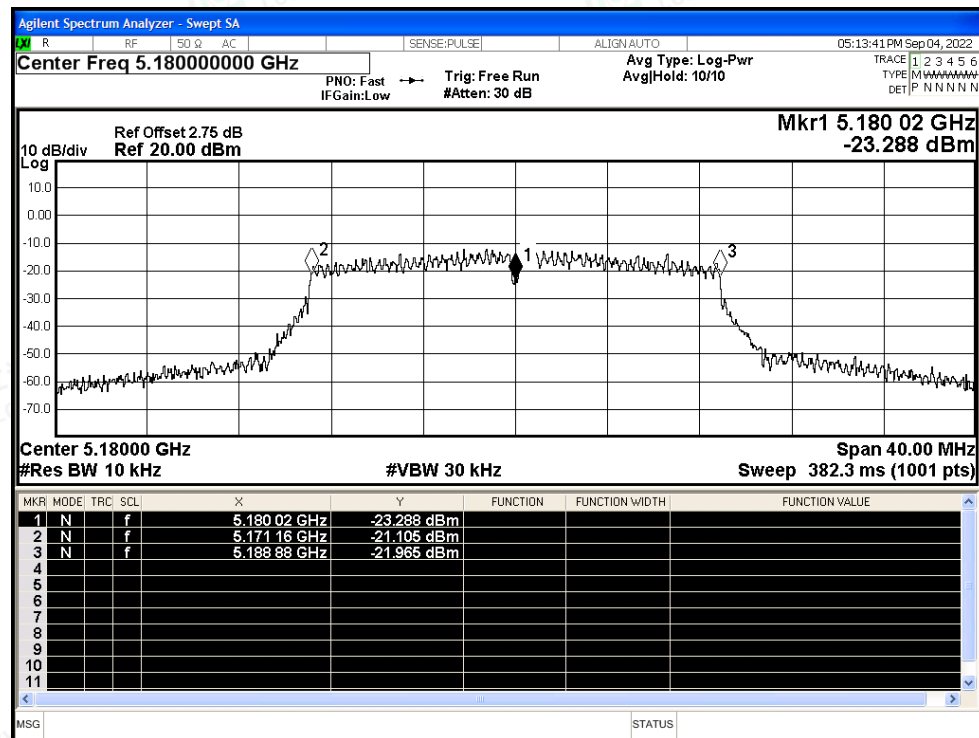


Freq. Stability NVNT a 5200MHz Ant0

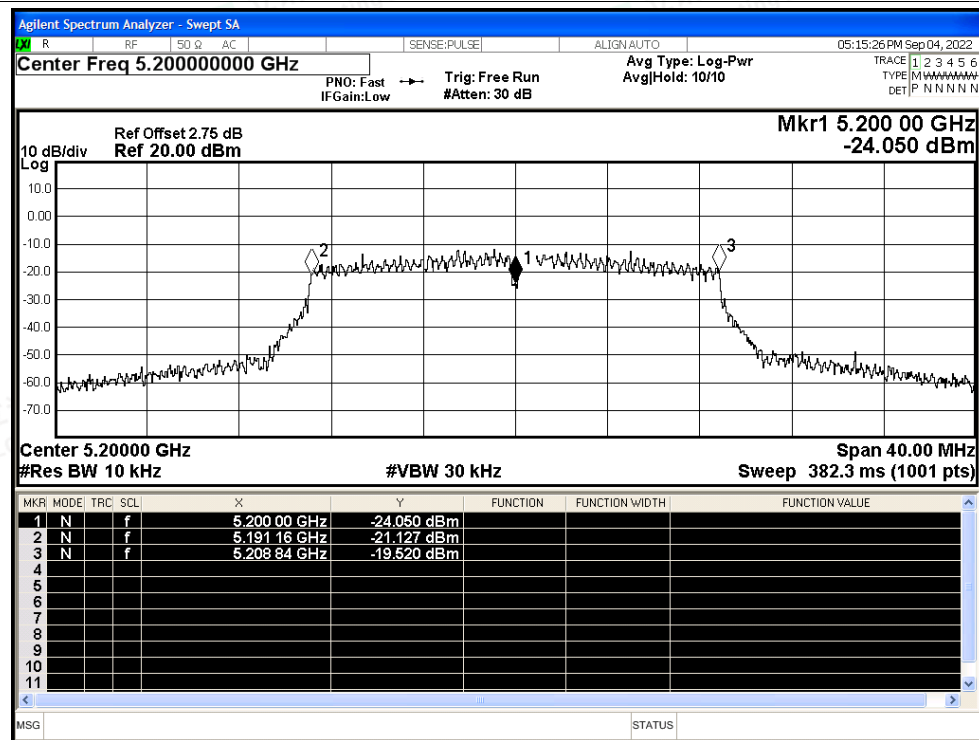




Freq. Stability NVNT a 5240MHz Ant0

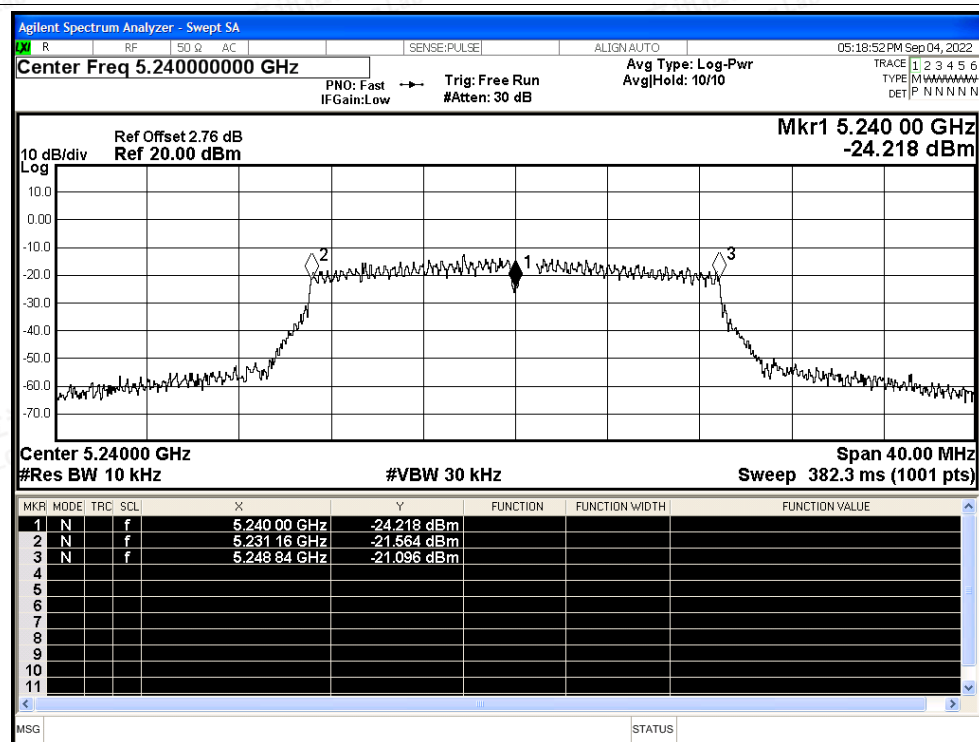


Freq. Stability NVNT n20 5180MHz Ant0

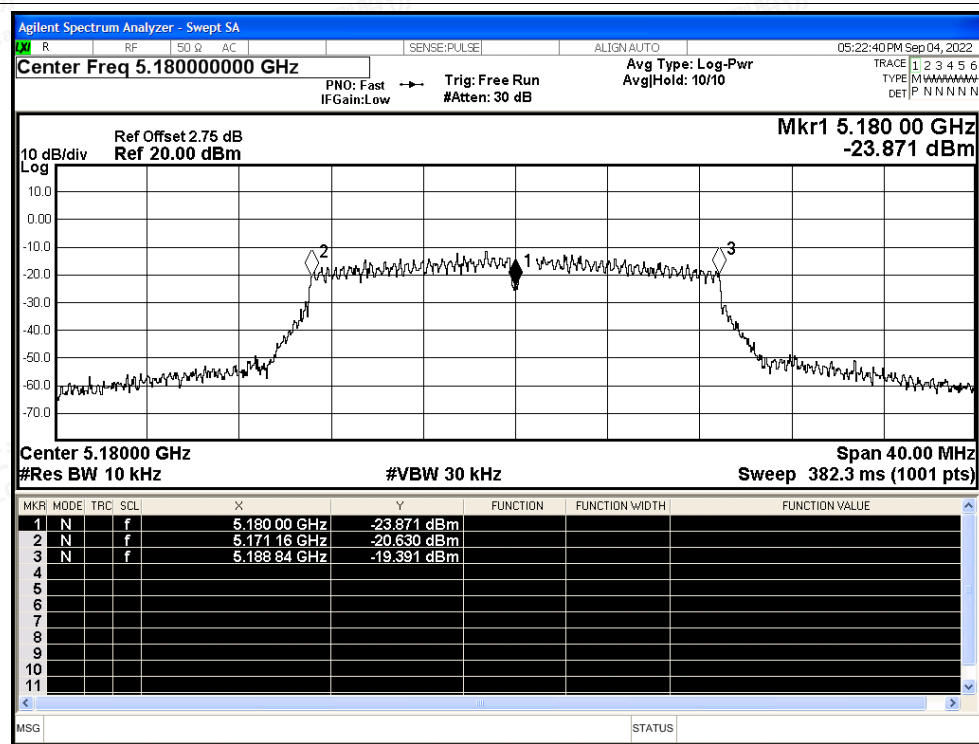




Freq. Stability NVNT n20 5200MHz Ant0

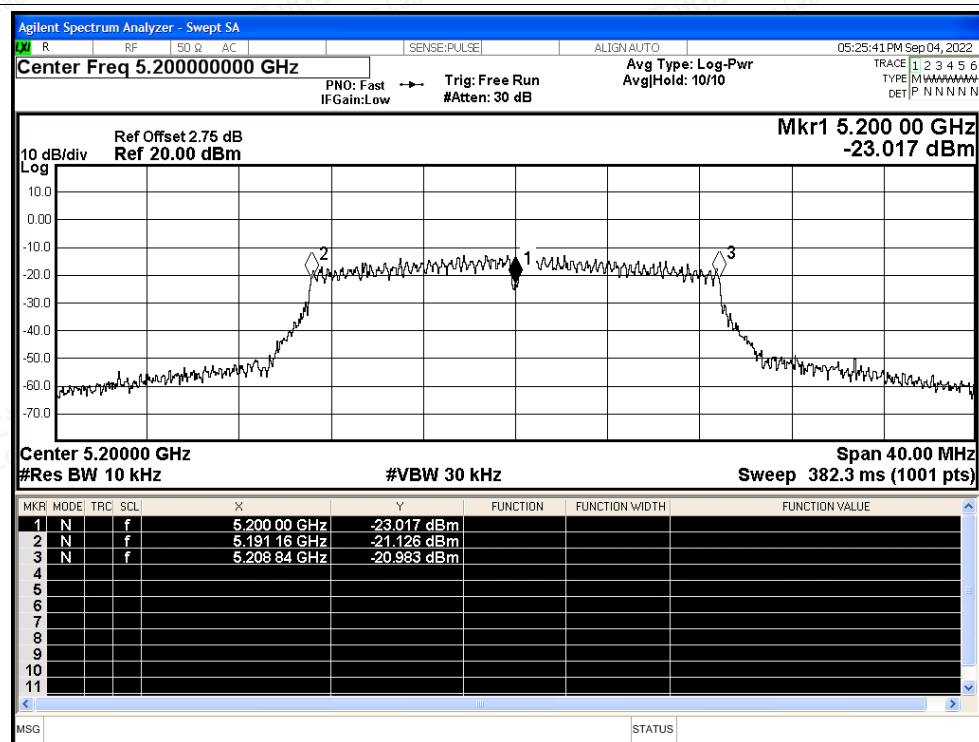


Freq. Stability NVNT n20 5240MHz Ant0

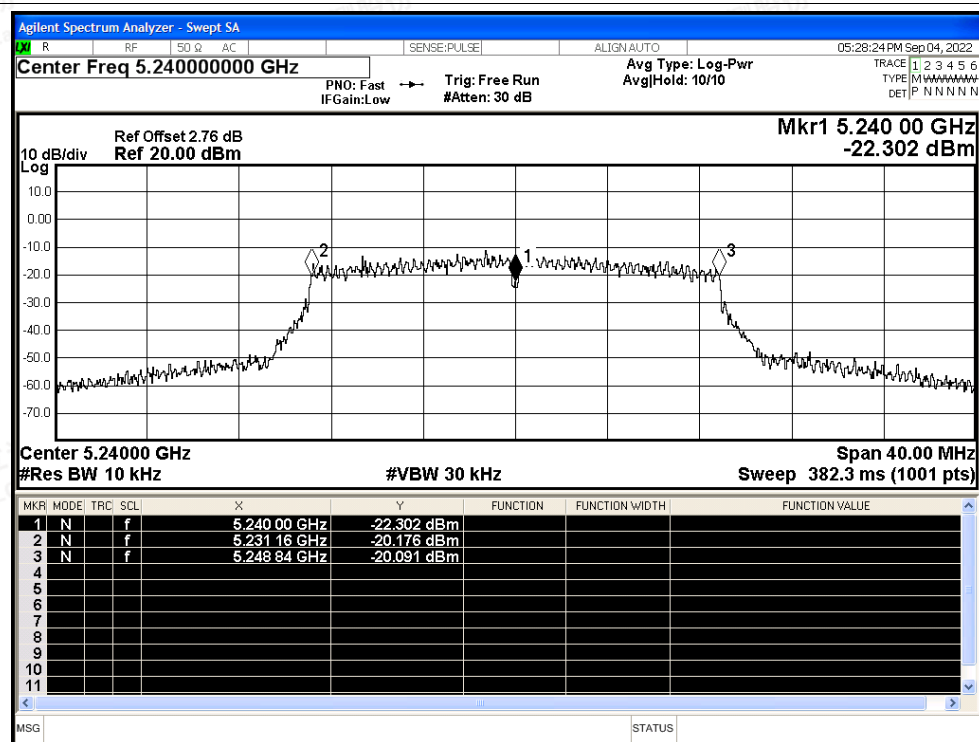




Freq. Stability NVNT n40 5190MHz Ant0

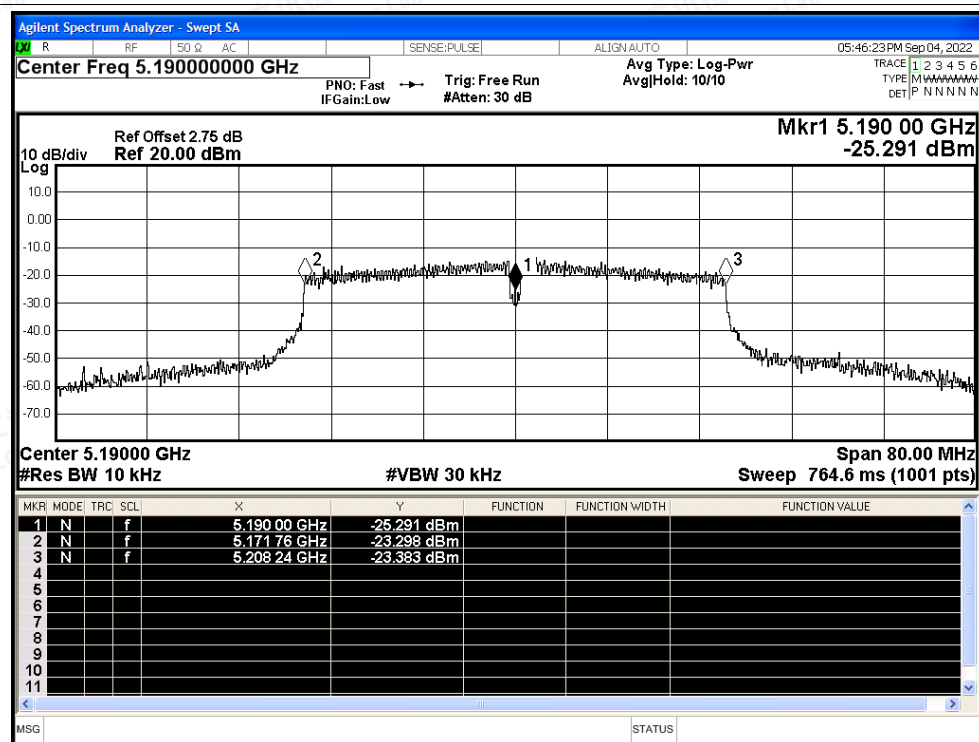


Freq. Stability NVNT n40 5230MHz Ant0

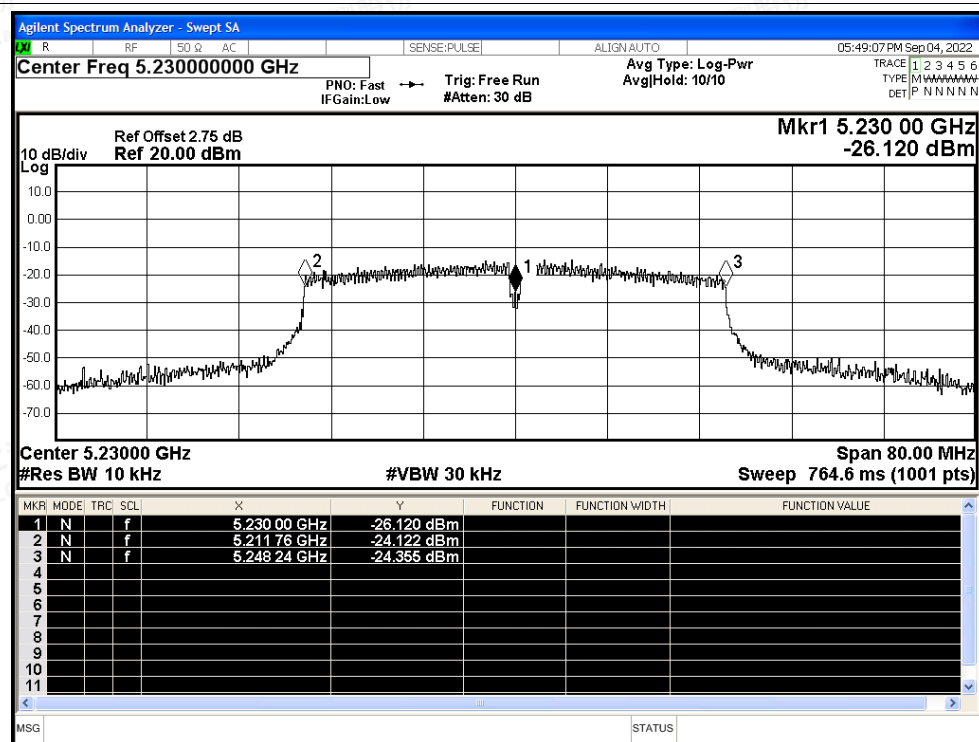




Freq. Stability NVNT ac20 5180MHz Ant0

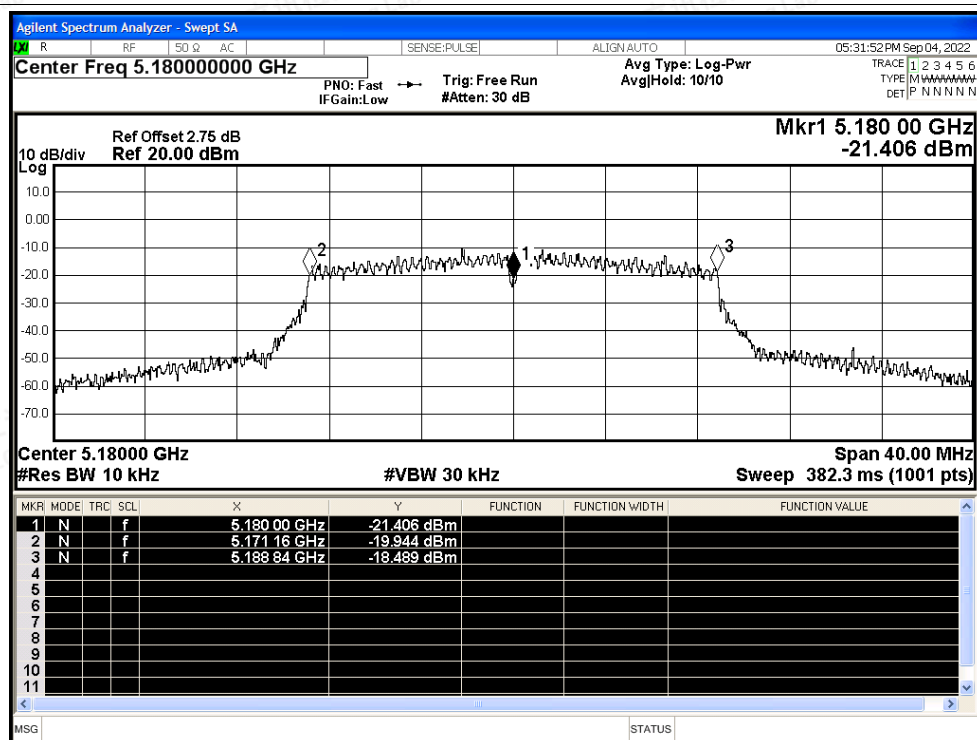


Freq. Stability NVNT ac20 5200MHz Ant0

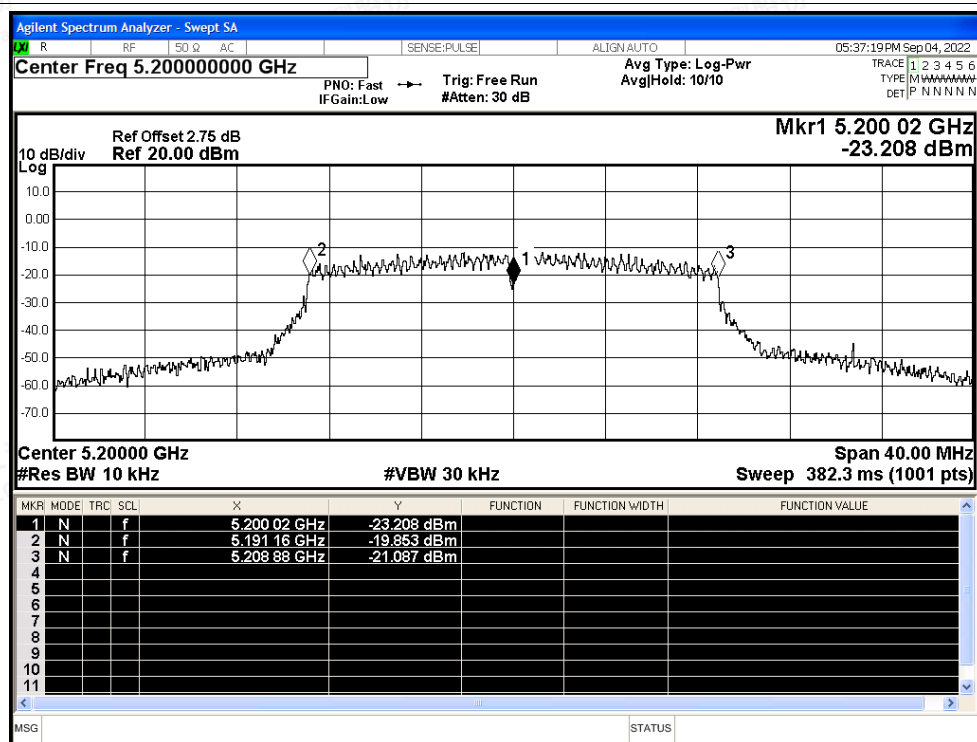




Freq. Stability NVNT ac20 5240MHz Ant0

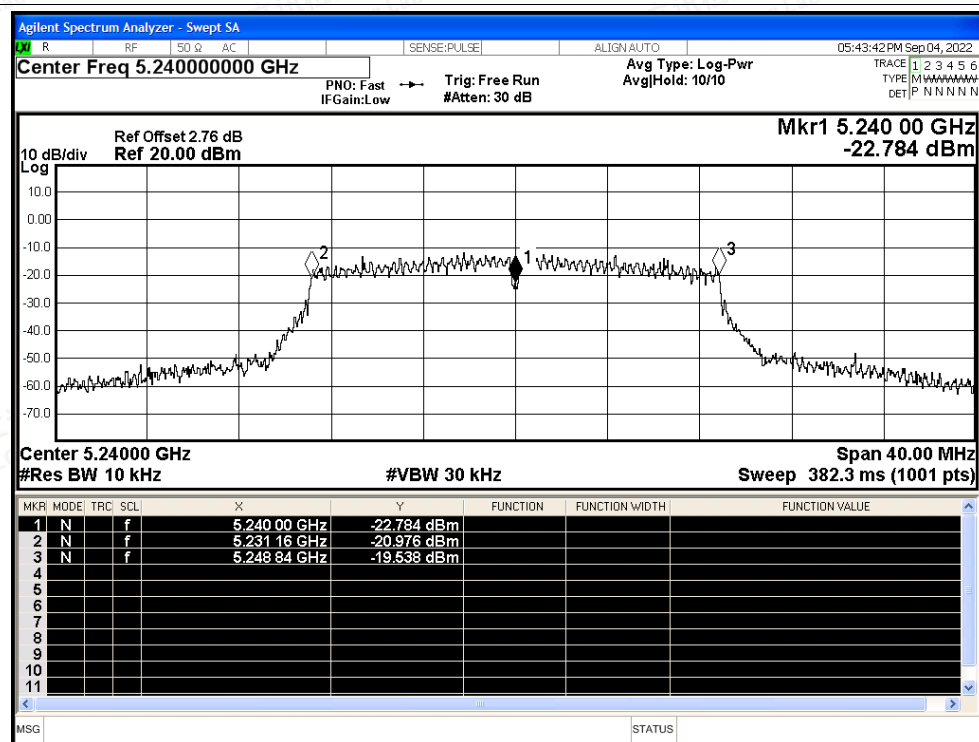


Freq. Stability NVNT ac40 5190MHz Ant0

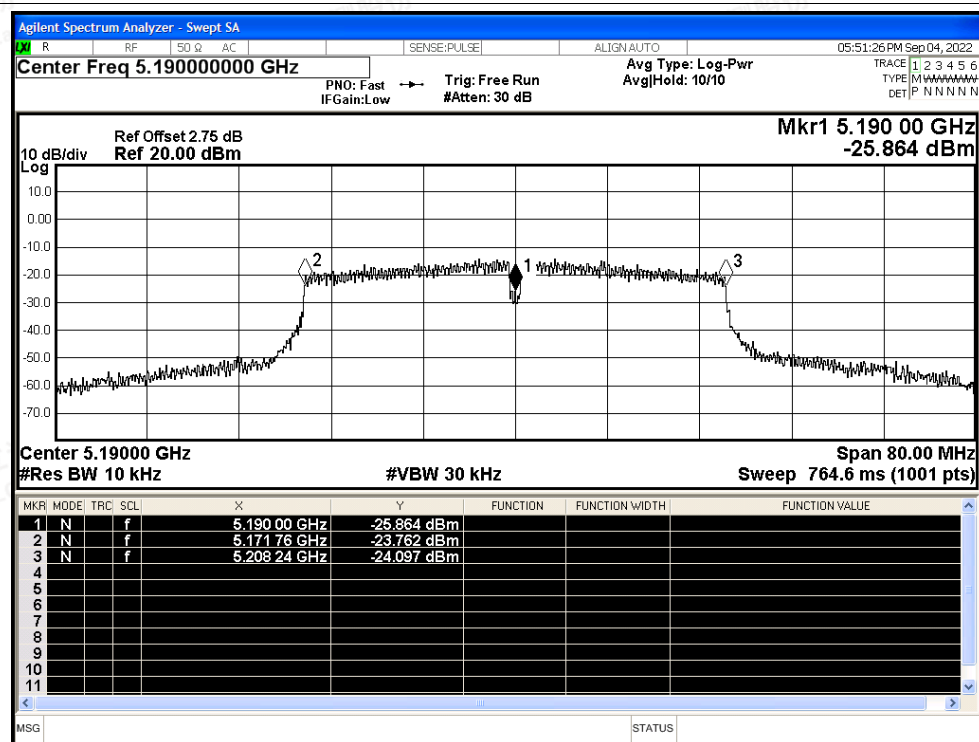




Freq. Stability NVNT ac40 5230MHz Ant0

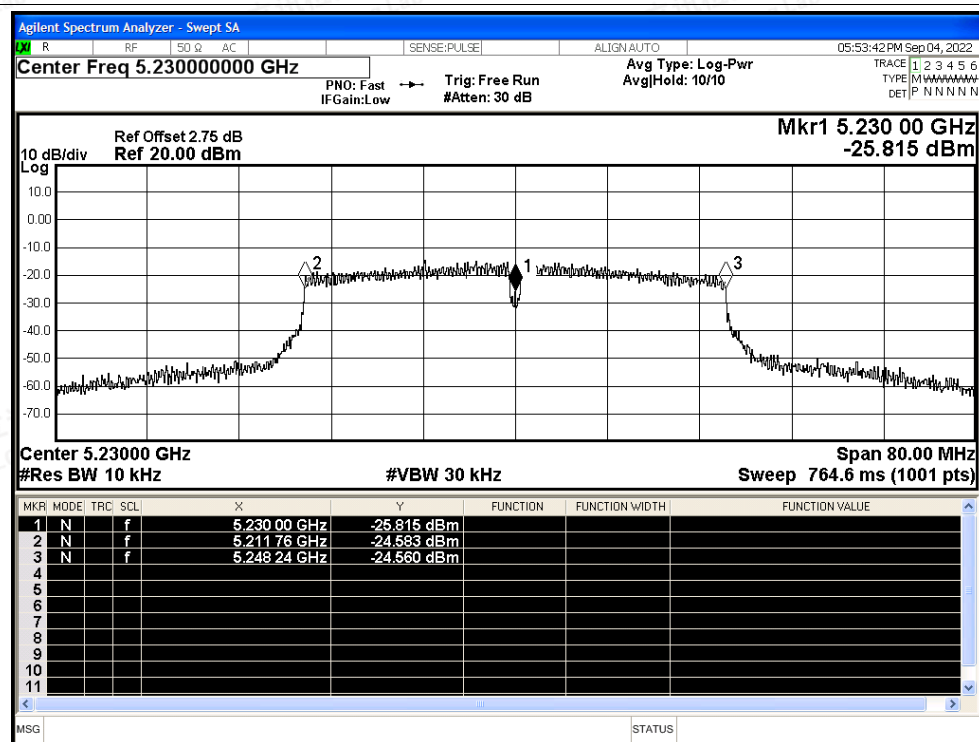

Freq. Stability NVNT ac80 5210MHz Ant0

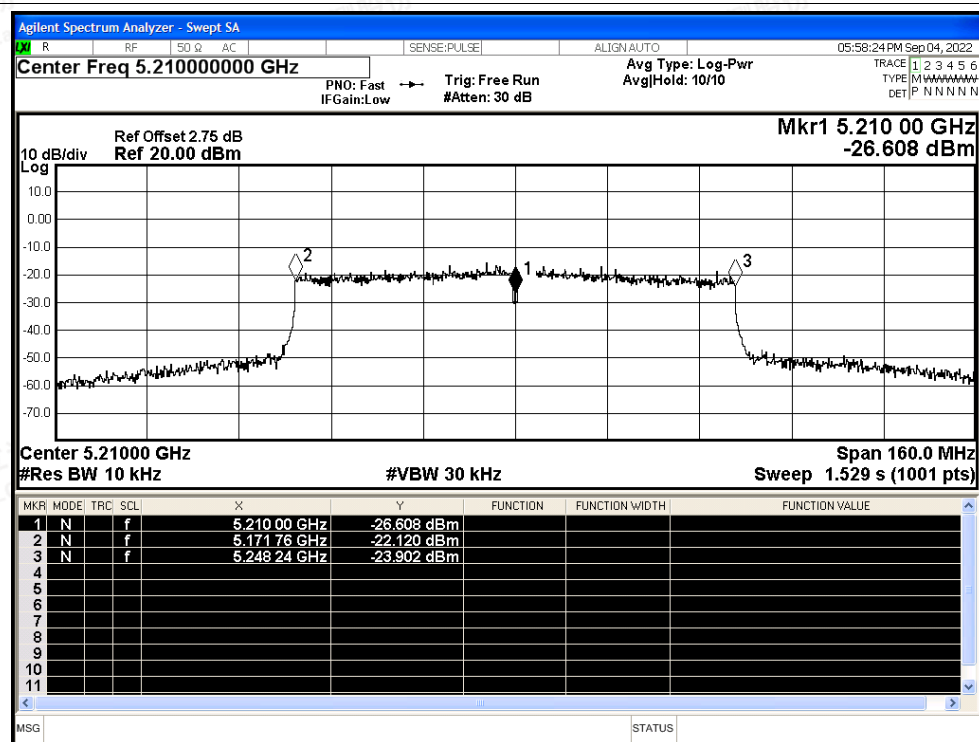




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5200.02	20000	3.85	25	Pass
NVNT	a	5240	Ant1	5240.02	20000	3.82	25	Pass
NVNT	n20	5180	Ant1	5180	0	0	25	Pass
NVNT	n20	5200	Ant1	5200	0	0	25	Pass
NVNT	n20	5240	Ant1	5240	0	0	25	Pass
NVNT	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
NVNT	ac20	5200	Ant1	5200.02	20000	3.85	25	Pass
NVNT	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

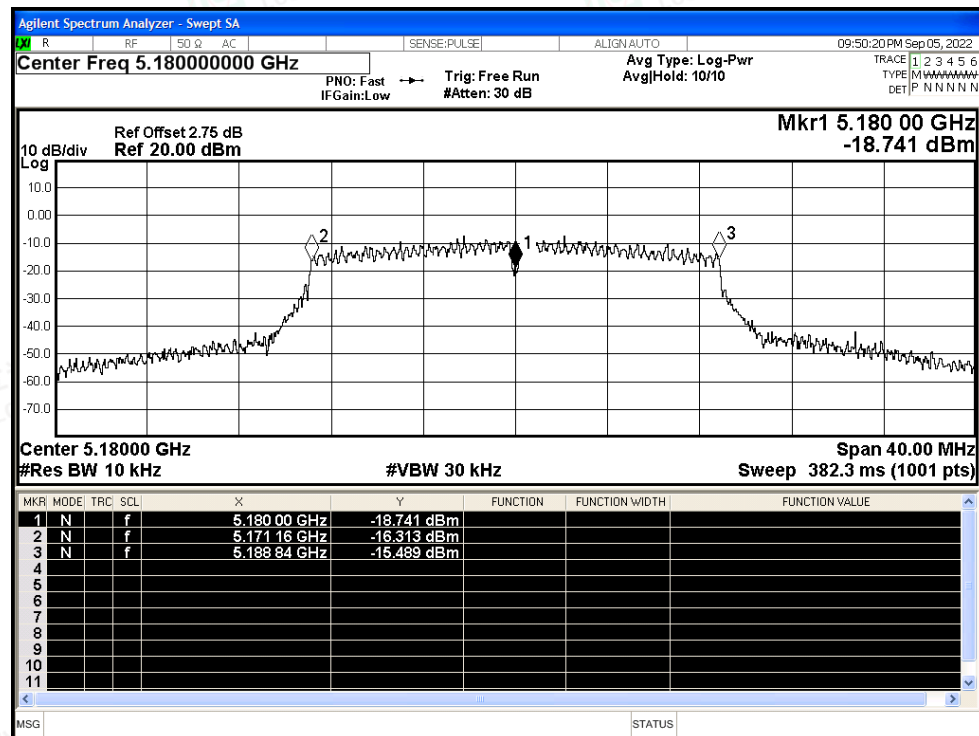


Freq. Stability NVNT a 5200MHz Ant1

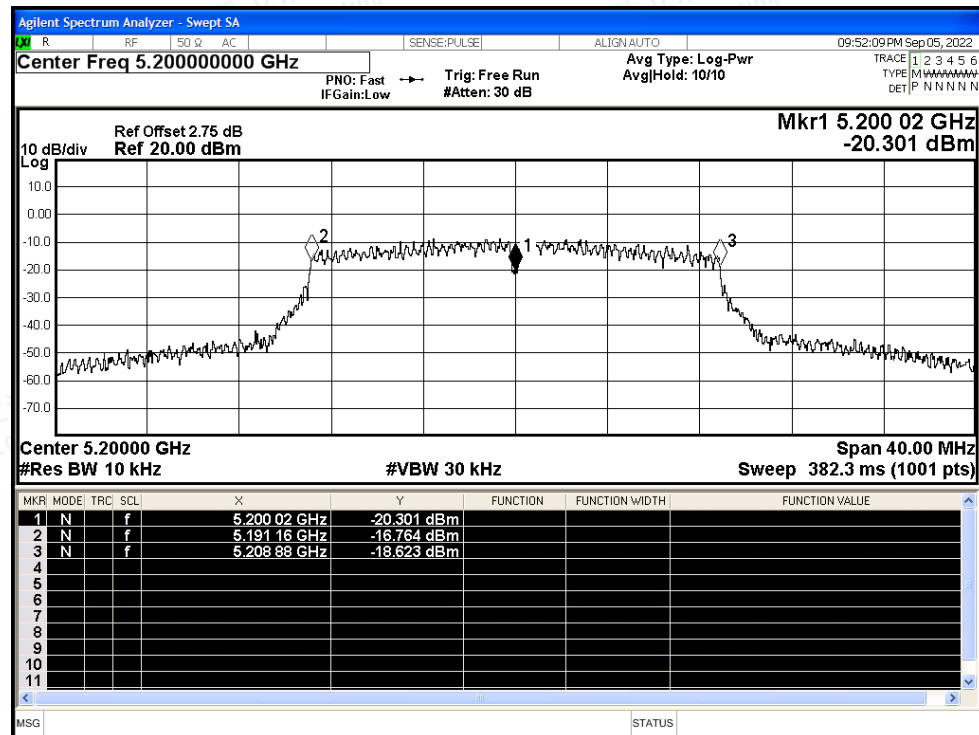




Freq. Stability NVNT a 5240MHz Ant1

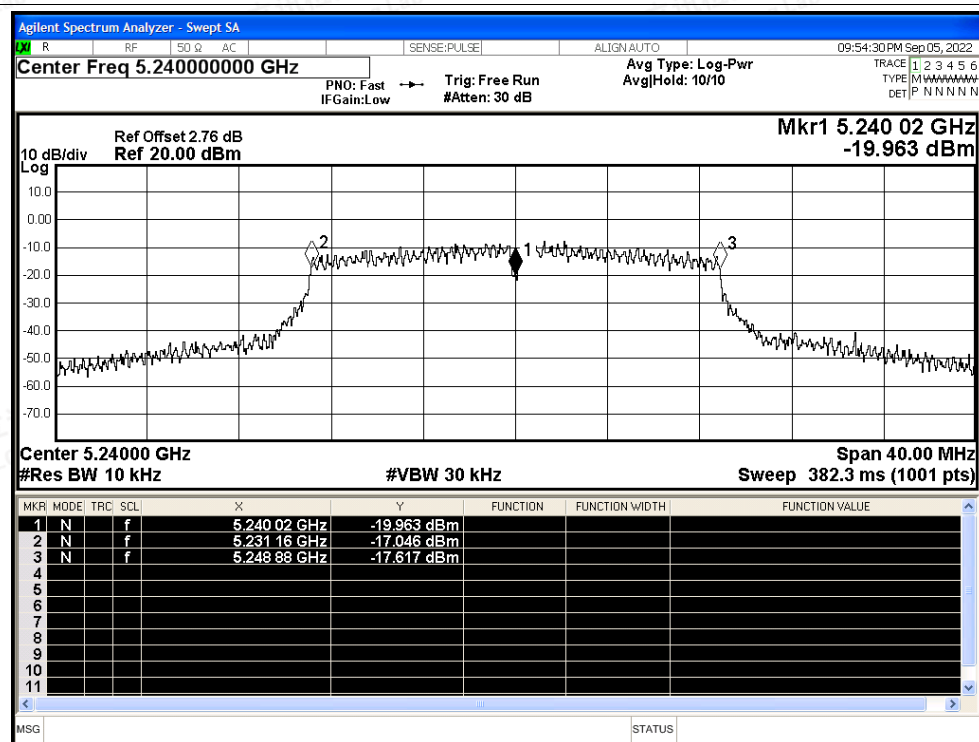


Freq. Stability NVNT n20 5180MHz Ant1

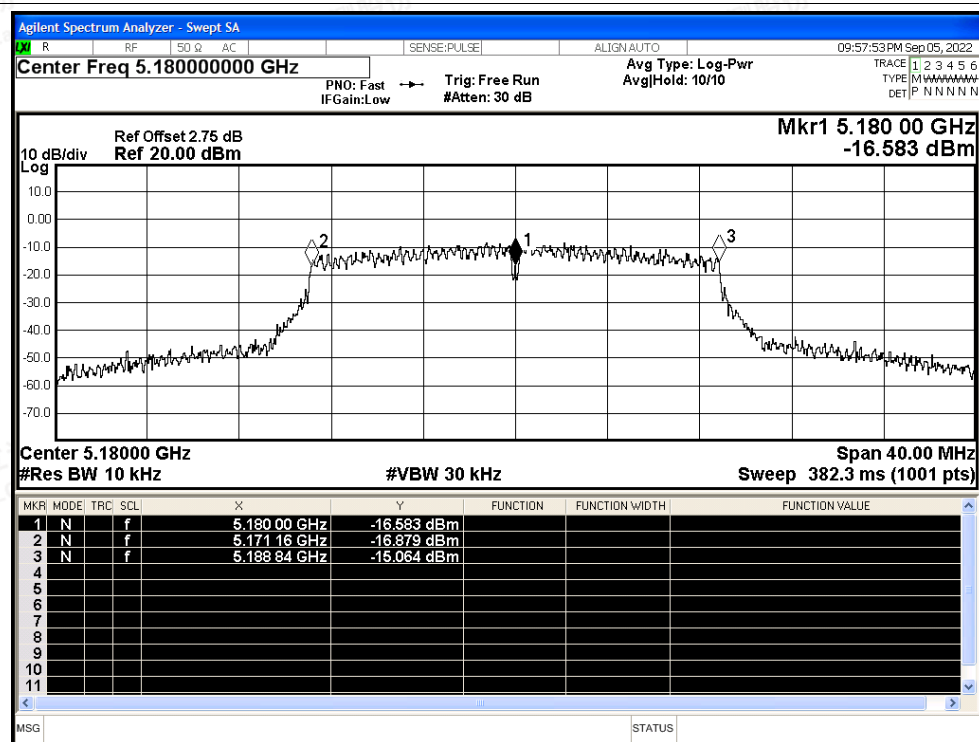




Freq. Stability NVNT n20 5200MHz Ant1

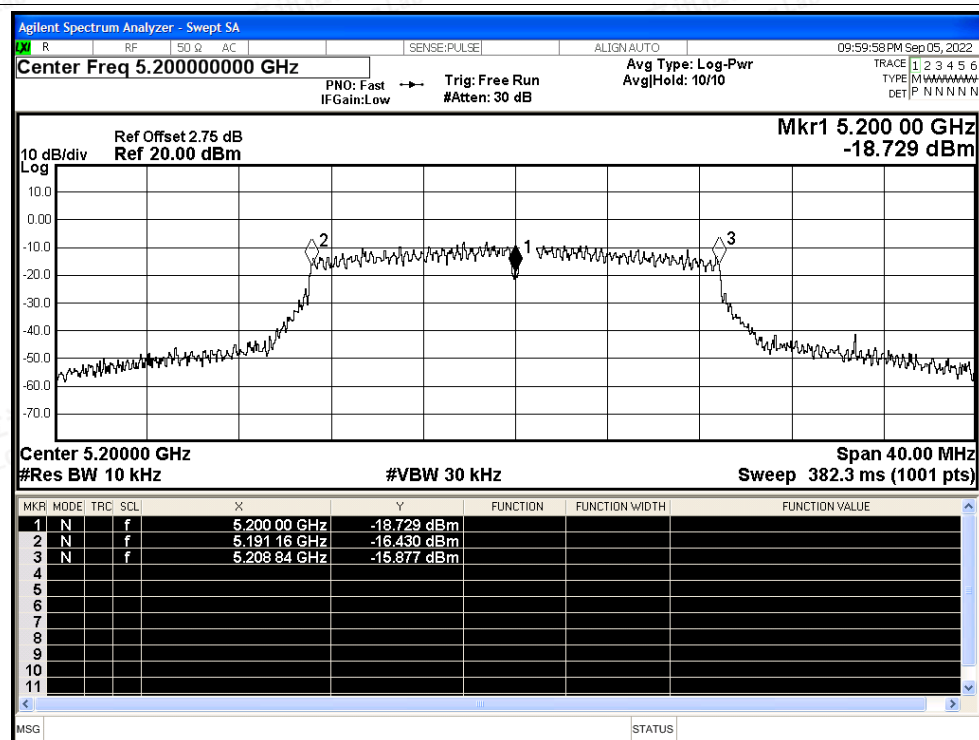


Freq. Stability NVNT n20 5240MHz Ant1

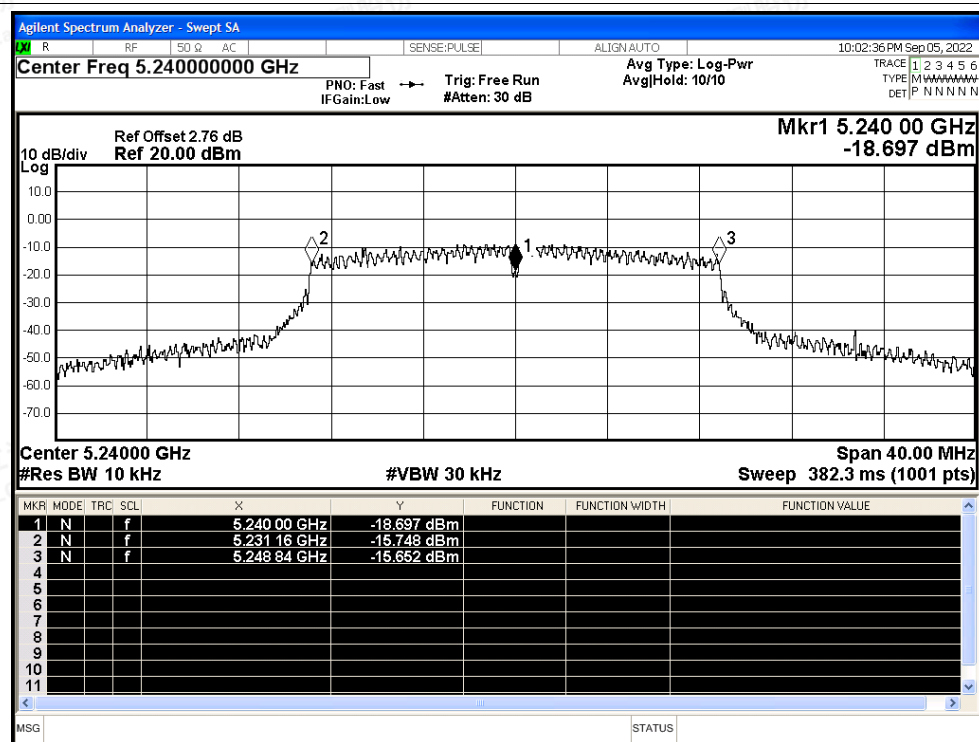




Freq. Stability NVNT n40 5190MHz Ant1

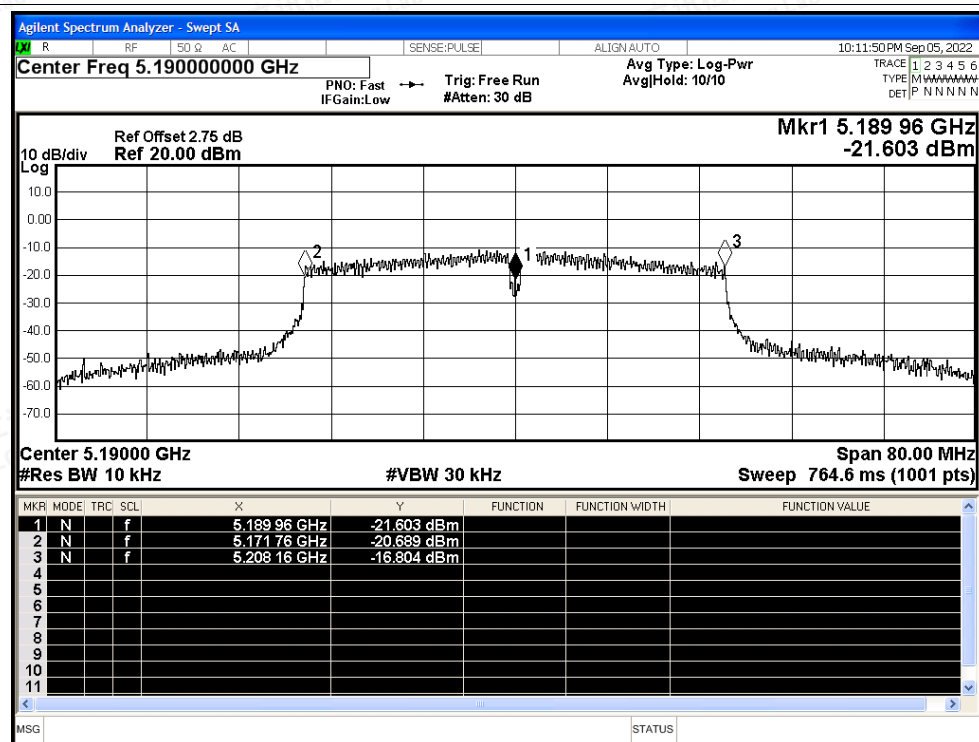


Freq. Stability NVNT n40 5230MHz Ant1

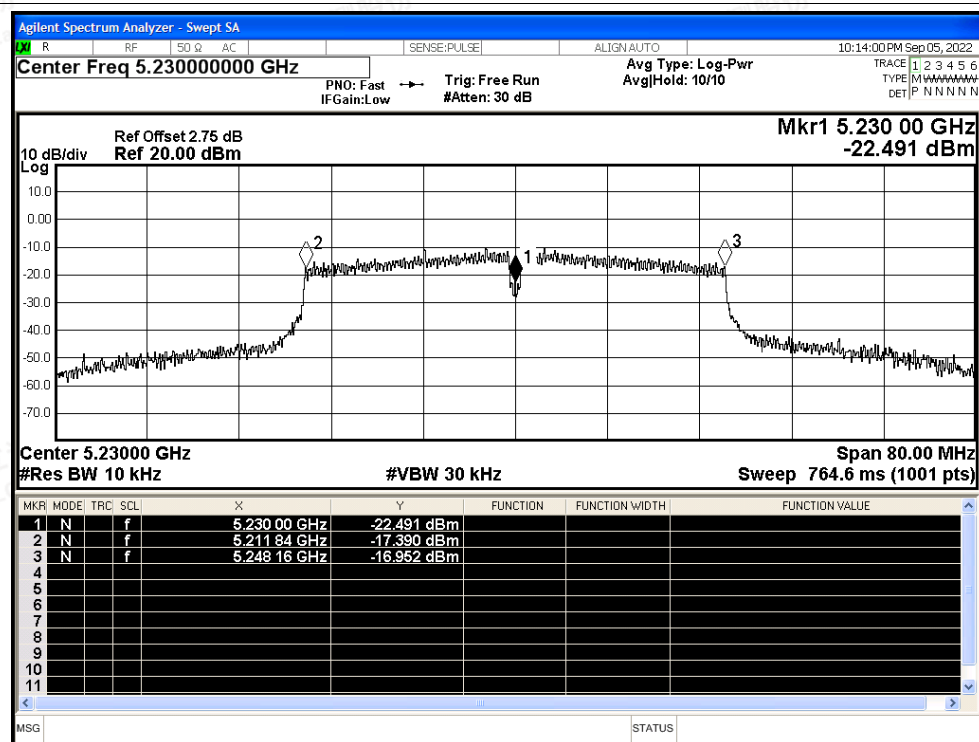




Freq. Stability NVNT ac20 5180MHz Ant1

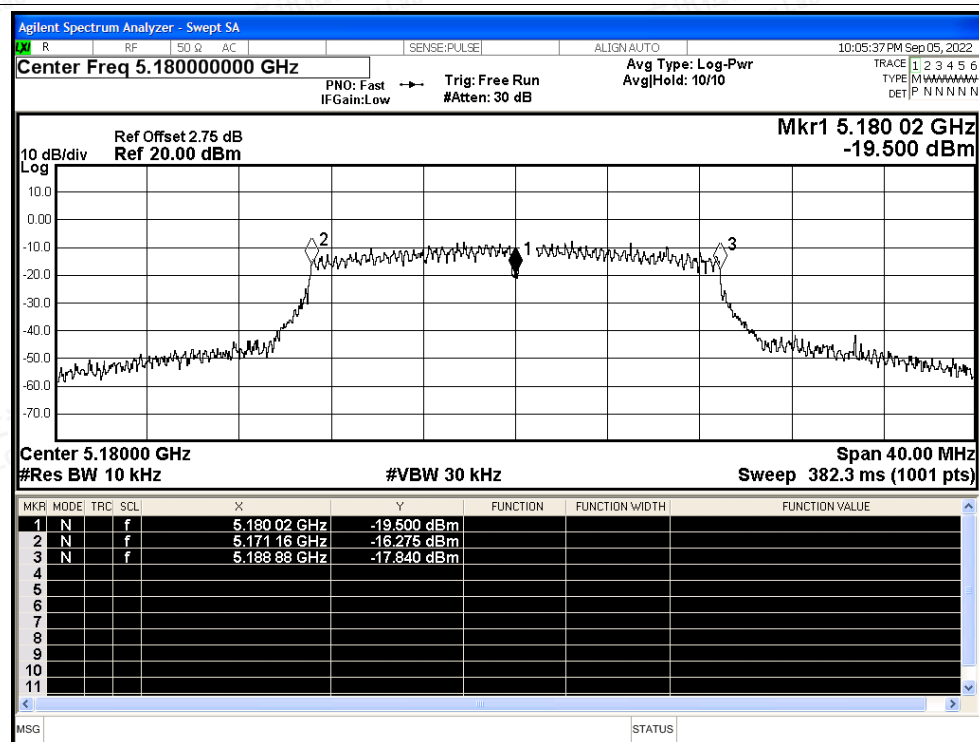


Freq. Stability NVNT ac20 5200MHz Ant1

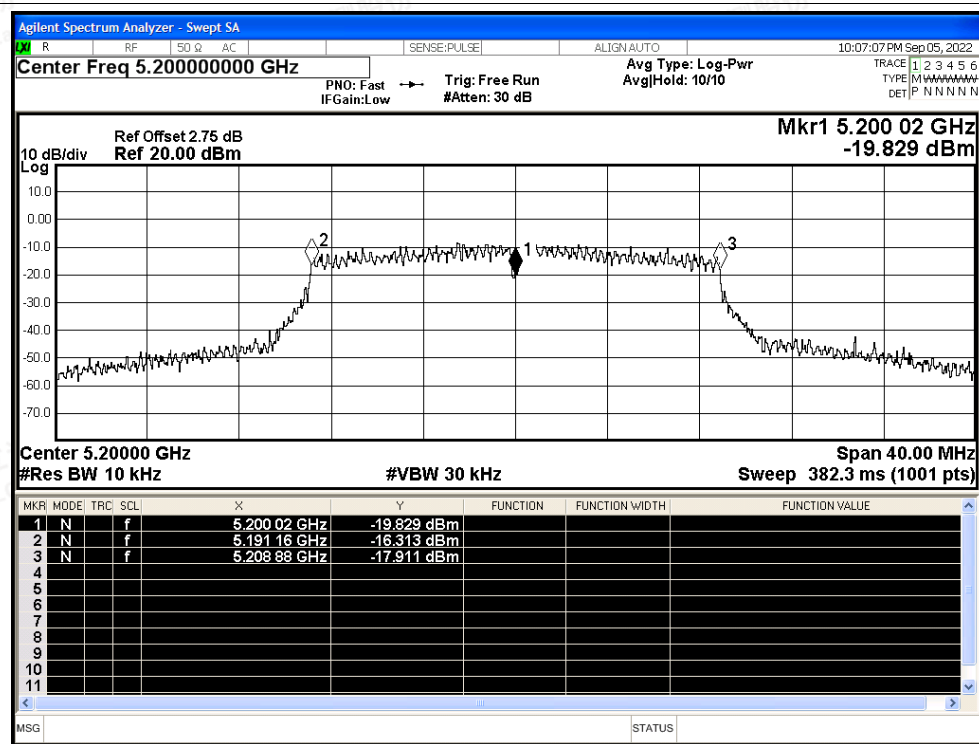




Freq. Stability NVNT ac20 5240MHz Ant1

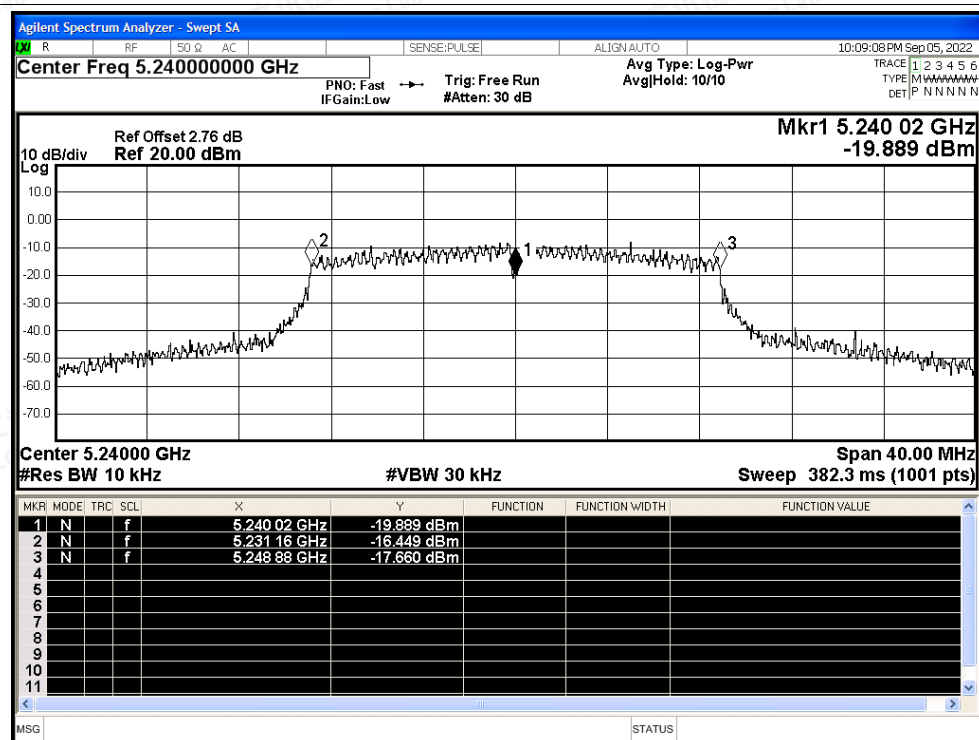


Freq. Stability NVNT ac40 5190MHz Ant1

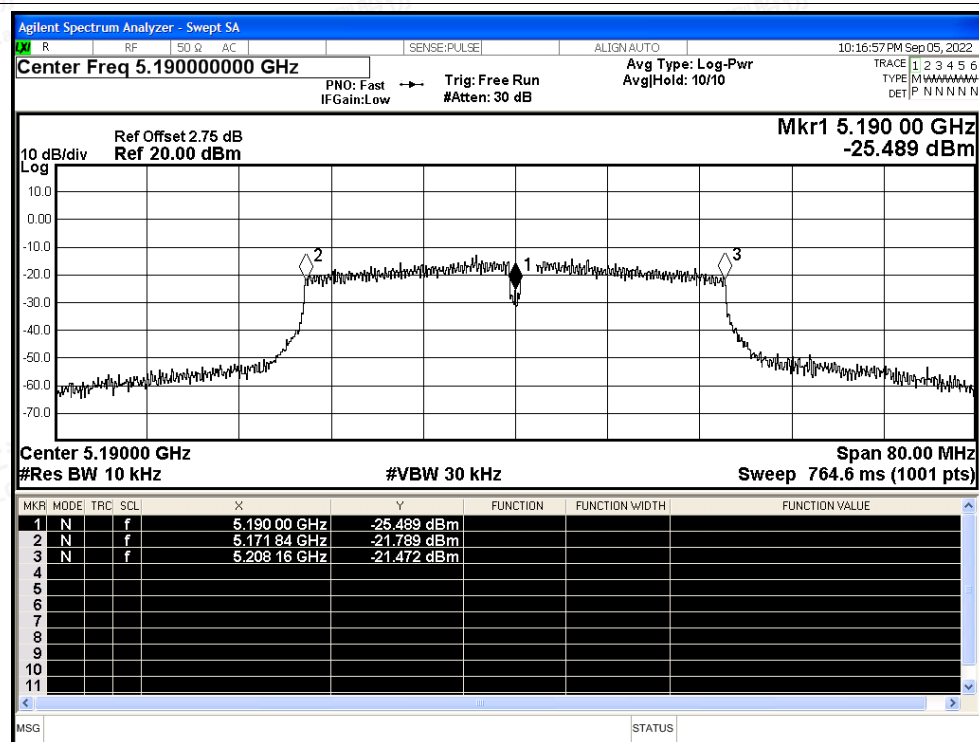




Freq. Stability NVNT ac40 5230MHz Ant1

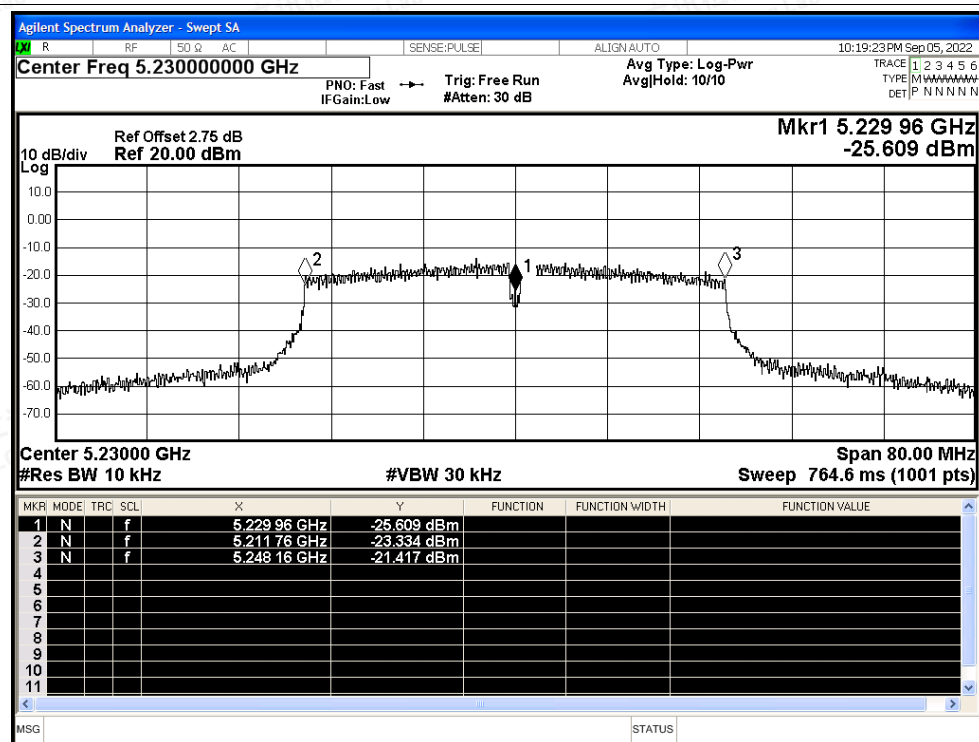

Freq. Stability NVNT ac80 5210MHz Ant1

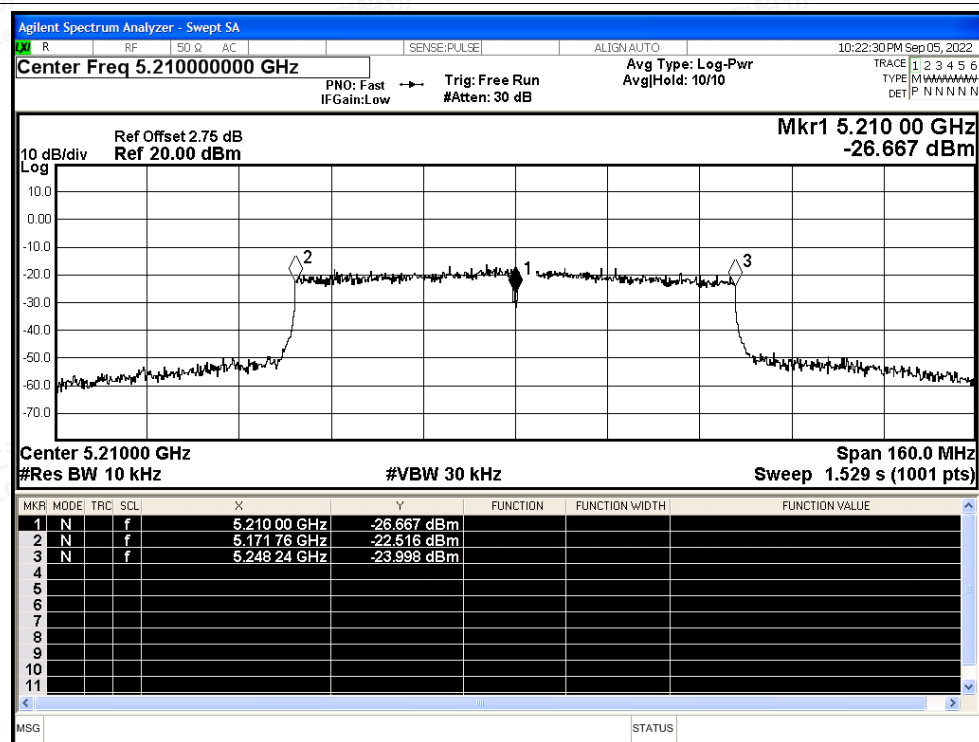



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant0	96.87	0.14	0.72
NVNT	a	5200	Ant0	96.94	0.13	0.72
NVNT	a	5240	Ant0	96.94	0.13	0.72
NVNT	n20	5180	Ant0	96.73	0.14	0.77
NVNT	n20	5200	Ant0	96.73	0.14	0.77
NVNT	n20	5240	Ant0	96.65	0.15	0.77
NVNT	n40	5190	Ant0	93.64	0.29	1.54
NVNT	n40	5230	Ant0	93.79	0.28	1.54
NVNT	ac20	5180	Ant0	96.68	0.15	0.76
NVNT	ac20	5200	Ant0	96.76	0.14	0.76
NVNT	ac20	5240	Ant0	96.68	0.15	0.76
NVNT	ac40	5190	Ant0	93.82	0.28	1.53
NVNT	ac40	5230	Ant0	93.69	0.28	1.53
NVNT	ac80	5210	Ant0	88.08	0.55	3.08
NVNT	ax20	5180	Ant0	96.76	0.14	0.76
NVNT	ax20	5200	Ant0	96.76	0.14	0.76
NVNT	ax20	5240	Ant0	96.68	0.15	0.76
NVNT	ax40	5190	Ant0	93.68	0.28	1.53
NVNT	ax40	5230	Ant0	93.82	0.28	1.53
NVNT	ax80	5210	Ant0	88.04	0.55	3.09






Test Graphs

Duty Cycle NVNT a 5180MHz Ant0

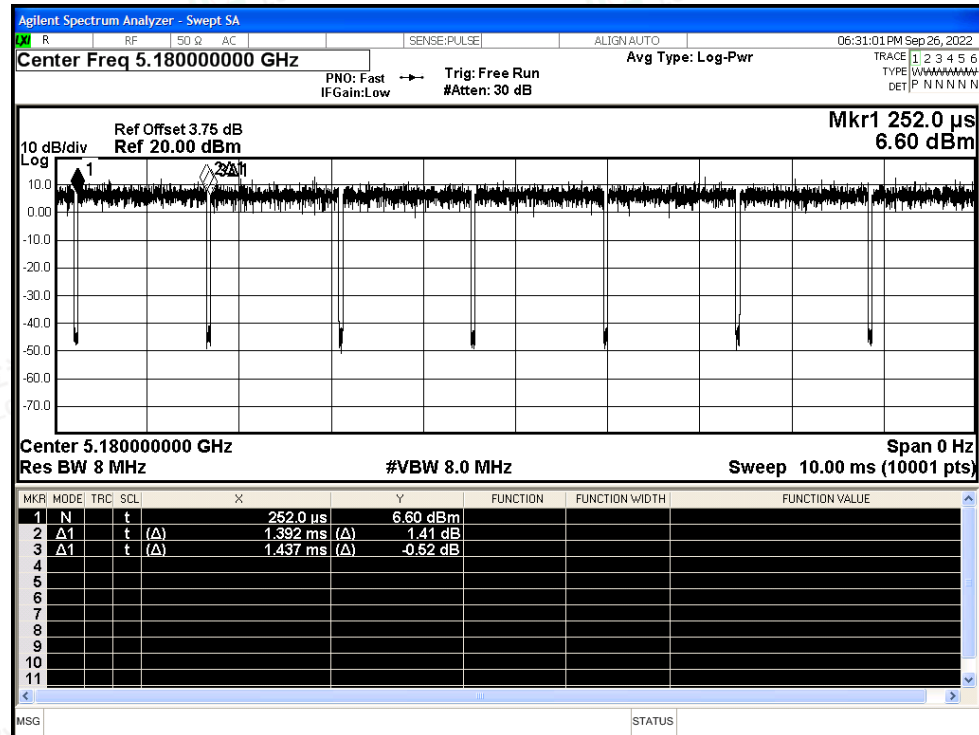


Duty Cycle NVNT a 5200MHz Ant0

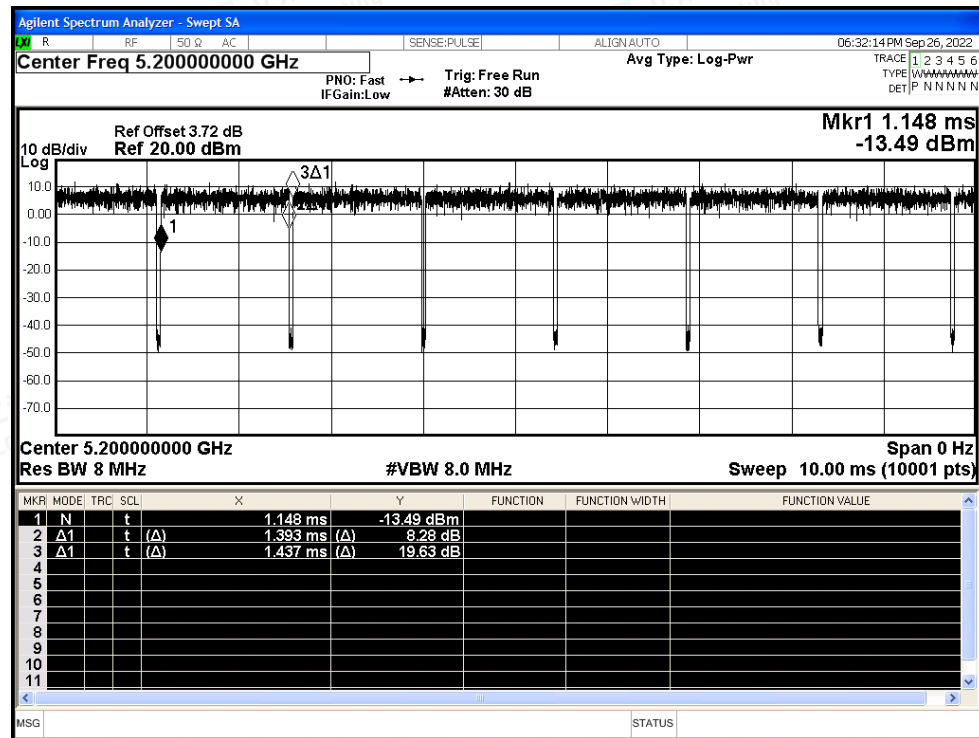




Duty Cycle NVNT a 5240MHz Ant0

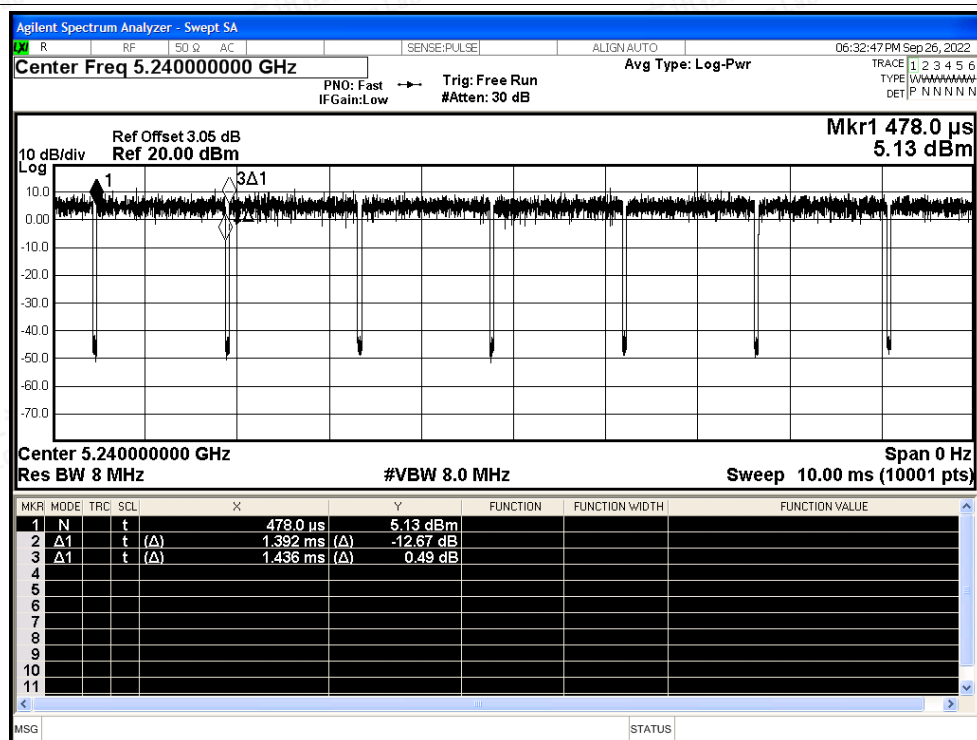


Duty Cycle NVNT n20 5180MHz Ant0

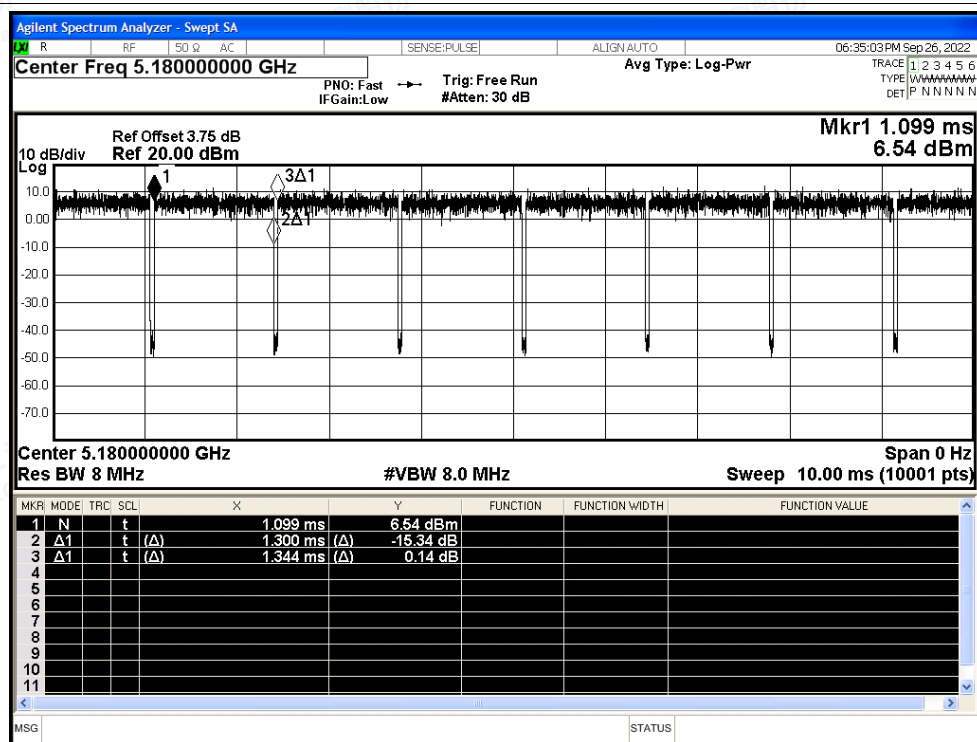




Duty Cycle NVNT n20 5200MHz Ant0

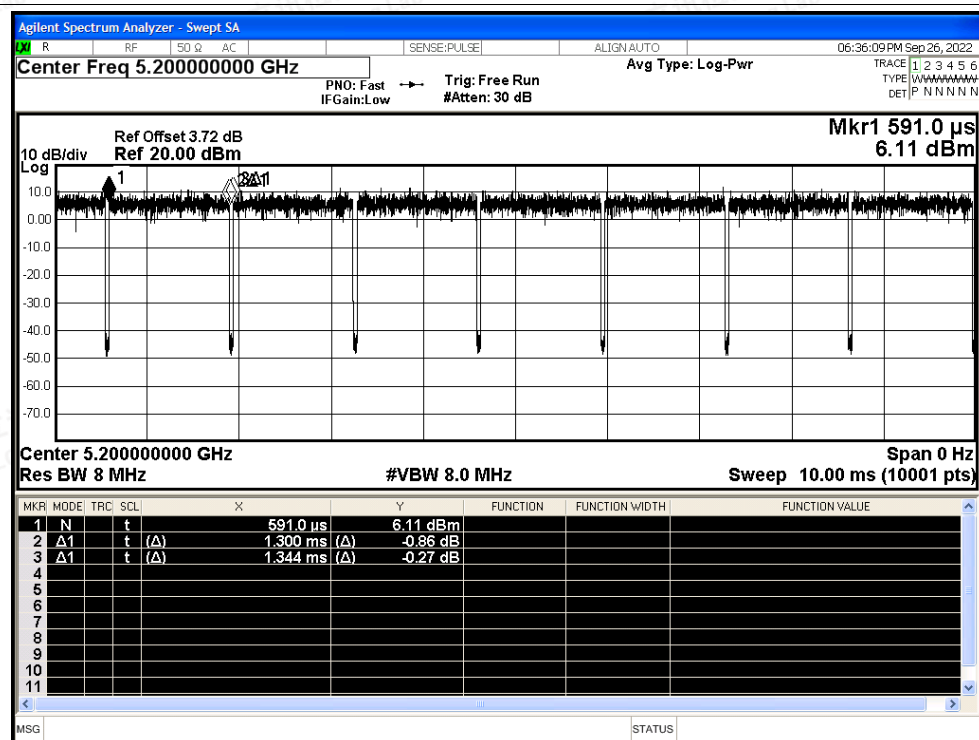


Duty Cycle NVNT n20 5240MHz Ant0

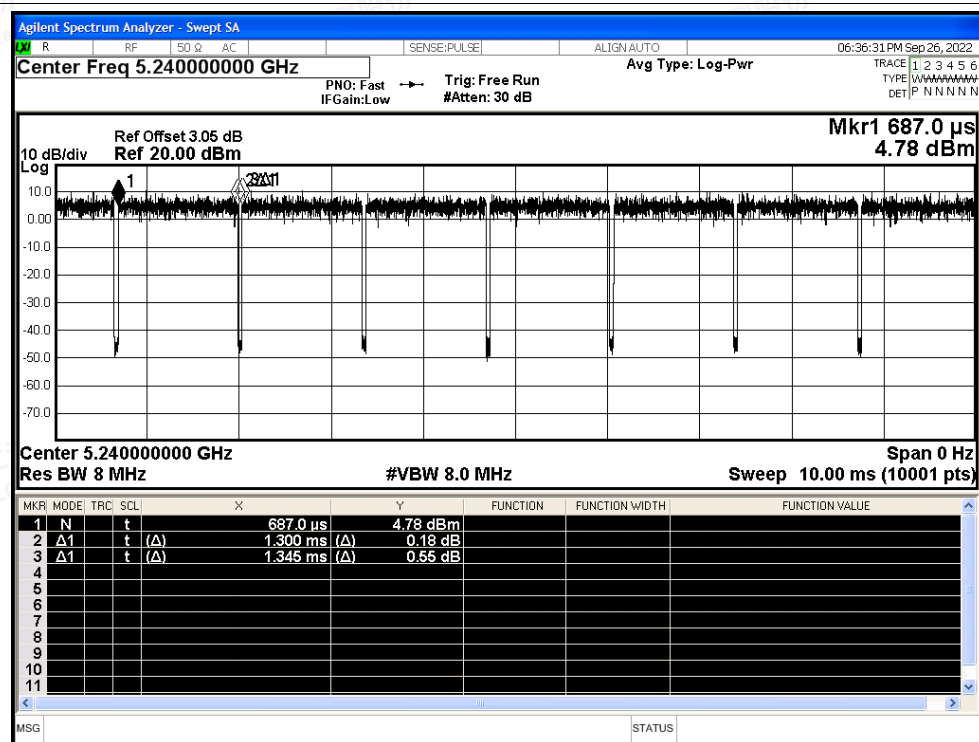




Duty Cycle NVNT n40 5190MHz Ant0

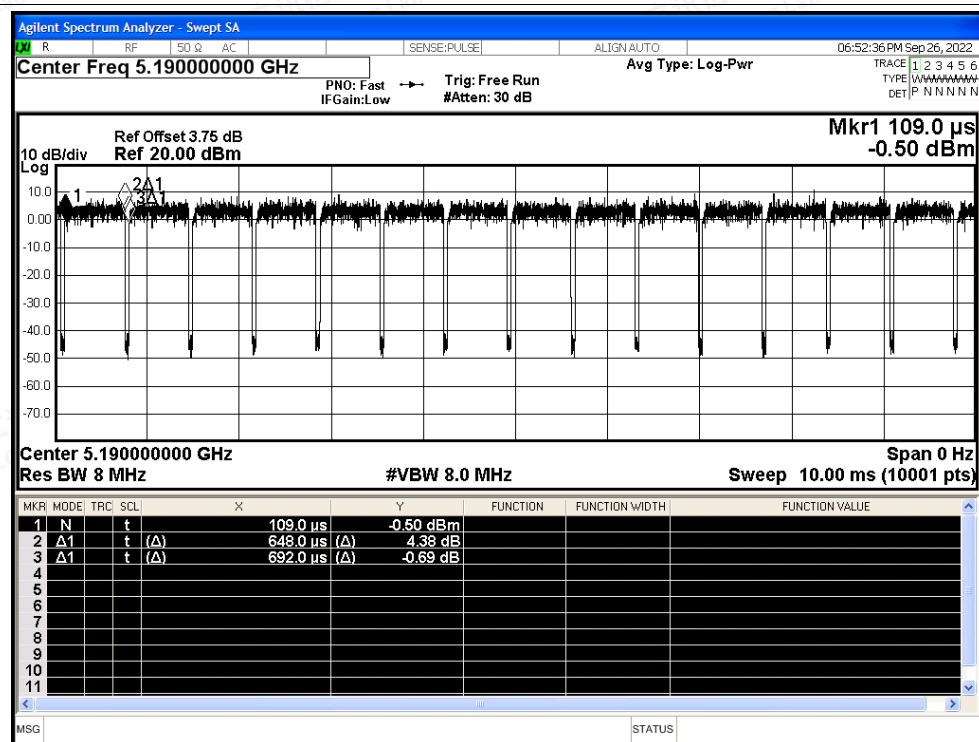


Duty Cycle NVNT n40 5230MHz Ant0

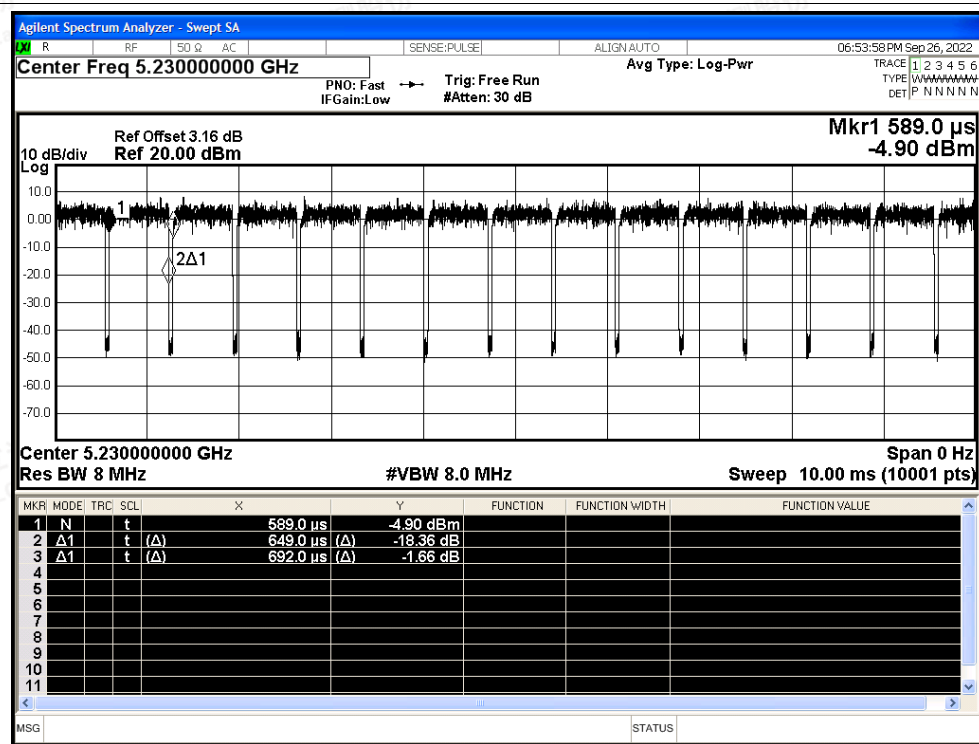




Duty Cycle NVNT ac20 5180MHz Ant0

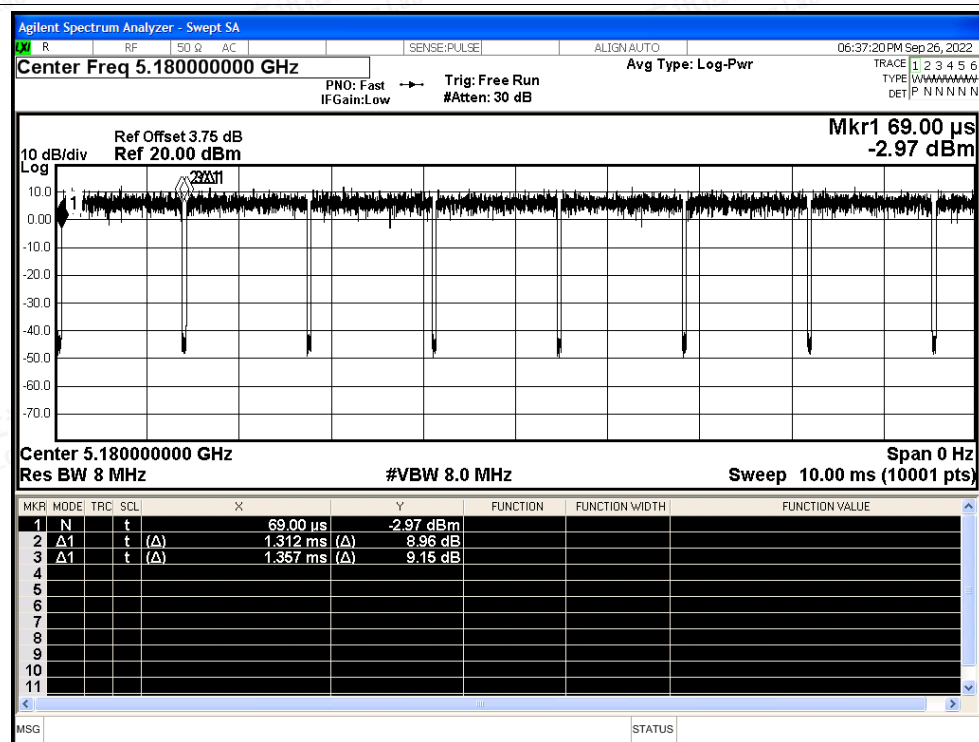


Duty Cycle NVNT ac20 5200MHz Ant0

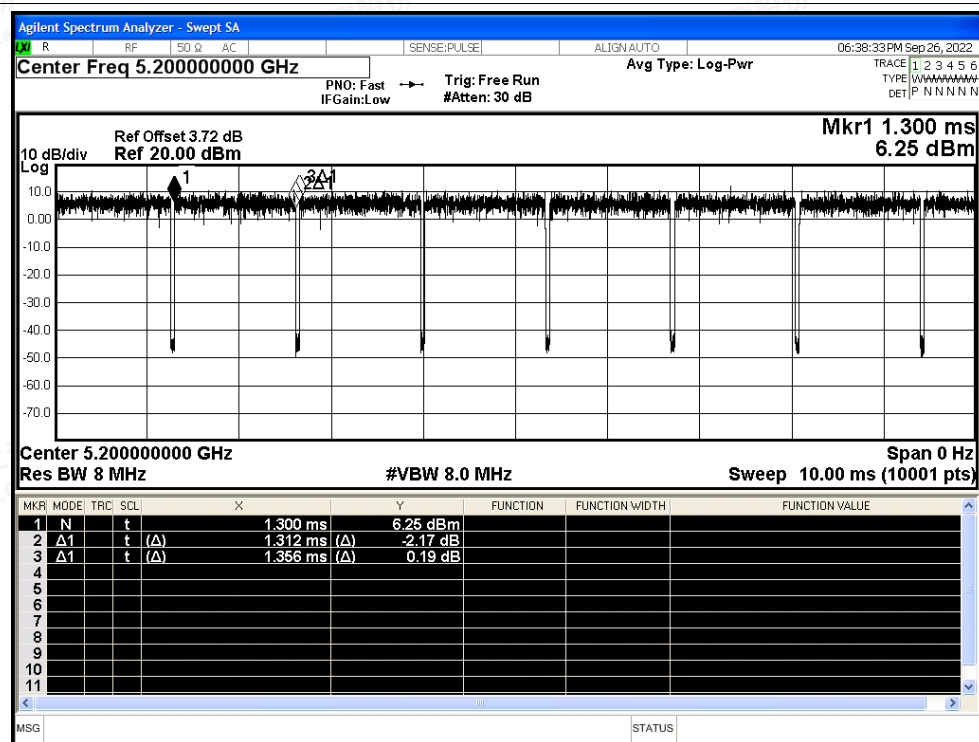




Duty Cycle NVNT ac20 5240MHz Ant0

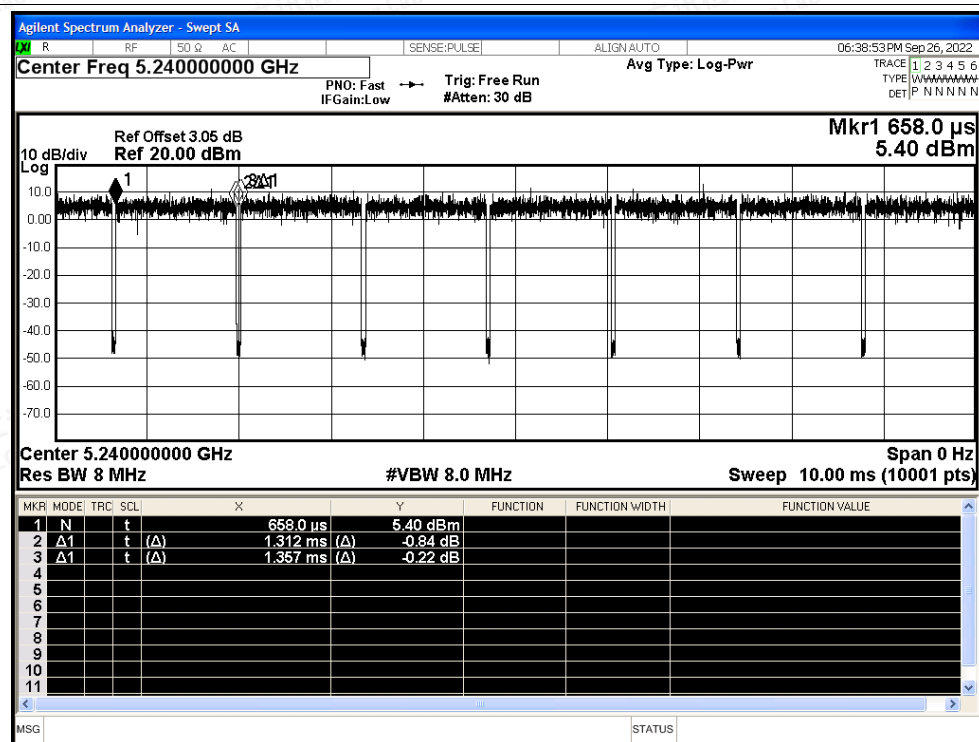


Duty Cycle NVNT ac40 5190MHz Ant0

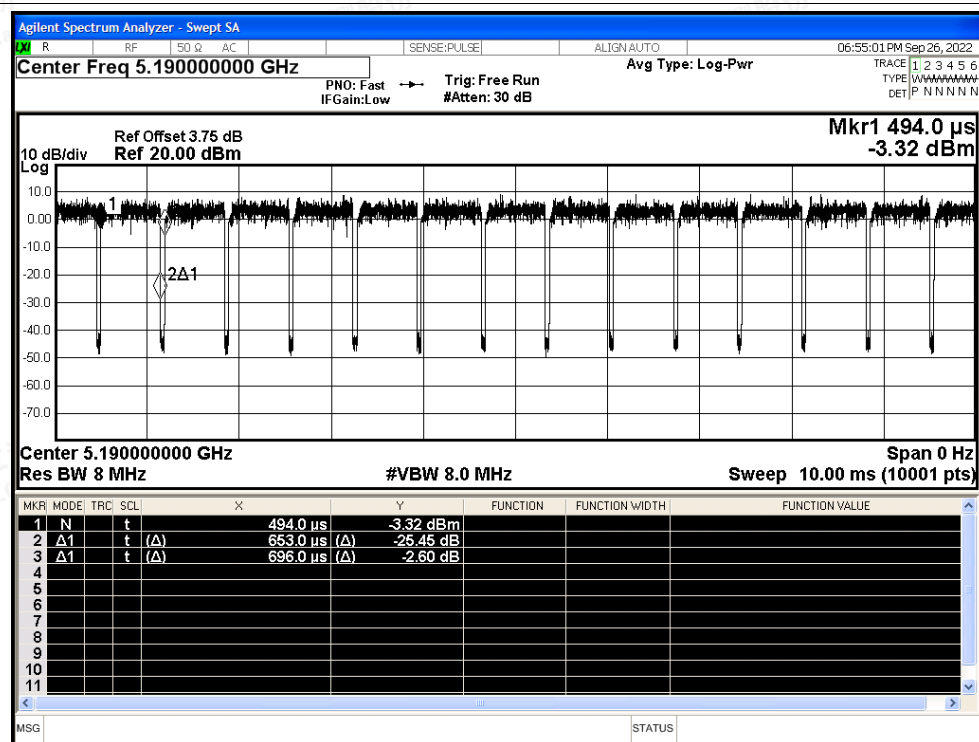




Duty Cycle NVNT ac40 5230MHz Ant0

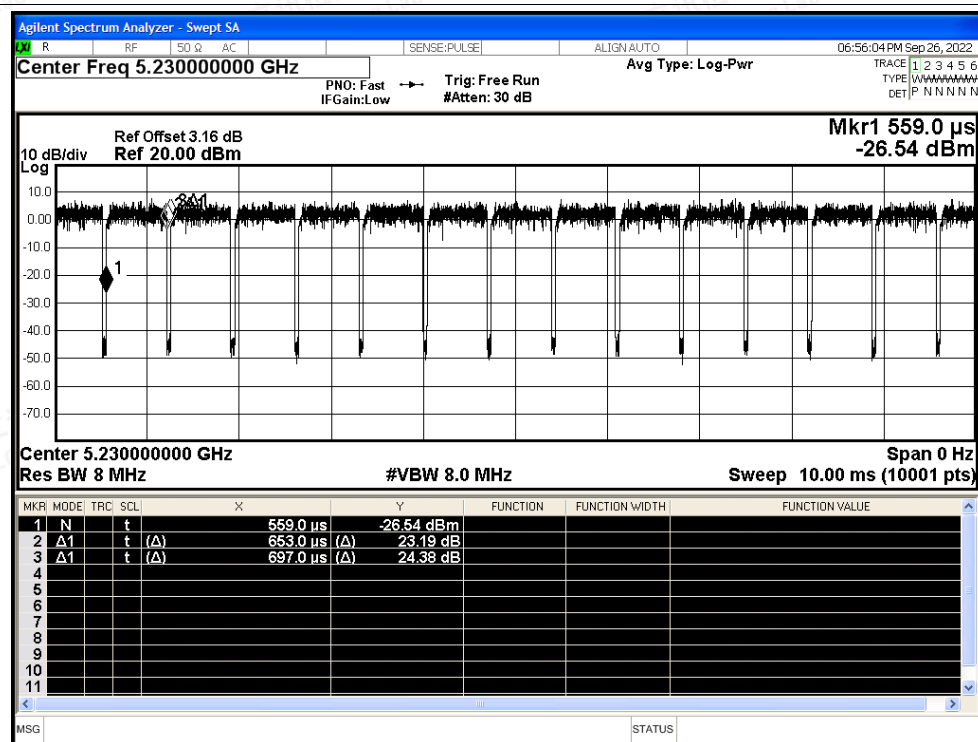


Duty Cycle NVNT ac80 5210MHz Ant0

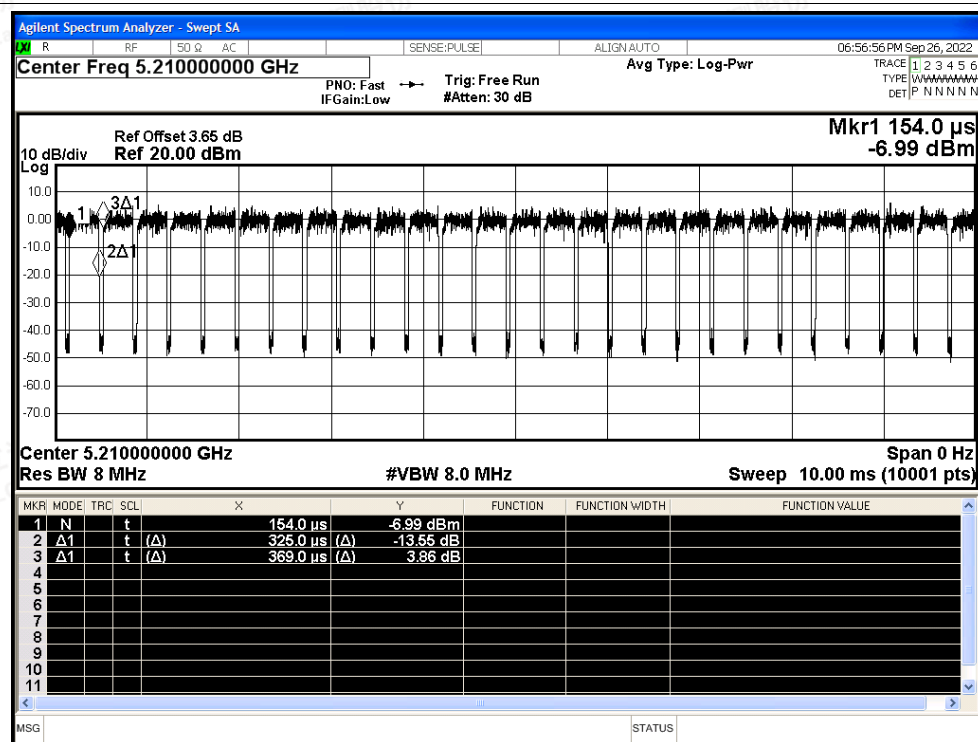




Duty Cycle NVNT ax20 5180MHz Ant0

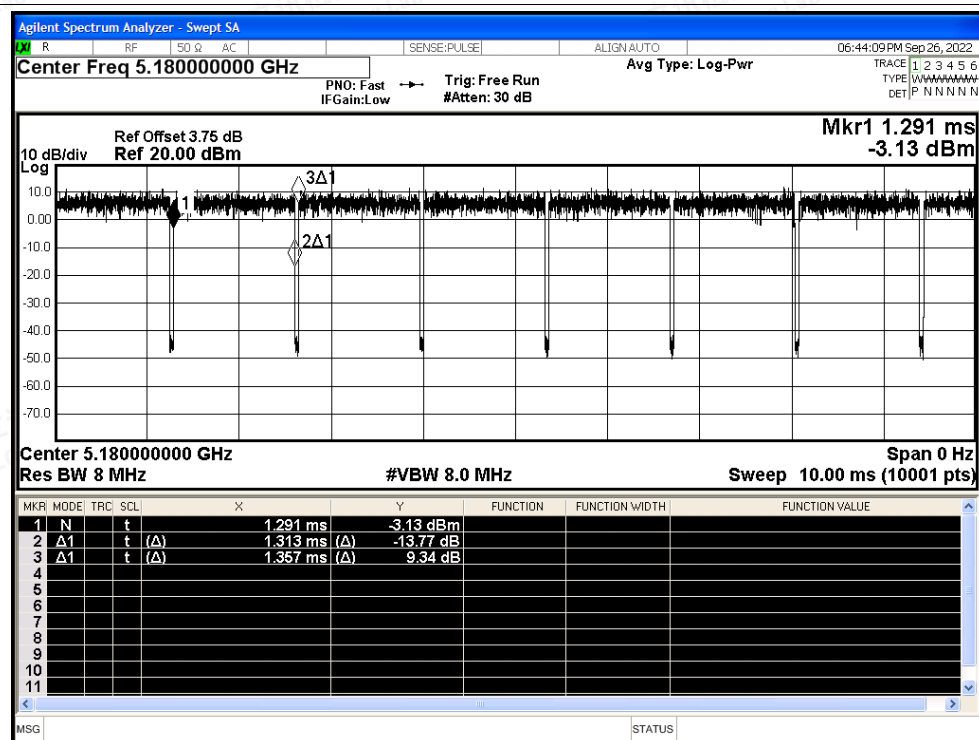


Duty Cycle NVNT ax20 5200MHz Ant0

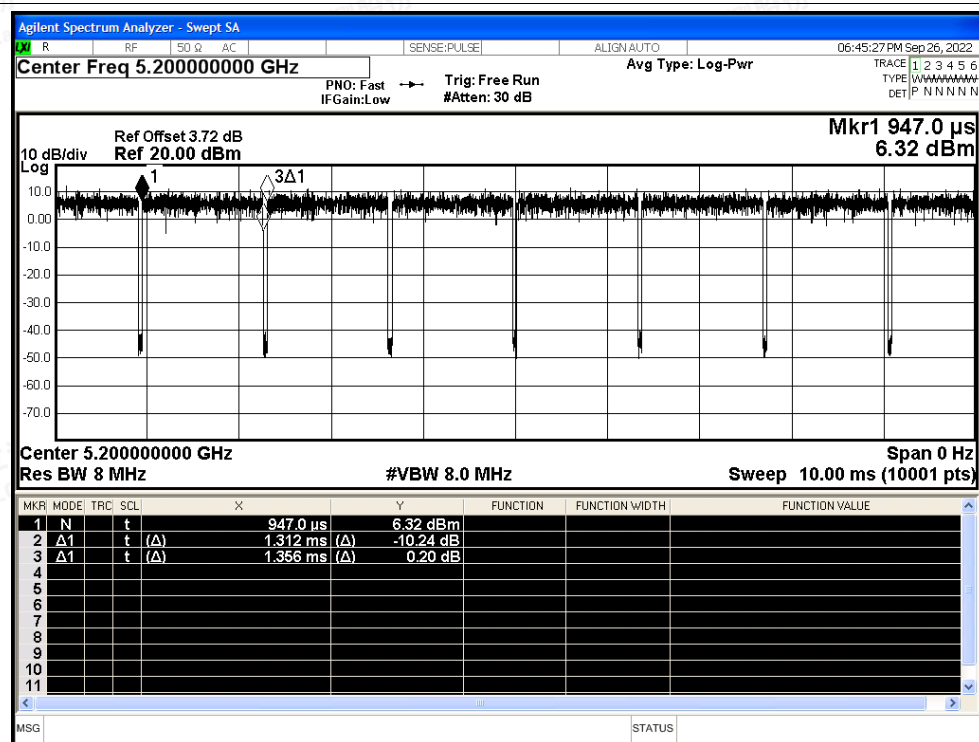




Duty Cycle NVNT ax20 5240MHz Ant0

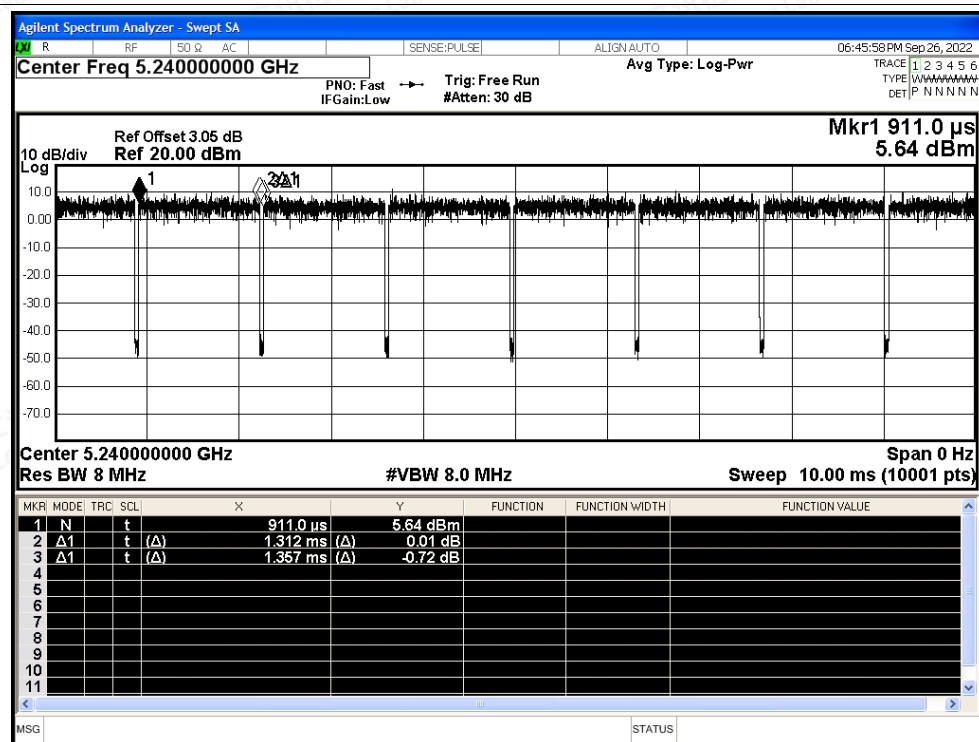


Duty Cycle NVNT ax40 5190MHz Ant0

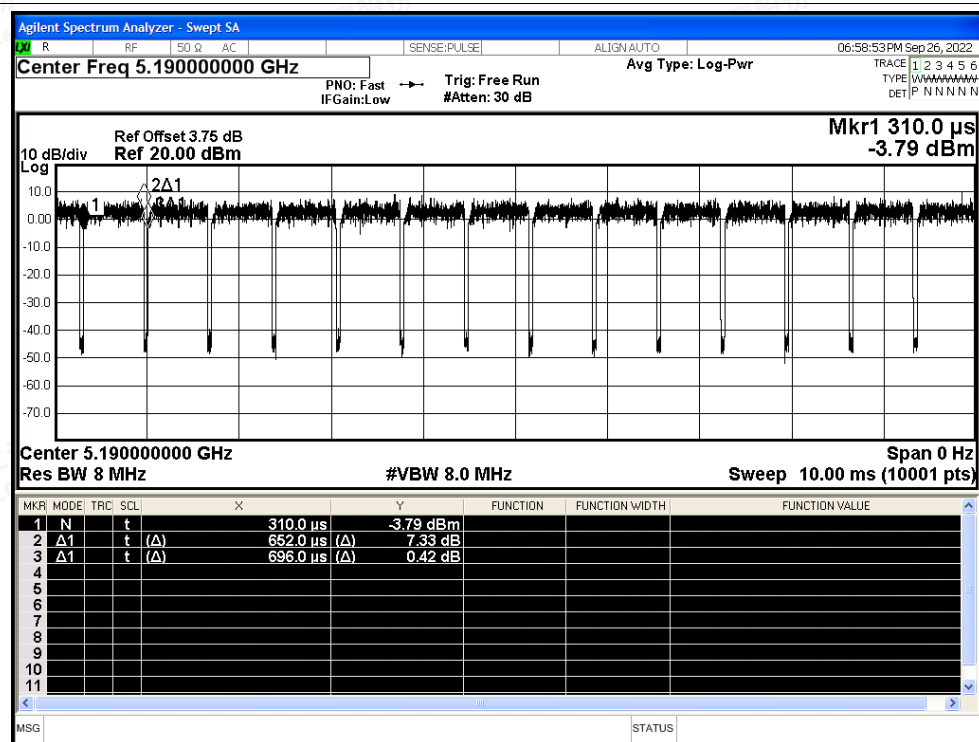




Duty Cycle NVNT ax40 5230MHz Ant0

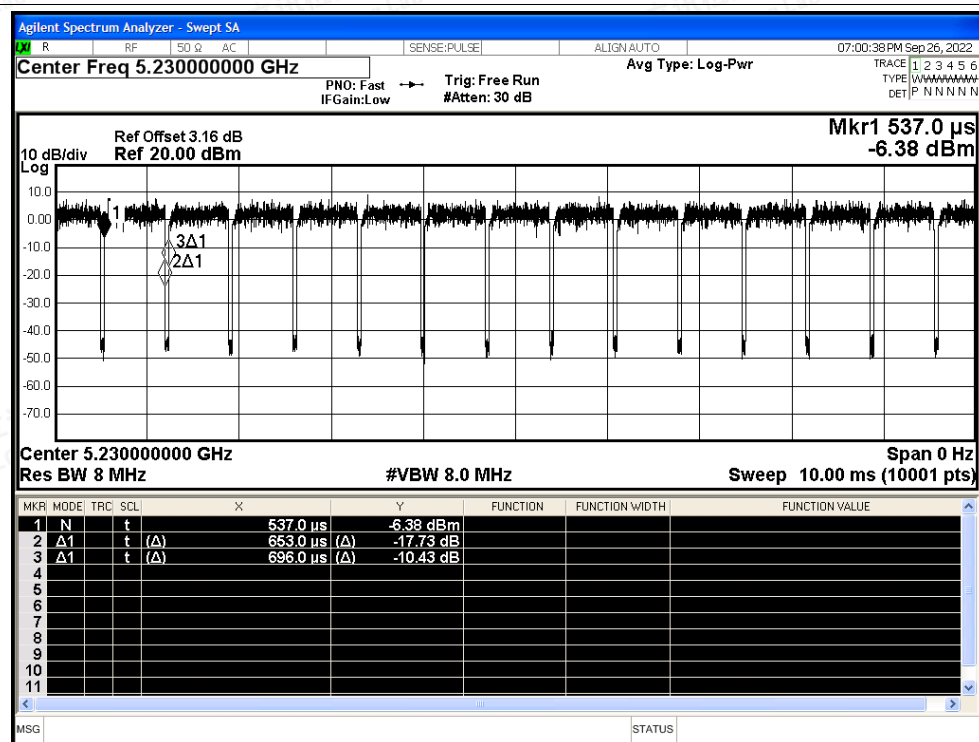

Duty Cycle NVNT ax80 5210MHz Ant0

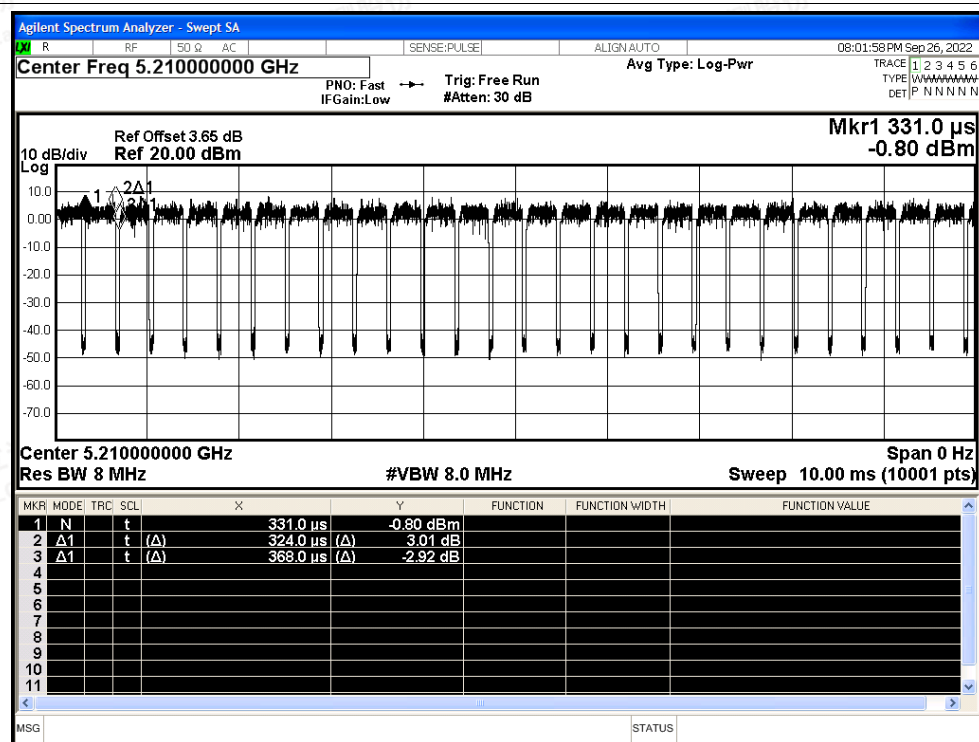



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	96.94	0.13	0.72
NVNT	a	5200	Ant1	96.94	0.13	0.72
NVNT	a	5240	Ant1	96.87	0.14	0.72
NVNT	n20	5180	Ant1	96.65	0.15	0.77
NVNT	n20	5200	Ant1	96.73	0.14	0.77
NVNT	n20	5240	Ant1	96.65	0.15	0.77
NVNT	n40	5190	Ant1	93.64	0.29	1.54
NVNT	n40	5230	Ant1	93.79	0.28	1.54
NVNT	ac20	5180	Ant1	96.68	0.15	0.76
NVNT	ac20	5200	Ant1	96.76	0.14	0.76
NVNT	ac20	5240	Ant1	96.76	0.14	0.76
NVNT	ac40	5190	Ant1	93.82	0.28	1.53
NVNT	ac40	5230	Ant1	93.68	0.28	1.53
NVNT	ac80	5210	Ant1	88.08	0.55	3.08
NVNT	ax20	5180	Ant1	96.76	0.14	0.76
NVNT	ax20	5200	Ant1	96.76	0.14	0.76
NVNT	ax20	5240	Ant1	96.68	0.15	0.76
NVNT	ax40	5190	Ant1	93.68	0.28	1.53
NVNT	ax40	5230	Ant1	99.73	0	0.01
NVNT	ax80	5210	Ant1	88.08	0.55	3.08




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

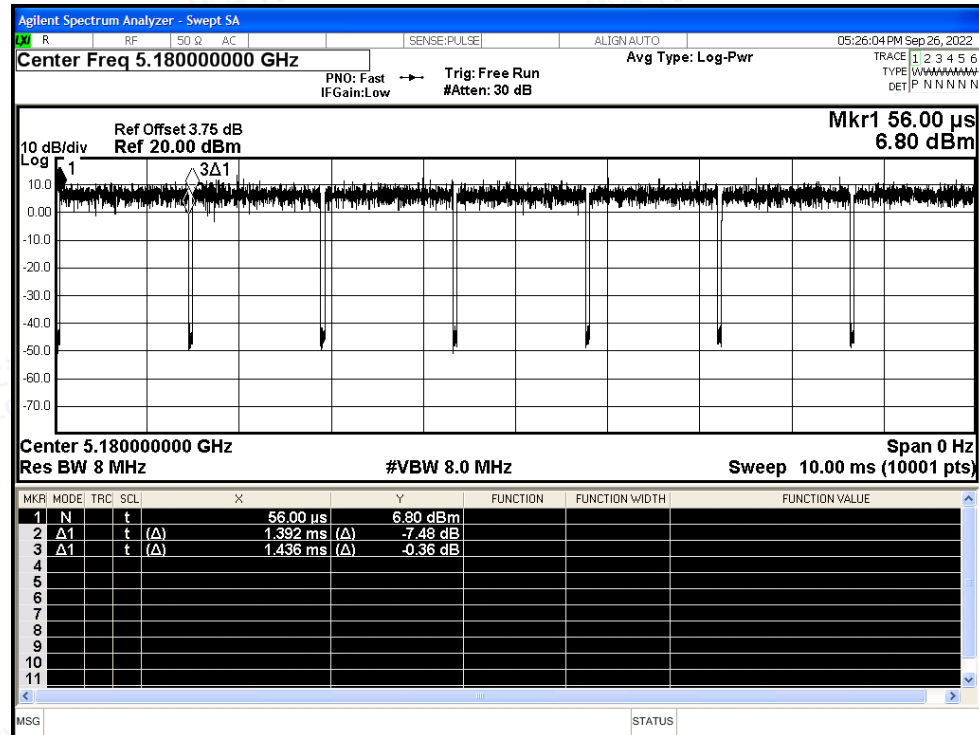

Duty Cycle NVNT a 5200MHz Ant1

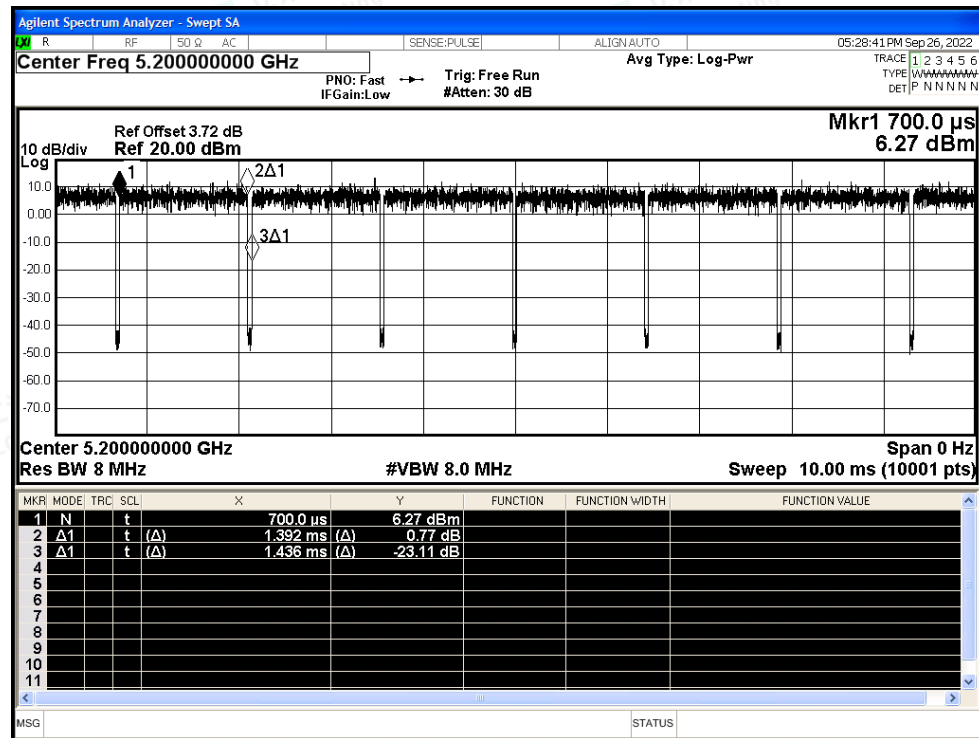

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

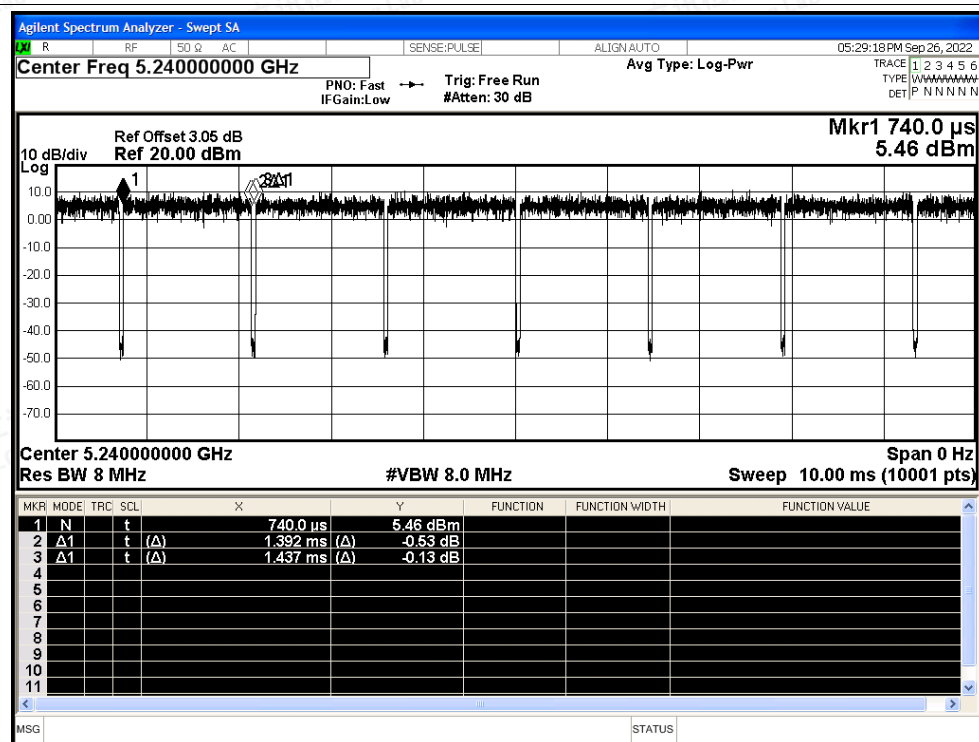


Duty Cycle NVNT n20 5180MHz Ant1

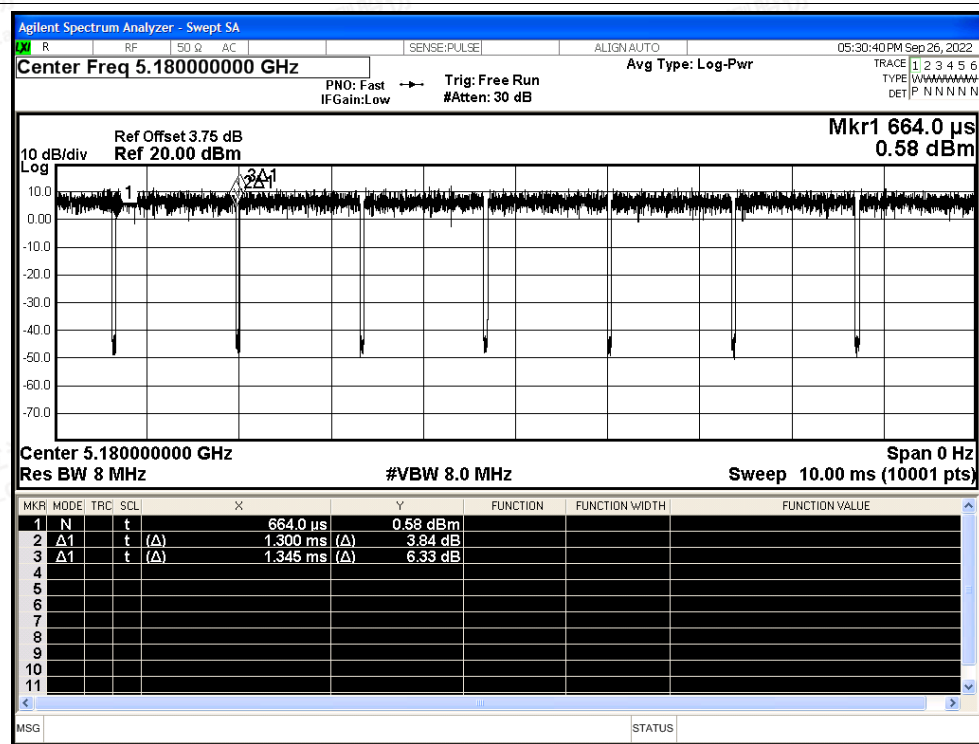




Duty Cycle NVNT n20 5200MHz Ant1

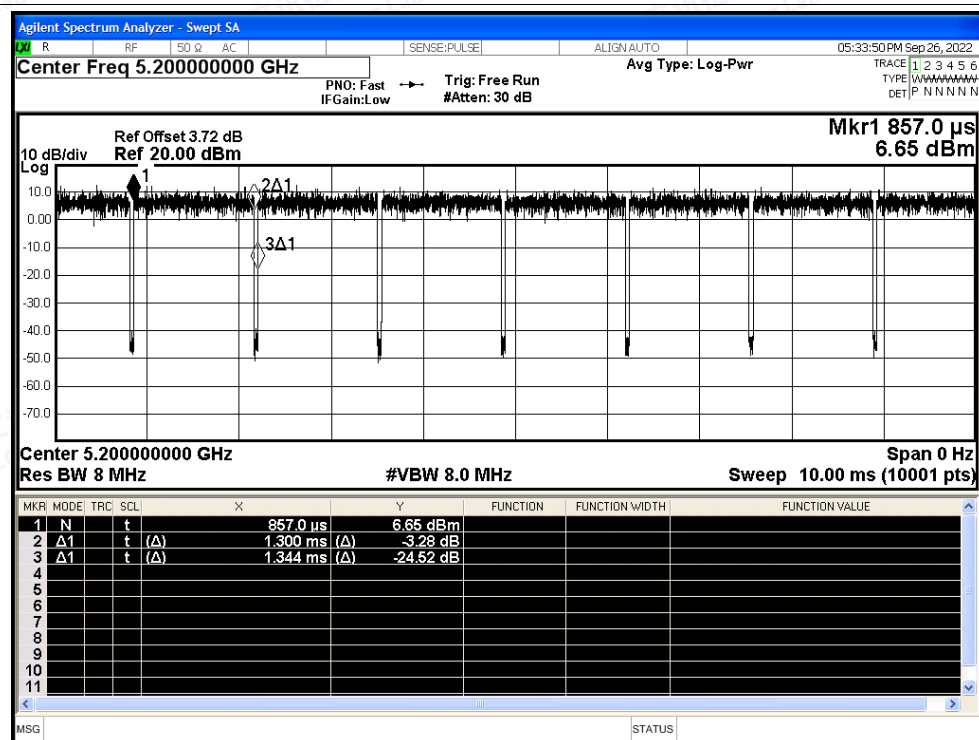


Duty Cycle NVNT n20 5240MHz Ant1

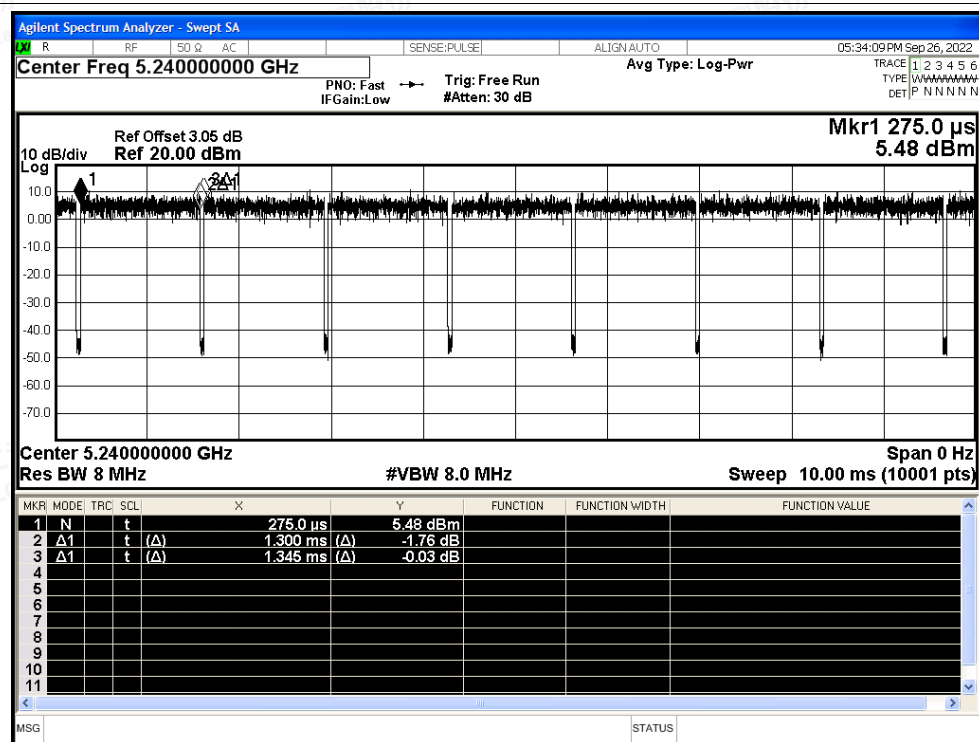




Duty Cycle NVNT n40 5190MHz Ant1

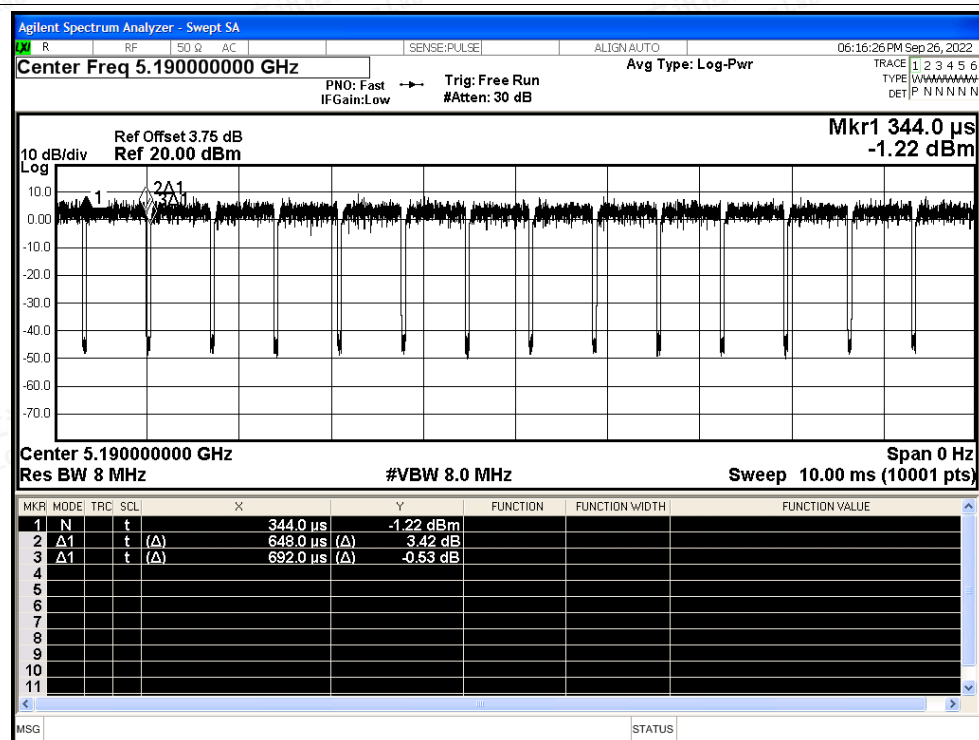


Duty Cycle NVNT n40 5230MHz Ant1

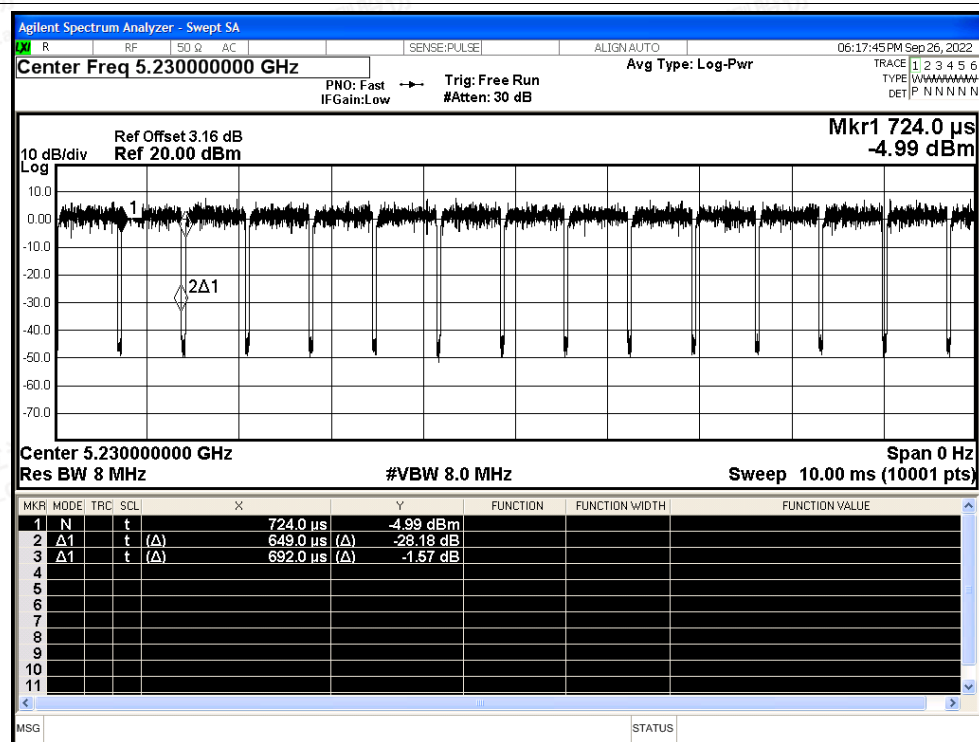




Duty Cycle NVNT ac20 5180MHz Ant1

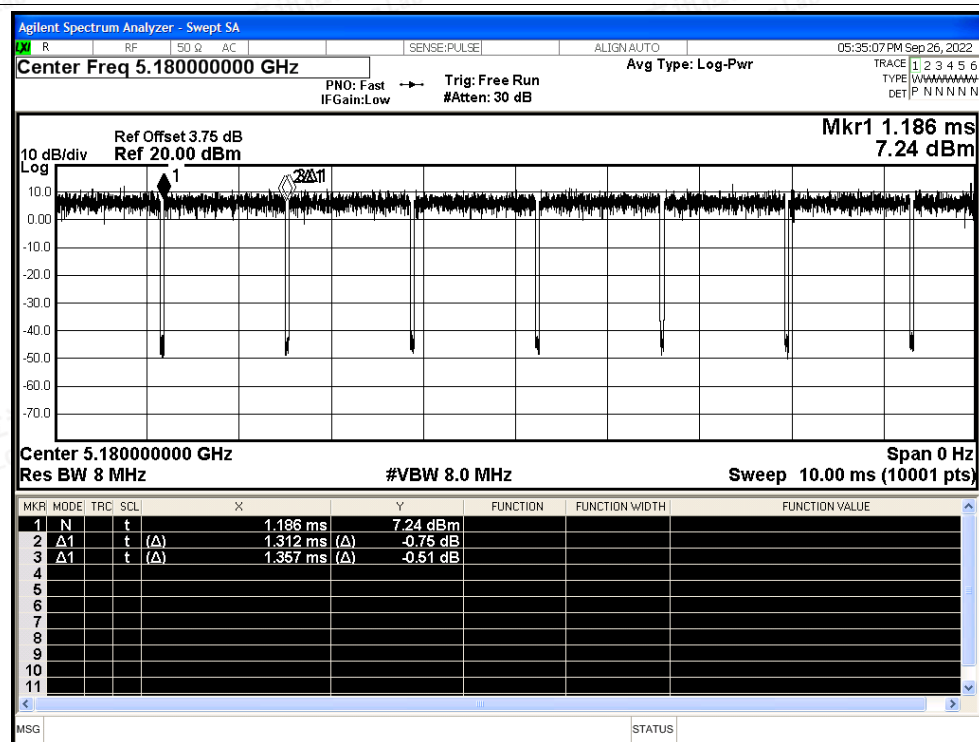


Duty Cycle NVNT ac20 5200MHz Ant1

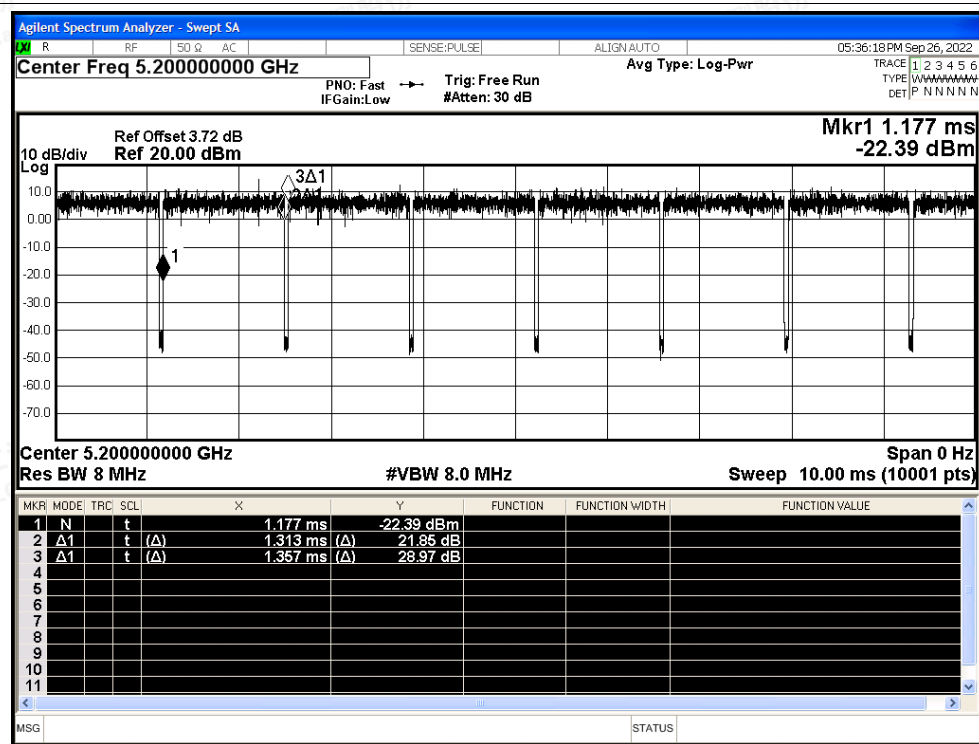




Duty Cycle NVNT ac20 5240MHz Ant1

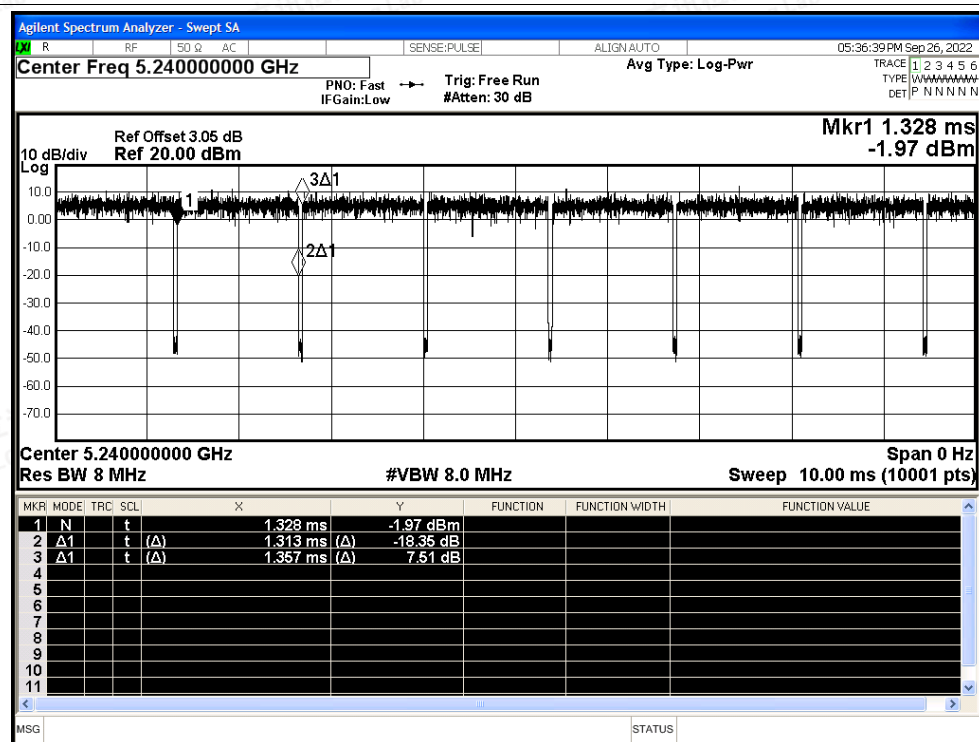


Duty Cycle NVNT ac40 5190MHz Ant1

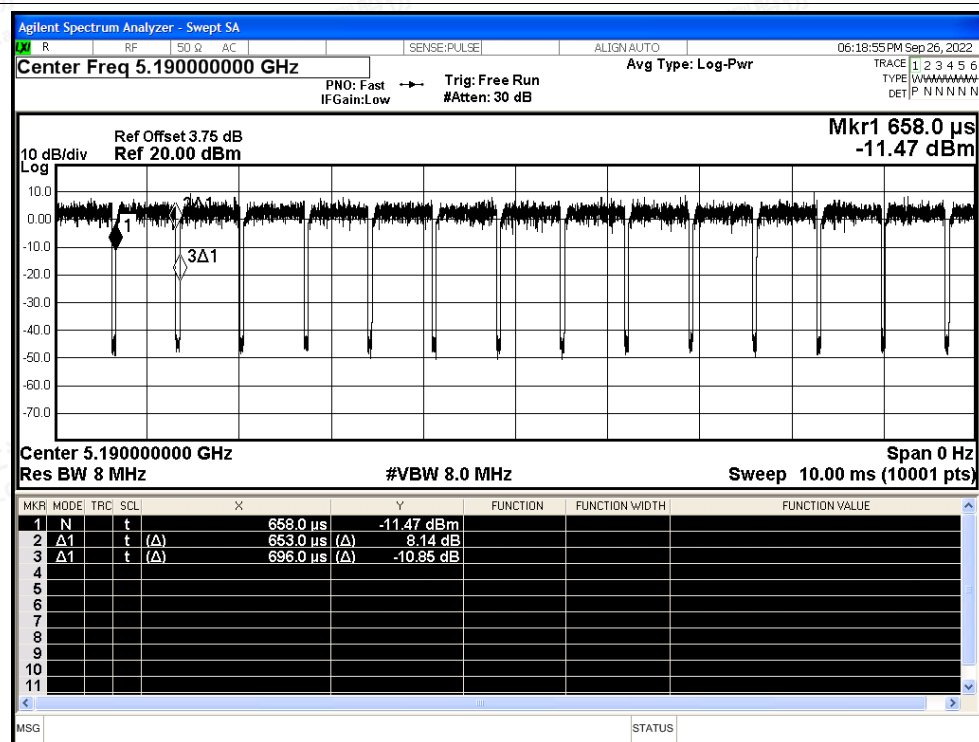




Duty Cycle NVNT ac40 5230MHz Ant1

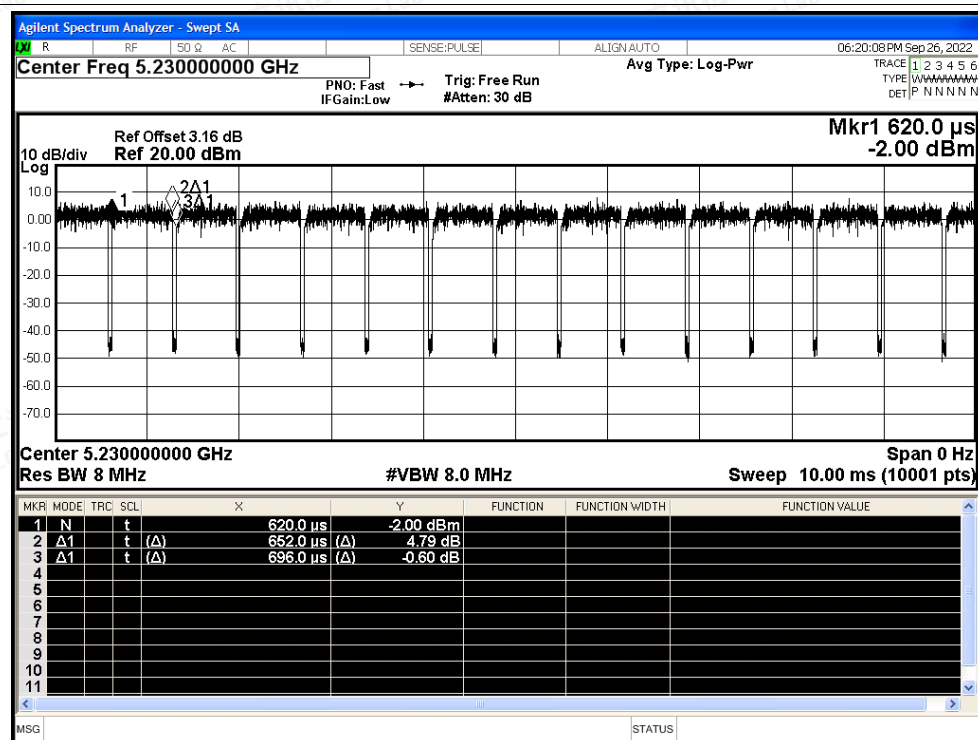


Duty Cycle NVNT ac80 5210MHz Ant1

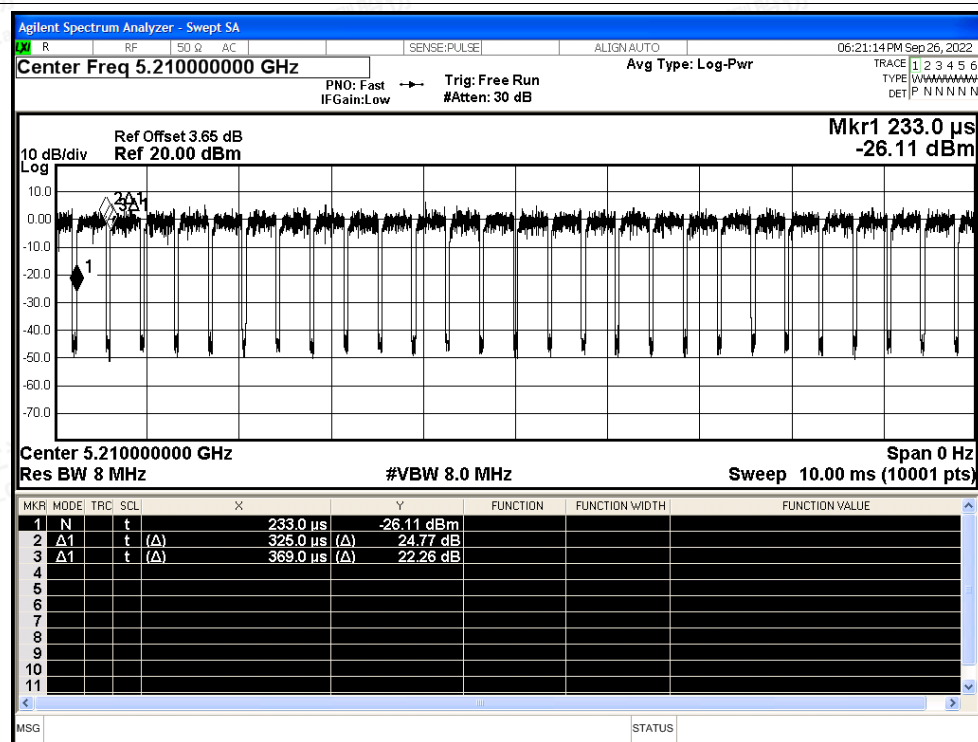




Duty Cycle NVNT ax20 5180MHz Ant1

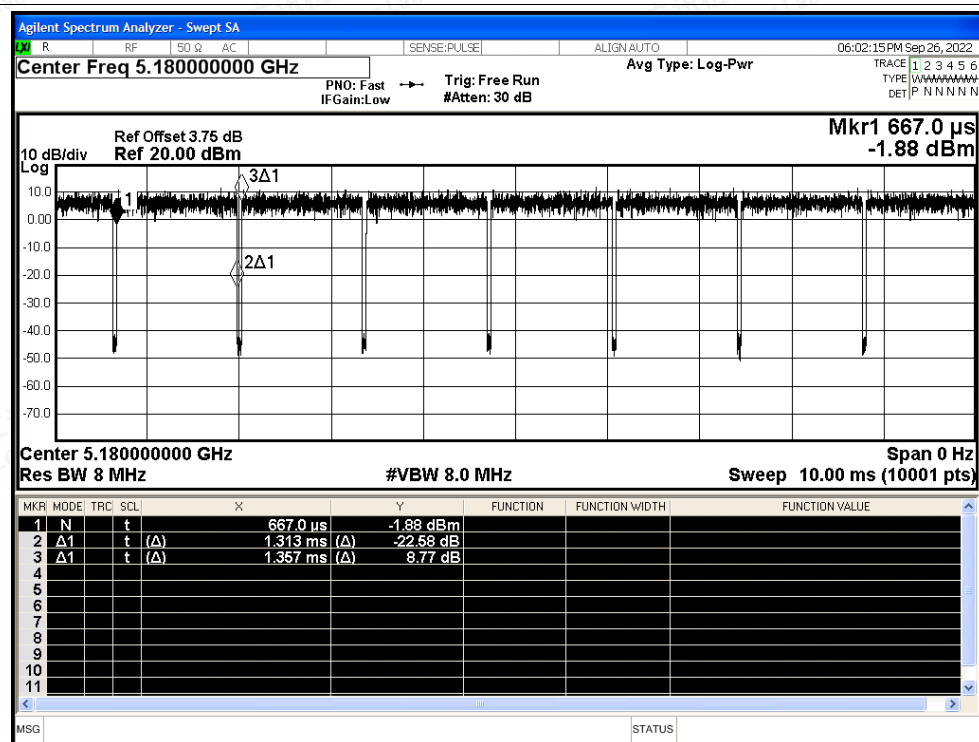


Duty Cycle NVNT ax20 5200MHz Ant1

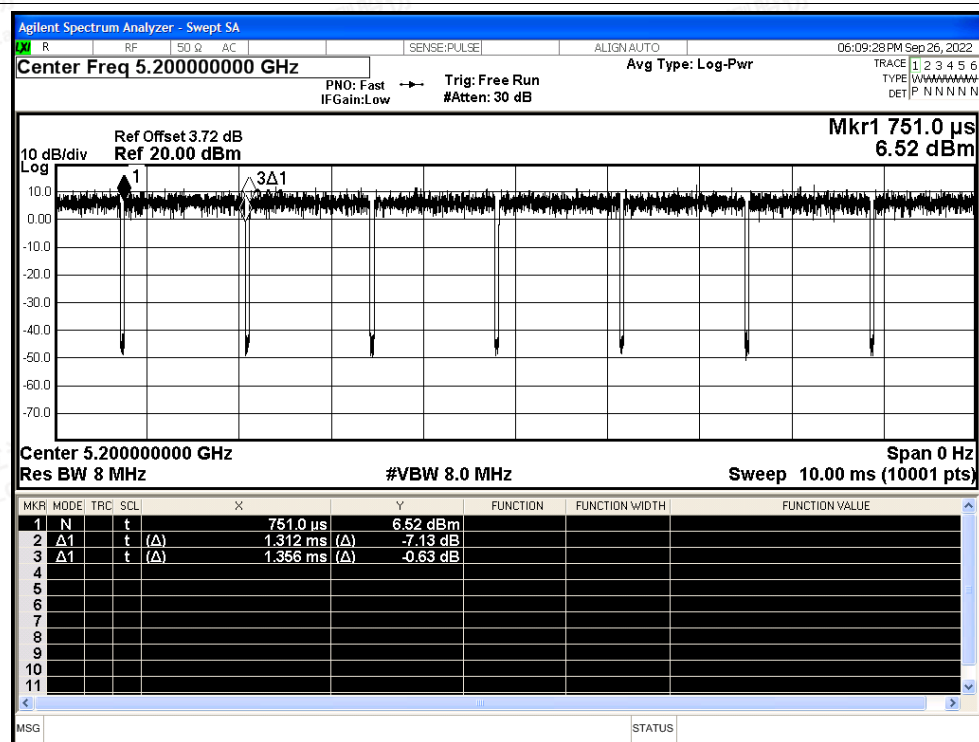




Duty Cycle NVNT ax20 5240MHz Ant1

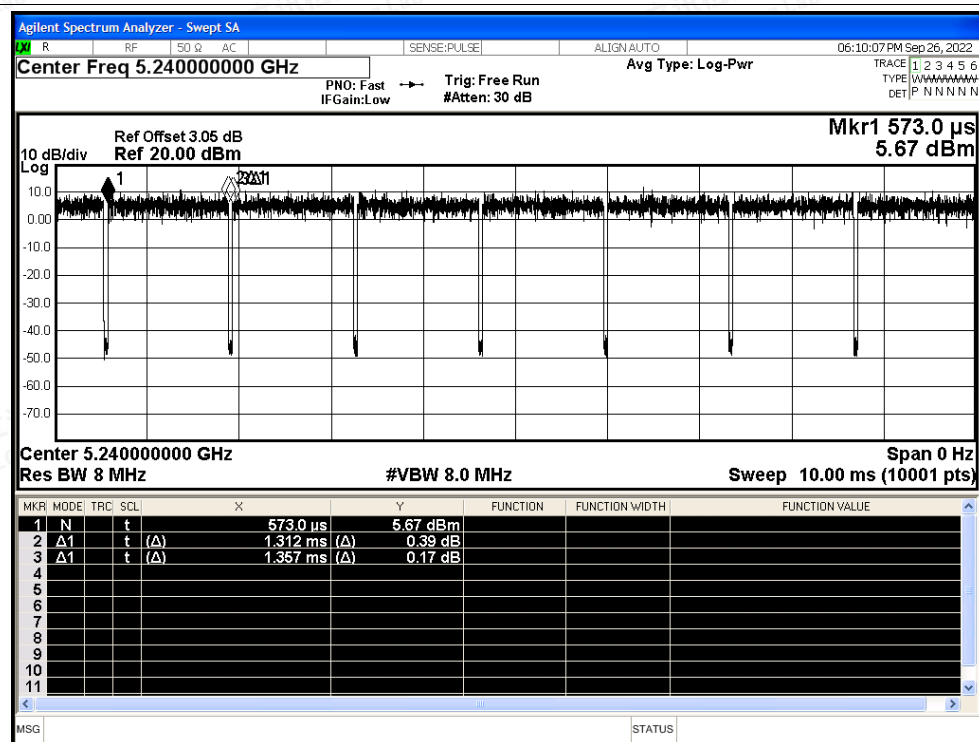


Duty Cycle NVNT ax40 5190MHz Ant1

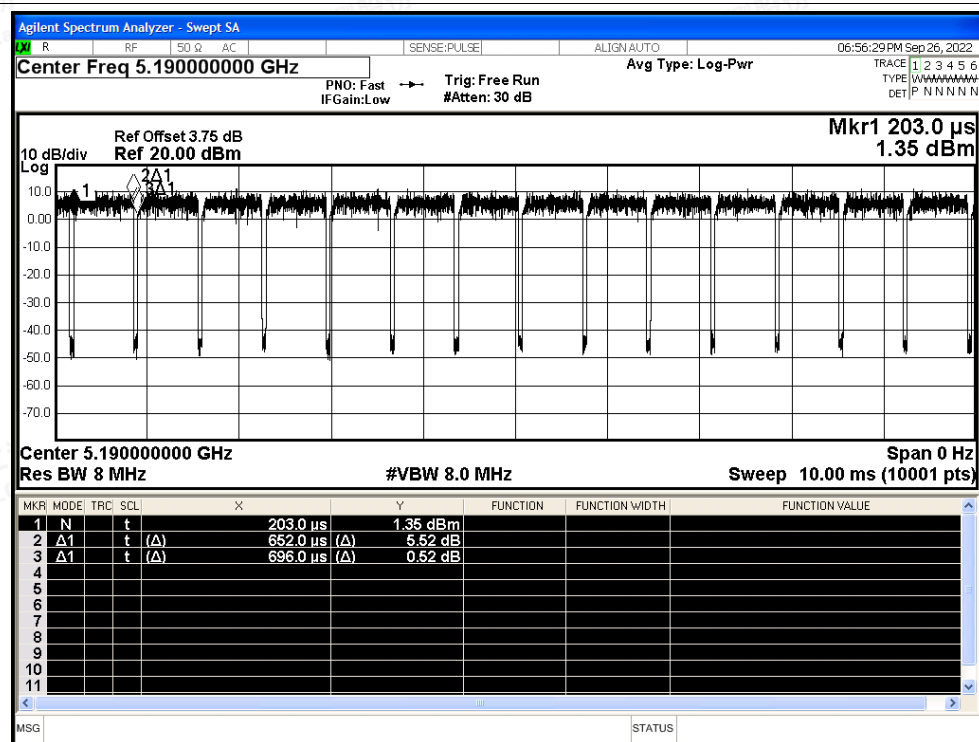



Duty Cycle NVNT ax40 5230MHz Ant1

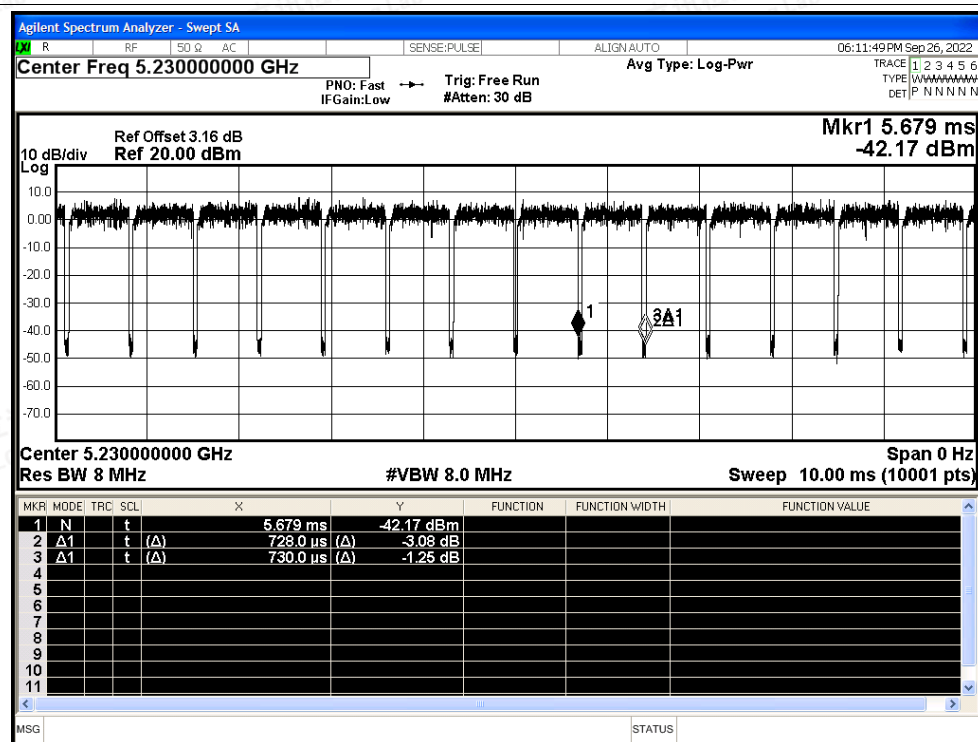

Duty Cycle NVNT ax80 5210MHz Ant1

