



Appendix E

RF Test Data for 5.5GWIFI (Conducted Measurement)

Product Name: Tablet computer

Test Model: IST-10

Environmental Conditions

Temperature:	23.8° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



E.1 -26dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Limit -26 dB Bandwidth (MHz)	Verdict
NVNT	a	5500	Ant1	28.433	≥ 0.5	Pass
NVNT	a	5580	Ant1	29.366	≥ 0.5	Pass
NVNT	a	5700	Ant1	29.969	≥ 0.5	Pass
NVNT	n20	5500	Ant1	29.518	≥ 0.5	Pass
NVNT	n20	5580	Ant1	29	≥ 0.5	Pass
NVNT	n20	5700	Ant1	28.278	≥ 0.5	Pass
NVNT	n40	5510	Ant1	45.852	≥ 0.5	Pass
NVNT	n40	5550	Ant1	45.22	≥ 0.5	Pass
NVNT	n40	5670	Ant1	41.383	≥ 0.5	Pass
NVNT	ac20	5500	Ant1	28.384	≥ 0.5	Pass
NVNT	ac20	5580	Ant1	28.333	≥ 0.5	Pass
NVNT	ac20	5700	Ant1	29.514	≥ 0.5	Pass
NVNT	ac40	5510	Ant1	44.67	≥ 0.5	Pass
NVNT	ac40	5550	Ant1	40.308	≥ 0.5	Pass
NVNT	ac40	5670	Ant1	43.89	≥ 0.5	Pass
NVNT	ac80	5530	Ant1	81.591	≥ 0.5	Pass
NVNT	ac80	5610	Ant1	78.317	≥ 0.5	Pass






Test Graphs

-26dB Bandwidth NVNT a 5500MHz Ant1

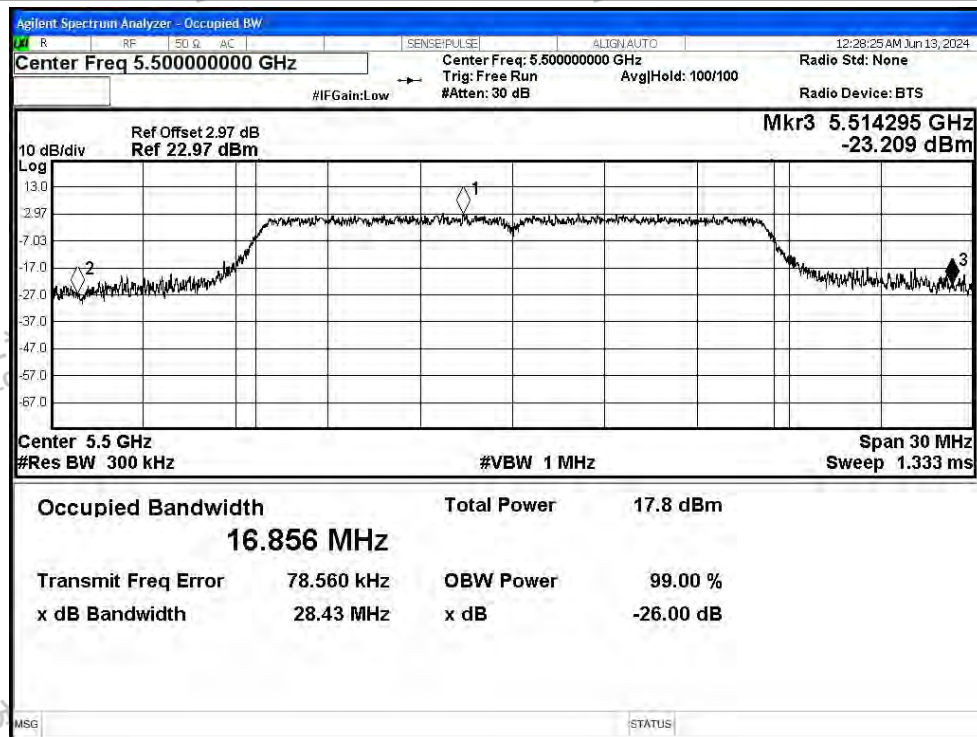

-26dB Bandwidth NVNT a 5580MHz Ant1

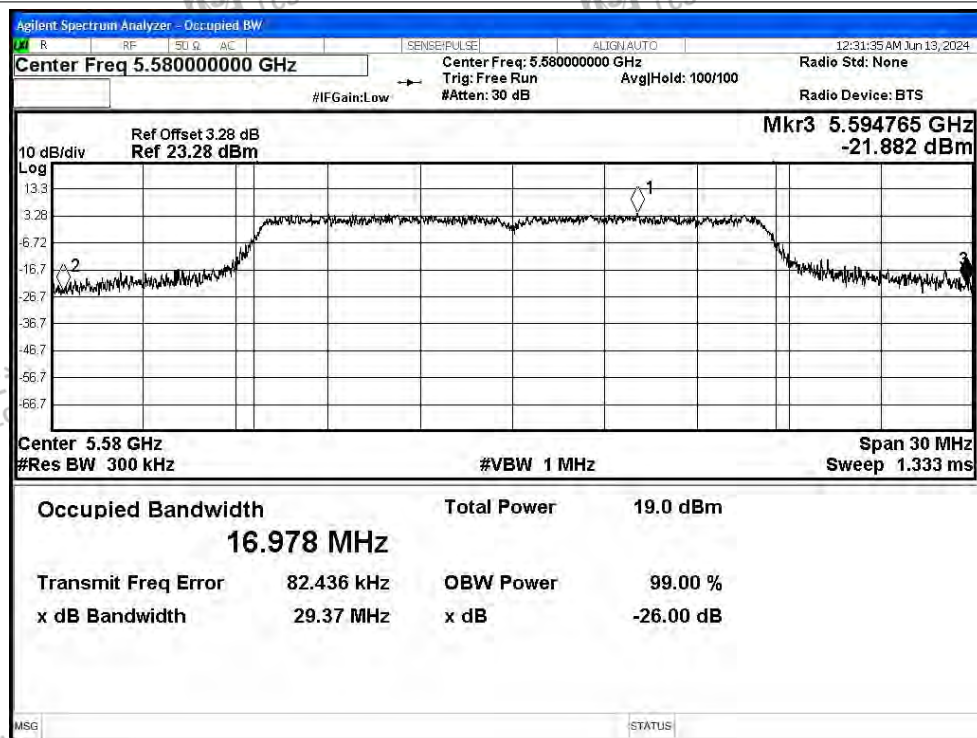

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT a 5700MHz Ant1

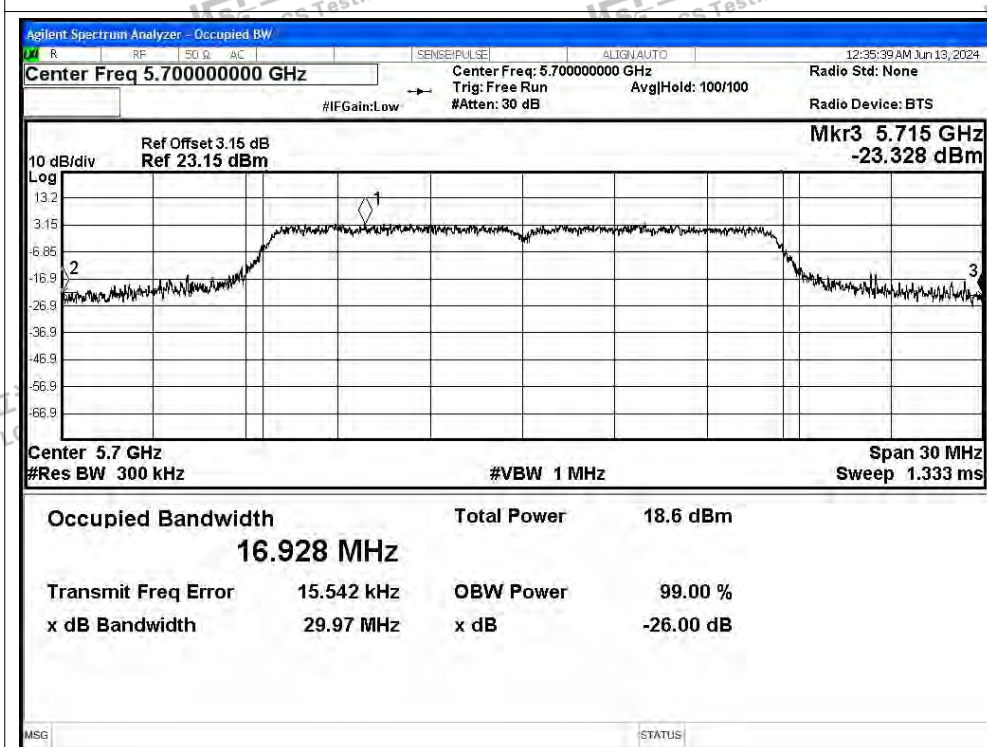

-26dB Bandwidth NVNT n20 5500MHz Ant1

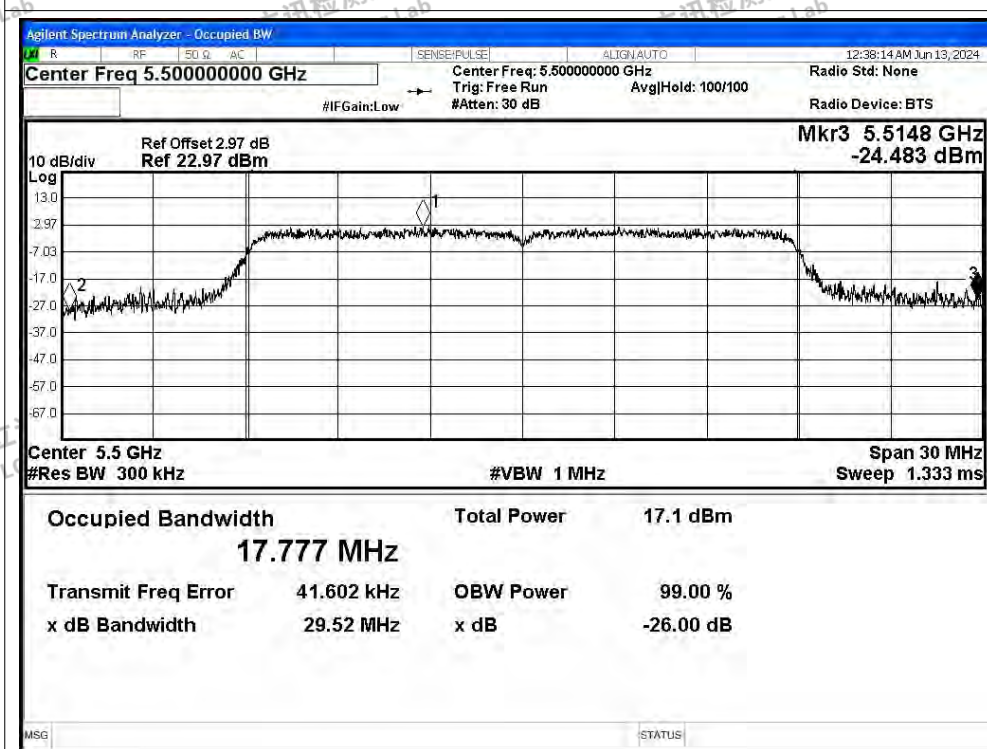

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n20 5580MHz Ant1

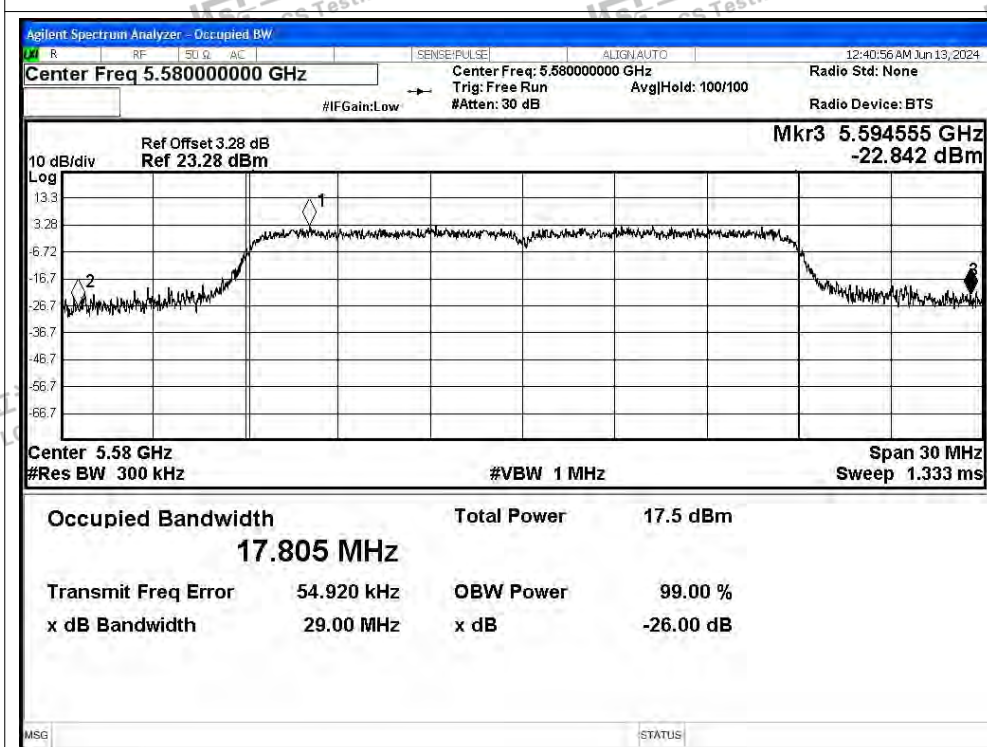

-26dB Bandwidth NVNT n20 5700MHz Ant1

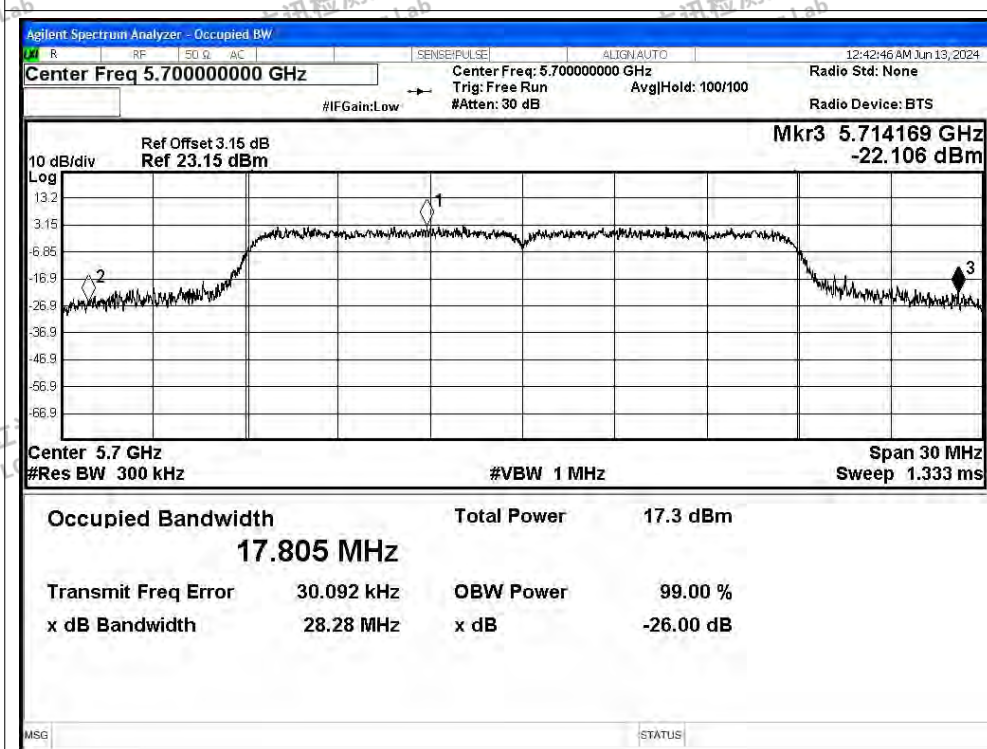

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n40 5510MHz Ant1

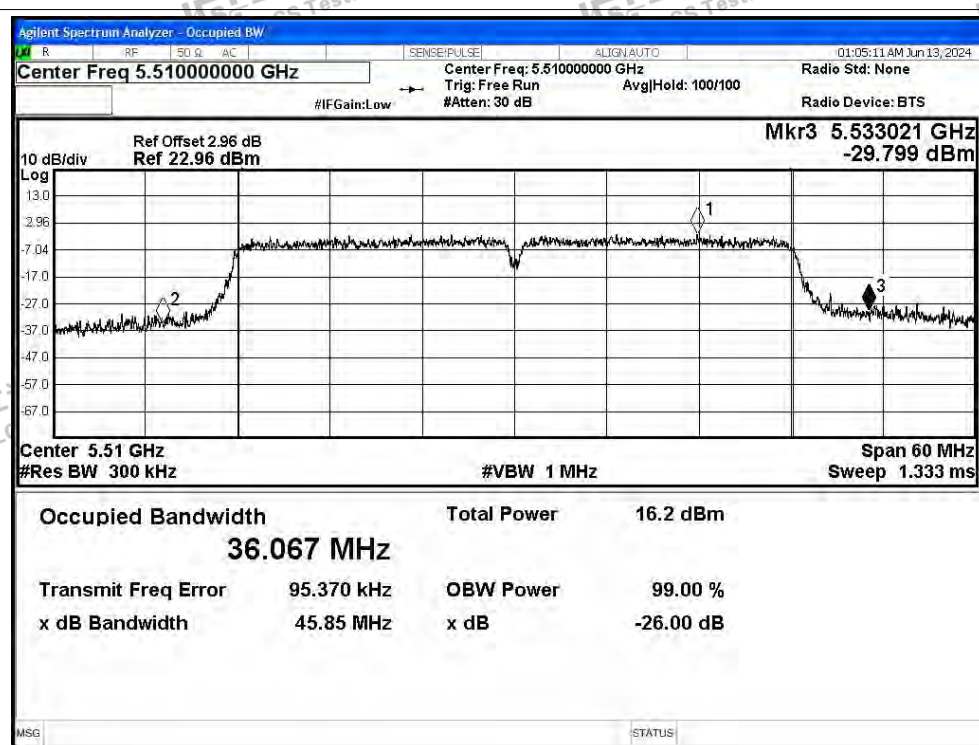

-26dB Bandwidth NVNT n40 5550MHz Ant1

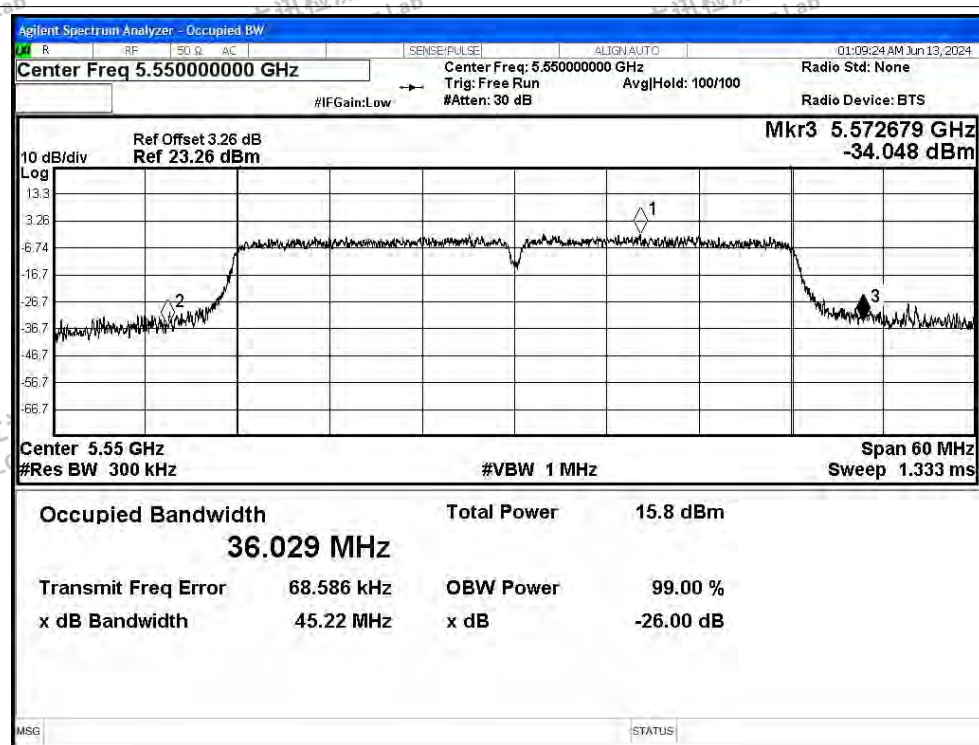

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT n40 5670MHz Ant1

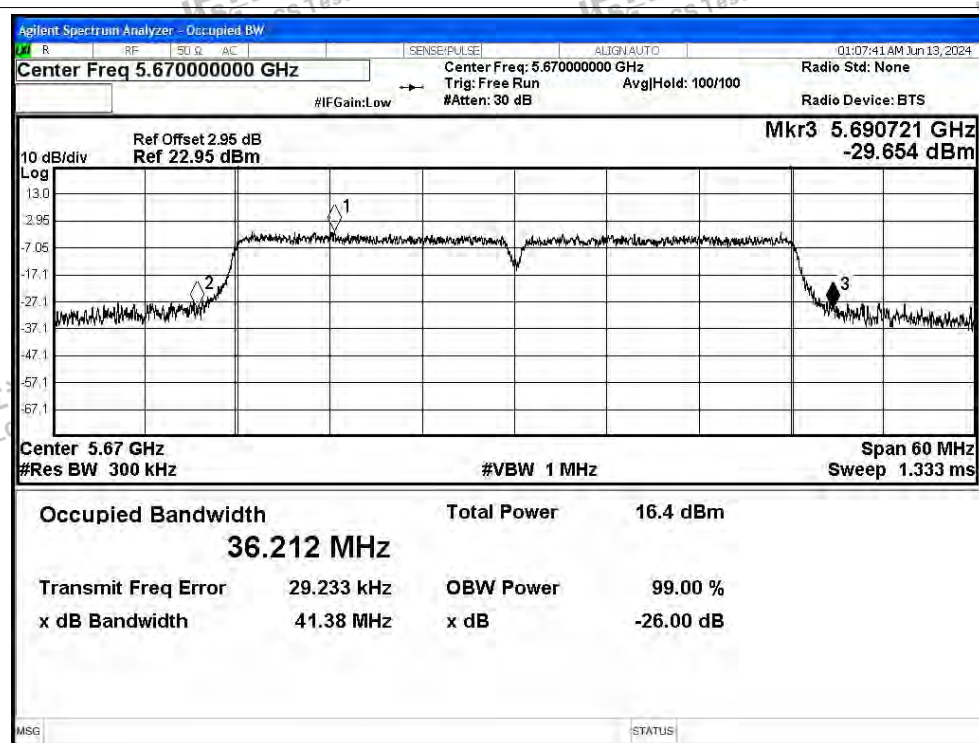

-26dB Bandwidth NVNT ac20 5500MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5580MHz Ant1

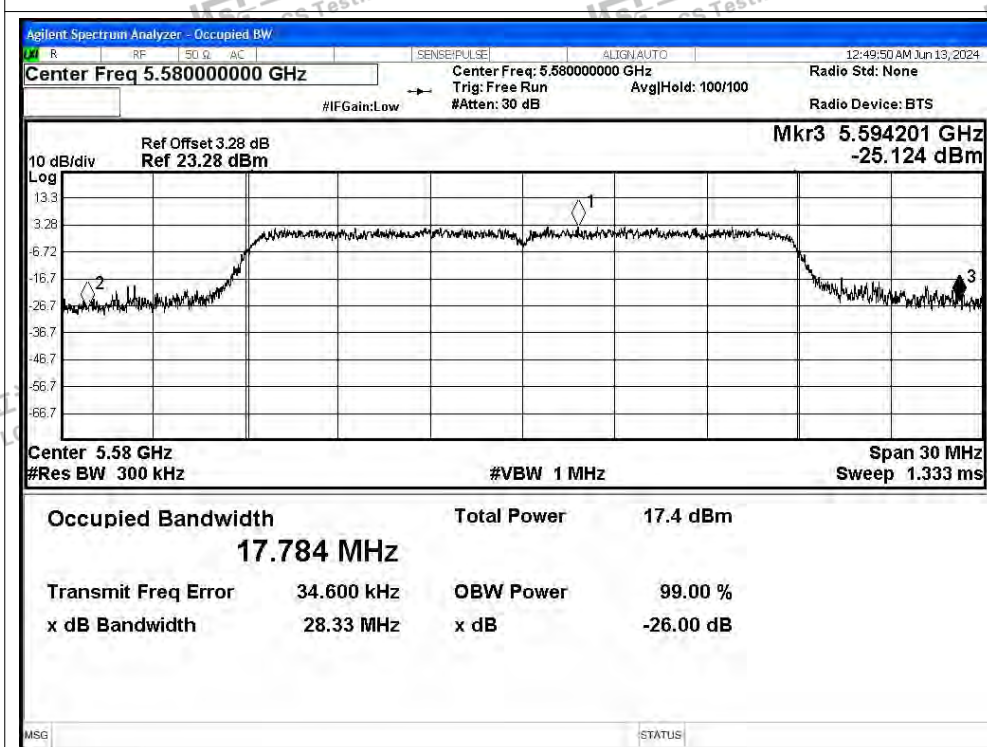

-26dB Bandwidth NVNT ac20 5700MHz Ant1

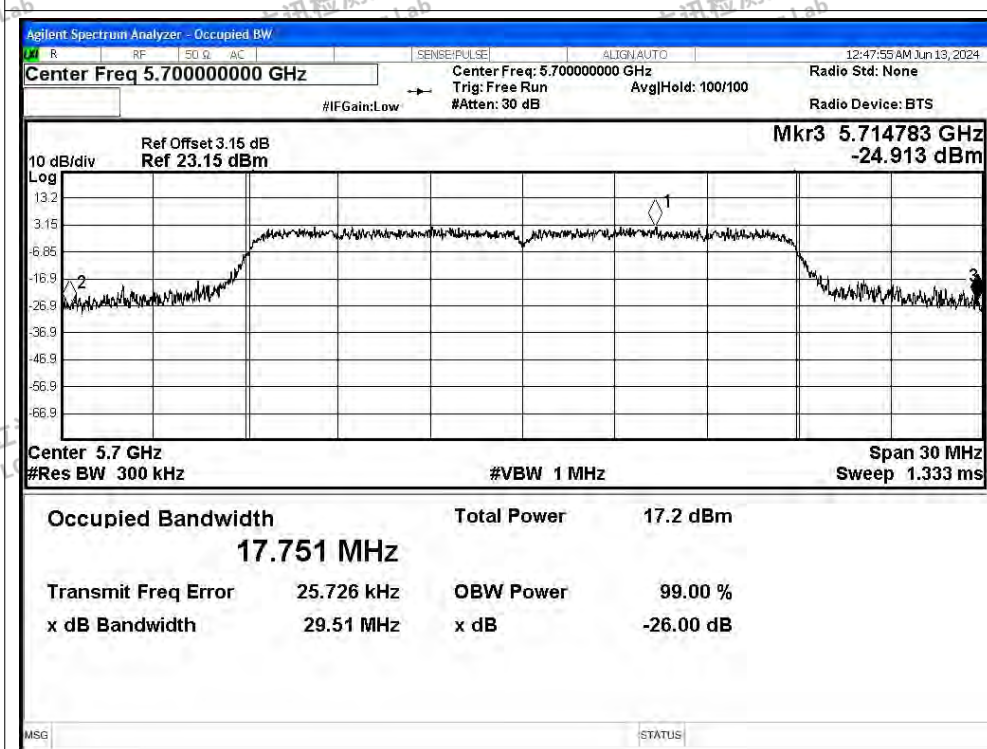

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5510MHz Ant1

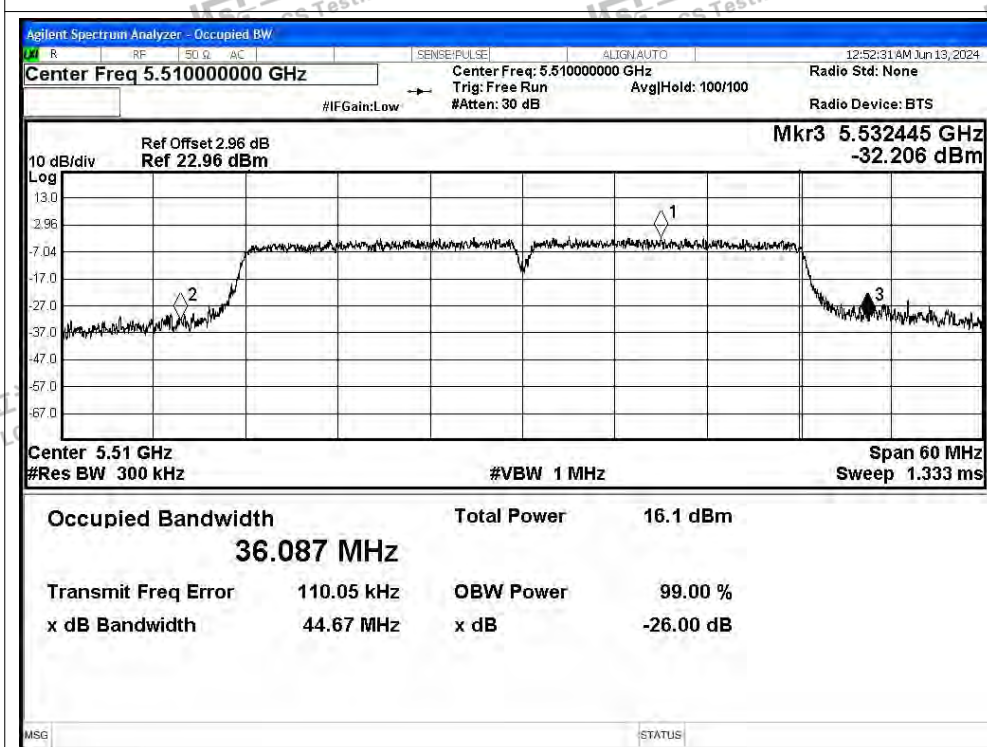

-26dB Bandwidth NVNT ac40 5550MHz Ant1

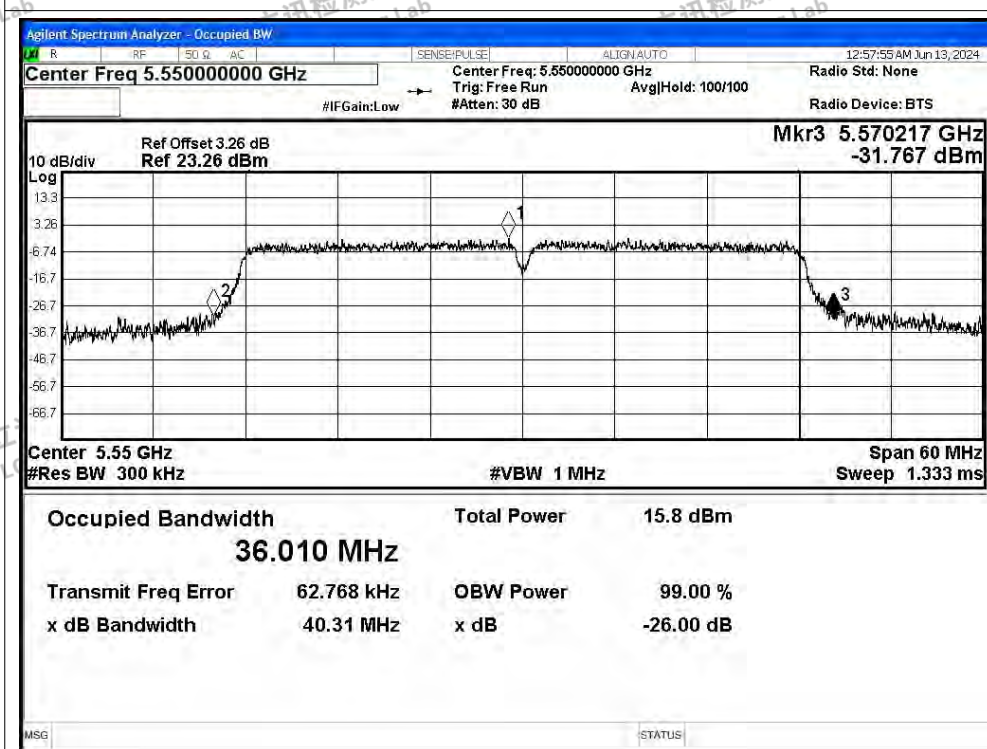

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5670MHz Ant1

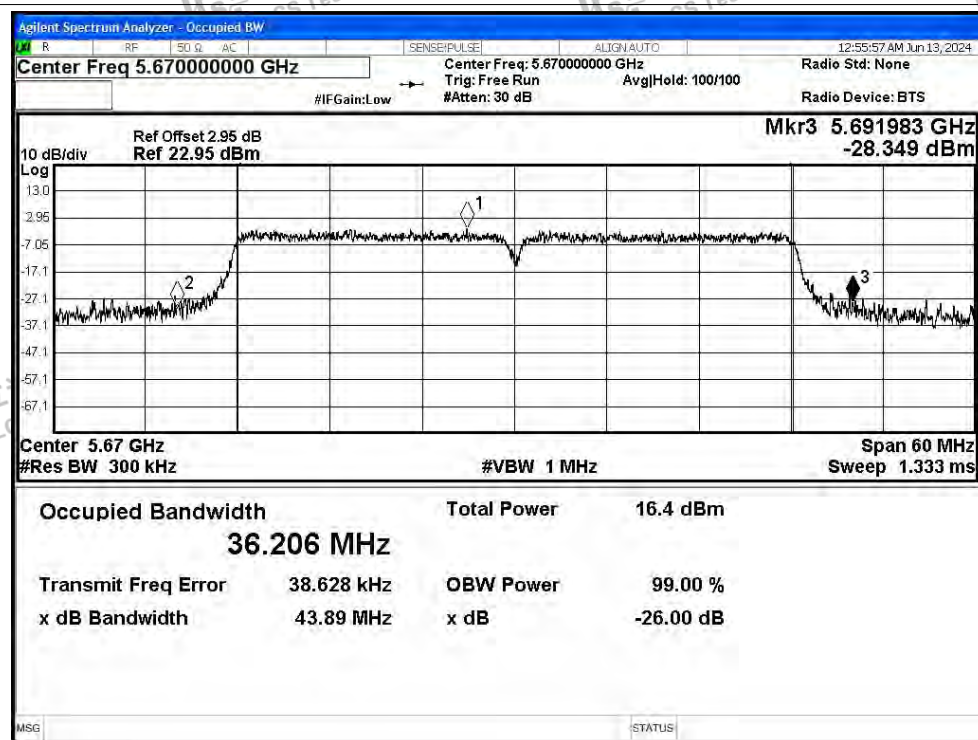

-26dB Bandwidth NVNT ac80 5530MHz Ant1

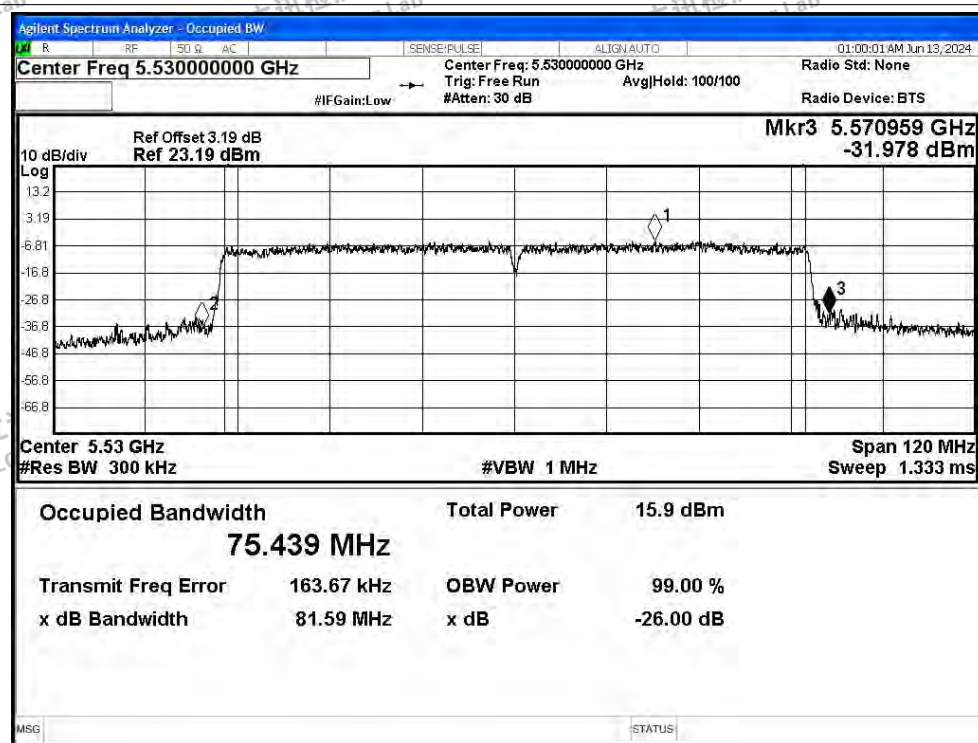

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT ac80 5610MHz Ant1

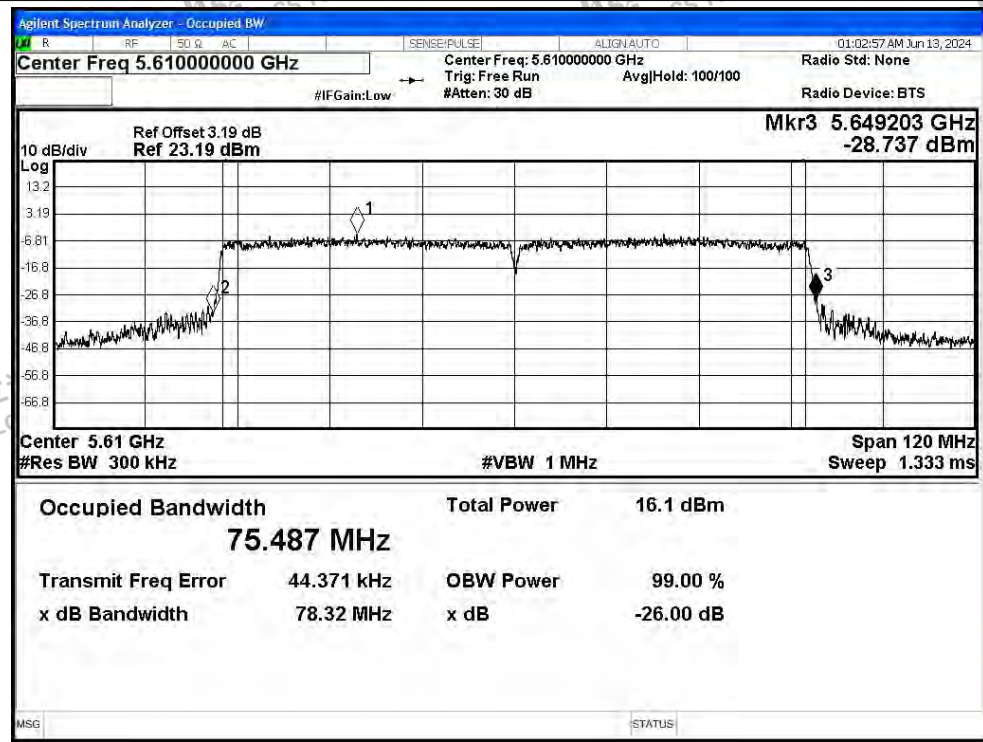

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5500	Ant1	12.11	0.19	12.3	24	Pass
NVNT	a	5580	Ant1	12.47	0.19	12.66	24	Pass
NVNT	a	5700	Ant1	12.84	0.2	13.04	24	Pass
NVNT	n20	5500	Ant1	11.57	0.23	11.8	24	Pass
NVNT	n20	5580	Ant1	11.88	0.23	12.11	24	Pass
NVNT	n20	5700	Ant1	11.5	0.23	11.73	24	Pass
NVNT	n40	5510	Ant1	10.42	0.23	10.65	24	Pass
NVNT	n40	5550	Ant1	10.13	0.24	10.37	24	Pass
NVNT	n40	5670	Ant1	10.72	0.24	10.96	24	Pass
NVNT	ac20	5500	Ant1	11.44	0.23	11.67	24	Pass
NVNT	ac20	5580	Ant1	11.8	0.23	12.03	24	Pass
NVNT	ac20	5700	Ant1	11.51	0.23	11.74	24	Pass
NVNT	ac40	5510	Ant1	10.34	0.23	10.57	24	Pass
NVNT	ac40	5550	Ant1	10.04	0.24	10.28	24	Pass
NVNT	ac40	5670	Ant1	10.59	0.24	10.83	24	Pass
NVNT	ac80	5530	Ant1	9.61	0.47	10.08	24	Pass
NVNT	ac80	5610	Ant1	9.65	0.47	10.12	24	Pass





E.3 Maximum Power Spectral Density Level


Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5500	Ant1	1.62	0.19	1.81	11	Pass
NVNT	a	5580	Ant1	1.9	0.19	2.09	11	Pass
NVNT	a	5700	Ant1	2.37	0.2	2.57	11	Pass
NVNT	n20	5500	Ant1	0.6	0.23	0.83	11	Pass
NVNT	n20	5580	Ant1	1.16	0.23	1.39	11	Pass
NVNT	n20	5700	Ant1	0.7	0.23	0.93	11	Pass
NVNT	n40	5510	Ant1	-3.12	0.23	-2.89	11	Pass
NVNT	n40	5550	Ant1	-3.41	0.24	-3.17	11	Pass
NVNT	n40	5670	Ant1	-2.15	0.24	-1.91	11	Pass
NVNT	ac20	5500	Ant1	0.69	0.23	0.92	11	Pass
NVNT	ac20	5580	Ant1	1.17	0.23	1.4	11	Pass
NVNT	ac20	5700	Ant1	0.88	0.23	1.11	11	Pass
NVNT	ac40	5510	Ant1	-3.31	0.23	-3.08	11	Pass
NVNT	ac40	5550	Ant1	-3.66	0.24	-3.42	11	Pass
NVNT	ac40	5670	Ant1	-2.9	0.24	-2.66	11	Pass
NVNT	ac80	5530	Ant1	-7.16	0.47	-6.69	11	Pass
NVNT	ac80	5610	Ant1	-7	0.47	-6.53	11	Pass






Test Graphs

PSD NVNT a 5500MHz Ant1

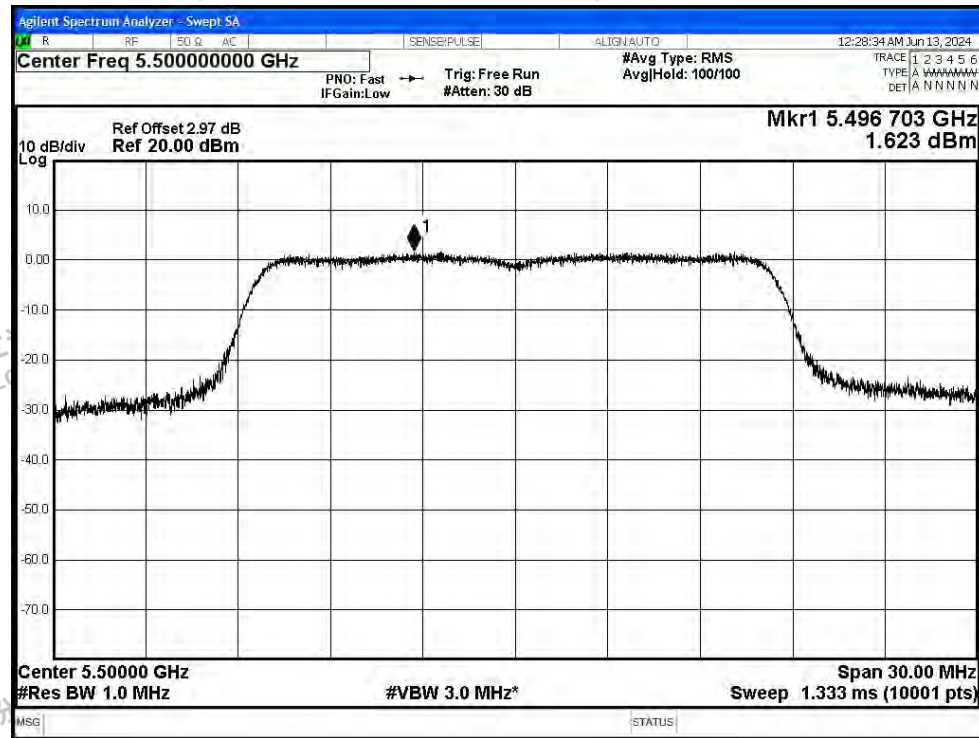

PSD NVNT a 5580MHz Ant1

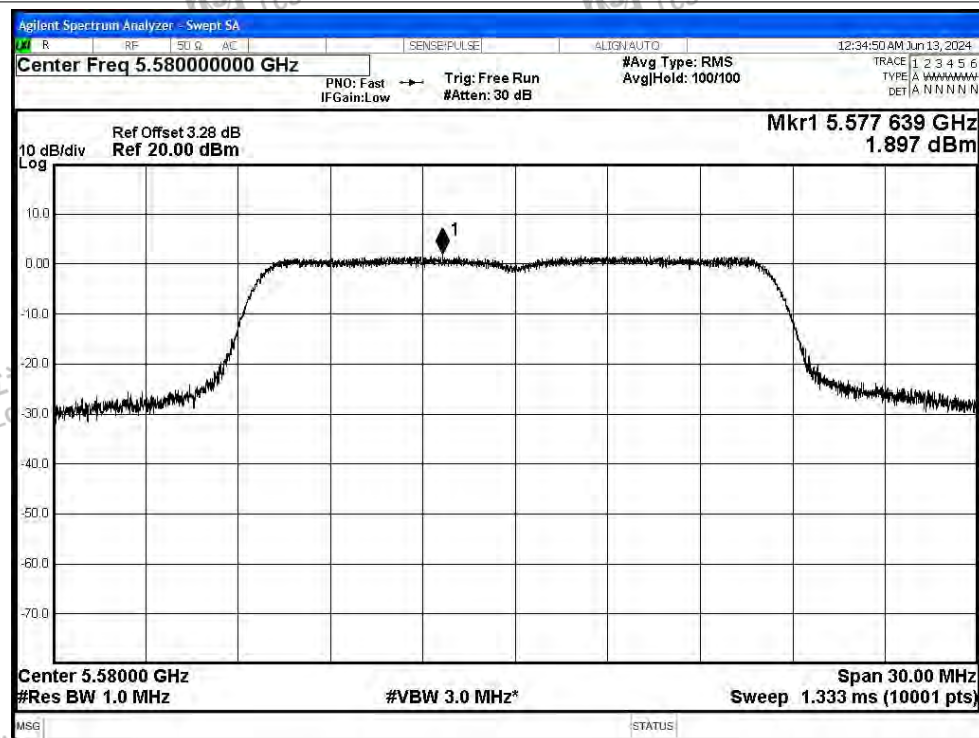

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5700MHz Ant1

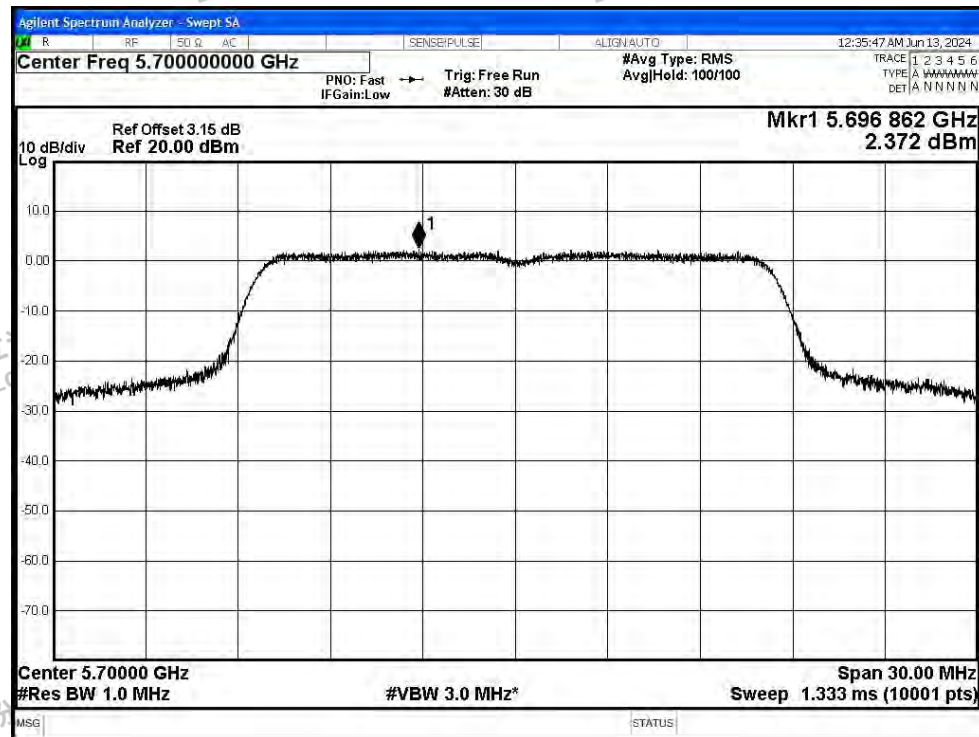

PSD NVNT n20 5500MHz Ant1

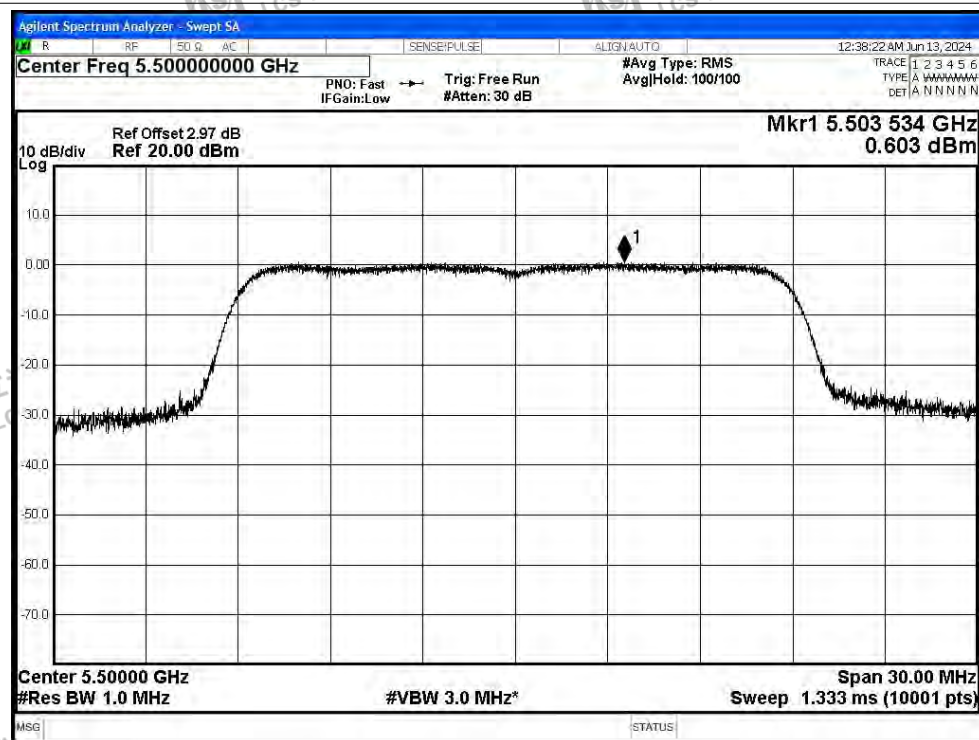

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT n20 5580MHz Ant1

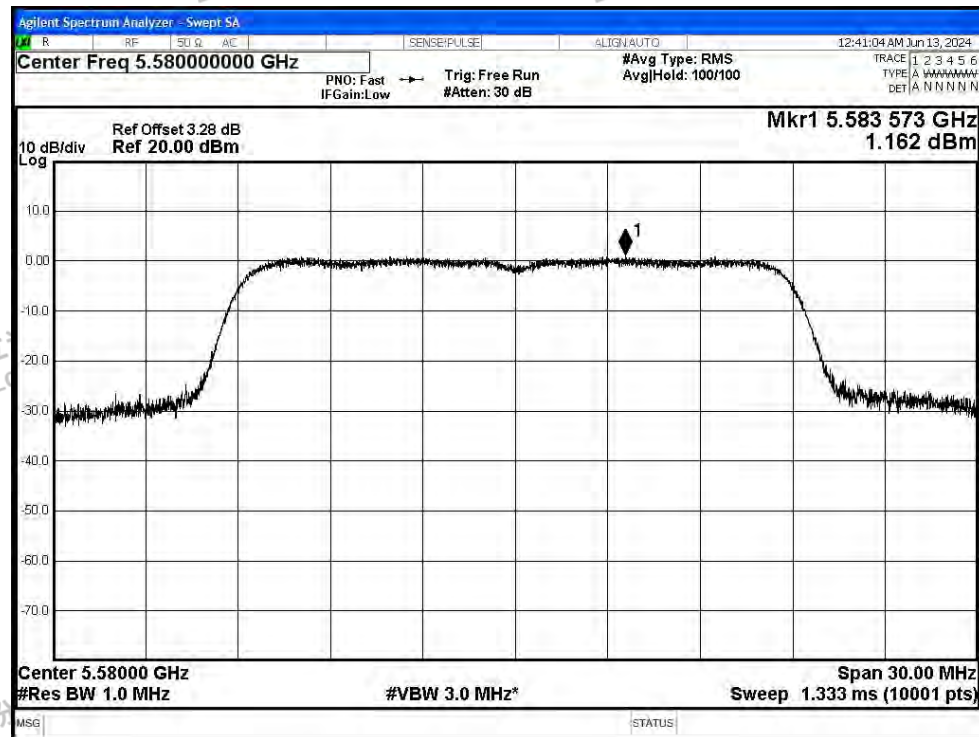

PSD NVNT n20 5700MHz Ant1


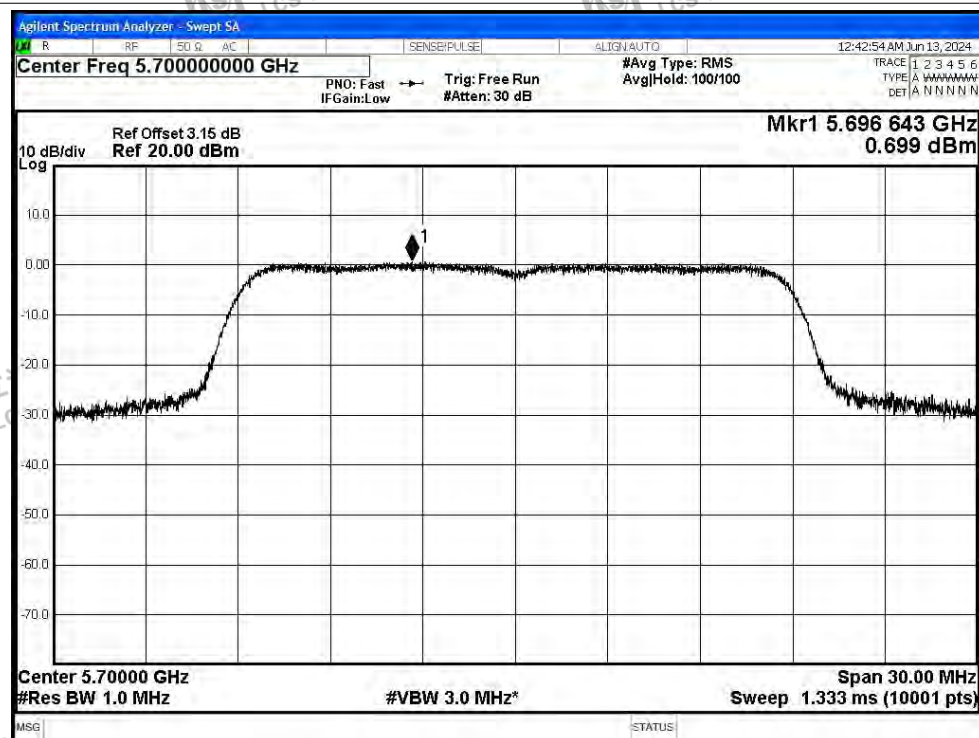


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

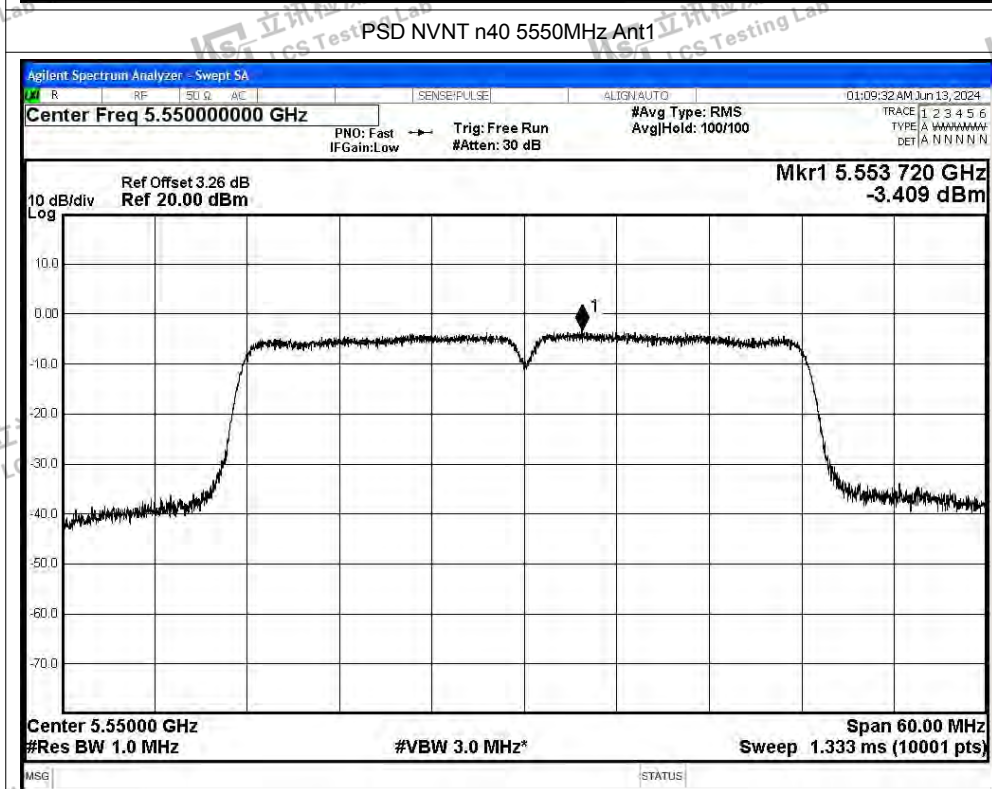
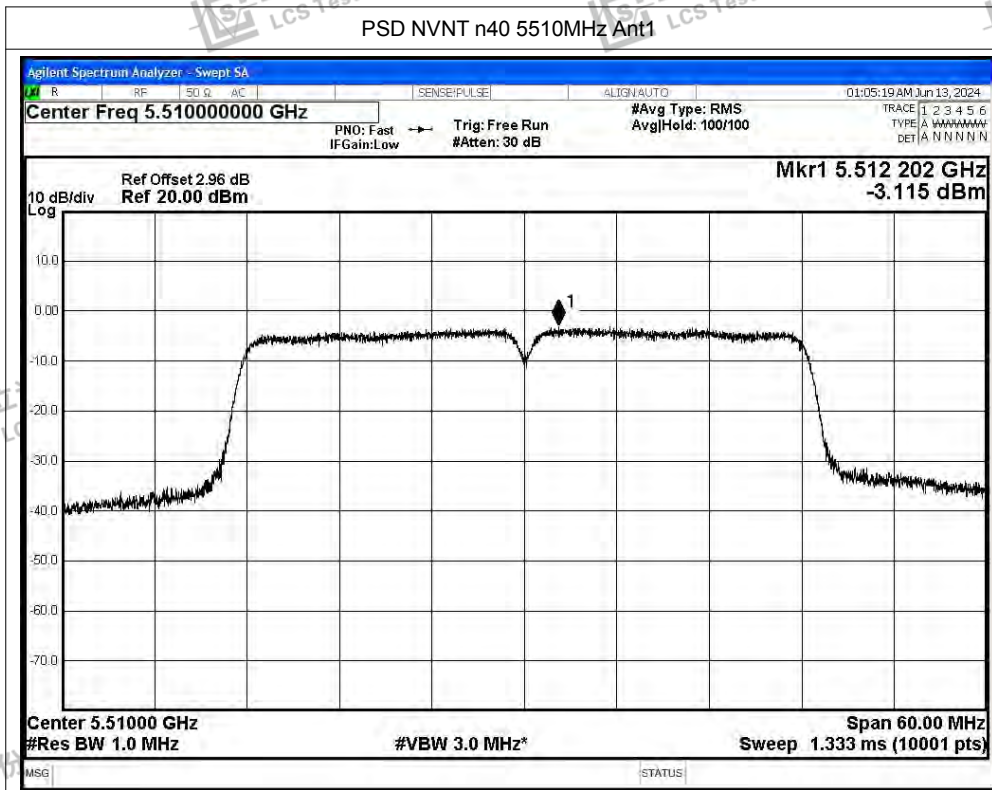


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

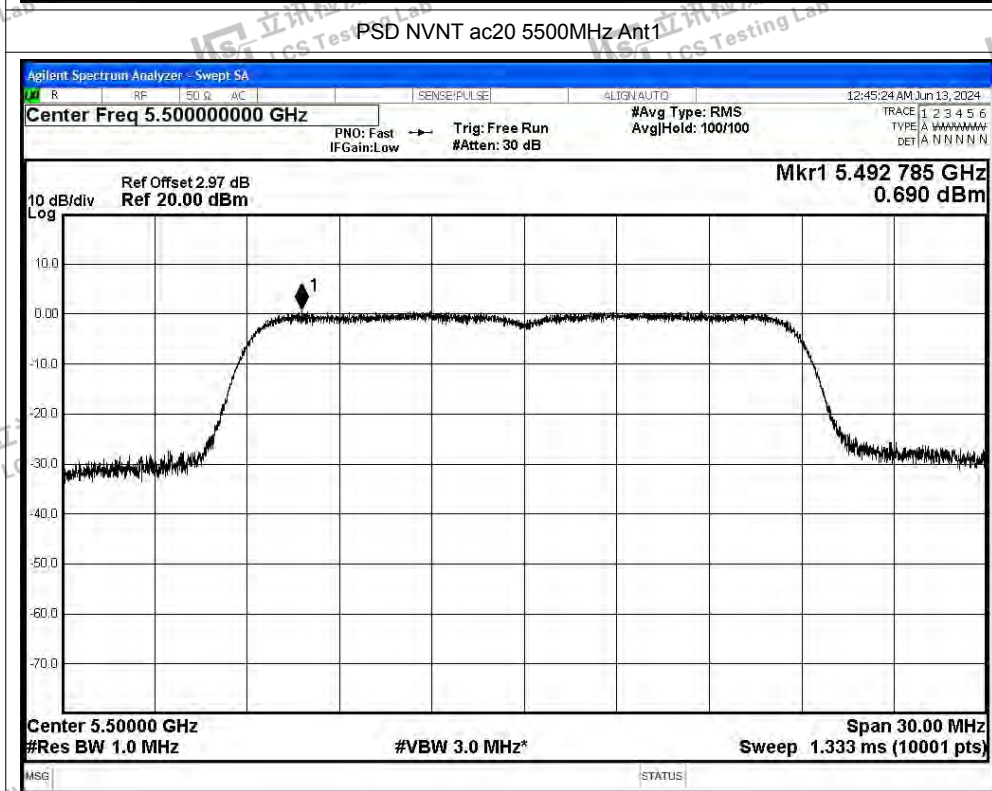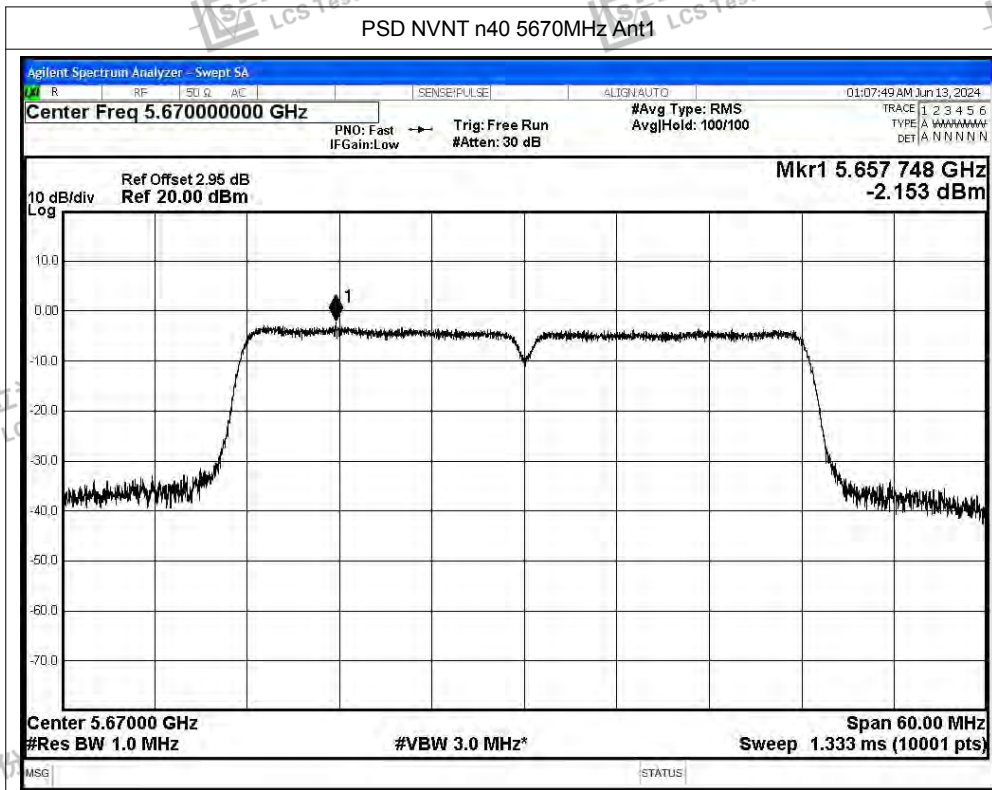

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5580MHz Ant1

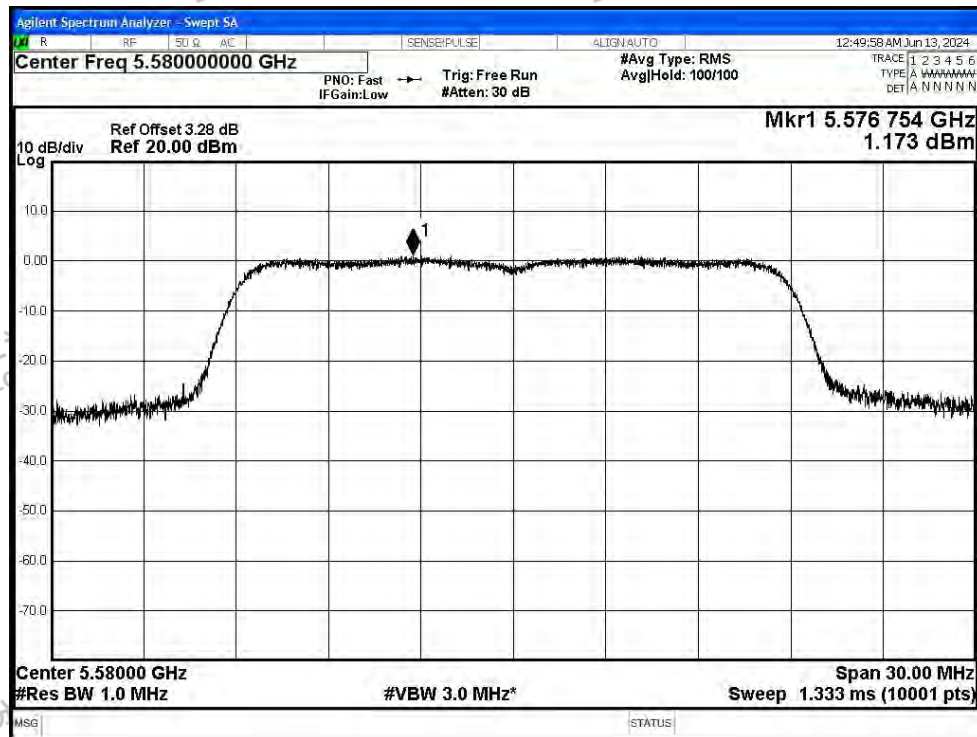

PSD NVNT ac20 5700MHz Ant1

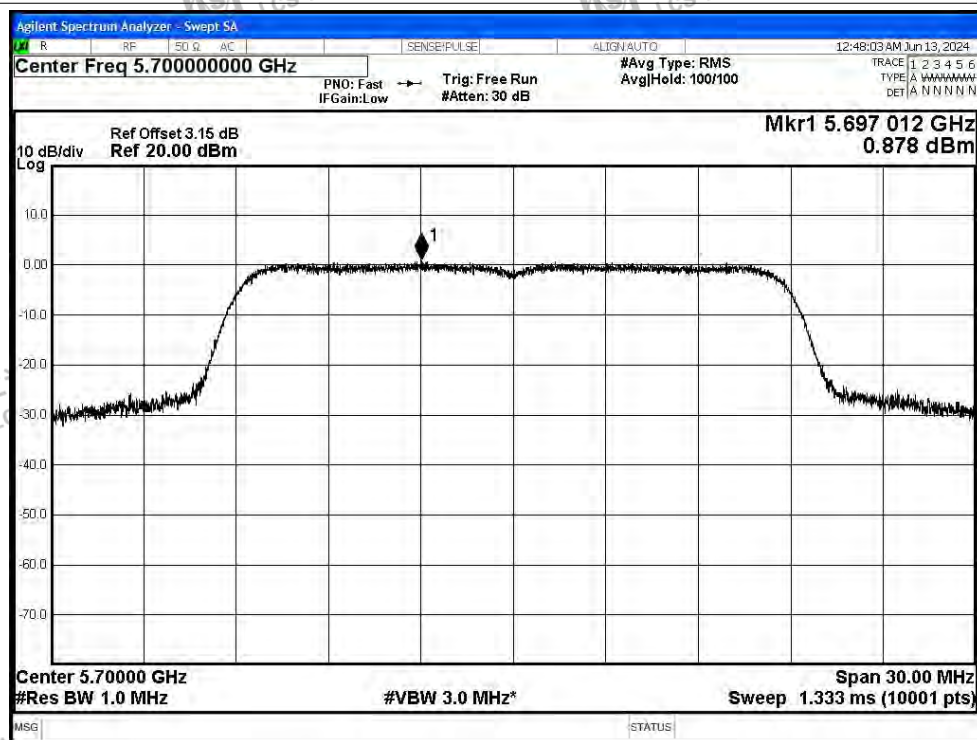

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5510MHz Ant1

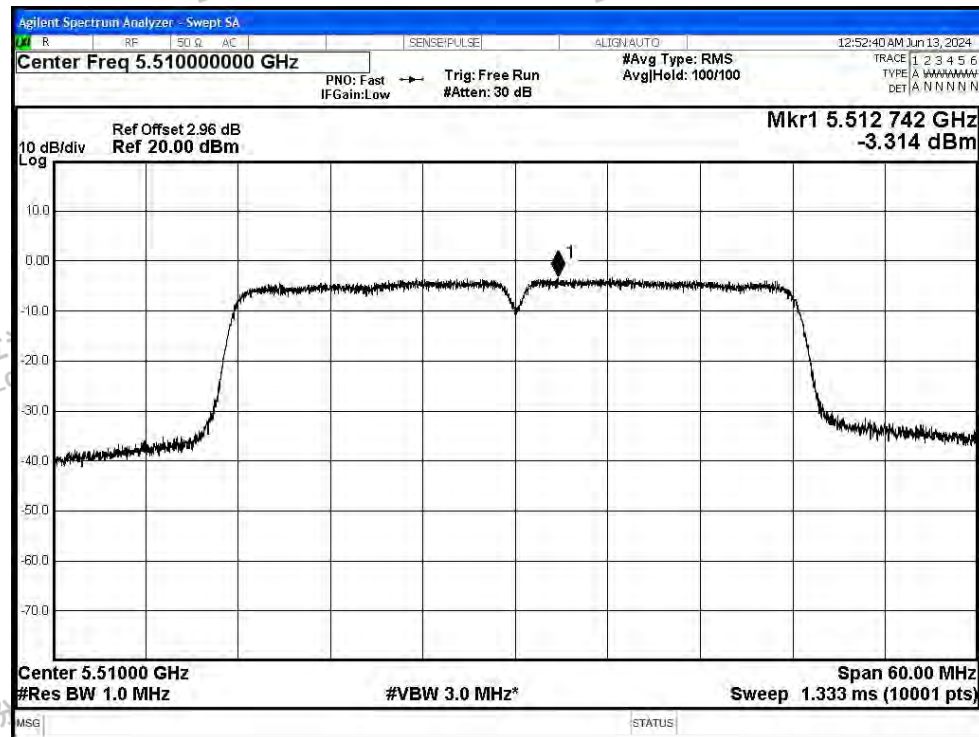

PSD NVNT ac40 5550MHz Ant1

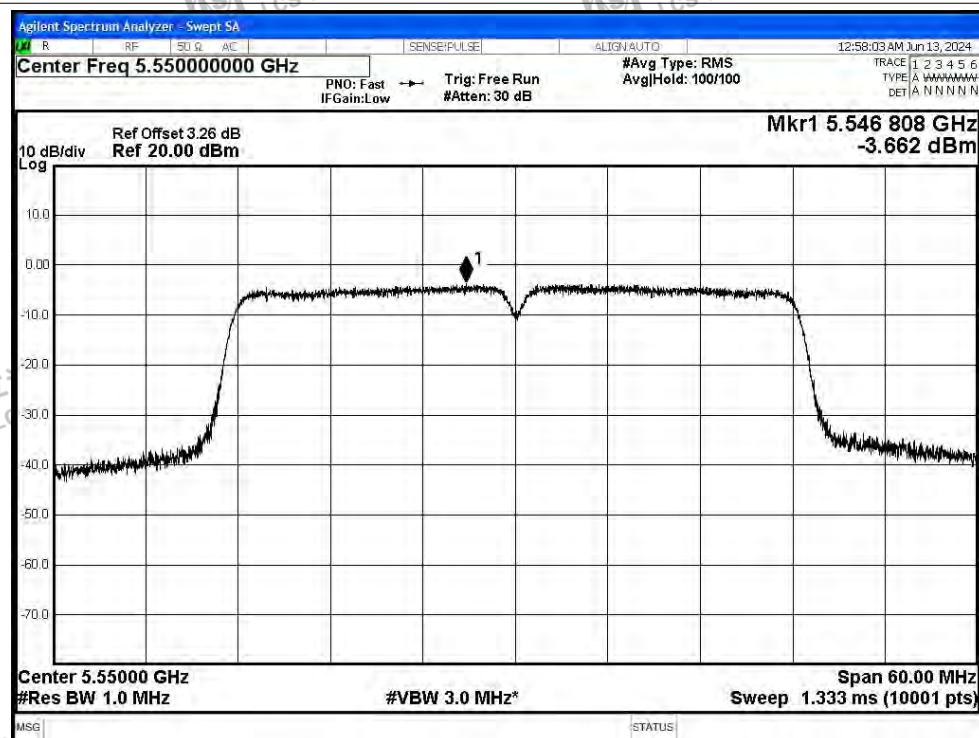

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5670MHz Ant1

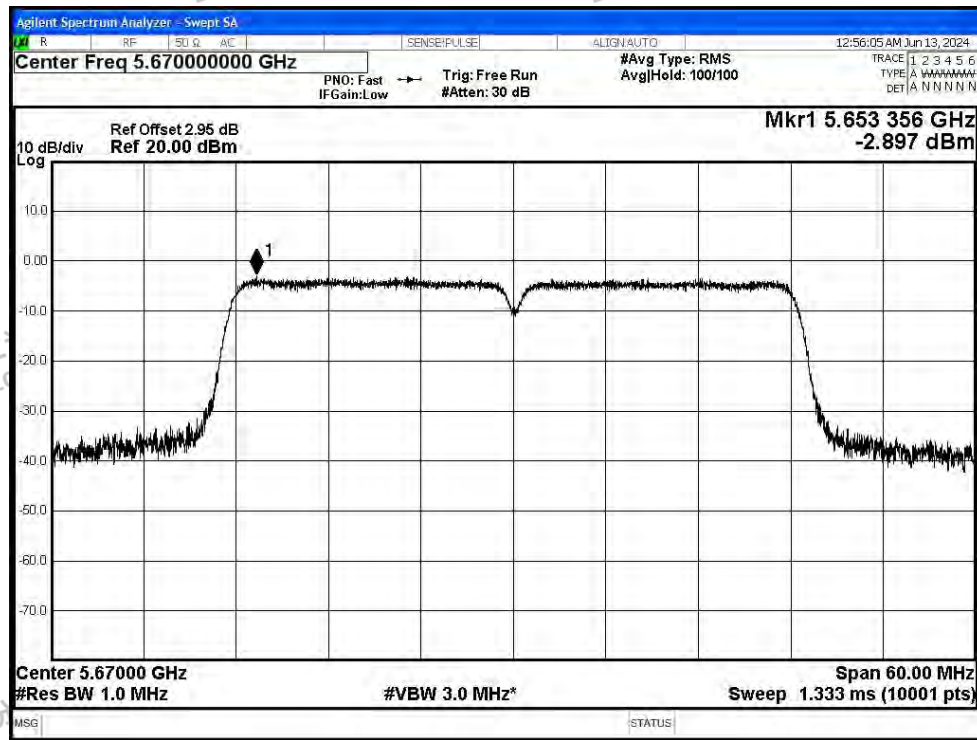

PSD NVNT ac80 5530MHz Ant1

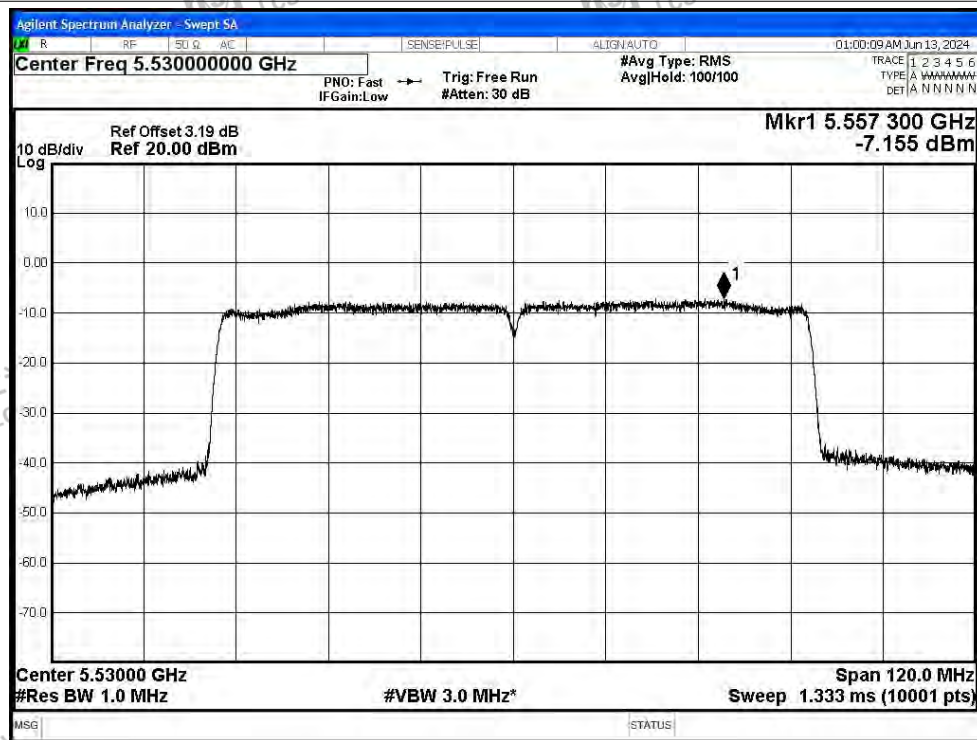


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

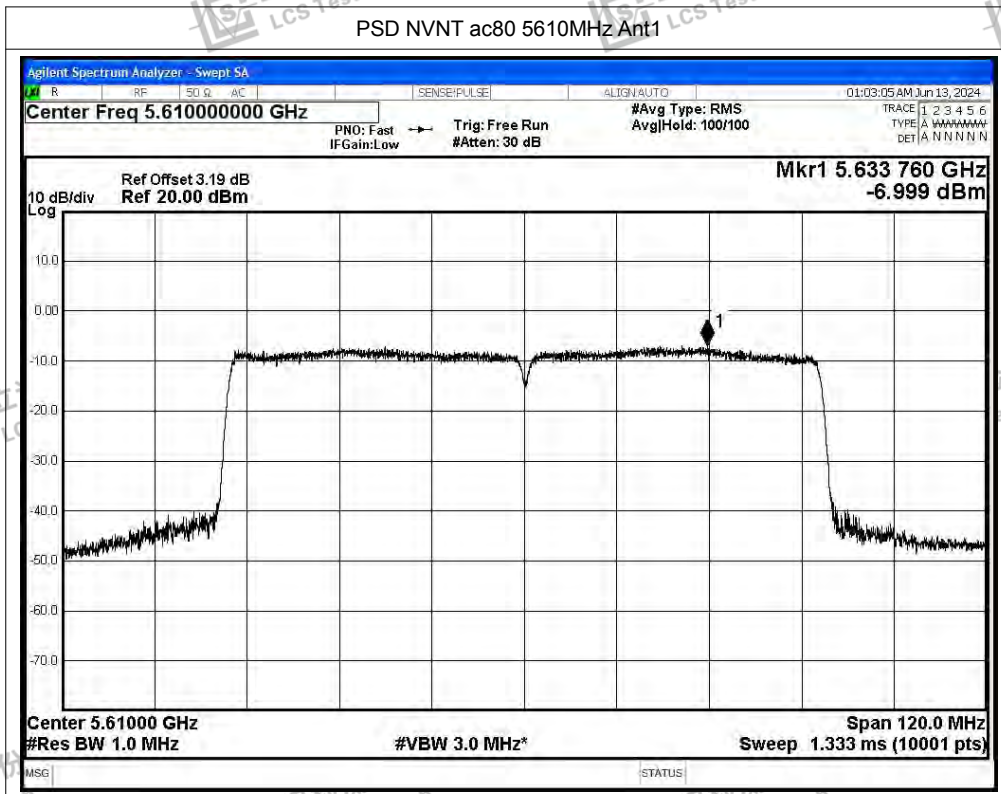

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-49.14	3.82	-	49.94	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-57.9	3.82	0.19	41.18	Average	54	Pass
NVNT	a	5500	Ant1	5468	-42.23	3.82	-	56.85	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-55.53	3.82	0.19	43.55	Average	54	Pass
NVNT	a	5500	Ant1	5470	-47	3.82	-	52.08	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-40.95	3.82	-	58.13	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-53.65	3.82	0.2	45.43	Average	54	Pass
NVNT	a	5700	Ant1	5725.2	-39.86	3.82	-	59.22	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-46.98	3.82	-	52.1	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-57.47	3.82	0.2	41.61	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-49.6	3.82	-	49.48	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-57.86	3.82	0.23	41.22	Average	54	Pass
NVNT	n20	5500	Ant1	5469	-45.43	3.82	-	53.65	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5468.2	-56.69	3.82	0.23	42.39	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-47.52	3.82	-	51.56	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-56.73	3.82	0.23	42.35	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-41.41	3.82	-	57.67	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.01	3.82	0.23	46.07	Average	54	Pass
NVNT	n20	5700	Ant1	5725.4	-37.08	3.82	-	62	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725.2	-52.26	3.82	0.23	46.82	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-47.82	3.82	-	51.26	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-57.47	3.82	0.23	41.61	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-49.34	3.82	-	49.74	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-58.17	3.82	0.23	40.91	Average	54	Pass
NVNT	n40	5510	Ant1	5467.8	-41.83	3.82	-	57.25	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-55.17	3.82	0.23	43.91	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-44.49	3.82	-	54.59	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-49.54	3.82	-	49.54	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-57.75	3.82	0	41.33	Average	54	Pass
NVNT	n40	5670	Ant1	5727.4	-48.23	3.82	-	50.85	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725.6	-57.21	3.82	0	41.87	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-49.07	3.82	-	50.01	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-58.11	3.82	0	40.97	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-50.07	3.82	-	49.01	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5460	-58.33	3.82	0.23	40.75	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ac20	5500	Ant1	5469.4	-44.14	3.82	-	54.94	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5469.4	-56.52	3.82	0.23	42.56	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-45.39	3.82	-	53.69	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-56.83	3.82	0.23	42.25	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-40.01	3.82	-	59.07	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-52.72	3.82	0	46.36	Average	54	Pass
NVNT	ac20	5700	Ant1	5725.6	-37.97	3.82	-	61.11	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725.4	-52.12	3.82	0	46.96	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-48.53	3.82	-	50.55	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-56.85	3.82	0	42.23	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-48.91	3.82	-	50.17	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-57.39	3.82	0.23	41.69	Average	54	Pass
NVNT	ac40	5510	Ant1	5469.8	-41.63	3.82	-	57.45	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5469.8	-55.04	3.82	0.23	44.04	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-47.65	3.82	-	51.43	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-55.6	3.82	0.23	43.48	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-50.18	3.82	-	48.9	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-58	3.82	0	41.08	Average	54	Pass
NVNT	ac40	5670	Ant1	5726.2	-47.03	3.82	-	52.05	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725.8	-57.6	3.82	0	41.48	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-49.9	3.82	-	49.18	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-58.29	3.82	0	40.79	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-48.33	3.82	-	50.75	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-55.9	3.82	0.47	43.18	Average	54	Pass
NVNT	ac80	5530	Ant1	5469.8	-43.91	3.82	-	55.17	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-54.82	3.82	0.47	44.26	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-46.07	3.82	-	53.01	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-50.27	3.82	-	48.81	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-57.6	3.82	0	41.48	Average	54	Pass
NVNT	ac80	5610	Ant1	5731.31	-47.6	3.82	-	51.48	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725.16	-57.5	3.82	0	41.58	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-50.63	3.82	-	48.45	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-57.85	3.82	0	41.23	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5500MHz Ant1 Peak

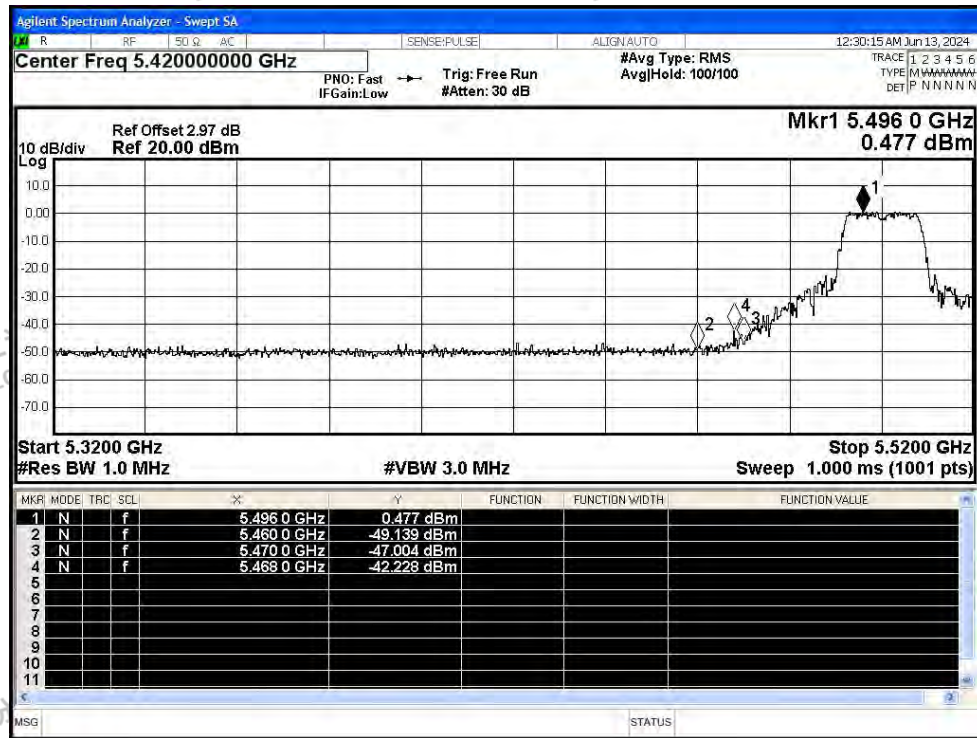

Restrict Band NVNT a 5500MHz Ant1 Average

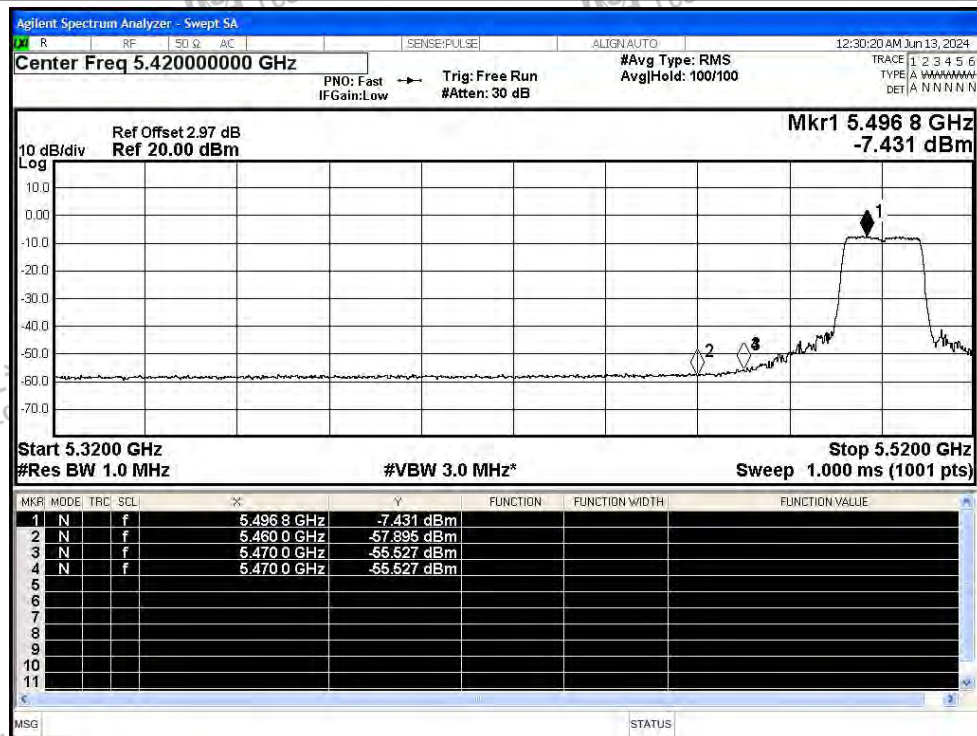

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant1 Peak

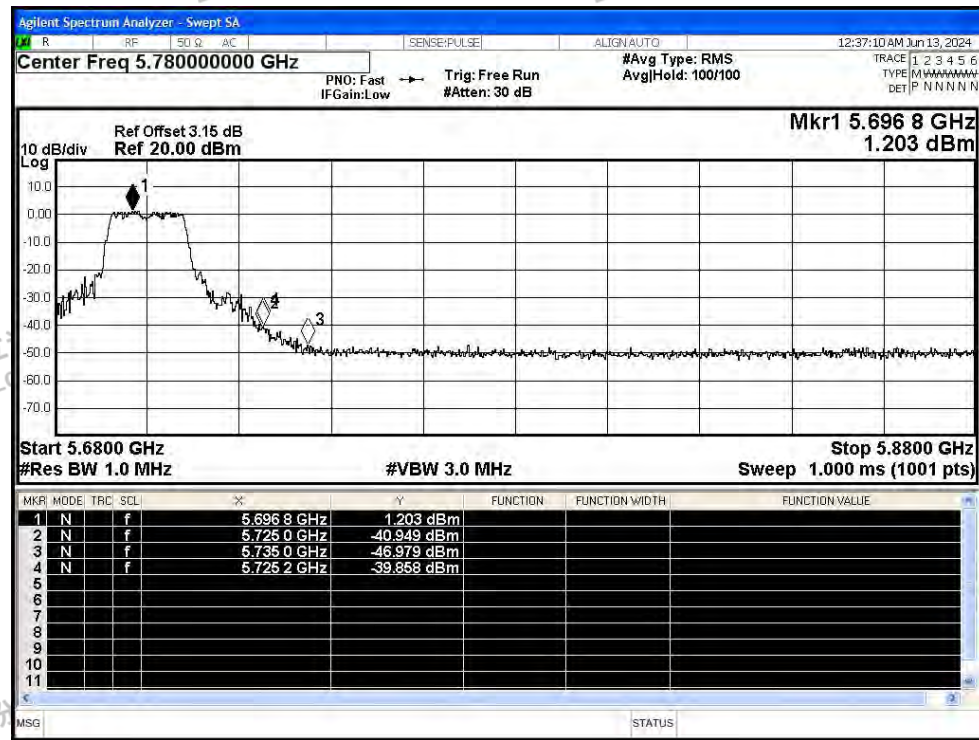

Restrict Band NVNT a 5700MHz Ant1 Average

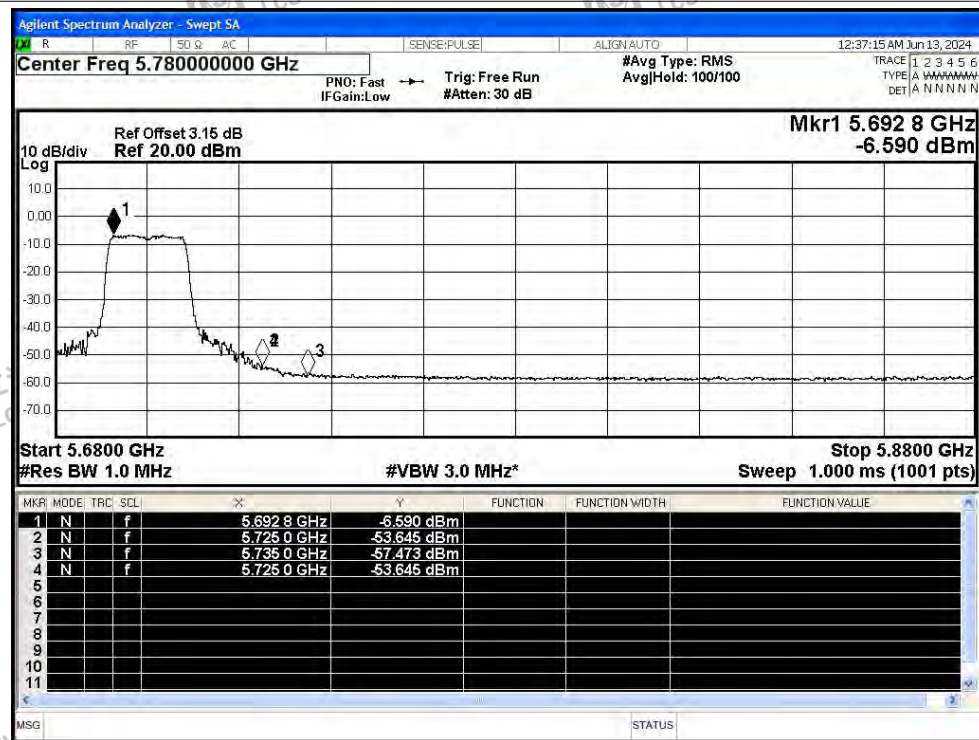

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant1 Peak



Restrict Band NVNT n20 5500MHz Ant1 Average

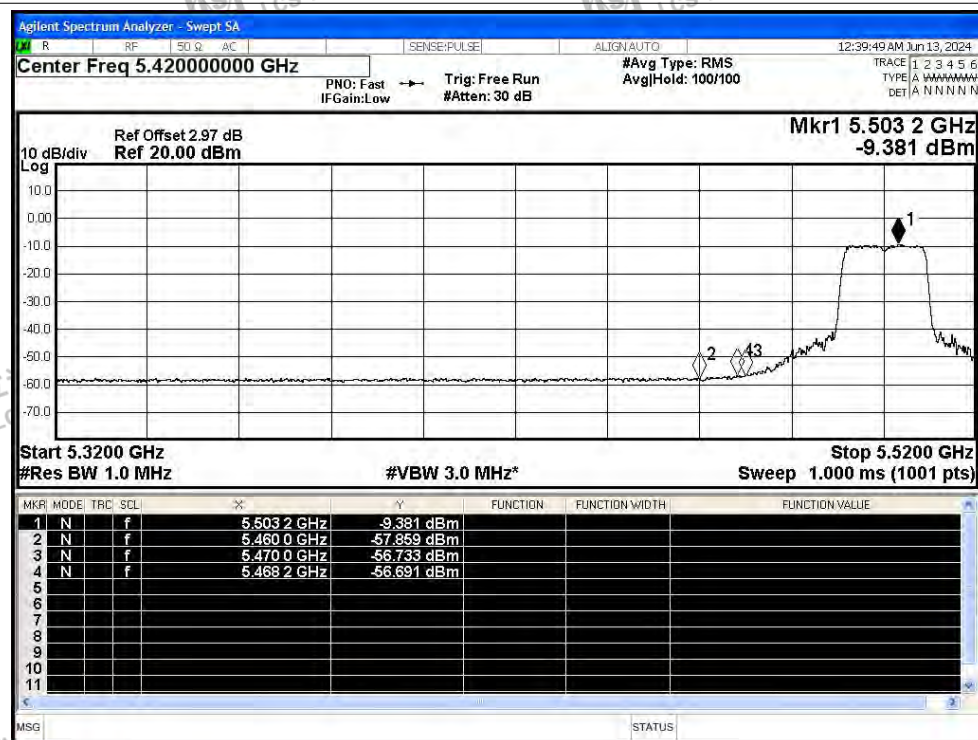

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant1 Peak

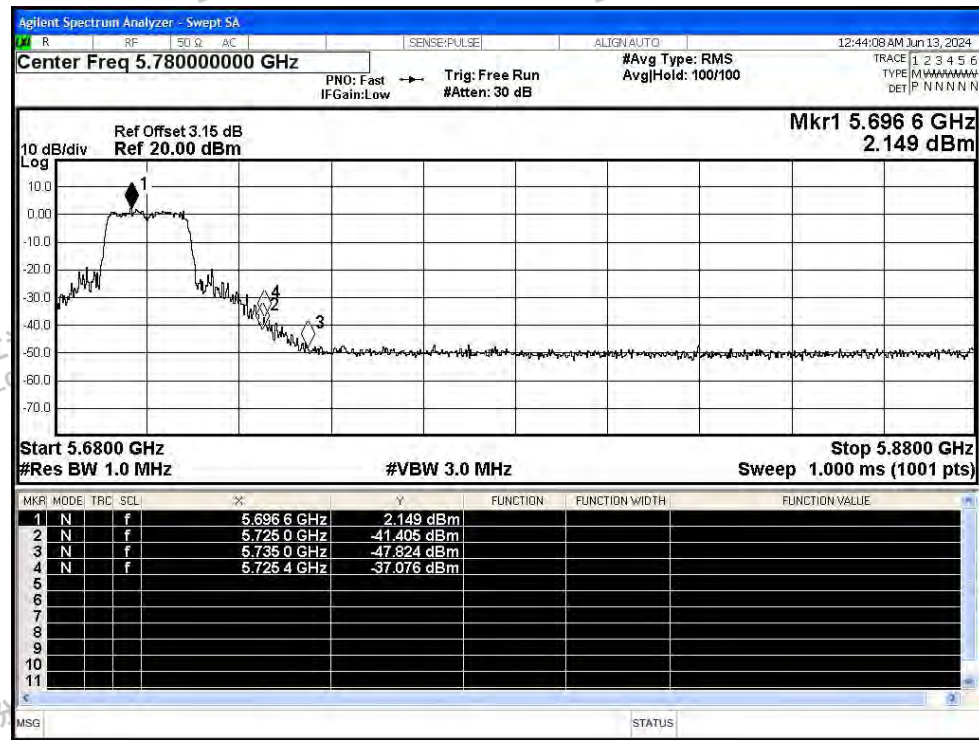

Restrict Band NVNT n20 5700MHz Ant1 Average

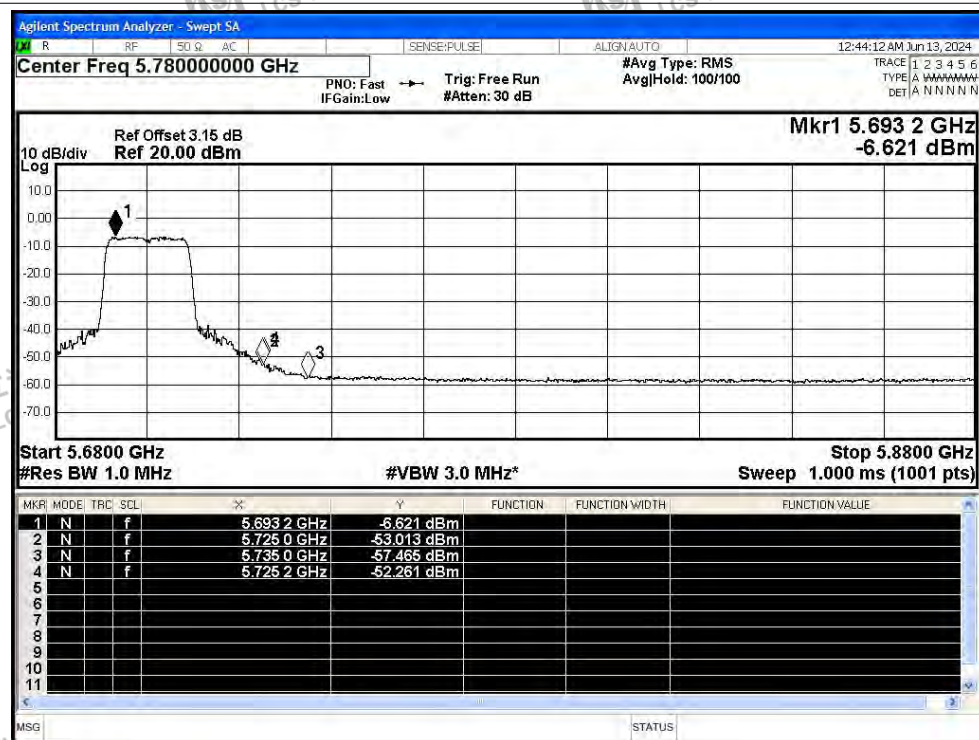

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant1 Peak

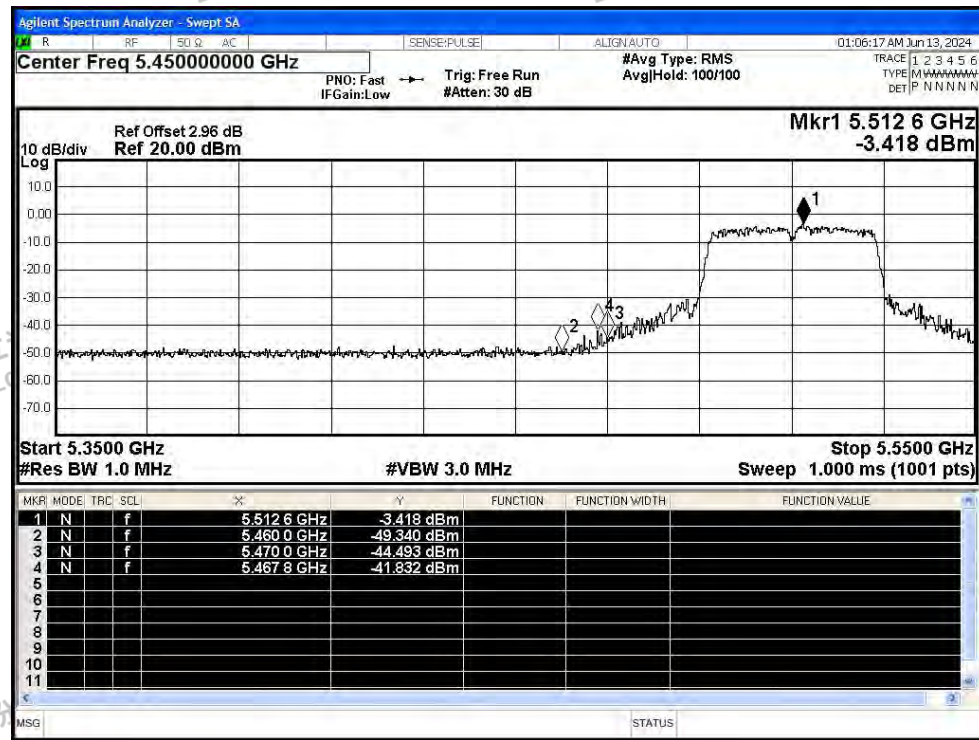

Restrict Band NVNT n40 5510MHz Ant1 Average

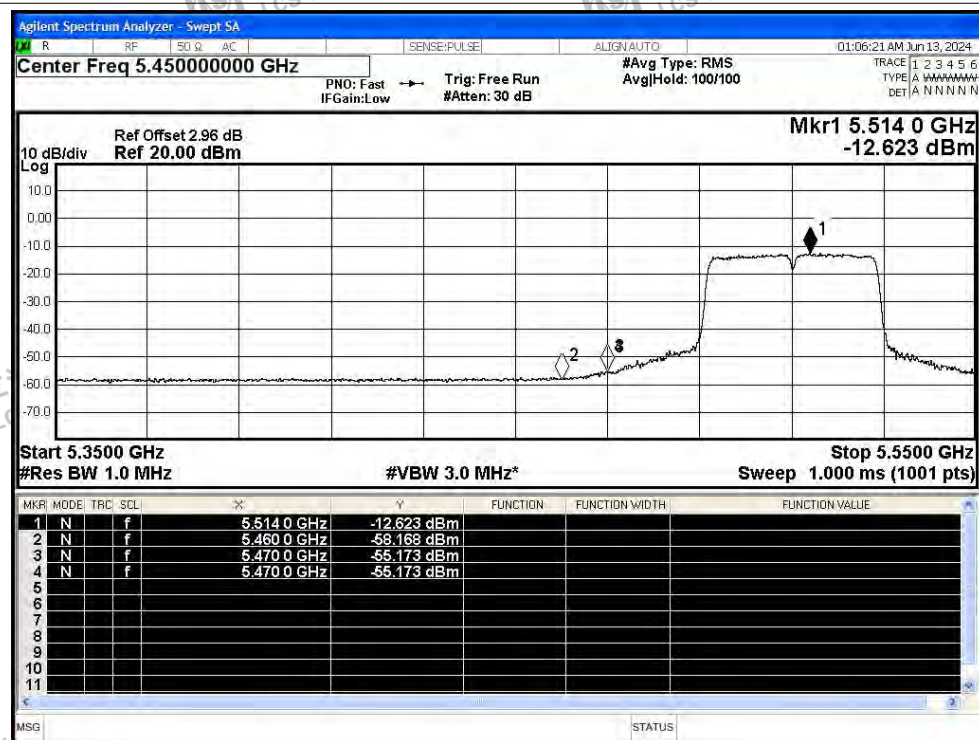

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant1 Peak

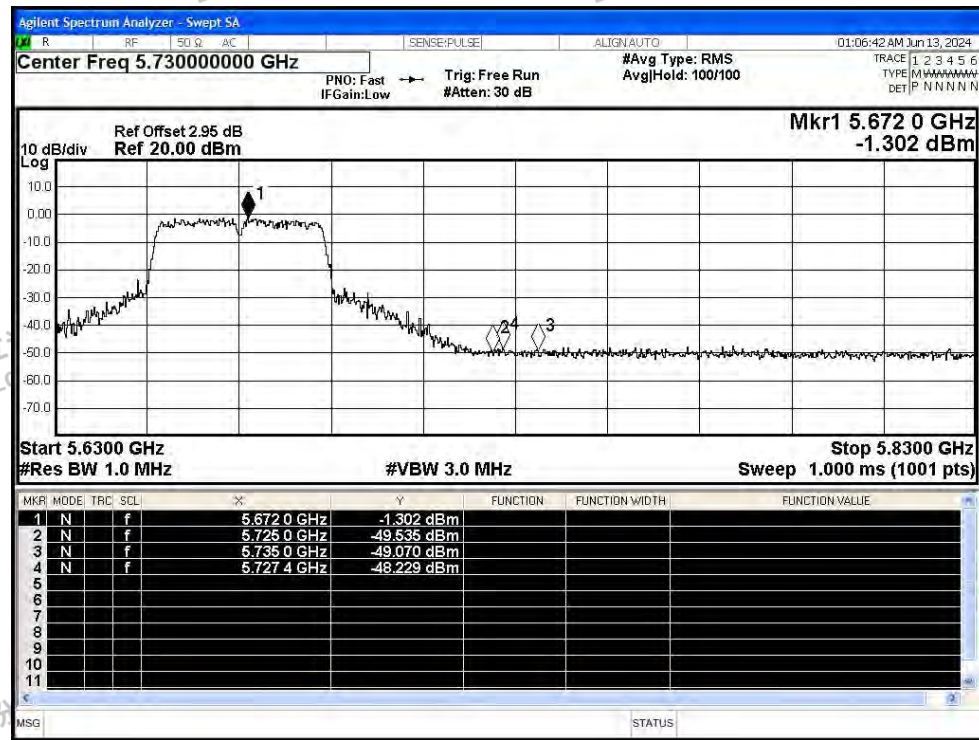

Restrict Band NVNT n40 5670MHz Ant1 Average

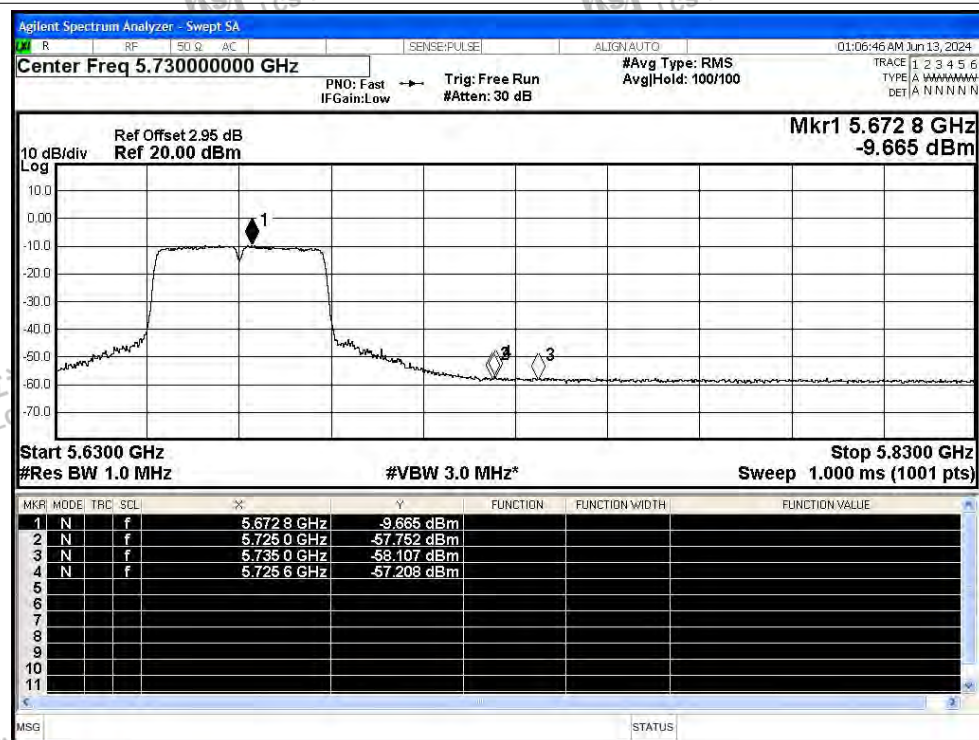

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant1 Peak

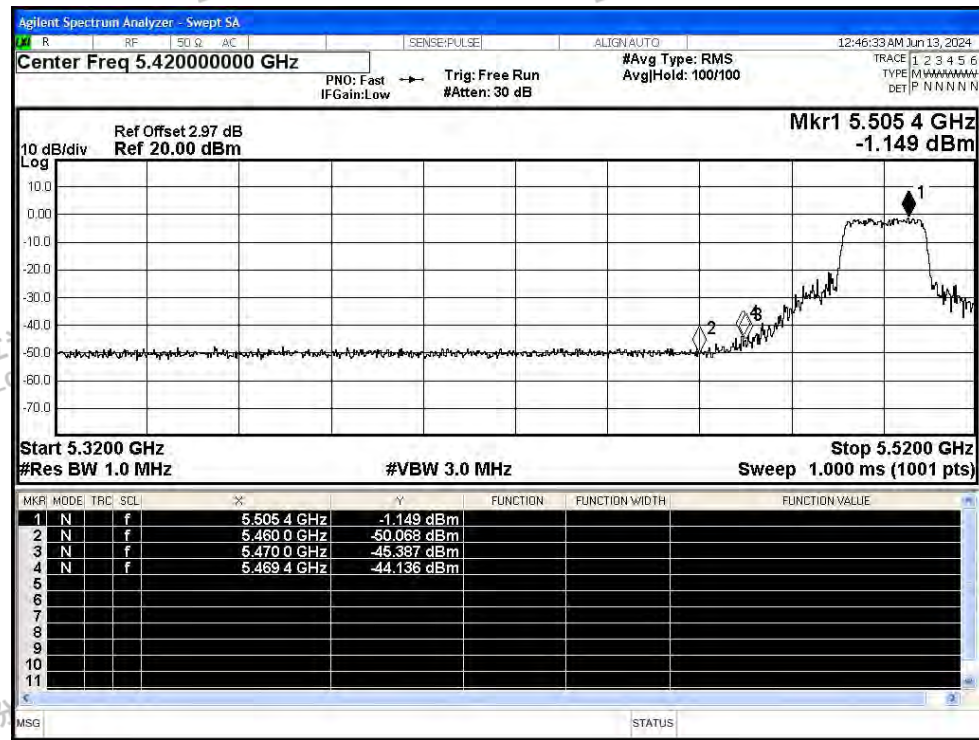

Restrict Band NVNT ac20 5500MHz Ant1 Average

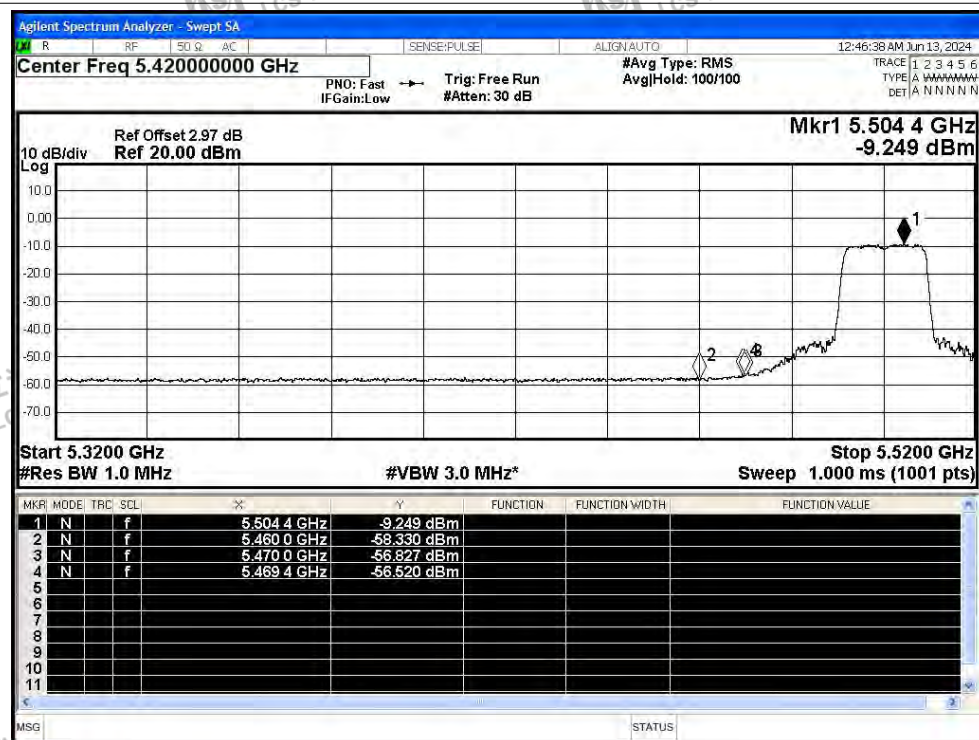

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant1 Peak

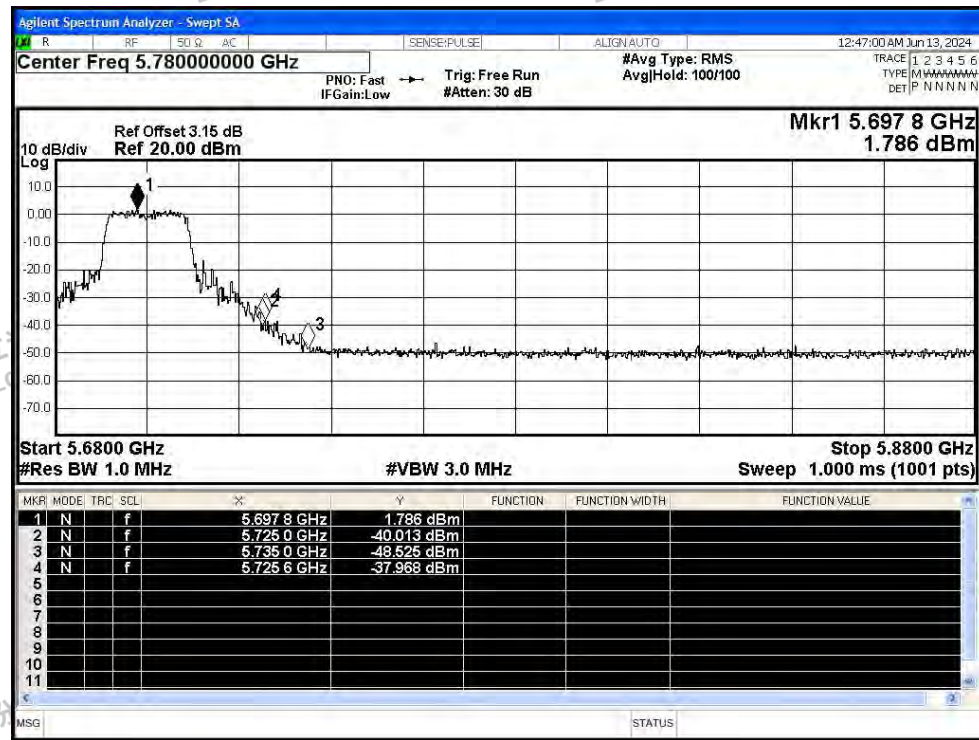

Restrict Band NVNT ac20 5700MHz Ant1 Average

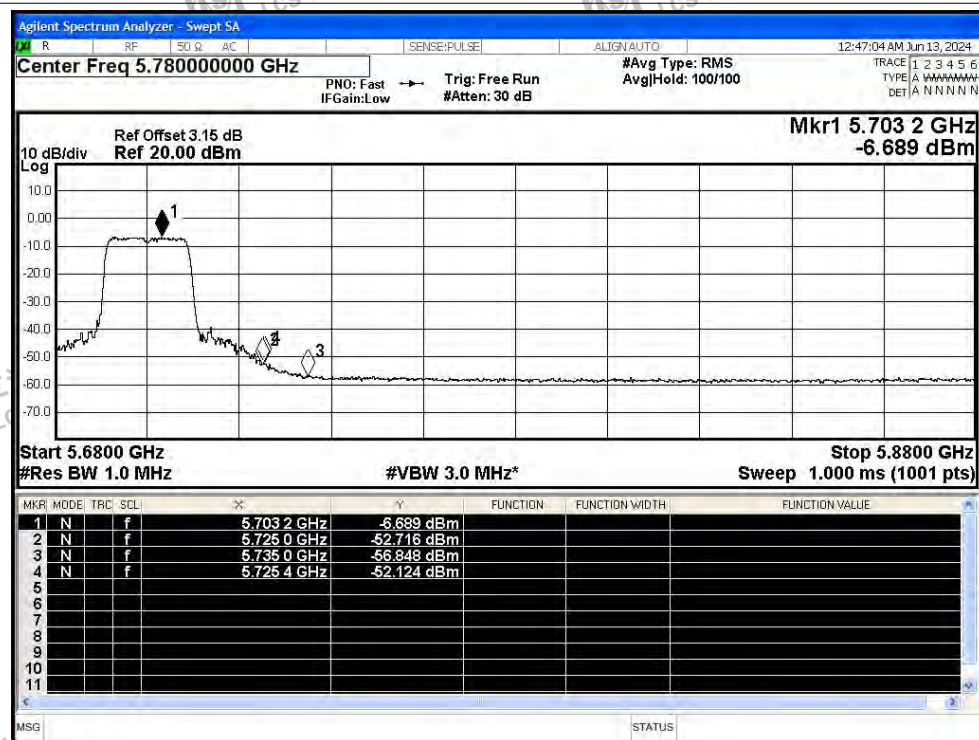

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant1 Peak

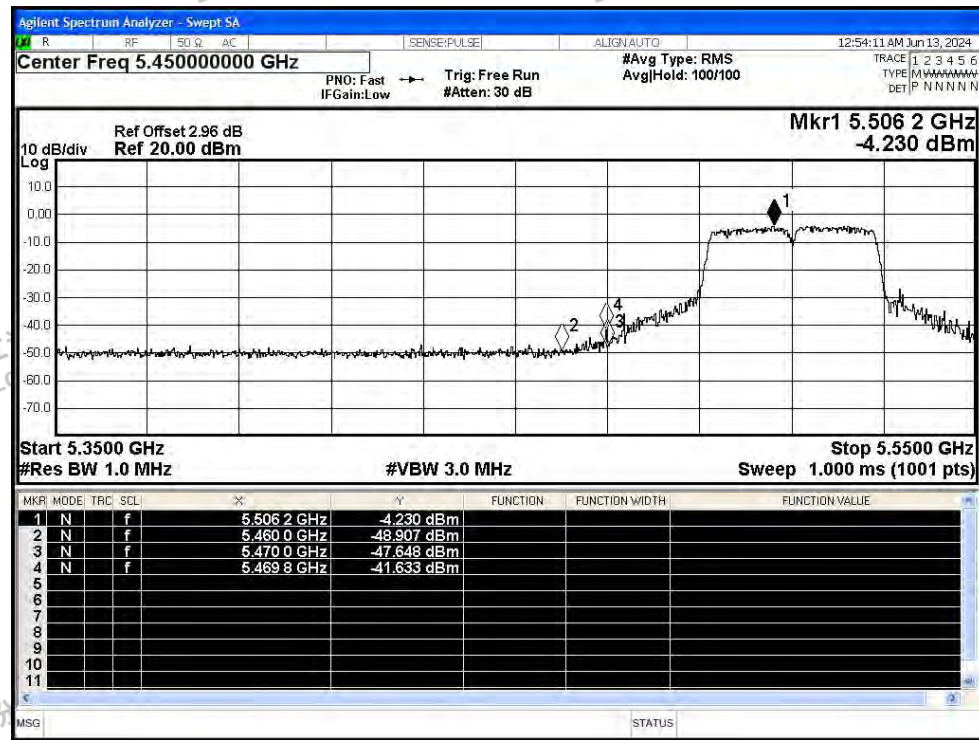

Restrict Band NVNT ac40 5510MHz Ant1 Average

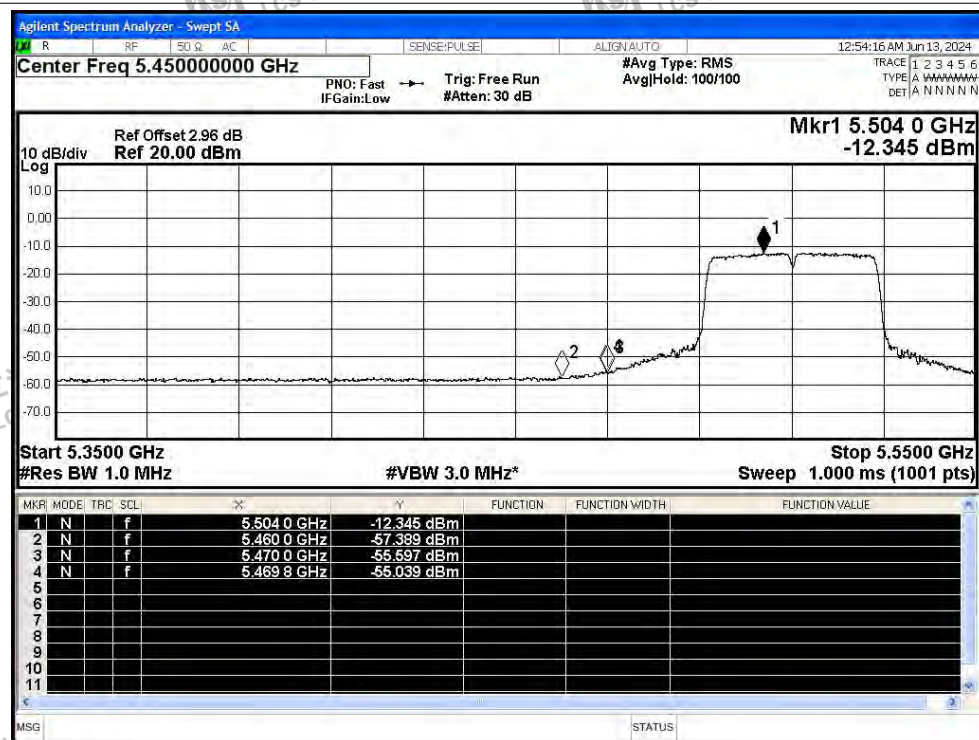

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant1 Peak

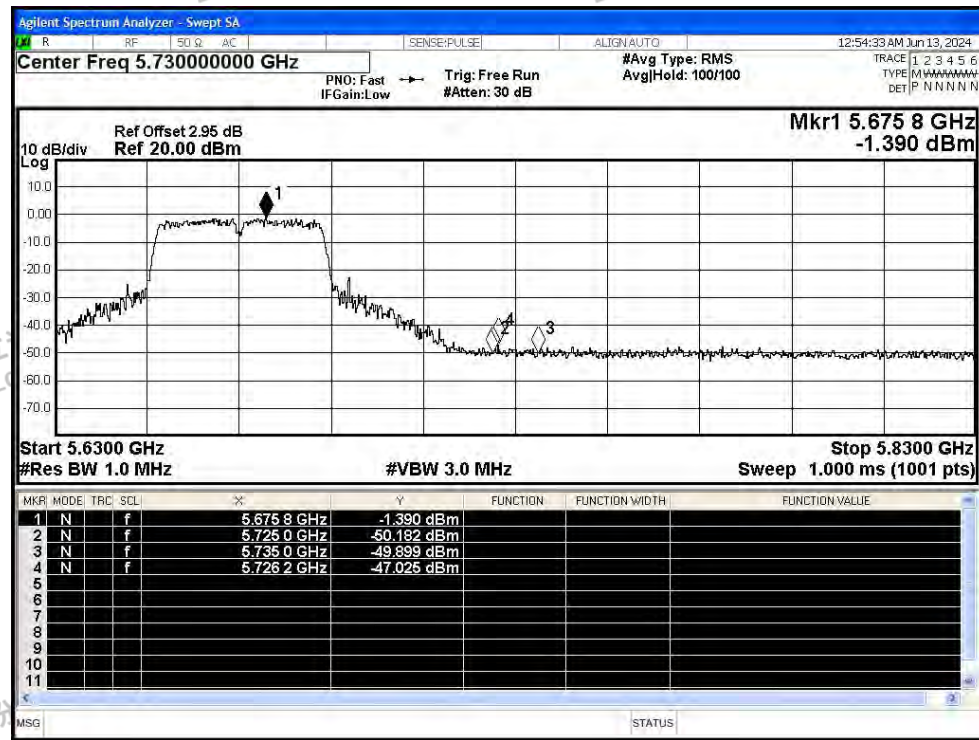

Restrict Band NVNT ac40 5670MHz Ant1 Average

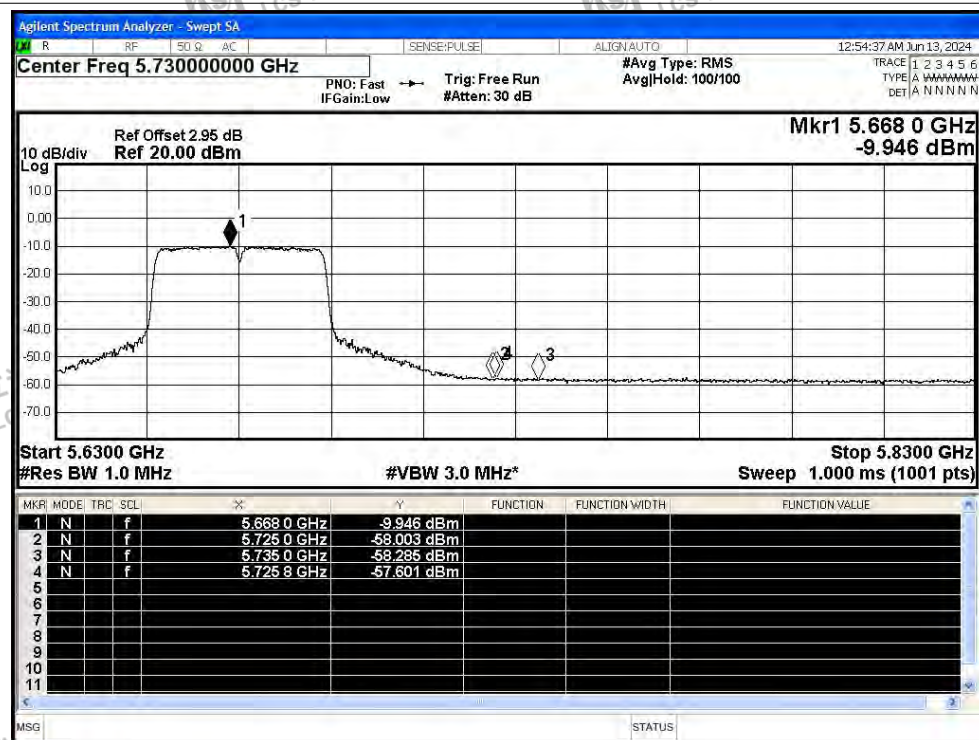

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant1 Peak

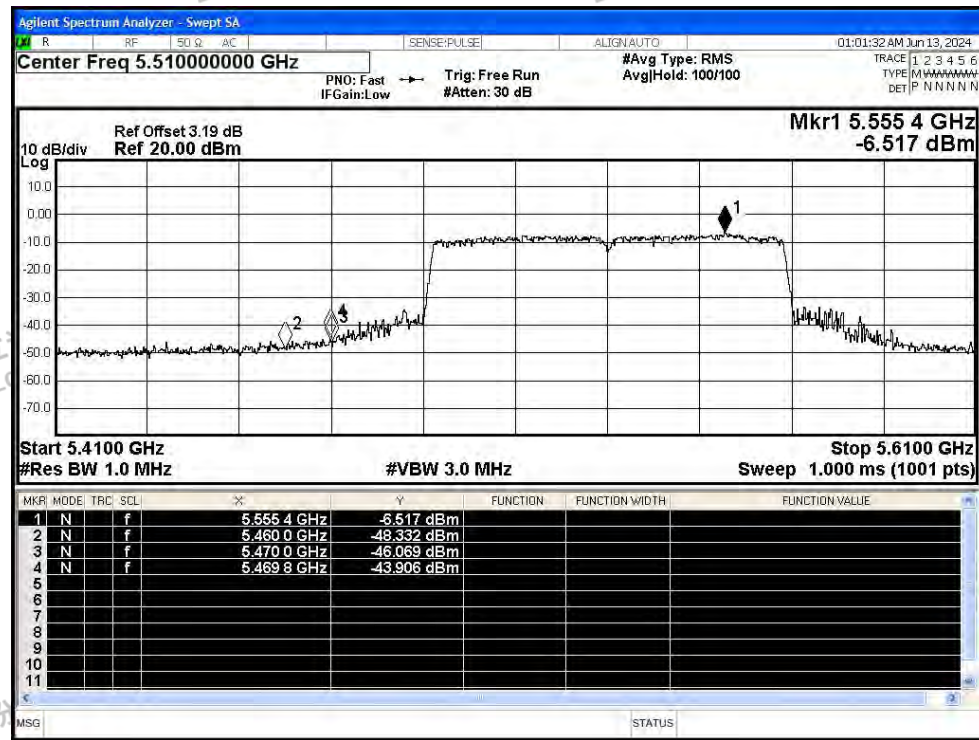

Restrict Band NVNT ac80 5530MHz Ant1 Average

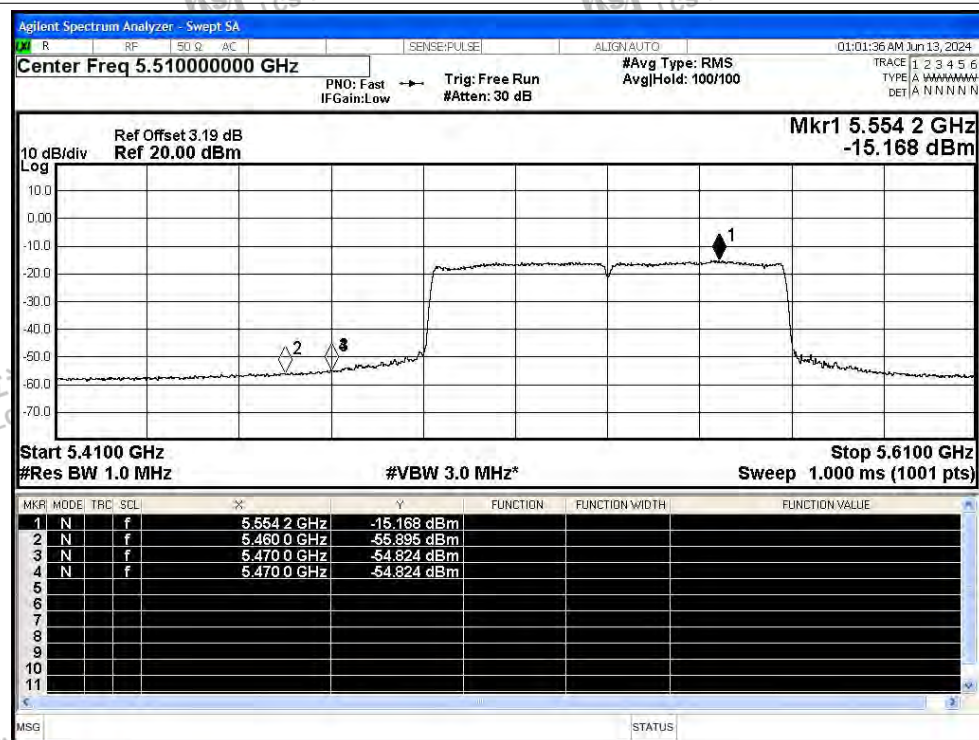

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant1 Peak

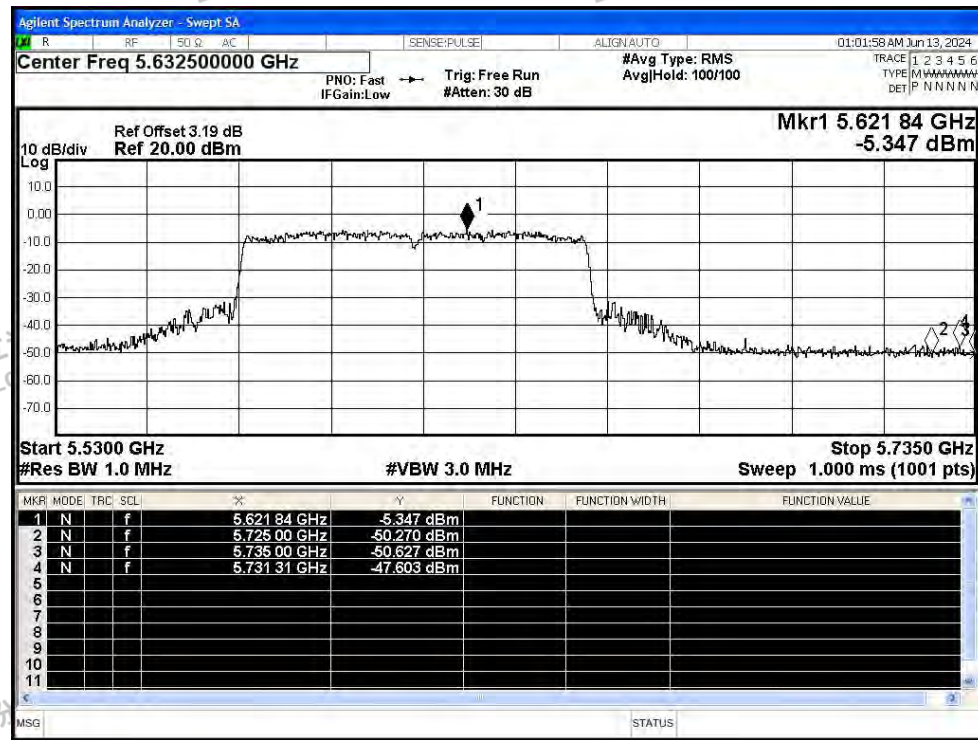

Restrict Band NVNT ac80 5610MHz Ant1 Average

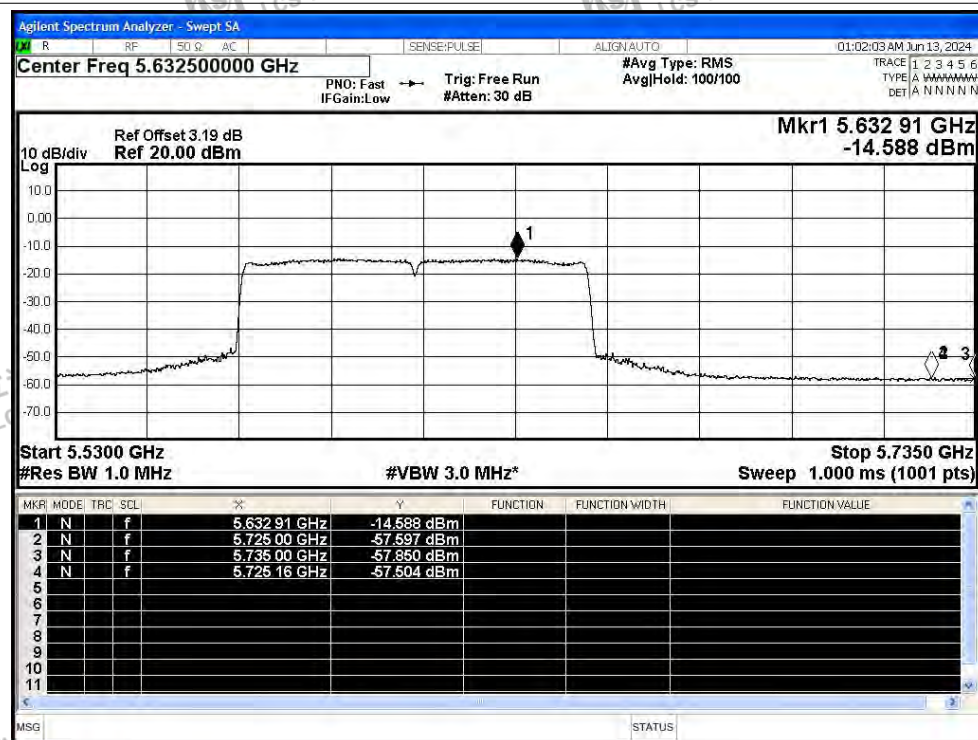

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
NVNT	ac20	5580	Ant1	5580	0	0	25	Pass
NVNT	ac20	5700	Ant1	5700	0	0	25	Pass
NVNT	ac40	5510	Ant1	5510	0	0	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass






Test Graphs

Freq. Stability NVNT ac20 5500MHz Ant1

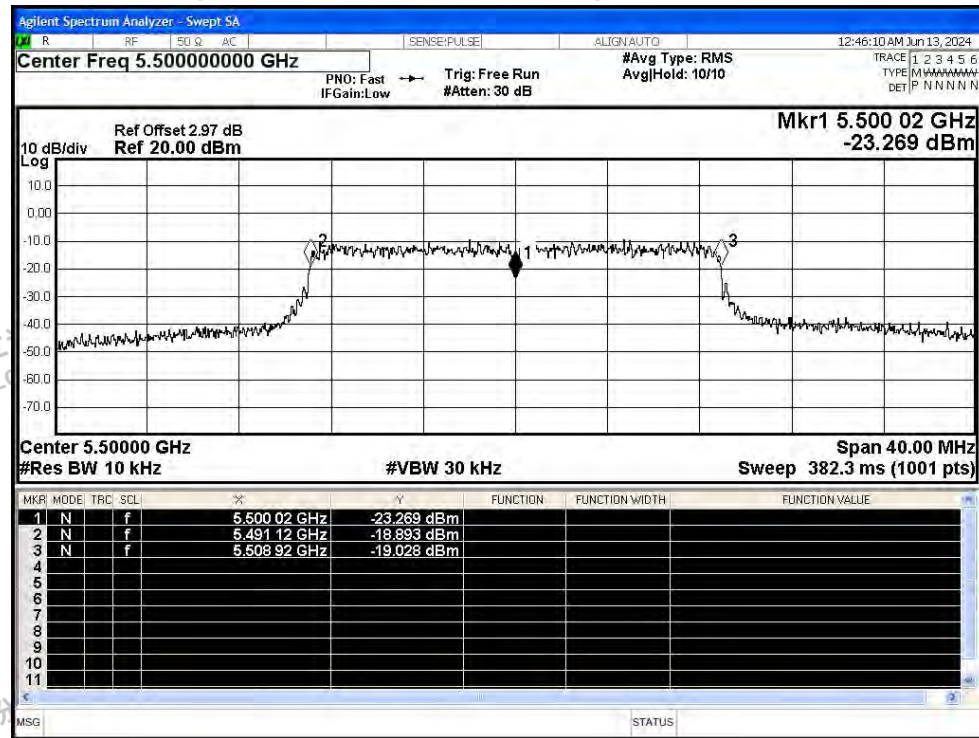

Freq. Stability NVNT ac20 5580MHz Ant1

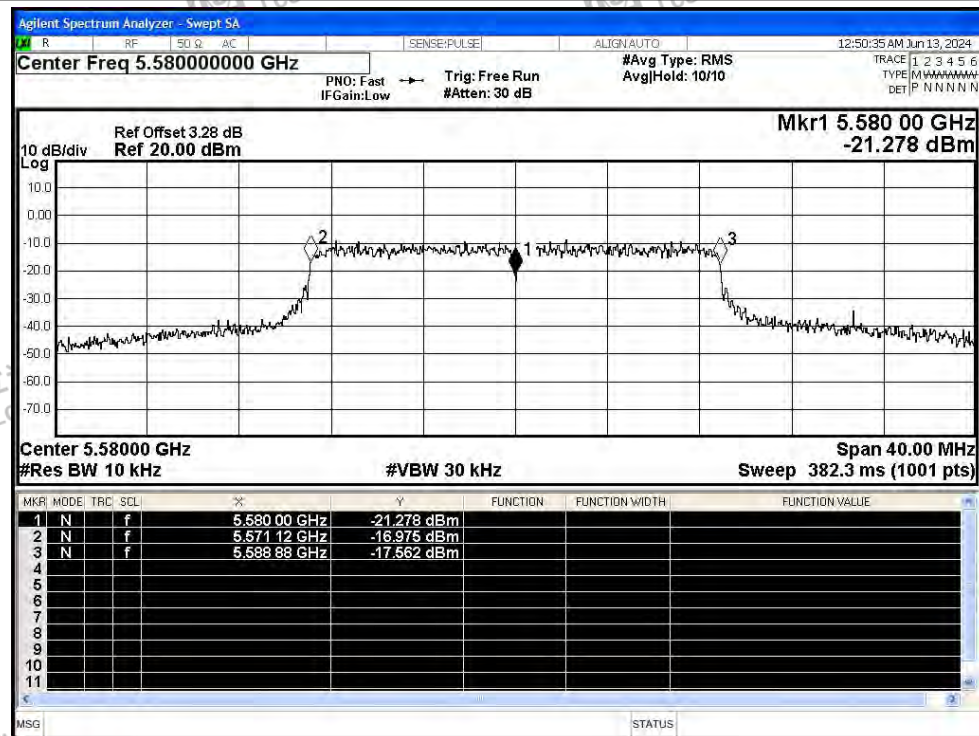

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5700MHz Ant1

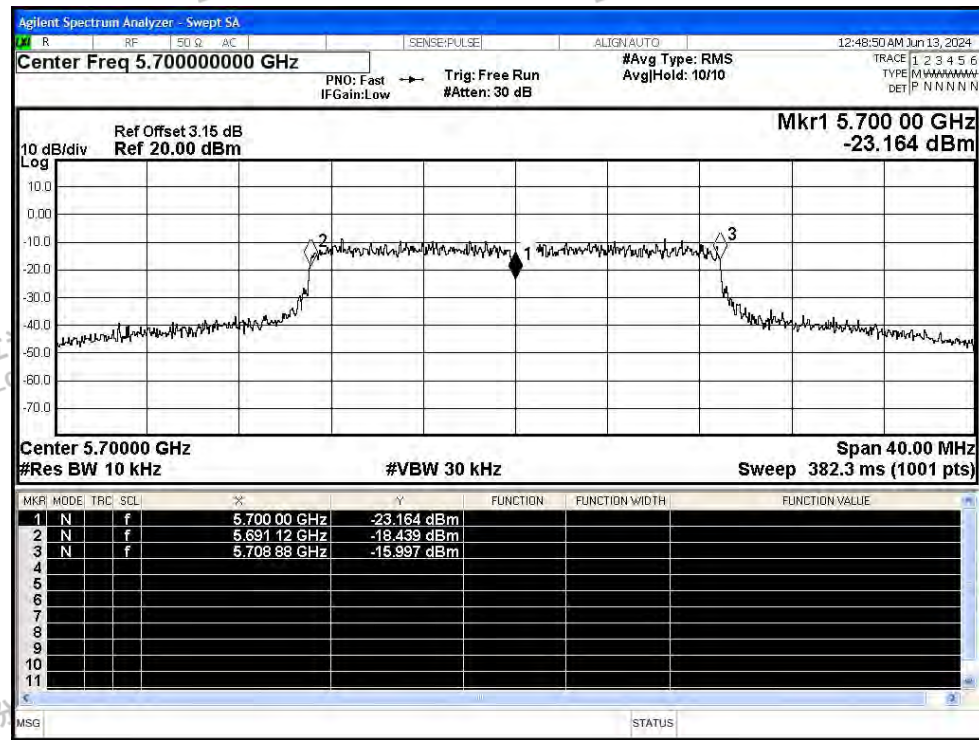

Freq. Stability NVNT ac40 5510MHz Ant1

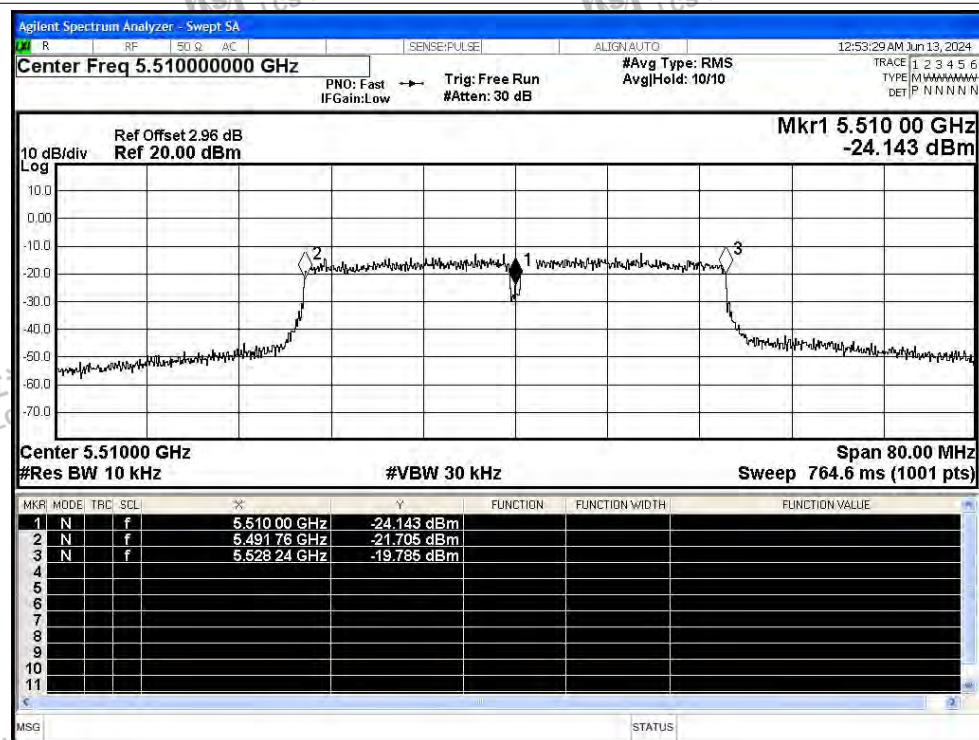

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5550MHz Ant1

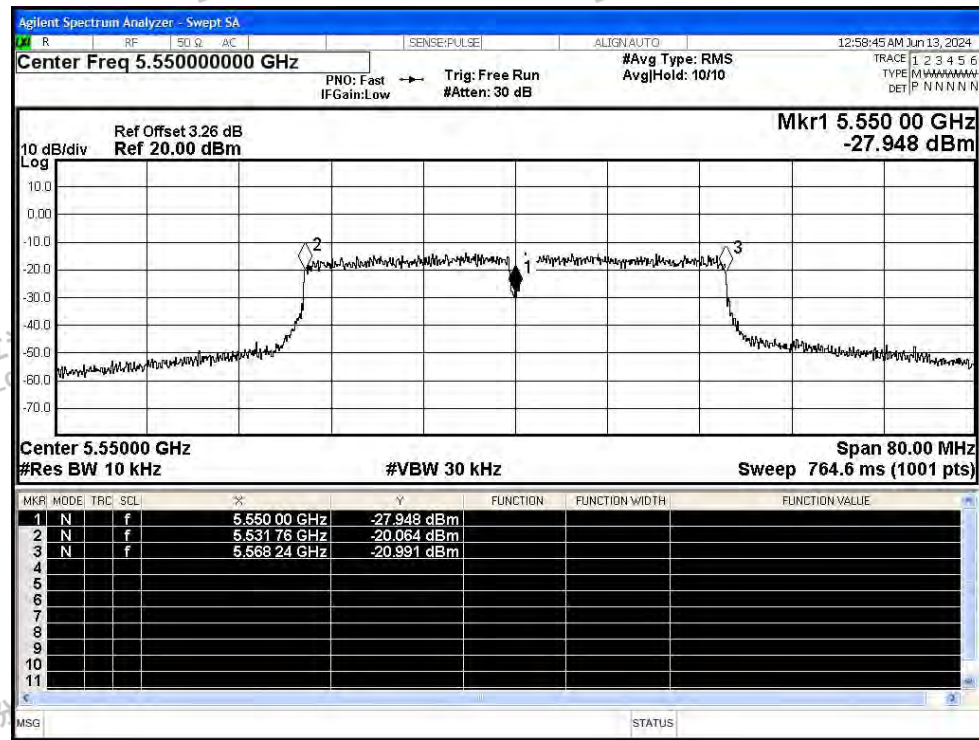

Freq. Stability NVNT ac40 5670MHz Ant1

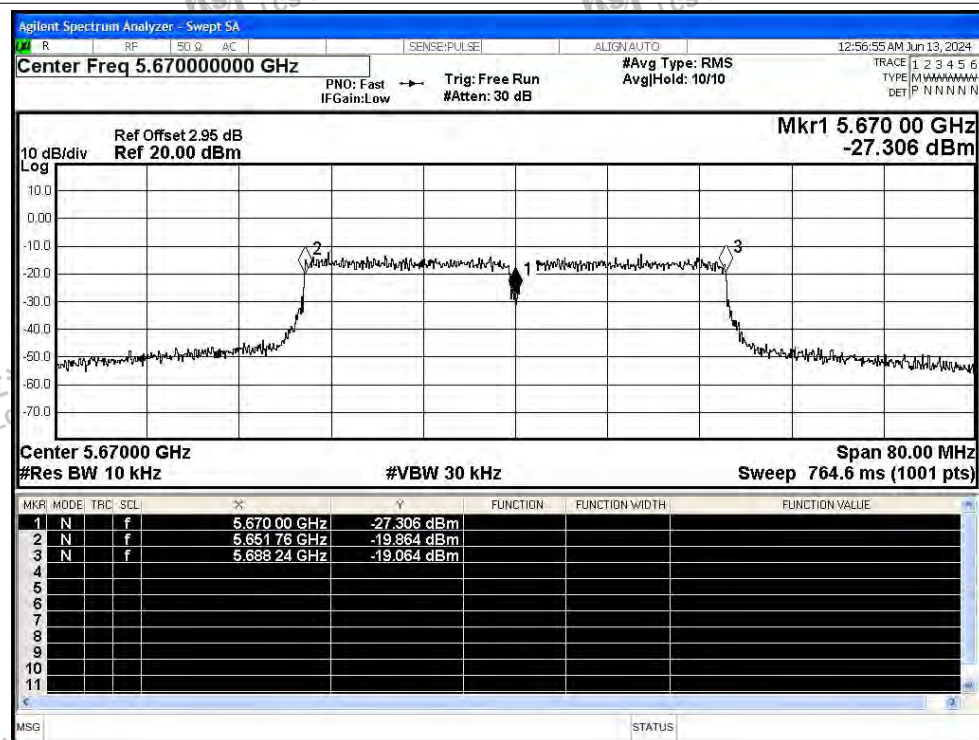

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5530MHz Ant1

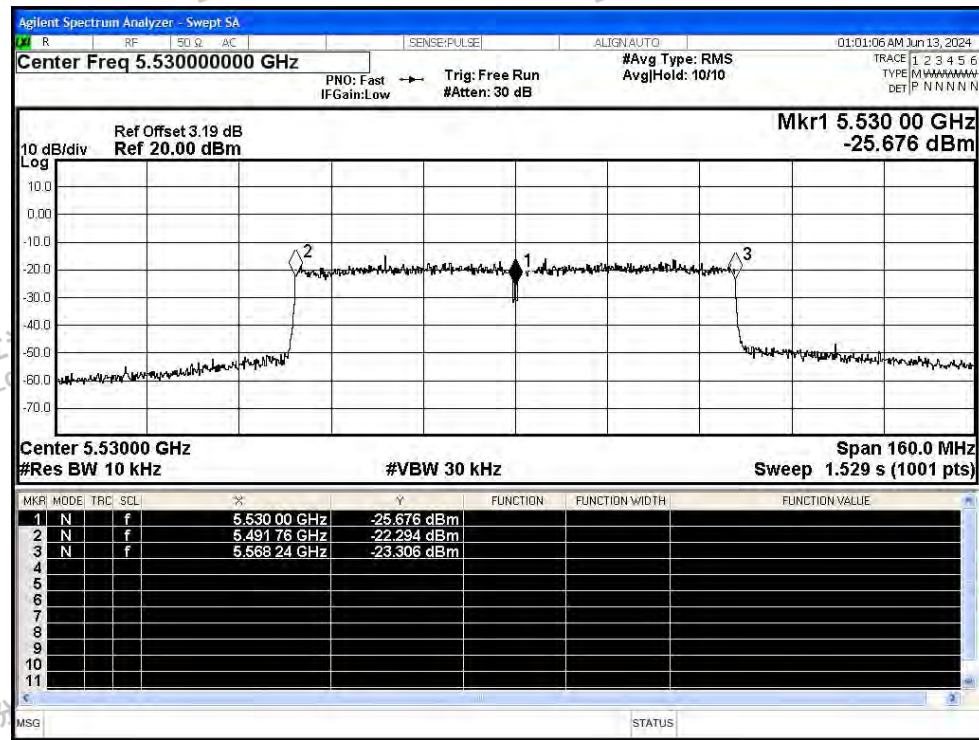

Freq. Stability NVNT ac80 5610MHz Ant1

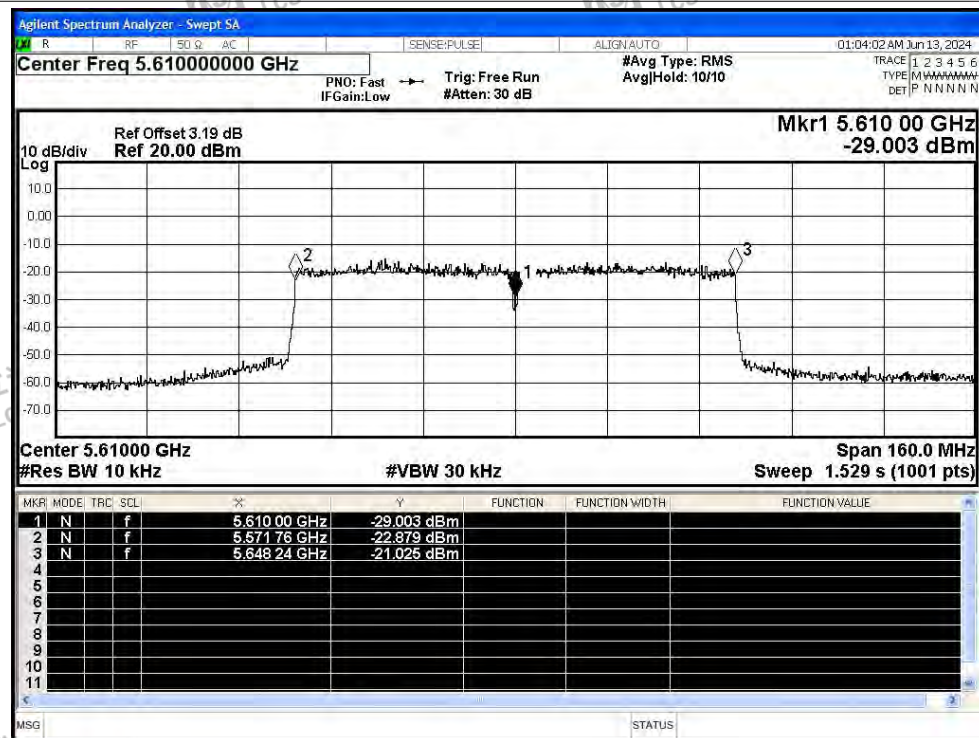

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant1	95.66	0.19	0.73
NVNT	a	5580	Ant1	95.66	0.19	0.73
NVNT	a	5700	Ant1	95.59	0.2	0.73
NVNT	n20	5500	Ant1	94.9	0.23	0.87
NVNT	n20	5580	Ant1	94.81	0.23	0.87
NVNT	n20	5700	Ant1	94.81	0.23	0.87
NVNT	n40	5510	Ant1	94.79	0.23	0.9
NVNT	n40	5550	Ant1	94.71	0.24	0.9
NVNT	n40	5670	Ant1	94.71	0.24	0.9
NVNT	ac20	5500	Ant1	94.85	0.23	0.86
NVNT	ac20	5580	Ant1	94.85	0.23	0.86
NVNT	ac20	5700	Ant1	94.85	0.23	0.86
NVNT	ac40	5510	Ant1	94.81	0.23	0.9
NVNT	ac40	5550	Ant1	94.72	0.24	0.9
NVNT	ac40	5670	Ant1	94.72	0.24	0.9
NVNT	ac80	5530	Ant1	89.65	0.47	1.86
NVNT	ac80	5610	Ant1	89.65	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5500MHz Ant1

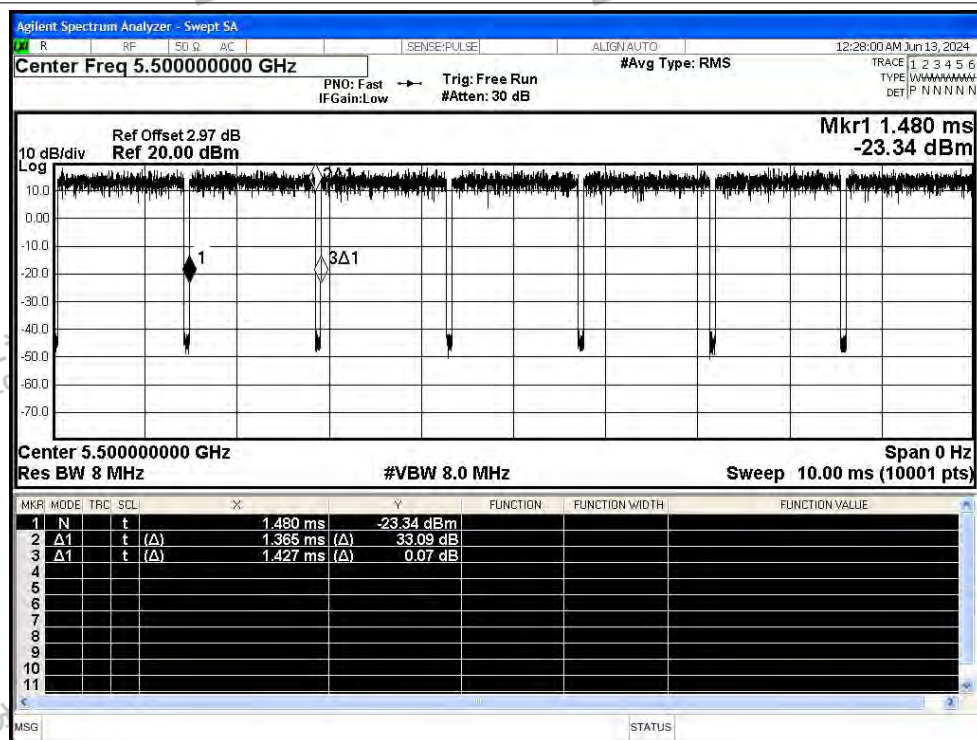

Duty Cycle NVNT a 5580MHz Ant1

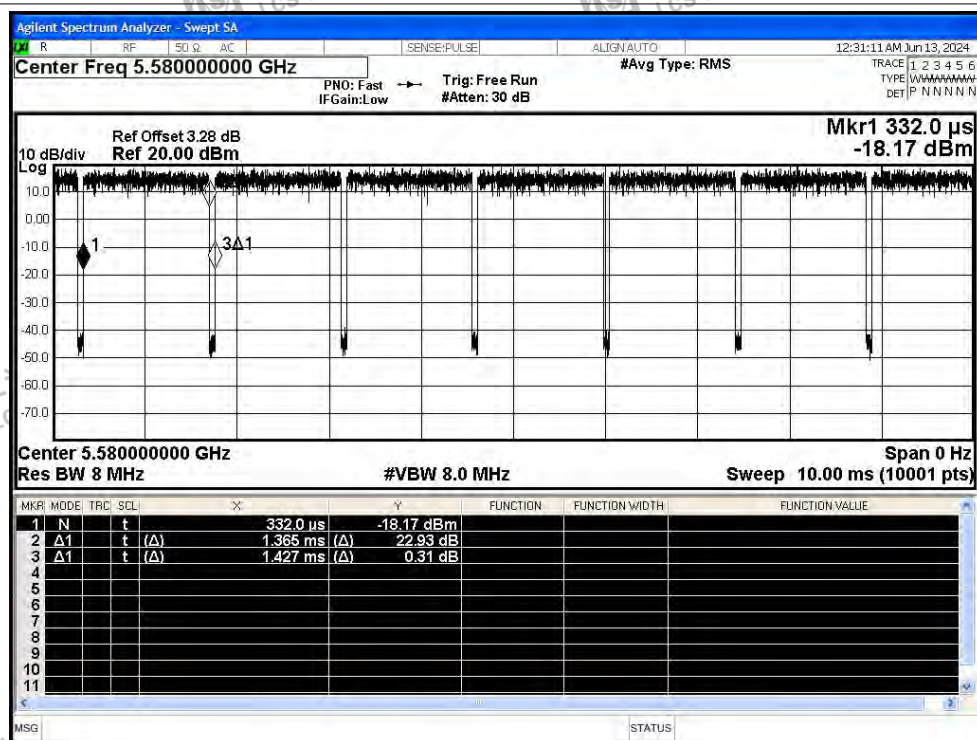

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant1

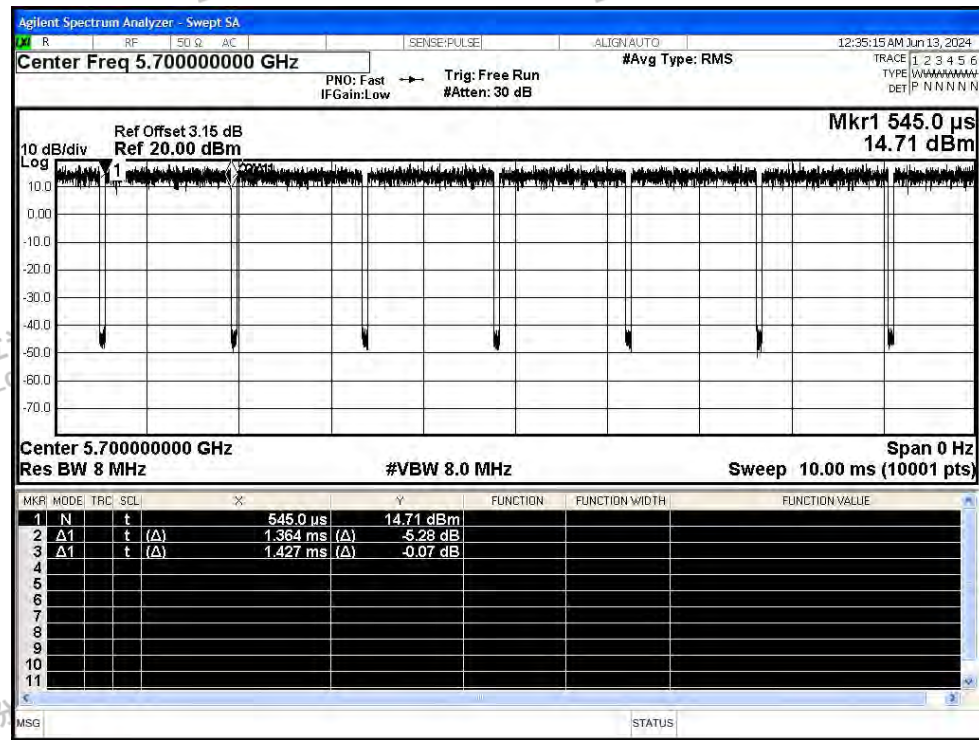

Duty Cycle NVNT n20 5500MHz Ant1

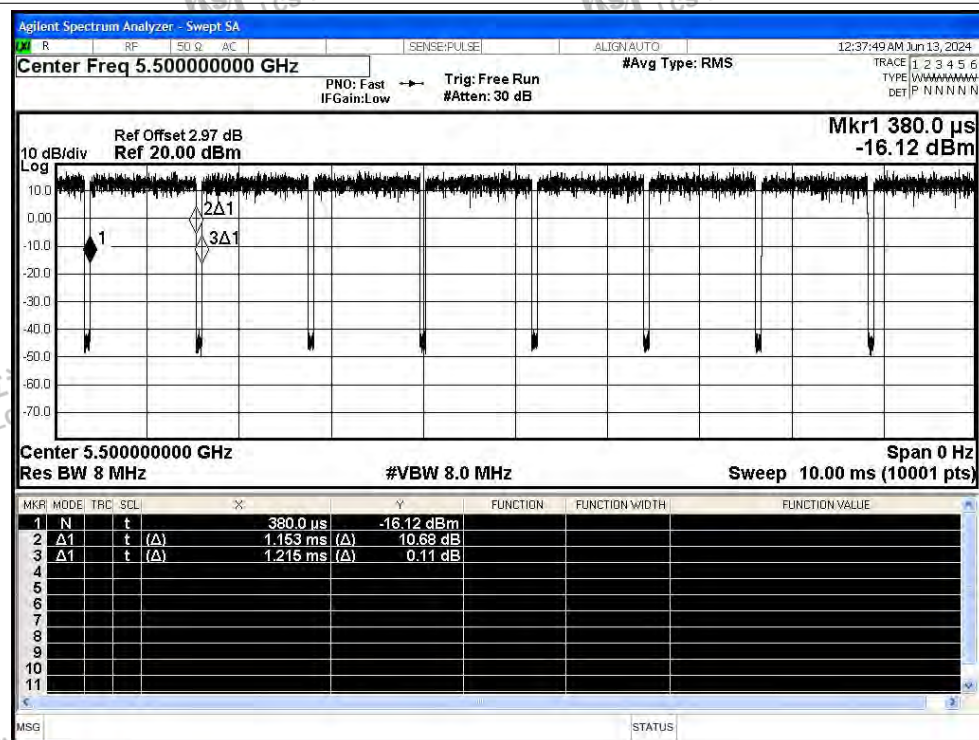

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant1

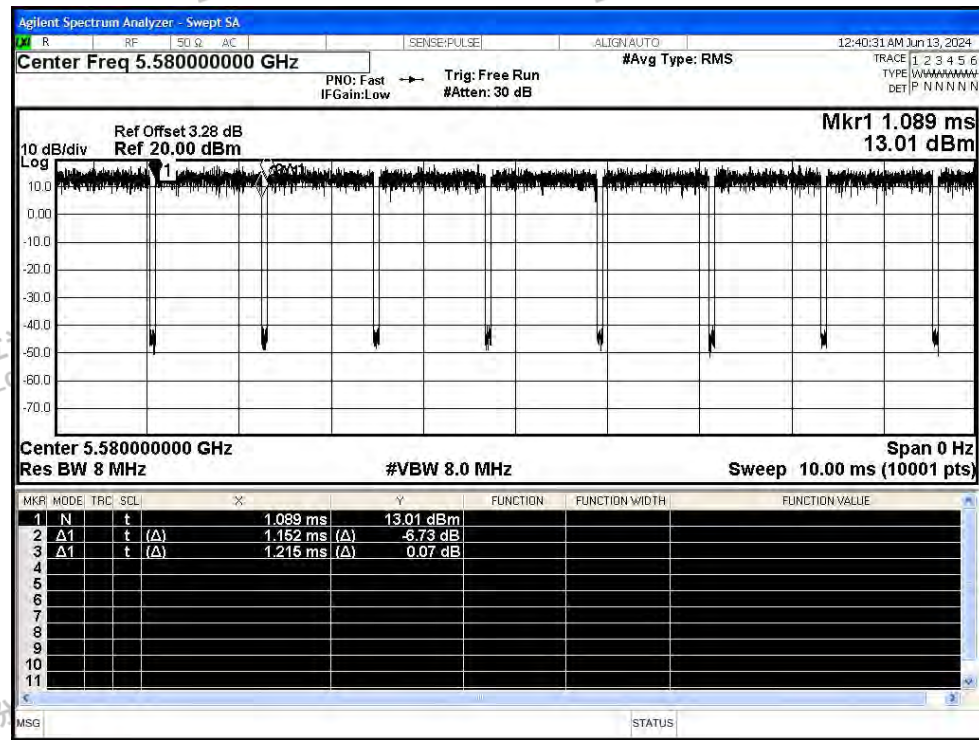

Duty Cycle NVNT n20 5700MHz Ant1

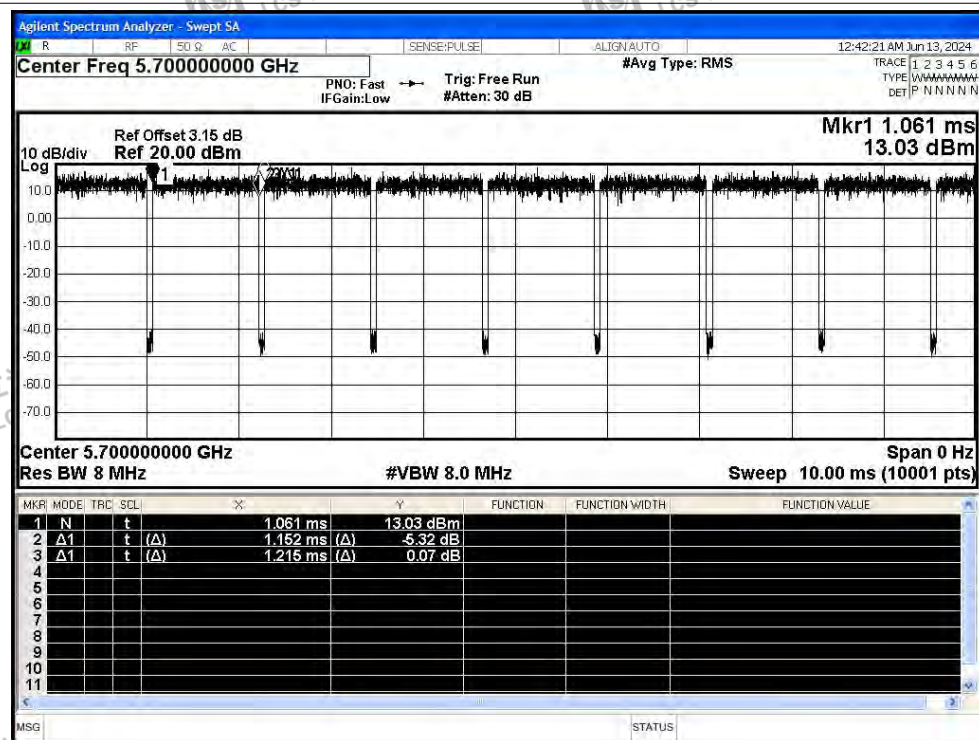

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant1

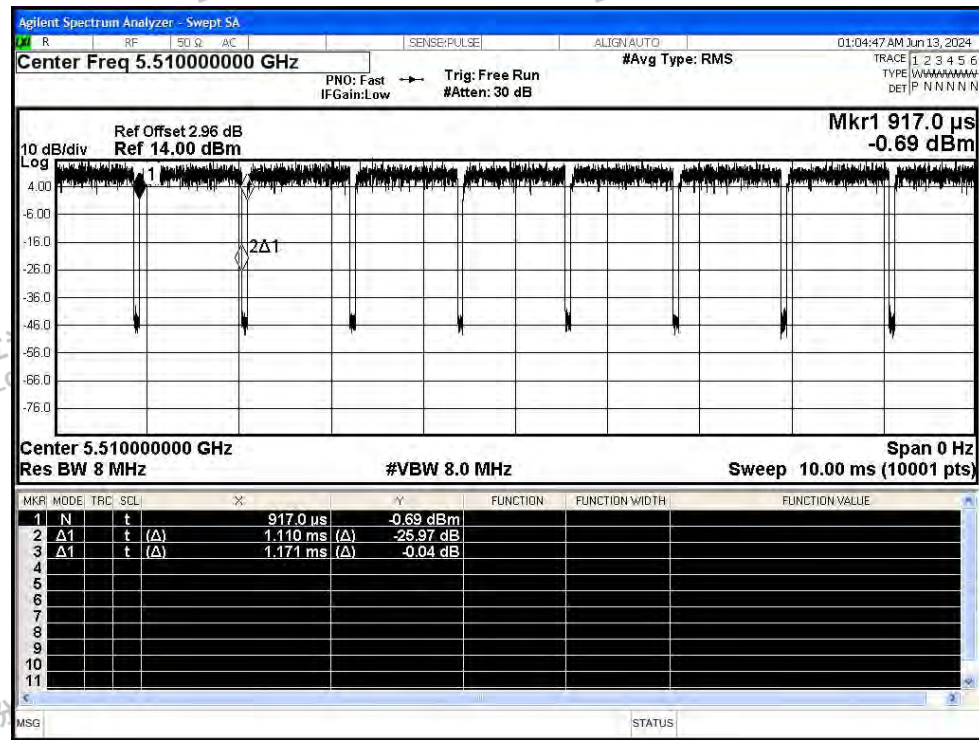

Duty Cycle NVNT n40 5550MHz Ant1

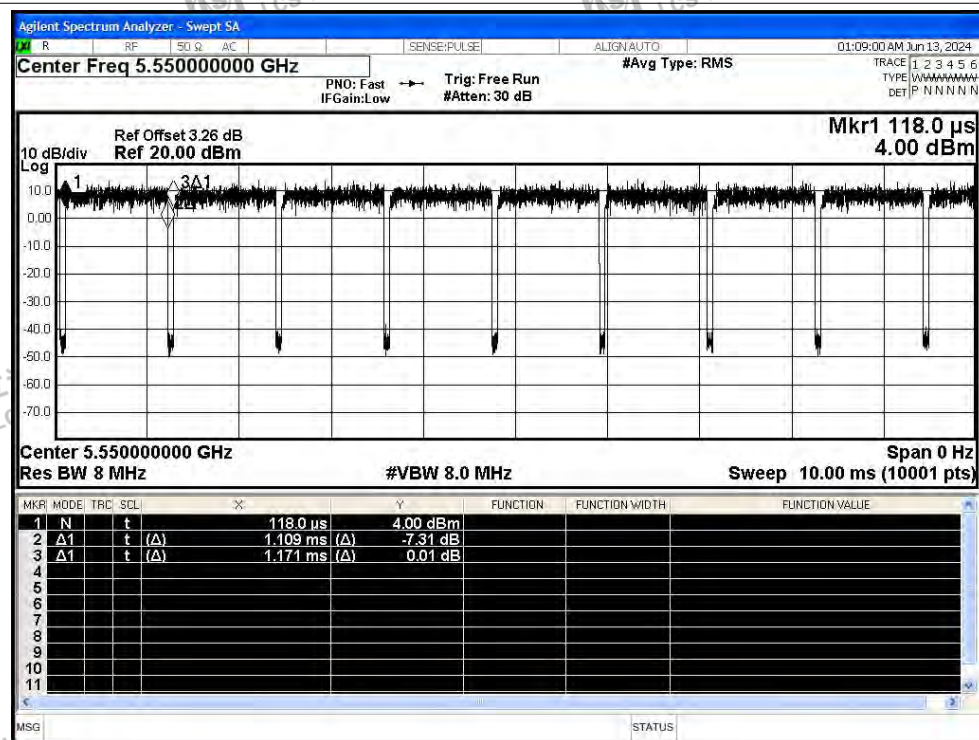

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant1

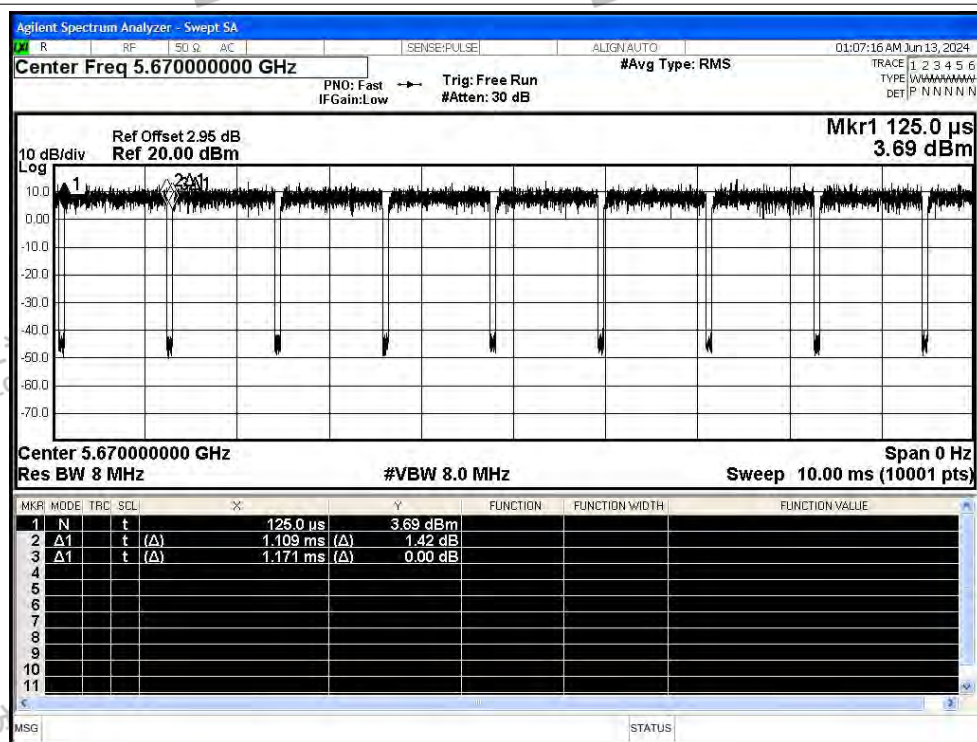

Duty Cycle NVNT ac20 5500MHz Ant1

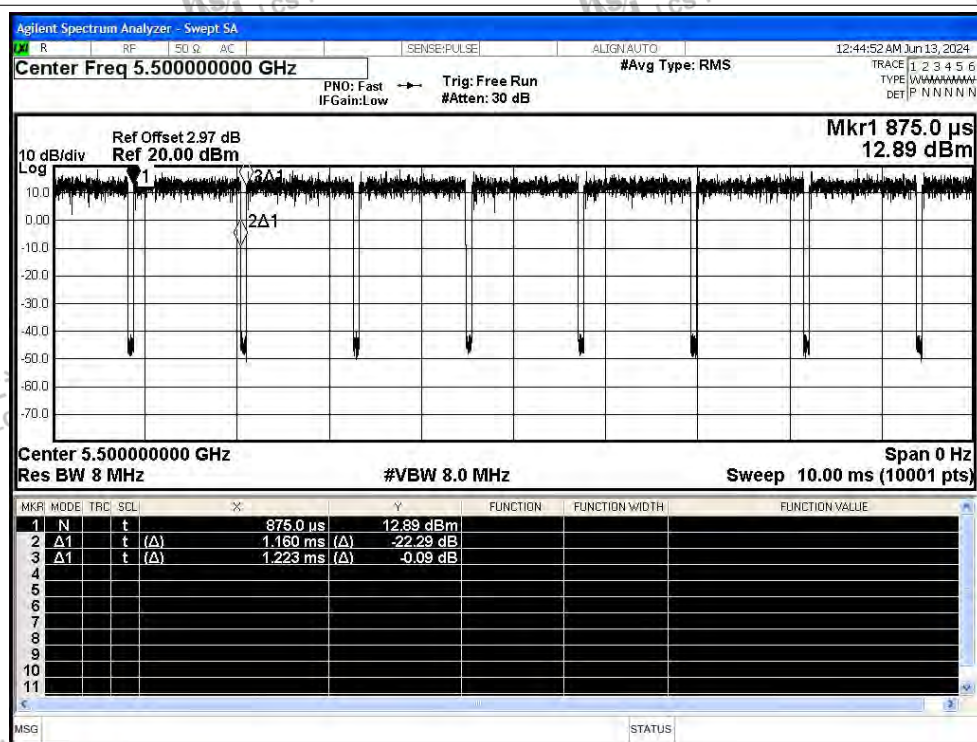

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant1

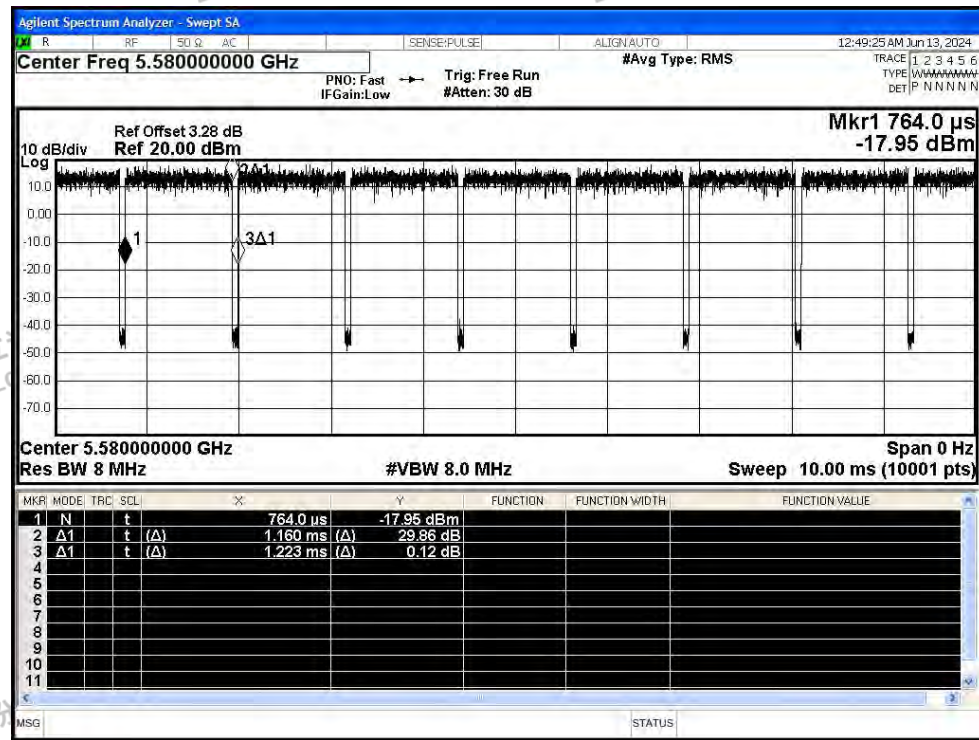

Duty Cycle NVNT ac20 5700MHz Ant1

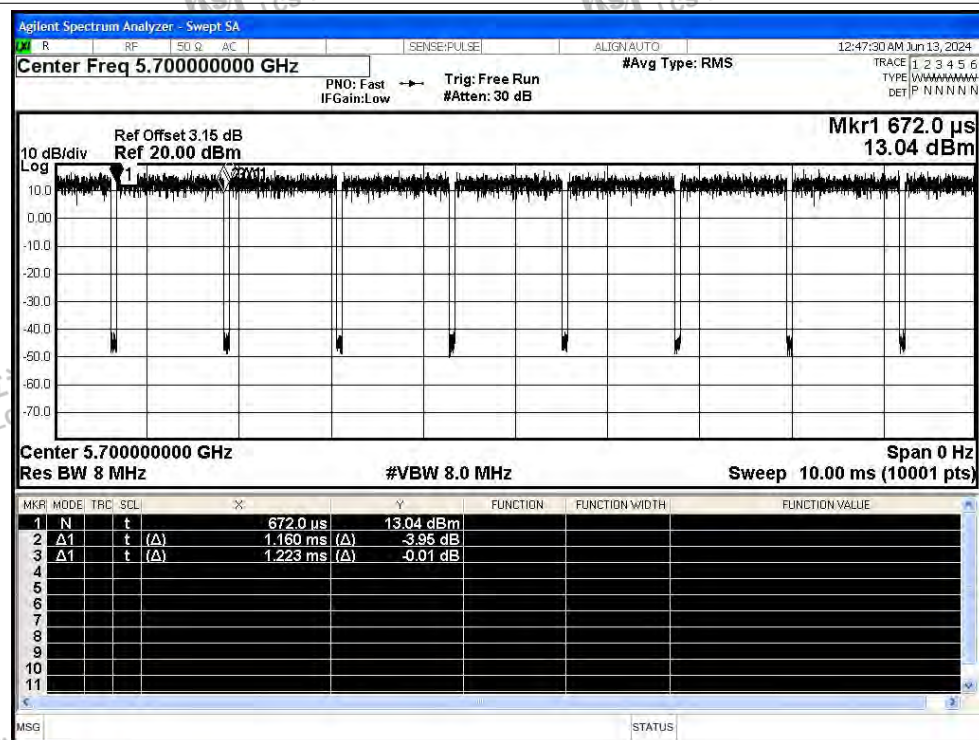

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5510MHz Ant1

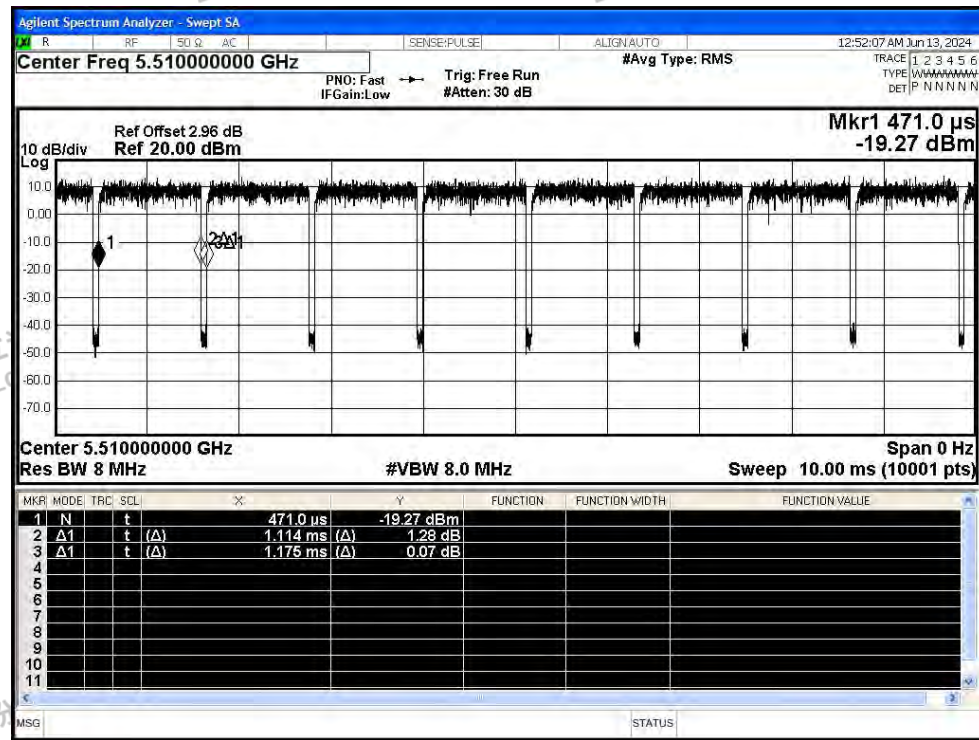

Duty Cycle NVNT ac40 5550MHz Ant1

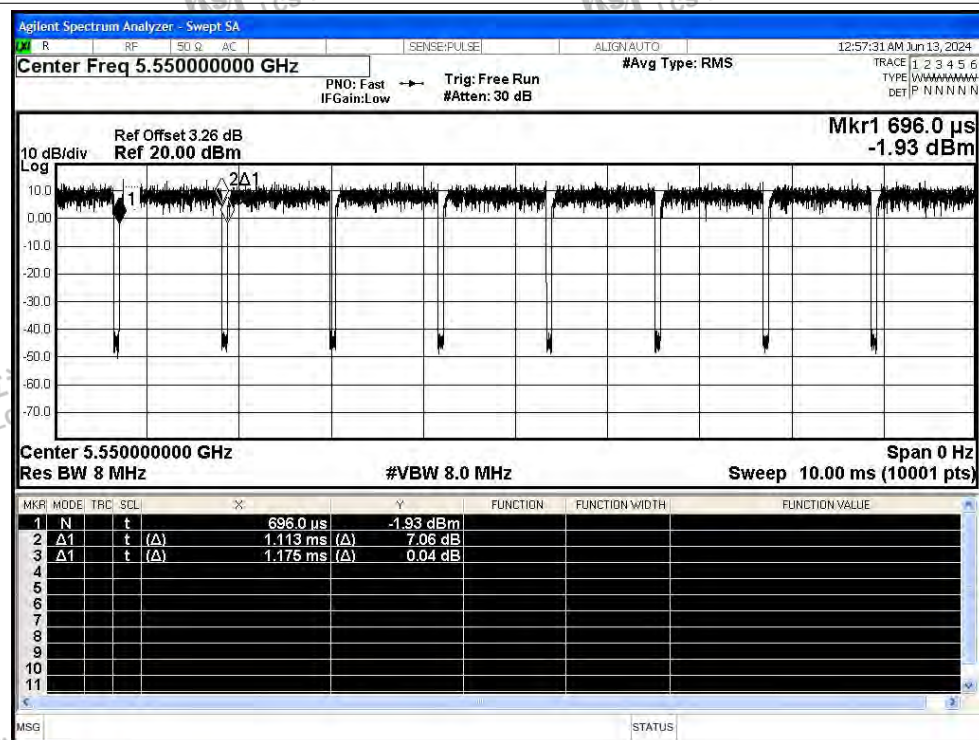

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant1

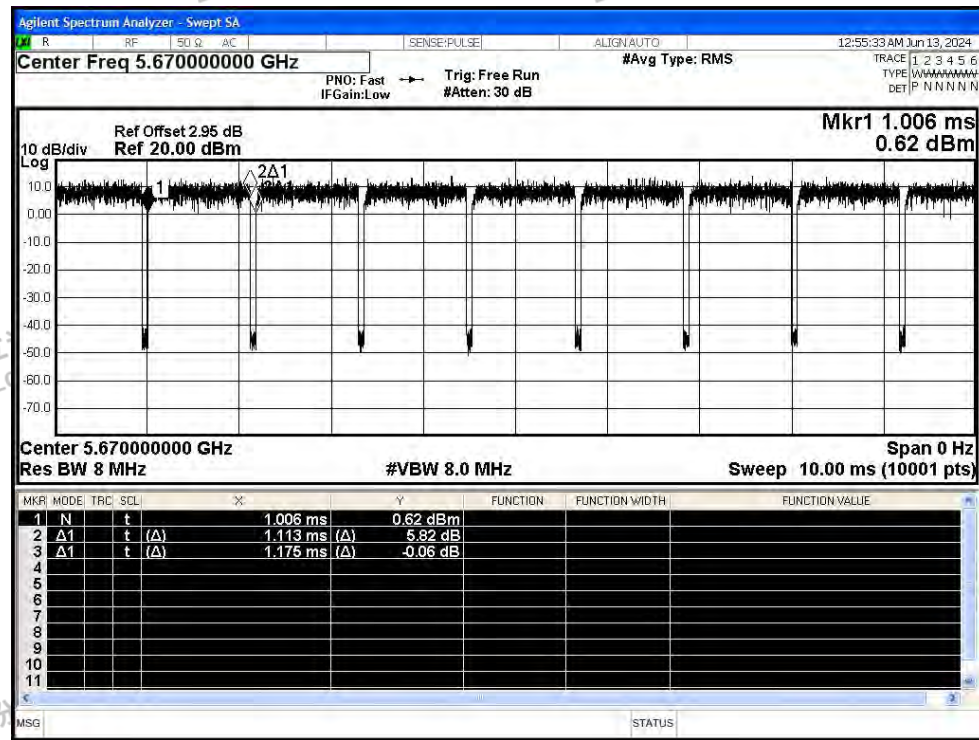

Duty Cycle NVNT ac80 5530MHz Ant1

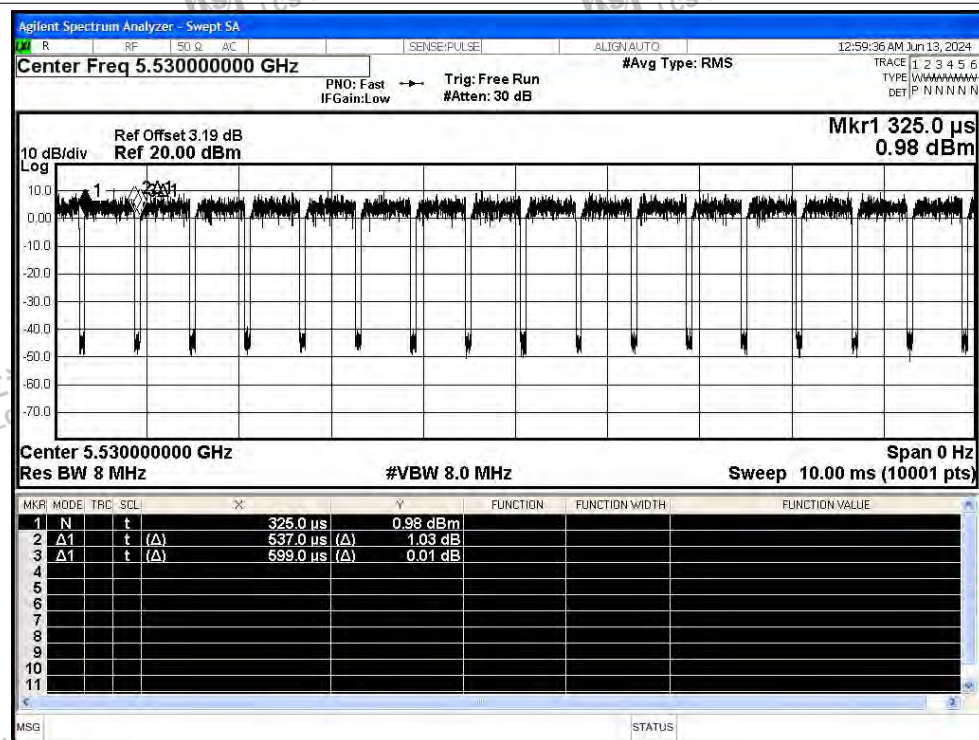

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Duty Cycle NVNT ac80 5610MHz Ant1

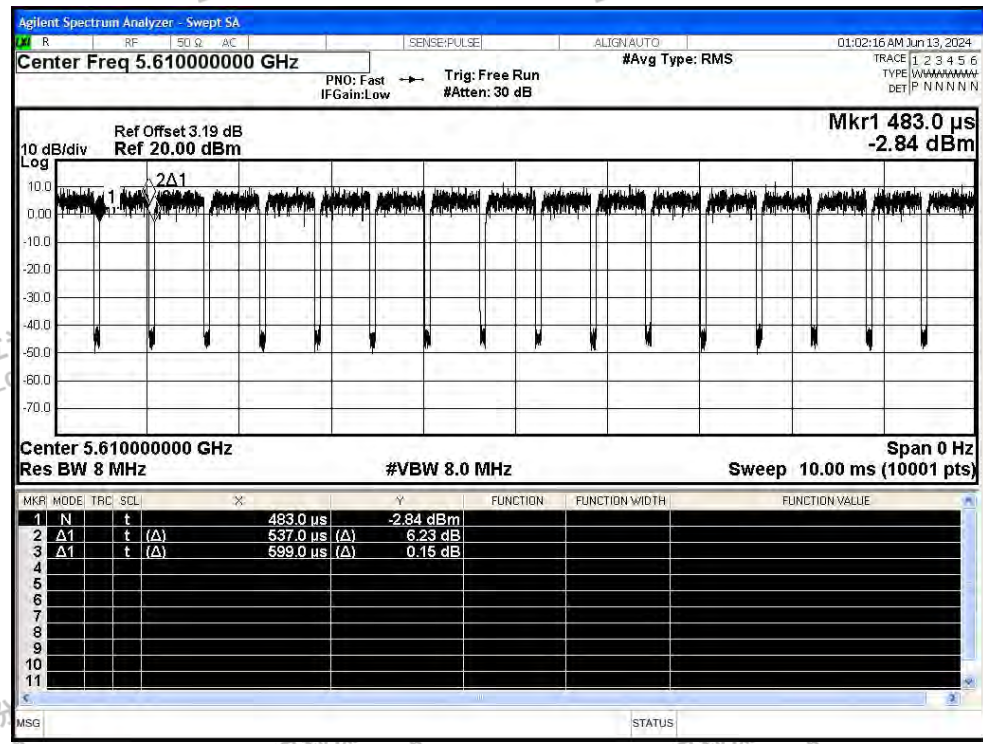

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity